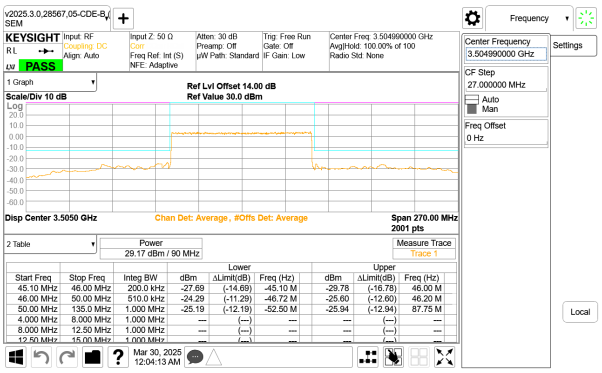

5G NR n77 90MHz BPSK High Channel RB243-0 Port A

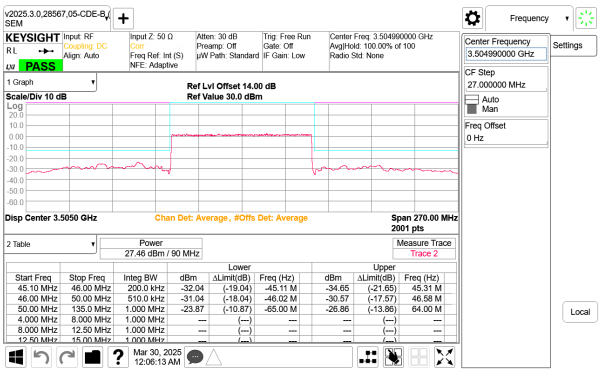

5G NR n77 90MHz BPSK High Channel RB243-0 Port B

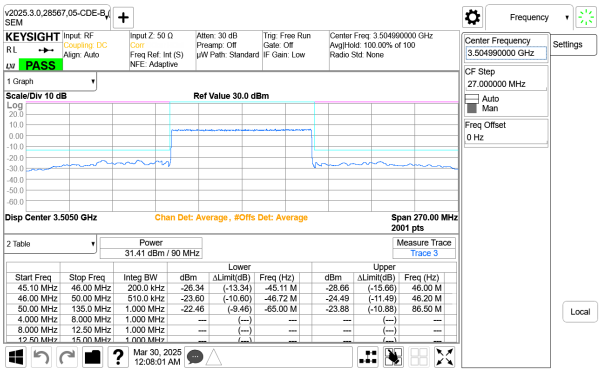

5G NR n77 90MHz BPSK High Channel RB243-0 Port A+B

Intentionally Blank

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

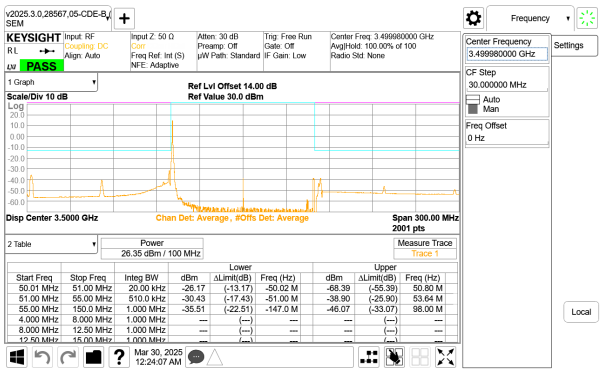

Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
				Lower			Upper	
50.01 MHz	51.00 MHz	20.00 kHz	-26.17	(-13.17)	-50.02 M	-68.39	(-55.39)	50.80 M
51.00 MHz	55.00 MHz	510.0 kHz	-30.43	(-17.43)	-51.00 M	-38.90	(-25.90)	53.64 M
55.00 MHz	150.0 MHz	1.000 MHz	-35.51	(-22.51)	-147.0 M	-46.07	(-33.07)	98.00 M
4.000 MHz	8.000 MHz	1.000 MHz	---	(---)	---	---	(---)	---
8.000 MHz	12.50 MHz	1.000 MHz	---	(---)	---	---	(---)	---
12.50 MHz	15.00 MHz	1.000 MHz	---	(---)	---	---	(---)	---

5G NR n77 100MHz BPSK Mid Channel RB1-0 Port A

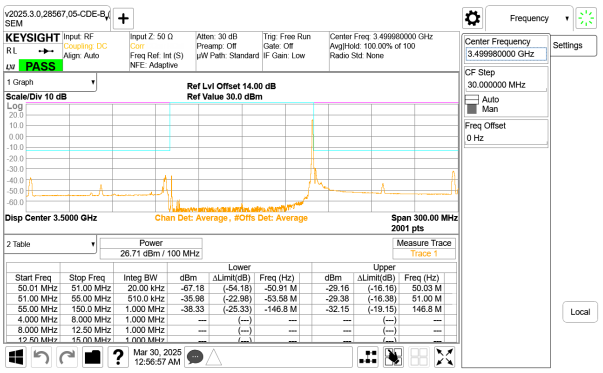

Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
				Lower			Upper	
50.01 MHz	51.00 MHz	20.00 kHz	-67.18	(-54.18)	-50.91 M	-29.16	(-16.16)	50.03 M
51.00 MHz	55.00 MHz	510.0 kHz	-35.98	(-22.98)	-53.58 M	-29.38	(-16.38)	51.00 M
55.00 MHz	150.0 MHz	1.000 MHz	-38.33	(-25.33)	-146.8 M	-32.15	(-19.15)	146.8 M
4.000 MHz	8.000 MHz	1.000 MHz	---	(---)	---	---	(---)	---
8.000 MHz	12.50 MHz	1.000 MHz	---	(---)	---	---	(---)	---
12.50 MHz	15.00 MHz	1.000 MHz	---	(---)	---	---	(---)	---

5G NR n77 100MHz BPSK Mid Channel RB1-272 Port A

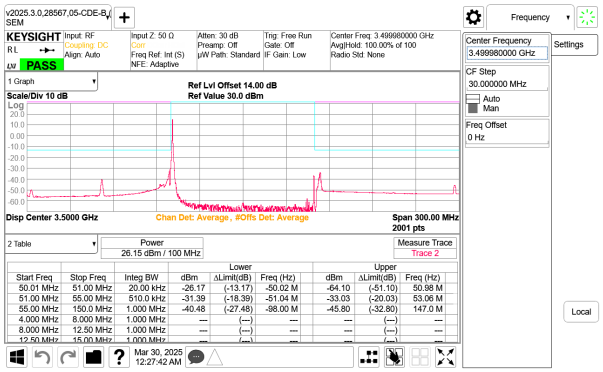

Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
				Lower			Upper	
50.01 MHz	51.00 MHz	20.00 kHz	-26.17	(-13.17)	-50.02 M	-64.10	(-51.10)	50.98 M
51.00 MHz	55.00 MHz	510.0 kHz	-31.39	(-18.39)	-51.04 M	-33.03	(-20.03)	53.06 M
55.00 MHz	150.0 MHz	1.000 MHz	-40.48	(-27.48)	-98.00 M	-45.80	(-32.80)	147.0 M
4.000 MHz	8.000 MHz	1.000 MHz	---	(---)	---	---	(---)	---
8.000 MHz	12.50 MHz	1.000 MHz	---	(---)	---	---	(---)	---
12.50 MHz	15.00 MHz	1.000 MHz	---	(---)	---	---	(---)	---

5G NR n77 100MHz BPSK Mid Channel RB1-0 Port B

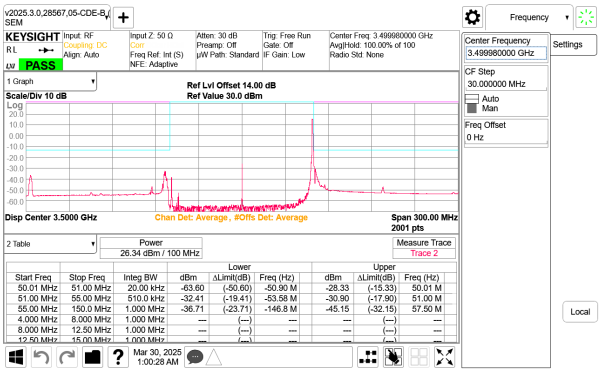

Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
				Lower			Upper	
50.01 MHz	51.00 MHz	20.00 kHz	-63.60	(-50.60)	-50.90 M	-28.33	(-15.33)	50.01 M
51.00 MHz	55.00 MHz	510.0 kHz	-32.41	(-19.41)	-53.58 M	-30.90	(-17.90)	51.00 M
55.00 MHz	150.0 MHz	1.000 MHz	-36.71	(-23.71)	-146.8 M	-45.15	(-32.15)	57.50 M
4.000 MHz	8.000 MHz	1.000 MHz	---	(---)	---	---	(---)	---
8.000 MHz	12.50 MHz	1.000 MHz	---	(---)	---	---	(---)	---
12.50 MHz	15.00 MHz	1.000 MHz	---	(---)	---	---	(---)	---

5G NR n77 100MHz BPSK Mid Channel RB1-272 Port B

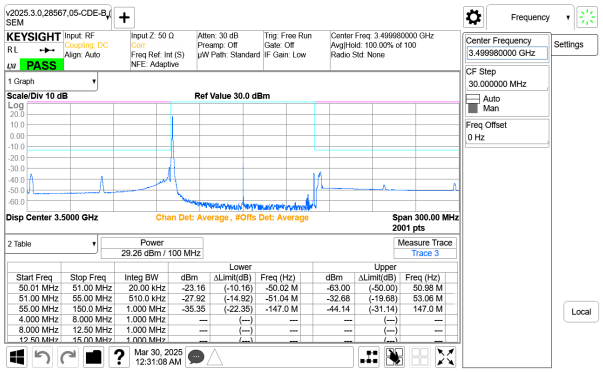

Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
				Lower			Upper	
50.01 MHz	51.00 MHz	20.00 kHz	-23.16	(-10.16)	-50.02 M	-63.00	(-50.00)	50.98 M
51.00 MHz	55.00 MHz	510.0 kHz	-27.92	(-14.92)	-51.04 M	-32.68	(-19.68)	53.06 M
55.00 MHz	150.0 MHz	1.000 MHz	-35.35	(-22.35)	-147.0 M	-44.14	(-31.14)	147.0 M
4.000 MHz	8.000 MHz	1.000 MHz	---	(---)	---	---	(---)	---
8.000 MHz	12.50 MHz	1.000 MHz	---	(---)	---	---	(---)	---
12.50 MHz	15.00 MHz	1.000 MHz	---	(---)	---	---	(---)	---

5G NR n77 100MHz BPSK Mid Channel RB1-0 Port A+B

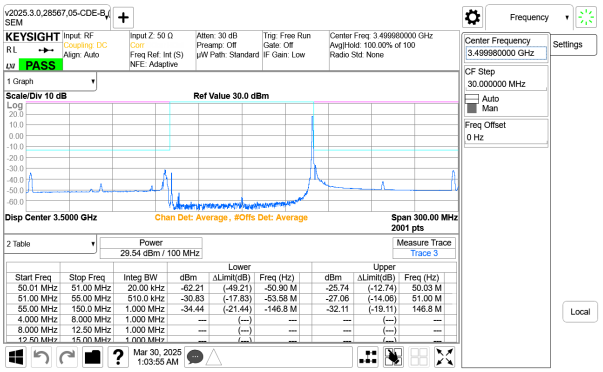

Start Freq	Stop Freq	Integ BW	dBm	ΔLimit(dB)	Freq (Hz)	dBm	ΔLimit(dB)	Freq (Hz)
				Lower			Upper	
50.01 MHz	51.00 MHz	20.00 kHz	-62.21	(-49.21)	-50.90 M	-25.74	(-12.74)	50.03 M
51.00 MHz	55.00 MHz	510.0 kHz	-30.83	(-17.83)	-53.58 M	-27.06	(-14.06)	51.00 M
55.00 MHz	150.0 MHz	1.000 MHz	-34.44	(-21.44)	-146.8 M	-32.11	(-19.11)	146.8 M
4.000 MHz	8.000 MHz	1.000 MHz	---	(---)	---	---	(---)	---
8.000 MHz	12.50 MHz	1.000 MHz	---	(---)	---	---	(---)	---
12.50 MHz	15.00 MHz	1.000 MHz	---	(---)	---	---	(---)	---

5G NR n77 100MHz BPSK Mid Channel RB1-272 Port A+B

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

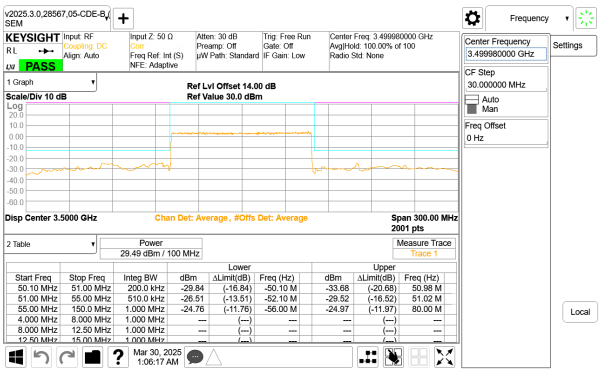

5G NR n77 100MHz BPSK Mid Channel RB270-0 Port A

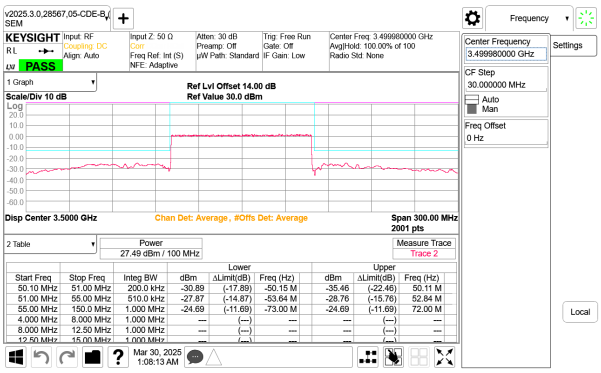

5G NR n77 100MHz BPSK Mid Channel RB270-0 Port B

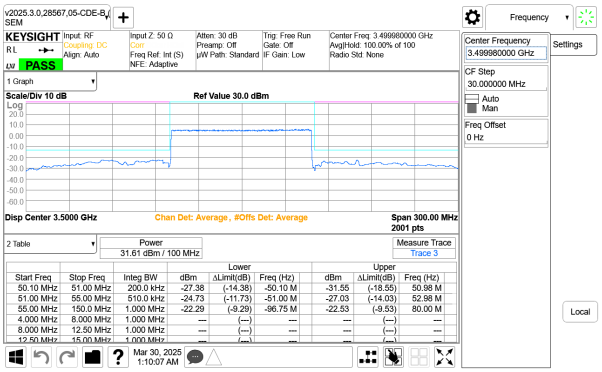

5G NR n77 100MHz BPSK Mid Channel RB270-0 Port A+B

Intentionally Blank

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

9.2.3. 5G NR n77 (FCC Part 27 3700-3980MHz, SISO)

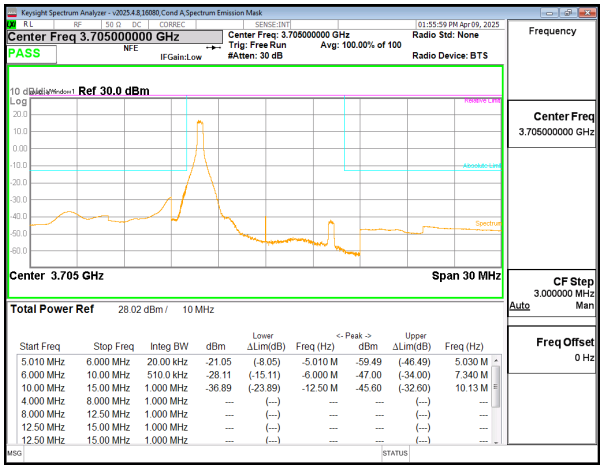

5G NR n77 10MHz BPSK Low Channel RB1-0

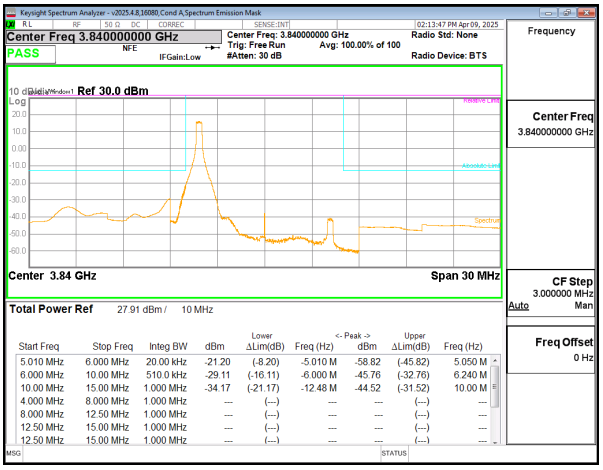

5G NR n77 10MHz BPSK Middle Channel RB1-0

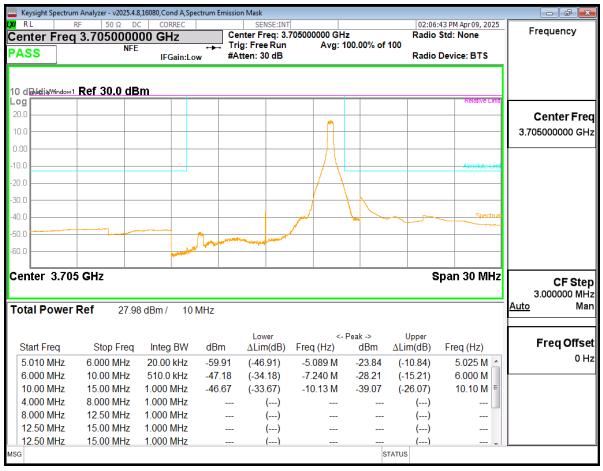

5G NR n77 10MHz BPSK Low Channel RB1-23

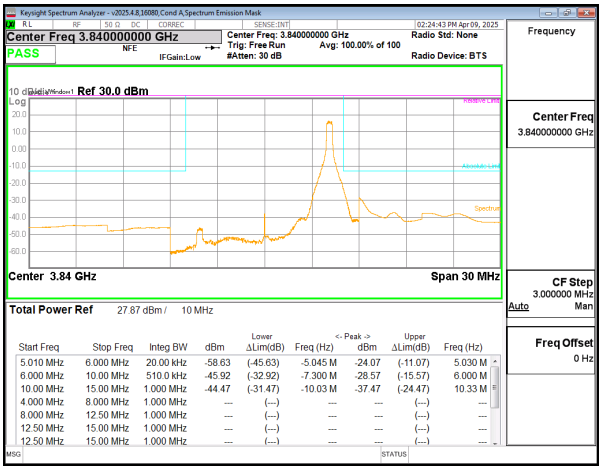

5G NR n77 10MHz BPSK Middle Channel RB1-23

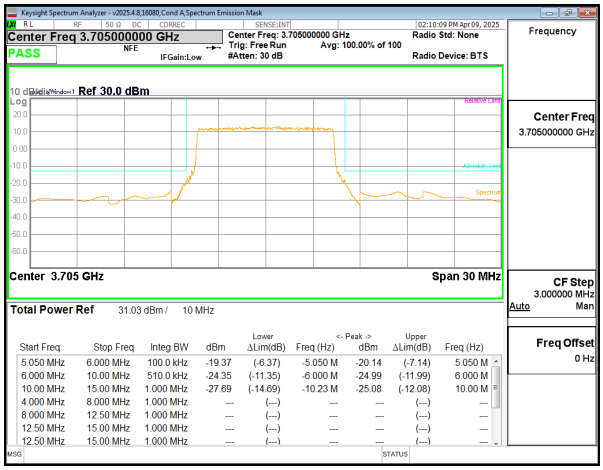

5G NR n77 10MHz BPSK Low Channel RB24-0

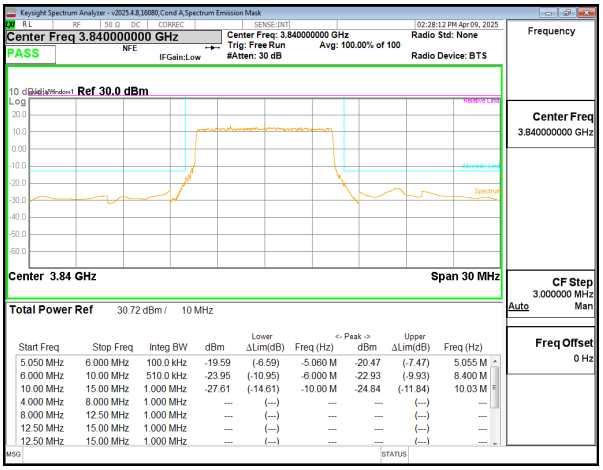

5G NR n77 10MHz BPSK Middle Channel RB24-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

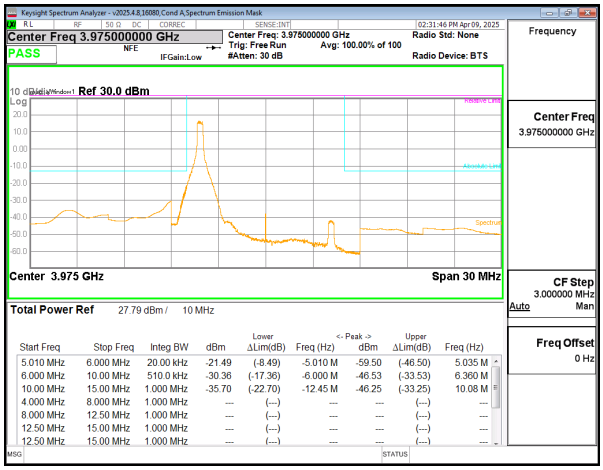

5G NR n77 10MHz BPSK High Channel RB1-0

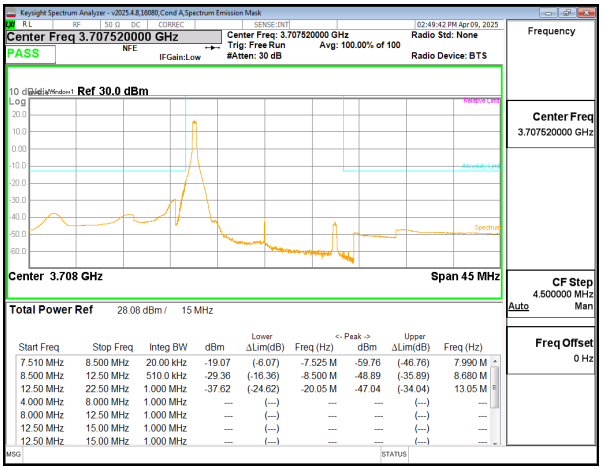

5G NR n77 15MHz BPSK Low Channel RB1-0

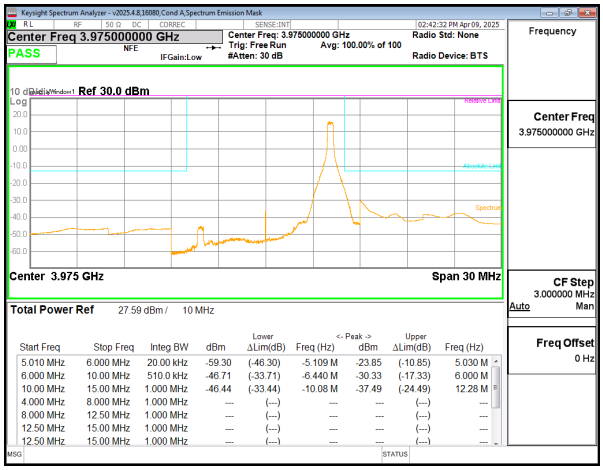

5G NR n77 10MHz BPSK High Channel RB1-23

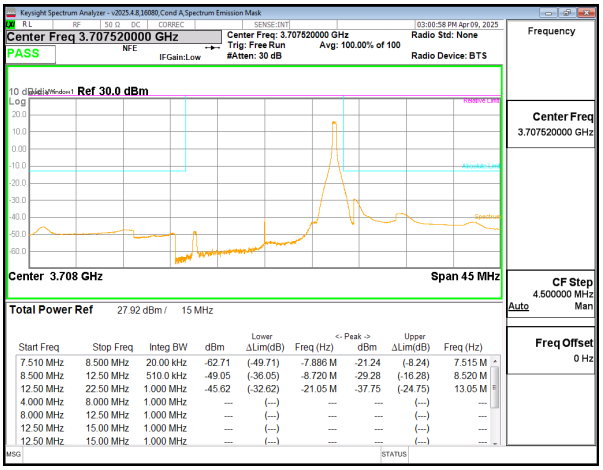

5G NR n77 15MHz BPSK Low Channel RB1-37

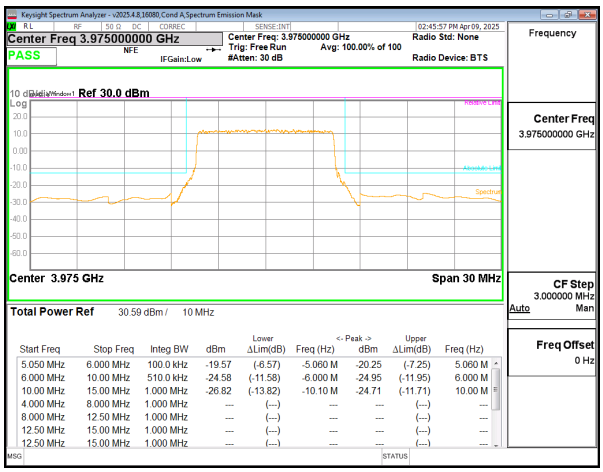

5G NR n77 10MHz BPSK High Channel RB24-0

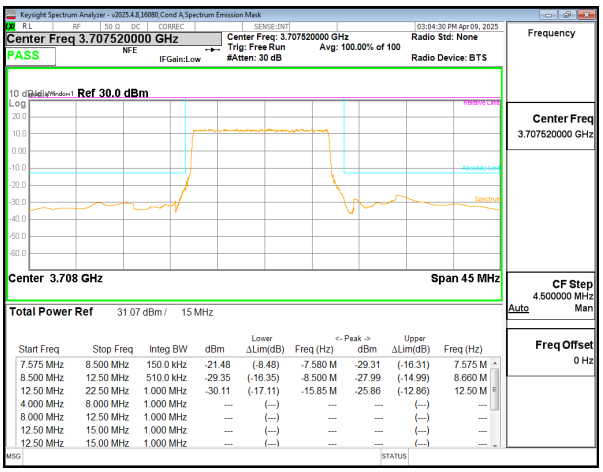

5G NR n77 15MHz BPSK Low Channel RB36-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

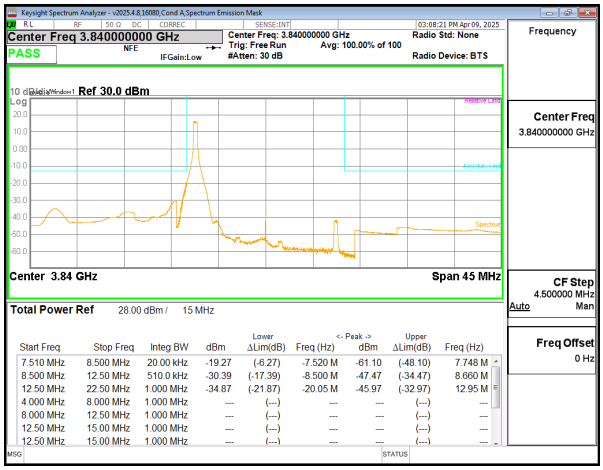

5G NR n77 15MHz BPSK Middle Channel RB1-0

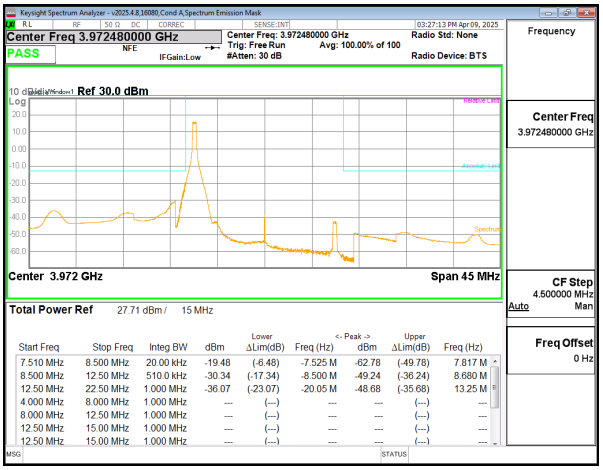

5G NR n77 15MHz BPSK High Channel RB1-0

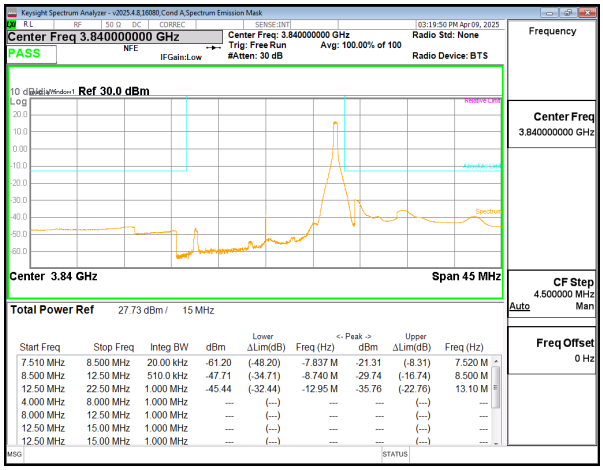

5G NR n77 15MHz BPSK Middle Channel RB1-37

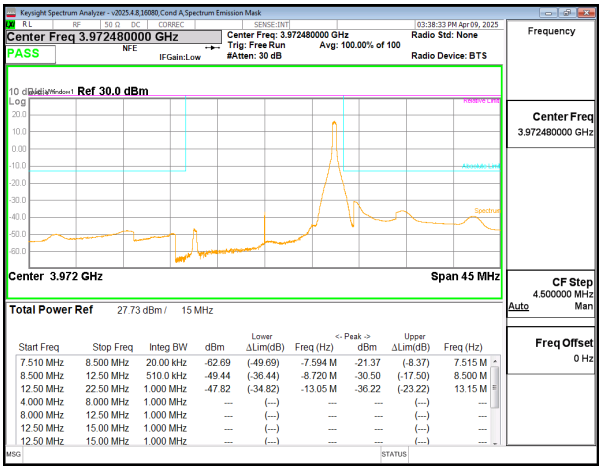

5G NR n77 15MHz BPSK High Channel RB1-37

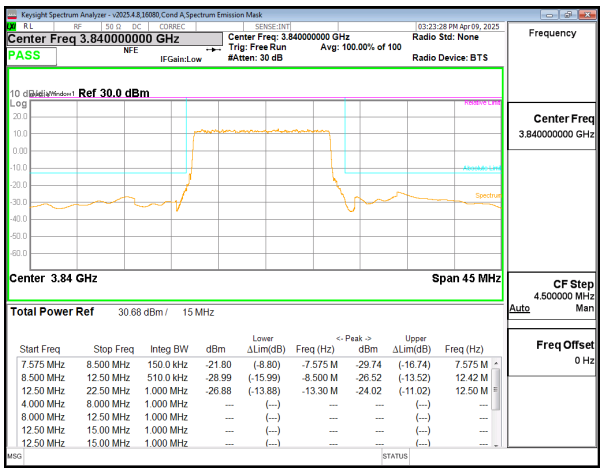

5G NR n77 15MHz BPSK Middle Channel RB36-0

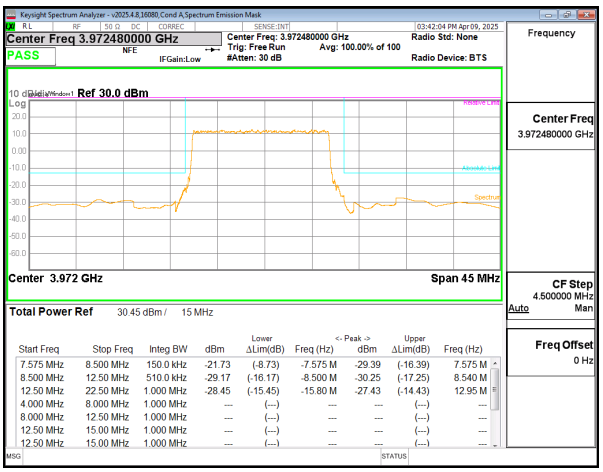

5G NR n77 15MHz BPSK High Channel RB36-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

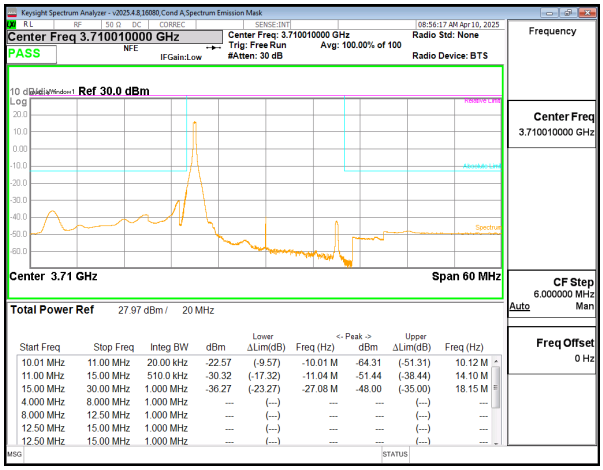

5G NR n77 20MHz BPSK Low Channel RB1-0

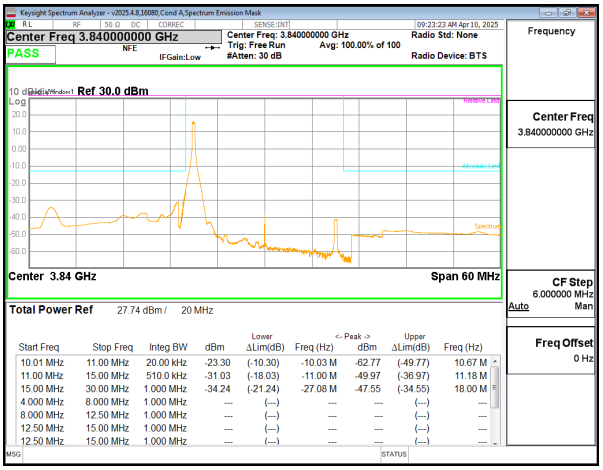

5G NR n77 20MHz BPSK Middle Channel RB1-0

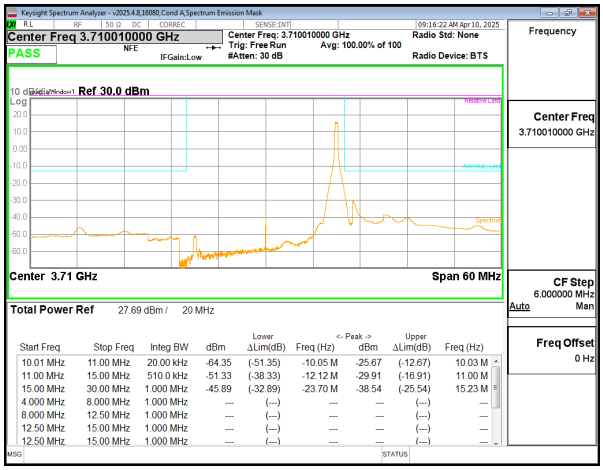

5G NR n77 20MHz BPSK Low Channel RB1-50

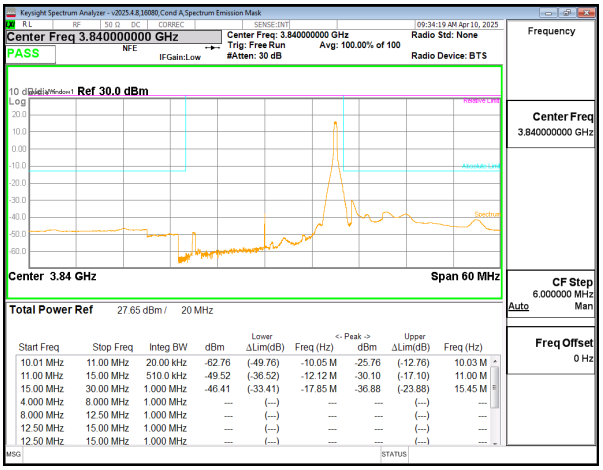

5G NR n77 20MHz BPSK Middle Channel RB1-50

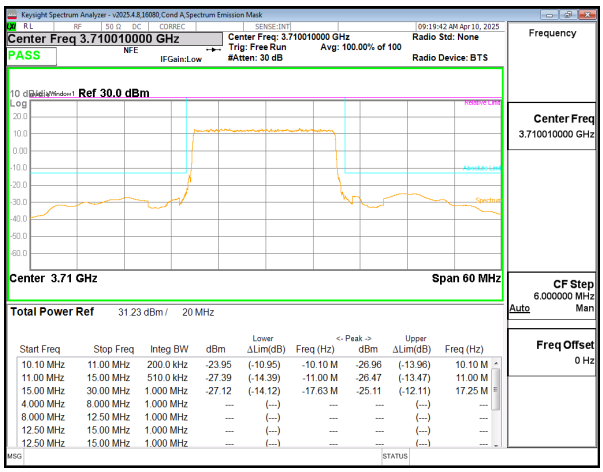

5G NR n77 20MHz BPSK Low Channel RB50-0

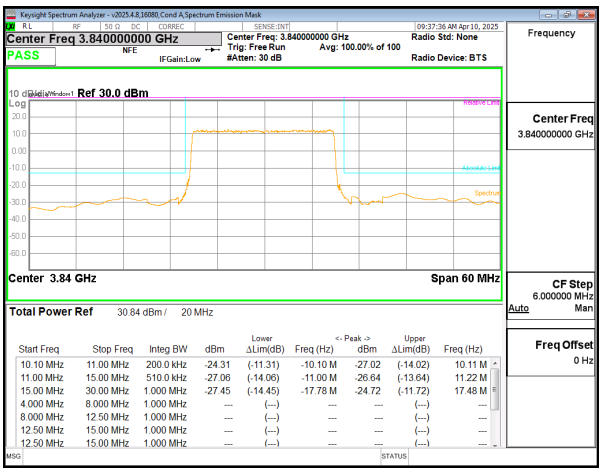

5G NR n77 20MHz BPSK Middle Channel RB50-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

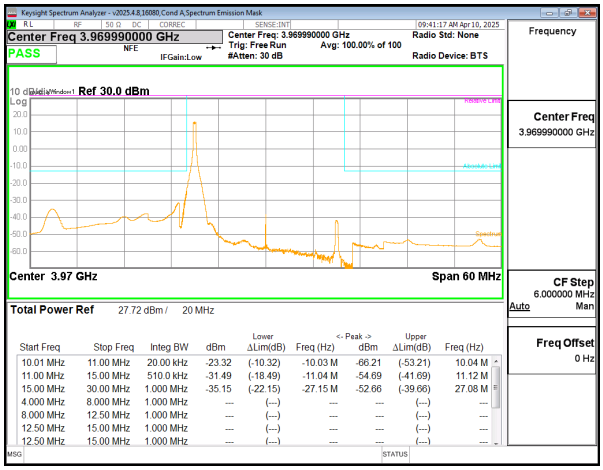

5G NR n77 20MHz BPSK High Channel RB1-0

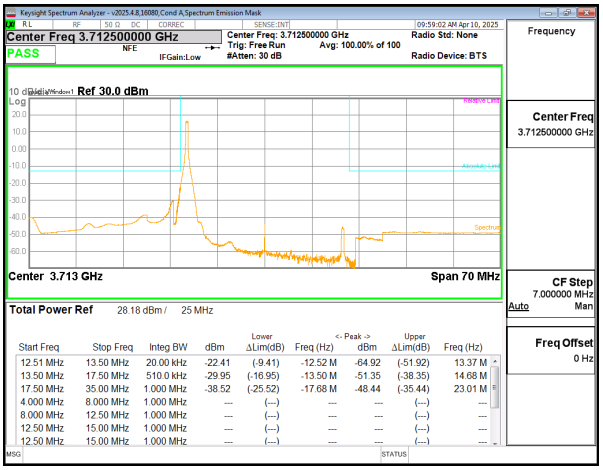

5G NR n77 25MHz BPSK Low Channel RB1-0

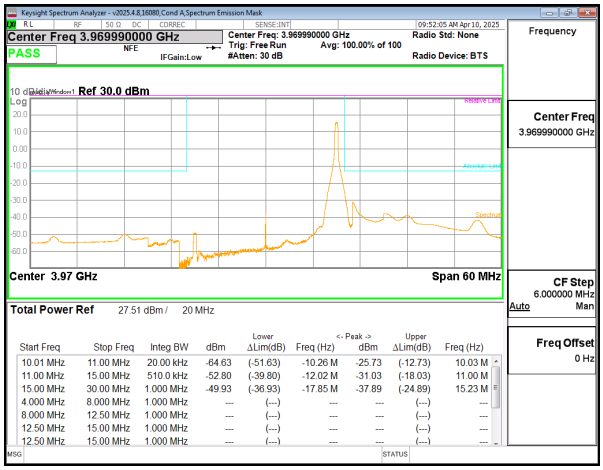

5G NR n77 20MHz BPSK High Channel RB1-50

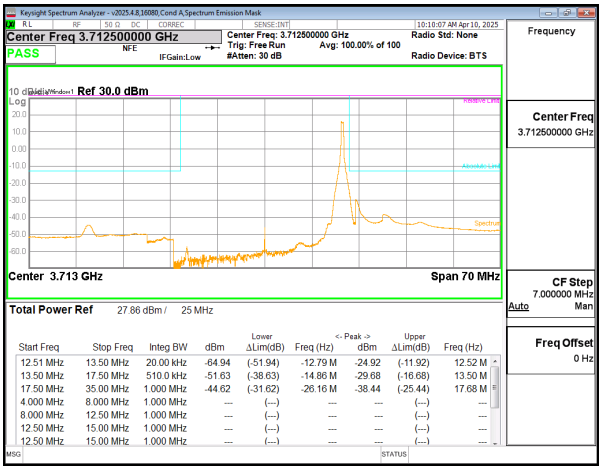

5G NR n77 25MHz BPSK Low Channel RB1-64

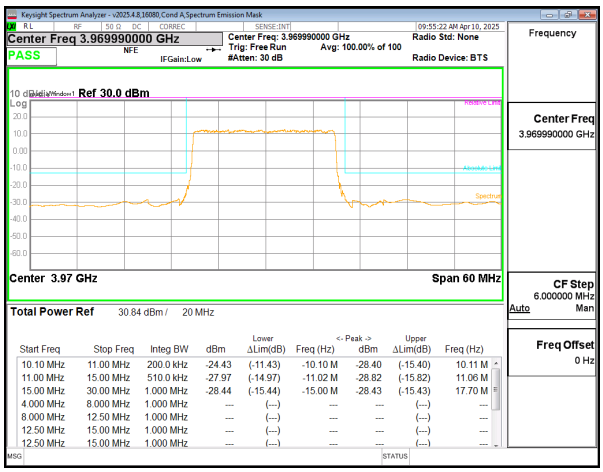

5G NR n77 20MHz BPSK High Channel RB50-0

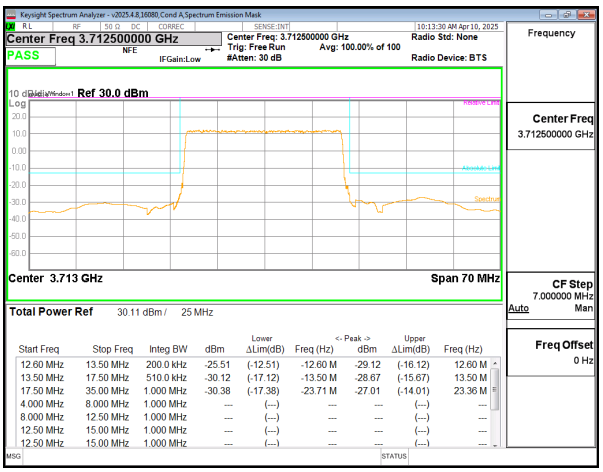

5G NR n77 25MHz BPSK Low Channel RB64-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

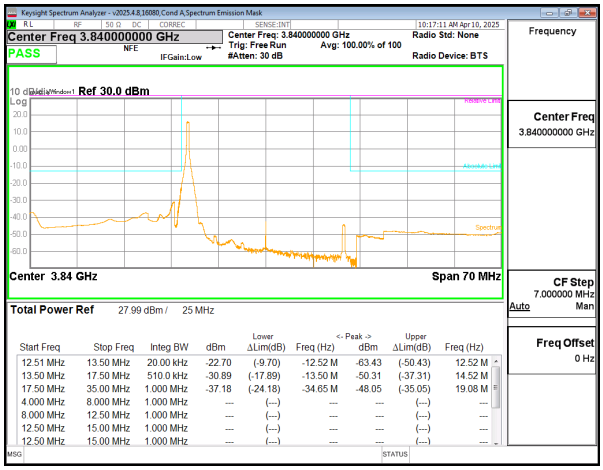

5G NR n77 25MHz BPSK Middle Channel RB1-0

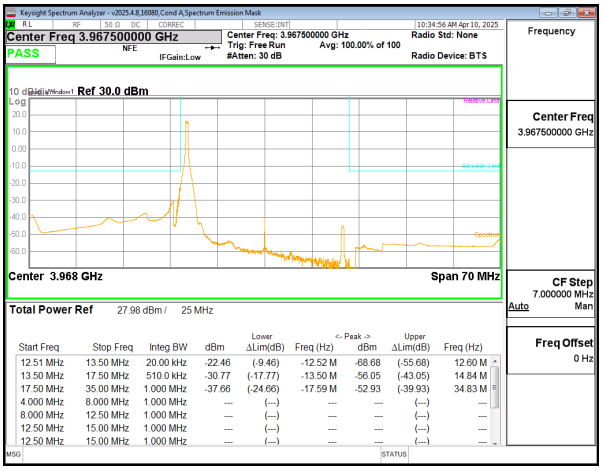

5G NR n77 25MHz BPSK High Channel RB1-0

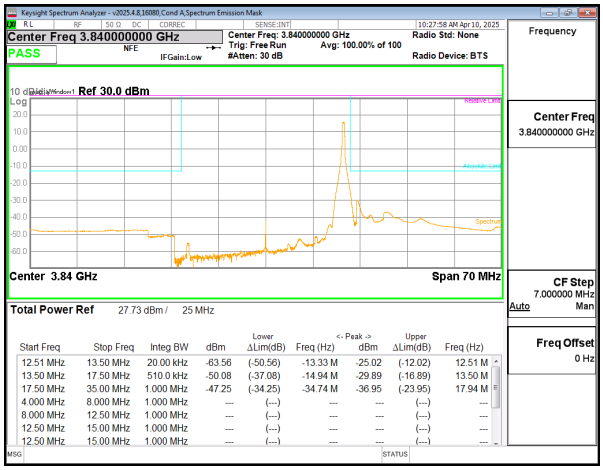

5G NR n77 25MHz BPSK Middle Channel RB1-64

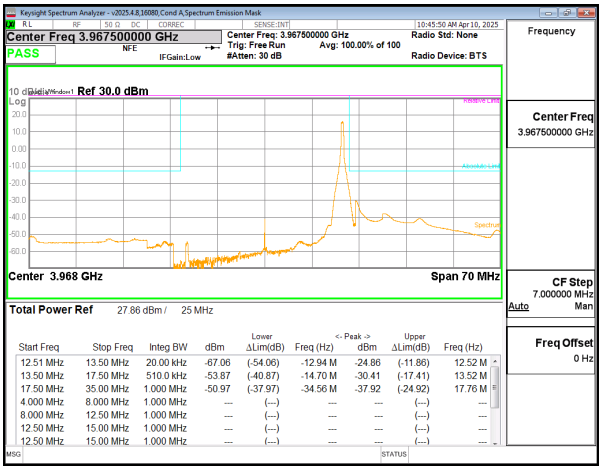

5G NR n77 25MHz BPSK High Channel RB1-64

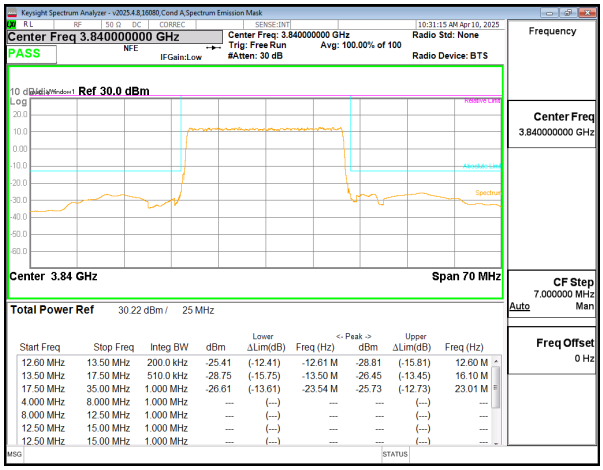

5G NR n77 25MHz BPSK Middle Channel RB64-0

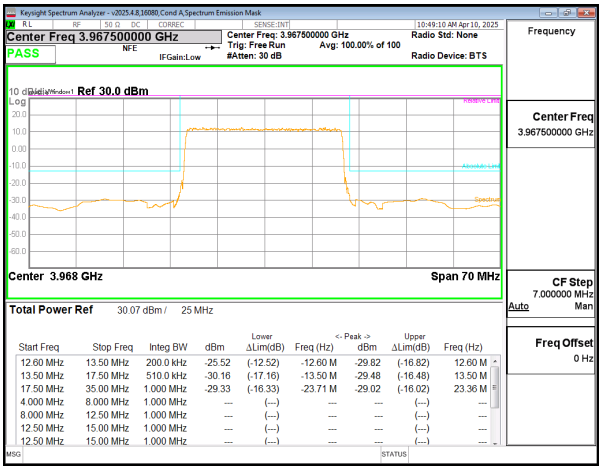

5G NR n77 25MHz BPSK High Channel RB64-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

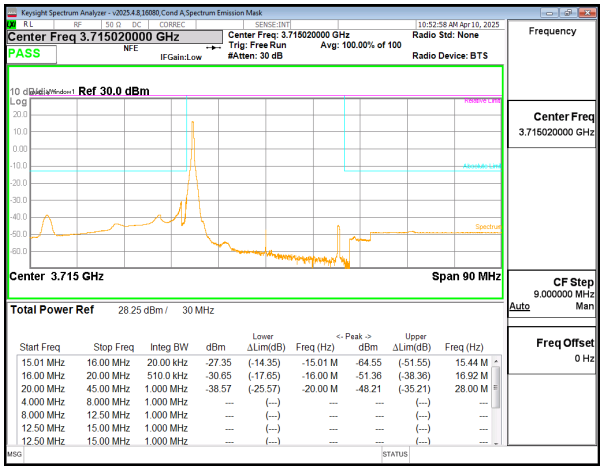

5G NR n77 30MHz BPSK Low Channel RB1-0

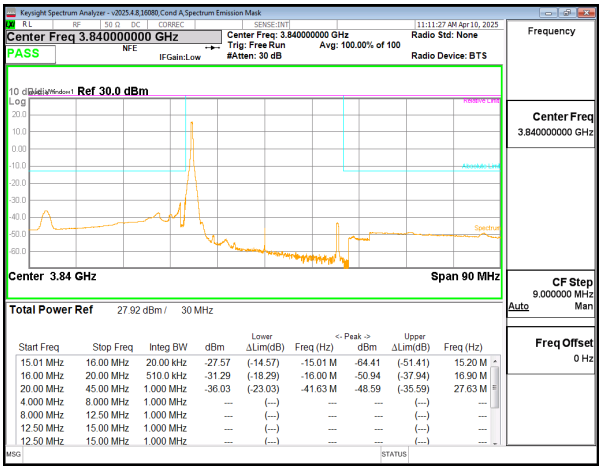

5G NR n77 30MHz BPSK Middle Channel RB1-0

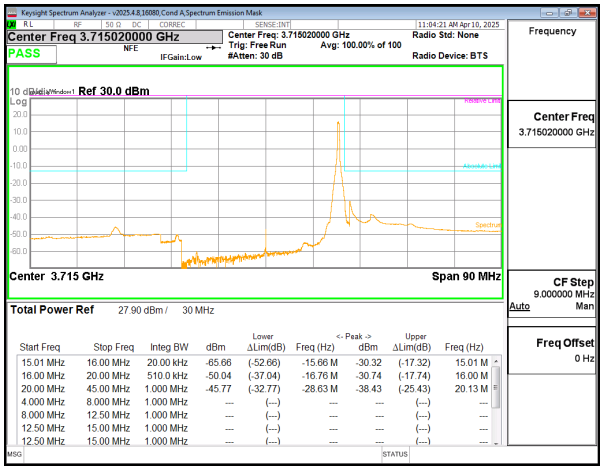

5G NR n77 30MHz BPSK Low Channel RB1-77

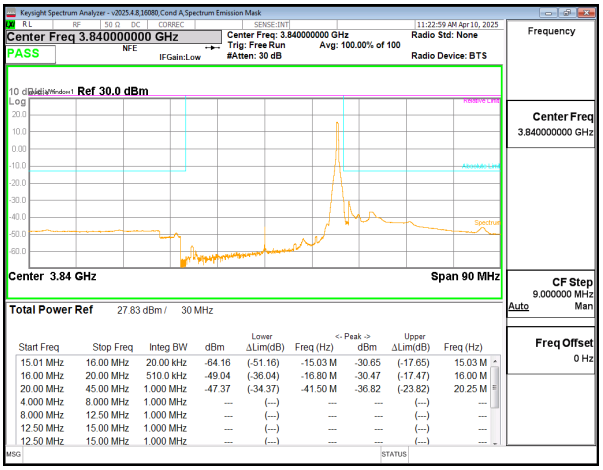

5G NR n77 30MHz BPSK Middle Channel RB1-77

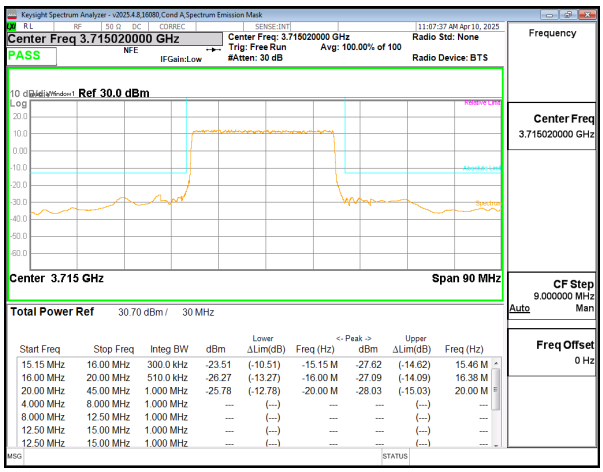

5G NR n77 30MHz BPSK Low Channel RB75-0

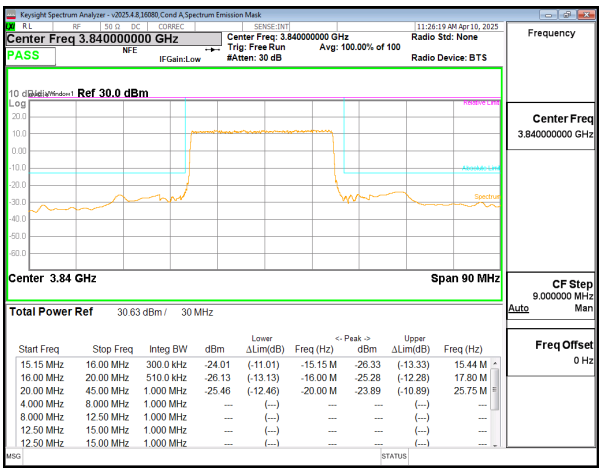

5G NR n77 30MHz BPSK Middle Channel RB75-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

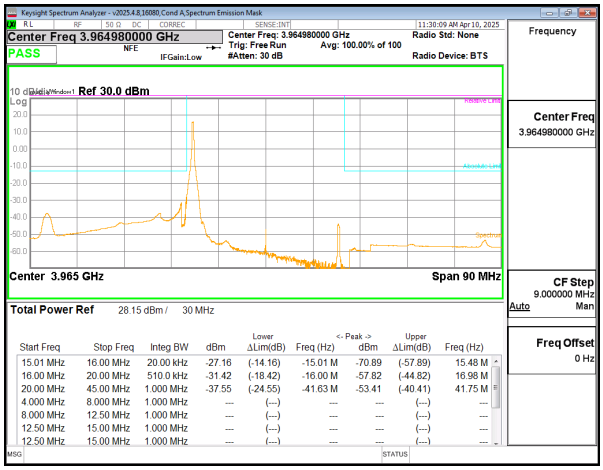

5G NR n77 30MHz BPSK High Channel RB1-0

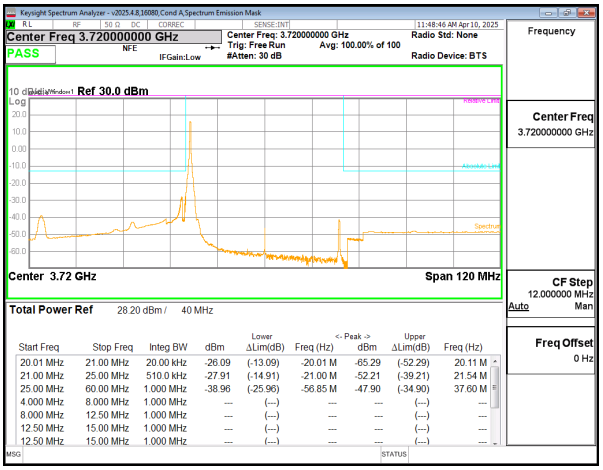

5G NR n77 40MHz BPSK Low Channel RB1-0

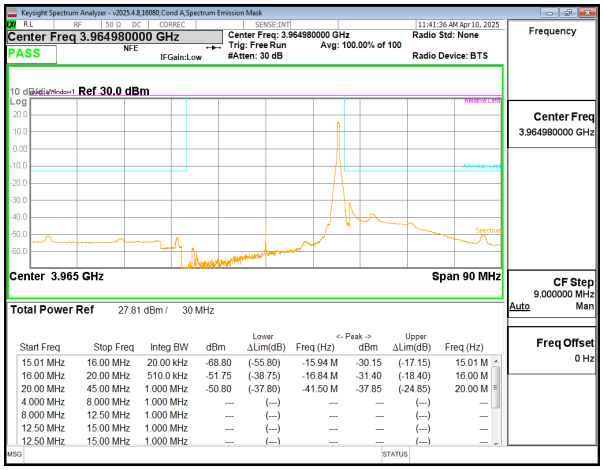

5G NR n77 30MHz BPSK High Channel RB1-77

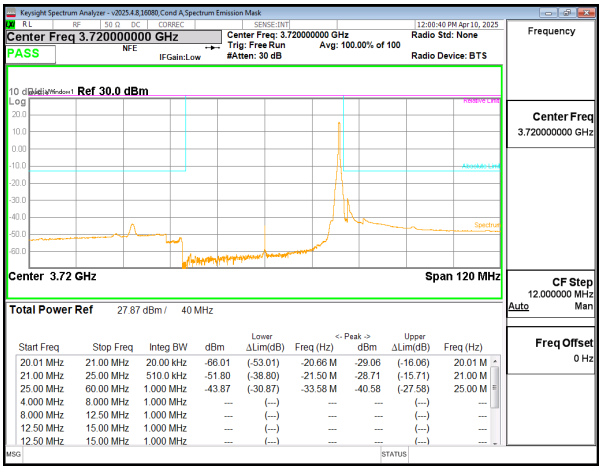

5G NR n77 40MHz BPSK Low Channel RB1-105

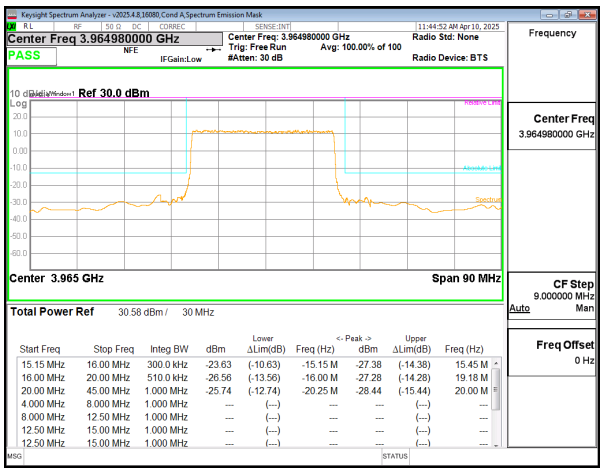

5G NR n77 30MHz BPSK High Channel RB75-0

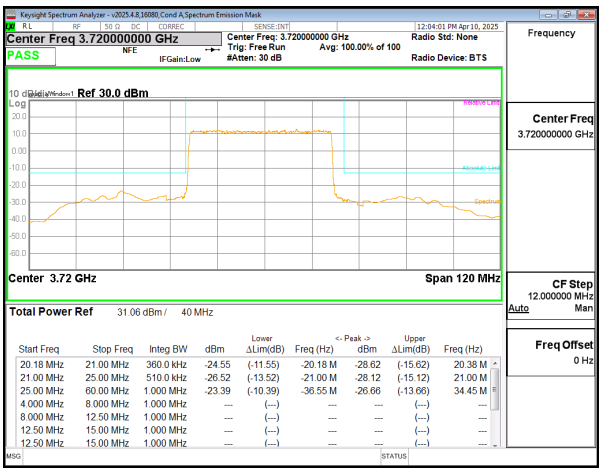

5G NR n77 40MHz BPSK Low Channel RB100-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

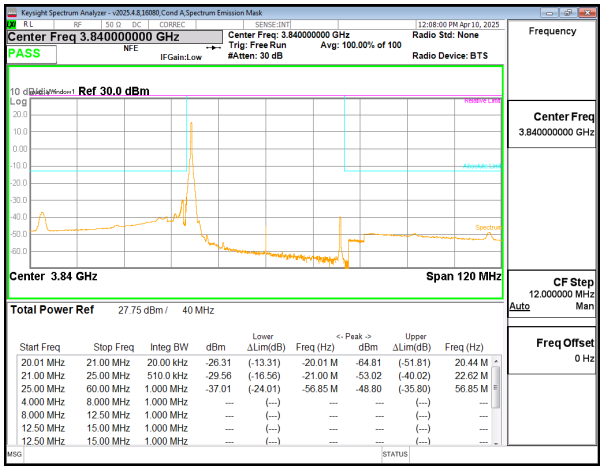

5G NR n77 40MHz BPSK Middle Channel RB1-0

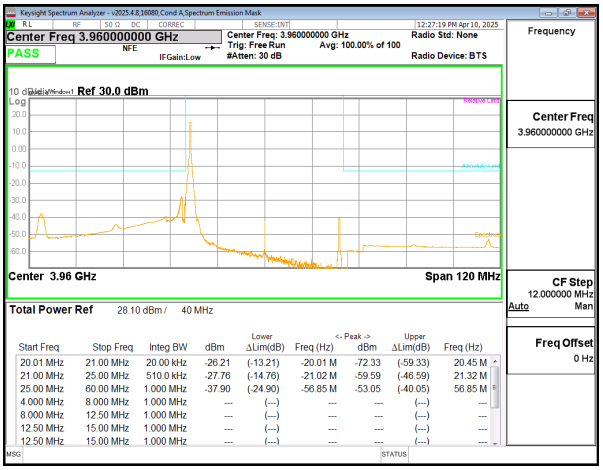

5G NR n77 40MHz BPSK High Channel RB1-0

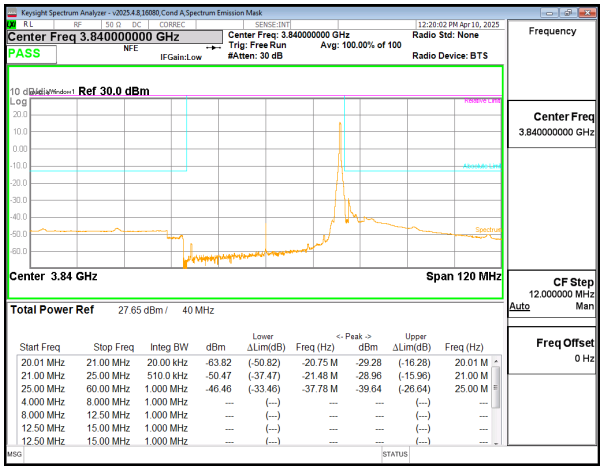

5G NR n77 40MHz BPSK Middle Channel RB1-105

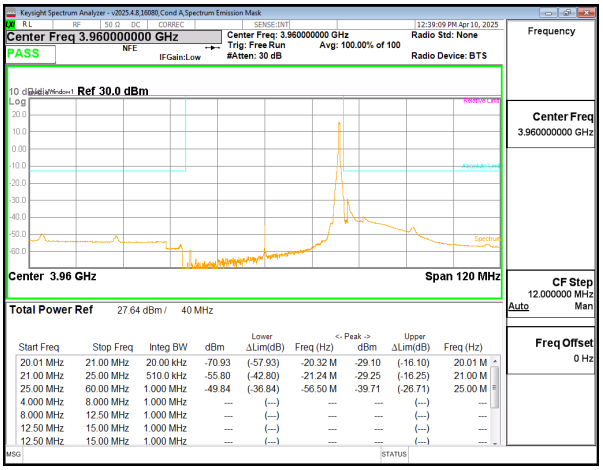

5G NR n77 40MHz BPSK High Channel RB1-105

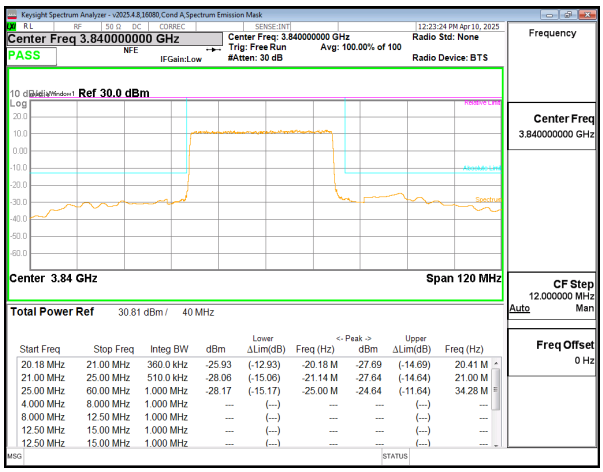

5G NR n77 40MHz BPSK Middle Channel RB100-0

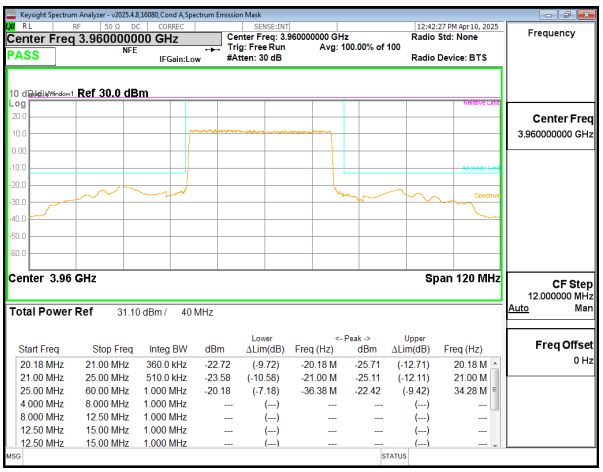

5G NR n77 40MHz BPSK High Channel RB100-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

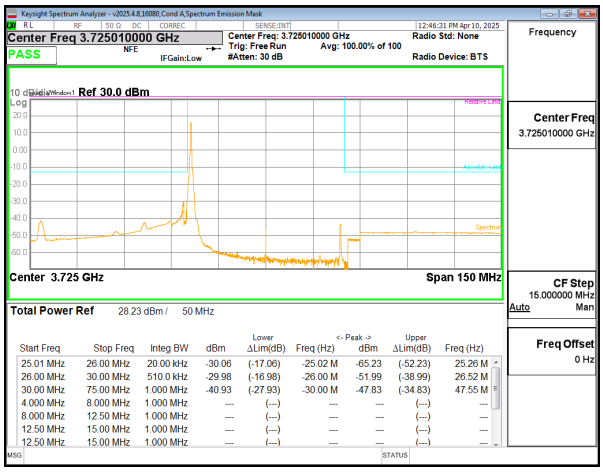

5G NR n77 50MHz BPSK Low Channel RB1-0

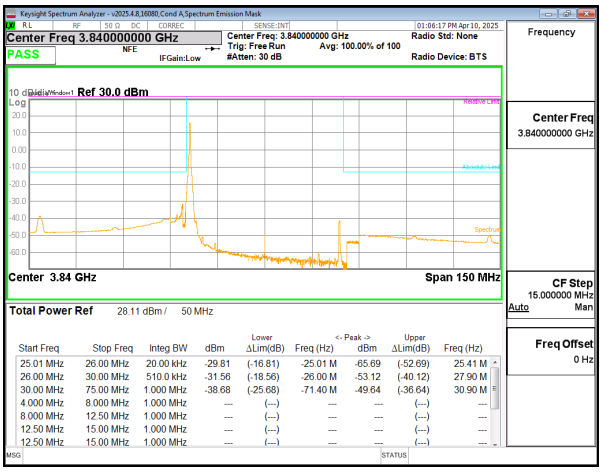

5G NR n77 50MHz BPSK Middle Channel RB1-0

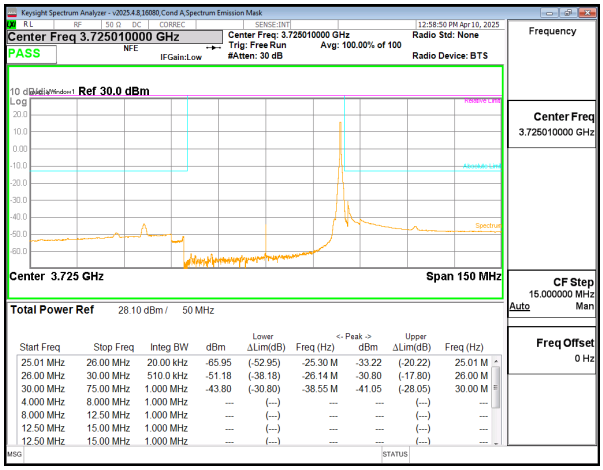

5G NR n77 50MHz BPSK Low Channel RB1-132

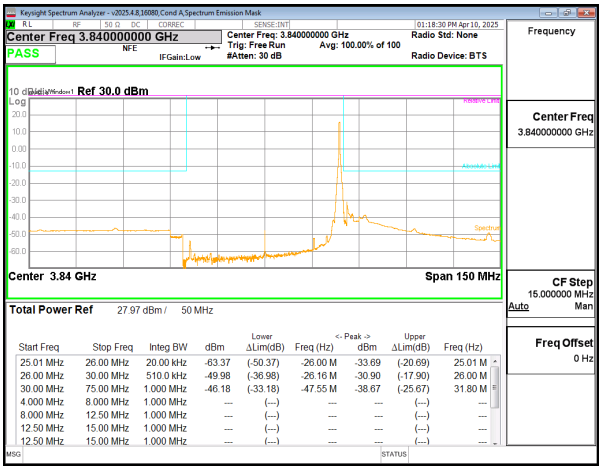

5G NR n77 50MHz BPSK Middle Channel RB1-132

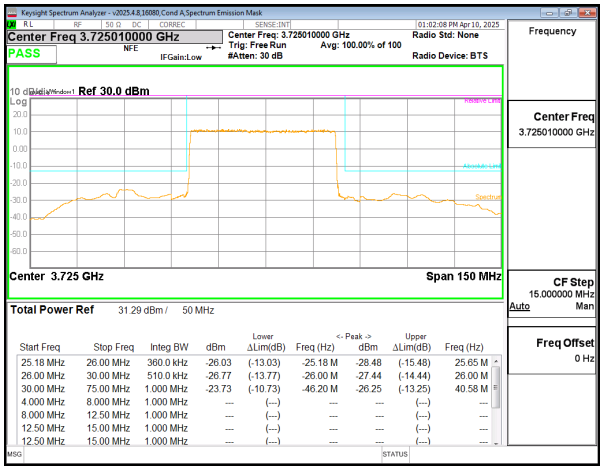

5G NR n77 50MHz BPSK Low Channel RB128-0

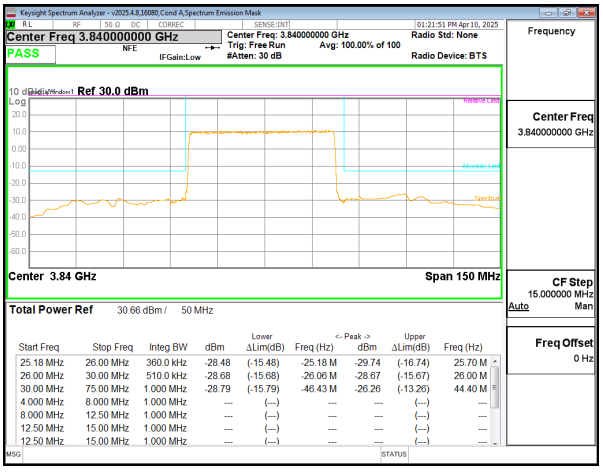

5G NR n77 50MHz BPSK Middle Channel RB128-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

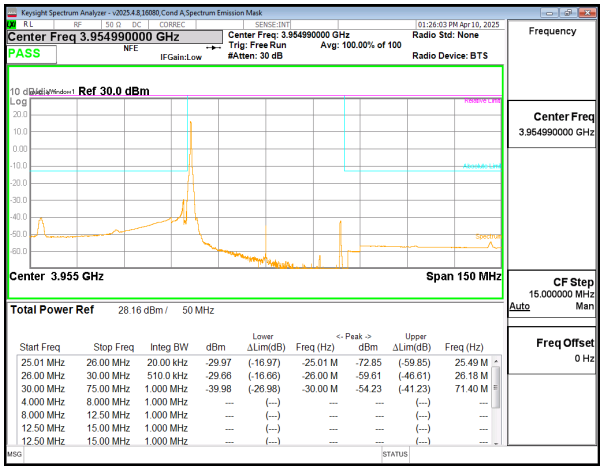

5G NR n77 50MHz BPSK High Channel RB1-0

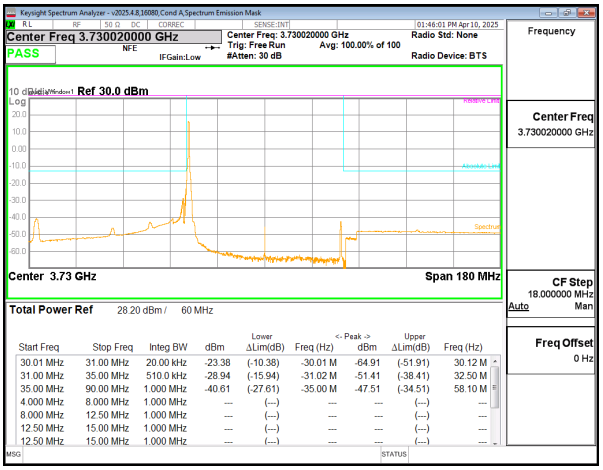

5G NR n77 60MHz BPSK Low Channel RB1-0

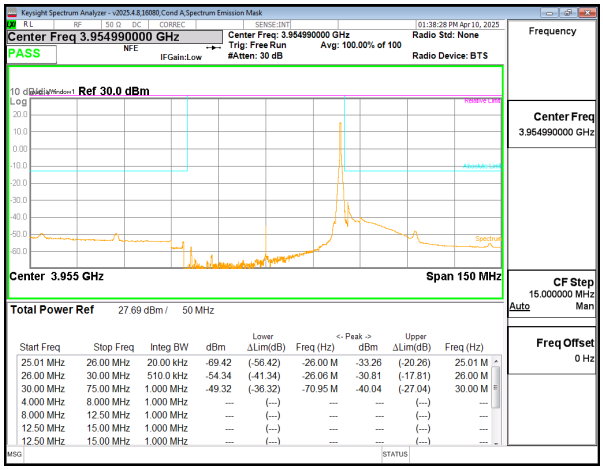

5G NR n77 50MHz BPSK High Channel RB1-132

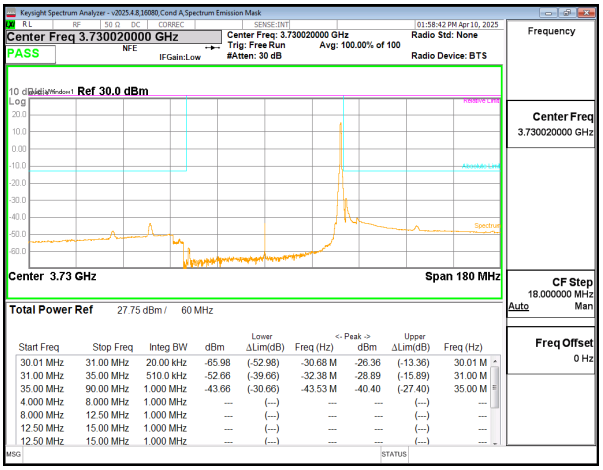

5G NR n77 60MHz BPSK Low Channel RB1-161

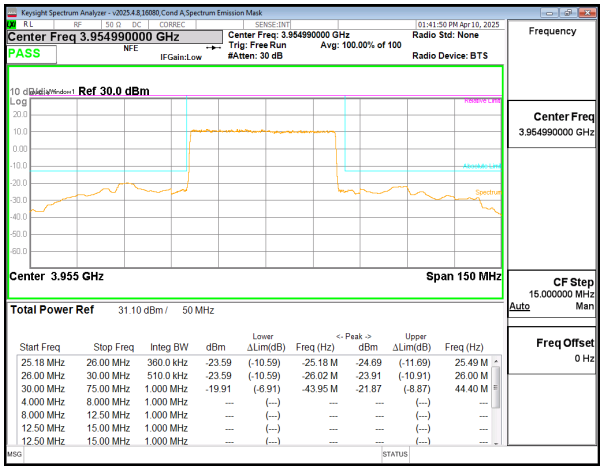

5G NR n77 50MHz BPSK High Channel RB128-0

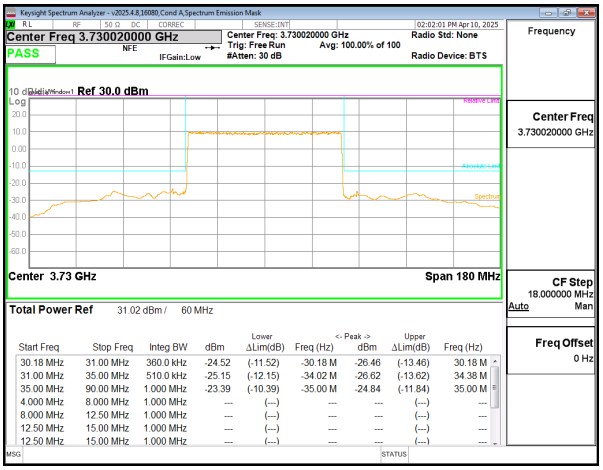

5G NR n77 60MHz BPSK Low Channel RB162-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

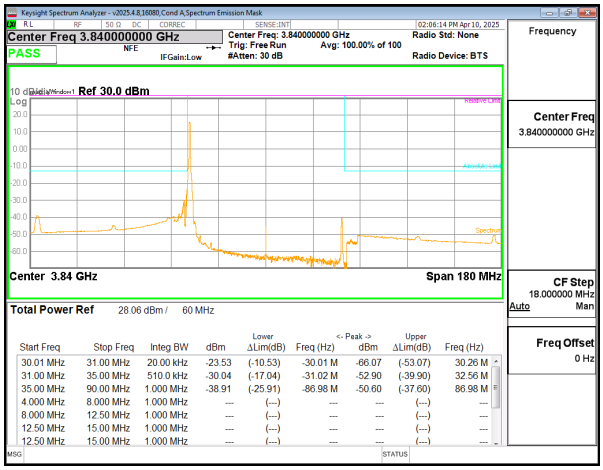

5G NR n77 60MHz BPSK Middle Channel RB1-0

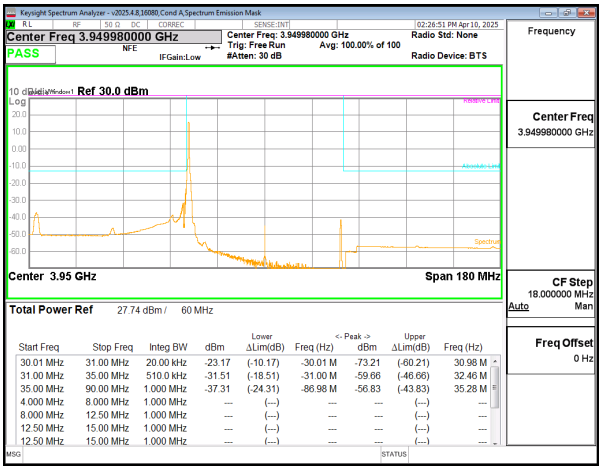

5G NR n77 60MHz BPSK High Channel RB1-0

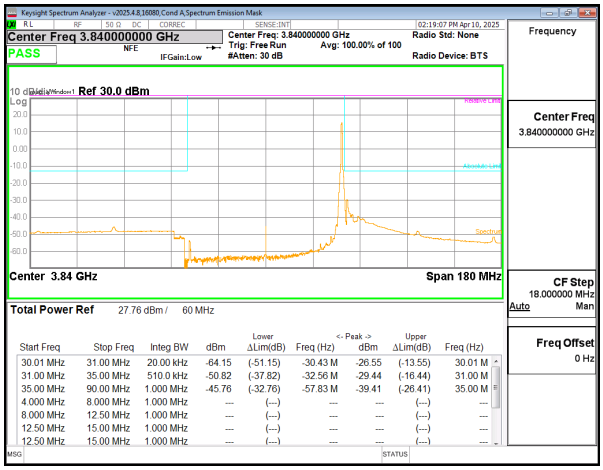

5G NR n77 60MHz BPSK Middle Channel RB1-161

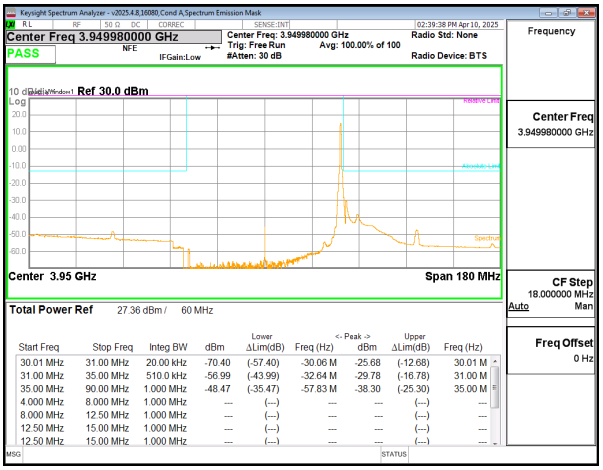

5G NR n77 60MHz BPSK High Channel RB1-161

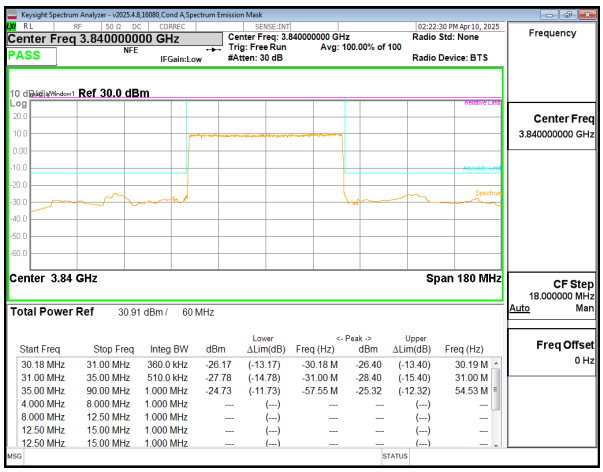

5G NR n77 60MHz BPSK Middle Channel RB162-0

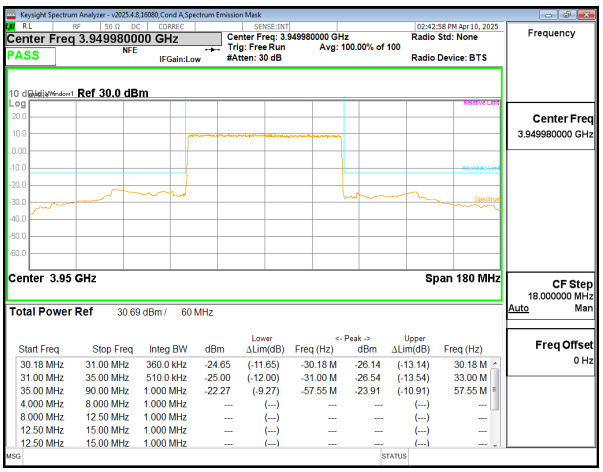

5G NR n77 60MHz BPSK High Channel RB162-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

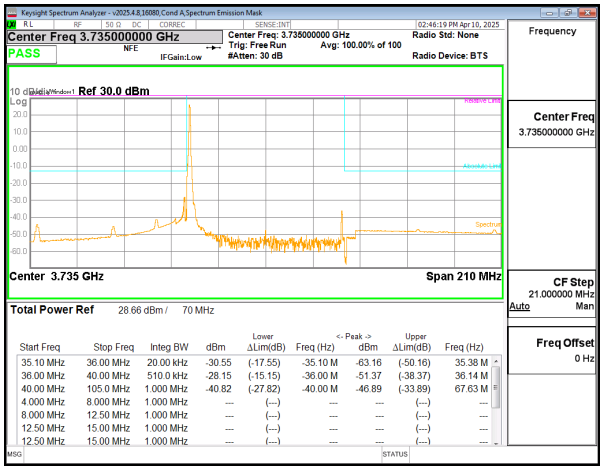

5G NR n77 70MHz BPSK Low Channel RB1-0

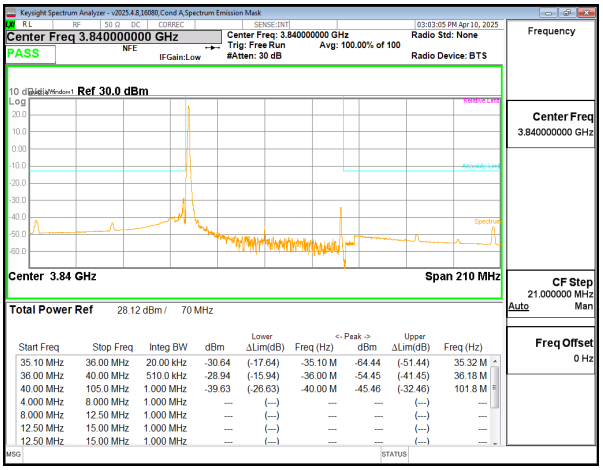

5G NR n77 70MHz BPSK Middle Channel RB1-0

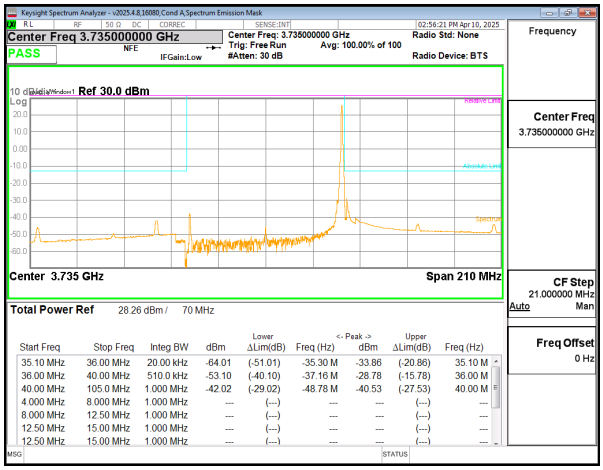

5G NR n77 70MHz BPSK Low Channel RB1-188

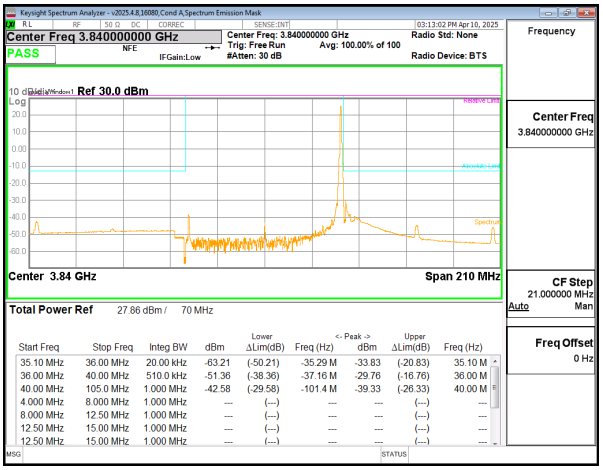

5G NR n77 70MHz BPSK Middle Channel RB1-188

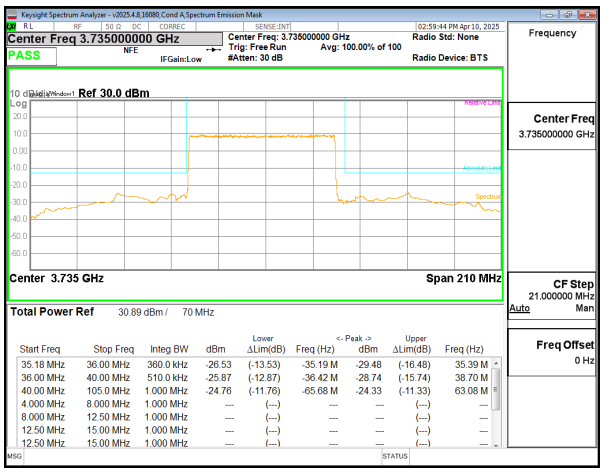

5G NR n77 70MHz BPSK Low Channel RB180-0

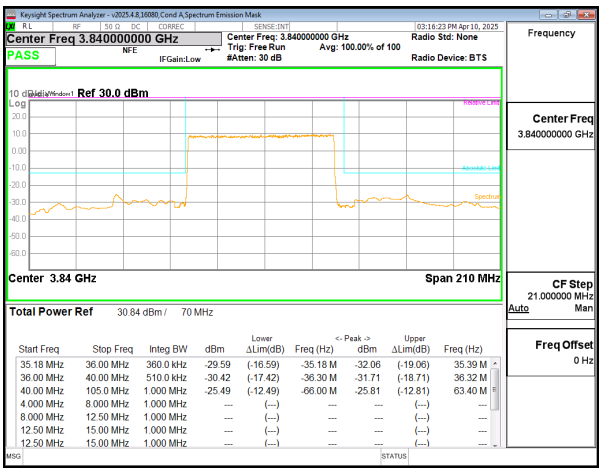

5G NR n77 70MHz BPSK Middle Channel RB180-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

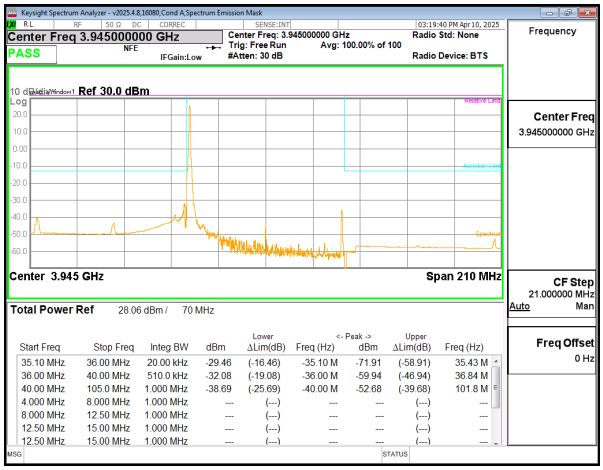

5G NR n77 70MHz BPSK High Channel RB1-0

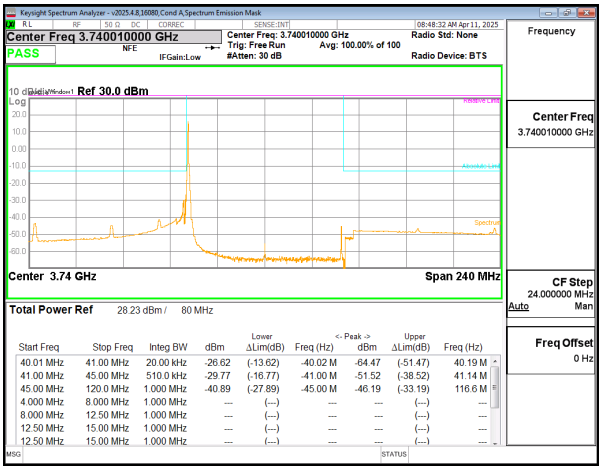

5G NR n77 80MHz BPSK Low Channel RB1-0

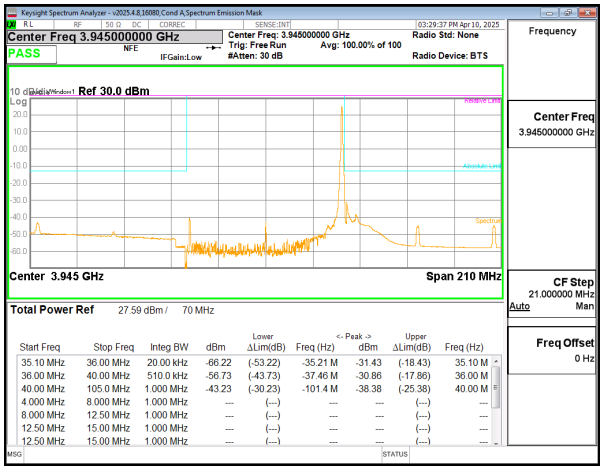

5G NR n77 70MHz BPSK High Channel RB1-188

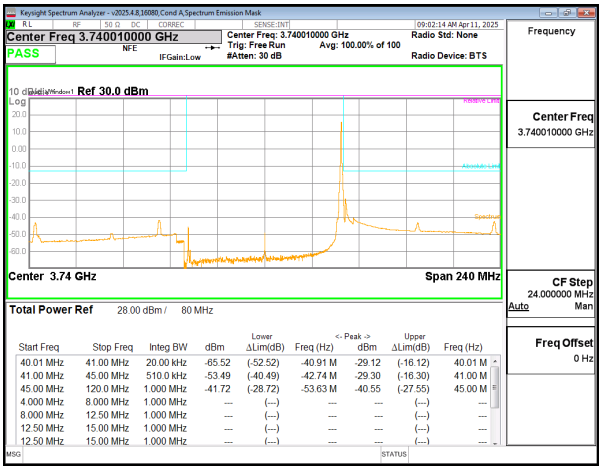

5G NR n77 80MHz BPSK Low Channel RB1-216

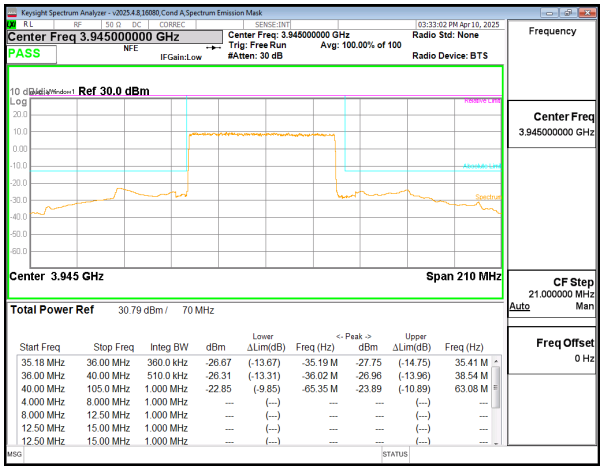

5G NR n77 70MHz BPSK High Channel RB180-0

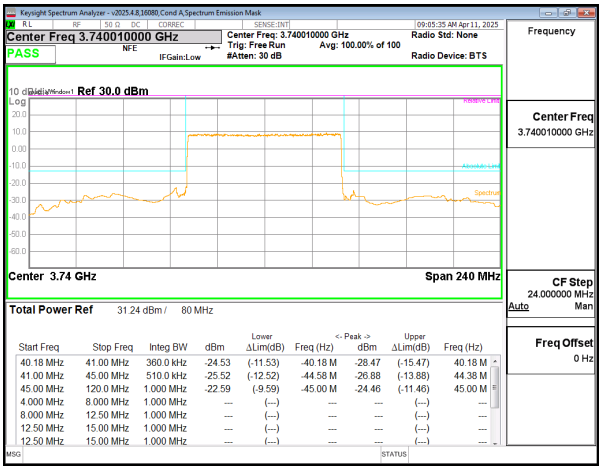

5G NR n77 80MHz BPSK Low Channel RB216-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.

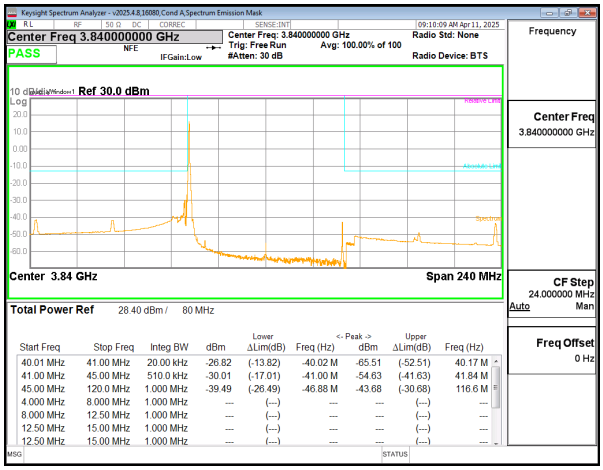

5G NR n77 80MHz BPSK Middle Channel RB1-0

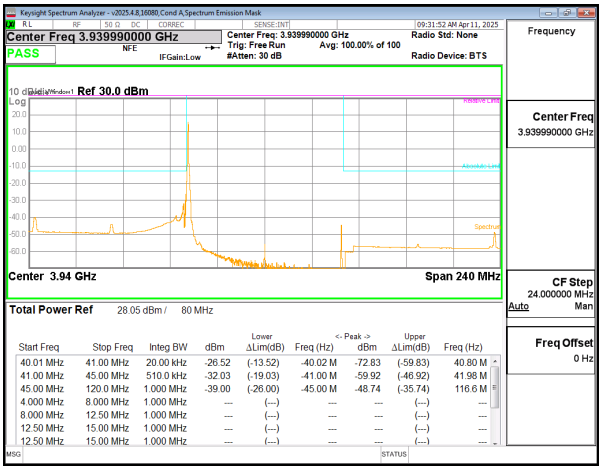

5G NR n77 80MHz BPSK High Channel RB1-0

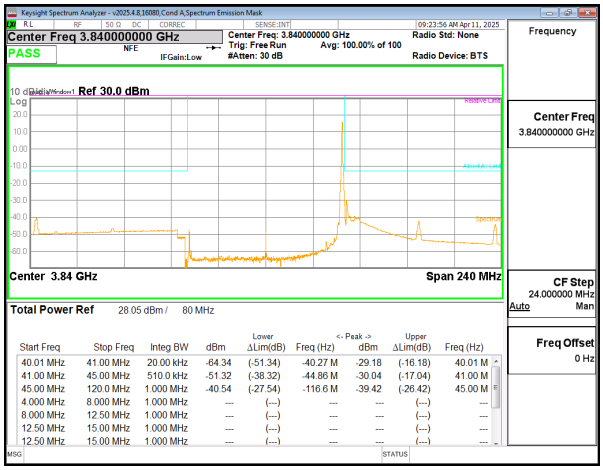

5G NR n77 80MHz BPSK Middle Channel RB1-216

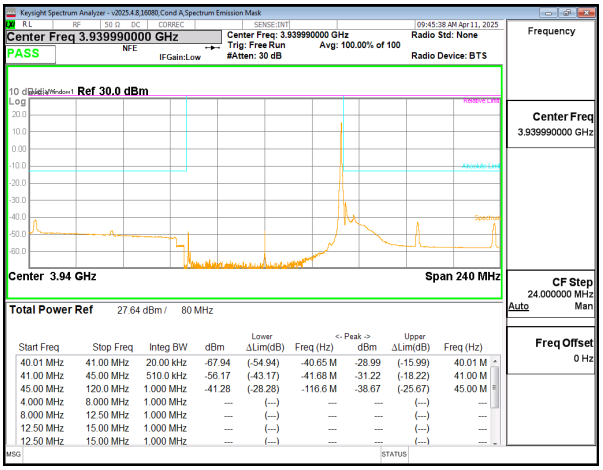

5G NR n77 80MHz BPSK High Channel RB1-216

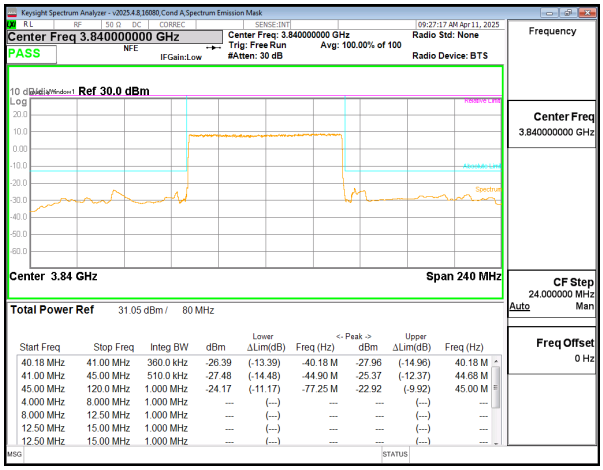

5G NR n77 80MHz BPSK Middle Channel RB216-0

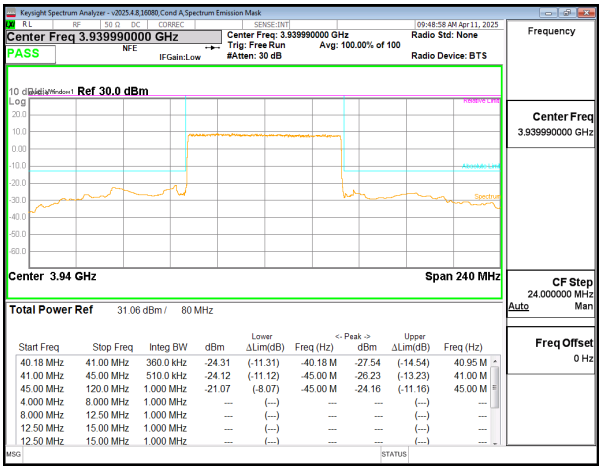

5G NR n77 80MHz BPSK High Channel RB216-0

UL VERIFICATION SERVICES INC.
47173 BENICIA STREET, FREMONT, CA 94538, USA TEL: (510) 319-4000 FAX: (510) 661-0888
This report shall not be reproduced except in full, without the written approval of UL Verification Services Inc.