



n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB180@0 -47.27dBm

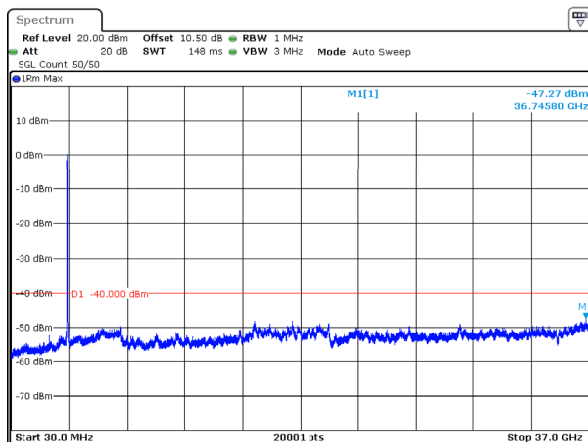


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:00:04

n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.63dBm

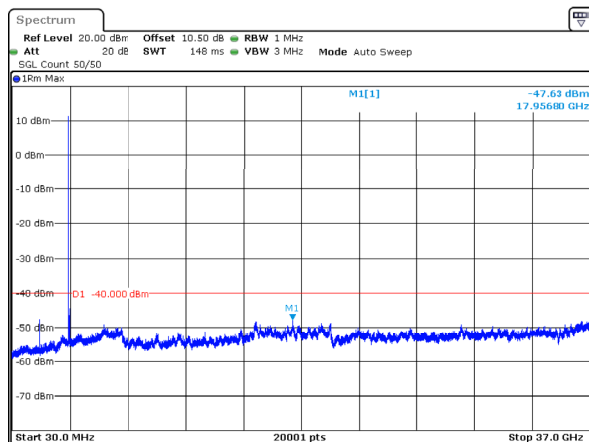


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:53:43

n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@188 -47.87dBm

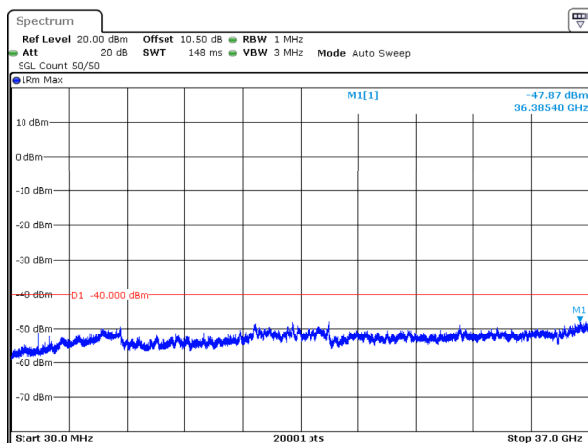


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 10:58:55

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0 -47.76dBm

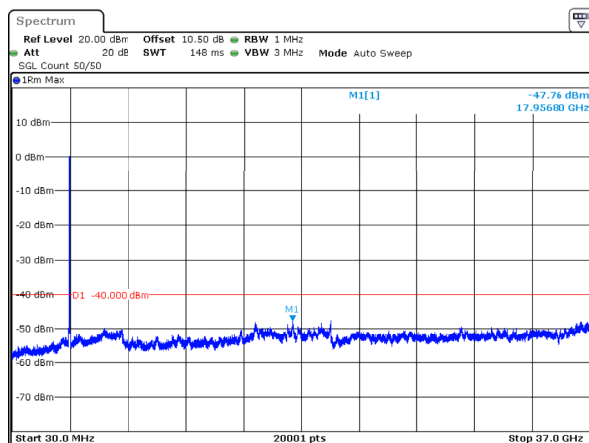


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:03:44

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@0 -47.88dBm

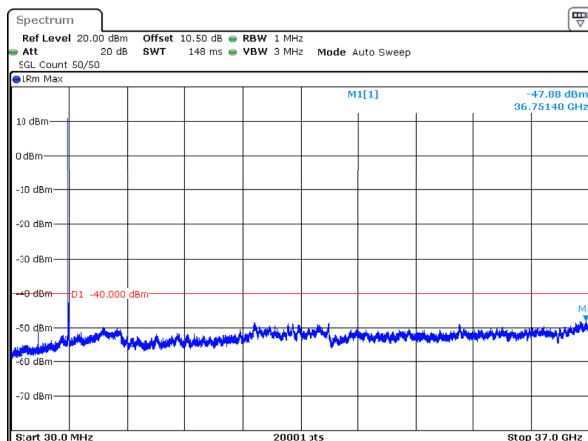


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:01:23

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188 -47.38dBm

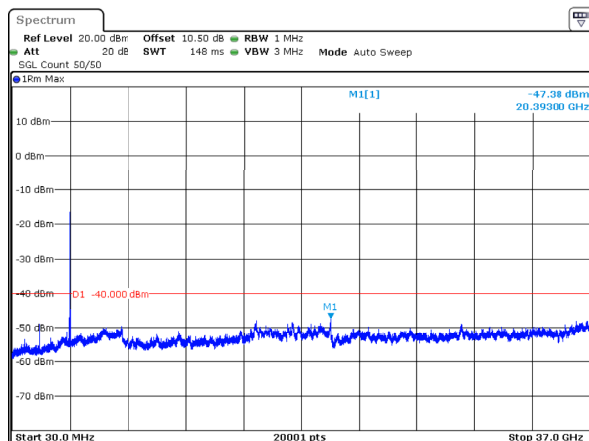


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:02:35

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@0 -45.69dBm

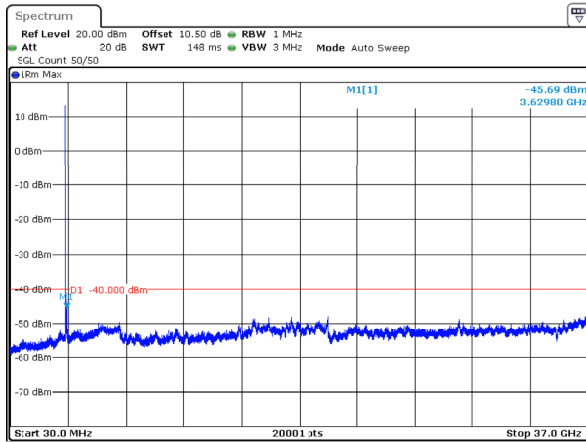


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:04:53

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@216 -47.92dBm

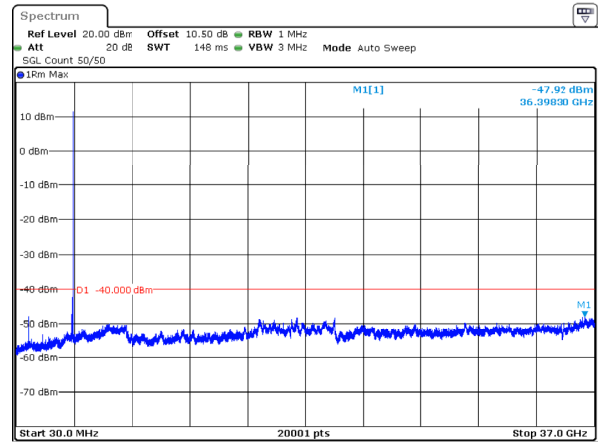


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:06:02

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0 -48.15dBm

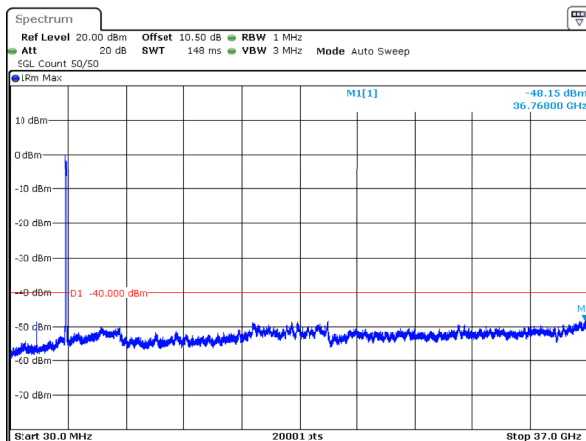


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:07:11

n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -46.83dBm

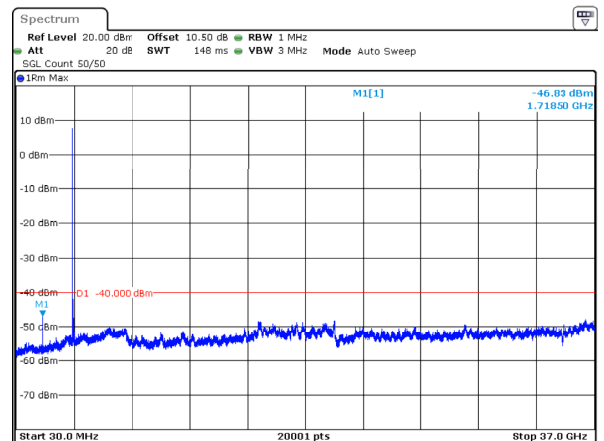


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:09:08

n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@216 -47.81dBm

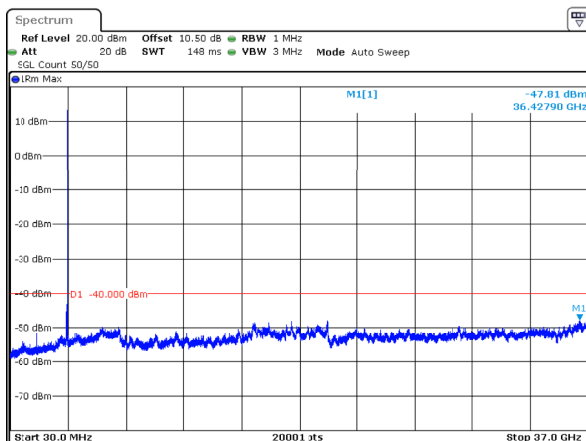


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:10:17

n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB216@0 -47.84dBm

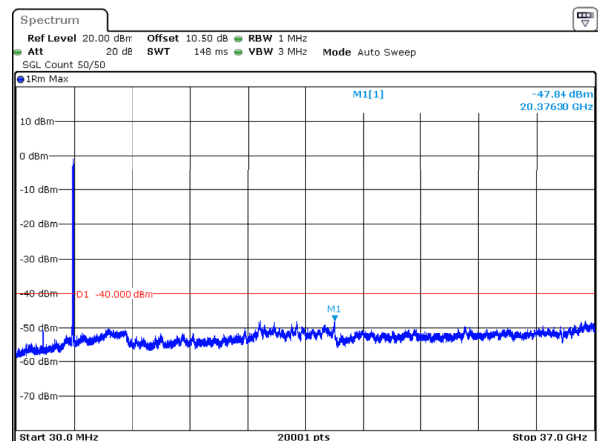


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:11:28

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@0 -47.80dBm

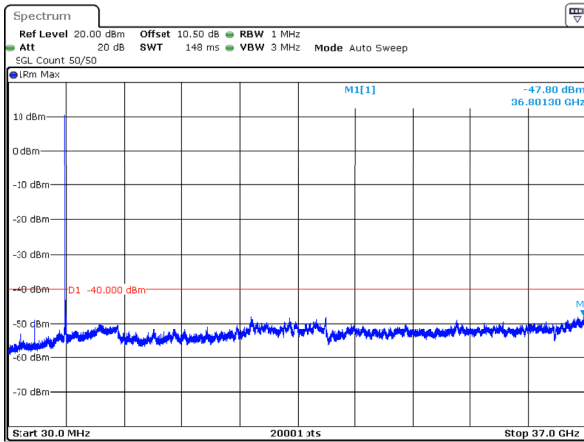


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:12:40

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216 -47.85dBm

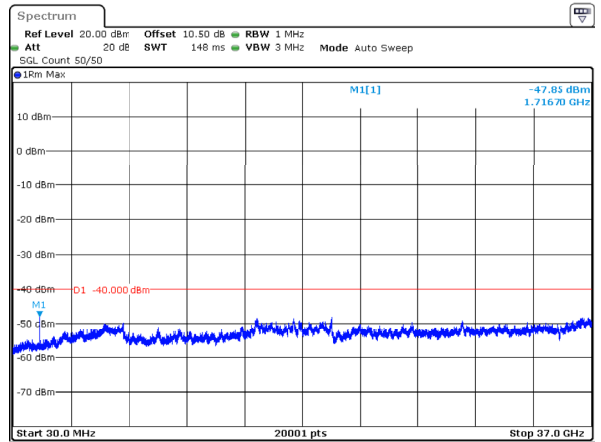


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:13:51

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0 -47.71dBm

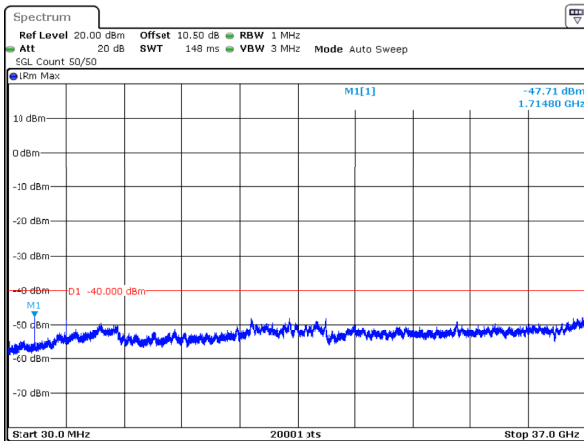


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:14:59

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@0 -47.82dBm

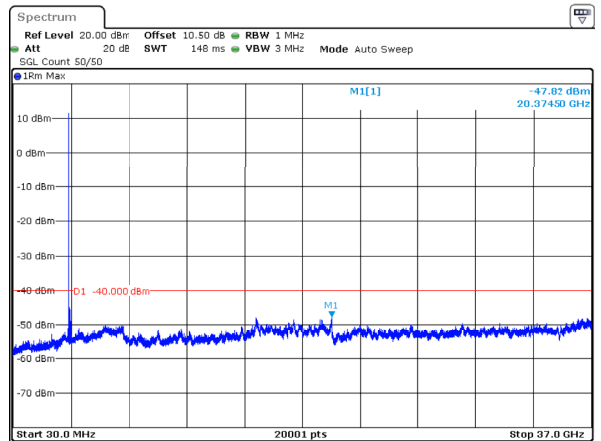


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:16:08

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@244 -47.37dBm

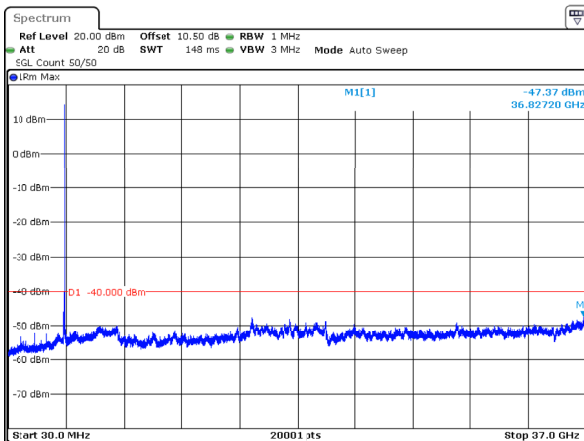


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:17:20

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0 -46.98dBm

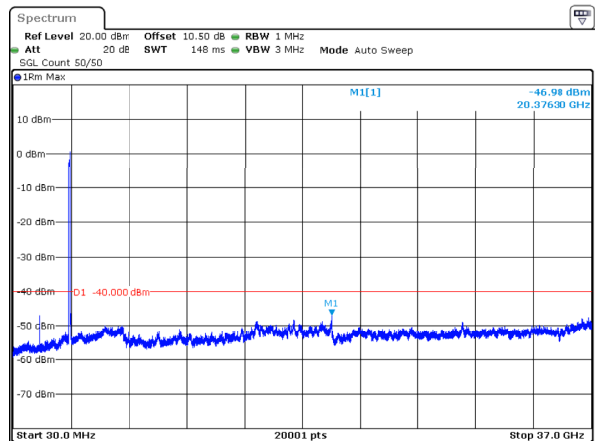


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:18:32

n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.20dBm

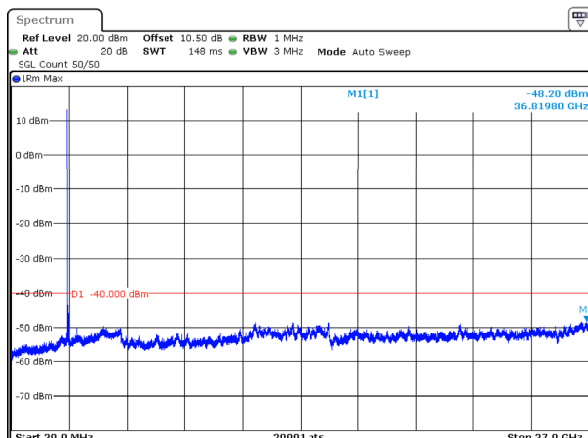


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:19:41

n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@244 -47.19dBm

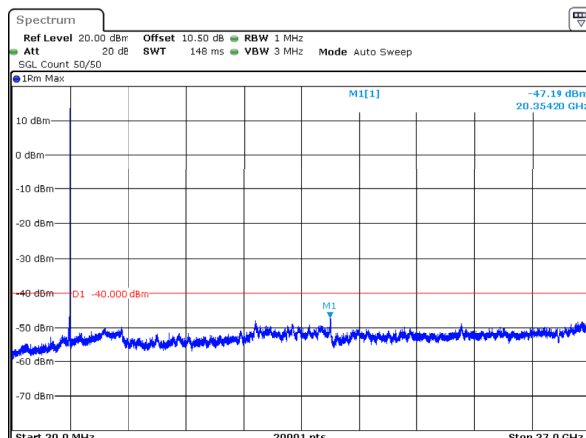


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:20:50

n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB243@0 -47.93dBm

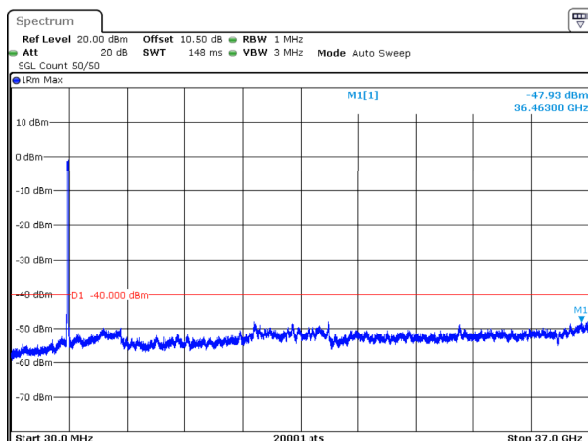


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:21:57

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@0 -47.67dBm

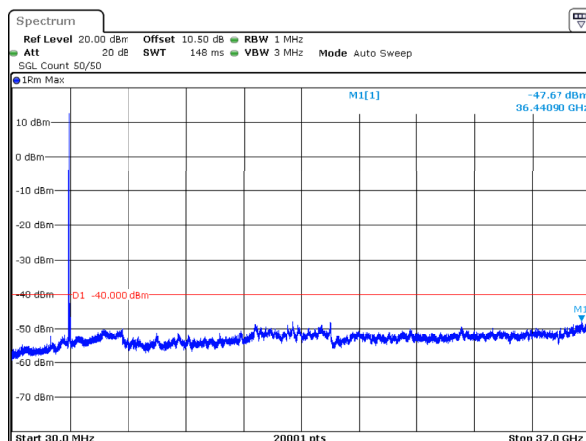


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:23:06

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244 -48.02dBm

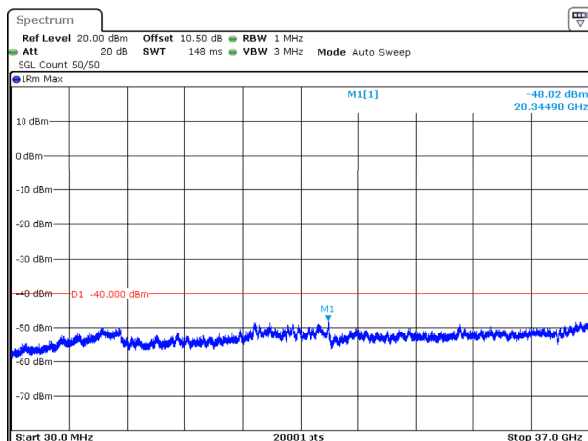


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:24:16

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0 -48.14dBm

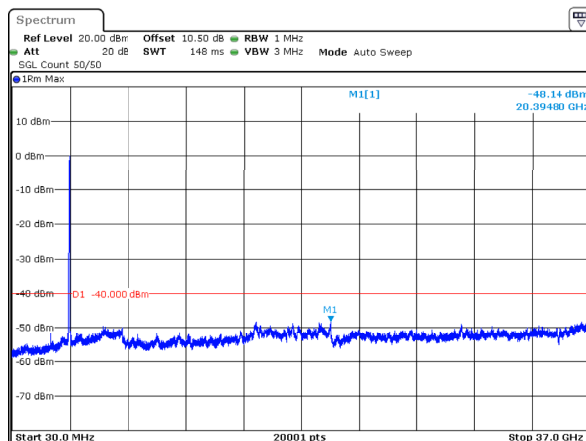


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:25:25

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@0 -48.26dBm

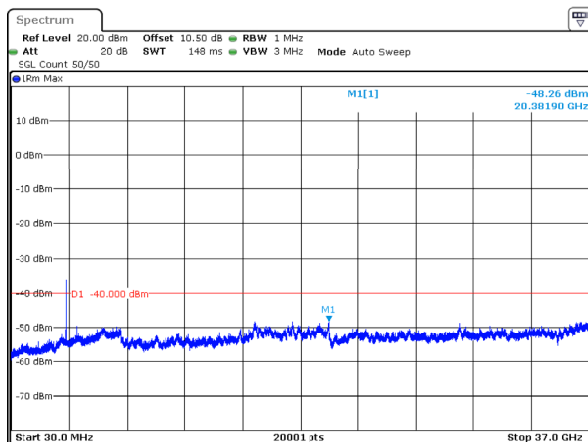


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:26:34

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@272 -47.82dBm

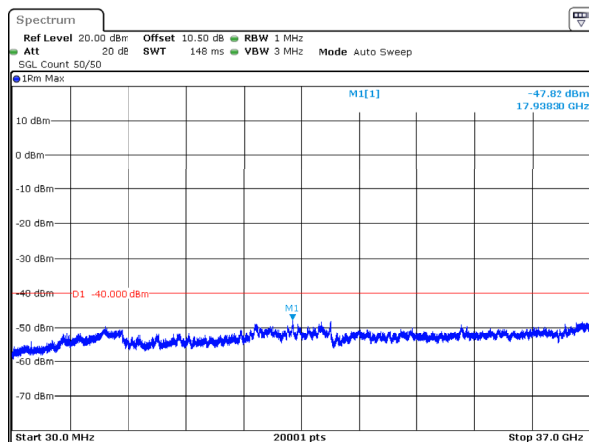


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:27:47

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0 -47.70dBm

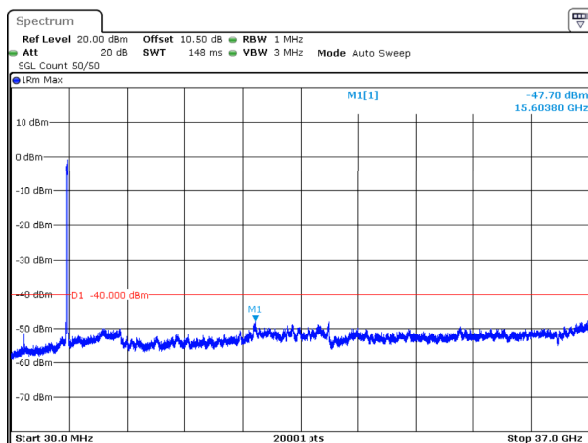


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:28:56

n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.39dBm

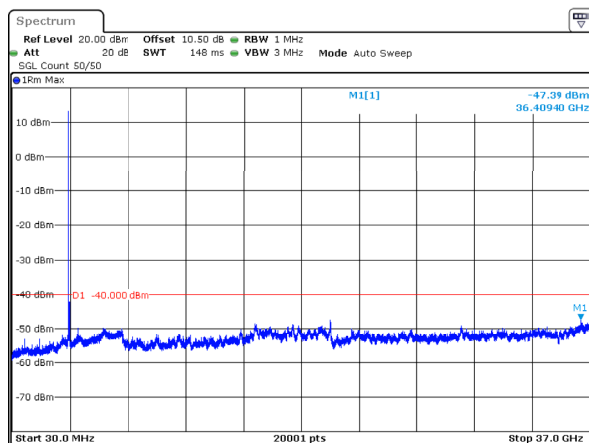


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:30:10

n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@272 -47.25dBm

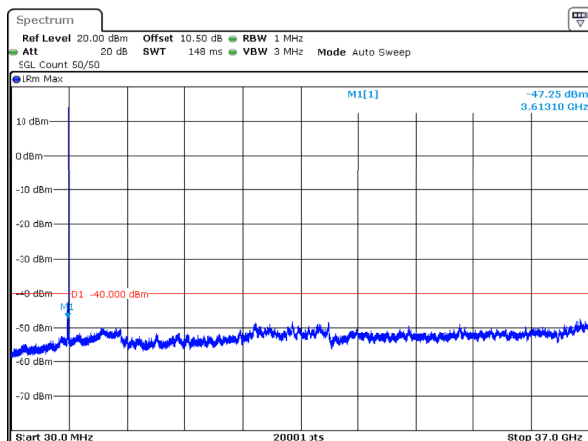


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:31:24

n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB270@0 -48.21dBm

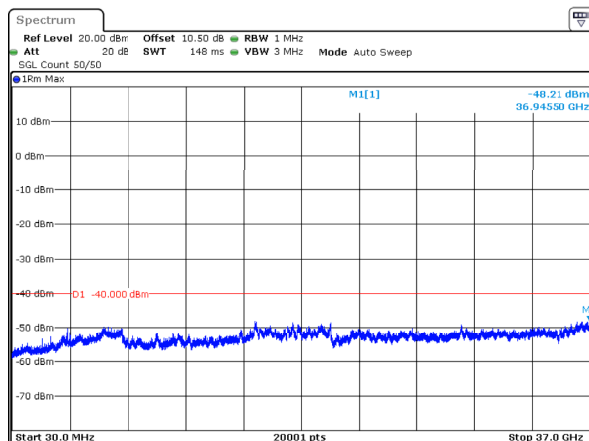


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:32:37

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@0 -47.29dBm

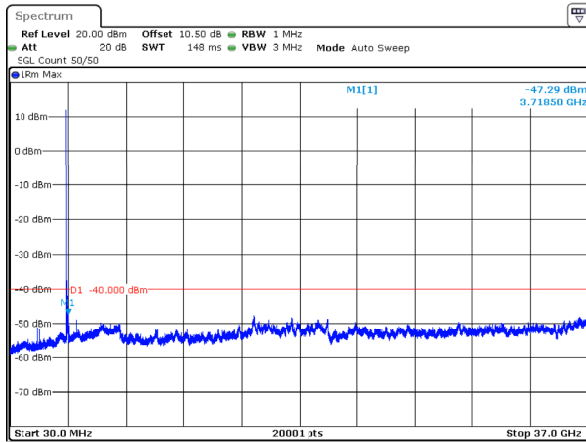

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:33:51


n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272 -48.11dBm

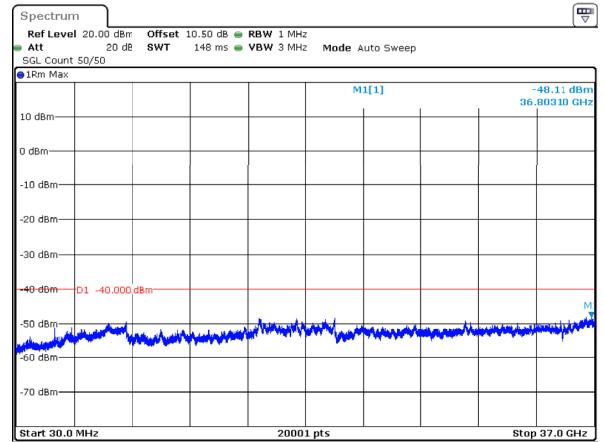

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:35:02


n78_2

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0 -47.46dBm

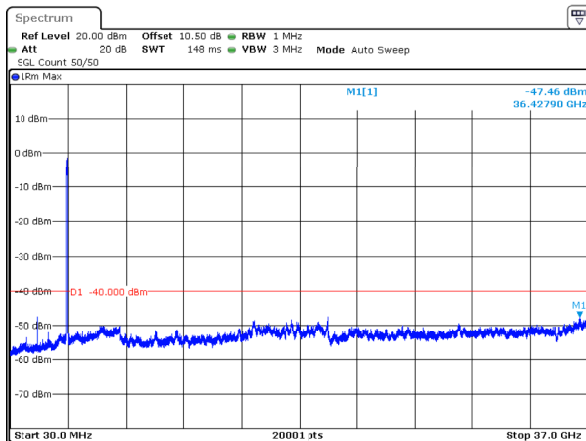


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:36:17

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0 -47.45dBm

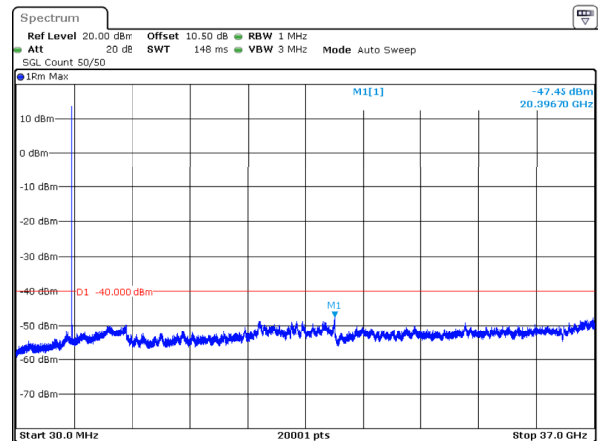


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:37:30

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@23 -47.82dBm

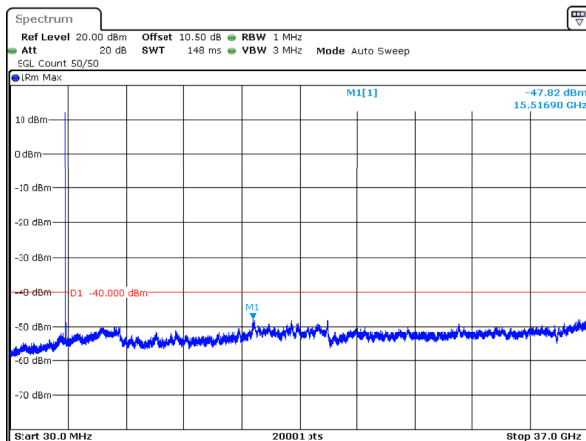


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:55:23

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0 -47.90dBm

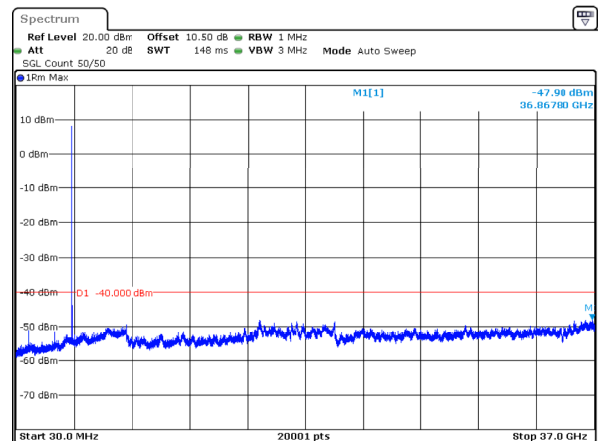


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:56:31

n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.23dBm

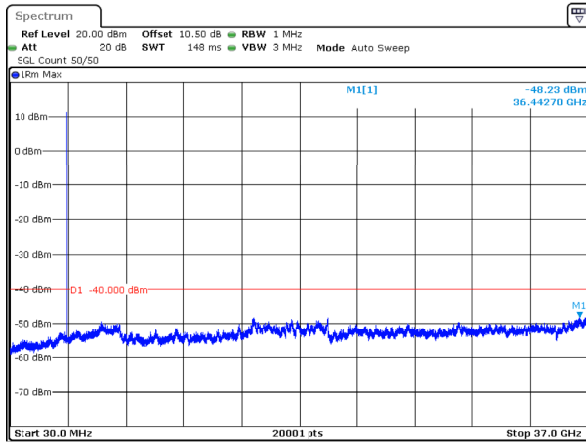


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:57:38

n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@23 -47.19dBm

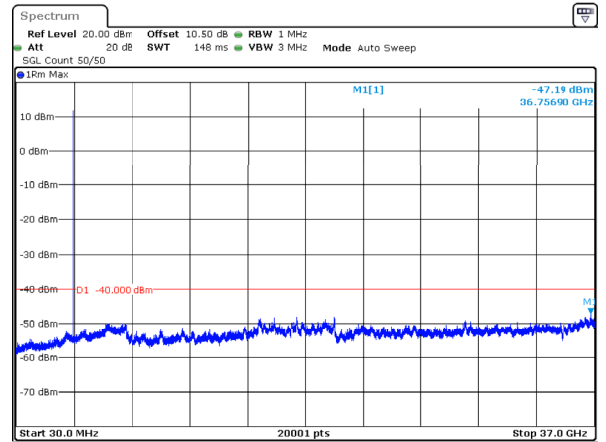


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:58:48

n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB24@0 -47.64dBm

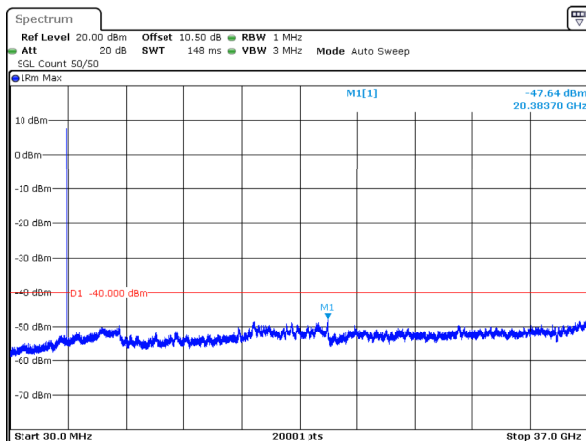


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 11:59:56

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@0 -47.95dBm

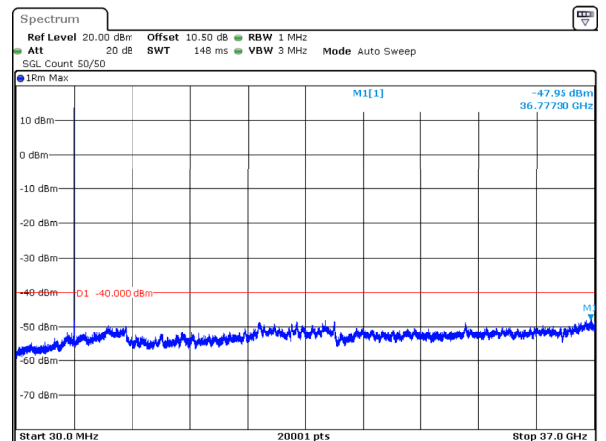


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:02:34

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23 -47.87dBm

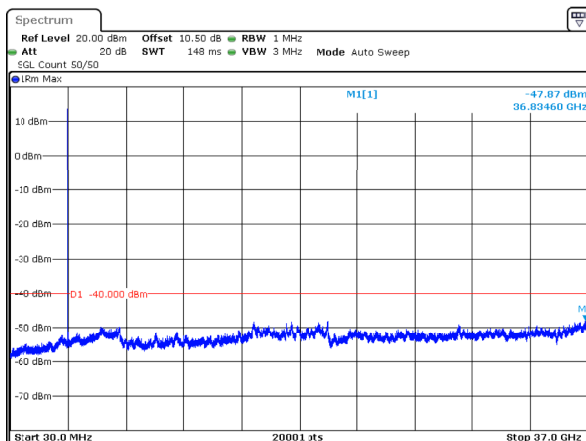


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:03:41

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0 -48.19dBm

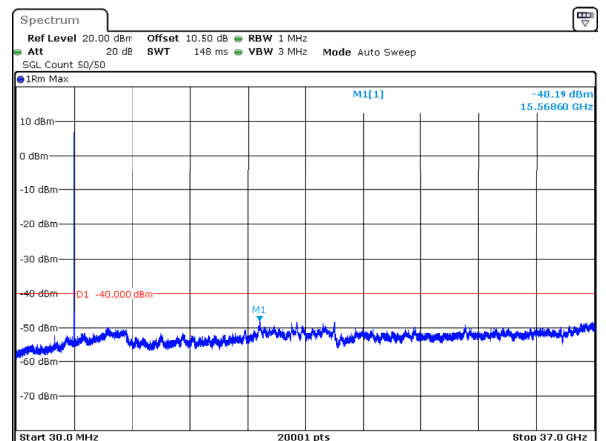


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:04:52

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.78dBm

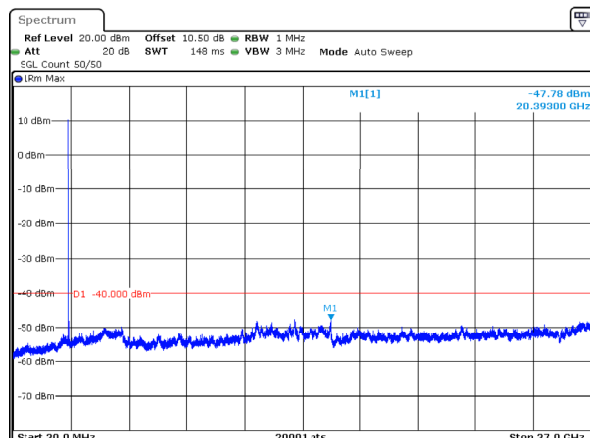


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:05:59

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@37 -48.03dBm

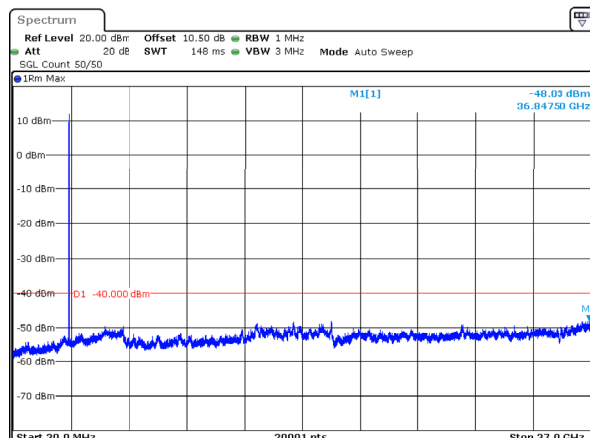


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:07:09

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0 -48.28dBm

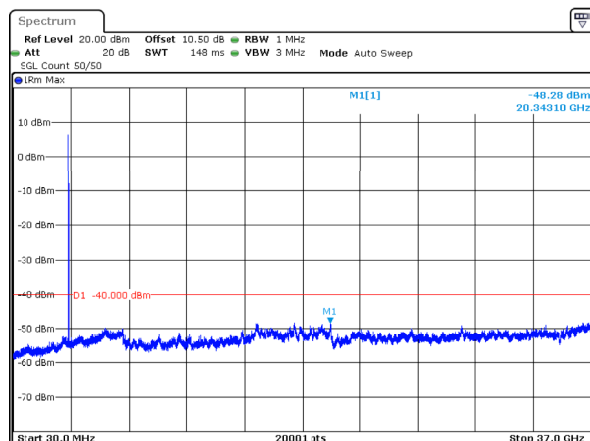


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:08:17

n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.96dBm

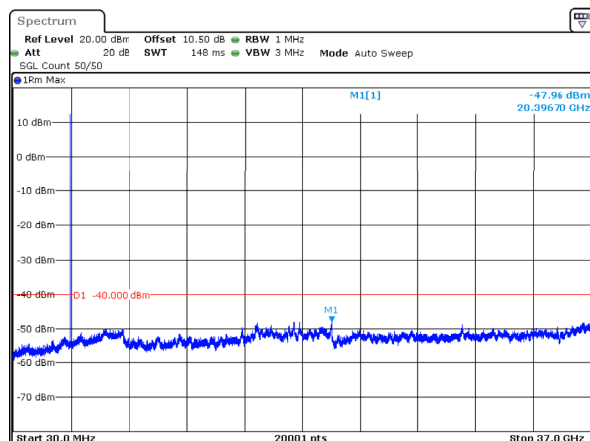


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:09:27

n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@37 -48.10dBm

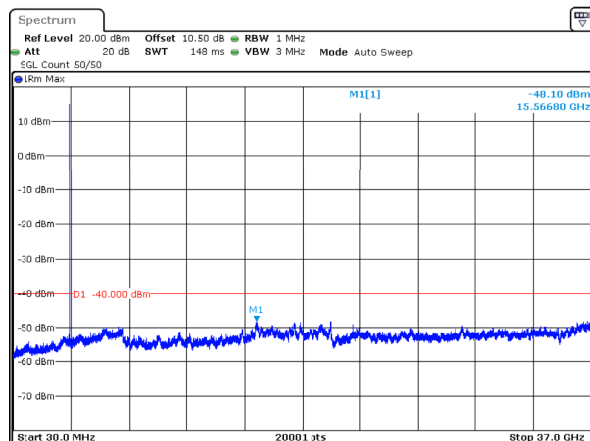


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:10:35

n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB36@0 -47.39dBm

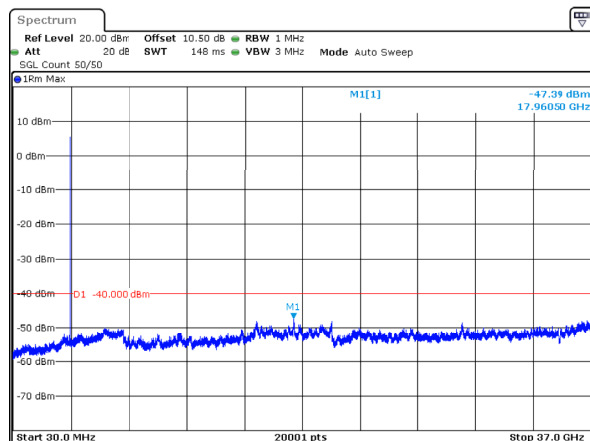


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:11:40

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.38dBm

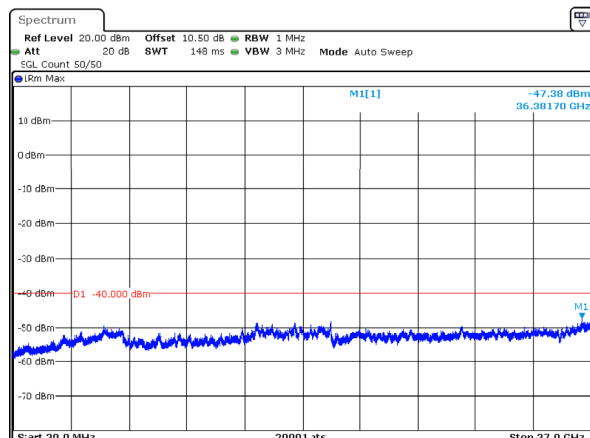


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:12:51

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37 -48.03dBm

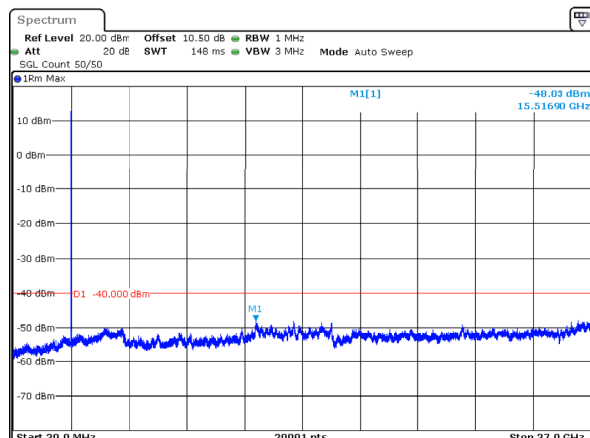


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:13:59

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0 -46.92dBm

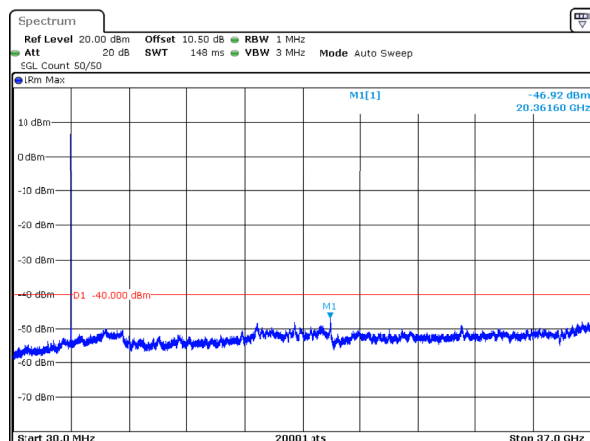


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:15:07

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0 -48.11dBm

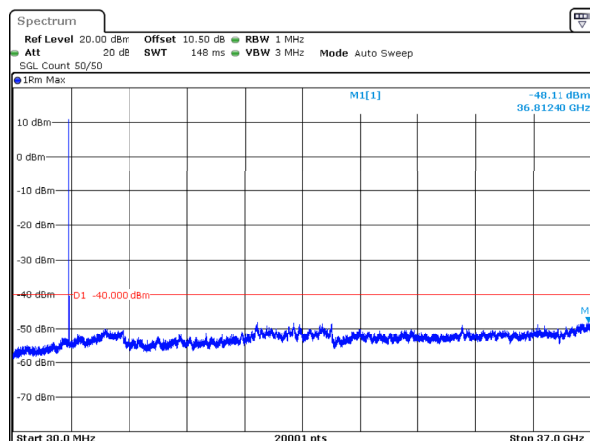


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:16:16

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@50 -48.04dBm

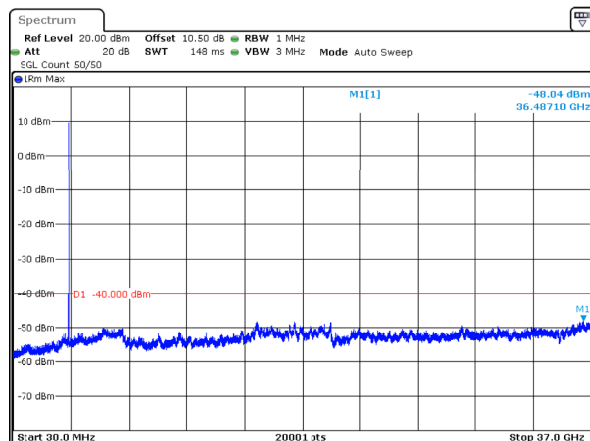


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:17:25

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0 -47.91dBm

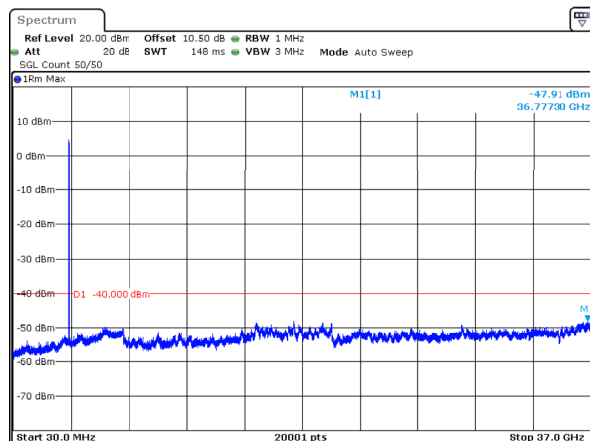


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:18:36

n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.27dBm

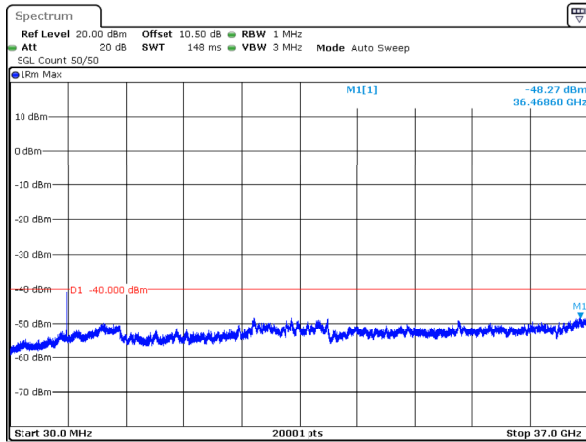


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:19:45

n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@50 -47.80dBm

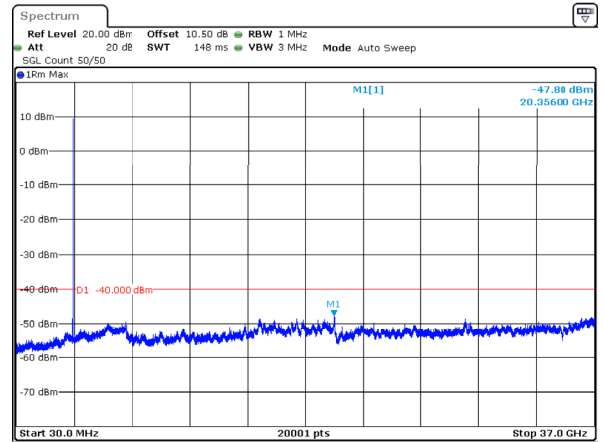


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:20:38

n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB50@0 -48.05dBm

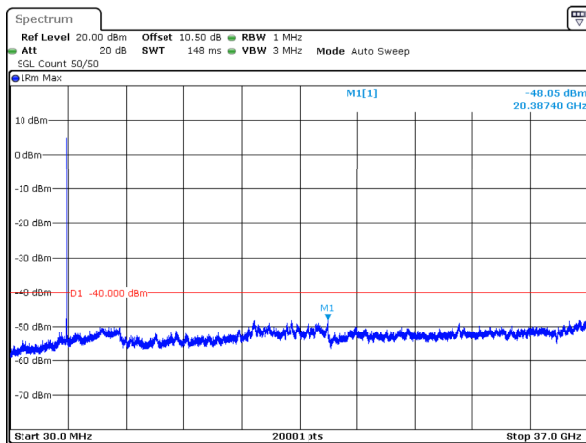


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:21:43

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@0 -47.42dBm

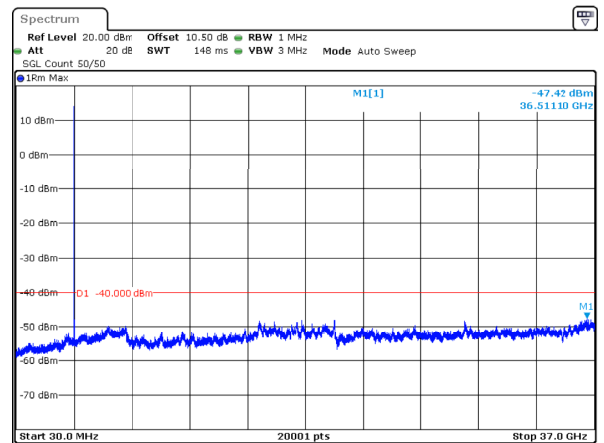


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:22:54

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50 -47.42dBm

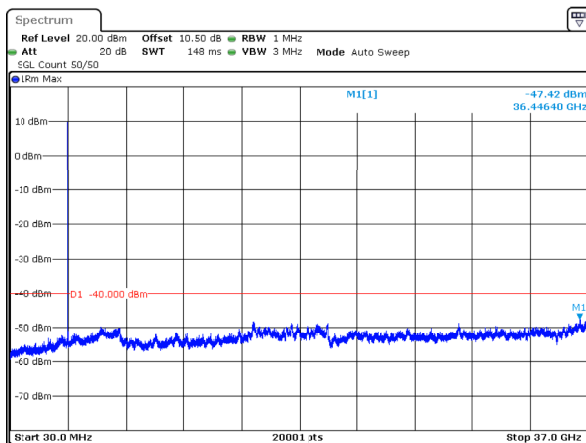


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:23:48

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0 -47.80dBm

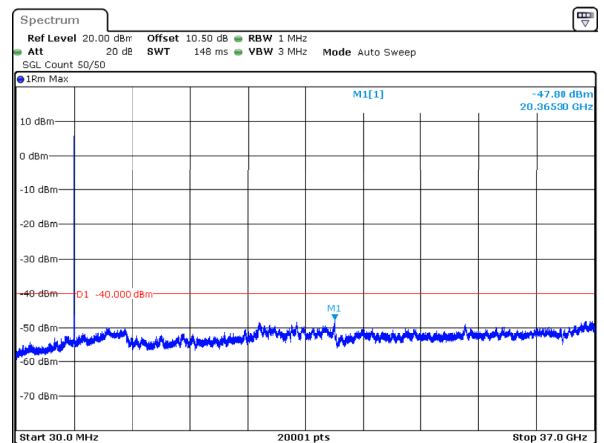


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:24:41


n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0 -47.70dBm

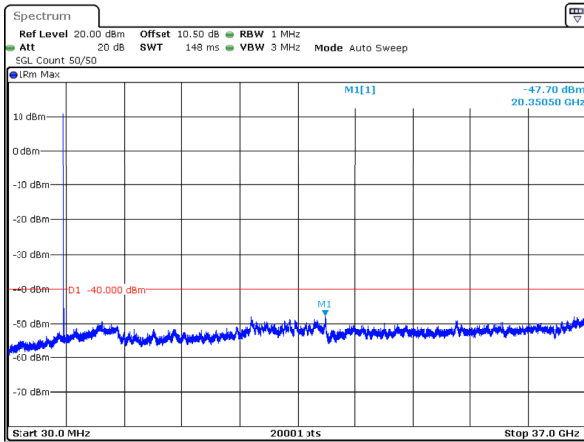


n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@77 -47.50dBm

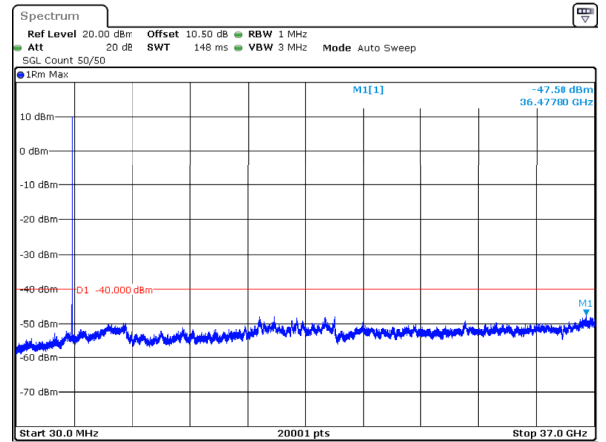


n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0 -47.64dBm

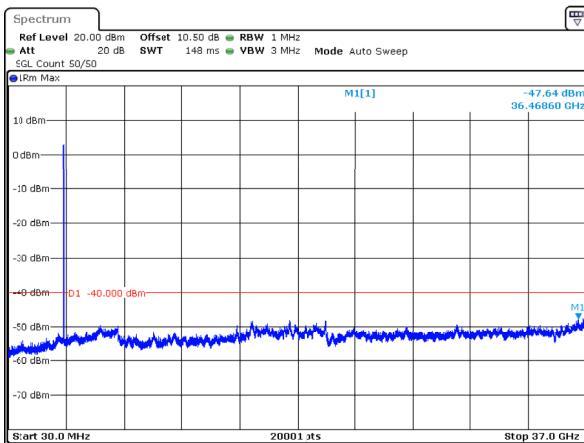


n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.43dBm

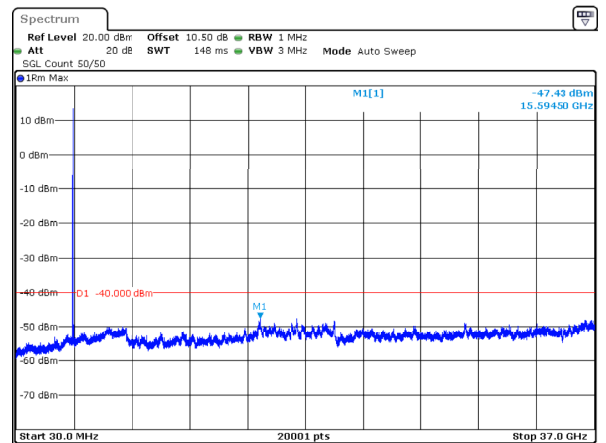


n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@77 -47.91dBm

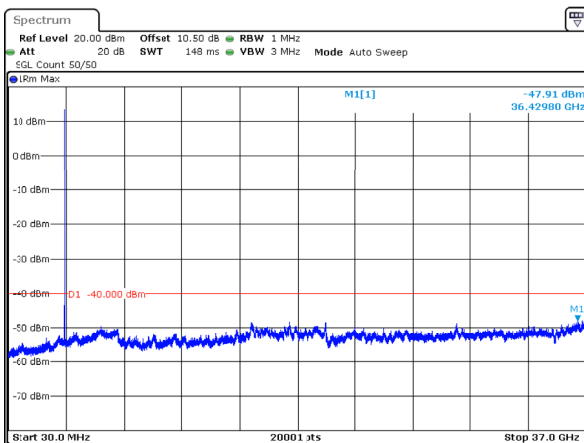

n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB75@0 -47.90dBm

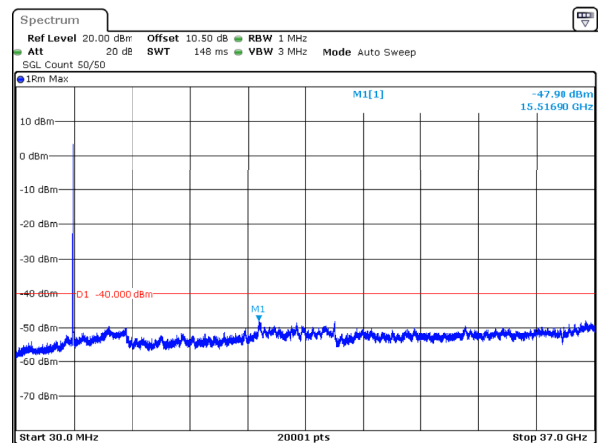


n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@0 -47.54dBm

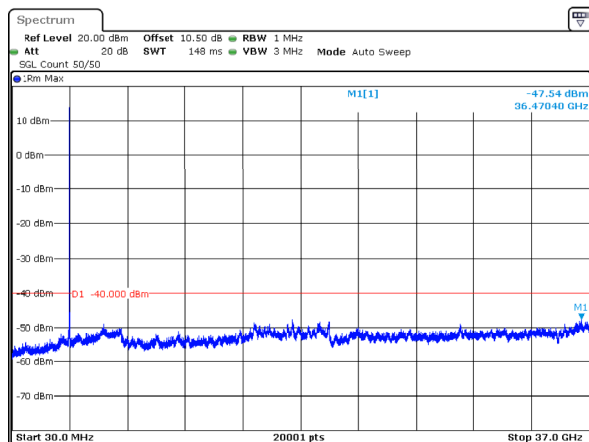


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:31:11

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77 -47.46dBm

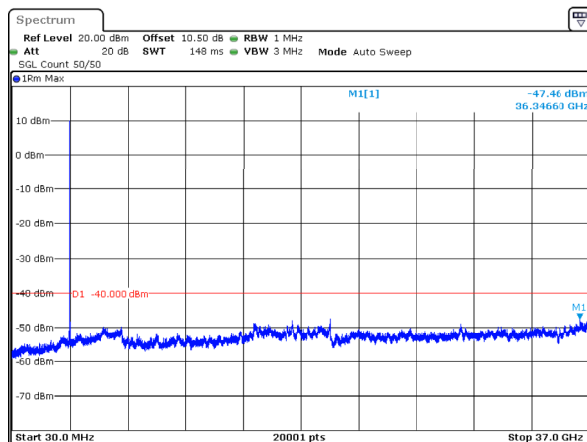


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:32:20

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0 -47.49dBm

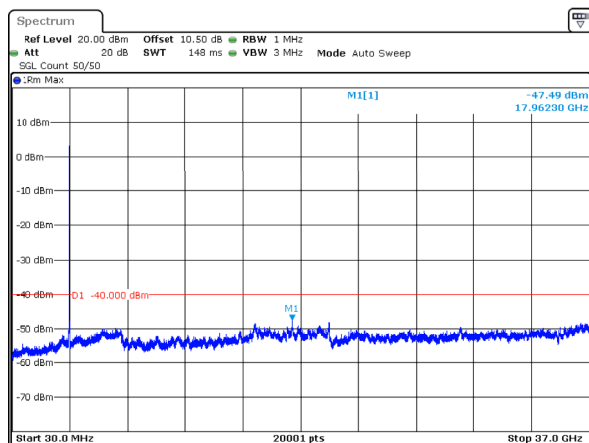


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:33:27

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0 -47.44dBm

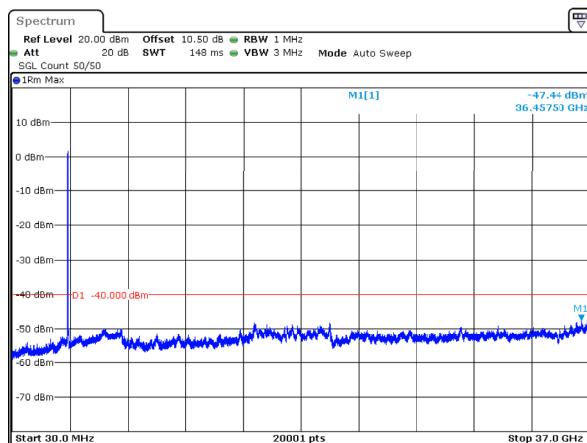


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:36:54

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0 -47.62dBm

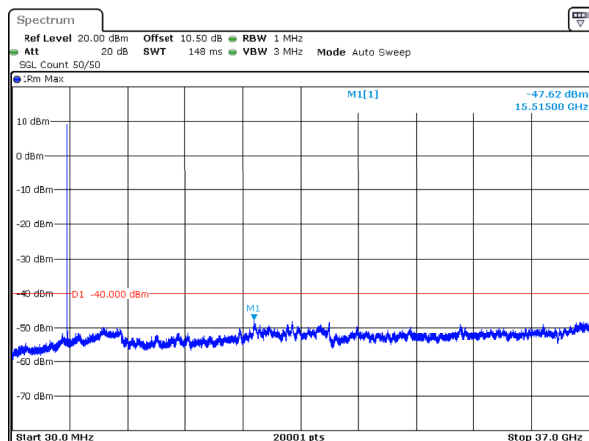


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:34:40

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@105 -46.95dBm

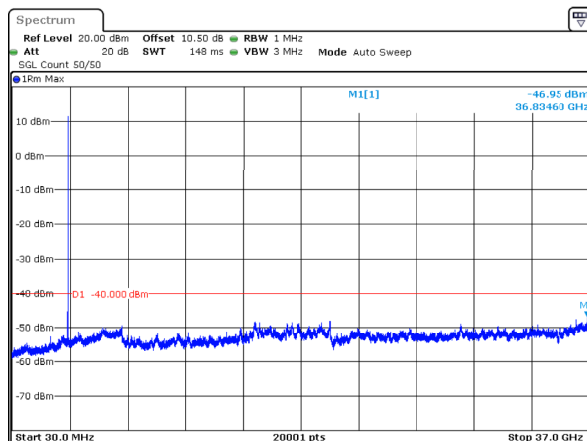


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:35:46

n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB100@0 -47.56dBm

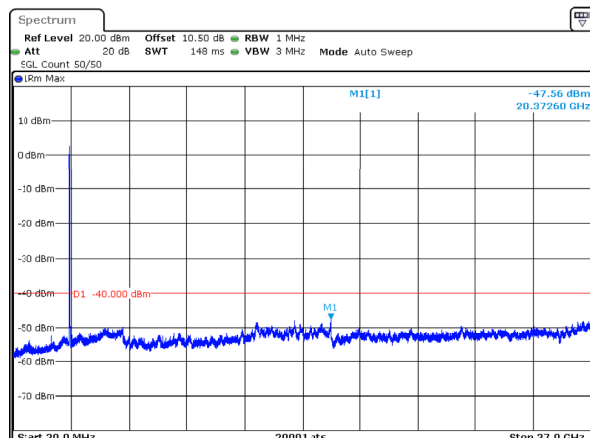


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:40:07

n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.91dBm

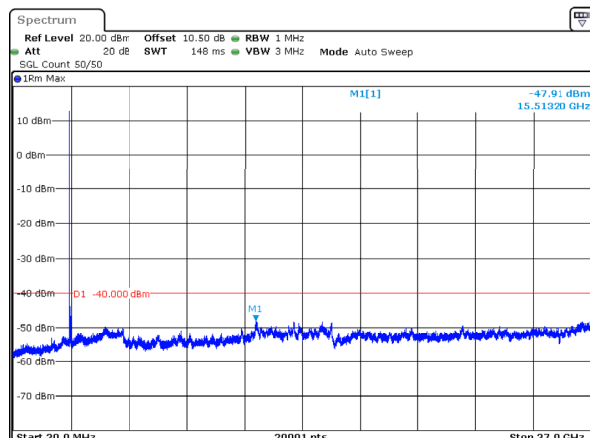


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:37:48

n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@105 -48.06dBm

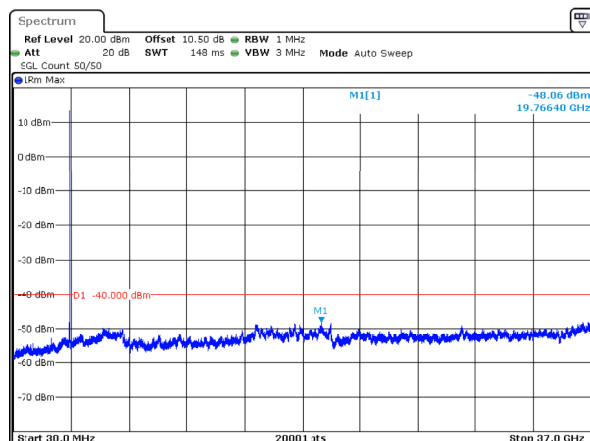


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:38:59

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0 -47.71dBm

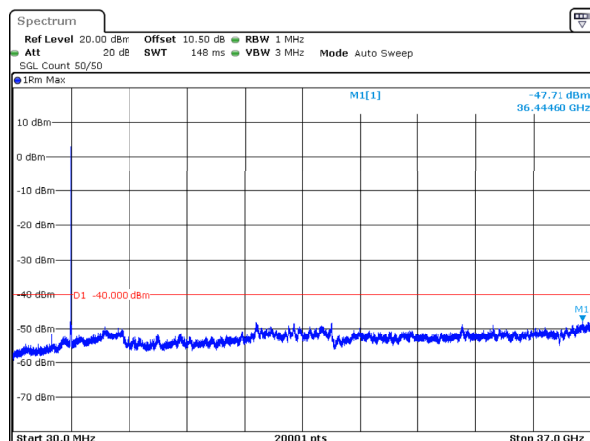


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:43:17

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@0 -48.16dBm

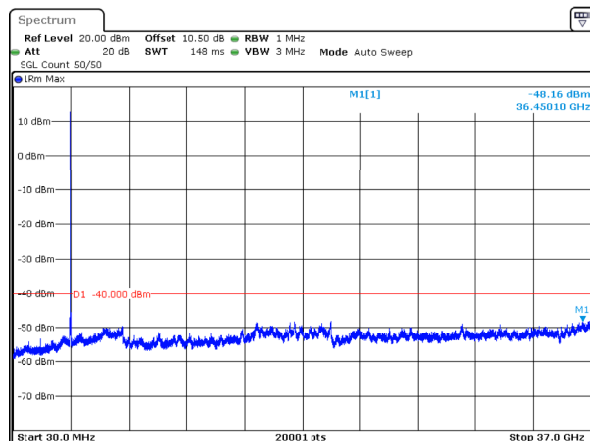


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:41:01

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105 -48.03dBm

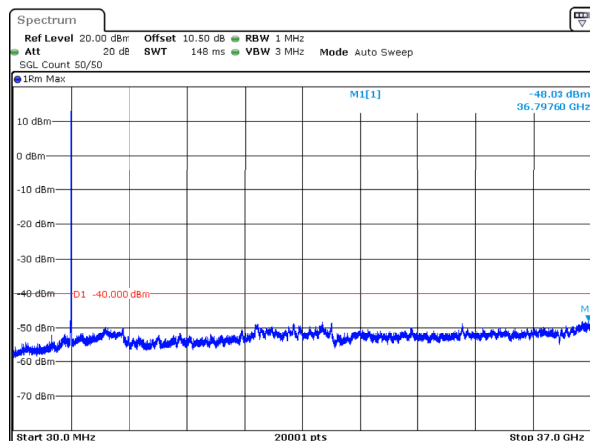


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:42:09

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0 -47.52dBm

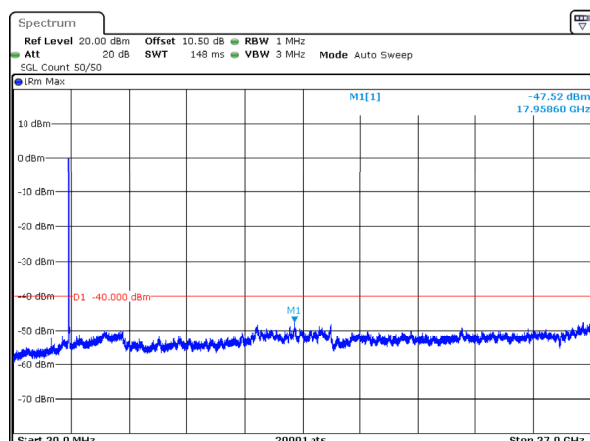


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:46:43

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0 -48.03dBm

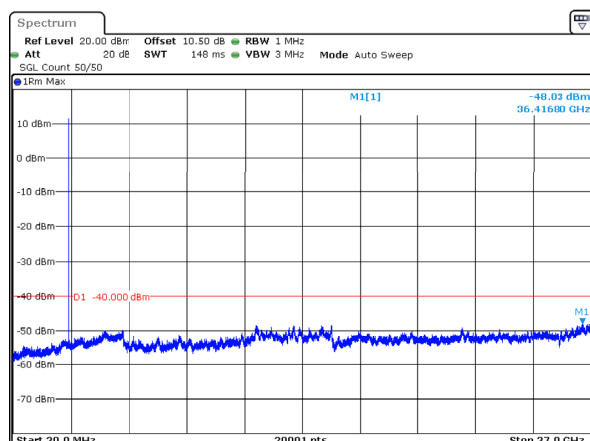


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:44:26

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@132 -47.51dBm

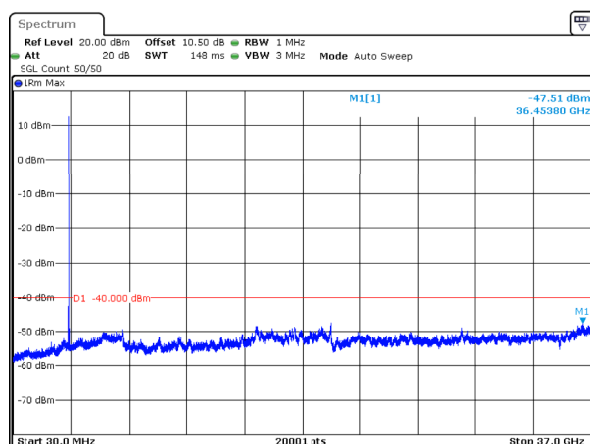


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:45:35

n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB128@0 -47.67dBm

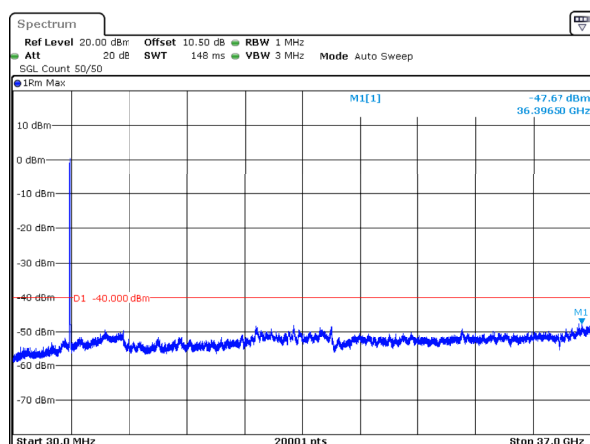


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:49:54

n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.90dBm

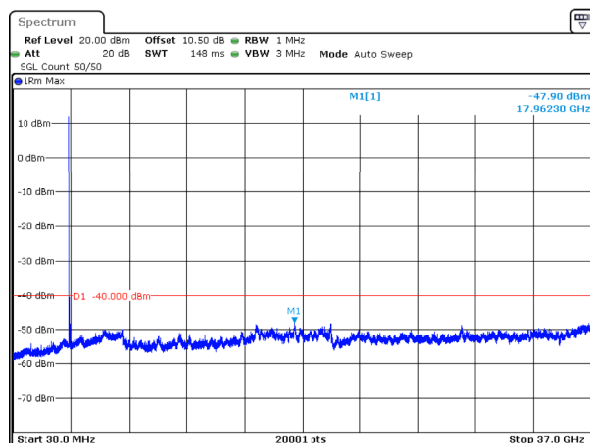


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:47:37

n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@132 -48.13dBm

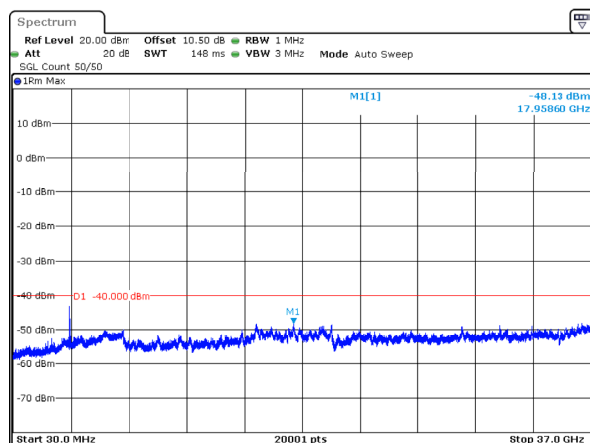


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:48:45

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0 -47.32dBm

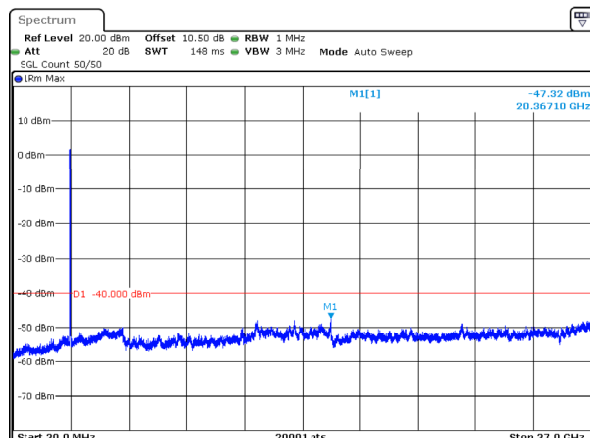


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:53:04

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@0 -47.85dBm

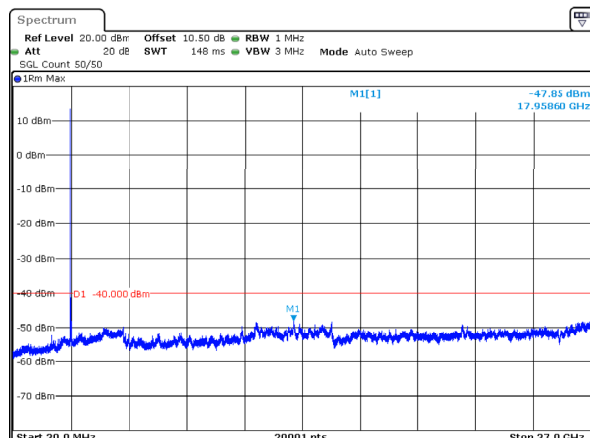


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:50:48

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132 -47.52dBm

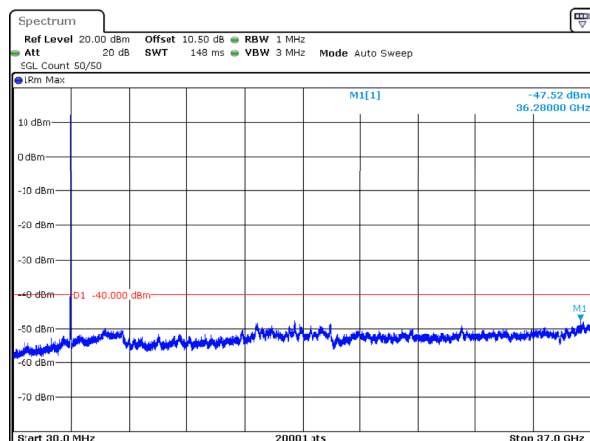


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:51:56

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0 -46.89dBm

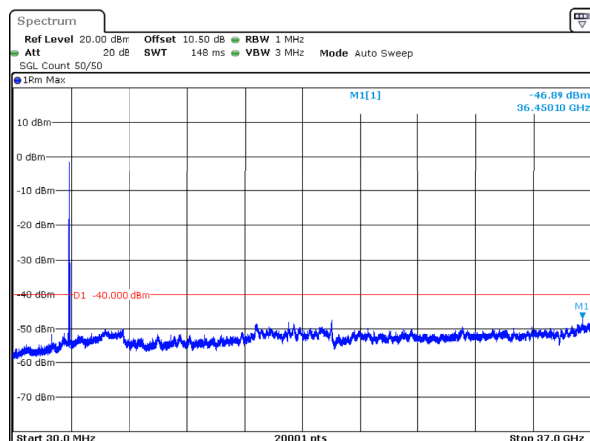


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:56:31

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0 -47.58dBm

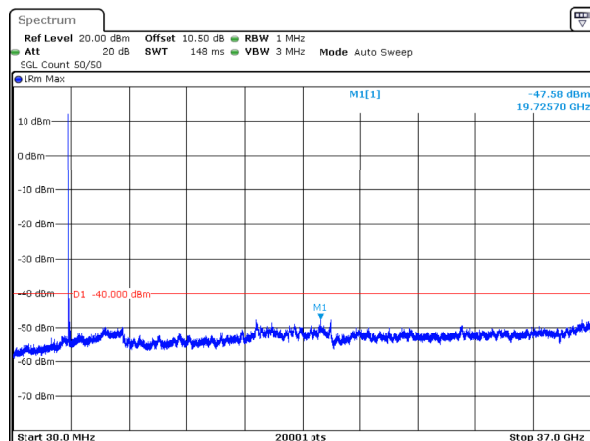


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:54:13

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@161 -47.83dBm

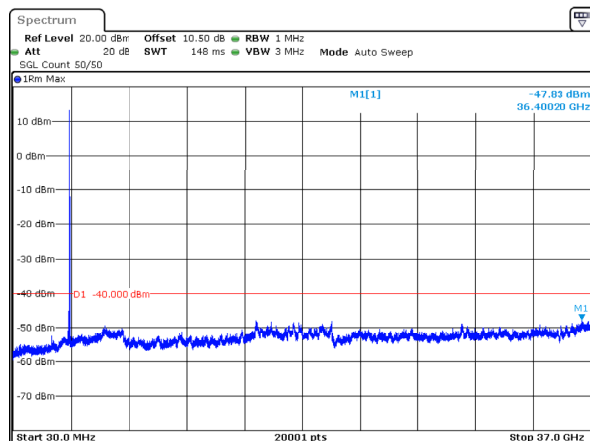


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:55:22

n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB162@0 -47.65dBm

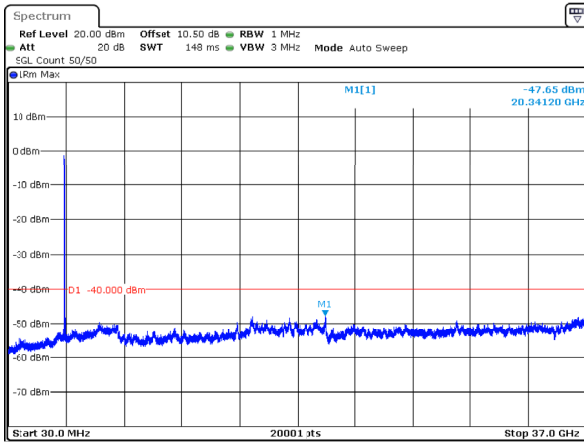


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:59:55

n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.80dBm

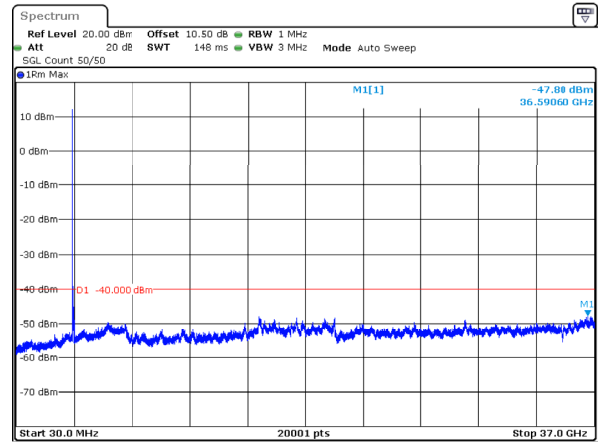


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:57:37

n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@161 -47.85dBm

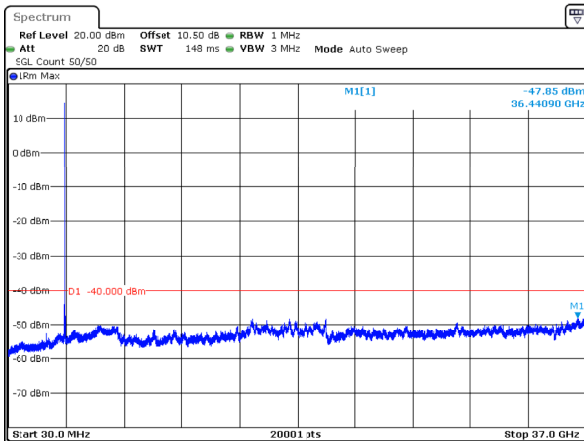


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 12:58:46

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0 -47.70dBm

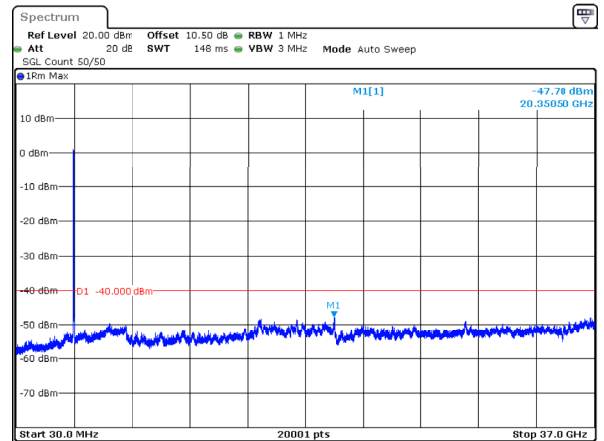


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:03:11

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@0 -47.51dBm

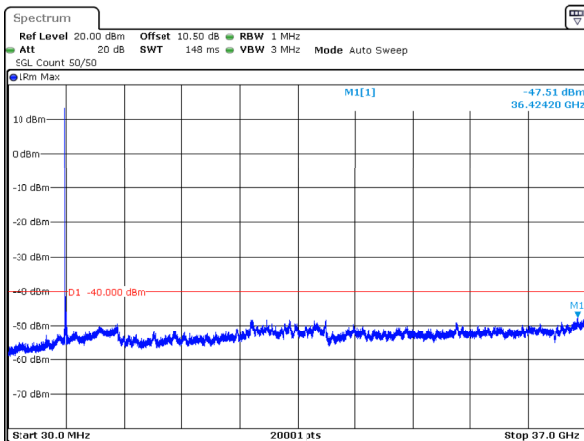


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:01:04

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161 -47.65dBm

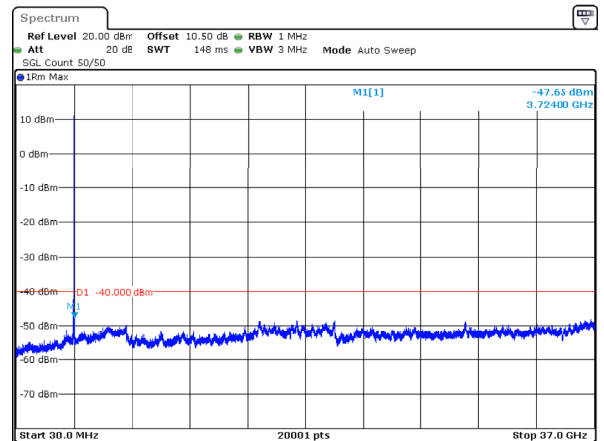


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:02:17

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0 -47.95dBm

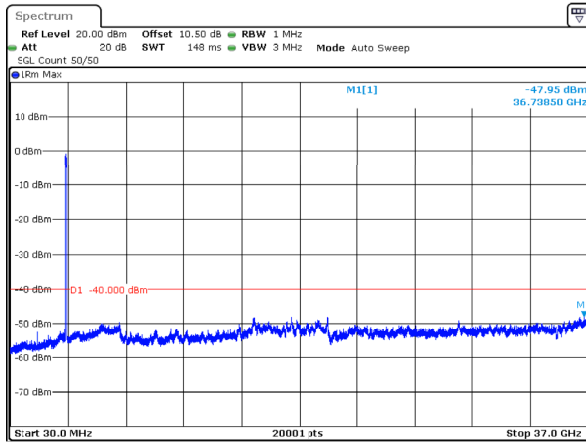


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:06:23

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0 -48.08dBm

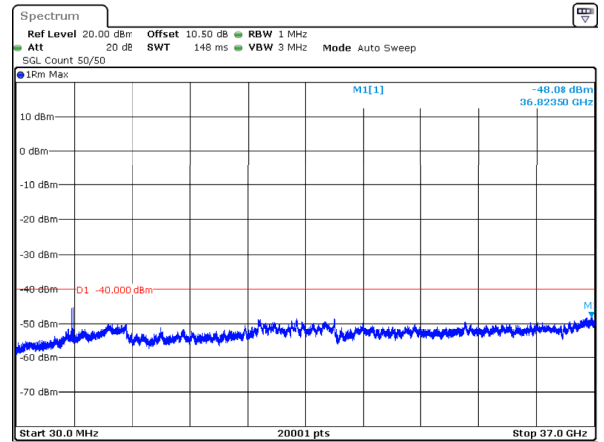


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:04:05

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@188 -48.44dBm

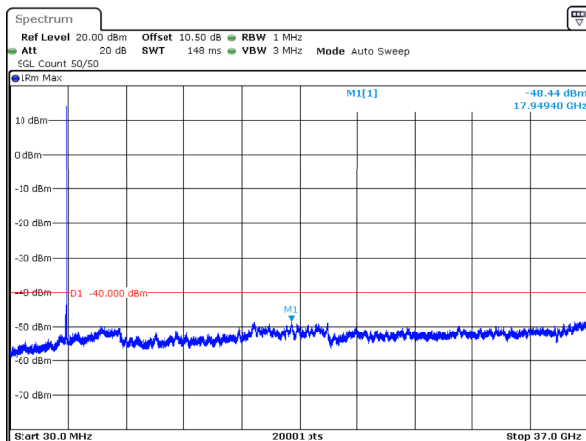


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:05:14

n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB180@0 -47.46dBm

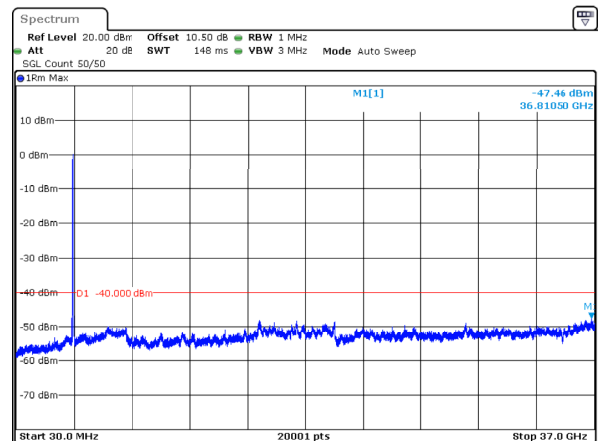


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:09:06

n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.35dBm

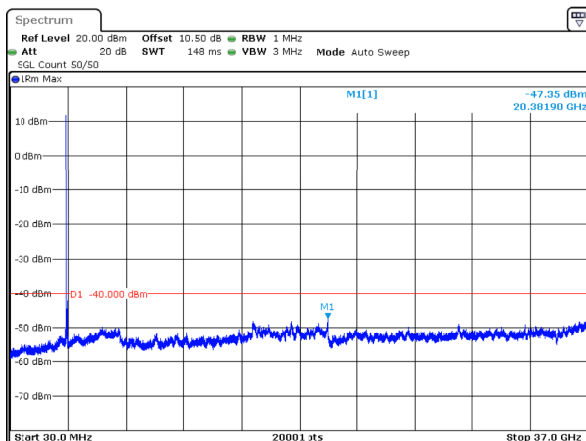


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:07:17

n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@188 -47.96dBm

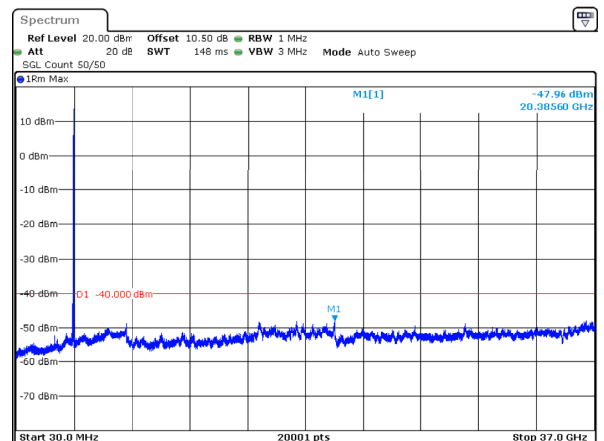


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:08:12

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0 -47.55dBm

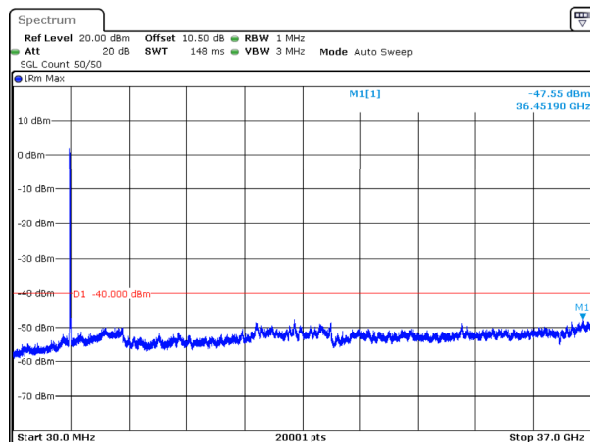


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:12:14

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@0 -47.30dBm

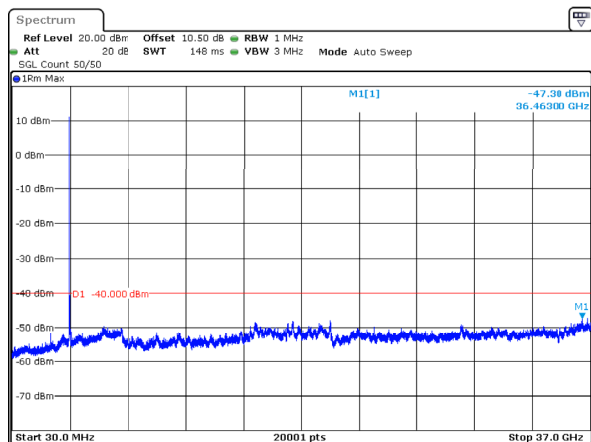


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:10:00

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188 -47.97dBm

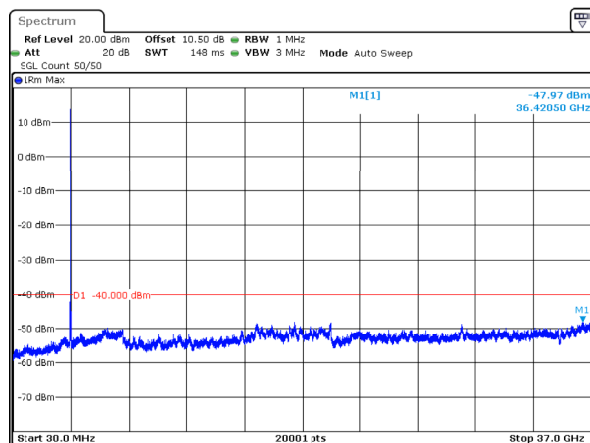


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:11:06

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@0 -47.74dBm

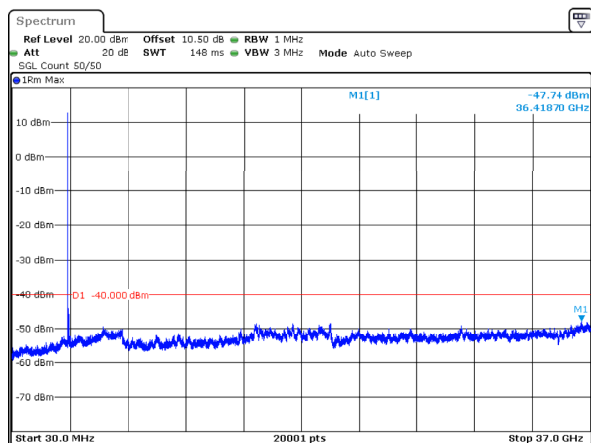


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:13:23

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@216 -47.83dBm

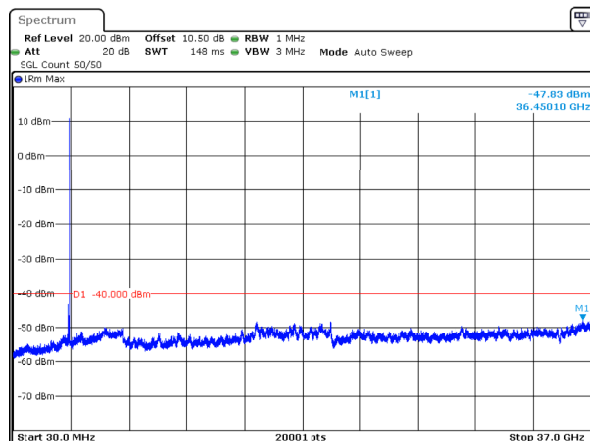


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:14:32

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0 -47.28dBm

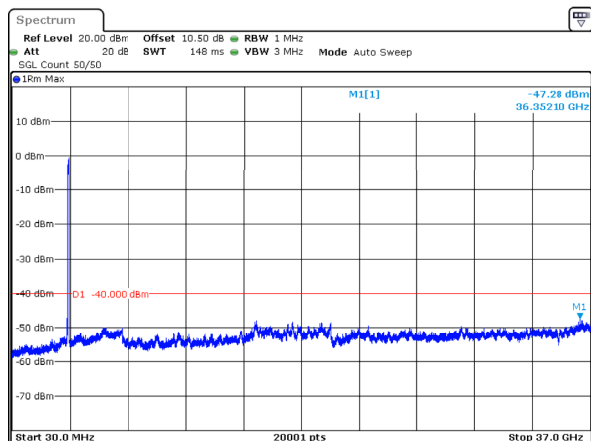


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:15:41

n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.02dBm

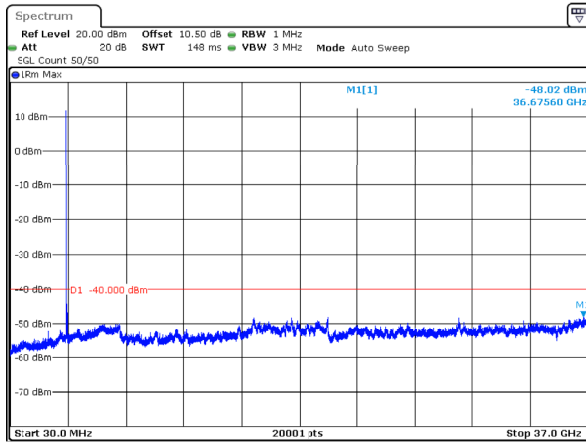


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:16:50

n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@216 -47.70dBm

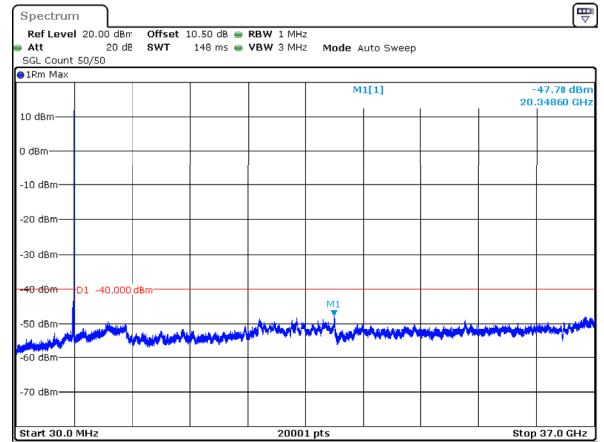


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:17:59

n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB216@0 -47.66dBm

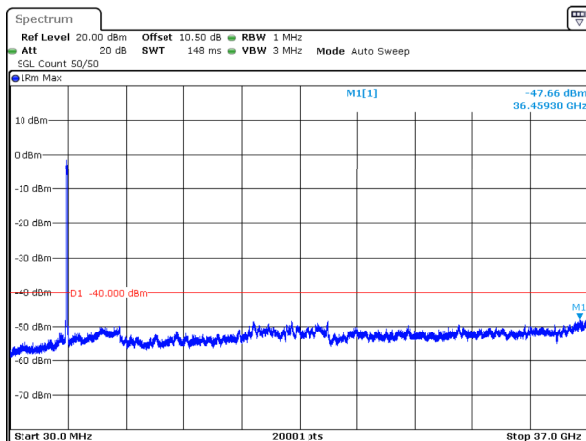


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:18:53

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@0 -47.20dBm

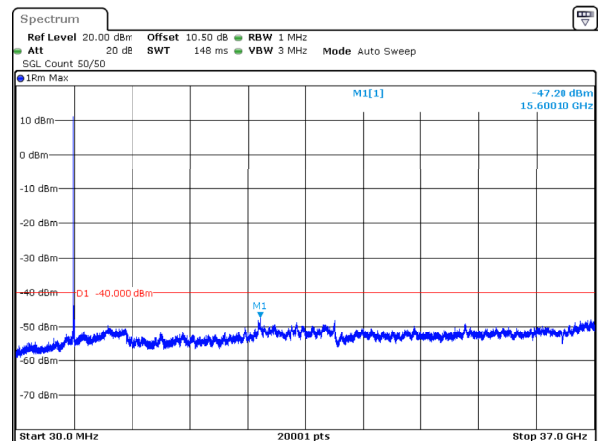


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:20:11

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216 -47.10dBm

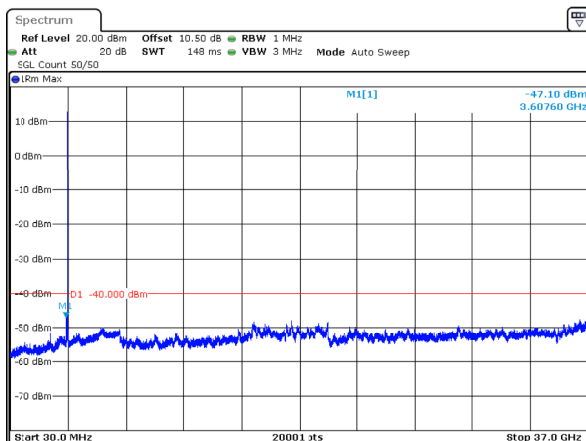


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:21:30

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0 -47.64dBm

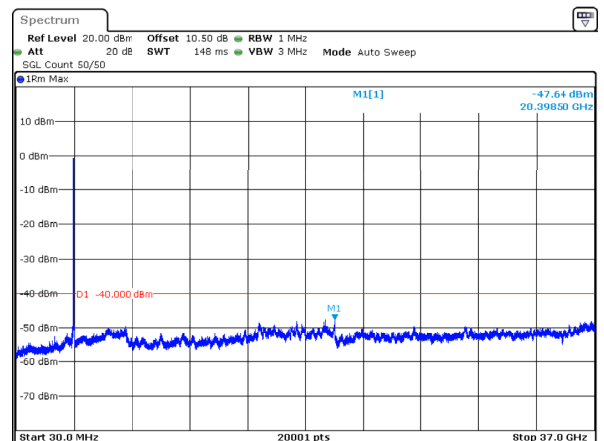


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:22:39

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@0 -47.97dBm

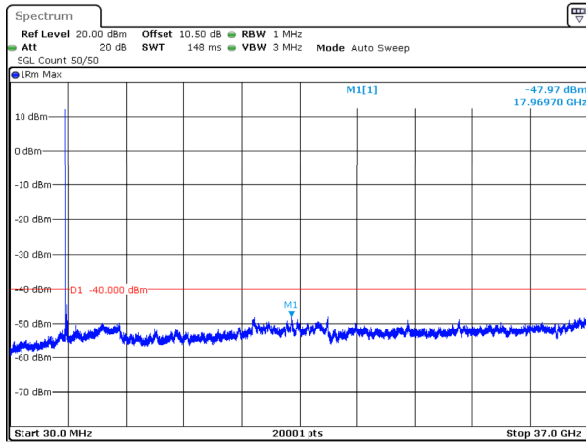


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:23:48

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@244 -47.99dBm

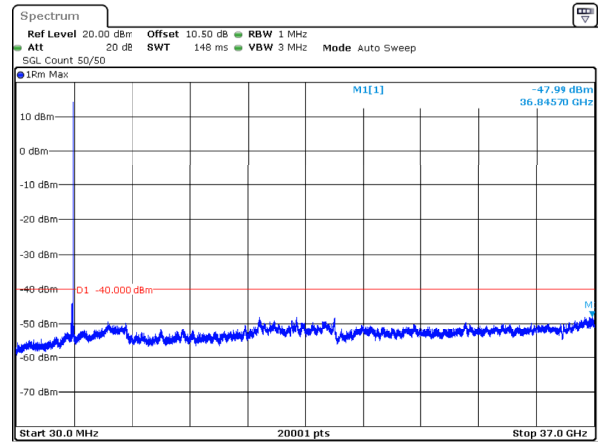


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:24:59

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0 -48.25dBm

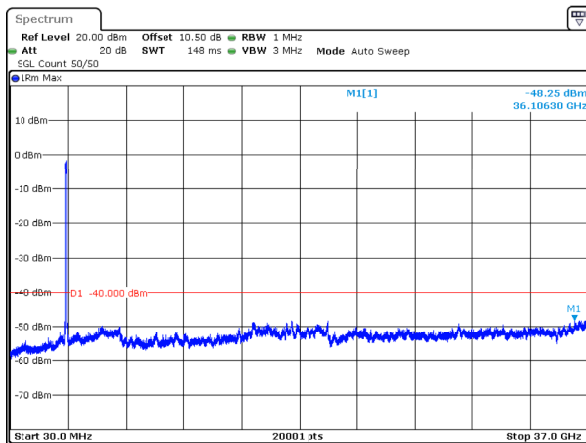


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:26:08

n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.08dBm

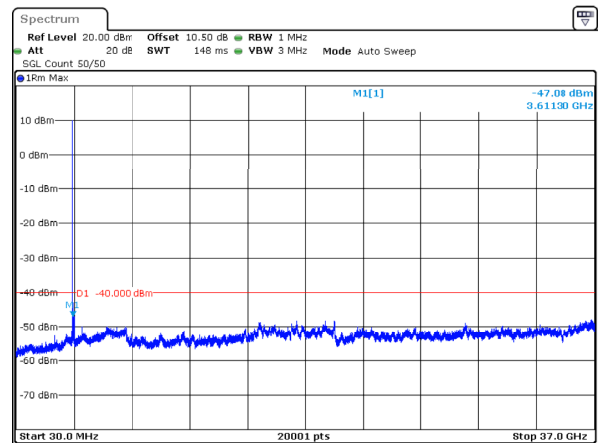


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:27:18

n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@244 -47.95dBm

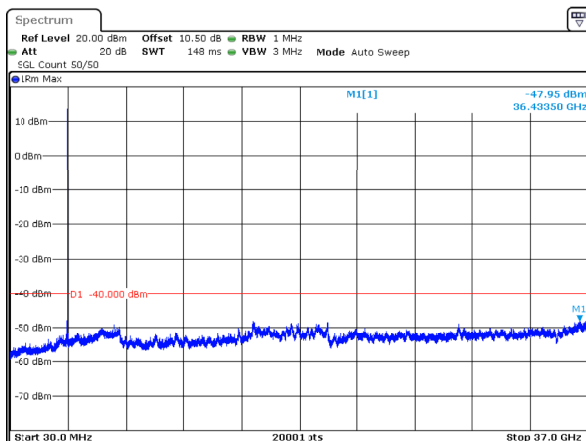


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:28:28

n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB243@0 -48dBm

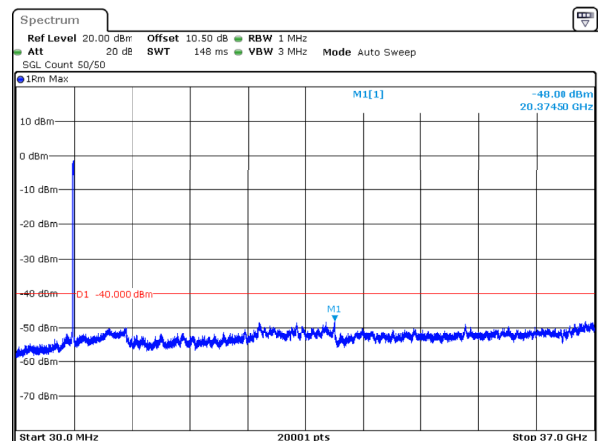


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:29:37

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@0 -47.42dBm

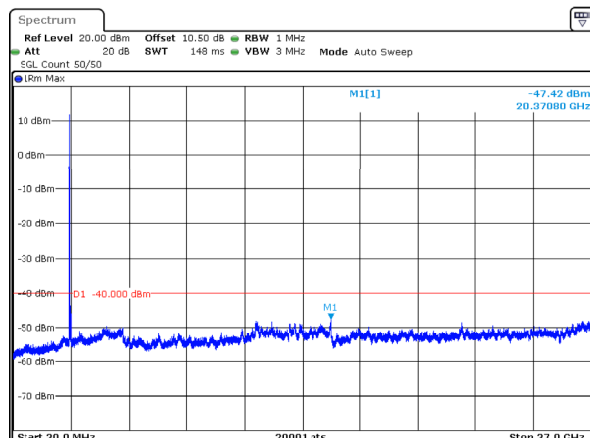


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:30:47

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244 -48.16dBm

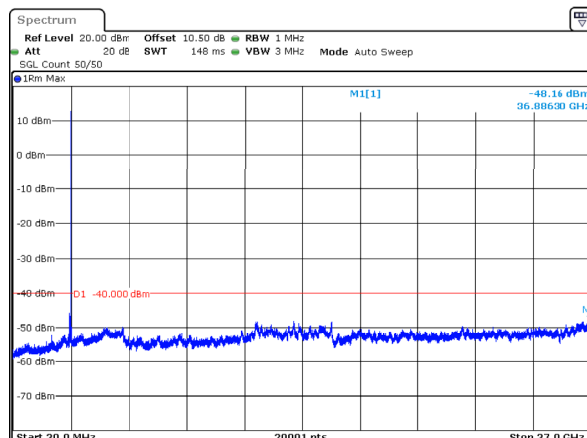


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:31:58

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0 -48.08dBm

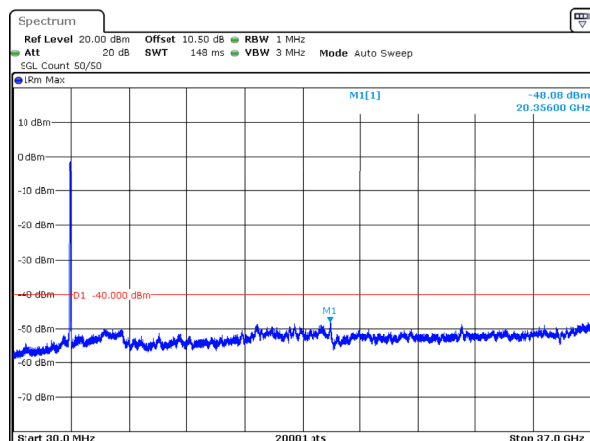


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:33:07

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@0 -47.86dBm

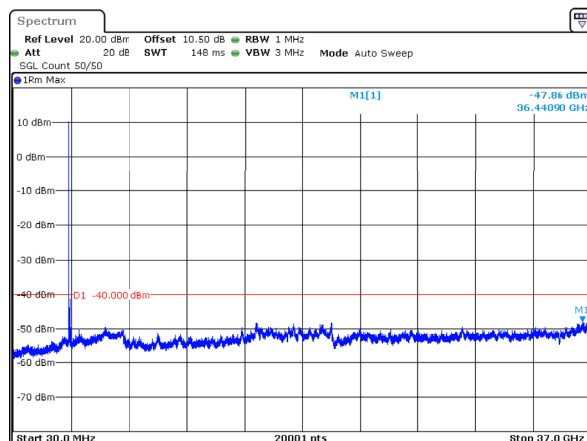


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:34:17

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@272 -47.55dBm

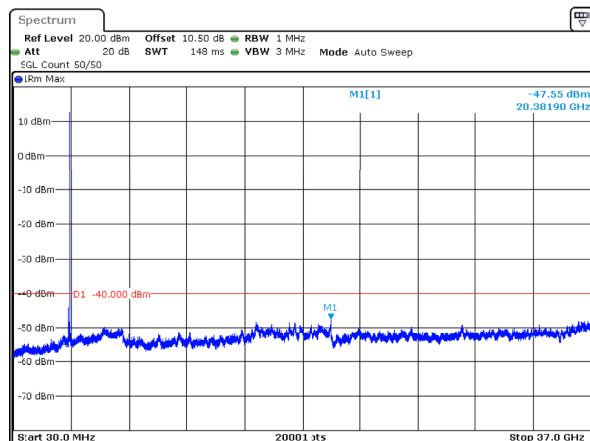


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:35:27

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0 -47.99dBm

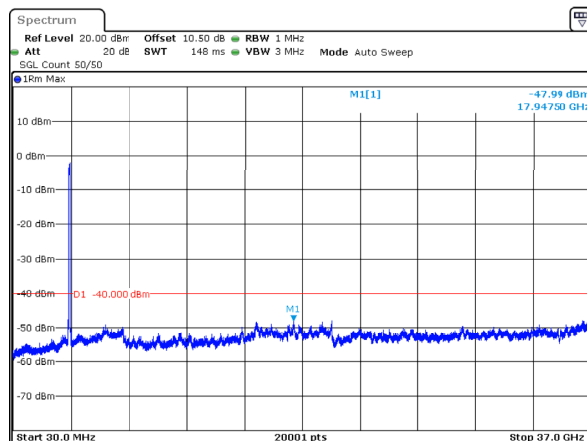


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:36:36

n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.68dBm

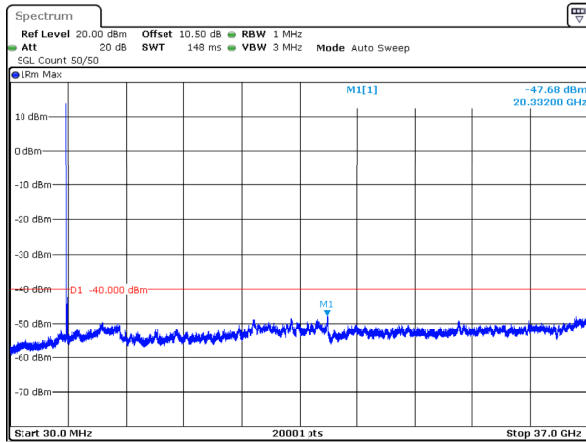


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:37:46

n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@272 -48.18dBm

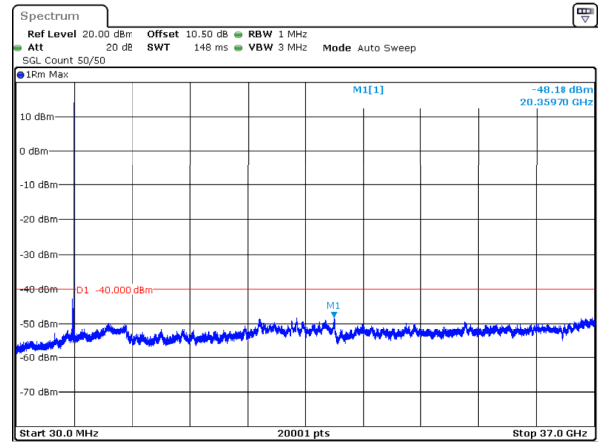


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:38:59

n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB270@0 -47.80dBm

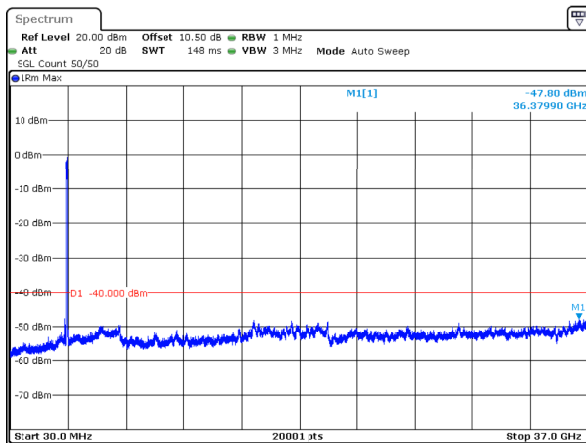


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:40:08

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@0 -47.59dBm

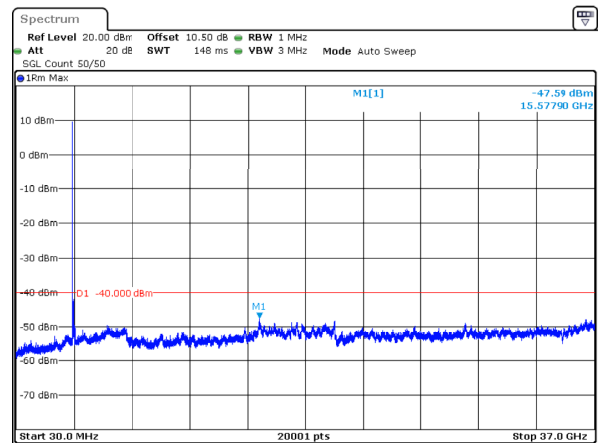


ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:41:19

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272 -47.40dBm

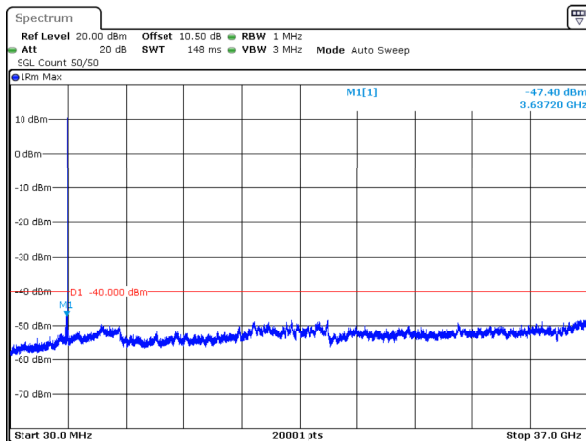

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:42:32

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0 -48.20dBm

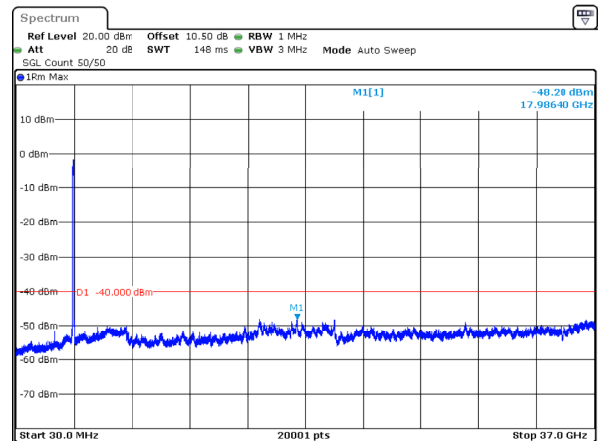

ProjectNo.:2401U81808E-RF Tester:Jim Cheng
Date: 1.AUG.2024 13:43:41