



Intertek Testing Services

ETL SEMKO

Report No.: 9909712

Tested By: Hong, Report No.: 9909712


Scan Settings (1 Range)

Frequencies				Receiver Settings			
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF 60dB

Final Measurement: x QP

Meas Time: 1 s
Subranges: 16
Acc Margin: 20dB

Transducer No.	Start	Stop	Name
3	9k	30M	EI078

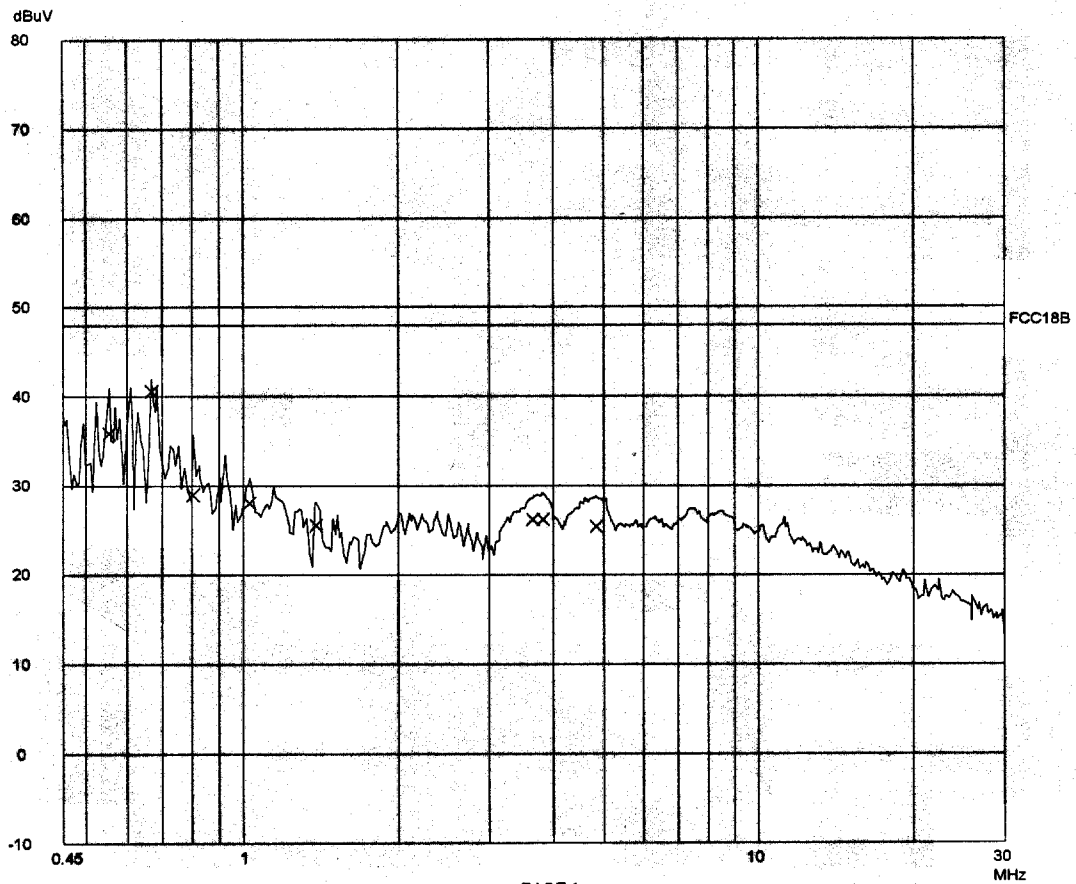

PAGE 1

Ctrl No.: NA



Intertek Testing Services

ETL SEMKO

Report No.: 9909712

Tested By: Hong, Report No.: 9909712

Scan Settings (1 Range)

Frequencies				Receiver Settings			
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF 60dB

Final Measurement Results:

Frequency	QP Level	QP Limit
MHz	dBuV	dBuV
0.55500	35.7	48.0
0.67000	40.5	48.0
0.80500	28.9	48.0
1.03500	28.0	48.0
1.38500	25.5	48.0
3.65500	26.2	48.0
3.82000	26.2	48.0
4.85000	25.3	48.0

* limit exceeded