




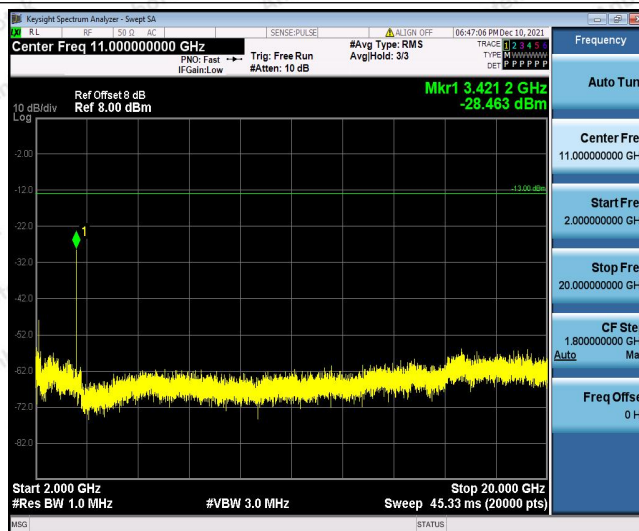

Band4-10MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

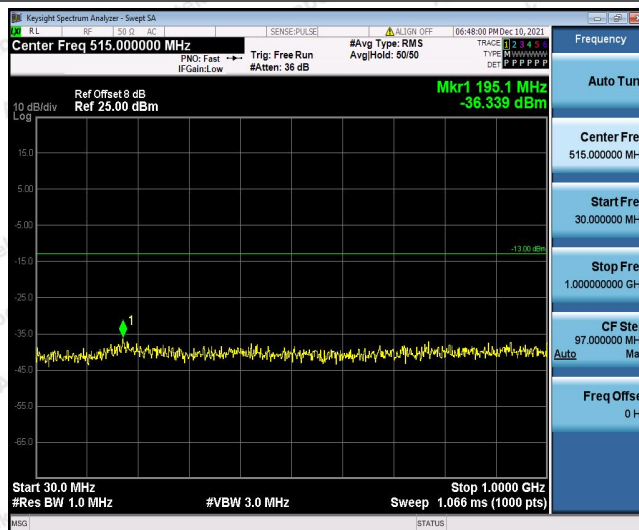

Band4-10MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

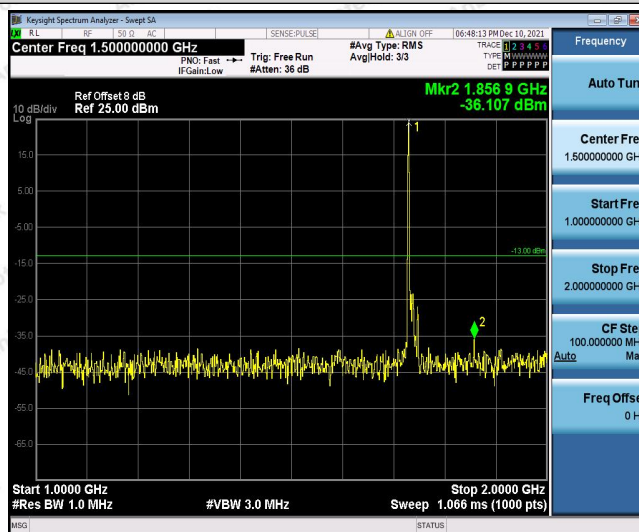


Band4-10MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

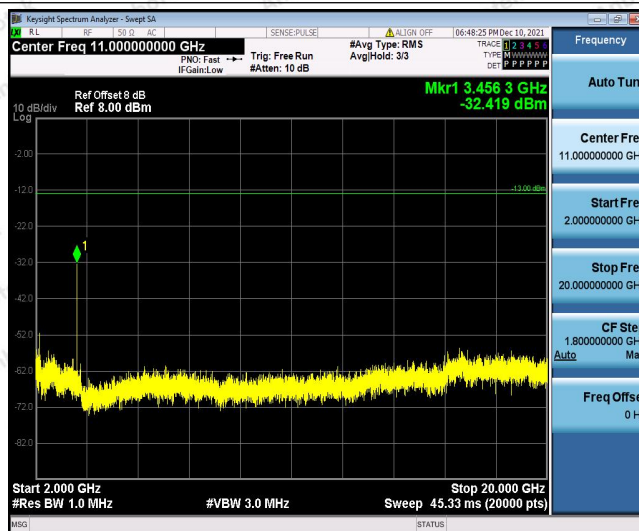

Band4-10MHz-16QAM-20350-1RB#0-Range1:30~1000MHz

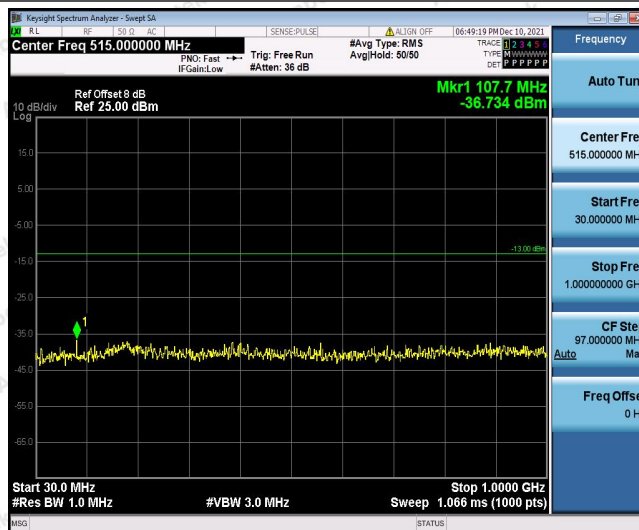

Band4-10MHz-16QAM-20350-1RB#0-Range2:1000~2000MHz

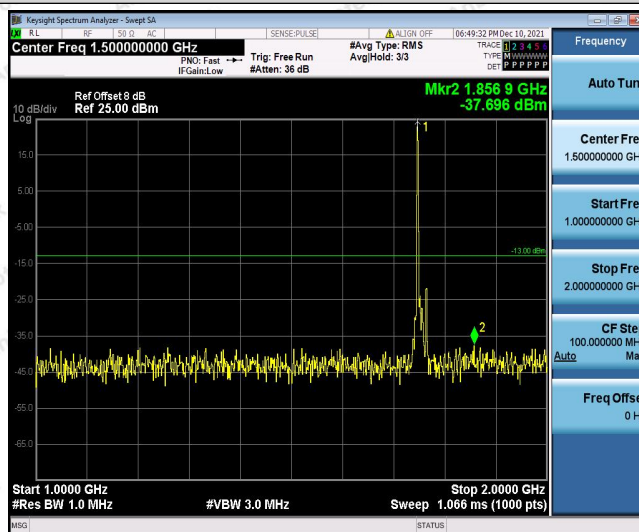


Band4-10MHz-16QAM-20350-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

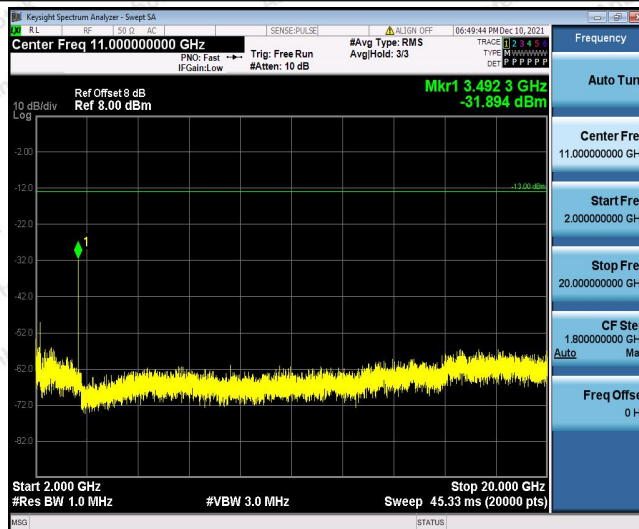


Band4-15MHz-QPSK-20025-1RB#0-Range1:30~1000MHz

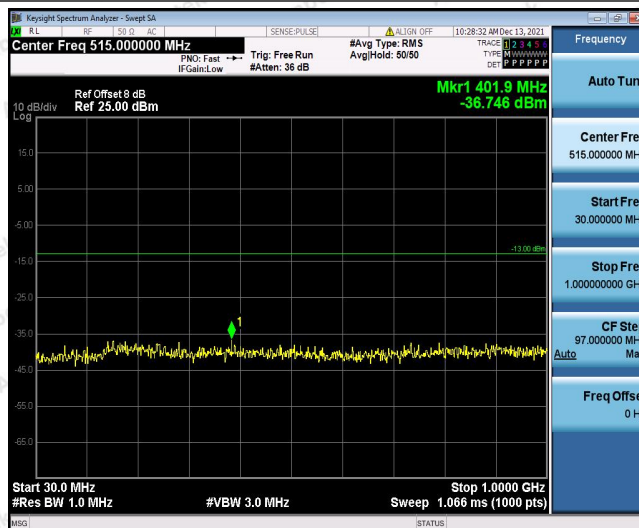


Band4-15MHz-QPSK-20025-1RB#0-Range2:1000~2000MHz

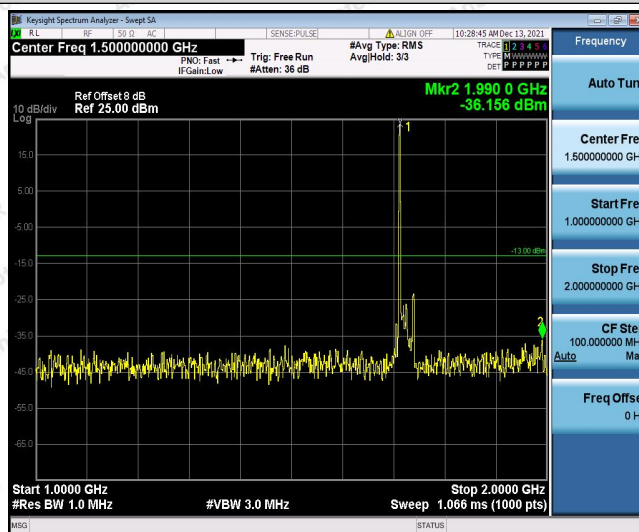


Band4-15MHz-QPSK-20025-1RB#0-Range3:2000~20000MHz

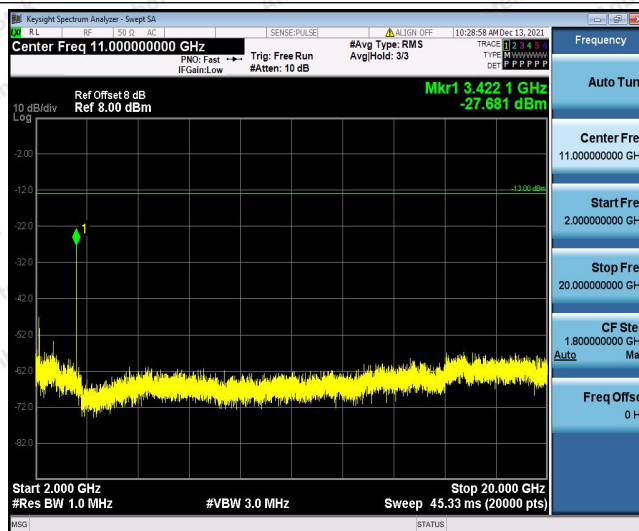

Band4-15MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

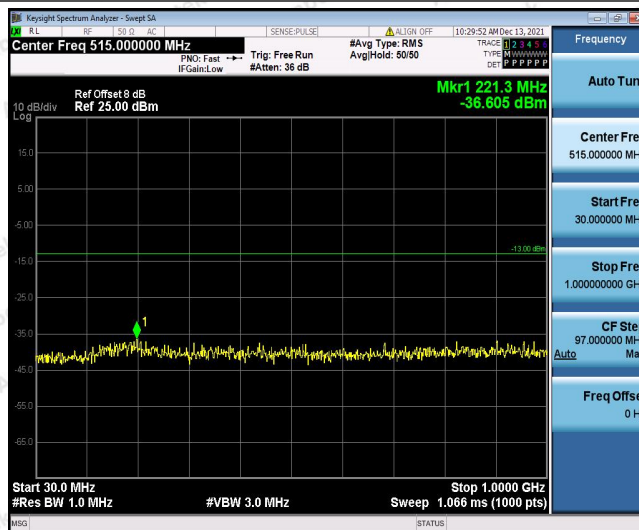

Band4-15MHz-QPSK-20175-1RB#0-Range2:1000~2000MHz

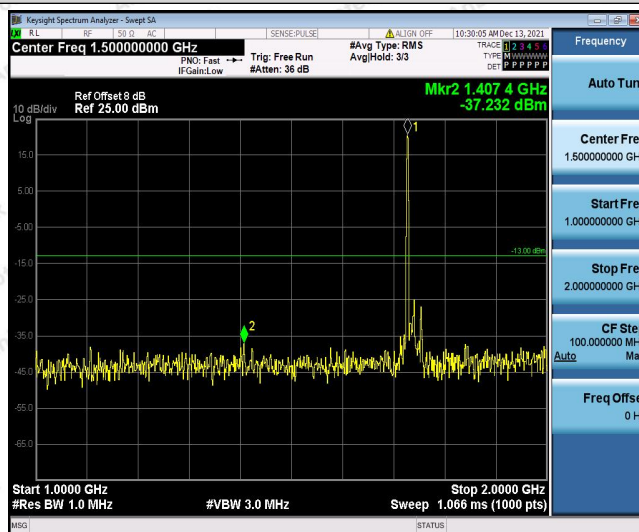

Band4-15MHz-QPSK-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

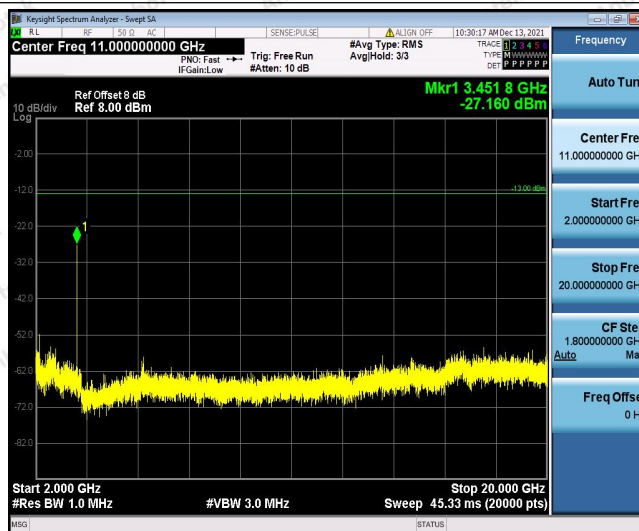


Band4-15MHz-QPSK-20325-1RB#0-Range1:30~1000MHz

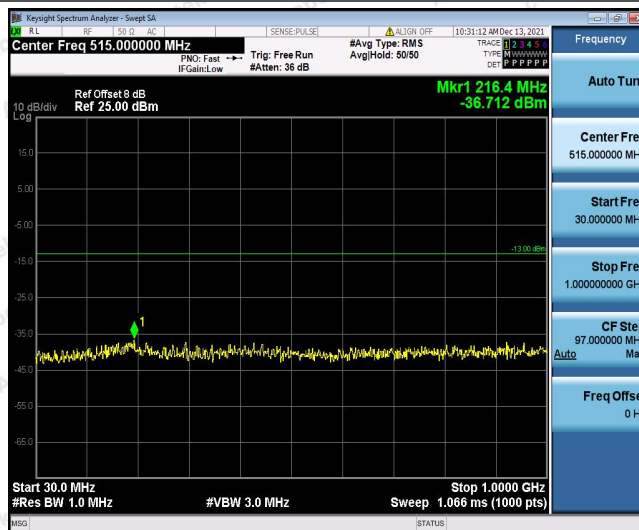


Band4-15MHz-QPSK-20325-1RB#0-Range2:1000~2000MHz

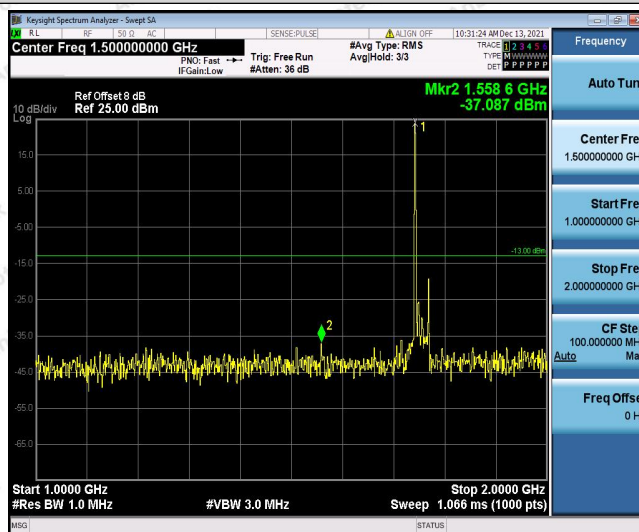


Band4-15MHz-QPSK-20325-1RB#0-Range3:2000~20000MHz

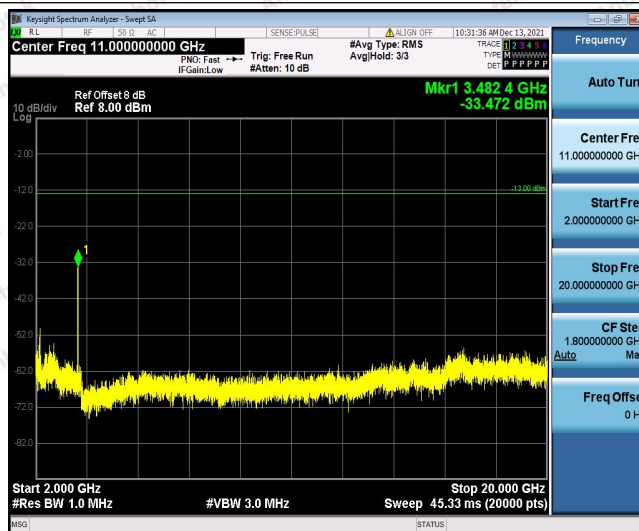

Band4-15MHz-16QAM-20025-1RB#0-Range1:30~1000MHz

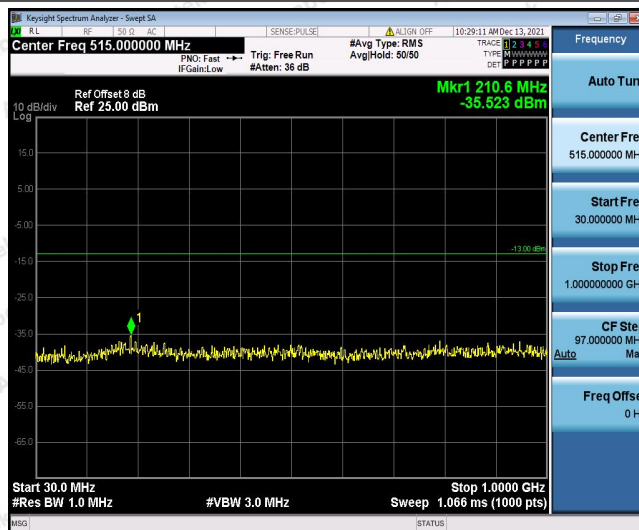

Band4-15MHz-16QAM-20025-1RB#0-Range2:1000~2000MHz

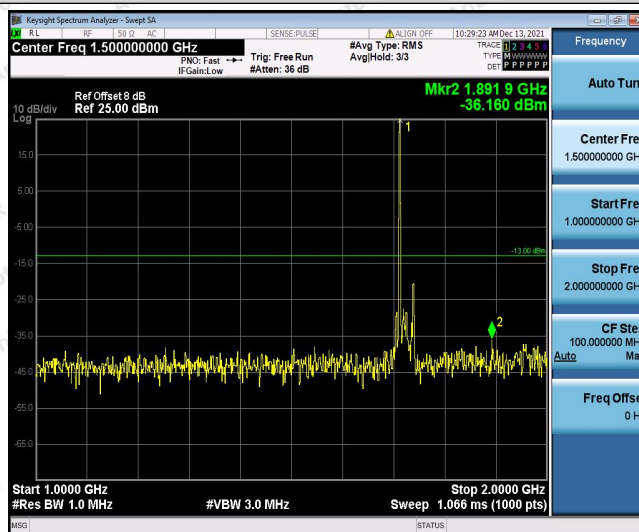


Band4-15MHz-16QAM-20025-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

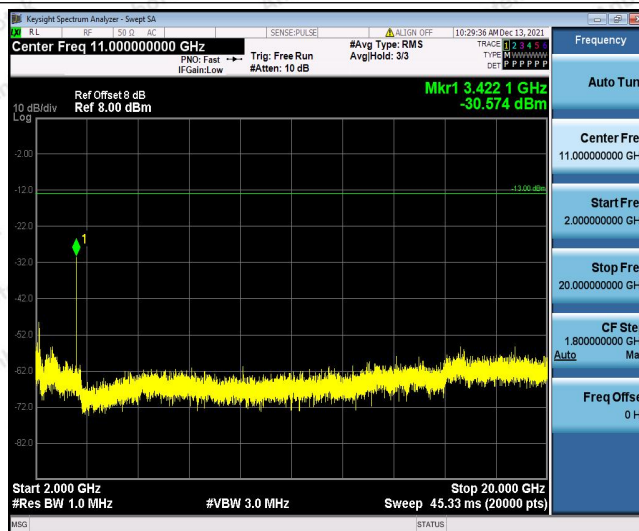

Band4-15MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

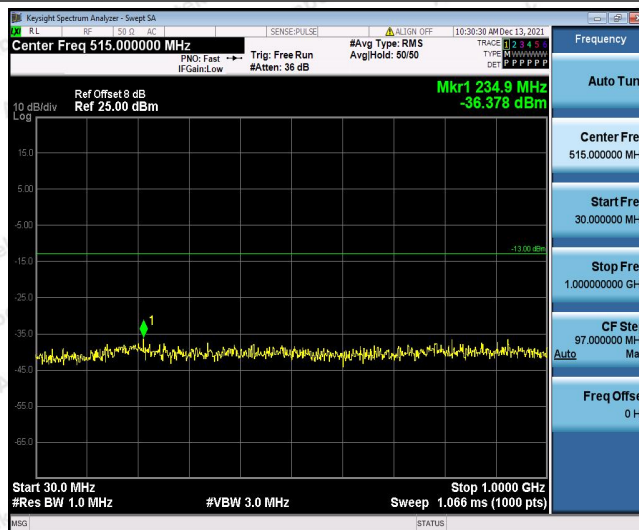

Band4-15MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

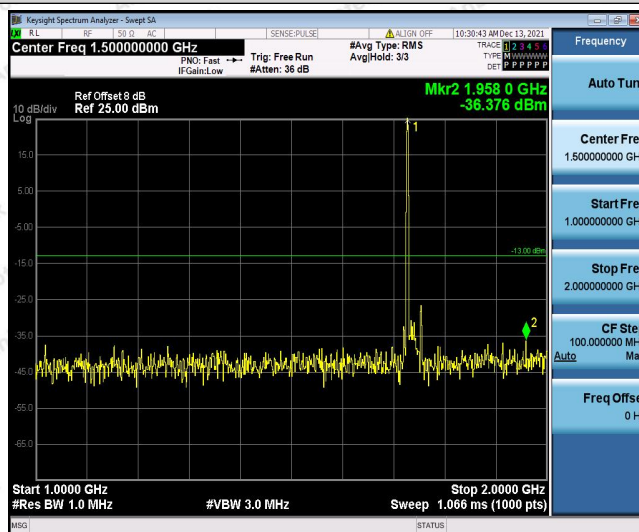


Band4-15MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

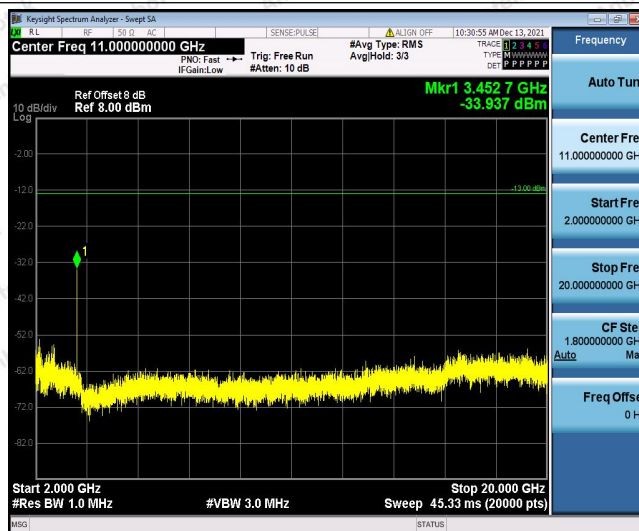

Band4-15MHz-16QAM-20325-1RB#0-Range1:30~1000MHz

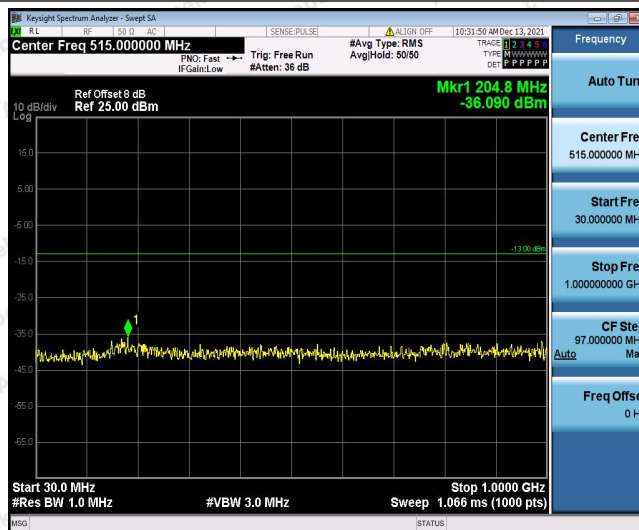

Band4-15MHz-16QAM-20325-1RB#0-Range2:1000~2000MHz

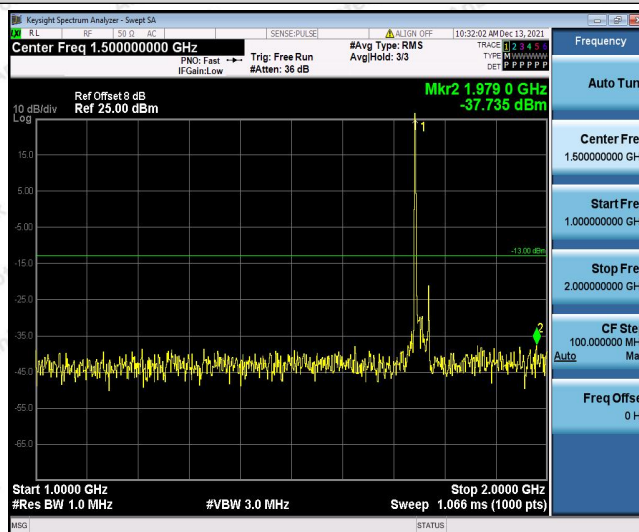


Band4-15MHz-16QAM-20325-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

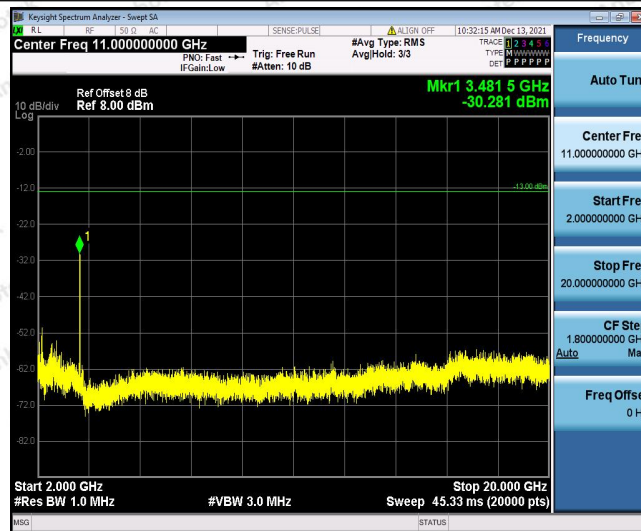

Band4-20MHz-QPSK-20050-1RB#0-Range1:30~1000MHz

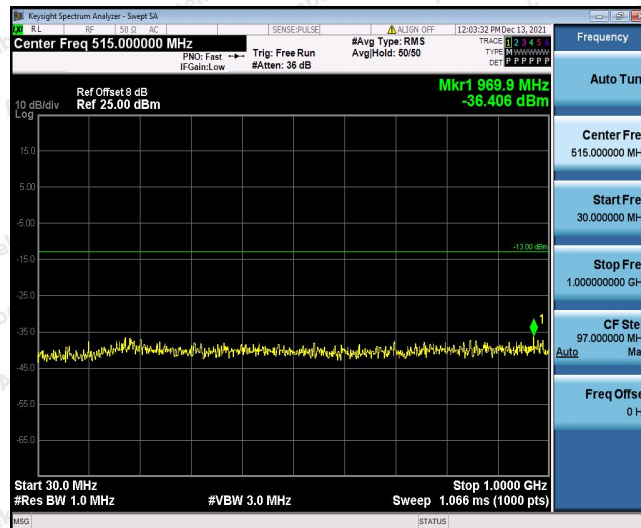

Band4-20MHz-QPSK-20050-1RB#0-Range2:1000~2000MHz

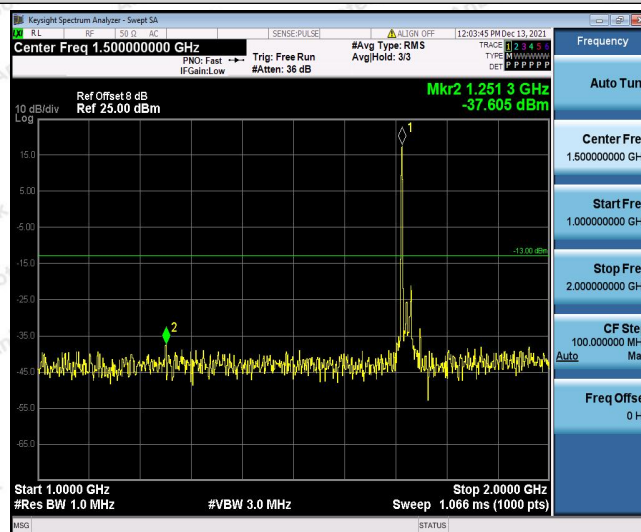


Band4-20MHz-QPSK-20050-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

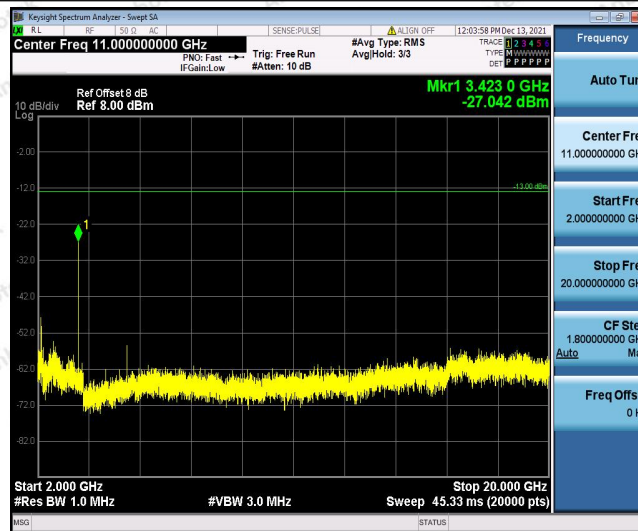

Band4-20MHz-QPSK-20175-1RB#0-Range1:30~1000MHz

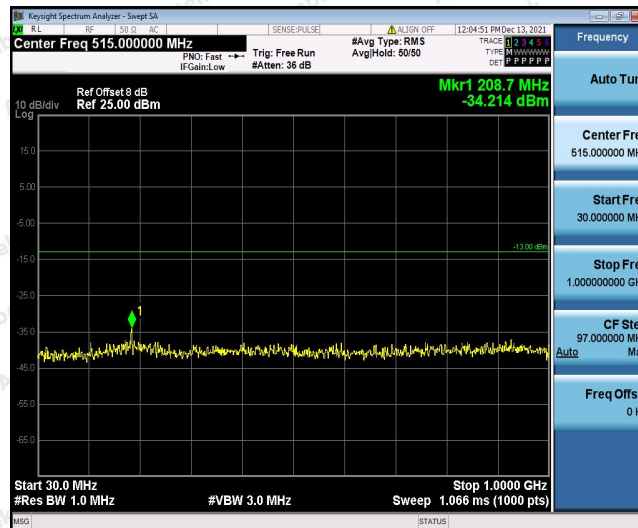

Band4-20MHz-QPSK-20175-1RB#0-Range2:1000~2000MHz

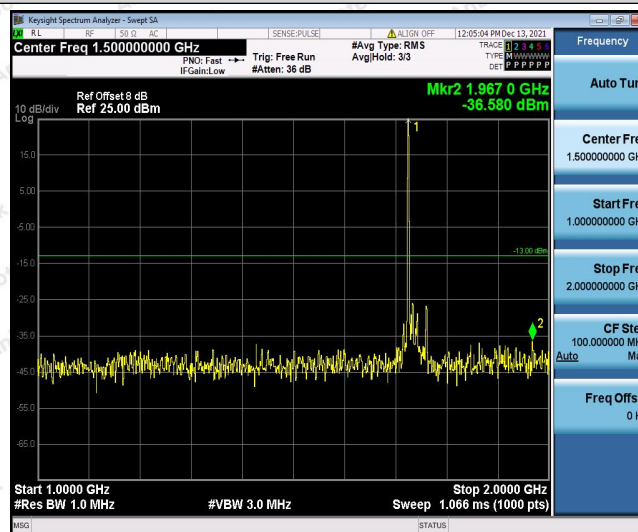


Band4-20MHz-QPSK-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

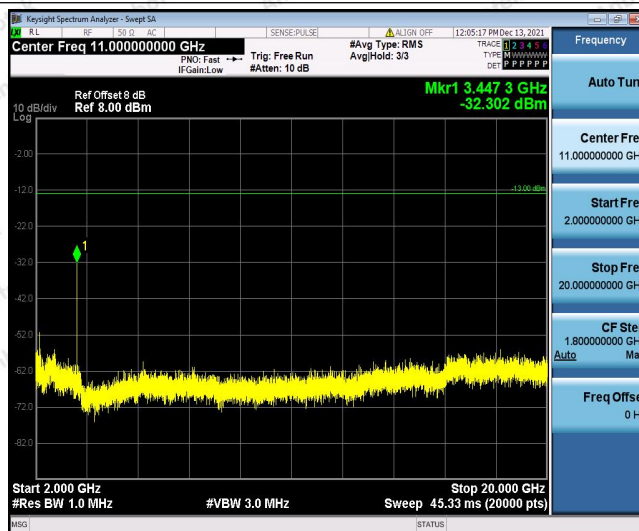

Band4-20MHz-QPSK-20300-1RB#0-Range1:30~1000MHz

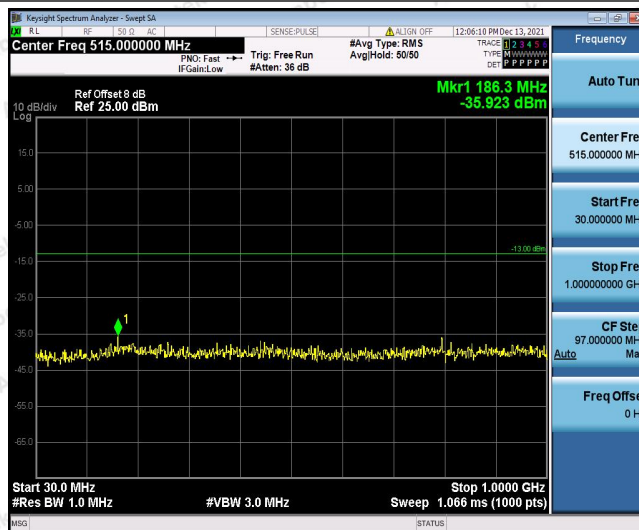

Band4-20MHz-QPSK-20300-1RB#0-Range2:1000~2000MHz

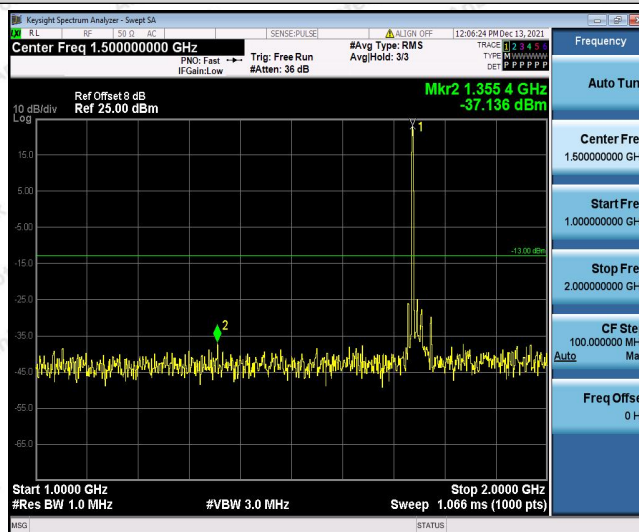


Band4-20MHz-QPSK-20300-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

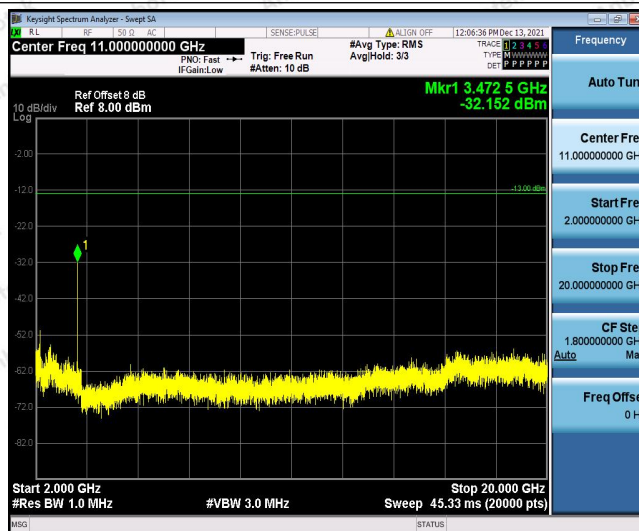


Band4-20MHz-16QAM-20050-1RB#0-Range1:30~1000MHz

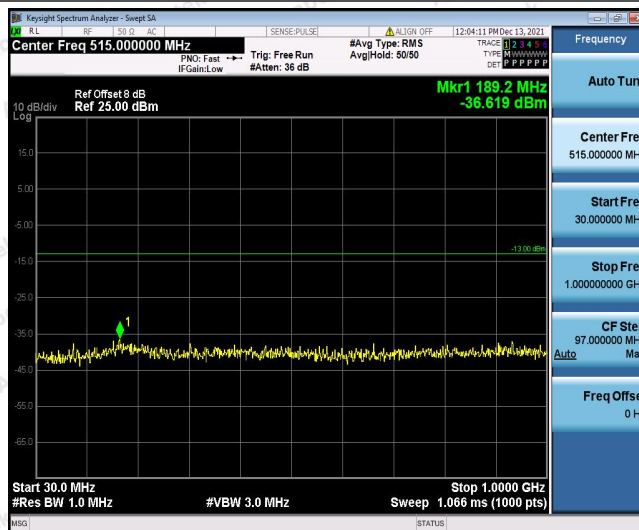


Band4-20MHz-16QAM-20050-1RB#0-Range2:1000~2000MHz

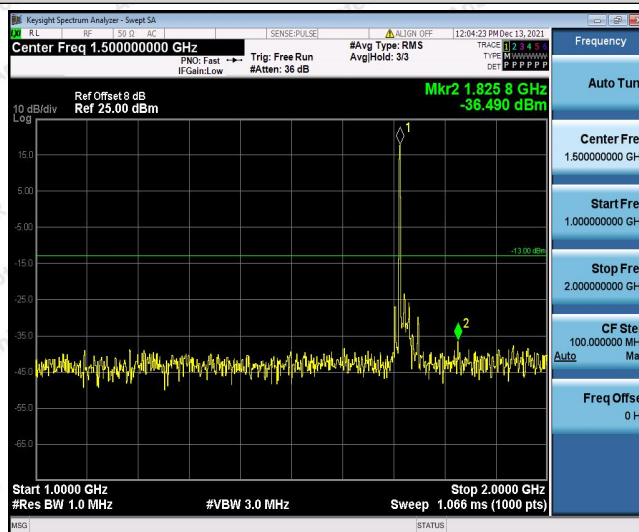


Band4-20MHz-16QAM-20050-1RB#0-Range3:2000~20000MHz

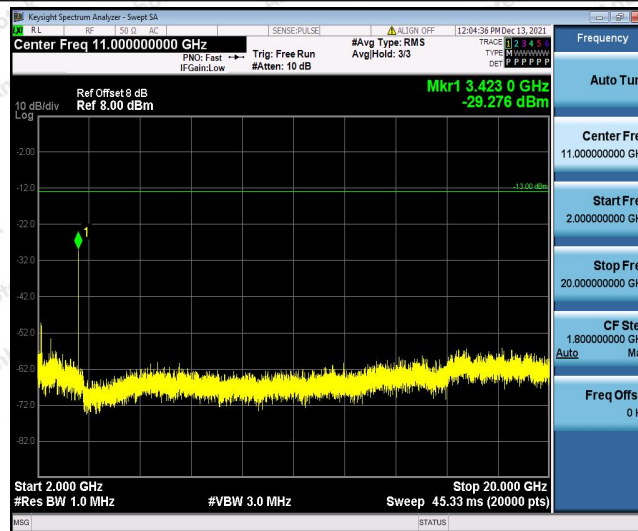

Band4-20MHz-16QAM-20175-1RB#0-Range1:30~1000MHz

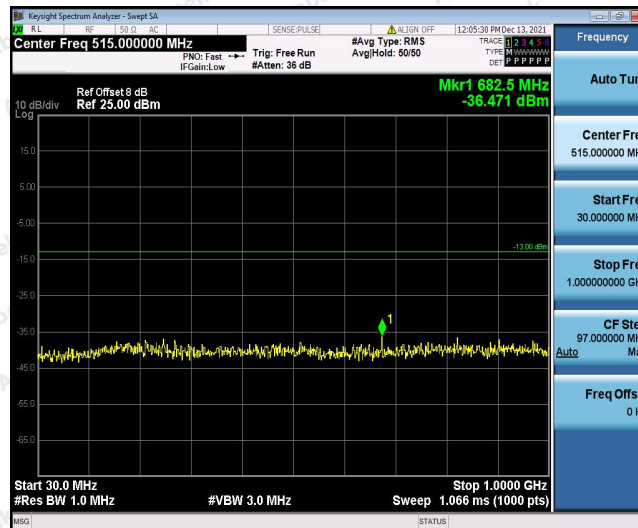

Band4-20MHz-16QAM-20175-1RB#0-Range2:1000~2000MHz

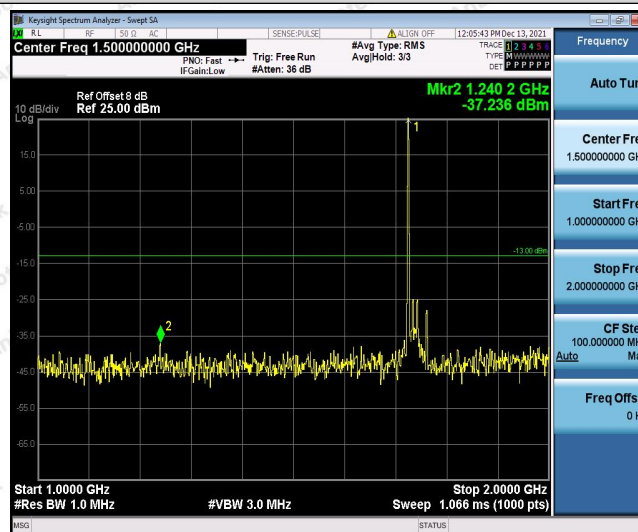


Band4-20MHz-16QAM-20175-1RB#0-Range3:2000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

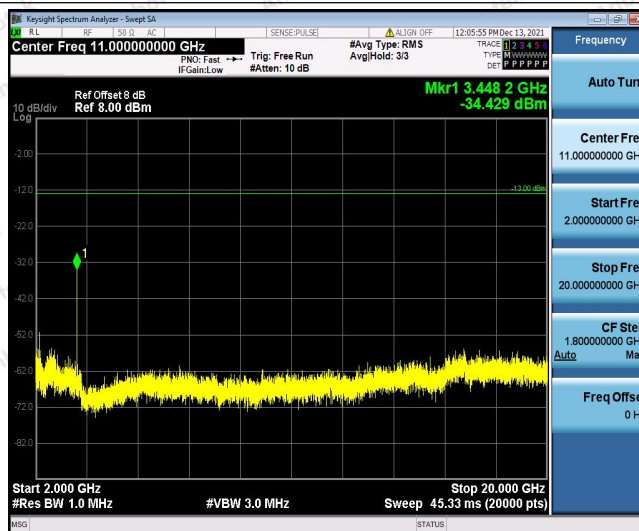


Band4-20MHz-16QAM-20300-1RB#0-Range1:30~1000MHz

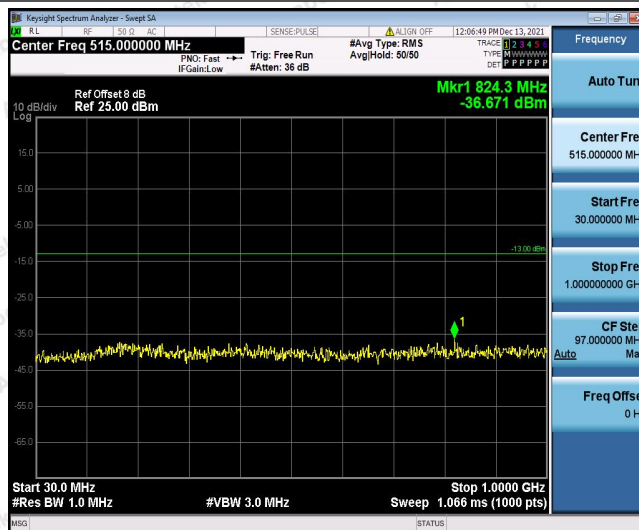

Band4-20MHz-16QAM-20300-1RB#0-Range2:1000~2000MHz

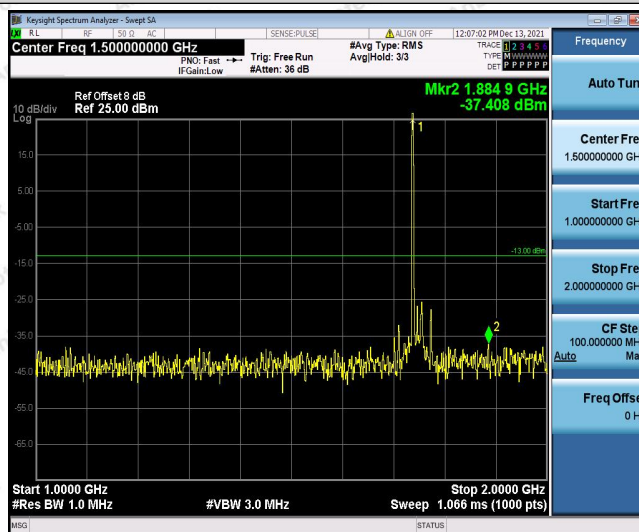

Band4-20MHz-16QAM-20300-1RB#0-Range3:2000~20000MHz

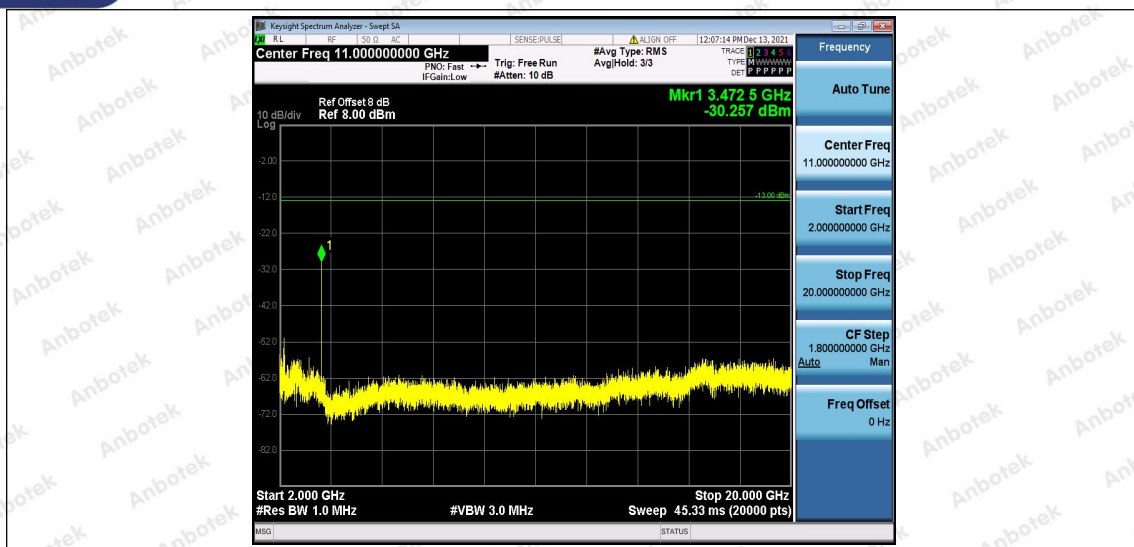

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	-16.04	-0.009376	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	-13.58	-0.007938	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	-11.34	-0.006629	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-10.99	-0.006343	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	-8.94	-0.005160	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	-7.41	-0.004277	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	-13.05	-0.007439	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	-21.80	-0.012427	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	-6.05	-0.003449	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	-23.15	-0.013532	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	-4.09	-0.002391	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	-11.56	-0.006757	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	-12.09	-0.006978	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	-17.74	-0.010240	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	-16.89	-0.009749	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	-6.75	-0.003848	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	-14.93	-0.008511	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	-6.31	-0.003597	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	-14.53	-0.008490	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	-18.08	-0.010564	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	-14.35	-0.008384	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	-5.76	-0.003325	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	-18.27	-0.010545	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	-12.09	-0.006978	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	-13.25	-0.007556	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	-19.51	-0.011126	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	-9.90	-0.005646	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	6.21	0.003628	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	-5.89	-0.003441	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	-10.00	-0.005843	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	-10.46	-0.006038	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	-14.08	-0.008127	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	-12.96	-0.007481	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VL	NT	-15.58	-0.008885	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band4	3MHz	16QAM	20385	15RB#0	VN	NT	-12.79	-0.007294	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	-15.46	-0.008817	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	-13.06	-0.007626	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	-12.70	-0.007416	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	-12.85	-0.007504	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	-2.83	-0.001633	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	-10.27	-0.005928	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	-12.50	-0.007215	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	-16.01	-0.009136	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	7.10	0.004051	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	-17.34	-0.009894	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	-14.26	-0.008327	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	-10.66	-0.006225	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	-7.08	-0.004134	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	-17.32	-0.009997	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	-13.80	-0.007965	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	-5.48	-0.003163	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	-16.19	-0.009238	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	-21.10	-0.012040	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	-9.51	-0.005427	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	-11.04	-0.006437	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	-10.96	-0.006391	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	-2.26	-0.001318	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	-8.20	-0.004733	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	7.65	0.004416	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	-6.59	-0.003804	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	-18.87	-0.010783	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	-10.76	-0.006149	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	-5.08	-0.002903	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	-14.75	-0.008601	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	-12.59	-0.007341	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	-9.30	-0.005423	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	5.04	0.002909	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	-6.17	-0.003561	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	-19.33	-0.011157	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	-18.41	-0.010520	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	-14.10	-0.008057	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	-10.87	-0.006211	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	-11.62	-0.006766	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	-9.34	-0.005438	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	VH	NT	-2.76	-0.001607	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	15MHz	QPSK	20175	75RB#0	VL	NT	-11.69	-0.006747	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	-14.18	-0.008185	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	-13.18	-0.007608	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	11.00	0.006295	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	-19.18	-0.010976	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	-9.61	-0.005499	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	-4.25	-0.002475	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	-13.98	-0.008140	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	-4.41	-0.002568	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	-12.43	-0.007175	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	9.61	0.005547	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	-17.29	-0.009980	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	-12.77	-0.007308	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	-18.20	-0.010415	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	-11.04	-0.006318	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VL	NT	-14.06	-0.008174	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VN	NT	-3.69	-0.002145	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	VH	NT	-9.73	-0.005657	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	-20.10	-0.011602	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	-14.92	-0.008612	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	-13.39	-0.007729	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VL	NT	12.36	0.007083	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VN	NT	-14.22	-0.008149	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	VH	NT	-17.02	-0.009754	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VL	NT	-11.97	-0.006959	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VN	NT	-17.60	-0.010233	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	VH	NT	-8.41	-0.004890	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VL	NT	-19.76	-0.011405	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VN	NT	13.86	0.008000	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	VH	NT	-9.88	-0.005703	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VL	NT	-7.97	-0.004567	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VN	NT	-15.26	-0.008745	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	VH	NT	-8.54	-0.004894	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix G: Frequency Stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	-3.40	-0.001987	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	-8.71	-0.005091	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	-12.69	-0.007418	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	-10.61	-0.006202	±2.5	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	4.84	0.002829	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	-4.28	-0.002470	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	8.30	0.004791	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	-18.20	-0.010505	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	8.21	0.004739	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	4.86	0.002805	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	-7.20	-0.004104	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	-5.99	-0.003414	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	-15.96	-0.009098	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	-14.53	-0.008283	±2.5	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	-6.07	-0.003460	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	-5.56	-0.003250	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	5.81	0.003396	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	3.71	0.002169	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	-10.74	-0.006278	±2.5	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	-14.82	-0.008663	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	-5.26	-0.003036	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	-12.96	-0.007481	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	-11.13	-0.006424	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	-10.66	-0.006153	±2.5	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	6.11	0.003527	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	-12.26	-0.006989	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	-4.62	-0.002634	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	-18.25	-0.010403	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	-16.91	-0.009639	±2.5	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	-14.68	-0.008368	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	-6.72	-0.003926	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	-9.13	-0.005335	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	6.72	0.003926	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	3MHz	QPSK	19965	15RB#0	NV	10	8.64	0.005048	±2.5	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	-9.57	-0.005592	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	-5.58	-0.003221	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	-10.86	-0.006268	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	-10.53	-0.006078	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	-15.09	-0.008710	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	-13.39	-0.007729	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	-13.30	-0.007585	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	-12.03	-0.006861	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	-8.70	-0.004962	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	-14.32	-0.008167	±2.5	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	-17.70	-0.010094	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	-13.23	-0.007730	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	-10.24	-0.005983	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	-14.88	-0.008694	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	-11.01	-0.006433	±2.5	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	-5.82	-0.003401	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	-15.42	-0.008900	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	-11.84	-0.006834	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	-14.20	-0.008196	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	-6.67	-0.003850	±2.5	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	-14.75	-0.008514	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	5.04	0.002874	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	-7.94	-0.004528	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	8.50	0.004847	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	-20.27	-0.011560	±2.5	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	-8.08	-0.004608	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	-13.38	-0.007813	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	2.68	0.001565	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	-11.63	-0.006791	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	-4.53	-0.002645	±2.5	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	-8.18	-0.004777	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	-14.59	-0.008421	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	-13.96	-0.008058	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	-4.86	-0.002805	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	-11.33	-0.006540	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	-9.88	-0.005703	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	8.03	0.004582	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	-9.47	-0.005404	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	-9.40	-0.005364	±2.5	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	-9.31	-0.005312	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	5MHz	QPSK	20375	25RB#0	NV	20	8.43	0.004810	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	12.55	0.007328	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-20	-12.87	-0.007515	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	-10.26	-0.005991	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	-12.79	-0.007469	±2.5	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	-16.21	-0.009466	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	-8.65	-0.004993	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	-10.79	-0.006228	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	-2.86	-0.001651	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	10	-14.45	-0.008341	±2.5	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	-16.88	-0.009743	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	-5.09	-0.002904	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	-16.88	-0.009632	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	-9.41	-0.005369	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	-16.19	-0.009238	±2.5	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	-20.40	-0.011641	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	7.04	0.004105	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	-9.28	-0.005411	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	-4.35	-0.002536	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	-6.35	-0.003703	±2.5	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	-5.65	-0.003294	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	-8.24	-0.004756	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	-4.49	-0.002592	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	-2.86	-0.001651	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	3.63	0.002095	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	-8.40	-0.004848	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	-13.09	-0.007480	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	-5.36	-0.003063	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	-11.66	-0.006663	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	10	-14.41	-0.008234	±2.5	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	-7.45	-0.004257	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	7.97	0.004647	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	-10.57	-0.006163	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	-12.65	-0.007376	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	7.51	0.004379	±2.5	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	10.41	0.006070	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	-8.85	-0.005108	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	-11.20	-0.006465	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	-6.68	-0.003856	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	-11.42	-0.006592	±2.5	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	-12.32	-0.007111	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	10MHz	16QAM	20350	50RB#0	NV	-30	-3.95	-0.002257	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	-10.93	-0.006246	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	0	-14.83	-0.008474	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	-13.96	-0.007977	±2.5	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	-17.12	-0.009783	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	-8.75	-0.005095	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	-8.31	-0.004838	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	-14.42	-0.008396	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	-14.09	-0.008204	±2.5	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	-11.54	-0.006719	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	-17.05	-0.009841	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	-15.05	-0.008687	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	-16.32	-0.009420	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	-11.23	-0.006482	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	-5.35	-0.003088	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	-13.99	-0.008006	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	-14.86	-0.008504	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	-12.12	-0.006936	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	-12.17	-0.006964	±2.5	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	-7.08	-0.004052	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	-16.58	-0.009654	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	-10.07	-0.005863	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	-10.31	-0.006003	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	-14.39	-0.008378	±2.5	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	-14.46	-0.008419	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	9.98	0.005760	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	-15.69	-0.009056	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	-5.08	-0.002932	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	-13.07	-0.007544	±2.5	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	-17.47	-0.010084	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	-8.87	-0.005076	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	-15.15	-0.008670	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	-11.82	-0.006764	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	10	-11.93	-0.006827	±2.5	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	-3.62	-0.002072	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-30	-10.27	-0.005971	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	-20	-11.60	-0.006744	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	0	-14.91	-0.008669	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	10	-13.22	-0.007686	±2.5	PASS
Band4	20MHz	QPSK	20050	100RB#0	NV	20	-14.41	-0.008378	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	-5.46	-0.003152	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band4	20MHz	QPSK	20175	100RB#0	NV	-20	-10.01	-0.005778	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	-14.75	-0.008514	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	10	-8.50	-0.004906	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	-6.32	-0.003648	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-30	-5.38	-0.003083	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	-20	-5.74	-0.003289	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	0	-13.76	-0.007885	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	10	9.28	0.005318	±2.5	PASS
Band4	20MHz	QPSK	20300	100RB#0	NV	20	12.00	0.006877	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-30	-12.62	-0.007337	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	-20	-8.87	-0.005157	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	0	-15.08	-0.008767	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	10	-14.10	-0.008198	±2.5	PASS
Band4	20MHz	16QAM	20050	100RB#0	NV	20	-5.05	-0.002936	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-30	-9.71	-0.005605	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	-20	-5.59	-0.003227	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	0	-12.33	-0.007117	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	10	-12.49	-0.007209	±2.5	PASS
Band4	20MHz	16QAM	20175	100RB#0	NV	20	-14.42	-0.008323	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-30	-13.98	-0.008011	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	-20	-8.65	-0.004957	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	0	-16.38	-0.009387	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	10	-11.59	-0.006642	±2.5	PASS
Band4	20MHz	16QAM	20300	100RB#0	NV	20	-19.51	-0.011181	±2.5	PASS

---End---

