

Test Information:

Sample No.:	2VFZ-1	Test Date:	2025/01/03~2025/02/10
Test Site:	RF	Test Mode:	Transmitting
Tester:	Kungfumaster Liang	Test Result:	Pass

Environmental Conditions:

Temperature: (°C):	23.8-24.8	Relative Humidity: (%)	44-52	ATM Pressure: (kPa)	101.4-101.6
-----------------------	-----------	---------------------------	-------	------------------------	-------------

Spurious Emissions at Antenna Terminal

FCC Part 96

n77_2

Mode	Value (dBm)	Limit	Verdict
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.45	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-46.96	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-47.57	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.44	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.65	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-47.42	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-47.38	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-47.47	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-47.17	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.64	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.61	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.76	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.55	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.34	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.44	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.12	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.54	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.52	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-47.75	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.57	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-47.80	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.33	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.82	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-47.86	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.34	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.66	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.31	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-47.09	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.36	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.10	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.20	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.74	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.14	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.63	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-44.59	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-47.13	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-47.46	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.42	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-47.28	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.50	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-40.80	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-47.14	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.64	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-44.69	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-40.48	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-47.40	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-47.55	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-45.13	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-47.64	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.43	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-47.40	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-47.85	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.28	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.21	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-47.77	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-46.95	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-40.70	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-47.61	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.91	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.16	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-47.22	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.02	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-47.15	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-47.89	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-47.62	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.25	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.05	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.31	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-47.48	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-42.19	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-47.20	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-47.22	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.02	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-47.25	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-47.61	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-43.77	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-46.96	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-47.52	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-46.99	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-46.92	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-47.03	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-45.53	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-46.74	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.68	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-44.42	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-47.29	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-46.69	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-43.37	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-47.24	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-46.71	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-43.08	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-46.71	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.75	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-43.34	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-47.15	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-47.36	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-41.77	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-47.49	-40	Pass

n78_2

Mode	Value (dBm)	Limit	Verdict
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.80	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-47.48	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-43.70	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.48	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.32	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-47.81	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-47.58	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-48.03	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-47.81	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-46.66	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.75	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-42.16	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.29	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.47	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.29	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-46.81	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-46.49	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.06	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-46.73	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.19	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-42.11	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.44	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.70	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-47.17	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.35	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.67	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.02	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-47.21	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.52	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.34	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.16	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.33	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.74	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.61	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-47.66	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-42.57	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-44.19	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.01	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-47.51	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.56	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.17	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-47.33	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.13	-40	Pass


Mode	Value (dBm)	Limit	Verdict
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-47.45	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-47.47	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-41.60	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-46.88	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-47.17	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-47.34	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.54	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-47.18	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-47.70	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.56	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.58	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-42.15	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-47.27	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-47.55	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-46.12	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.15	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.35	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-42.62	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.32	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-47.63	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-42.51	-40	Pass

Mode	Value (dBm)	Limit	Verdict
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-47.34	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.45	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.44	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.39	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-47.50	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-43.38	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-47.81	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-47.33	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.15	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-47.41	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-40.12	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.89	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-47.67	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-46.16	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-46.82	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.43	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-46.40	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-47.05	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-46.84	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-41.83	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.71	-40	Pass


Mode	Value (dBm)	Limit	Verdict
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-45	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-43.05	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-47.57	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-45.14	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-47.07	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-47.51	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-43.96	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-44.44	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-46.92	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-43.89	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-42.51	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-47.06	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-44.35	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-45.61	-40	Pass

n77_2


n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0 -47.45dBm

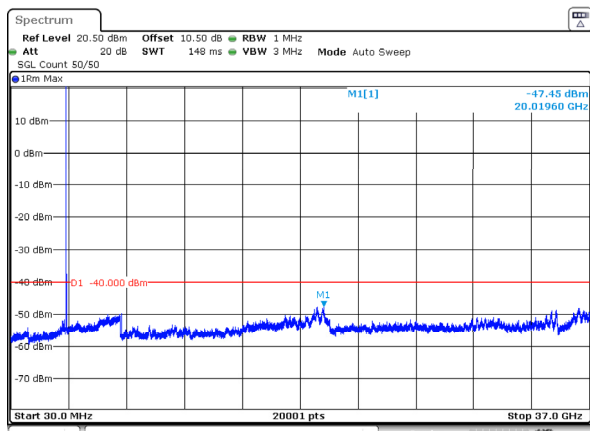


n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@23 -46.96dBm

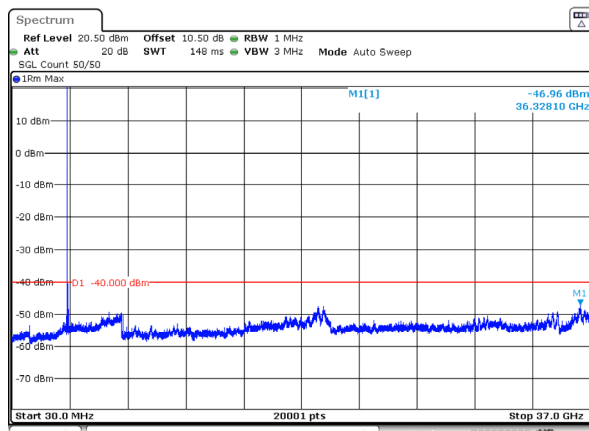


n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0 -47.57dBm

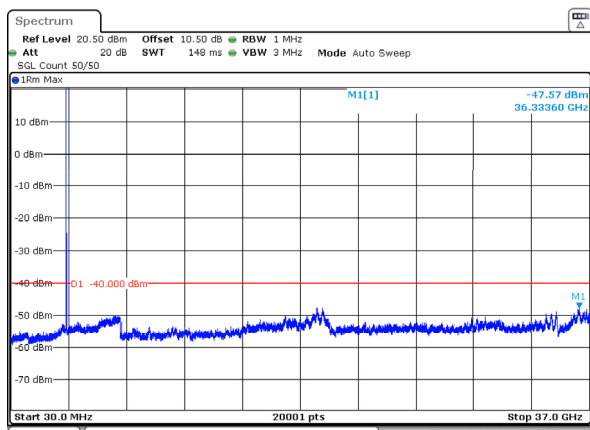


n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.44dBm

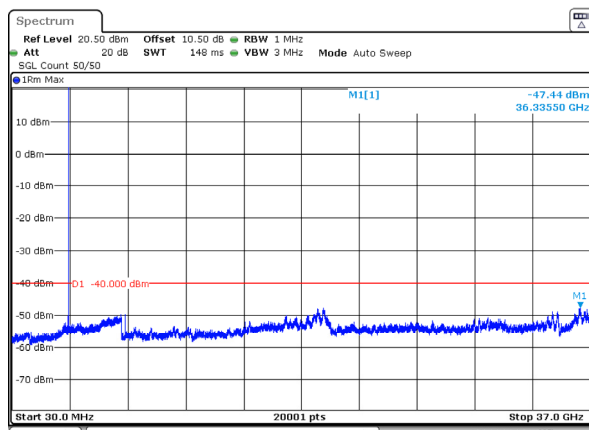


n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@23 -47.65dBm

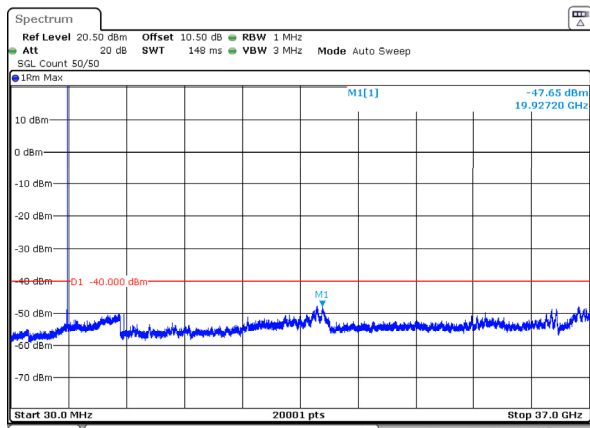

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB24@0 -47.42dBm

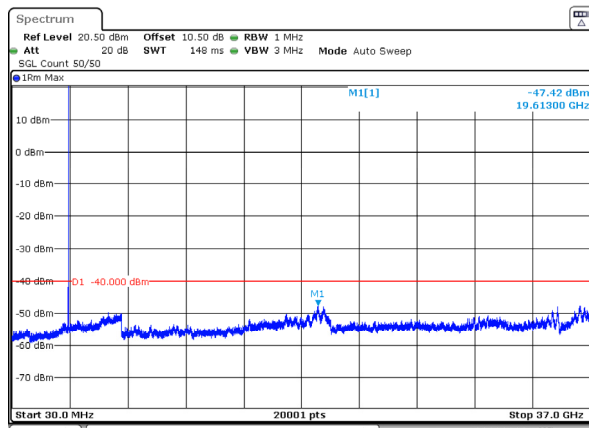


n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@0 -47.38dBm

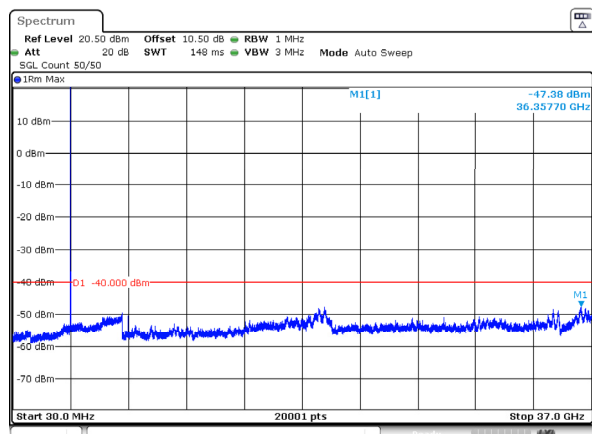


ProjectNo.:2401A43118E-RF Tester:Kungfumeester Liang
Date: 3..JPN.2025 02:39:33

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23 -47.47dBm

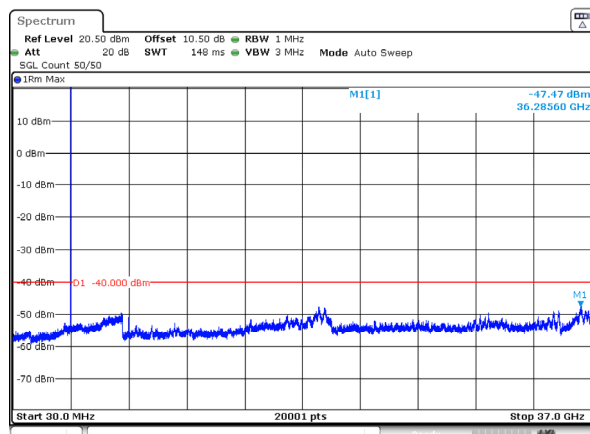


ProjectNo.:2401A43118E-RF Tester:Kungfumeester Liang
Date: 3..JPN.2025 02:40:49

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0 -47.17dBm

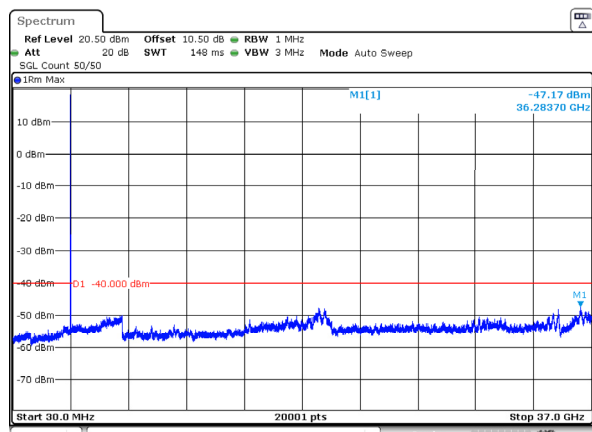


ProjectNo.:2401A43118E-RF Tester:Kungfumeester Liang
Date: 3..JPN.2025 02:42:04

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.64dBm

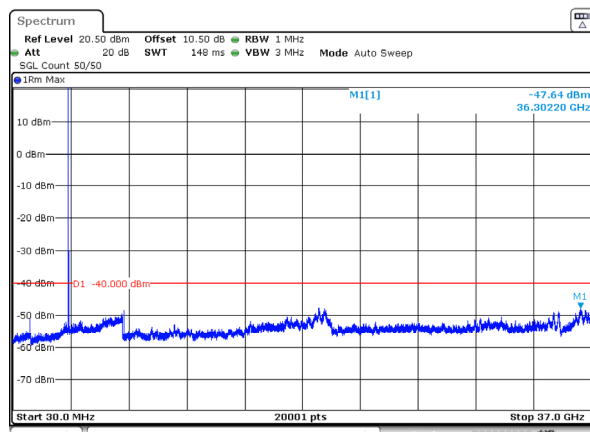


ProjectNo.:2401A43118E-RF Tester:Kungfumeester Liang
Date: 3..JPN.2025 02:45:35

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@37 -47.61dBm

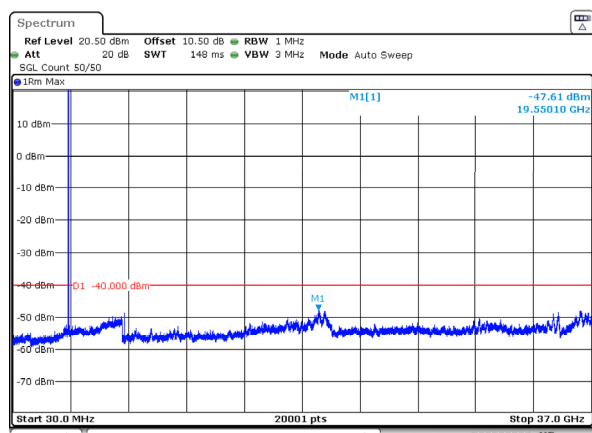


ProjectNo.:2401A43118E-RF Tester:Kungfumeester Liang
Date: 3..JPN.2025 02:46:52

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0 -47.76dBm

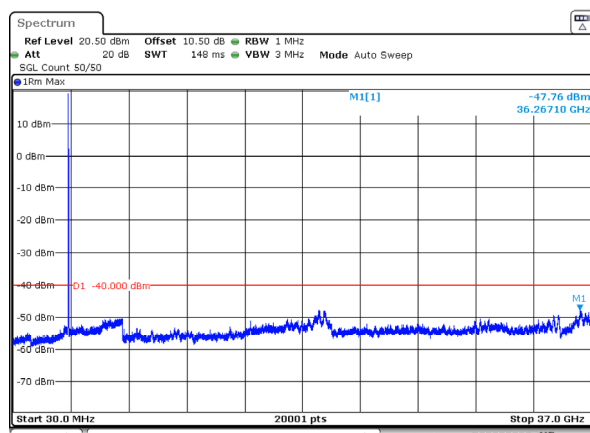


ProjectNo.:2401A43118E-RF Tester:Kungfumeester Liang
Date: 3..JPN.2025 02:48:07

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.55dBm

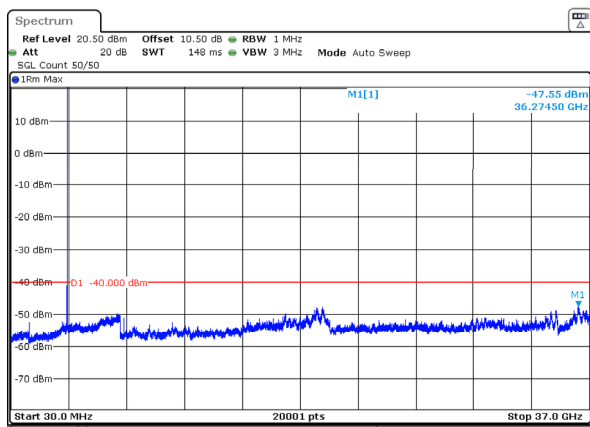


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:49:27

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@37 -47.34dBm

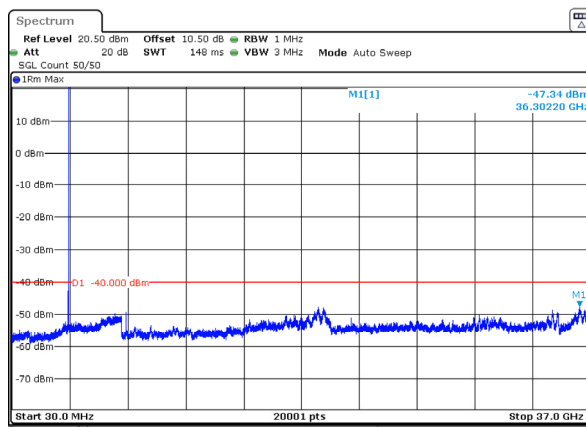


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:50:45

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB36@0 -47.44dBm

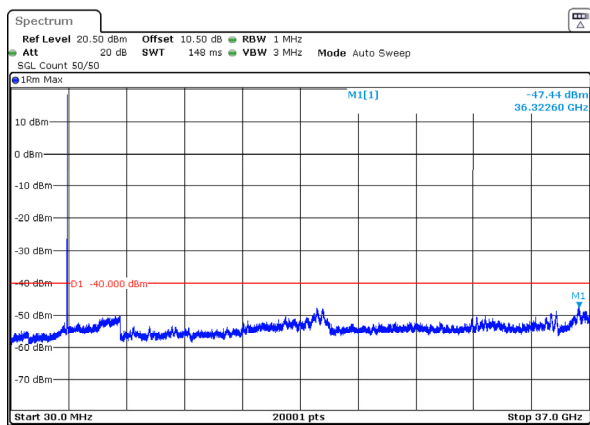


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:52:00

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.12dBm

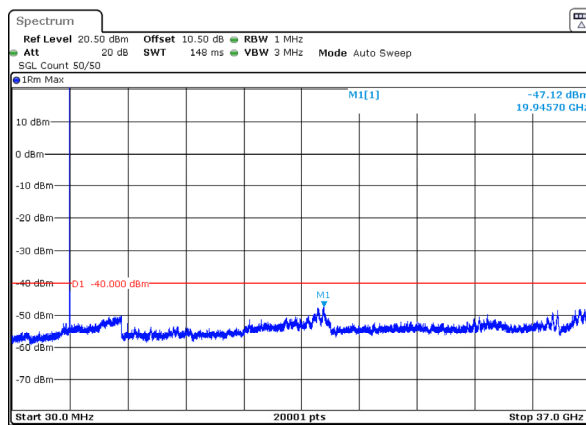


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:53:20

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37 -47.54dBm

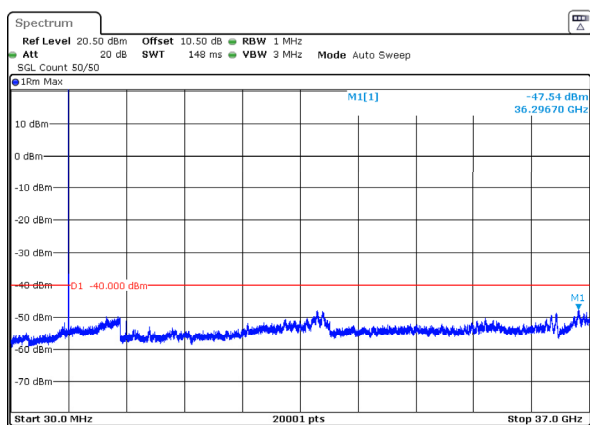


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:54:36

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0 -47.52dBm

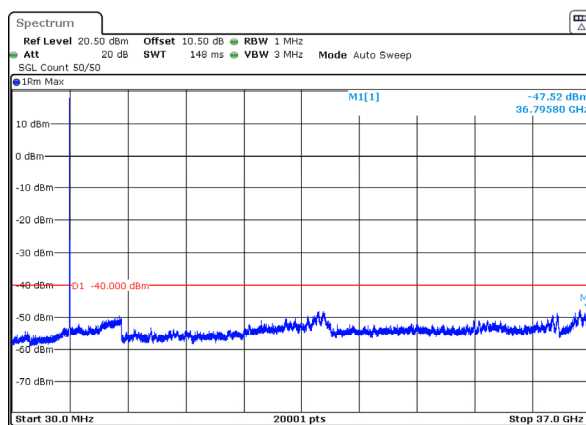


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:55:51

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0 -47.75dBm

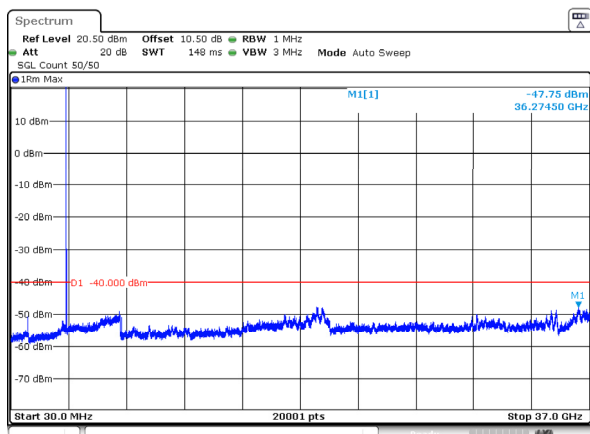


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:58:02

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@50 -47.57dBm

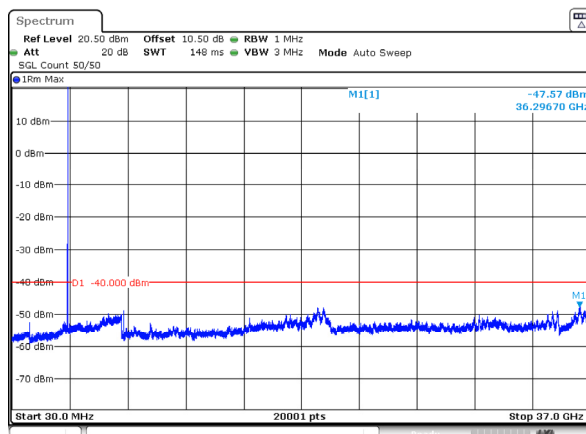


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 02:59:23

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0 -47.80dBm

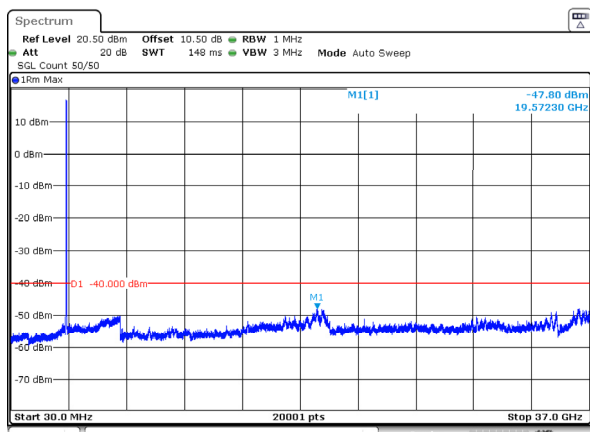


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:00:39

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.33dBm

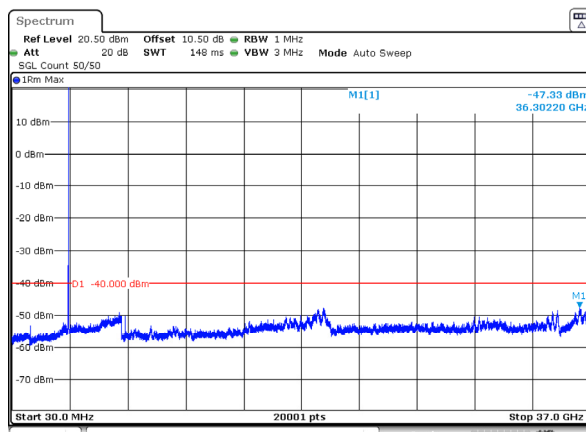


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:02:02

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@50 -47.82dBm

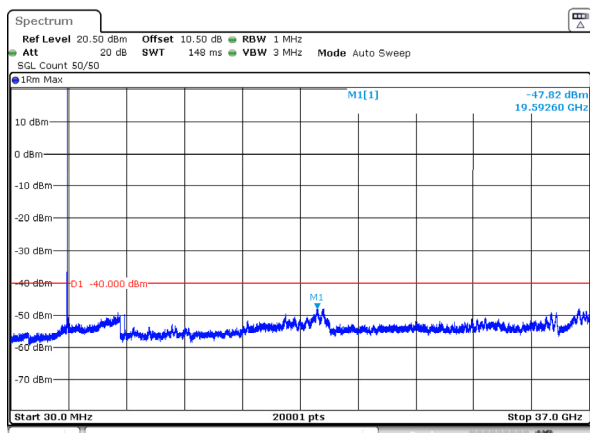


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:03:22

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB50@0 -47.86dBm

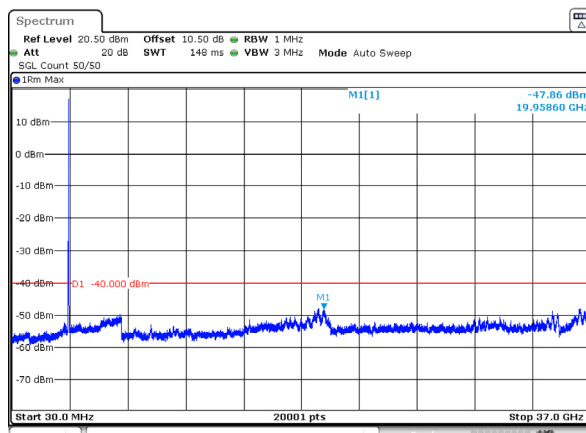


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:04:38

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@0 -47.34dBm

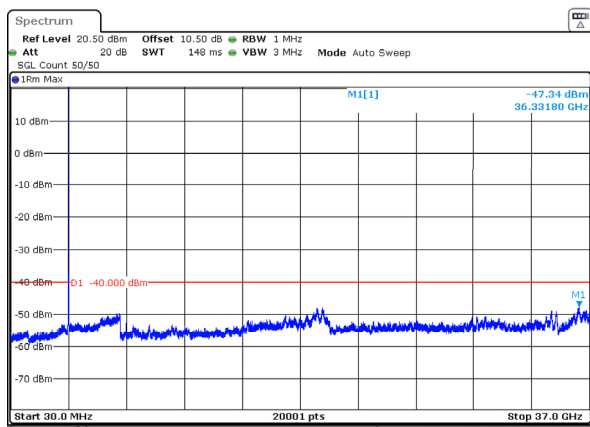


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:06:02

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50 -47.66dBm

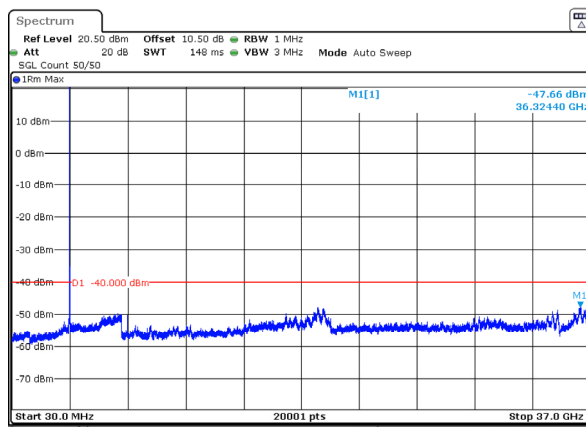


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:07:22

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0 -47.31dBm

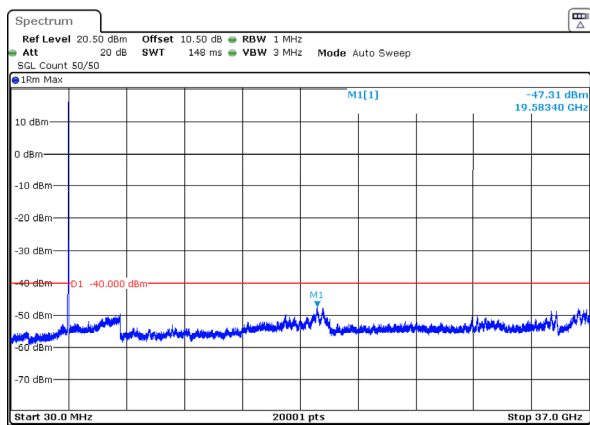


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:08:38

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0 -47.09dBm

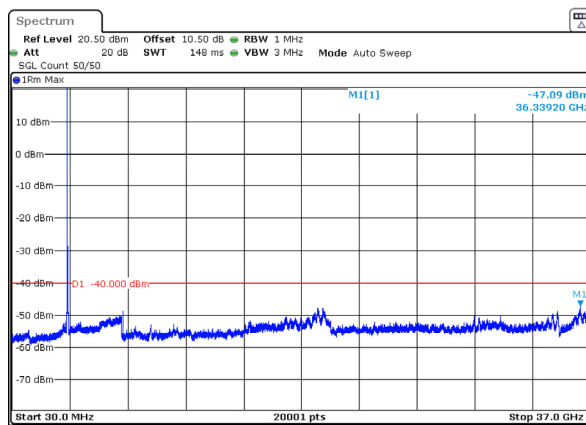


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:10:07

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@77 -47.36dBm

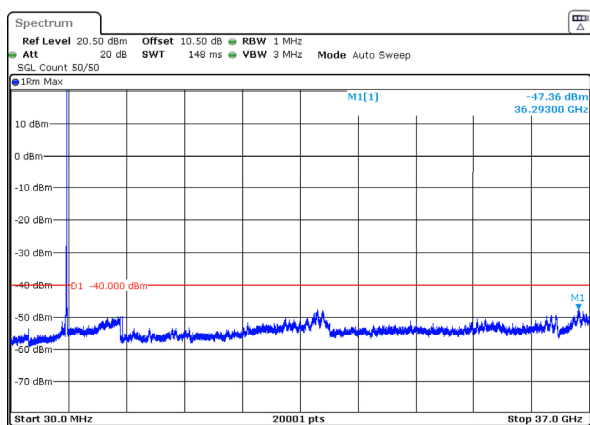


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:11:27

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0 -47.10dBm

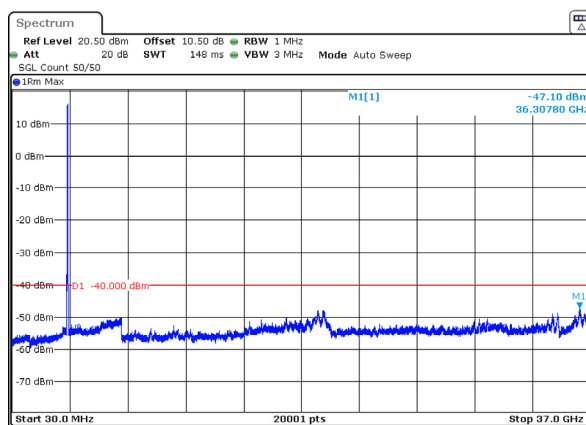


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:12:44

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.20dBm

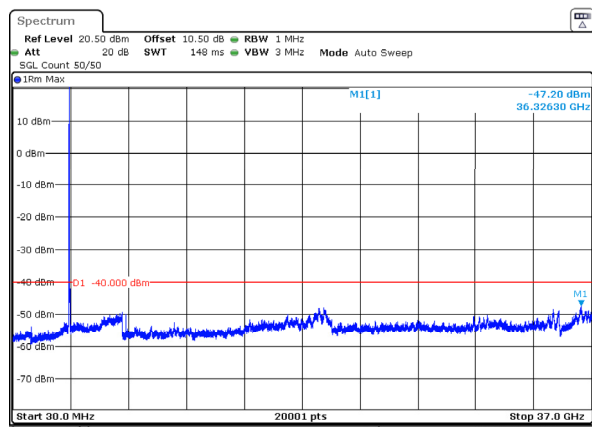


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:14:07

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@77 -47.74dBm

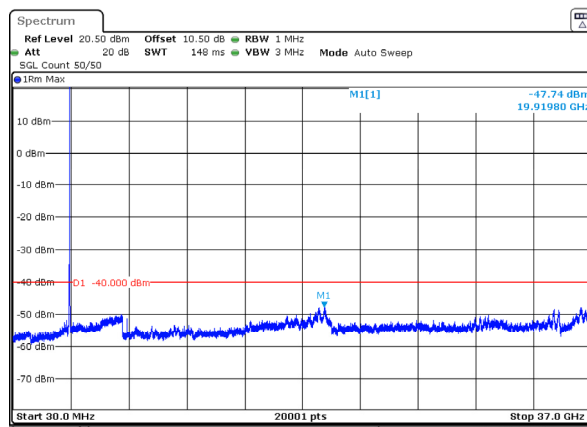


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:15:28

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB75@0 -47.14dBm

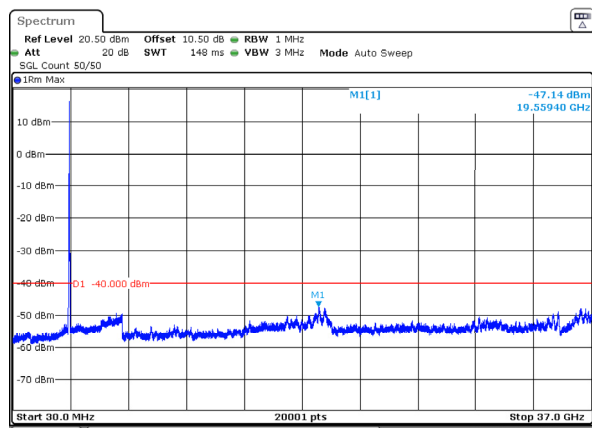


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:16:44

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@0 -47.63dBm

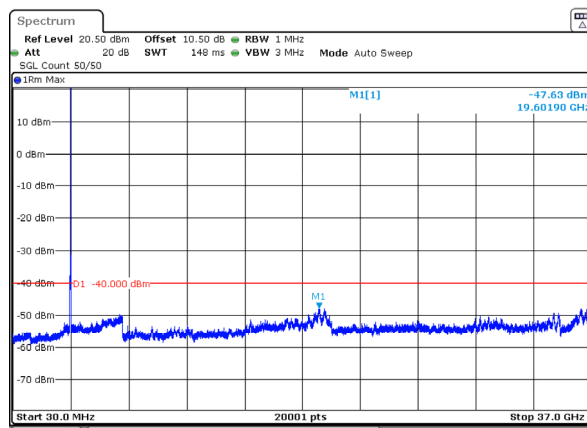


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:18:08

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77 -44.59dBm

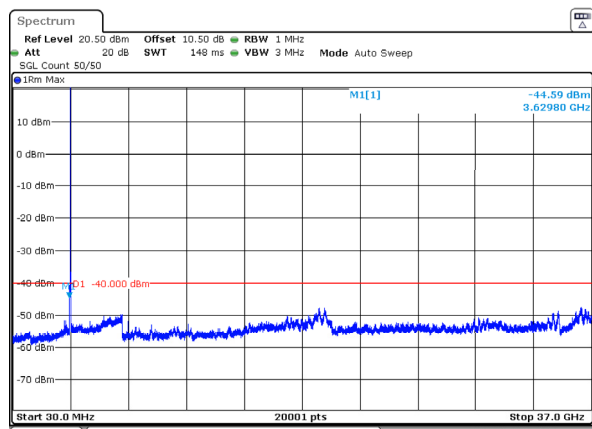


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 07:14:05

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0 -47.13dBm

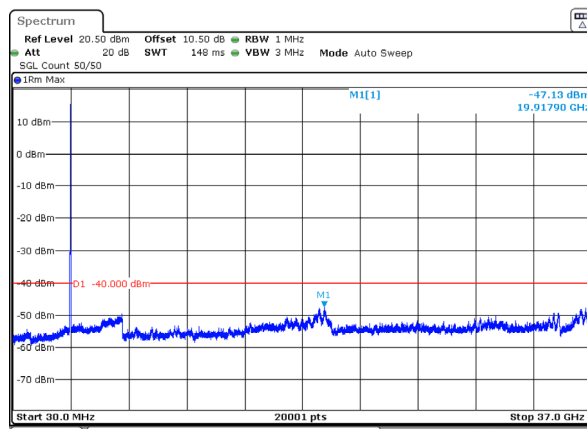


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:20:46

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0 -47.46dBm

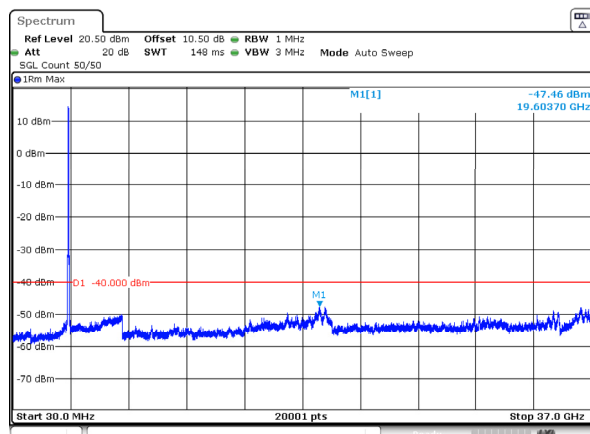


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JFN.2025 03:24:53

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0 -47.42dBm

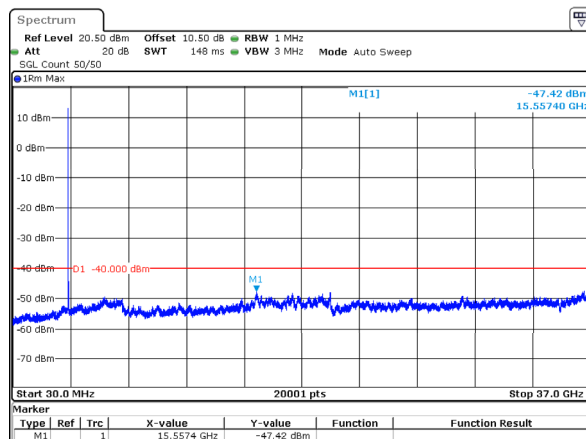


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 10.FEB.2025 10:19:45

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@105 -47.28dBm

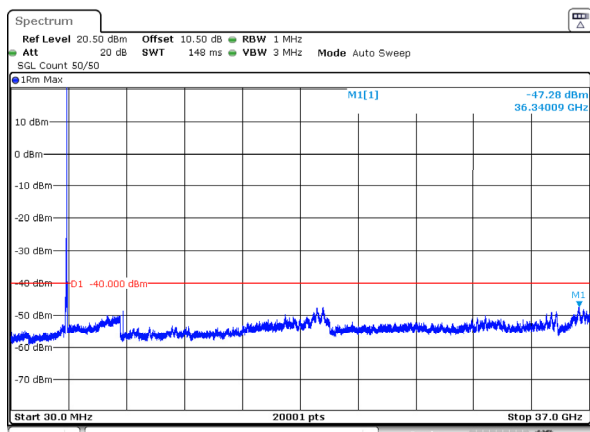


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JFN.2025 12:01:58

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB100@0 -47.50dBm

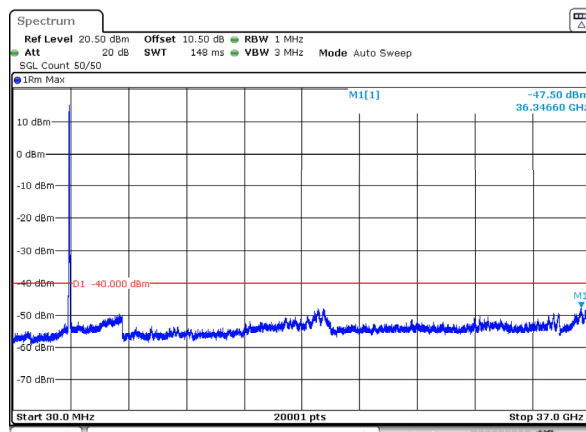


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JFN.2025 03:28:57

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -40.80dBm

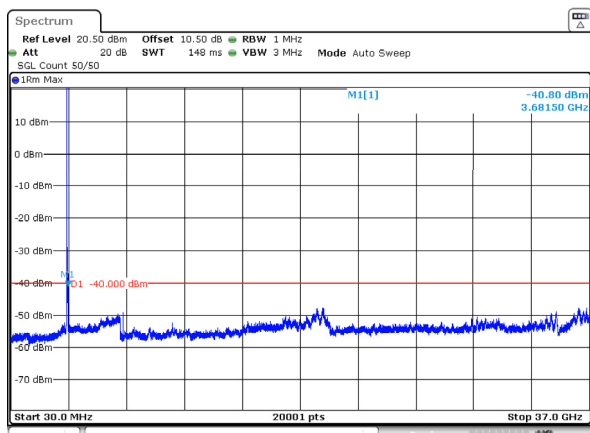


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JFN.2025 07:16:58

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@105 -47.14dBm

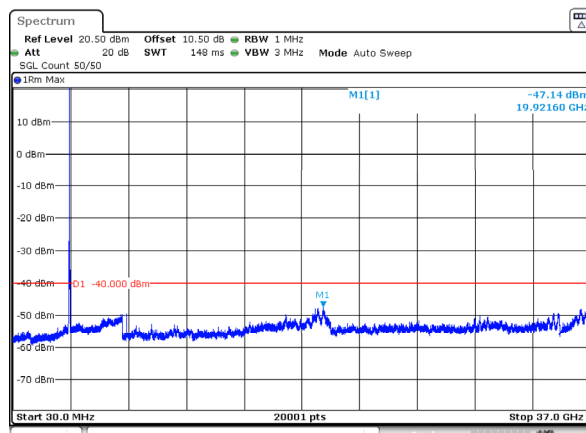


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JFN.2025 07:17:52

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0 -47.64dBm

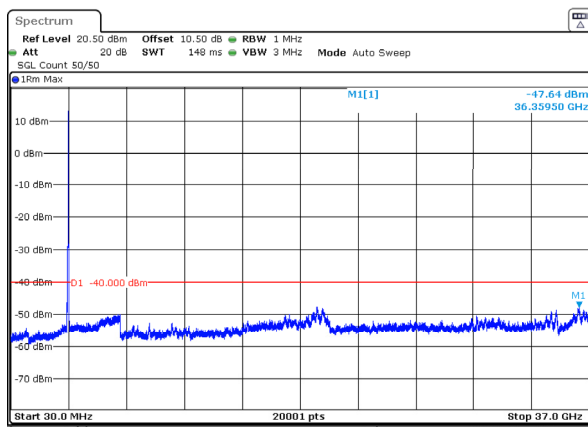


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:33:02

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@0 -44.69dBm

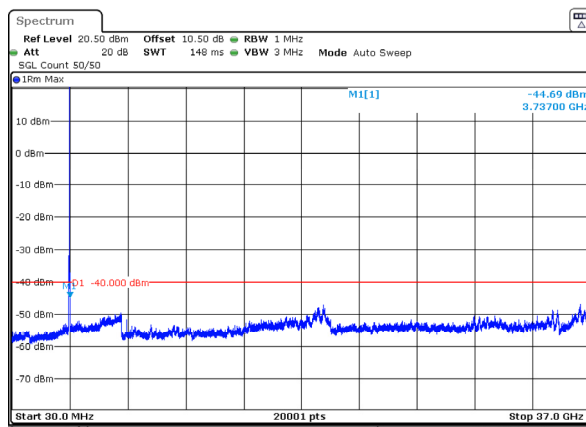


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 08:59:28

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105 -40.48dBm

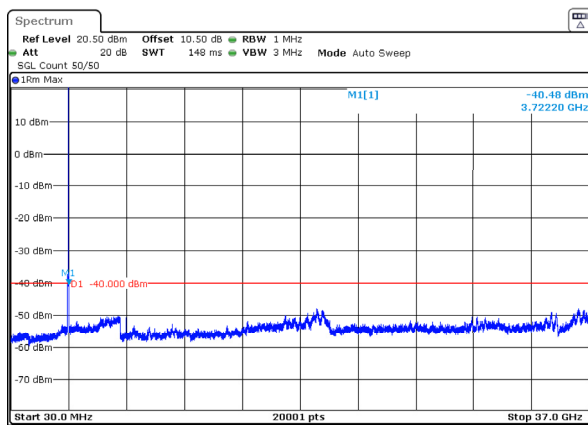


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:31:46

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0 -47.40dBm

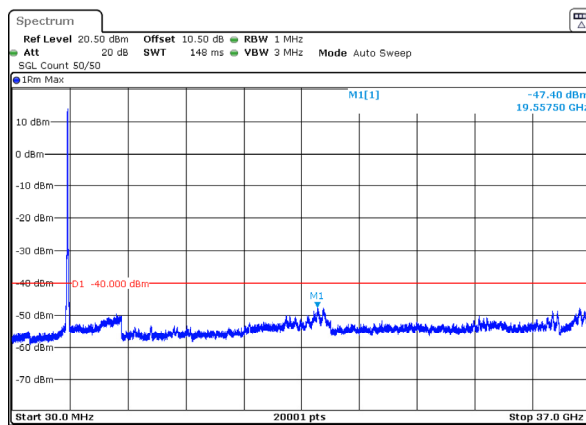


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:37:11

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0 -47.55dBm

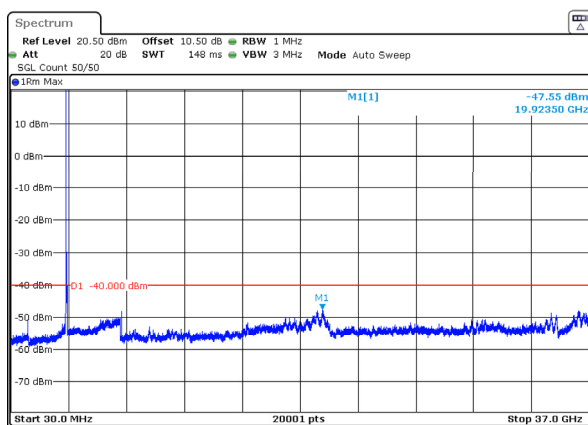


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 07:19:53

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@132 -45.13dBm

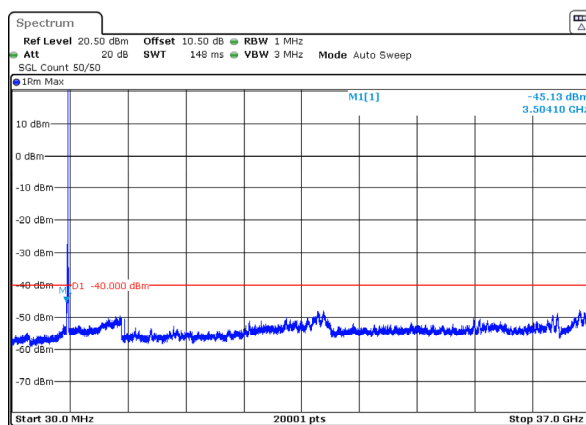


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 07:20:46

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB128@0 -47.64dBm

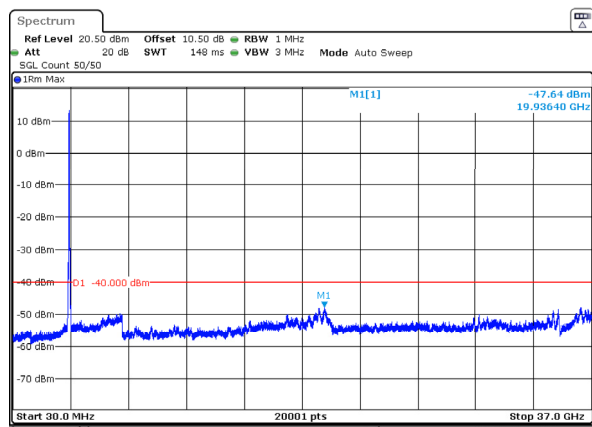


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:41:15

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.43dBm

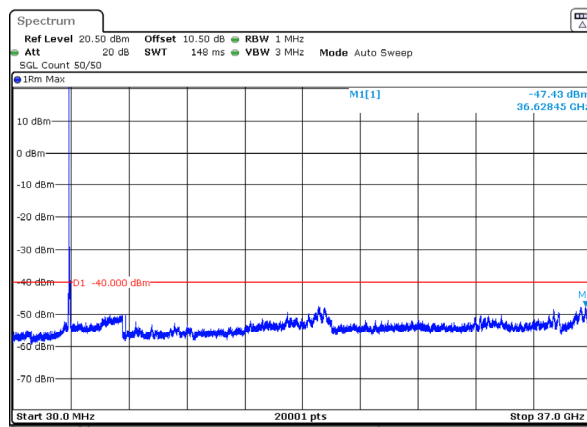


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 12:07:42

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@132 -47.40dBm

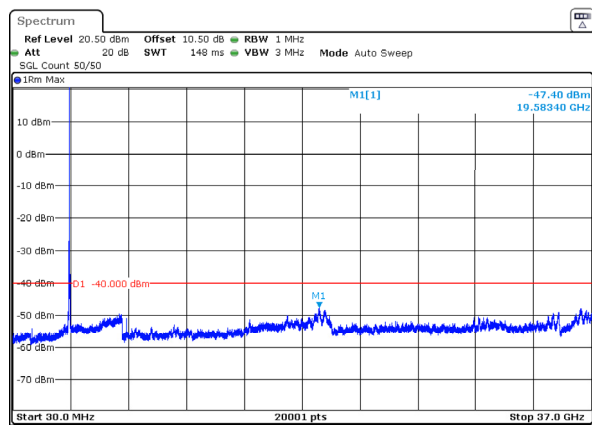


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:39:58

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0 -47.85dBm

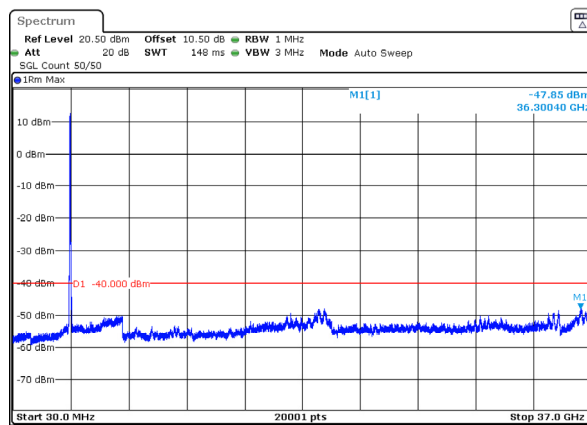


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 03:51:05

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@0 -47.28dBm

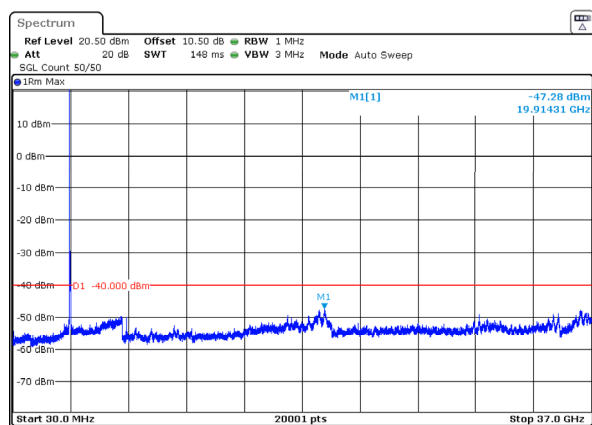


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 12:08:41

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132 -47.21dBm

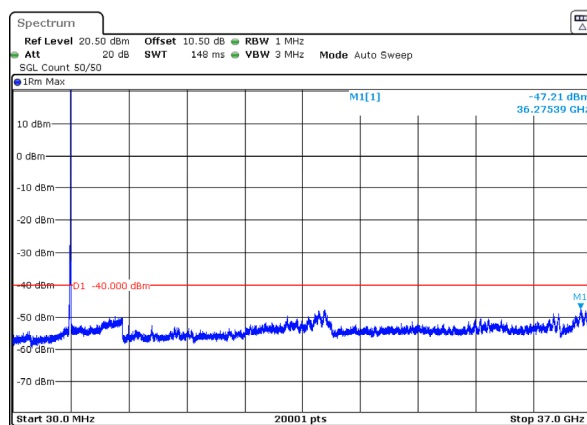


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JPN.2025 12:09:34

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0 -47.77dBm

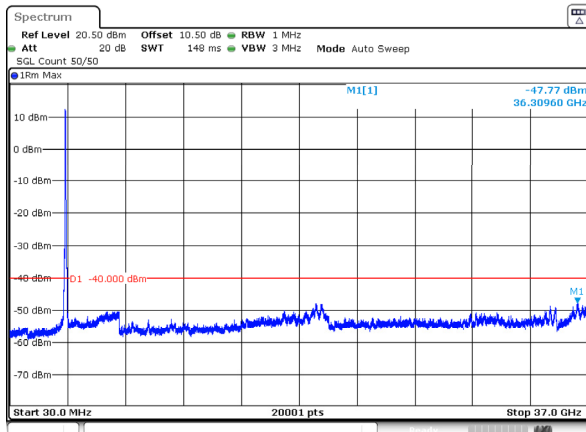


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 03:55:14

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0 -46.95dBm

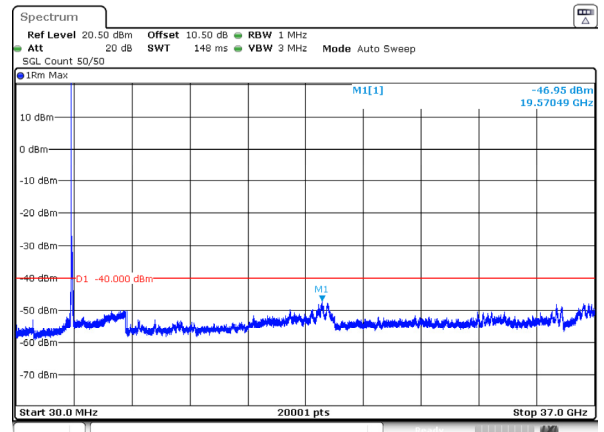


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 12:10:37

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@161 -40.70dBm

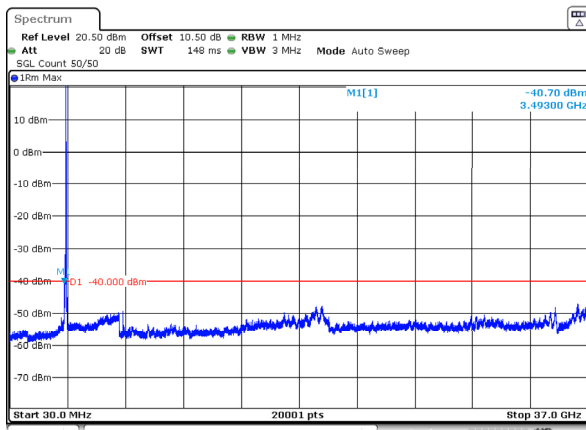


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 03:53:58

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB162@0 -47.61dBm

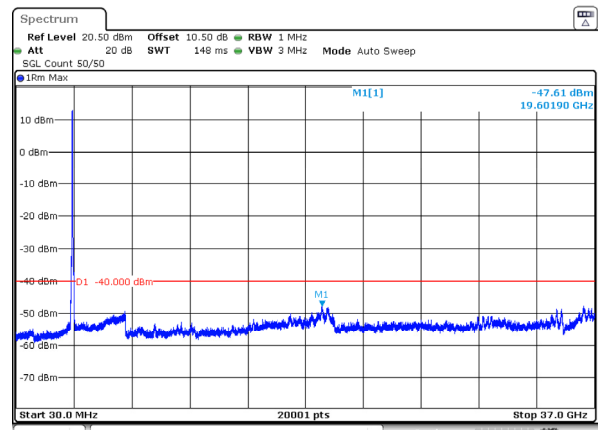


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 03:59:22

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -46.91dBm

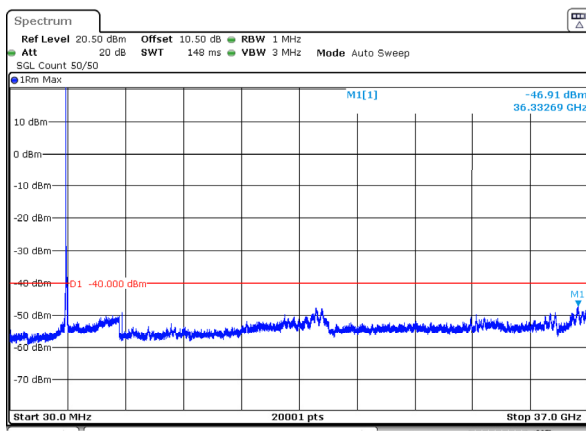


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 12:11:35

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@161 -47.16dBm

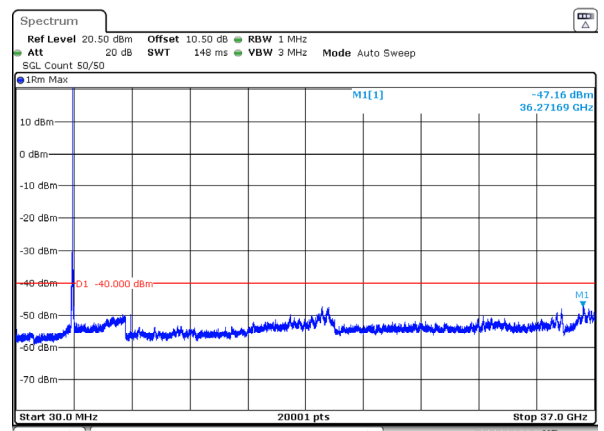


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 12:12:28

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0 -47.22dBm

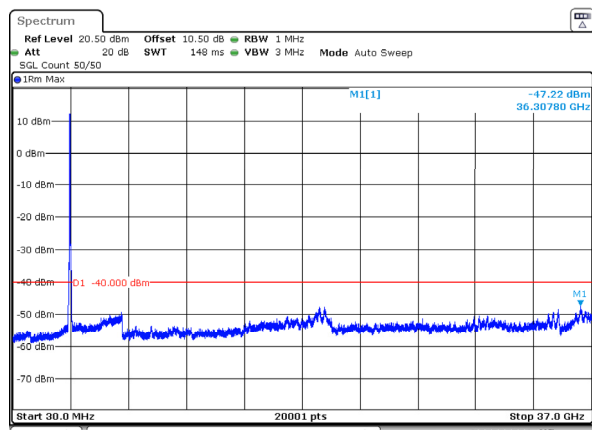


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 04:03:27

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@0 -47.02dBm

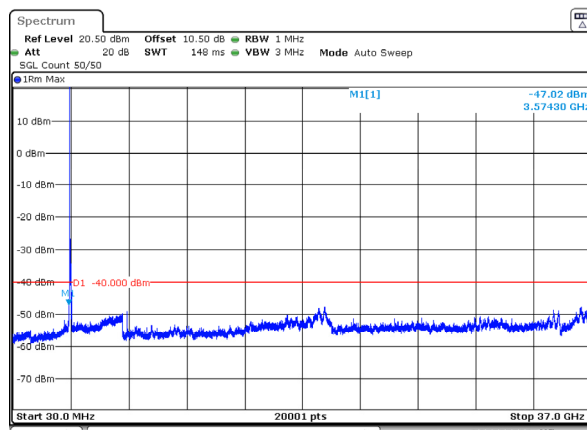


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 04:00:49

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161 -47.15dBm

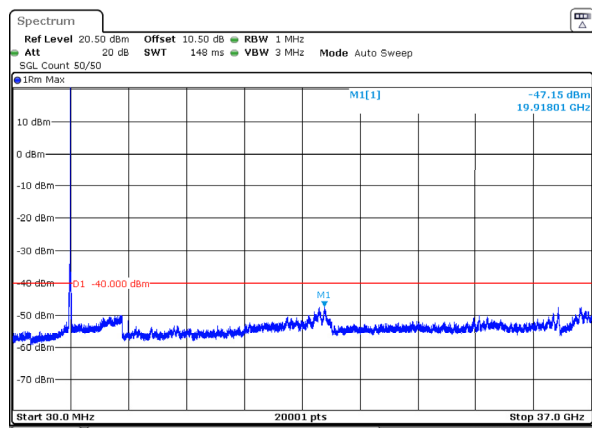


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 12:13:28

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0 -47.89dBm

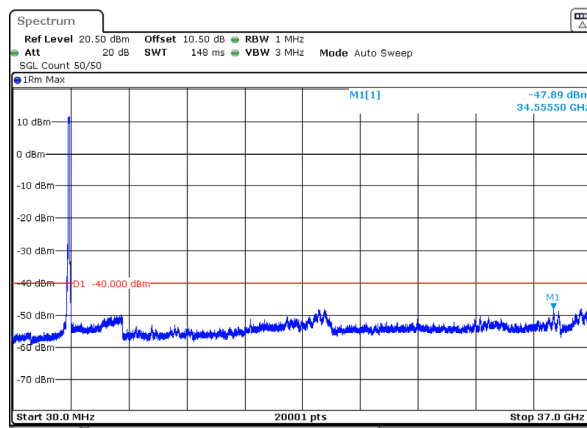


ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 04:07:37

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0 -47.62dBm

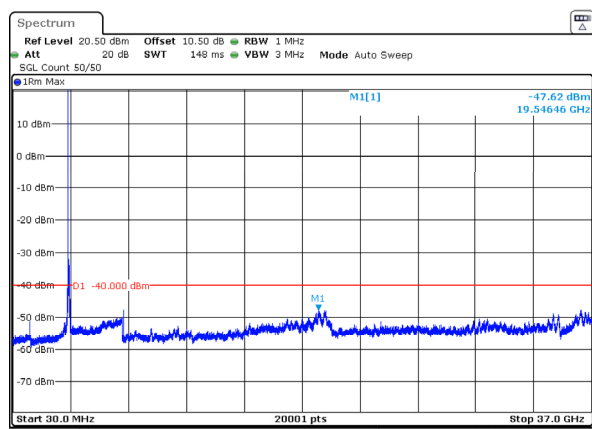

ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 3..JUN.2025 12:14:29

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@188 -47.25dBm

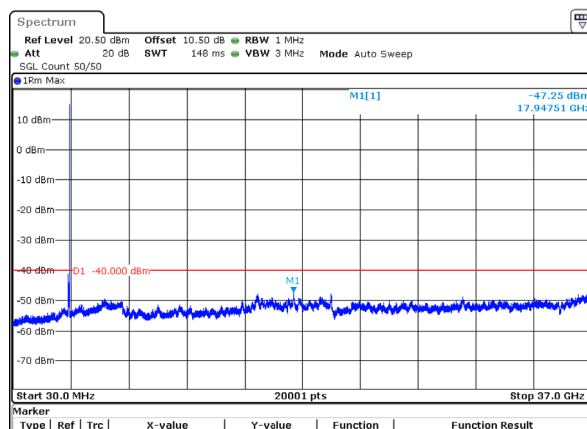

ProjectNo.:2401A43118E-RF Tester:Kungfumeister Liang
Date: 10.FEB.2025 10:20:55