

Test Information:

Sample No.:	2VFZ-1	Test Date:	2025/01/04~2025/01/12
Test Site:	RF	Test Mode:	Transmitting
Tester:	Kungfumaster Liang	Test Result:	Pass

Environmental Conditions:

Temperature: (°C):	23.6-25.3	Relative Humidity: (%)	37-53	ATM Pressure: (kPa)	101.2-101.5
-----------------------	-----------	---------------------------	-------	------------------------	-------------

Out of band emission, Band Edge

FCC Part 96

n77_2

Mode	Result (MHz)	Limit	Verdict
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-33.805	See Graphs	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-38.065	See Graphs	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-35.679	See Graphs	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-39.845	See Graphs	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-28.456	See Graphs	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-35.062	See Graphs	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-28.841	See Graphs	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-35.497	See Graphs	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-37.040	See Graphs	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-36.517	See Graphs	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-38.455	See Graphs	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-34.560	See Graphs	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-28.013	See Graphs	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-39.687	See Graphs	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-29.670	See Graphs	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-39.526	See Graphs	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-39.003	See Graphs	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-20.094	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-37.757	See Graphs	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-20.117	See Graphs	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-38.407	See Graphs	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-25.451	See Graphs	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-38.951	See Graphs	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-23.740	See Graphs	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-41.534	See Graphs	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-33.010	See Graphs	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-40.355	See Graphs	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-24.685	See Graphs	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-40.712	See Graphs	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-32.173	See Graphs	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-39.469	See Graphs	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-30.289	See Graphs	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-17.162	See Graphs	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-39.573	See Graphs	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-13.220	See Graphs	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-39.807	See Graphs	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-14.374	See Graphs	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-37.628	See Graphs	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-22.618	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-40.173	See Graphs	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-19.316	See Graphs	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-38.527	See Graphs	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-18.162	See Graphs	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-40.768	See Graphs	Pass

n78_2


Mode	Result (MHz)	Limit	Verdict
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-34.339	See Graphs	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-37.307	See Graphs	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-35.283	See Graphs	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-40.243	See Graphs	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-27.704	See Graphs	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-34.735	See Graphs	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-30.692	See Graphs	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-35.556	See Graphs	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-35.937	See Graphs	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-35.549	See Graphs	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-36.755	See Graphs	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-35.152	See Graphs	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-24.962	See Graphs	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-41.377	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-34.614	See Graphs	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-39.433	See Graphs	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-40.338	See Graphs	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-29.621	See Graphs	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-40.844	See Graphs	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-28.218	See Graphs	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-40.155	See Graphs	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-33.649	See Graphs	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-39.566	See Graphs	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-34.171	See Graphs	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-42.704	See Graphs	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-32.604	See Graphs	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-41.590	See Graphs	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-33.105	See Graphs	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-41.209	See Graphs	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-36.841	See Graphs	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-39.961	See Graphs	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-41.023	See Graphs	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-24.612	See Graphs	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-40.225	See Graphs	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-21.072	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-40.652	See Graphs	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-19.891	See Graphs	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-39.767	See Graphs	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-19.514	See Graphs	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-41.536	See Graphs	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-19.080	See Graphs	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-39.142	See Graphs	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-19.624	See Graphs	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-42.207	See Graphs	Pass


n77_2

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0

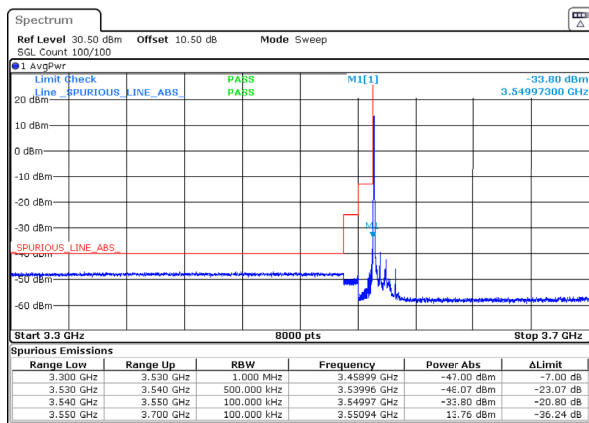


ProjectNo.:2401A43118E-RF Tester:Mingfamester Liang
Date: 4_JUN.2025 09:28:39

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0

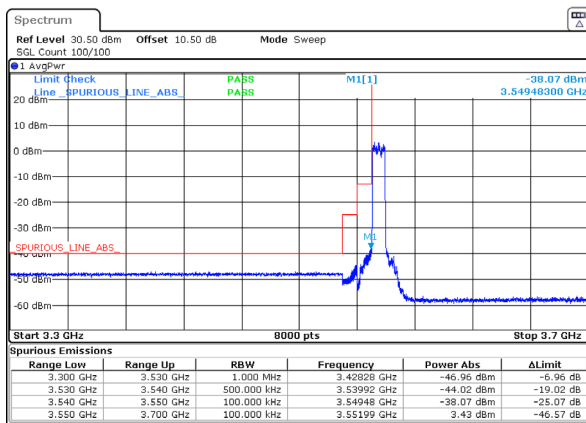


ProjectNo.:2401A43118E-RF Tester:Mingfamester Liang
Date: 4_JUN.2025 09:29:29

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

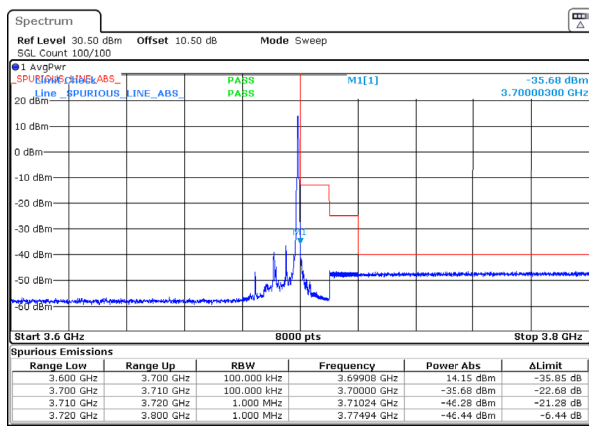


ProjectNo.:2401A43118E-RF Tester:Mingfamester Liang
Date: 4_JUN.2025 09:30:25

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0

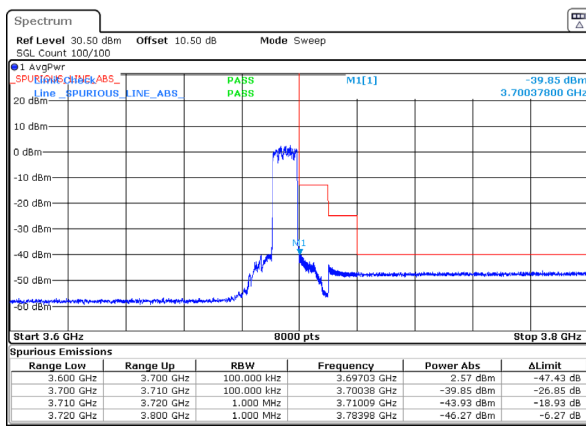


ProjectNo.:2401A43118E-RF Tester:Mingfamester Liang
Date: 4_JUN.2025 09:31:15

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

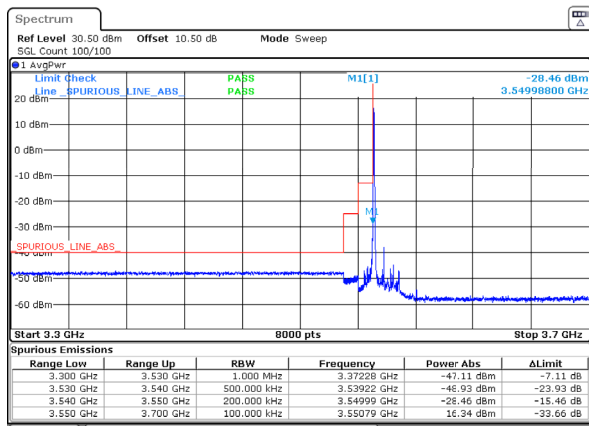


ProjectNo.:2401A43118E-RF Tester:Mingfamester Liang
Date: 4_JUN.2025 09:31:59

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

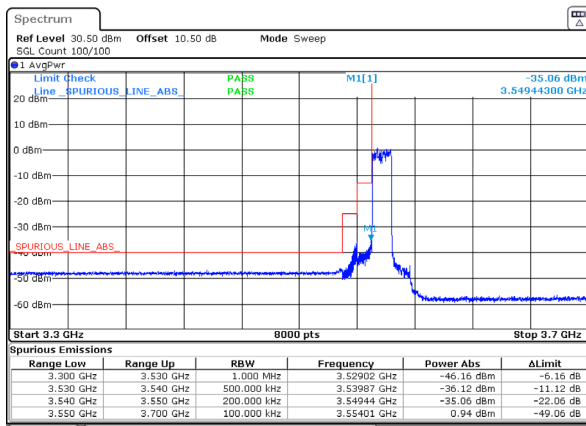


ProjectNo.:2401A43118E-RF Tester:Mingfamester Liang
Date: 4_JUN.2025 09:32:35

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37

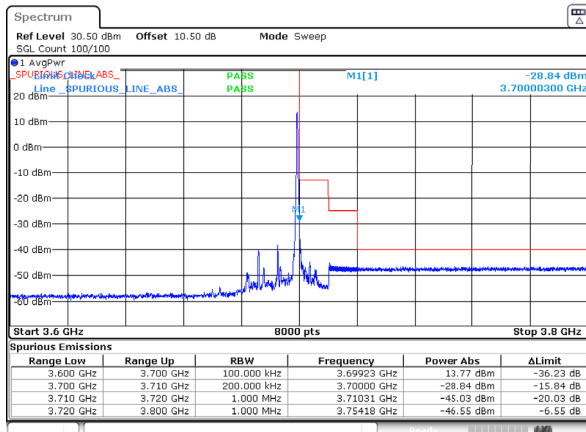


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4-JUN.2025 09:33:15

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0

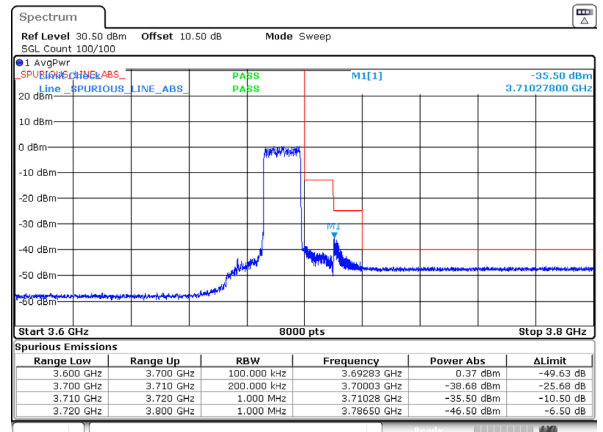


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4-JUN.2025 09:33:50

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0

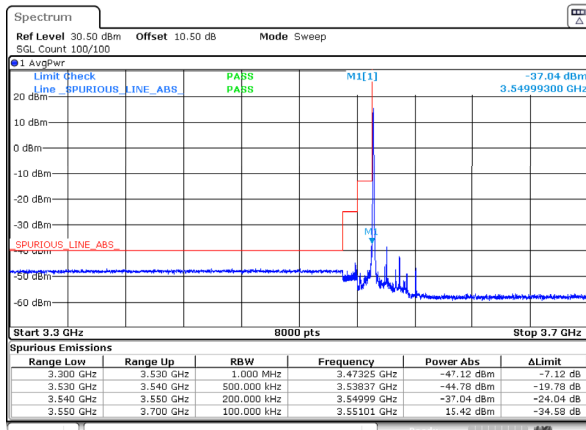


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4-JUN.2025 09:34:51

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0

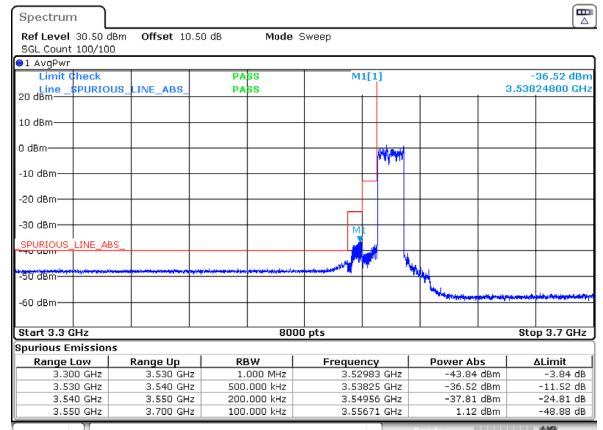


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4-JUN.2025 09:35:27

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50

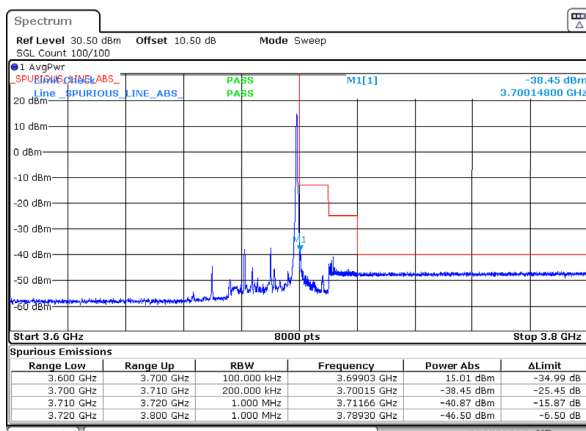


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4-JUN.2025 09:36:13

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0

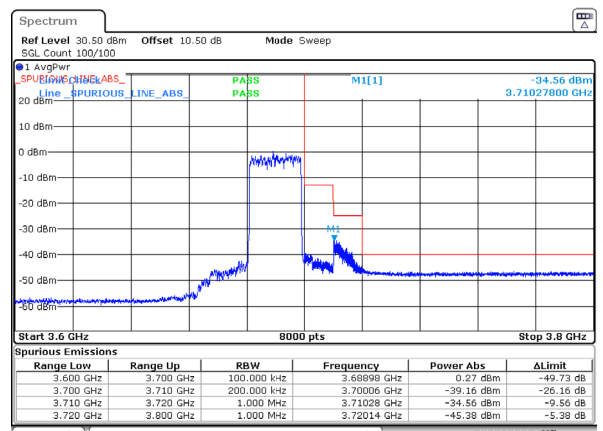


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4-JUN.2025 09:36:49

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0

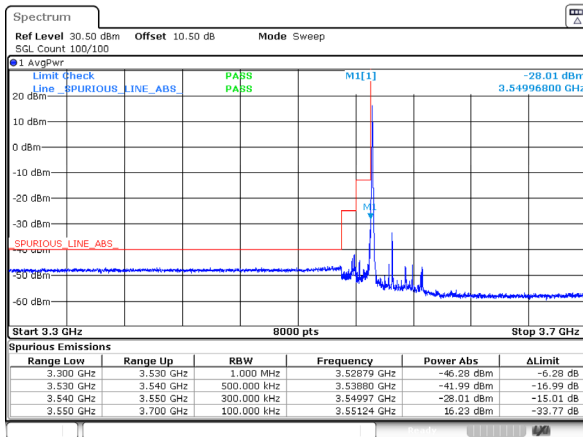


ProjectNo.:2401A43118E-RF Tester:Kungfaster Liang
Date: 4..JAN.2025 09:37:29

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0

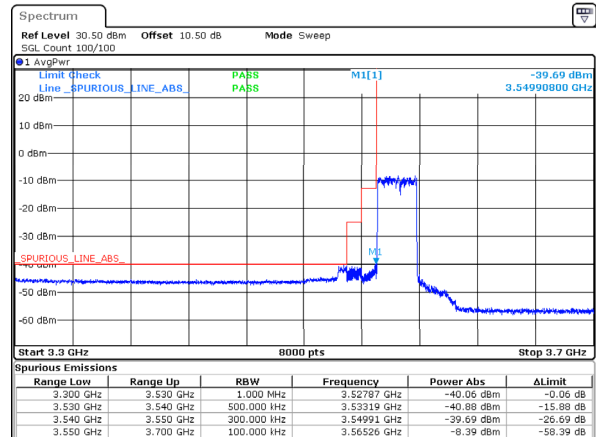


ProjectNo.:2401A43118E-RF Tester:Kungfaster Liang
Date: 12.JAN.2025 11:04:30

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77

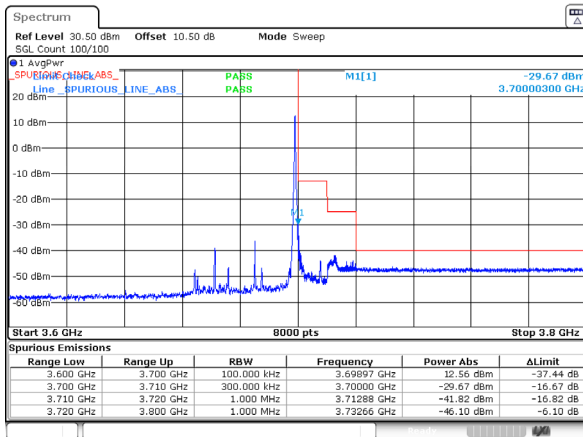


ProjectNo.:2401A43118E-RF Tester:Kungfaster Liang
Date: 4..JAN.2025 09:38:44

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0

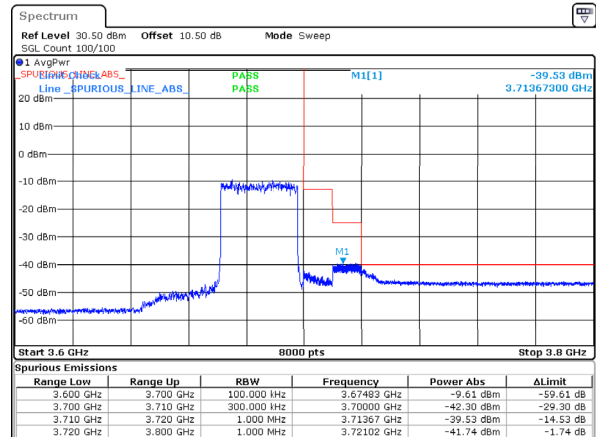


ProjectNo.:2401A43118E-RF Tester:Kungfaster Liang
Date: 12.JAN.2025 11:05:29

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

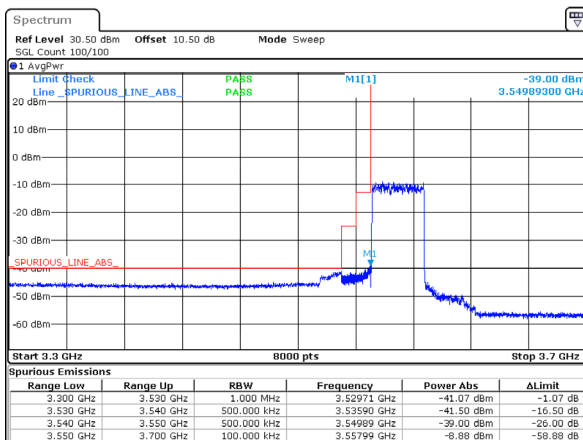


ProjectNo.:2401A43118E-RF Tester:Kungfaster Liang
Date: 12.JAN.2025 11:06:55

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0

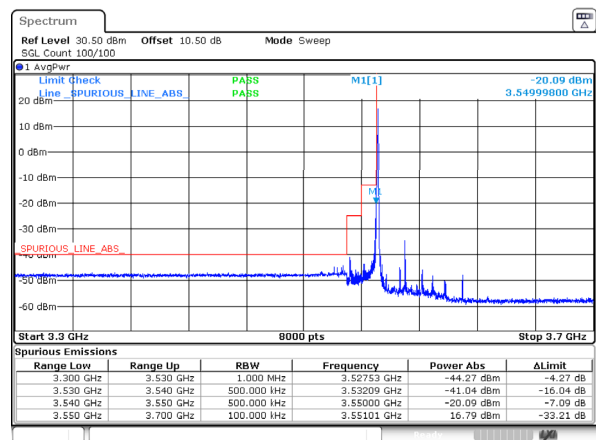


ProjectNo.:2401A43118E-RF Tester:Kungfaster Liang
Date: 4..JAN.2025 09:39:55

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

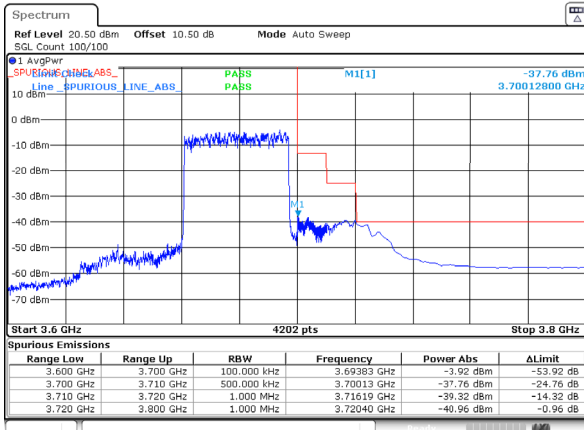


ProjectNo.:2401A43118E-RF Testers:Kungfumaster Liang
Date: 4..JAN.2025 09:46:45

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

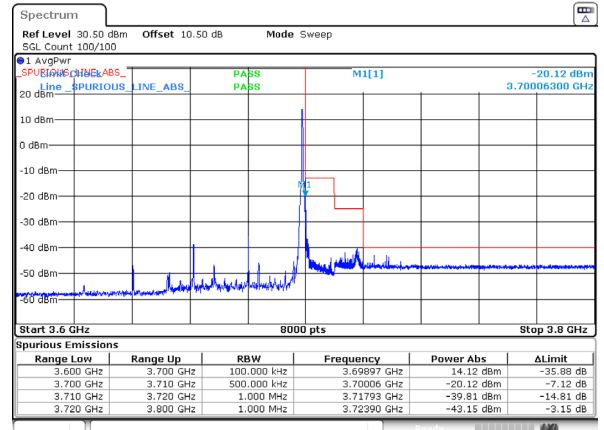


ProjectNo.:2401A43118E-RF Testers:Kungfumaster Liang
Date: 4..JAN.2025 09:41:58

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

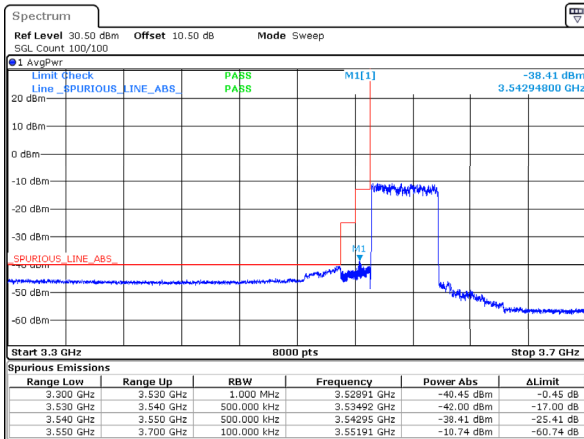


ProjectNo.:2401A43118E-RF Testers:Kungfumaster Liang
Date: 12.JAN.2025 11:07:44

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0

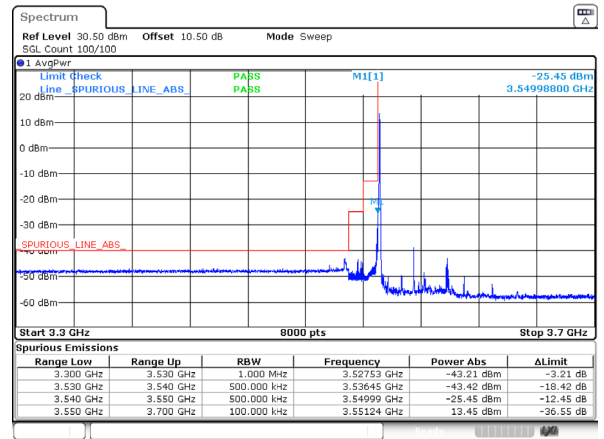


ProjectNo.:2401A43118E-RF Testers:Kungfumaster Liang
Date: 4..JAN.2025 09:47:25

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

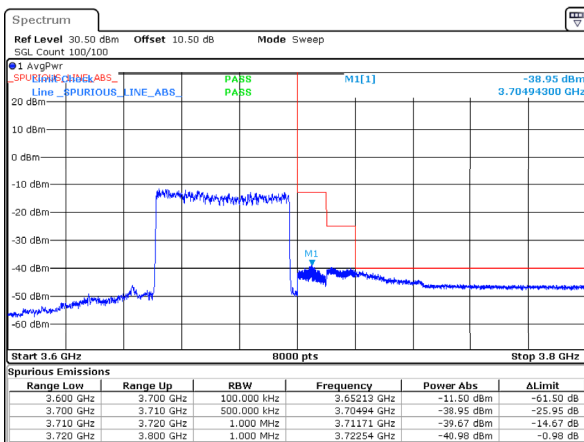


ProjectNo.:2401A43118E-RF Testers:Kungfumaster Liang
Date: 12.JAN.2025 11:08:52

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

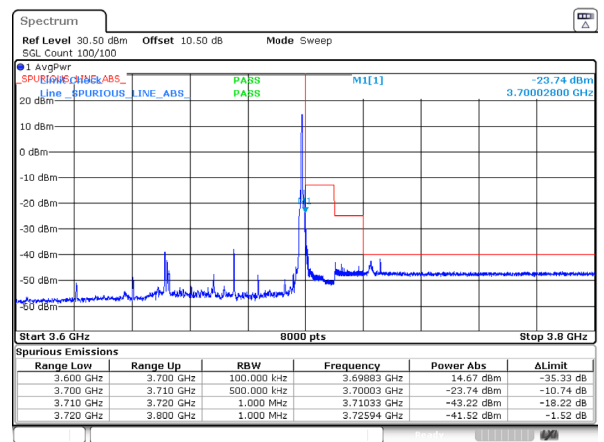


ProjectNo.:2401A43118E-RF Testers:Kungfumaster Liang
Date: 4..JAN.2025 09:48:35

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

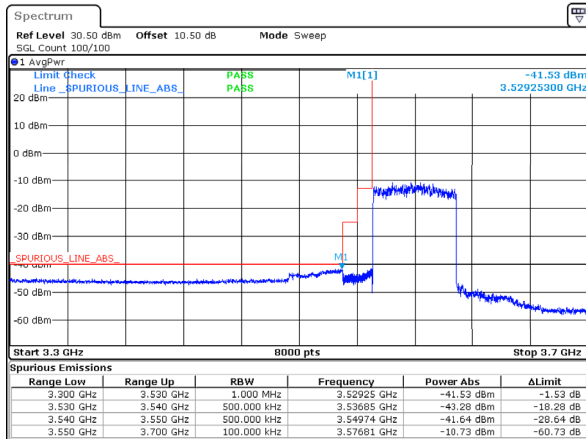


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:11:42

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0

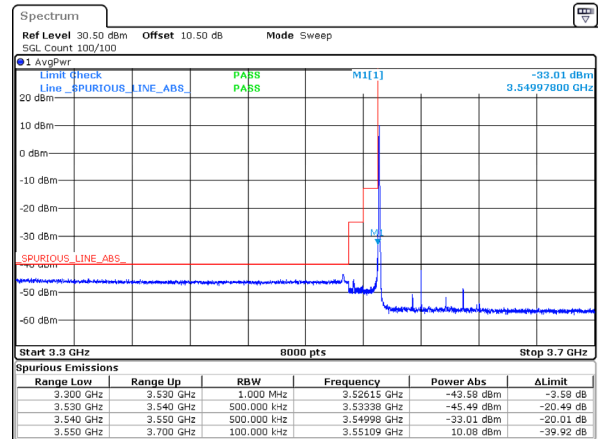


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:09:42

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0

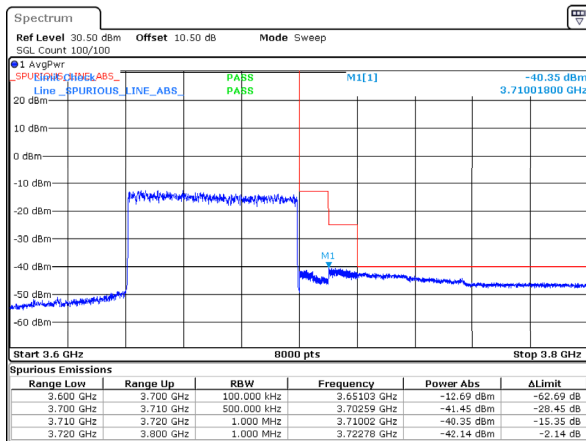


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:12:44

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161

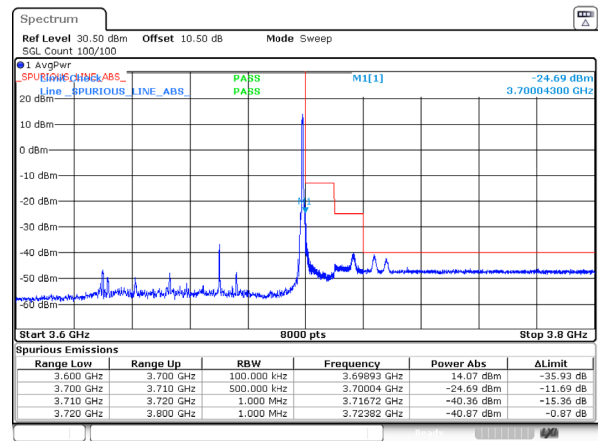


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4.JAN.2025 09:50:57

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0

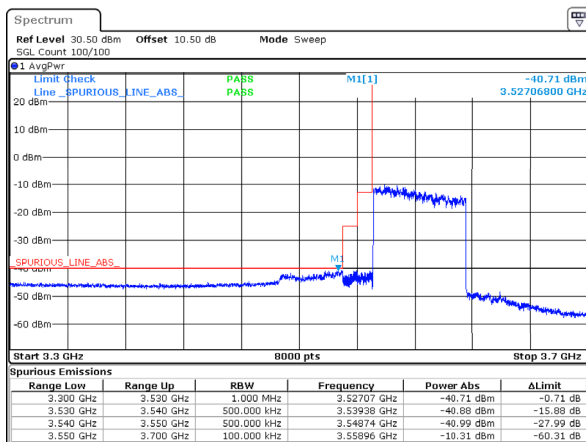


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:13:33

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0

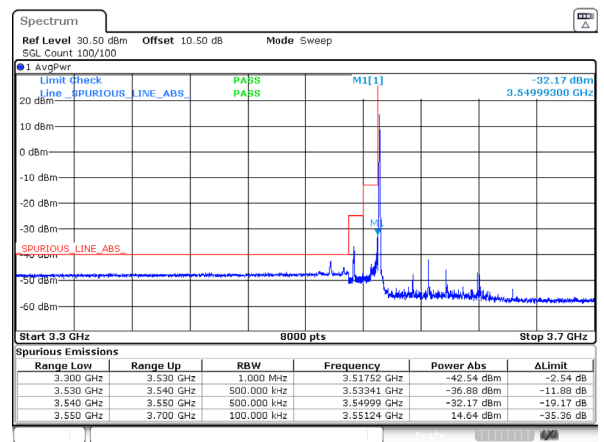


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4.JAN.2025 09:52:09

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0

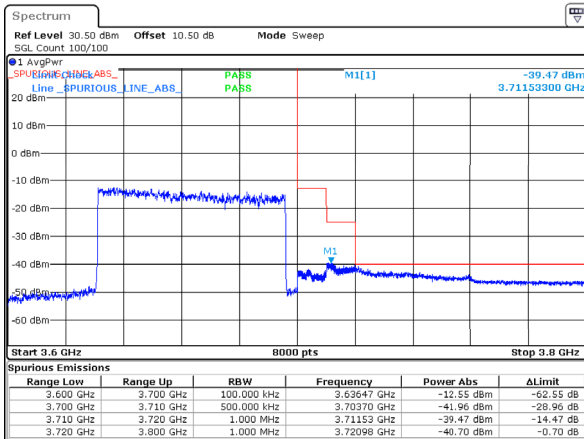


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:14:29

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188

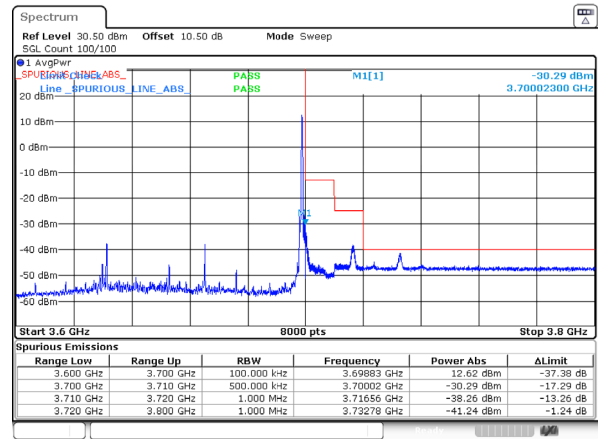


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4.JAN.2025 09:53:19

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@0

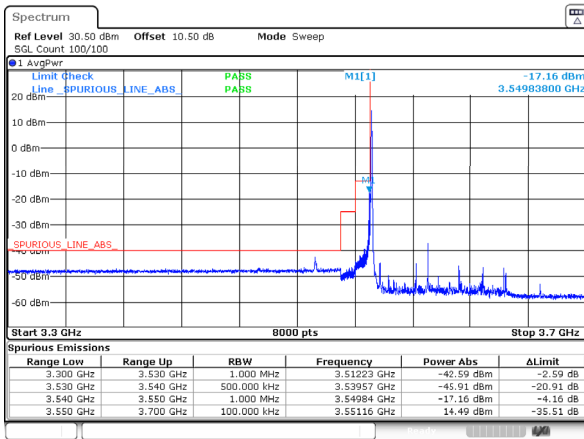


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4.JAN.2025 09:54:32

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

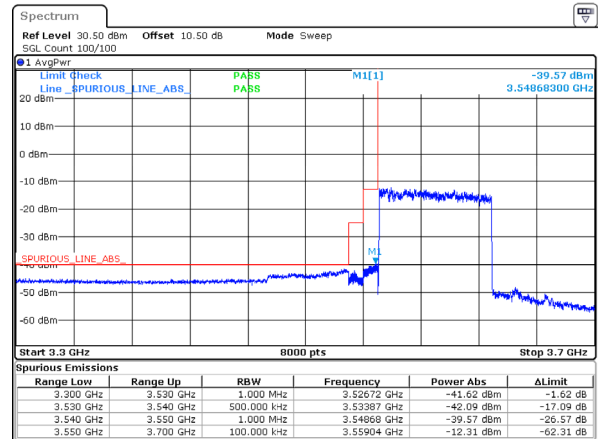


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:15:33

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

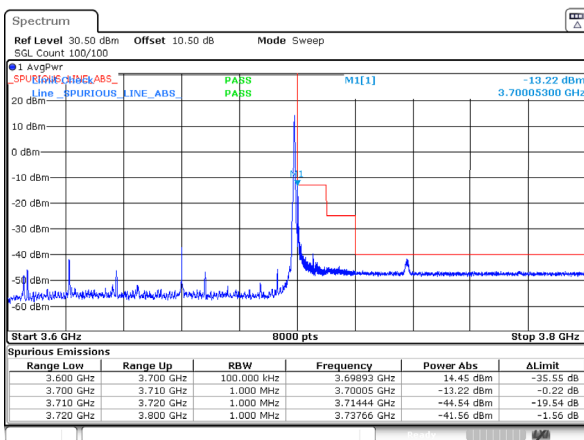


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4.JAN.2025 09:55:59

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

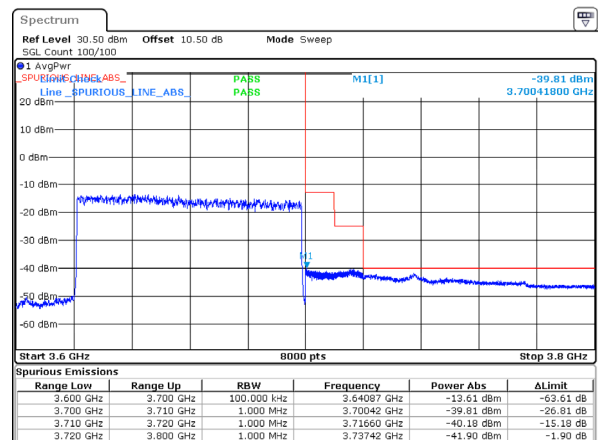


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:16:27

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@0

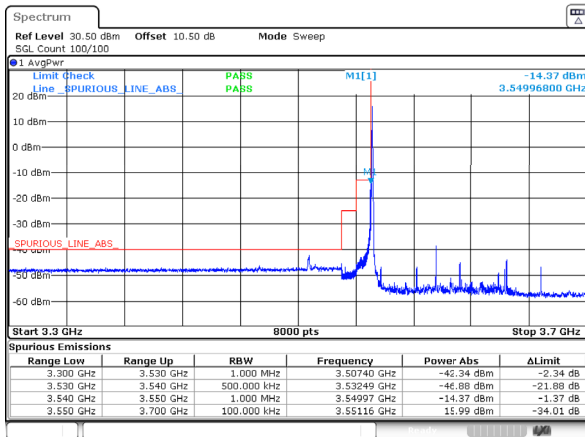


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4.JAN.2025 09:57:11

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

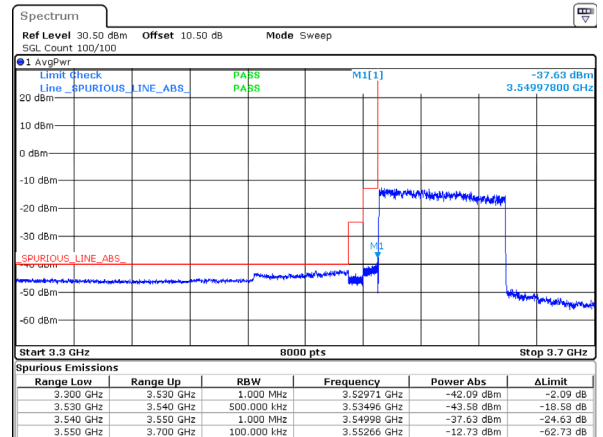


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:17:41

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244

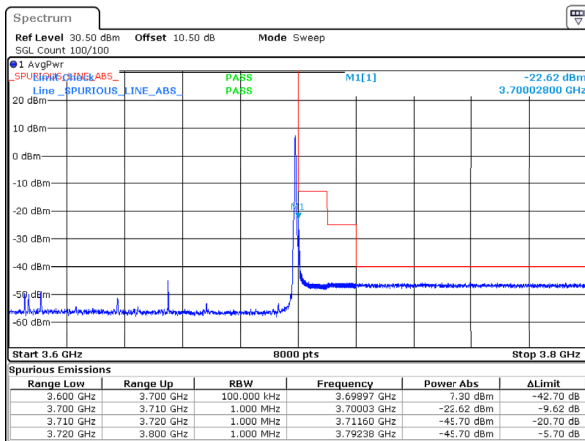


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:18:32

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0

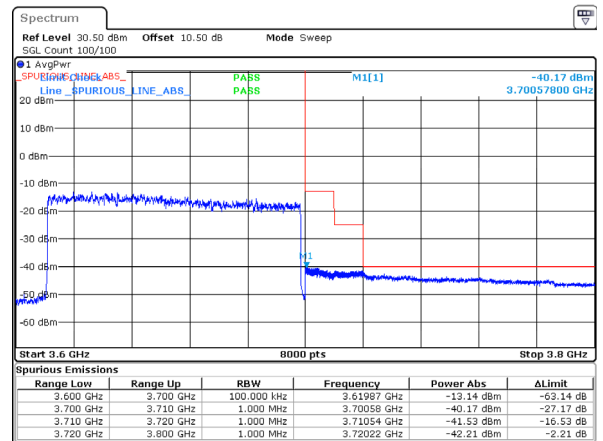


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:19:42

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@0

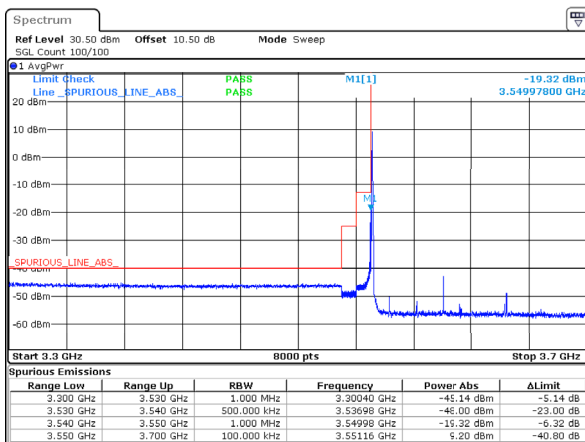


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:20:33

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0

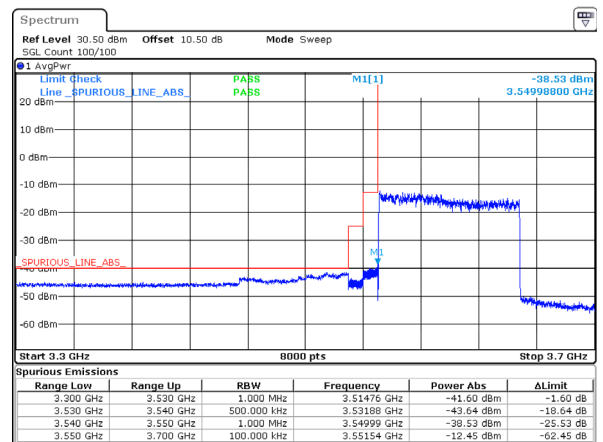


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:21:09

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272

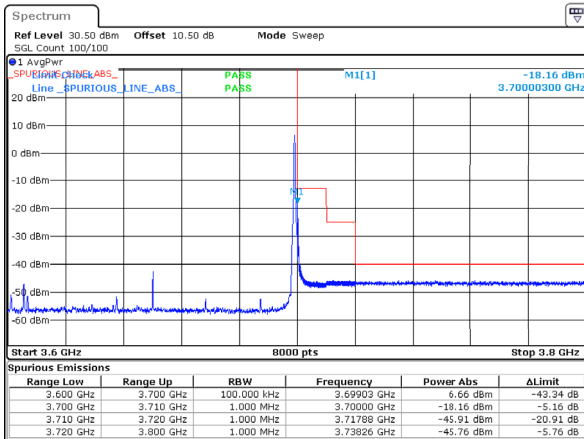

ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 12..JAN.2025 11:21:59


n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0

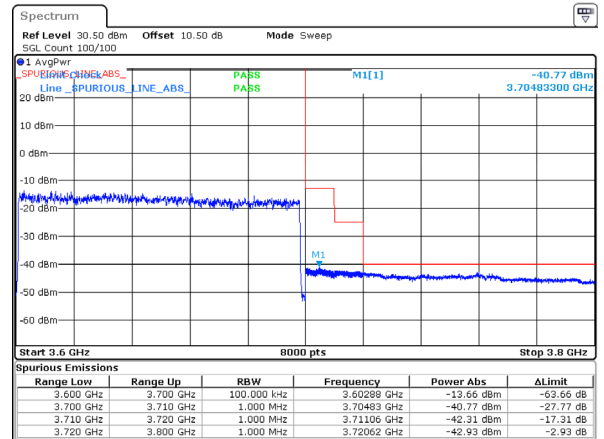

ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 12..JAN.2025 11:23:48


n78_2

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0

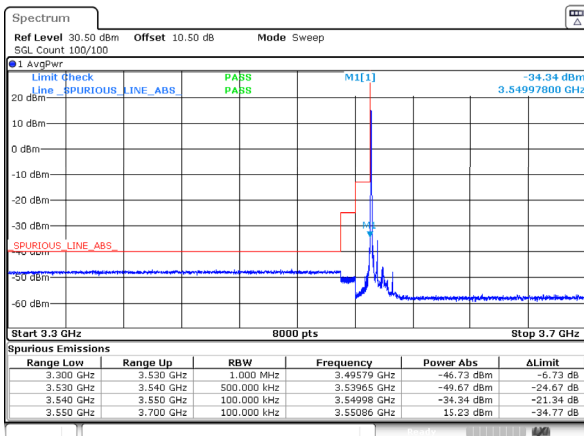


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4..JAN.2025 10:59:07

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0

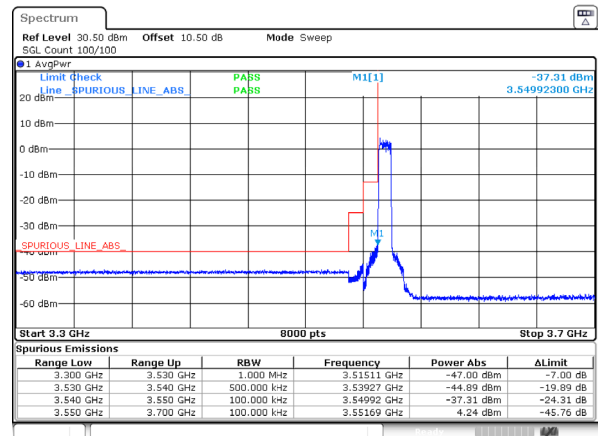


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4..JAN.2025 11:00:07

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

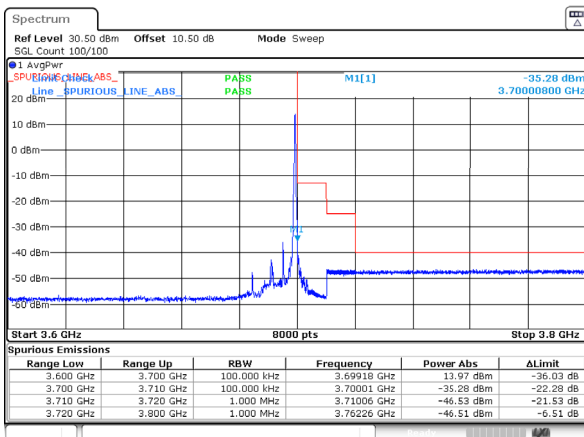


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4..JAN.2025 11:01:12

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0

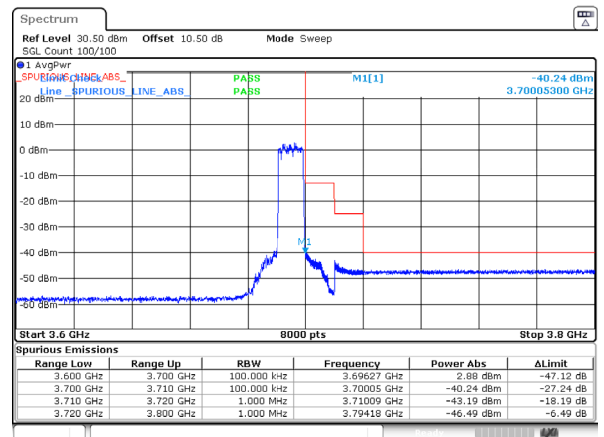


ProjectNo.:2401A43118E-RF Tester:Kungfamester Liang
Date: 4..JAN.2025 11:02:13

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

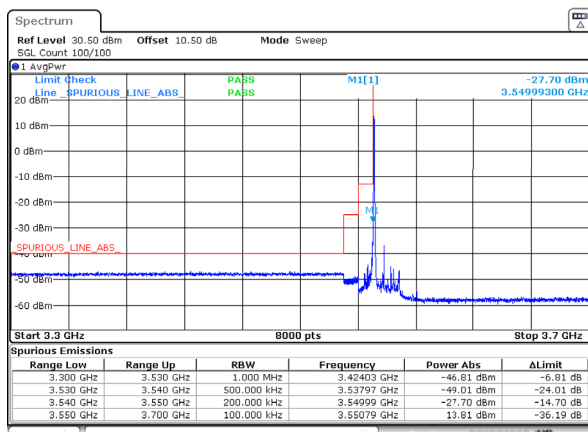


ProjectNo.:2401A43118E-RF Testert:Kungfamester Liang
Date: 4-JUN.2025 11:03:08

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

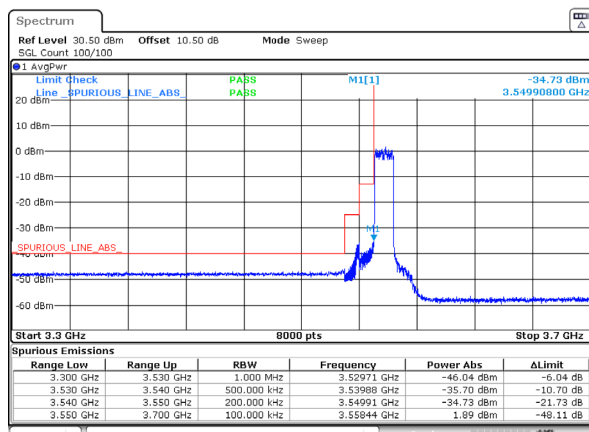


ProjectNo.:2401A43118E-RF Testert:Kungfamester Liang
Date: 4-JUN.2025 11:03:54

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37

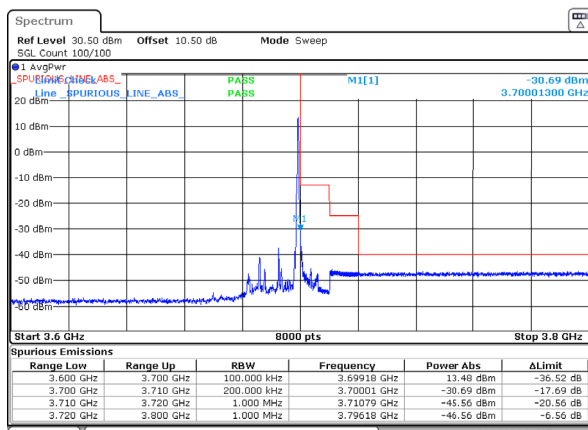


ProjectNo.:2401A43118E-RF Testert:Kungfamester Liang
Date: 4-JUN.2025 11:04:45

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0

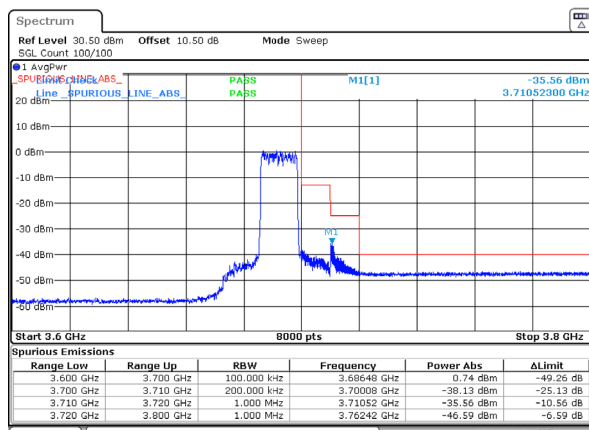


ProjectNo.:2401A43118E-RF Testert:Kungfamester Liang
Date: 4-JUN.2025 11:05:31

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0

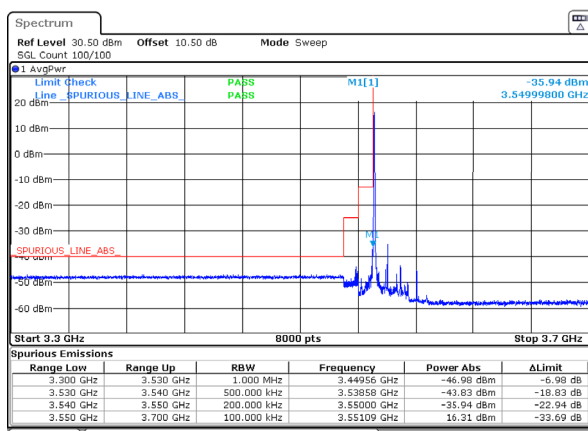


ProjectNo.:2401A43118E-RF Testert:Kungfamester Liang
Date: 4-JUN.2025 11:06:44

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0

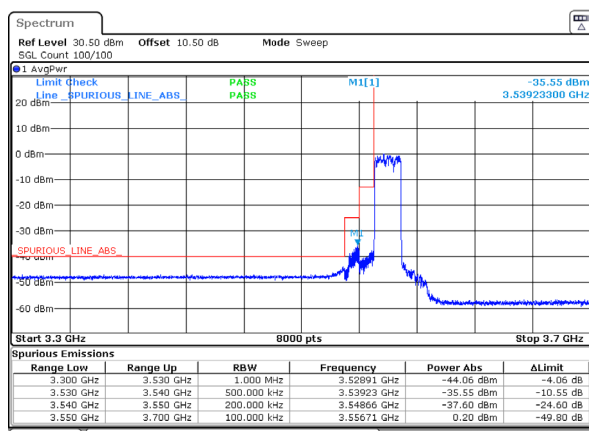


ProjectNo.:2401A43118E-RF Testert:Kungfamester Liang
Date: 4-JUN.2025 11:07:31

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50

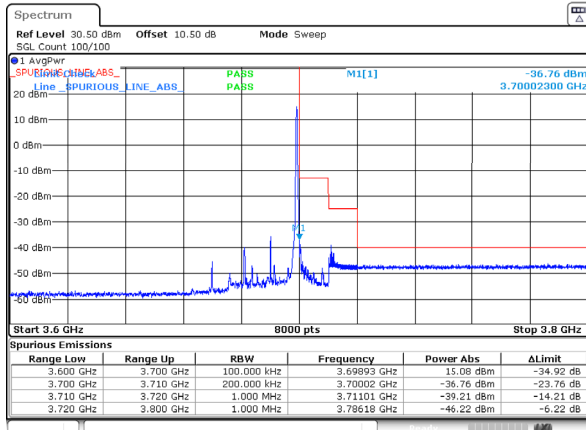


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4..JAN.2025 11:08:22

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0

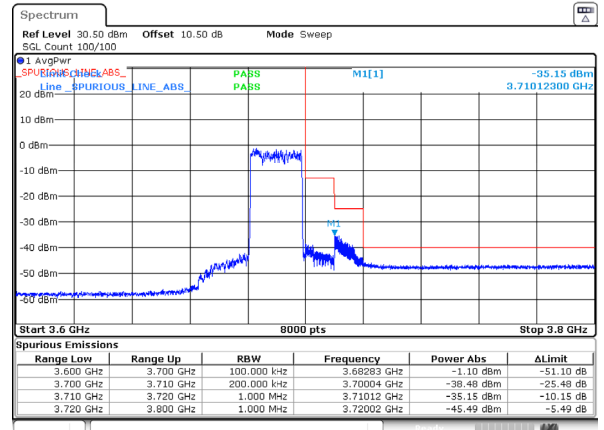


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4..JAN.2025 11:09:09

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0

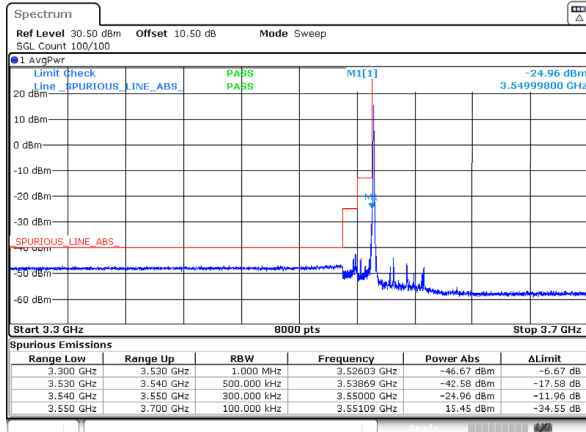


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 4..JAN.2025 11:10:00

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0

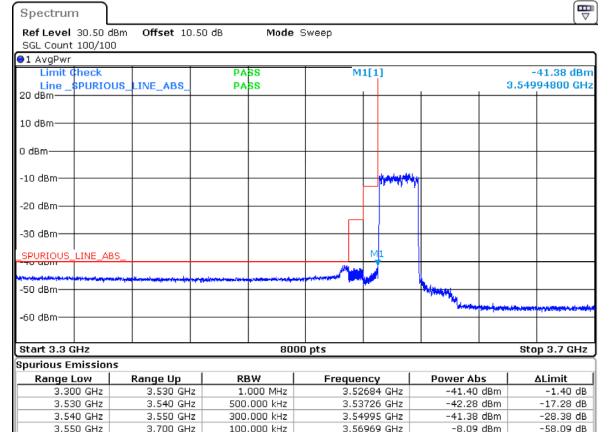


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:27:07

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77

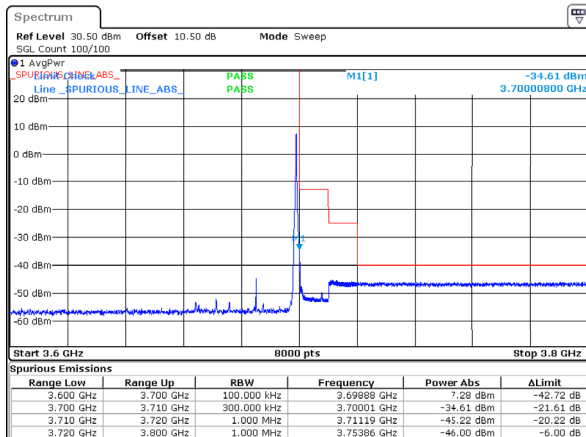


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:27:57

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0

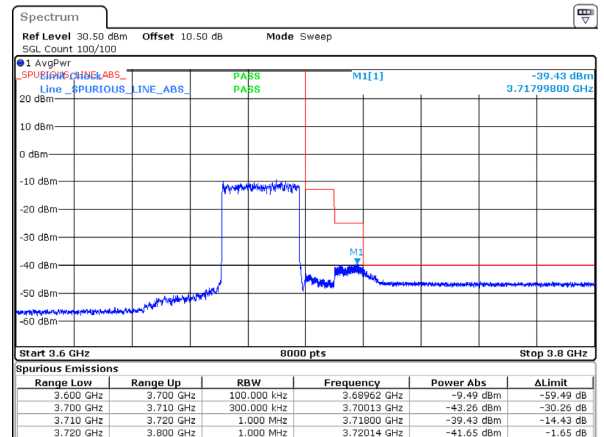


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:29:04

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

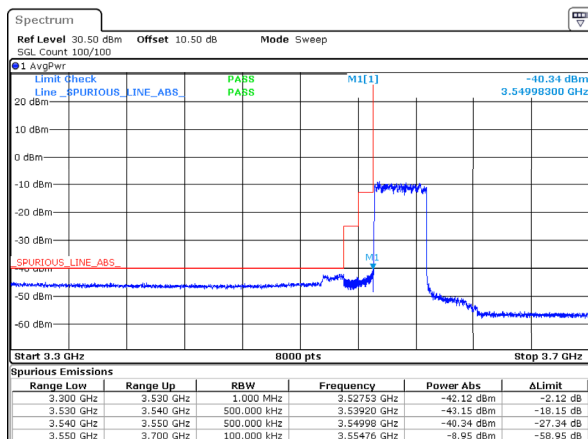


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:30:57

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0

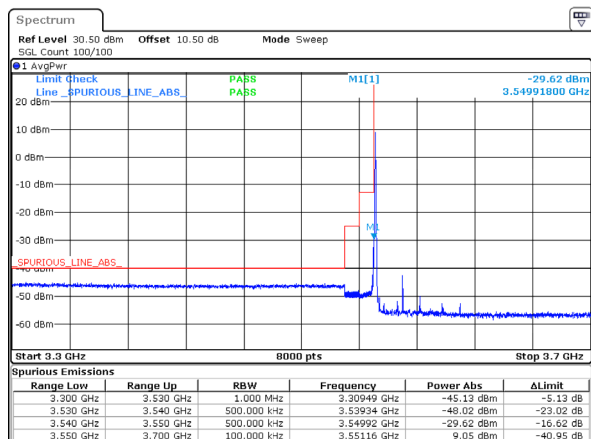


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:29:54

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

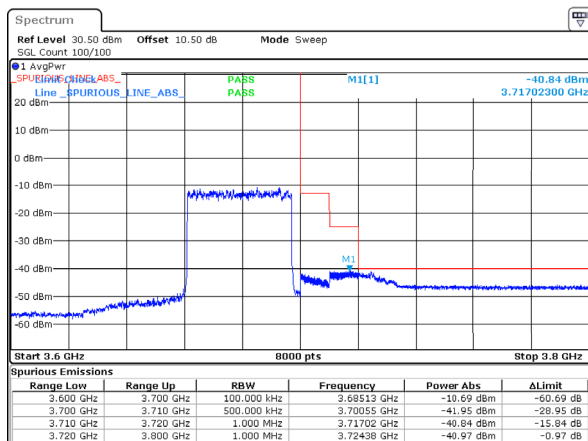


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:32:56

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

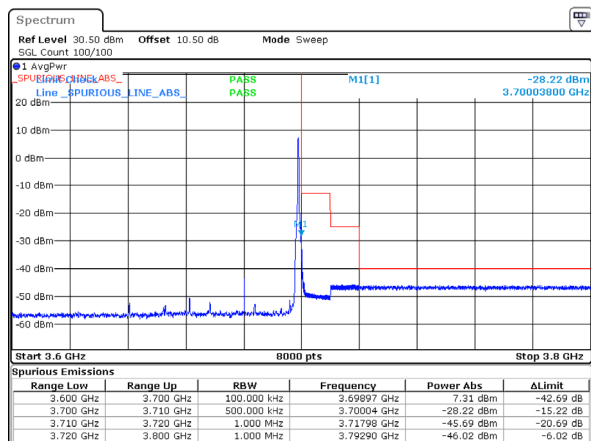


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:31:51

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

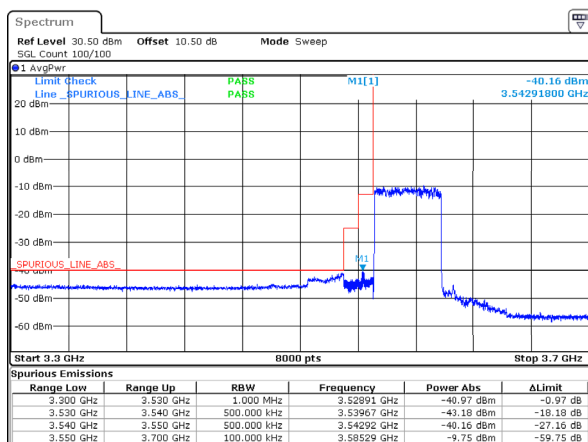


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:35:07

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0

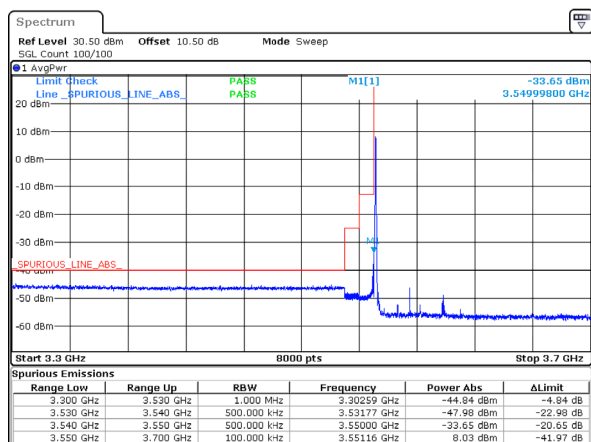


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:33:47

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

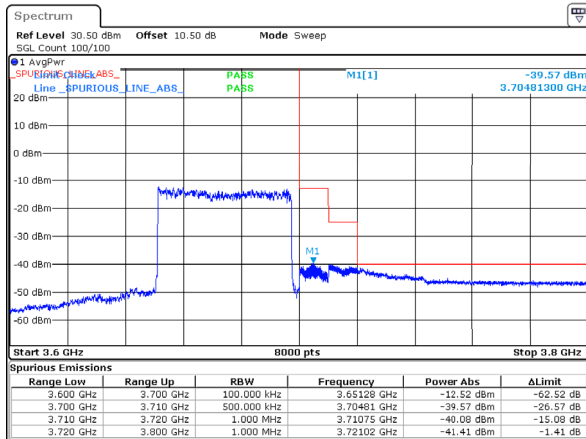


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:37:07

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

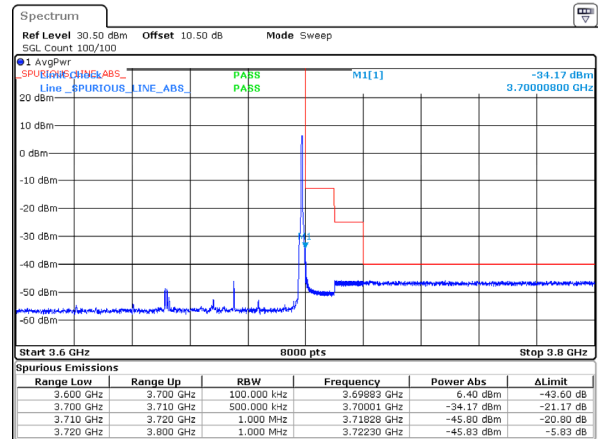


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:36:23

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

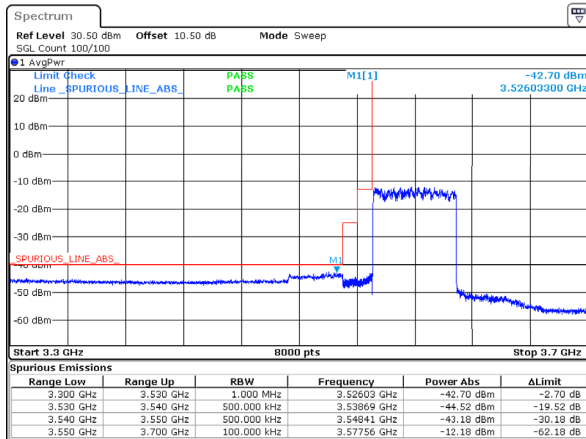


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:40:12

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0

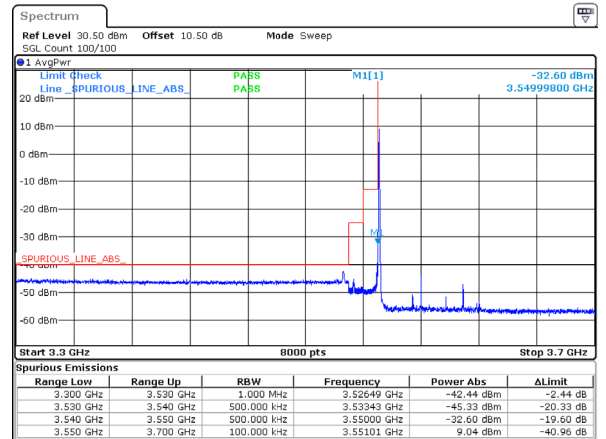


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:38:44

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0

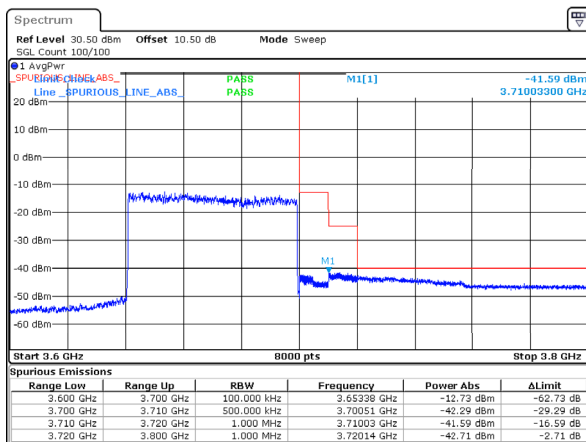


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:42:58

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161

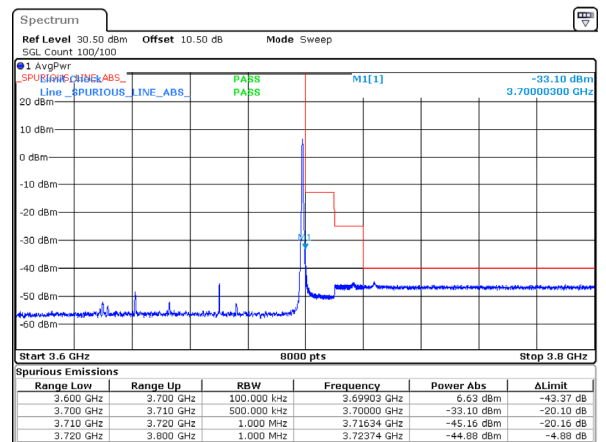


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:41:40

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0

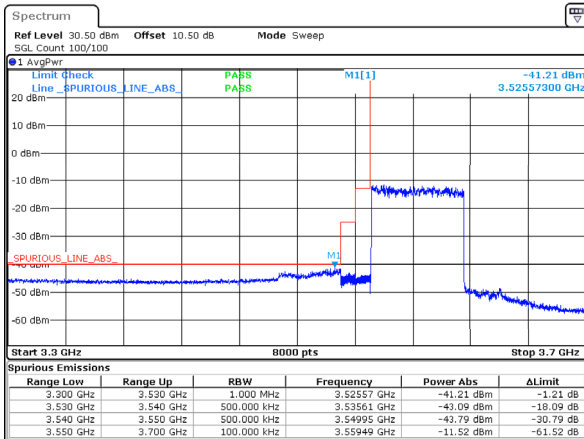


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:45:26

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0

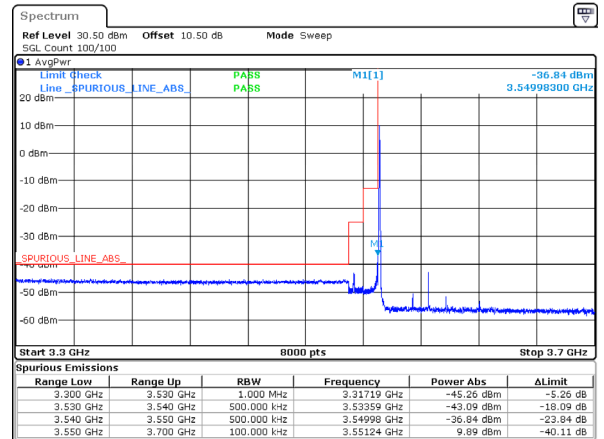


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:44:16

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0

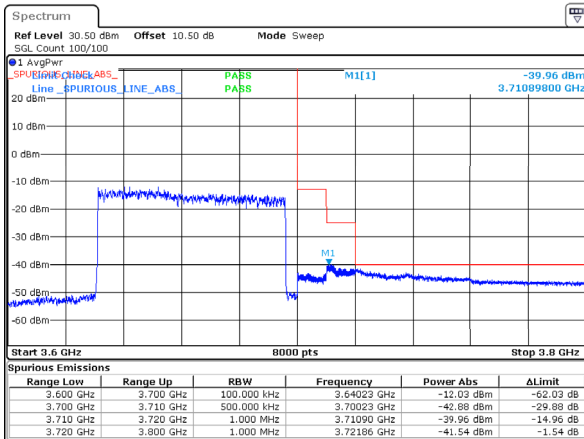


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:48:12

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188

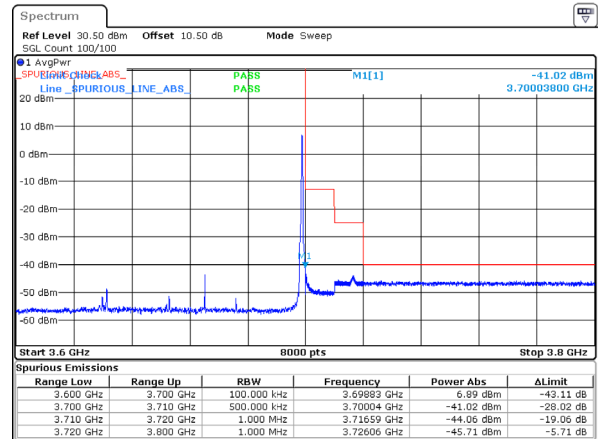


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:47:13

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@0

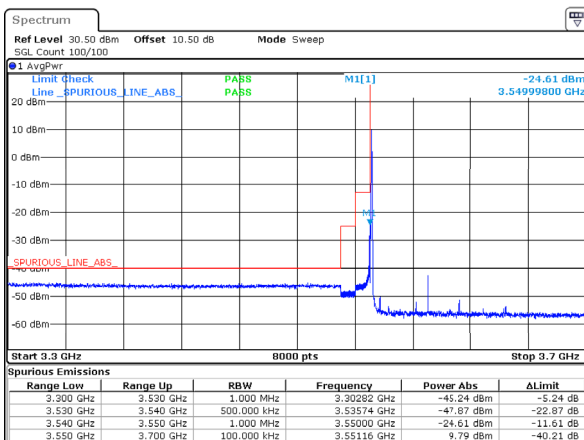


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:49:40

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

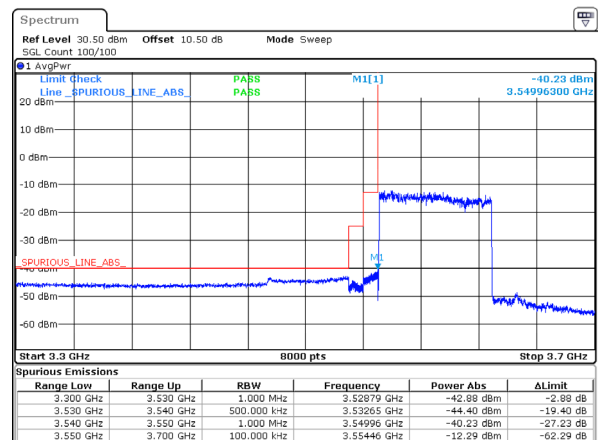


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:51:16

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

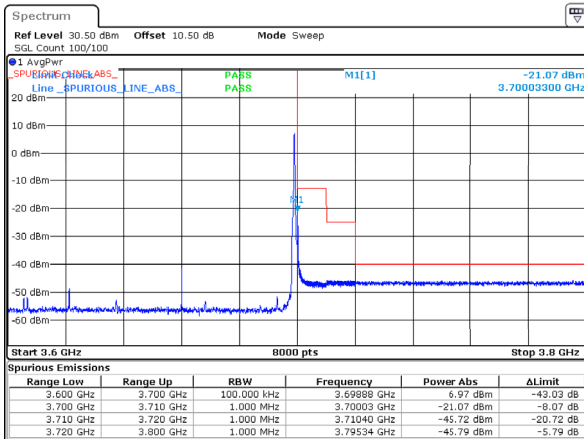


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:52:47

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

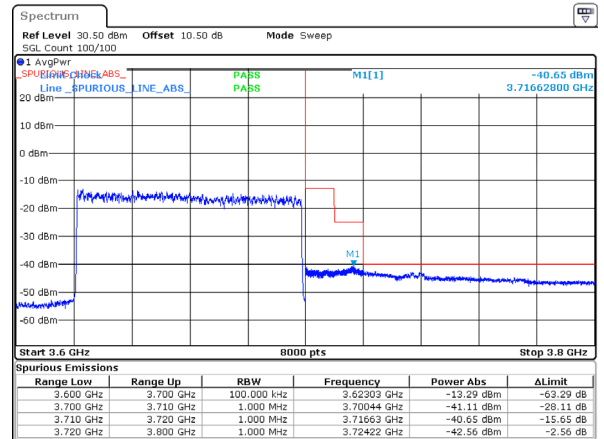


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:54:13

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@0

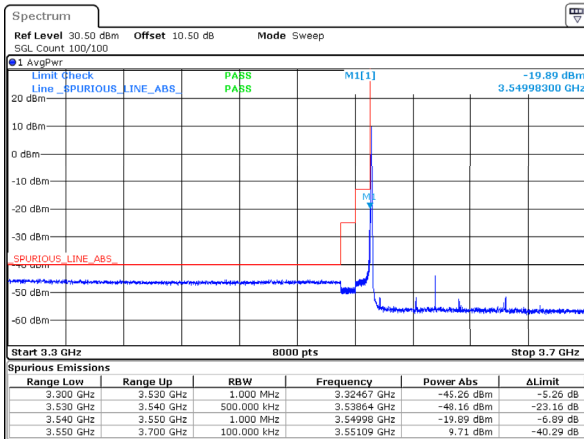


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:55:41

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

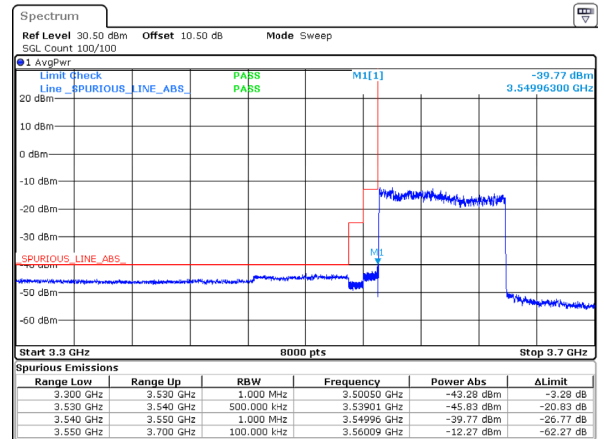


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:57:10

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244

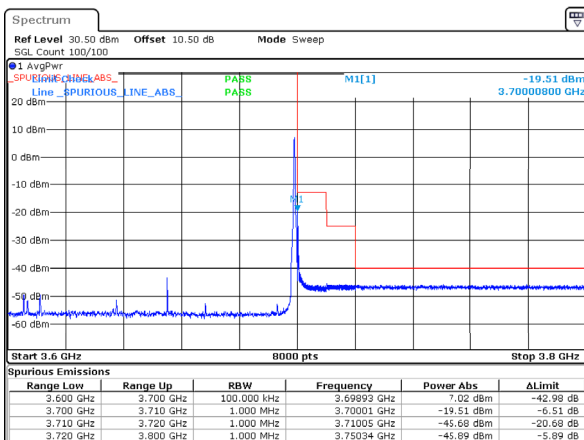


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 11:58:48

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0

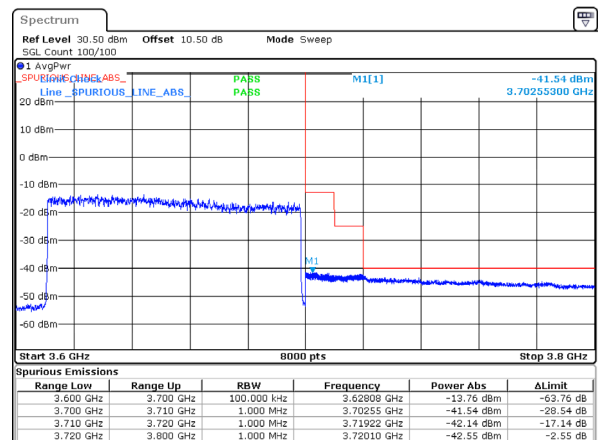


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 12:00:13

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@0

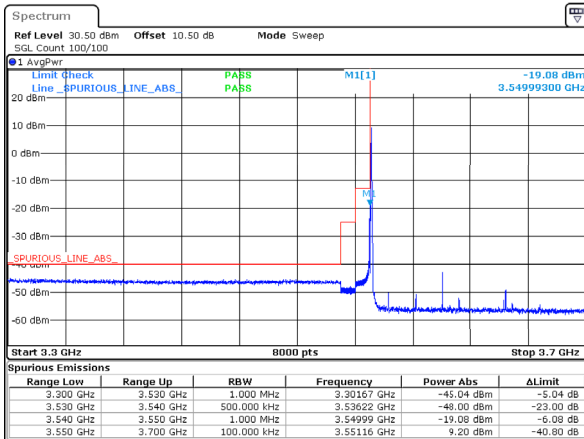


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 12:01:20

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0

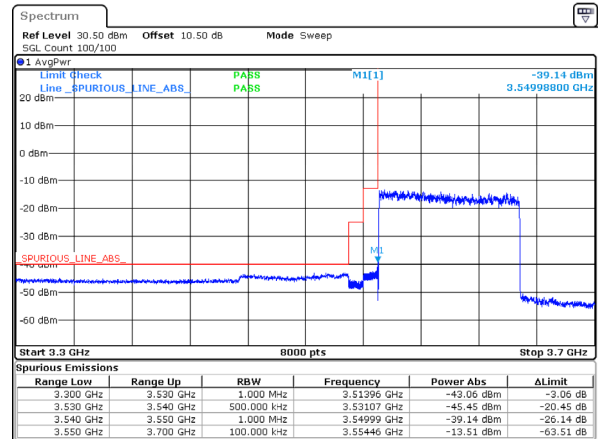


ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 12:02:42

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272

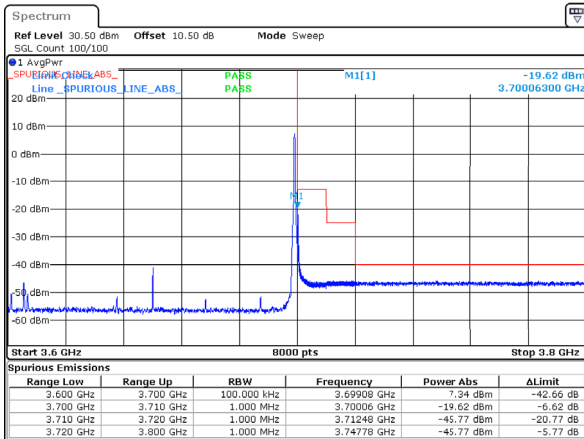

ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 12:03:46

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0

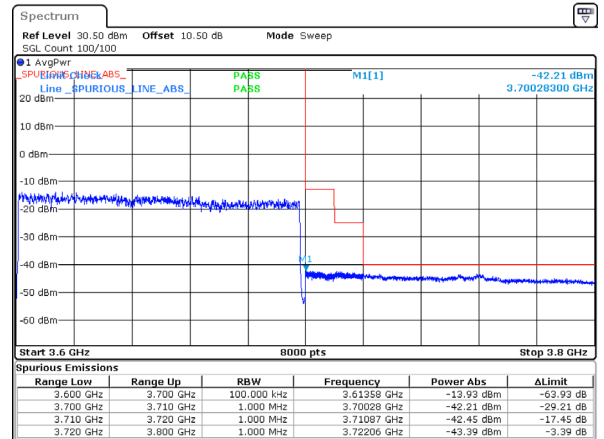

ProjectNo.:2401A43118E-RF Tester:Kungfumaster Liang
Date: 12.JAN.2025 12:05:11