

Test Information:

Sample No.:	2UGH-1	Test Date:	2024/12/07~2024/12/16
Test Site:	RF	Test Mode:	Transmitting
Tester:	Kungfumaster Liang	Test Result:	Pass

Environmental Conditions:

Temperature: (°C):	22.1-25.7	Relative Humidity: (%)	46-53	ATM Pressure: (kPa)	100.9-101
-----------------------	-----------	---------------------------	-------	------------------------	-----------

Out of band emission, Band Edge

FCC Part 96

n77_2

Mode	Result (MHz)	Limit	Verdict
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-41.271	See Graphs	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-41.080	See Graphs	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-40.581	See Graphs	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-40.655	See Graphs	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-34.546	See Graphs	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-41.289	See Graphs	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-39.441	See Graphs	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-39.937	See Graphs	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-41.009	See Graphs	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-41.014	See Graphs	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-40.547	See Graphs	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-40.014	See Graphs	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-33.603	See Graphs	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-40.975	See Graphs	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-32.994	See Graphs	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-39.930	See Graphs	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-41.063	See Graphs	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-27.050	See Graphs	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-39.994	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-25.821	See Graphs	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-40.885	See Graphs	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-31.188	See Graphs	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-39.952	See Graphs	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-30.708	See Graphs	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-41.027	See Graphs	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-28.275	See Graphs	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-40.418	See Graphs	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-28.663	See Graphs	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-41.083	See Graphs	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-32.990	See Graphs	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-40.198	See Graphs	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-32.537	See Graphs	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-27.187	See Graphs	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-27.233	See Graphs	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-22.707	See Graphs	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-37.700	See Graphs	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-27.821	See Graphs	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-24.899	See Graphs	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-24.689	See Graphs	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-40.127	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-20.831	See Graphs	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-27.039	See Graphs	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-18.525	See Graphs	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-40.083	See Graphs	Pass

n78_2


Mode	Result (MHz)	Limit	Verdict
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-41.049	See Graphs	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-41.173	See Graphs	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-40.566	See Graphs	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-40.551	See Graphs	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-35.536	See Graphs	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-41.108	See Graphs	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-37.328	See Graphs	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-40.104	See Graphs	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-40.948	See Graphs	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-40.921	See Graphs	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-40.530	See Graphs	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-40.095	See Graphs	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-32.314	See Graphs	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-40.767	See Graphs	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-34.608	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-40.144	See Graphs	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-40.918	See Graphs	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-28.922	See Graphs	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-40.091	See Graphs	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-27.932	See Graphs	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-40.287	See Graphs	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-31.225	See Graphs	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-39.815	See Graphs	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-32.462	See Graphs	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-40.994	See Graphs	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-27.931	See Graphs	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-40.355	See Graphs	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-28.859	See Graphs	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-40.882	See Graphs	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-31.413	See Graphs	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-40.194	See Graphs	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-34.331	See Graphs	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-25.619	See Graphs	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-27.084	See Graphs	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-24.565	See Graphs	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-38.390	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-24.996	See Graphs	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-27.519	See Graphs	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-22.788	See Graphs	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-40.201	See Graphs	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-18.769	See Graphs	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-25.099	See Graphs	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-24.673	See Graphs	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-40.135	See Graphs	Pass


n77_2

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0

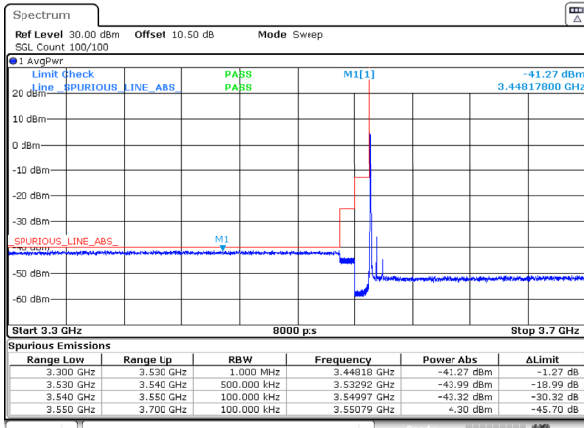


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang
Date: 7.DEC.2024 18:51:28

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0

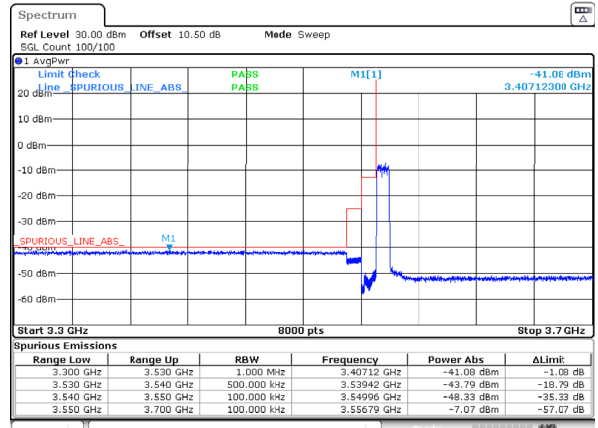


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang
Date: 7.DEC.2024 18:52:20

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

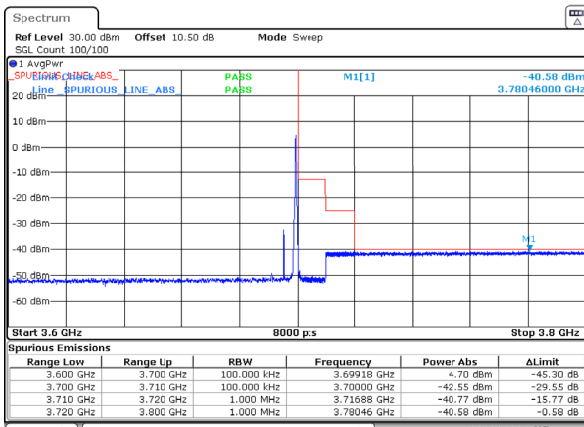


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang
Date: 7.DEC.2024 18:53:15

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0

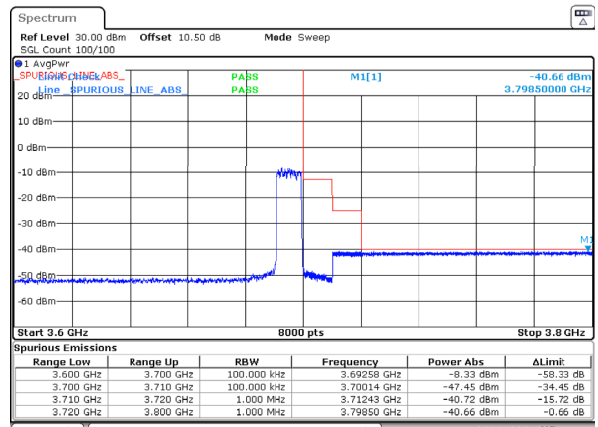


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang
Date: 7.DEC.2024 18:54:05

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

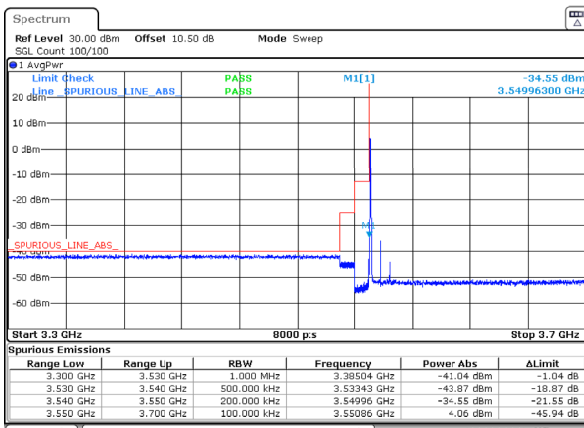


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang
Date: 7.DEC.2024 18:55:07

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

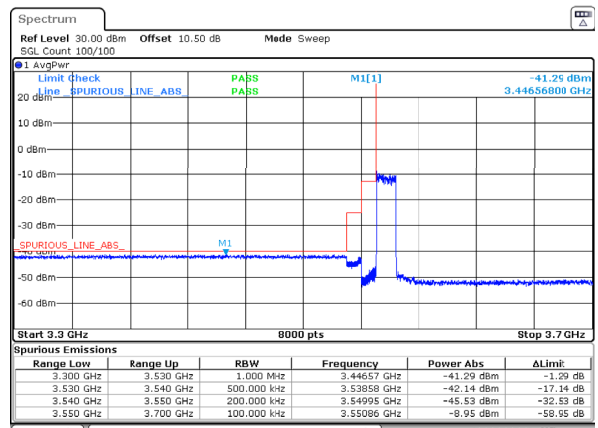


ProjectNo.:2401Z104805E-RF Tester:Mingfamester Liang
Date: 7.DEC.2024 18:55:58

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37

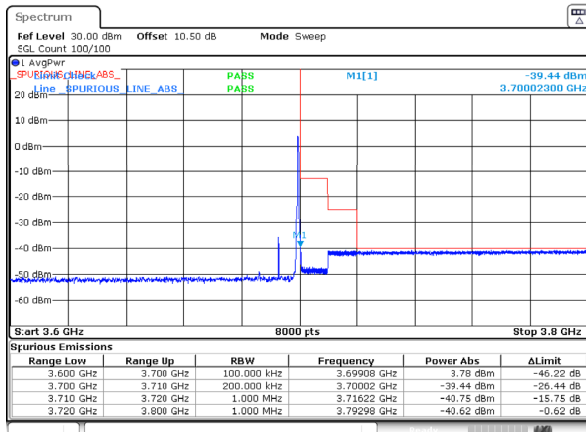


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 18:56:54

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0

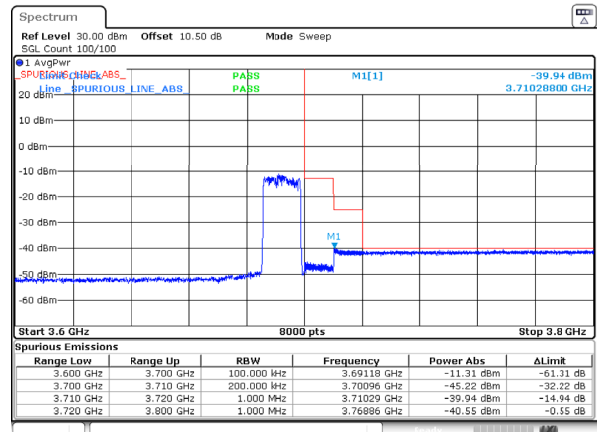


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 18:57:45

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0

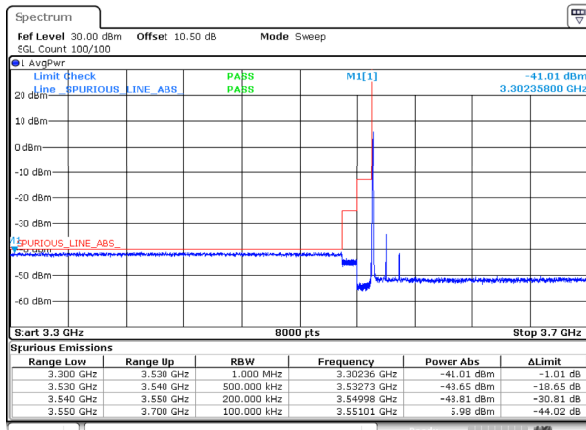


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:00:48

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0

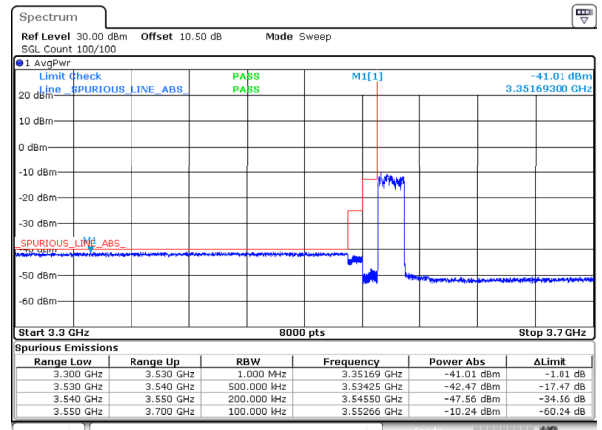


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:01:26

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50

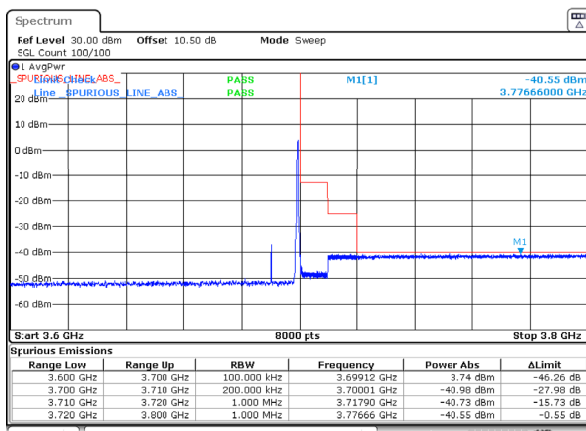


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:08:42

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0

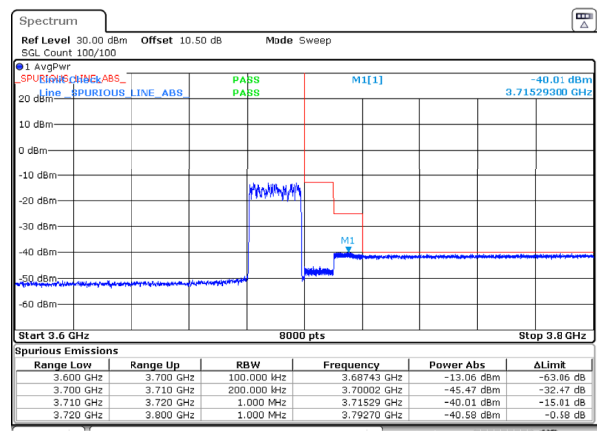


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:09:33

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0

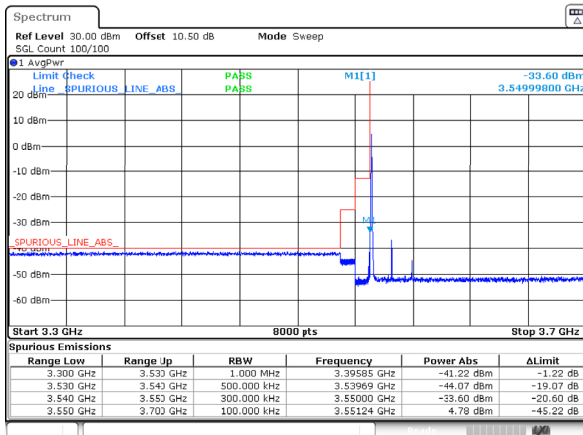


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang
Date: 7.DEC.2024 19:10:33

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0

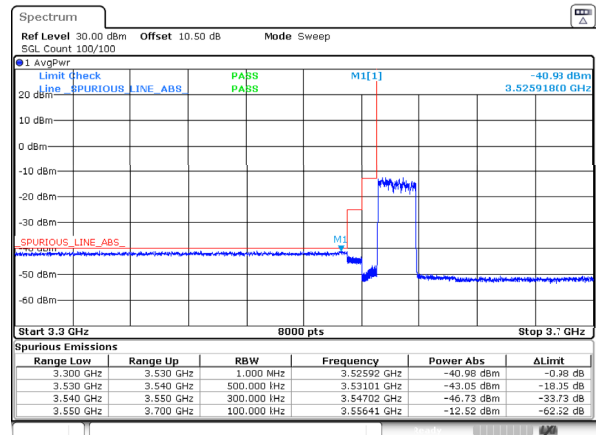


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang
Date: 7.DEC.2024 15:11:25

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77

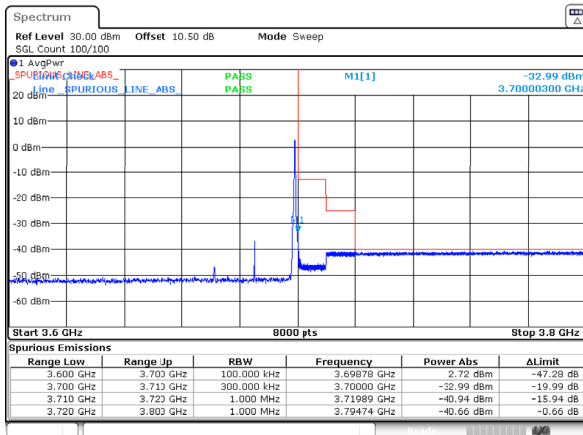


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang
Date: 7.DEC.2024 19:12:25

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0

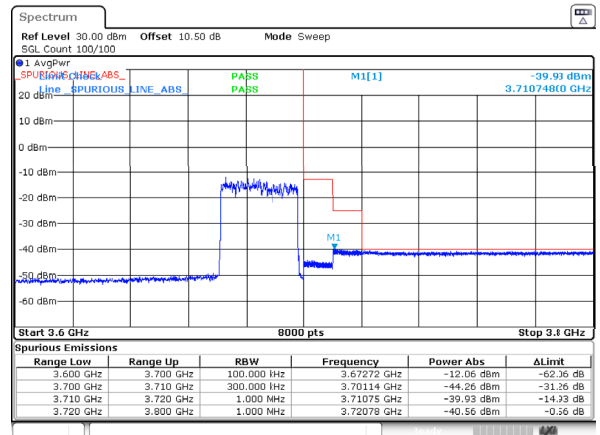


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang
Date: 7.DEC.2024 15:13:15

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

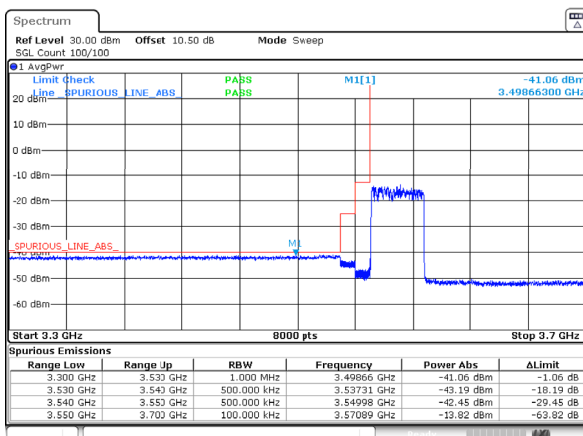


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang
Date: 7.DEC.2024 19:15:07

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0

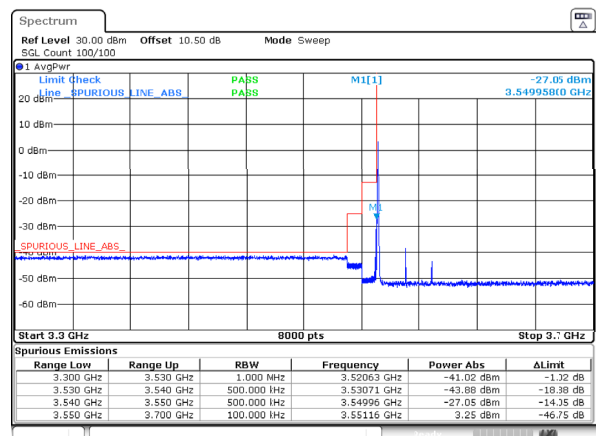


ProjectNo.:2401Z104805E-RF Tester:Mingfumeister Liang
Date: 7.DEC.2024 15:14:15

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

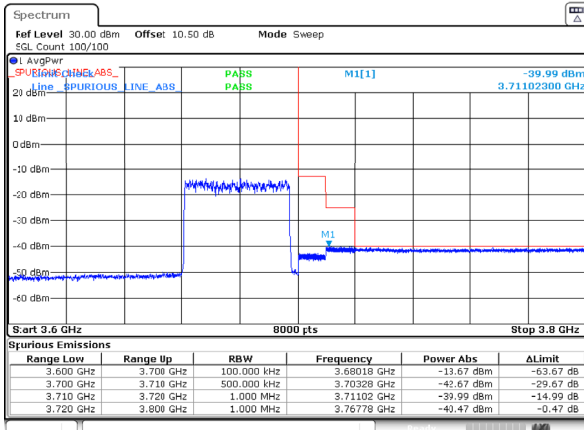


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:16:55

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

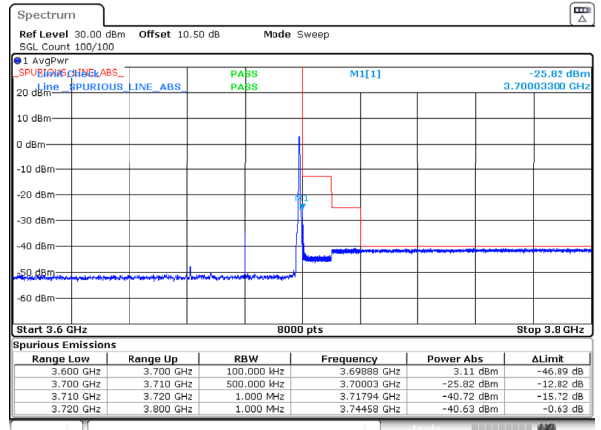


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:16:03

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

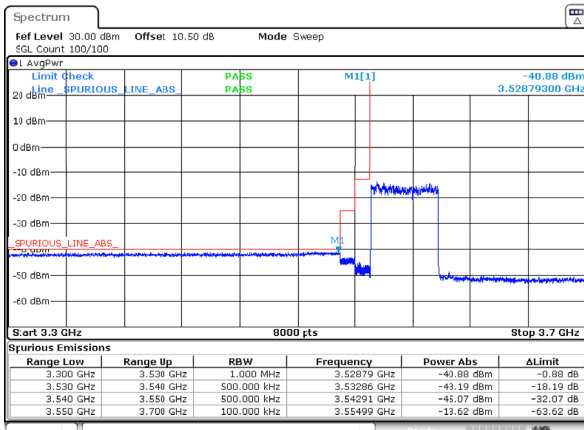


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:18:49

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0

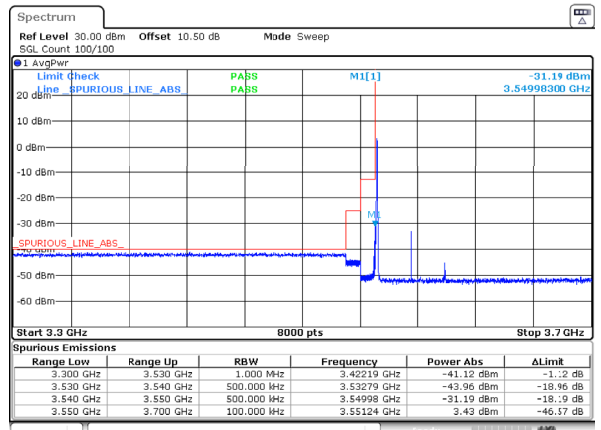


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:17:56

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

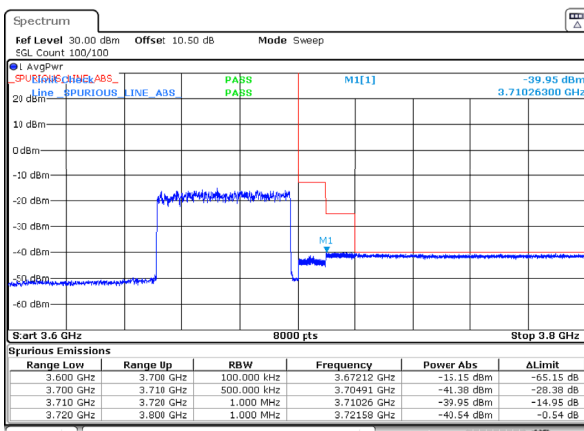


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:20:37

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

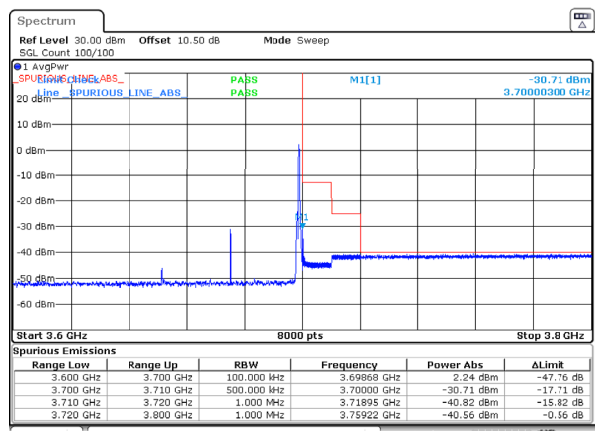


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:19:46

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

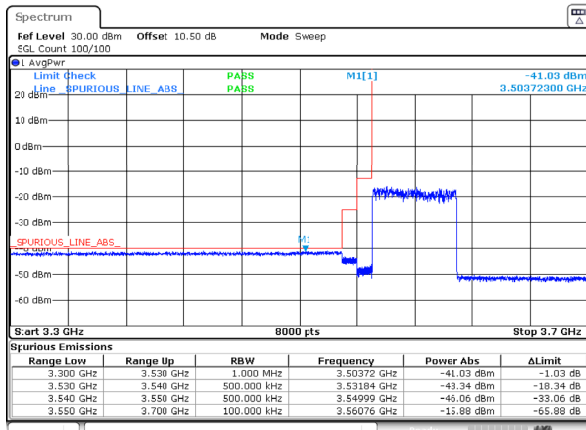


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:22:30

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0

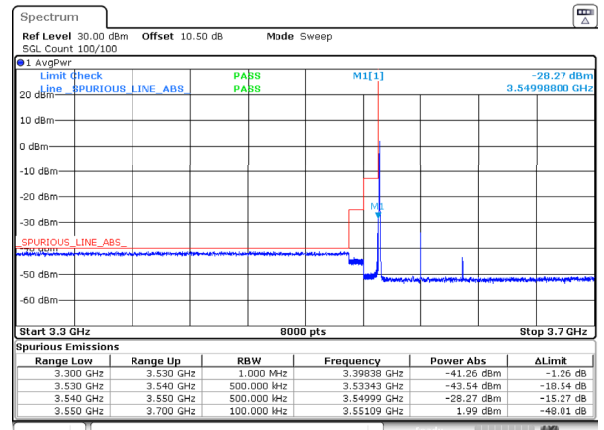


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:21:37

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0

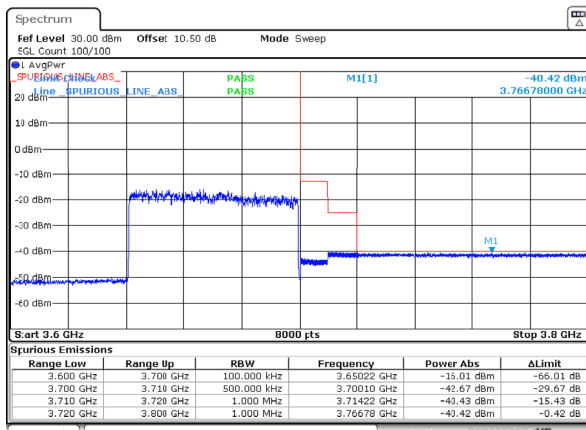


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:24:19

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161

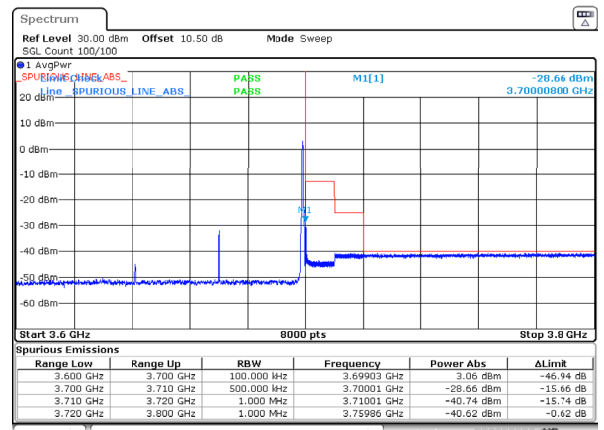


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:23:27

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0

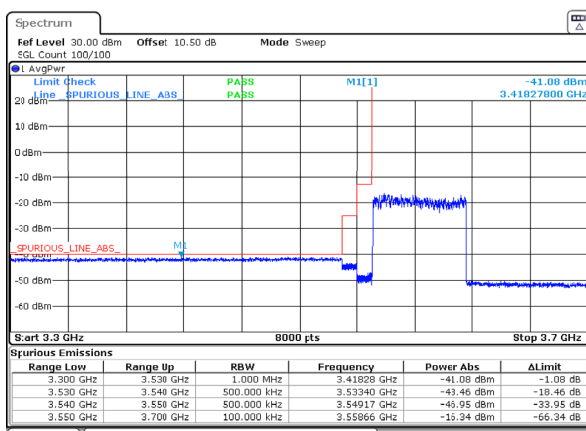


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:26:14

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0

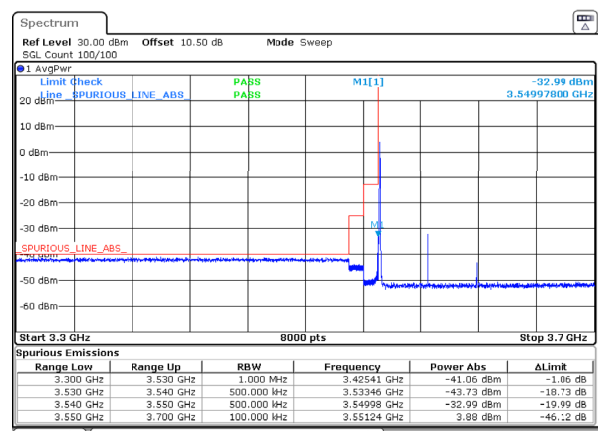


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:25:20

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0

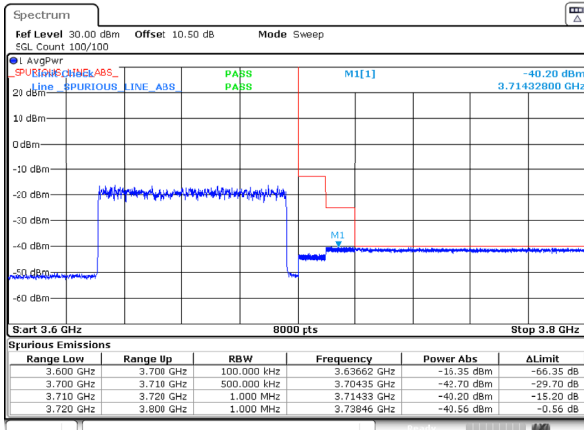


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:28:07

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188

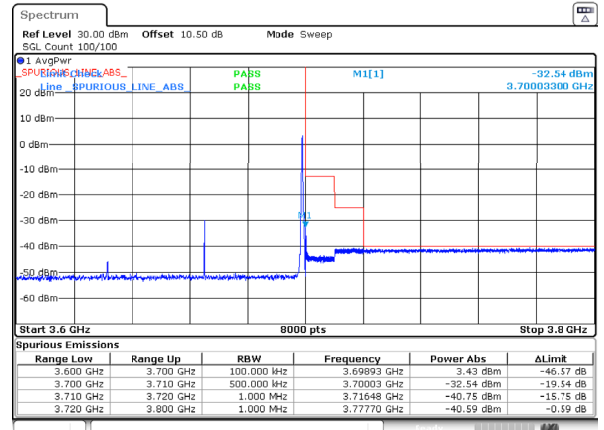


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:27:15

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@0

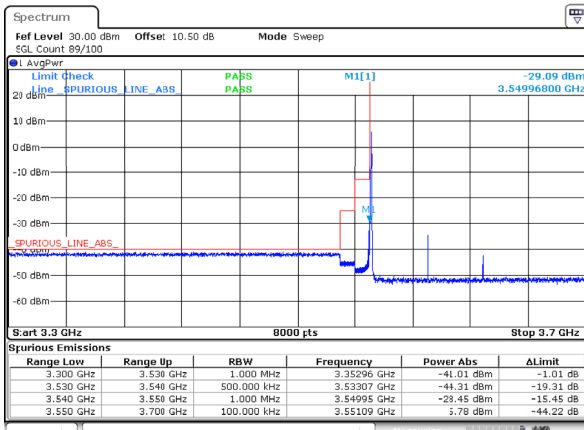


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:20:21

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

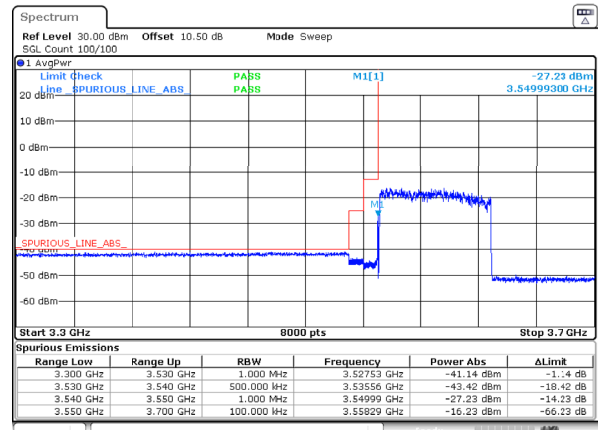


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:30:02

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

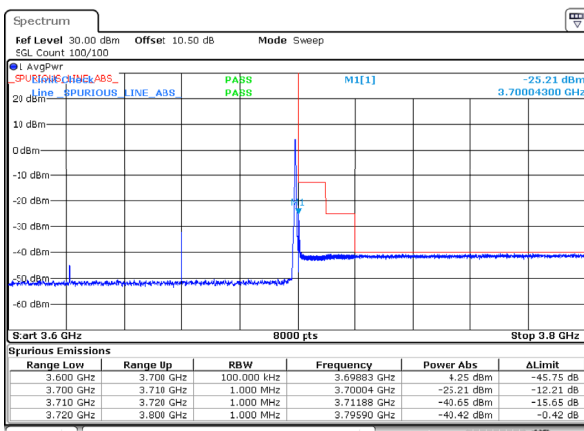


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:21:20

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

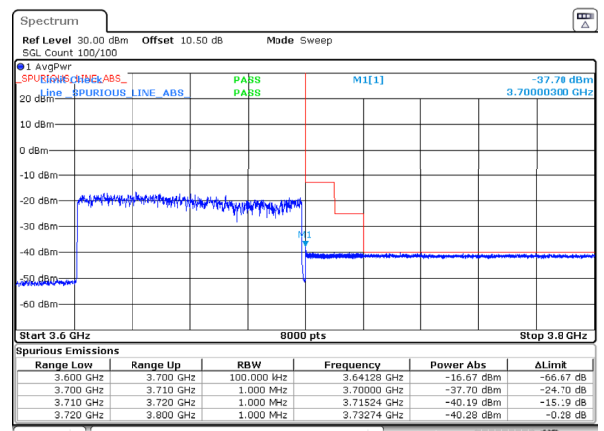


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 19:31:52

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@0

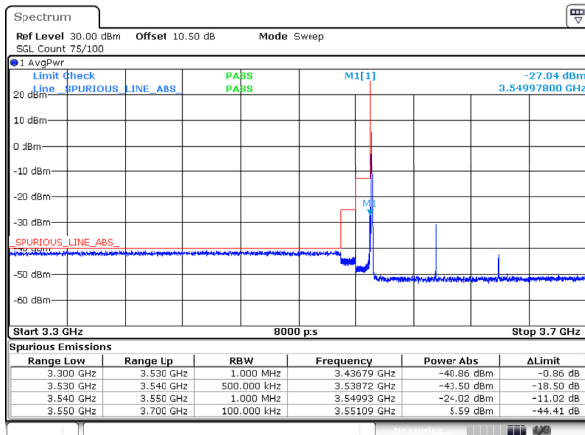


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang
Date: 16.DEC.2024 14:04:23

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

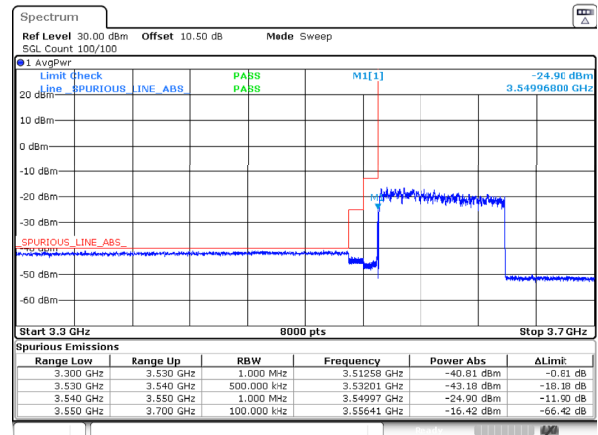


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang
Date: 7.DEC.2024 19:33:49

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244

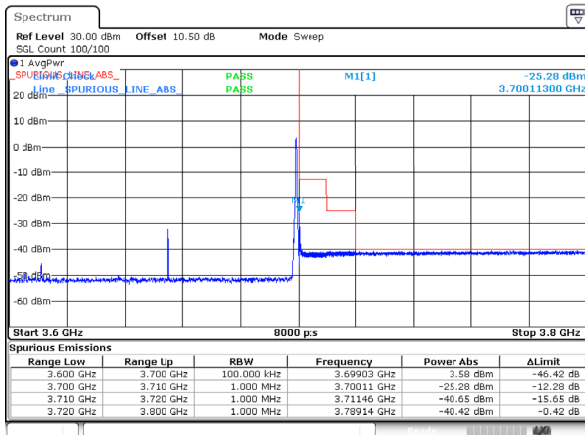


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang
Date: 16.DEC.2024 14:05:23

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0

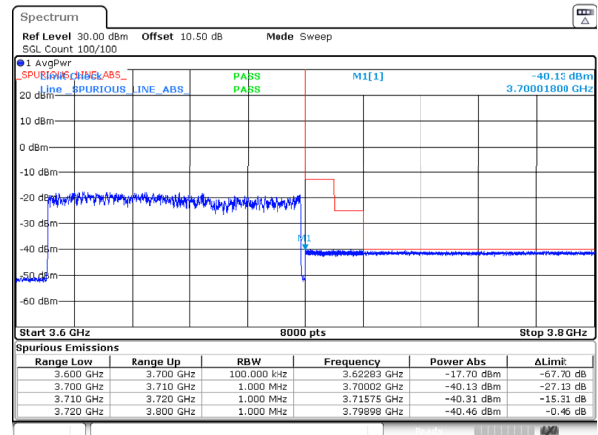


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang
Date: 7.DEC.2024 19:35:39

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@0

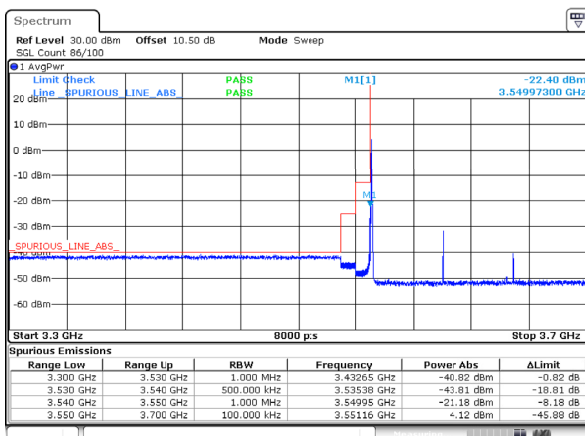


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang
Date: 16.DEC.2024 14:06:30

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0

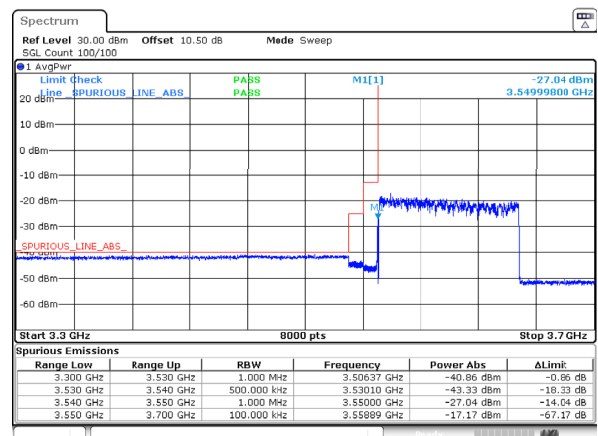


ProjectNo.:2401Z104805E-RF Testset:Kungfumeister Liang
Date: 7.DEC.2024 19:37:34

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272

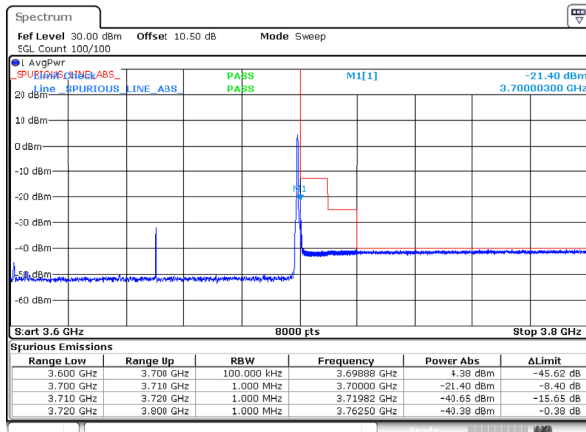

ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang
Date: 16.DEC.2024 14:07:34


n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0

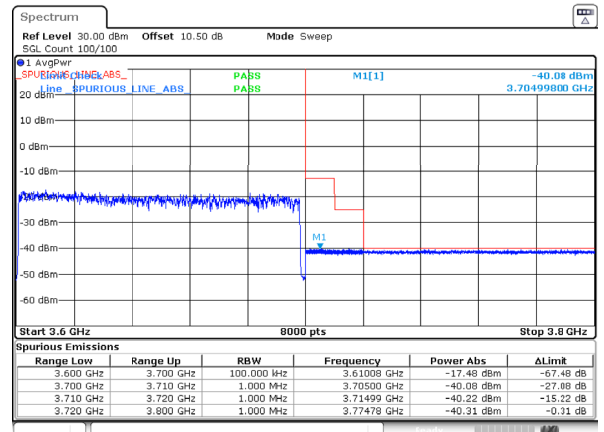

ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang
Date: 7.DEC.2024 19:39:29


n78_2

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0

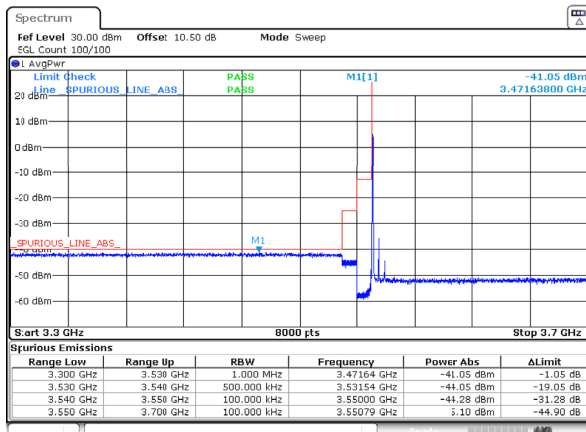


ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang
Date: 7.DEC.2024 21:15:24

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0

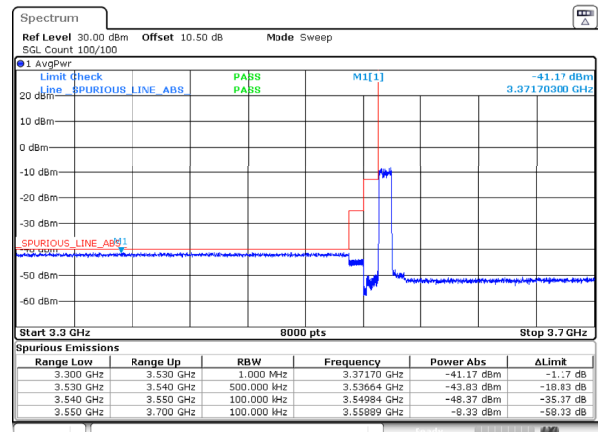


ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang
Date: 7.DEC.2024 21:16:33

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

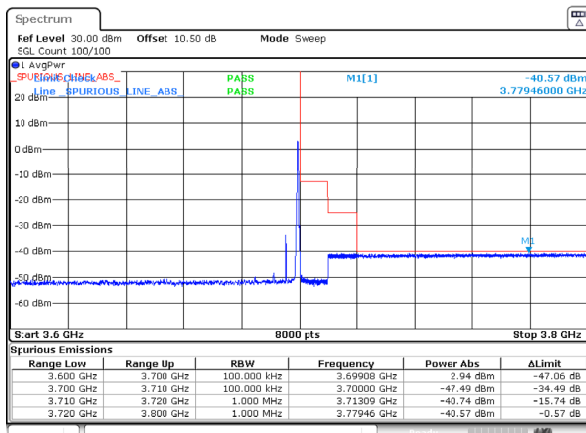


ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang
Date: 7.DEC.2024 21:17:47

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0

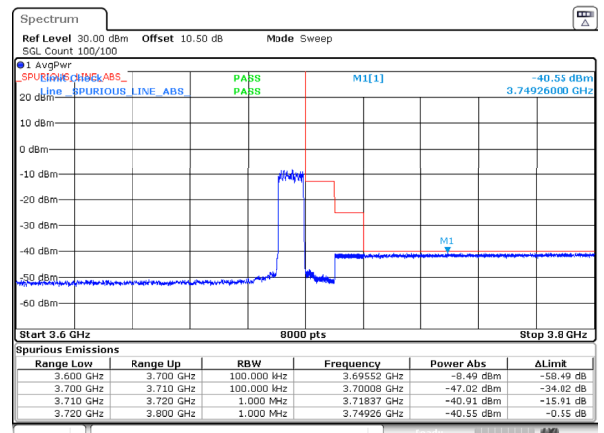


ProjectNo.:2401Z104805E-RF Tester:Rungfunaster: L.Jiang
Date: 7.DEC.2024 21:18:54

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

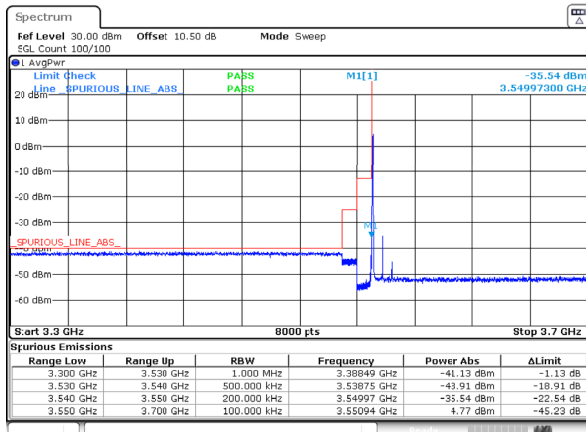


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang
Date: 7.DEC.2024 21:20:13

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

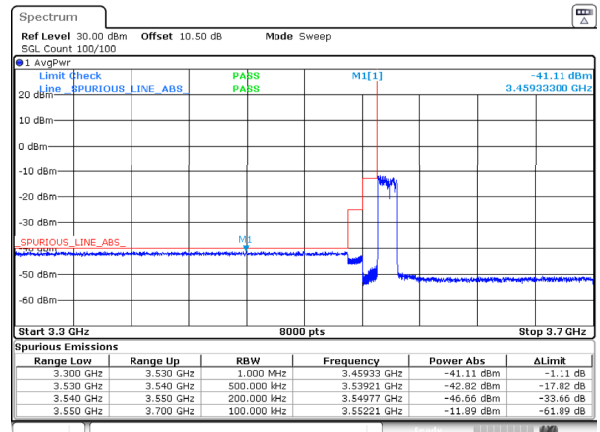


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang
Date: 7.DEC.2024 21:21:21

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37

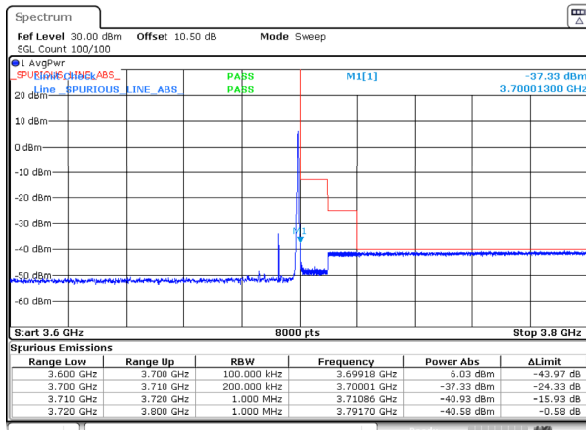


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang
Date: 7.DEC.2024 21:22:35

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0

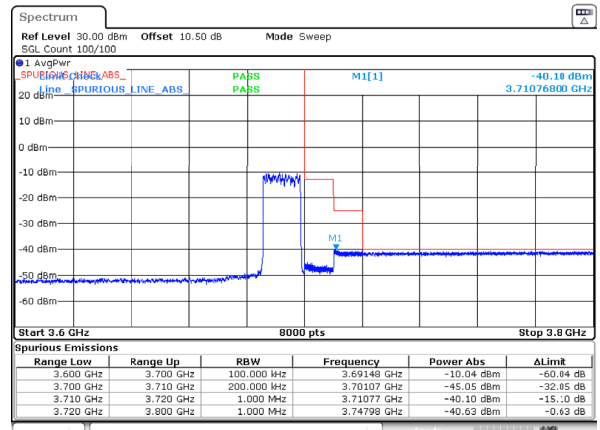


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang
Date: 7.DEC.2024 21:23:42

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0

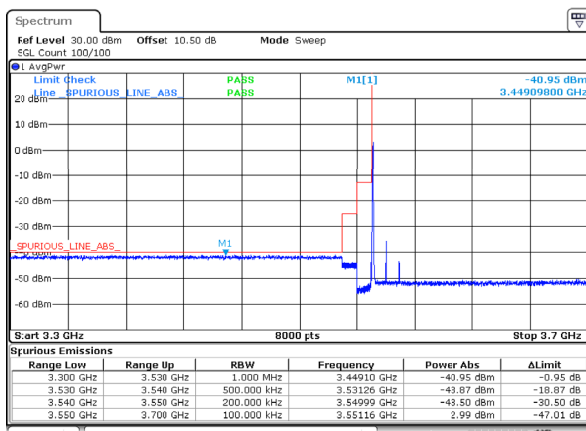


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang
Date: 16.DEC.2024 14:38:50

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0

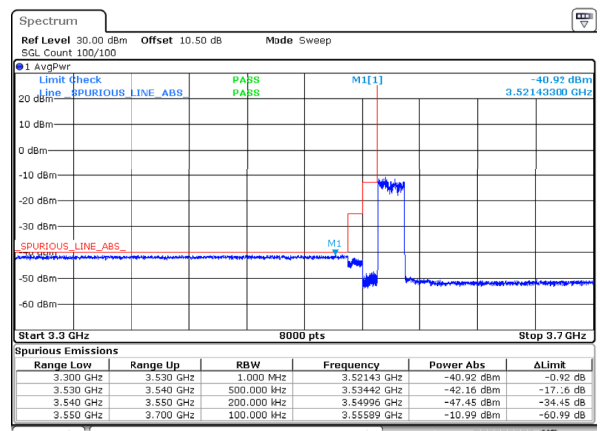


ProjectNo.:2401Z104805E-RF Tester:Rungfunmaster Liang
Date: 16.DEC.2024 14:39:32

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50

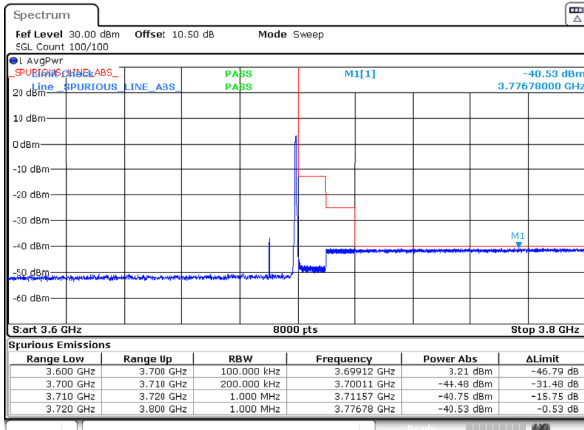


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:36:49

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0

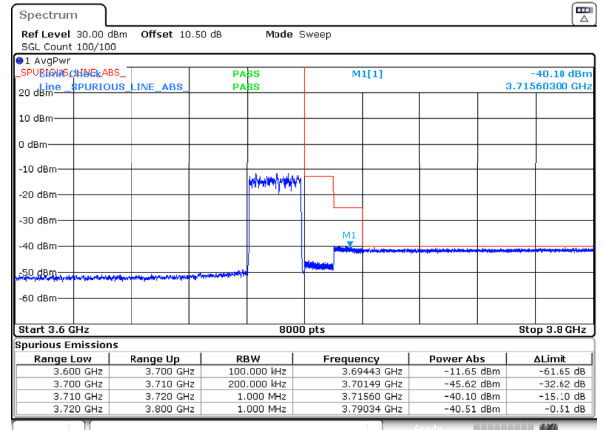


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:37:58

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0

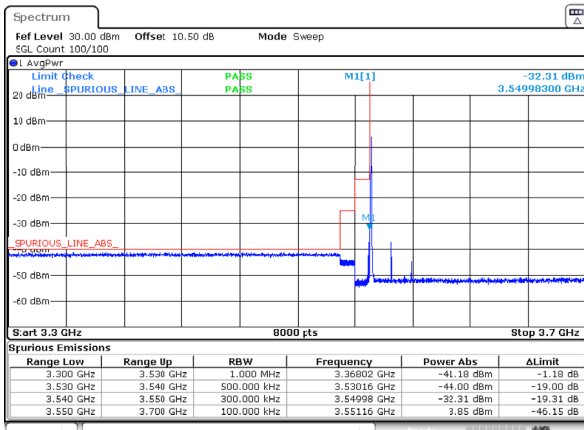


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:39:16

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0

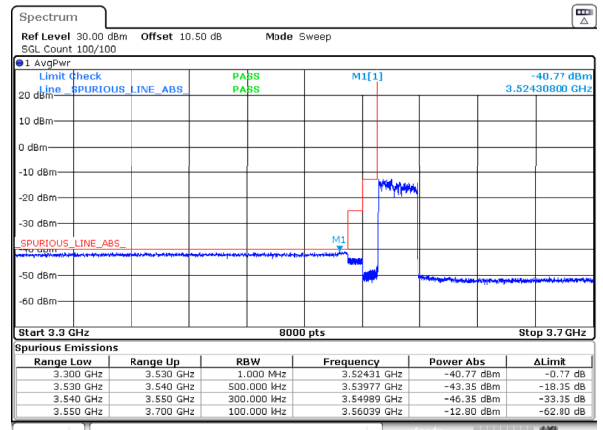


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:40:25

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77

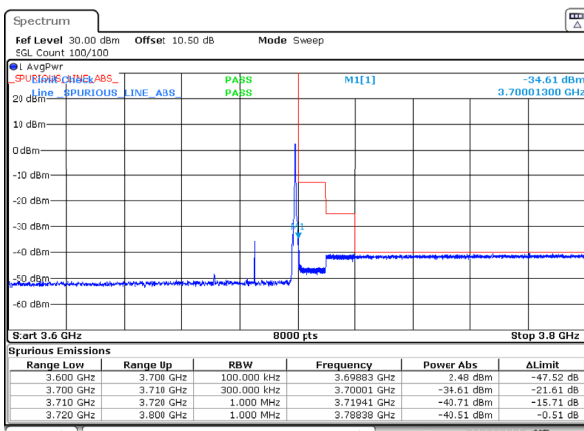


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:41:43

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0

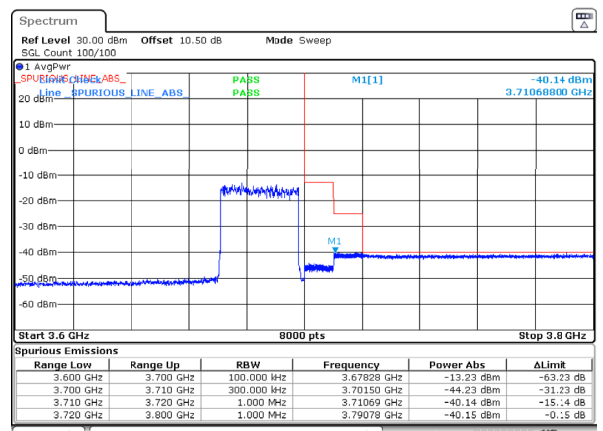


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:42:51

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

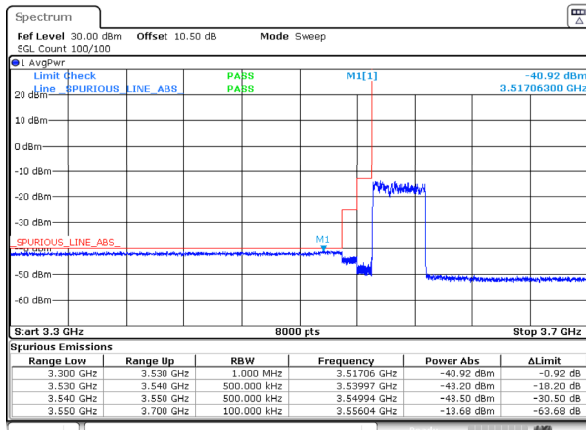


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang
Date: 7.DEC.2024 21:45:20

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0

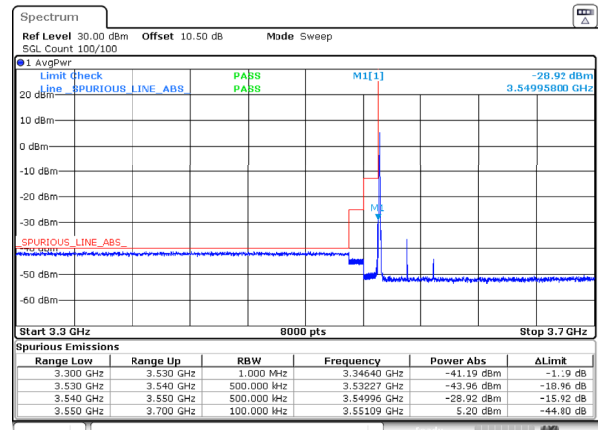


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang
Date: 7.DEC.2024 21:44:10

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

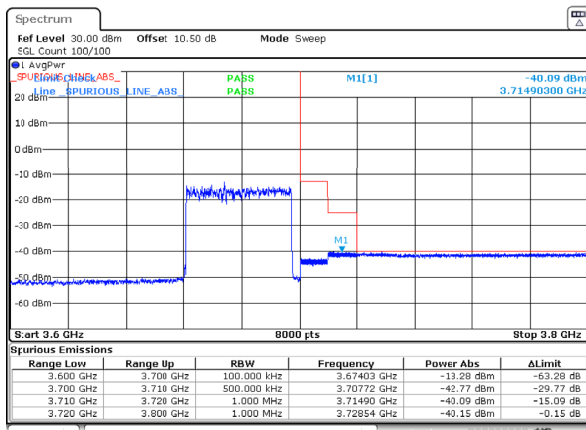


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang
Date: 7.DEC.2024 21:47:46

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

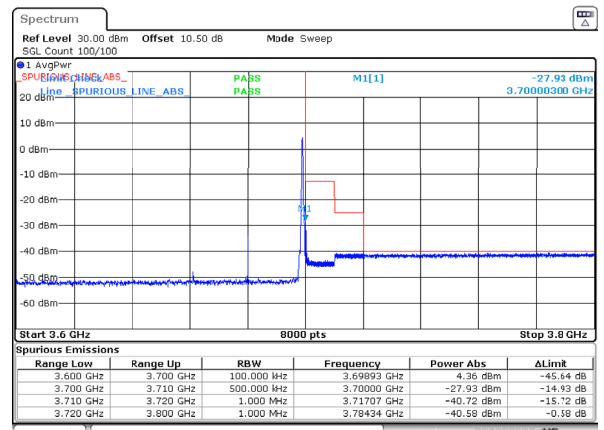


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang
Date: 7.DEC.2024 21:46:38

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

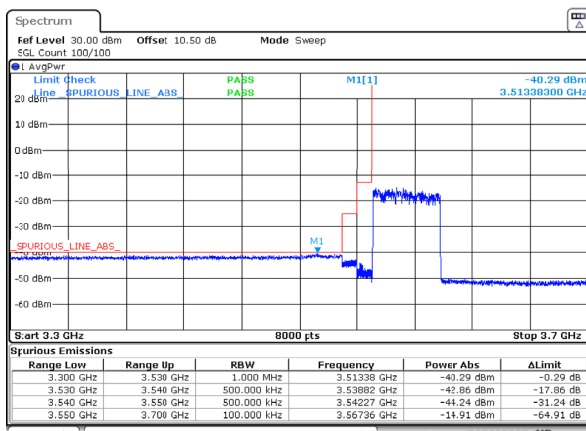


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang
Date: 7.DEC.2024 21:50:15

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0

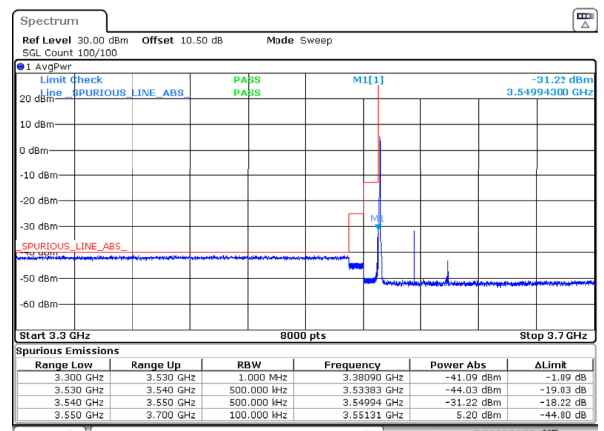


ProjectNo.:2401Z104805E-RF Testset:Rungfunmeter Liang
Date: 7.DEC.2024 21:49:05

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

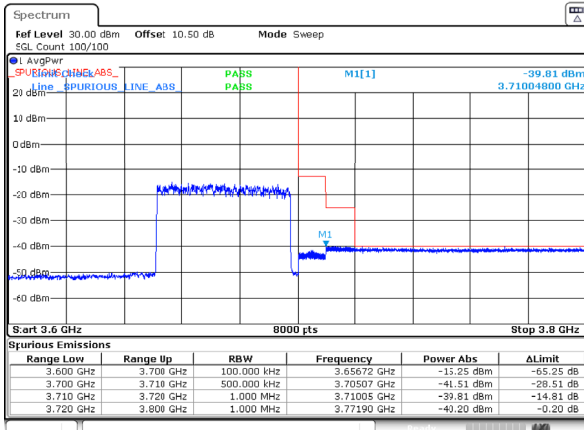


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:52:37

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

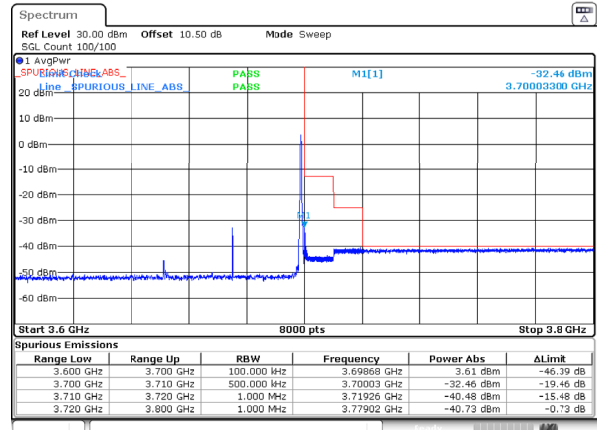


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:51:29

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

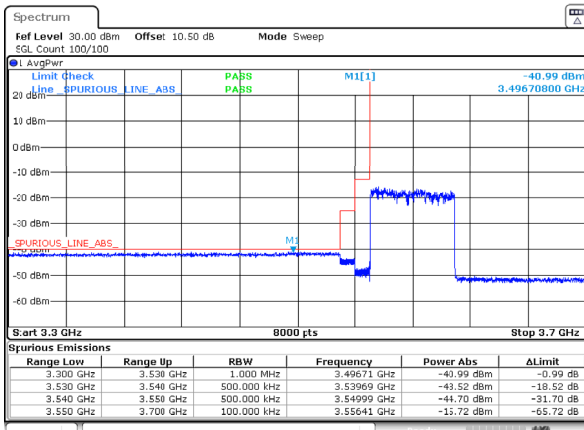


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:55:10

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0

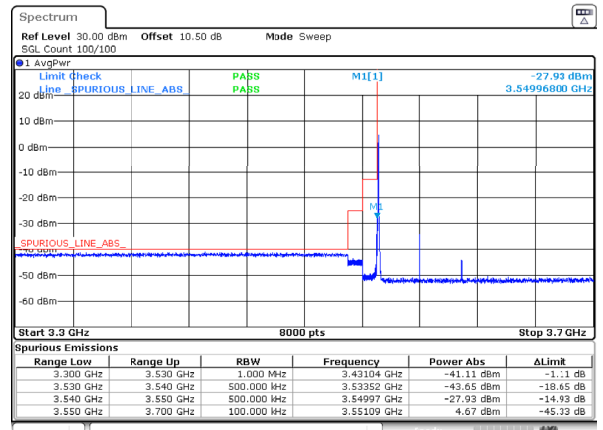


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:54:00

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0

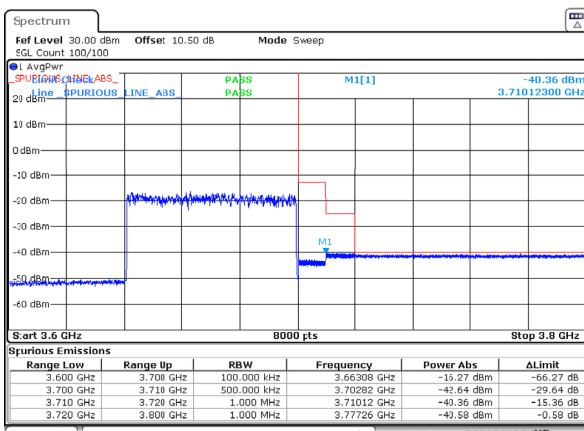


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:57:33

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161

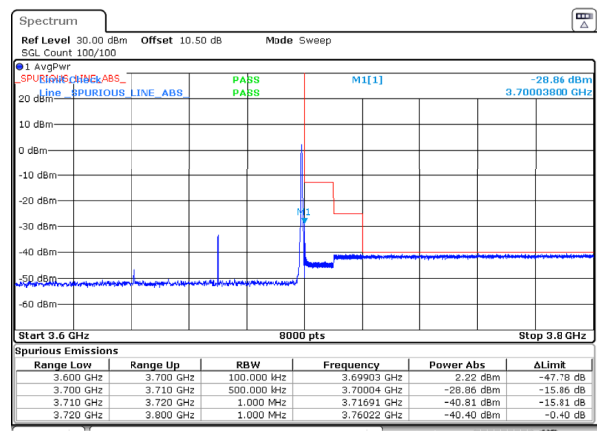


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:56:24

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0

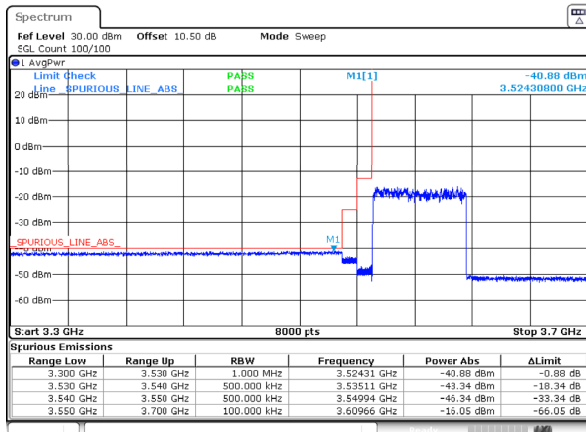


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:00:02

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0

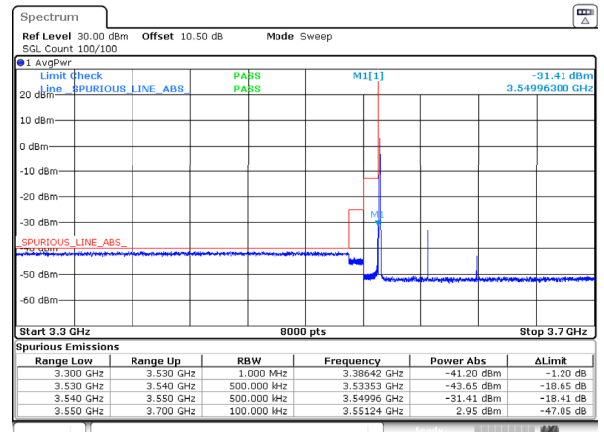


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 21:58:51

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0

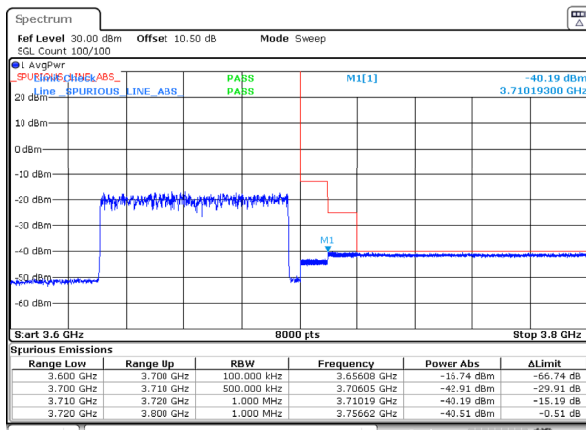


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:02:26

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188

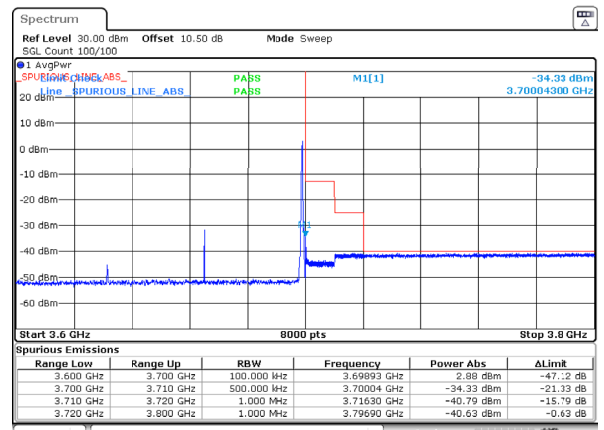


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:01:16

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB1@0

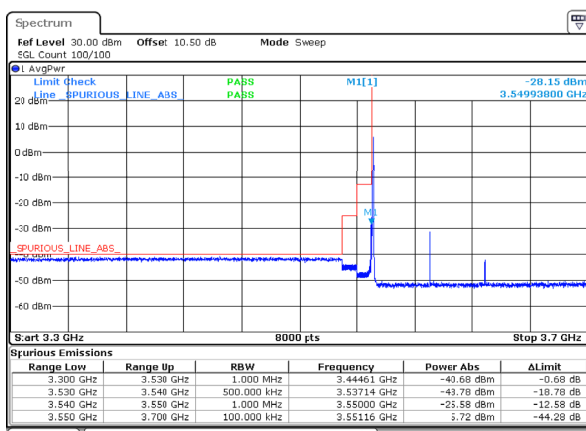


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:40:35

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

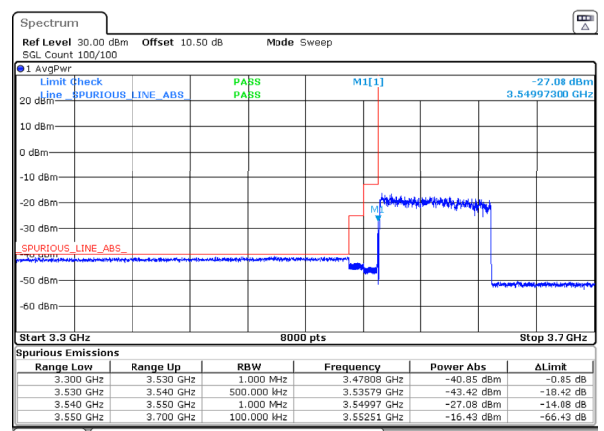


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:04:56

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

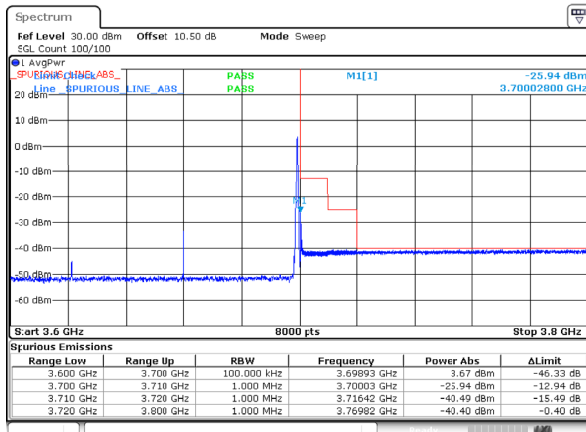


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:41:35

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

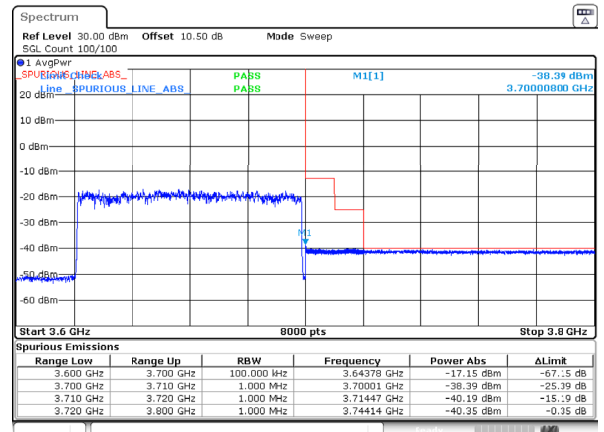


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:07:19

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB1@0

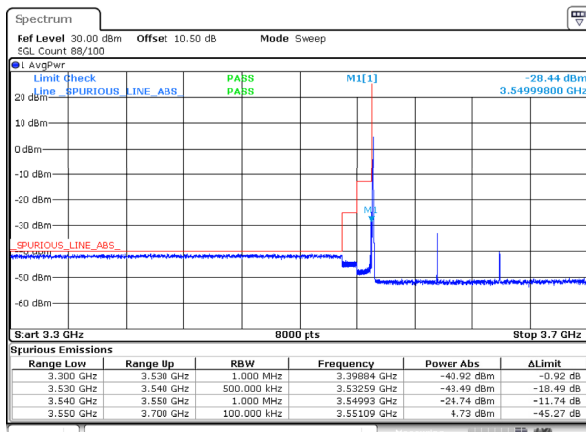


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:42:43

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

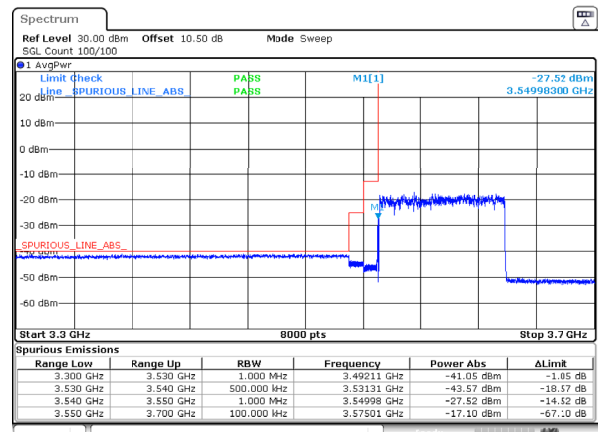


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:09:50

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244

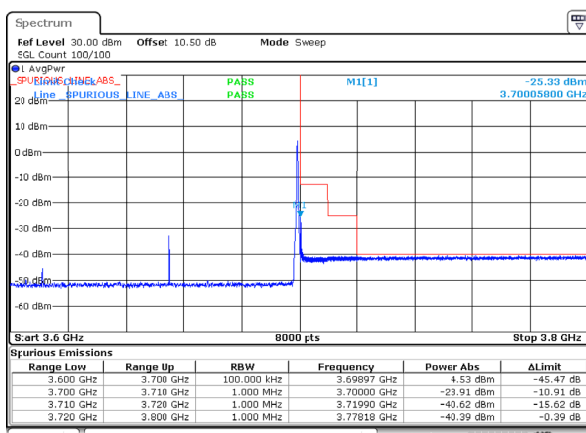


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 16.DEC.2024 14:43:42

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0

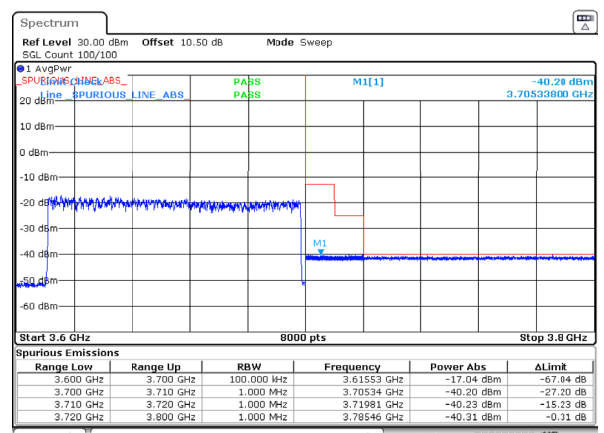


ProjectNo.:2401Z104805E-RF Tester:Rungfunmeter Liang
Date: 7.DEC.2024 22:12:14


n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB1@0

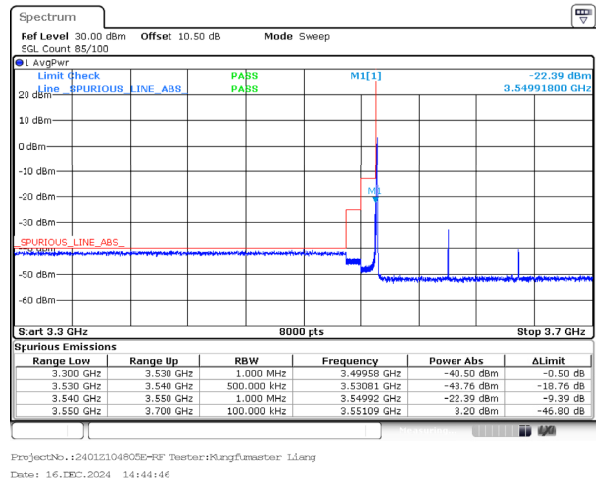

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0

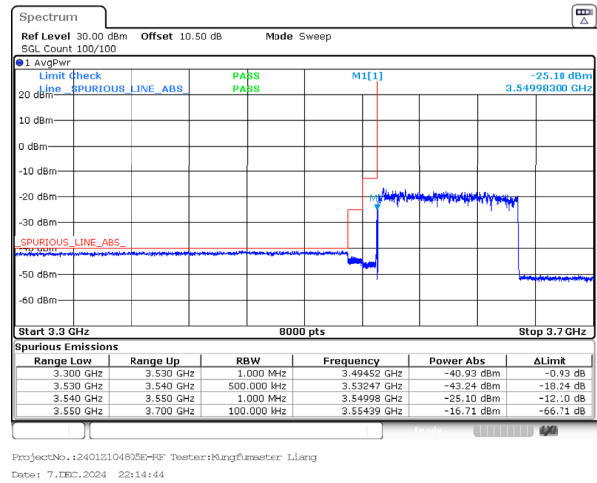

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272

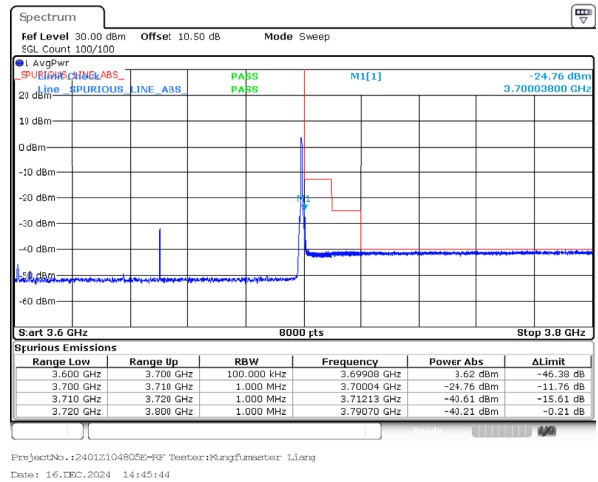

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0

