

Spurious Emissions at Antenna Terminal FCC Part 96

n77_2

Mode	Value (dBm)	Limit	Result
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.89	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-47.87	-40	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-48.13	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-41.61	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-45.78	-40	Pass
n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-45.07	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-44.91	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-47.80	-40	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-44	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-46.46	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-42.61	-40	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-48.09	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.15	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.48	-40	Pass
n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.45	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.58	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-43.53	-40	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-46.92	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-43.32	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.58	-40	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-40.68	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.79	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-41.15	-40	Pass
n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-45.32	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-48.31	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-45.99	-40	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-48.22	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-44.01	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.56	-40	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-42	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.01	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.78	-40	Pass
n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.56	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-47.41	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-48.14	-40	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-47.90	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-47.94	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-47.69	-40	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-48.25	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-47.98	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.13	-40	Pass
n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-48.16	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.71	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-48.08	-40	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-43.39	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-47.82	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-48.20	-40	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-47.32	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-47.49	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.05	-40	Pass
n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-47.74	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-48.14	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-47.93	-40	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-47.52	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-47.20	-40	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-46.70	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-48	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-47.86	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.75	-40	Pass
n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.63	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-47.26	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-44.96	-40	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-44.77	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-42.64	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-48.05	-40	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.81	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-48.11	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.55	-40	Pass
n77_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-48.21	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-48	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-48.35	-40	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-44.41	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.90	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-45.75	-40	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-47.90	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.09	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-47.70	-40	Pass
n77_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-47.88	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-40.88	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.50	-40	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-47.93	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-48.06	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-47.70	-40	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-48.05	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.78	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-47.71	-40	Pass
n77_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-47.75	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-47.70	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-47.70	-40	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-48.10	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-47.66	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-47.01	-40	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-47.58	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.62	-40	Pass

Mode	Value (dBm)	Limit	Result
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-47.83	-40	Pass
n77_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-47.59	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-47.79	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-47.93	-40	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-47.64	-40	Pass

n78_2

Mode	Value (dBm)	Limit	Result
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-48.09	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@23	-48.20	-40	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-46.06	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-44.77	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@23	-47.91	-40	Pass
n78_2_10MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB24@0	-41.32	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@0	-42.33	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-48.11	-40	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-47.22	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.38	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@37	-48.12	-40	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-41.52	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.82	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@37	-47.80	-40	Pass
n78_2_15MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB36@0	-47.79	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@0	-47.46	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-47.70	-40	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-46.33	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-47.90	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@50	-47.65	-40	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-48.24	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-48.02	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@50	-47.46	-40	Pass
n78_2_20MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB50@0	-48.16	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@0	-47.90	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-47.45	-40	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-47.61	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-45.09	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@77	-47.61	-40	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.74	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.34	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@77	-47.52	-40	Pass
n78_2_30MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB75@0	-47.88	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@0	-44.75	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-47.90	-40	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-47.80	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-48.07	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-48.09	-40	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@105	-48.14	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB100@0	-45.84	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-44.98	-40	Pass
n78_2_40MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@105	-47.86	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-47.13	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@0	-47.92	-40	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-47.89	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-48.06	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-45.90	-40	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@132	-47.74	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB128@0	-45.79	-40	Pass
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-45.33	-40	Pass


Mode	Value (dBm)	Limit	Result
n78_2_50MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@132	-47.16	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-48.12	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@0	-45.68	-40	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-46.37	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-44.05	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-46.34	-40	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@161	-46.23	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB162@0	-47.52	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.73	-40	Pass
n78_2_60MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@161	-47.45	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-47.53	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@0	-47.63	-40	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-47.67	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-48.33	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-47.55	-40	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@188	-47.65	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB180@0	-47.96	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.02	-40	Pass
n78_2_70MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@188	-47.81	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-47.47	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@0	-48.17	-40	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-48.01	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-47.85	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@216	-47.73	-40	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-47.94	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.80	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@216	-47.63	-40	Pass
n78_2_80MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB216@0	-48.04	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@0	-46.01	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-47.92	-40	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-48.05	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-48.14	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@244	-47.47	-40	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-48.30	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.70	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@244	-47.89	-40	Pass
n78_2_90MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB243@0	-48.10	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@0	-48.15	-40	Pass

Mode	Value (dBm)	Limit	Result
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-46.23	-40	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-48.06	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-47.55	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@272	-47.75	-40	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-47.58	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@0	-47.66	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB1@272	-45.92	-40	Pass
n78_2_100MHz_30kHz_3625MHz_DFT-s-OFDM QPSK_RB270@0	-47.28	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@0	-48.01	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-47.85	-40	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-47.89	-40	Pass


n77_2

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@0 -47.89dBm

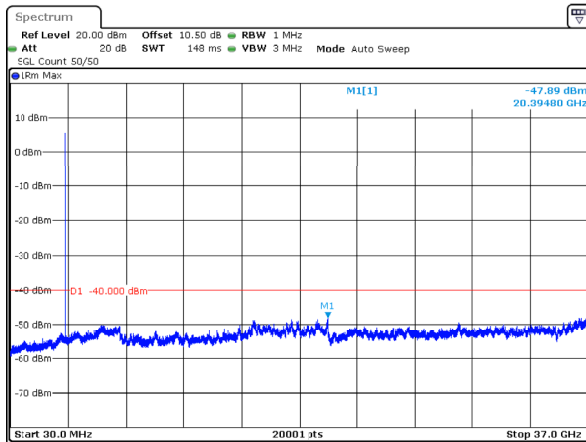


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 07:52:30

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB1@23 -47.87dBm

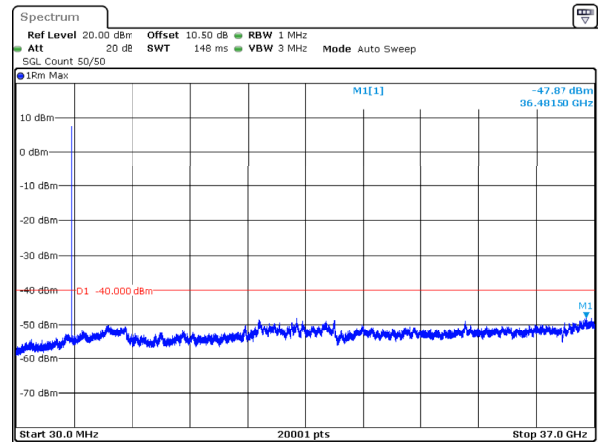


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 07:53:43

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM
QPSK_RB24@0 -48.13dBm

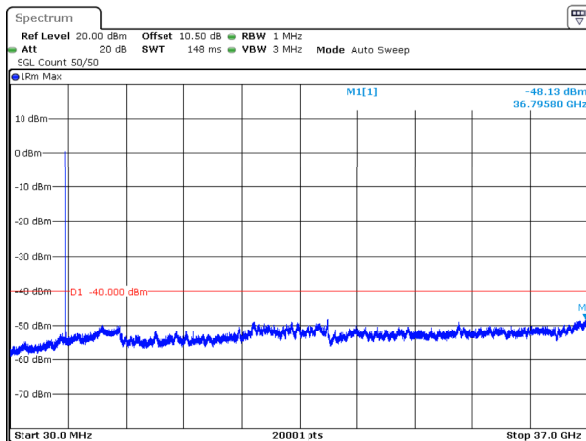


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 16:48:01

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -41.61dBm

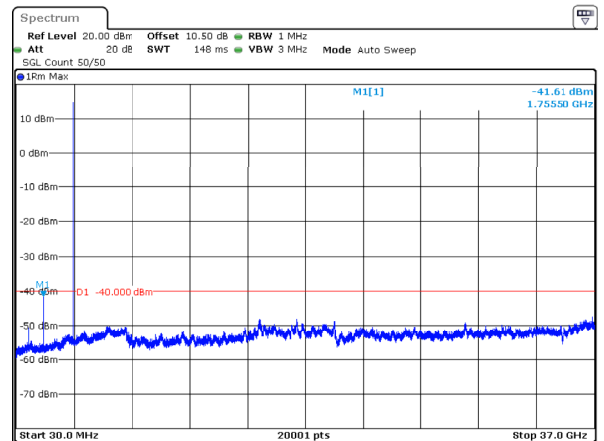


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:04:29

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@23 -45.78dBm

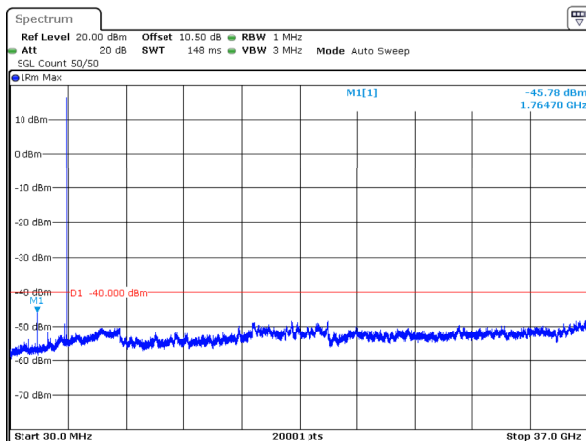


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:05:35

n77_2_10MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB24@0 -45.07dBm

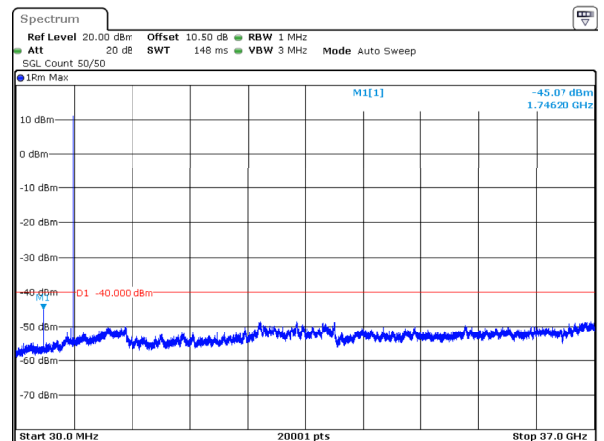


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:06:41

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@0 -44.91dBm

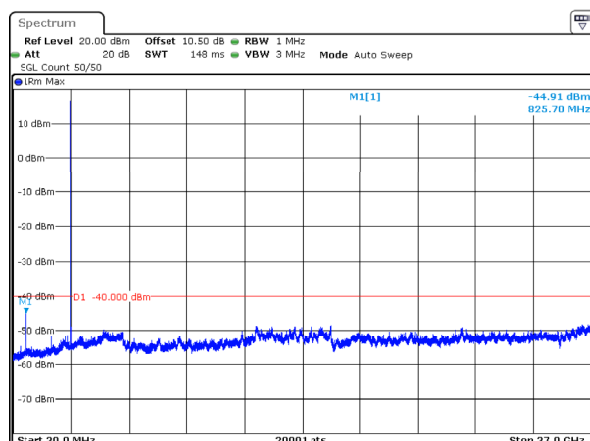


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:07:59

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23 -47.80dBm

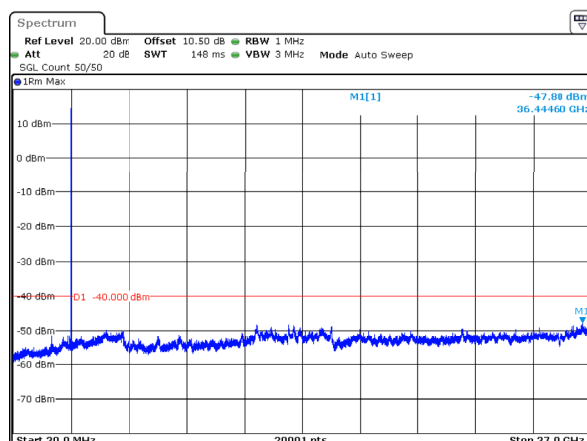


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:09:05

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB24@0 -44dBm

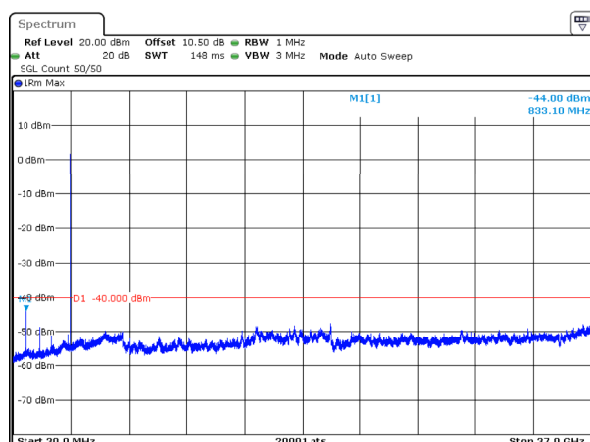


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:35:52

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0 -46.46dBm

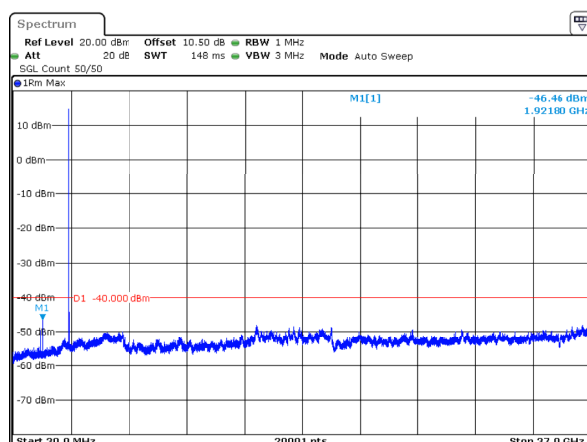


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:11:29

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@37 -42.61dBm

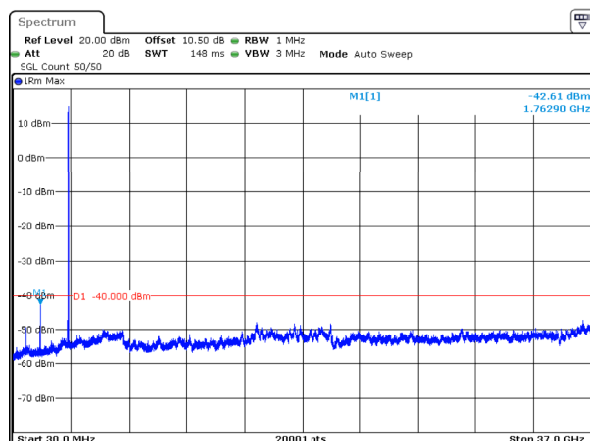


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:13:23

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0 -48.09dBm

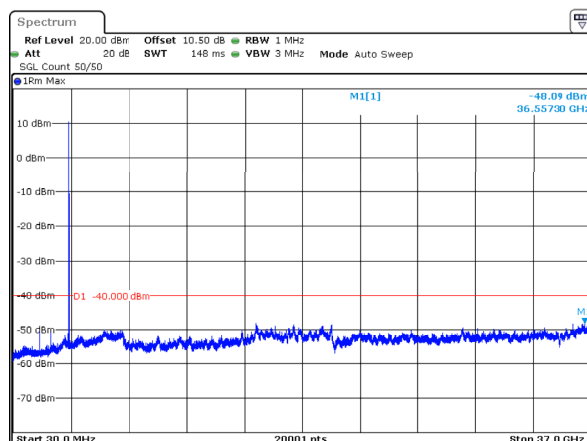


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:14:16

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.15dBm

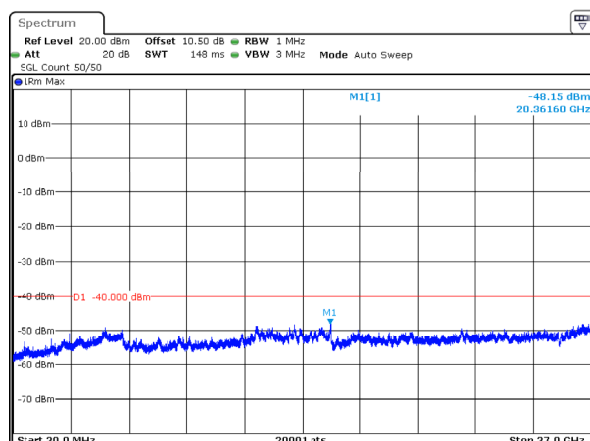


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 16:49:00

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@37 -47.48dBm

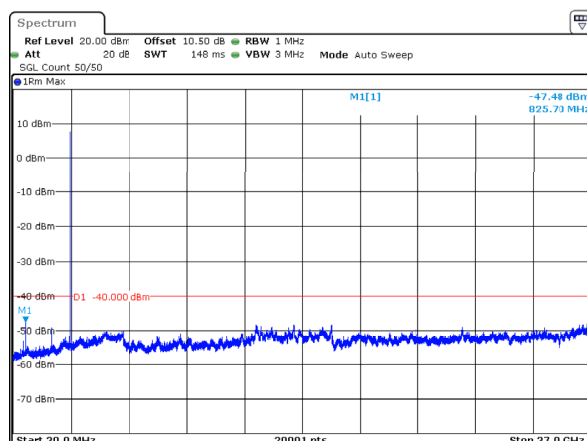


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:38:11

n77_2_15MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB36@0 -47.45dBm

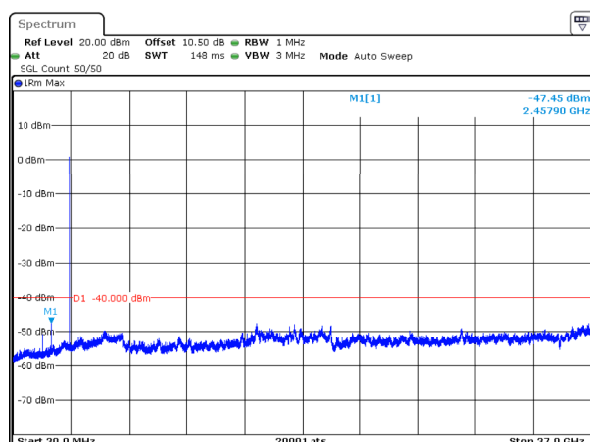


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:39:19

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@0 -47.58dBm

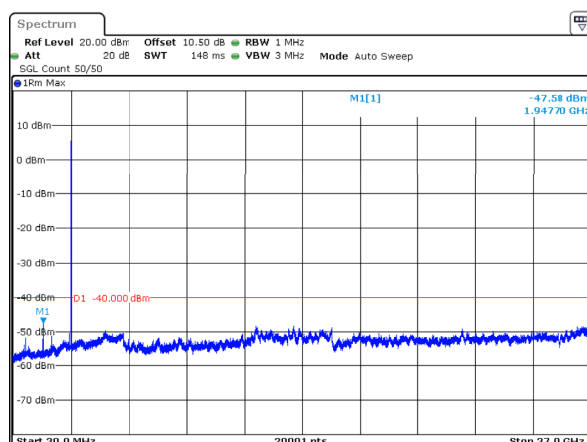


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:40:29

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37 -43.53dBm

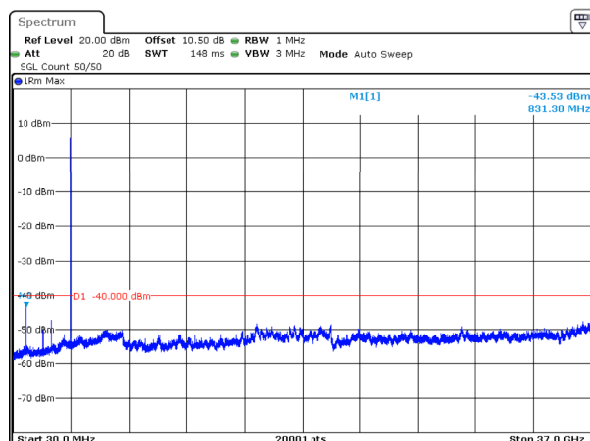


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:41:39

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0 -46.92dBm

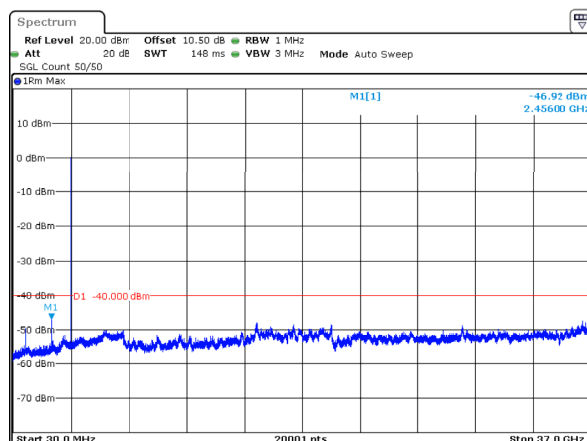


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:42:48

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@0 -43.32dBm

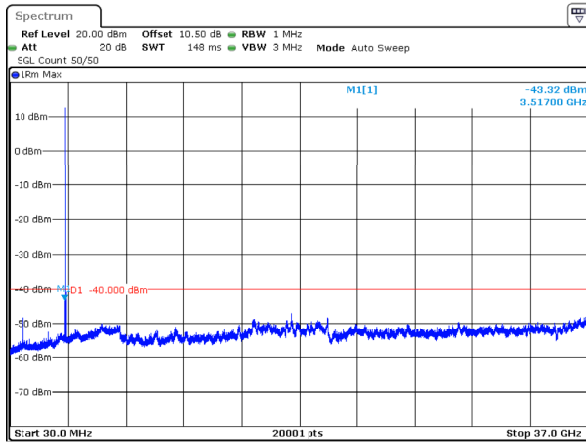


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:34:26

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB1@50 -47.58dBm

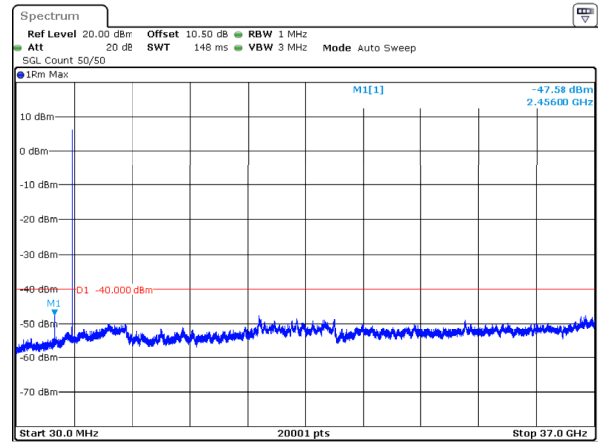


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:43:47

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM
QPSK_RB50@0 -40.68dBm

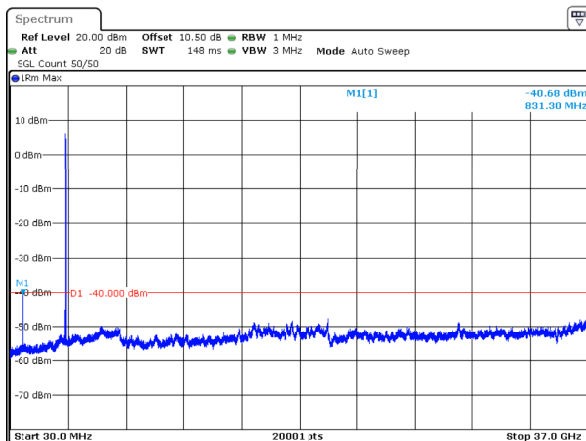


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:36:44

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.79dBm

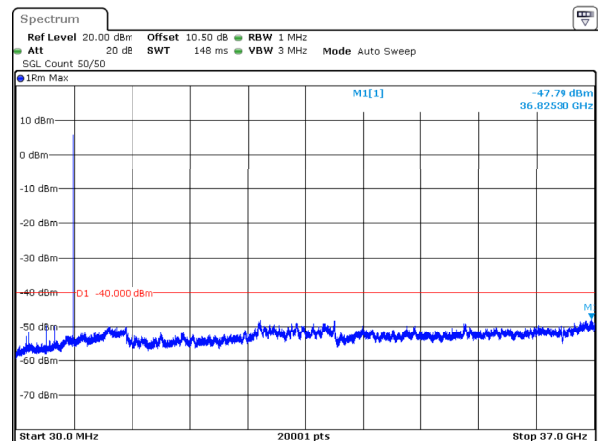


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:45:06

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@50 -41.15dBm

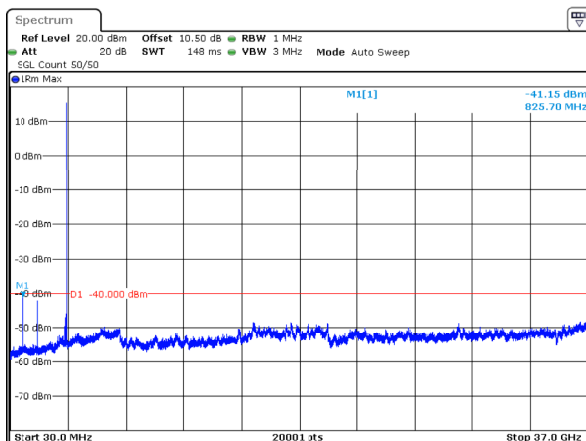


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:39:24

n77_2_20MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB50@0 -45.32dBm

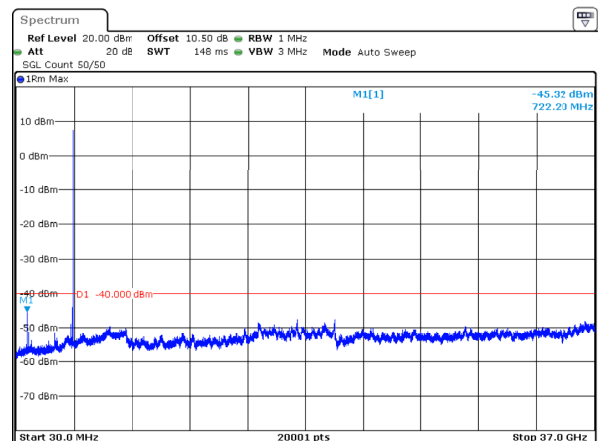


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:40:32

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@0 -48.31dBm

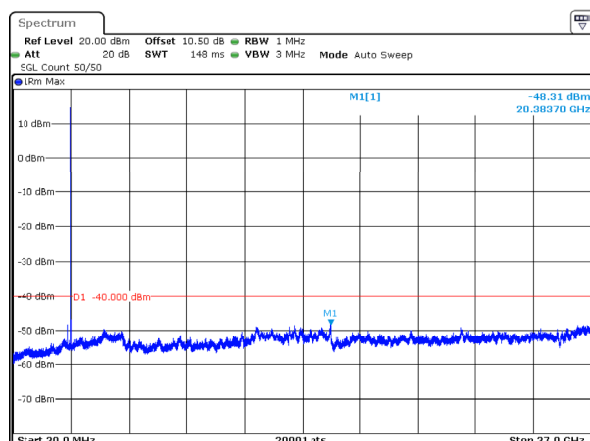


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:41:52

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB1@50 -45.99dBm

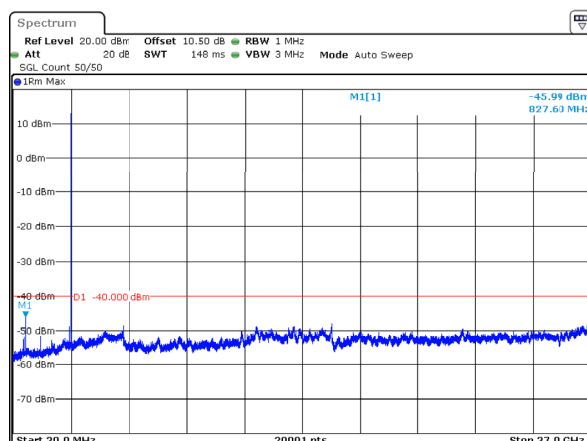


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:42:59

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM
QPSK_RB50@0 -48.22dBm

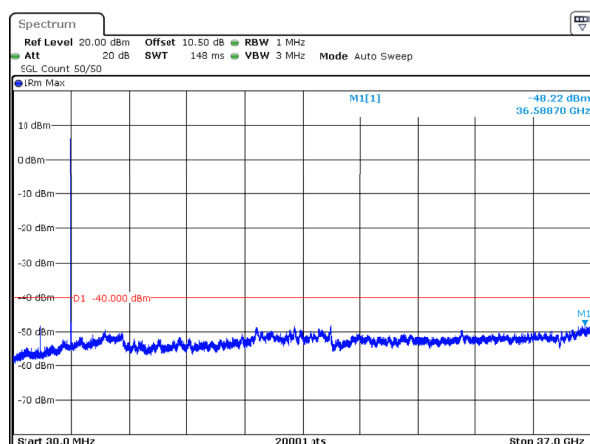


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:44:10

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@0 -44.01dBm

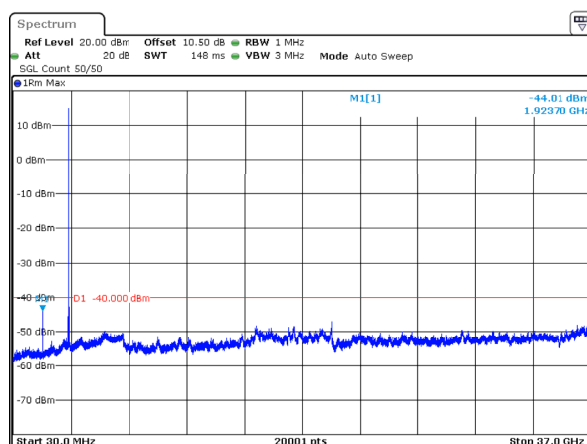


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:45:03

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB1@77 -47.56dBm

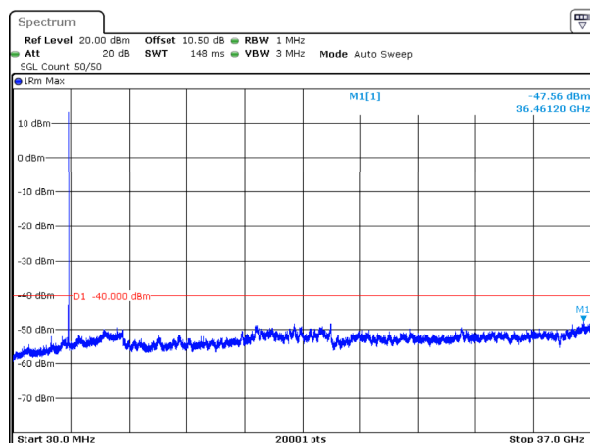


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:46:10

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM
QPSK_RB75@0 -42dBm

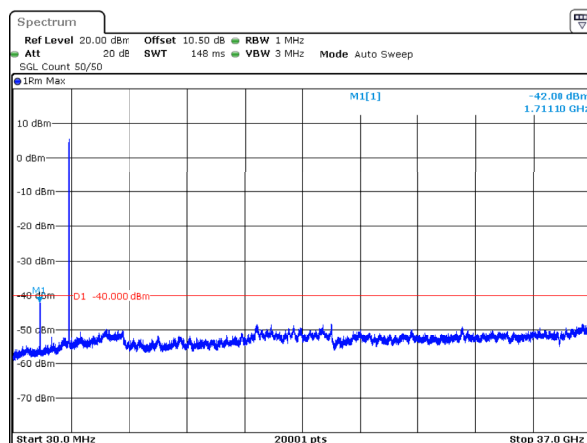


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:47:16

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.01dBm

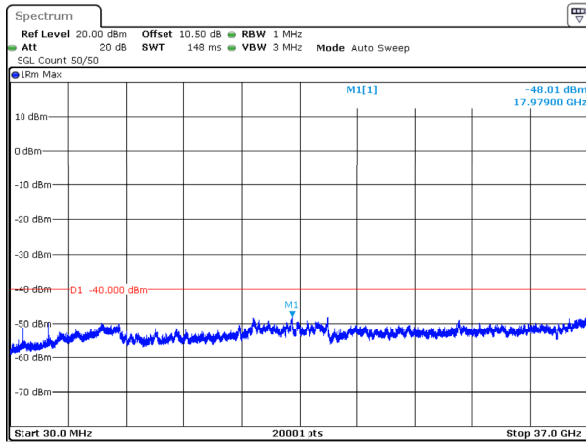


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:46:13

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@77 -47.78dBm

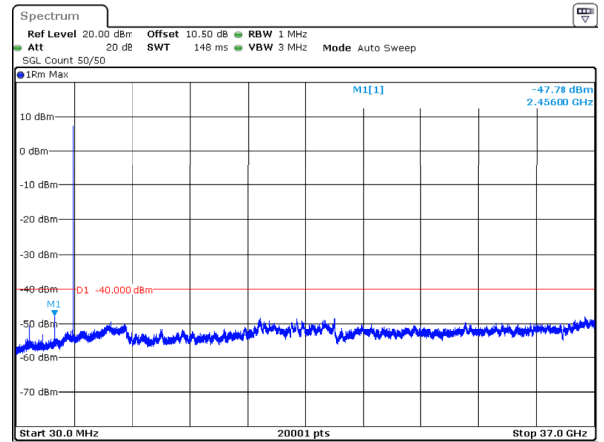


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:47:25

n77_2_30MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB75@0 -47.56dBm

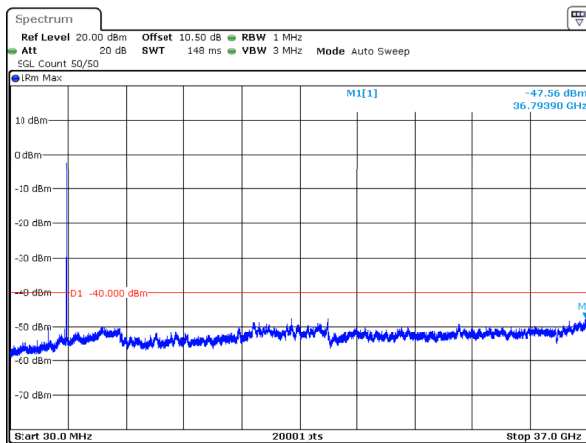


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:48:32

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@0 -47.41dBm

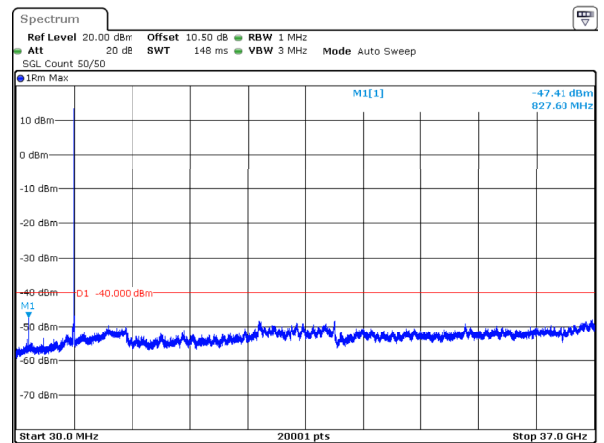


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:53:15

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77 -48.14dBm

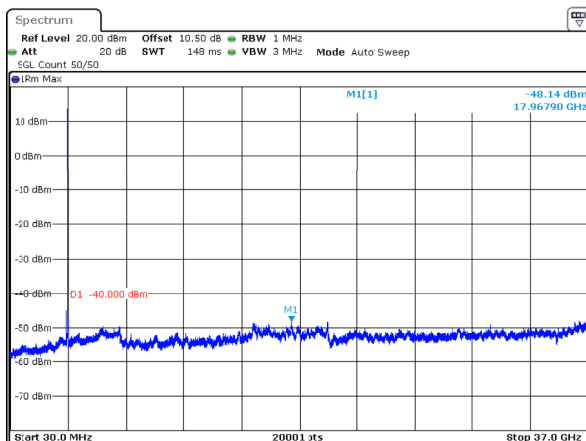


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:54:22

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB75@0 -47.90dBm

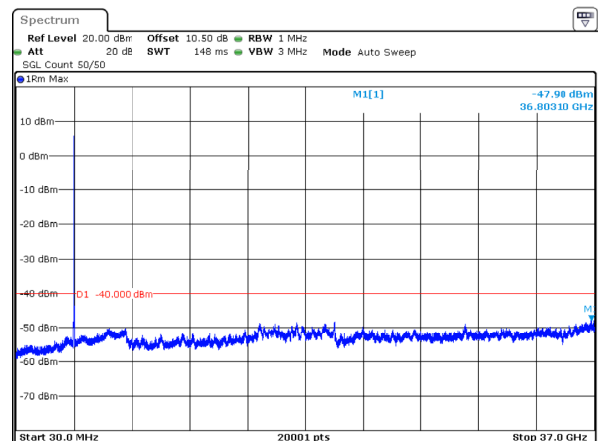


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:55:29

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0 -47.94dBm

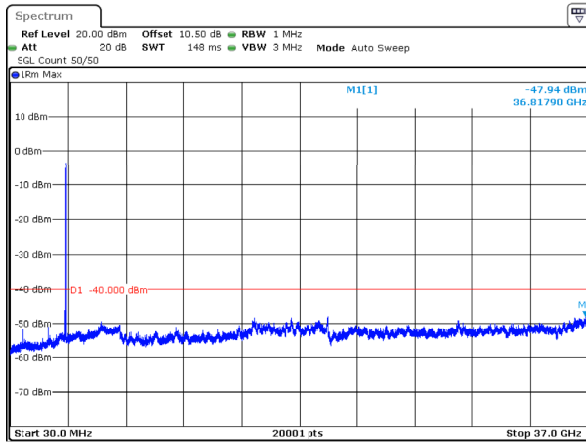


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:49:25

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@0 -47.69dBm

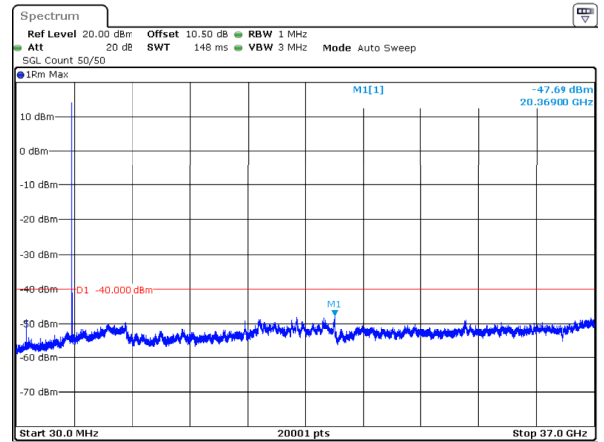


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:56:39

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB1@105 -48.25dBm

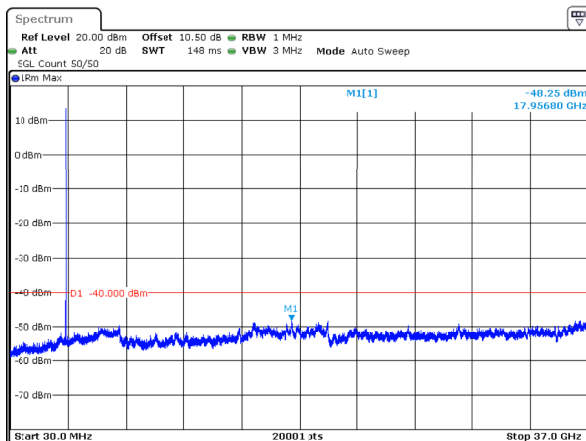


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 10:58:34

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB100@0 -47.98dBm

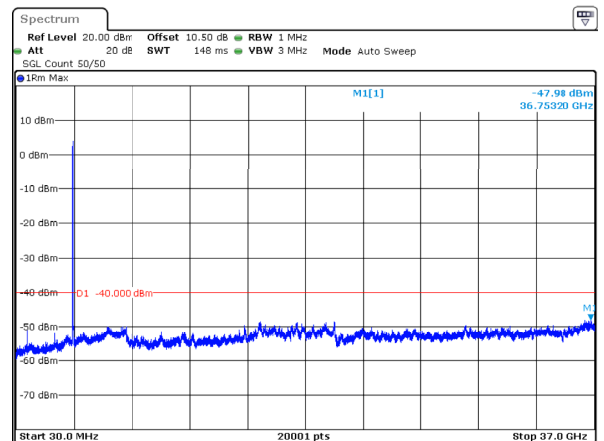


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:03:16

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.13dBm

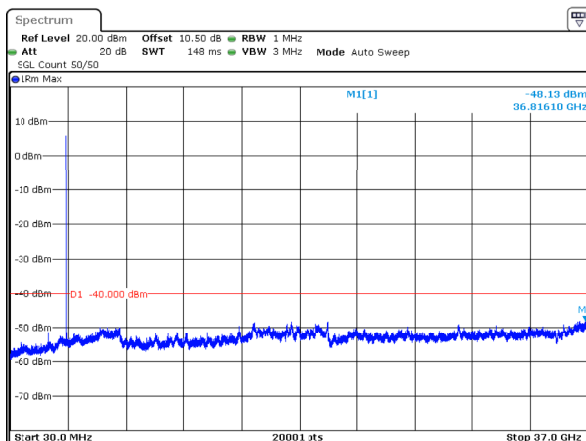


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:50:38

n77_2_40MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@105 -48.16dBm

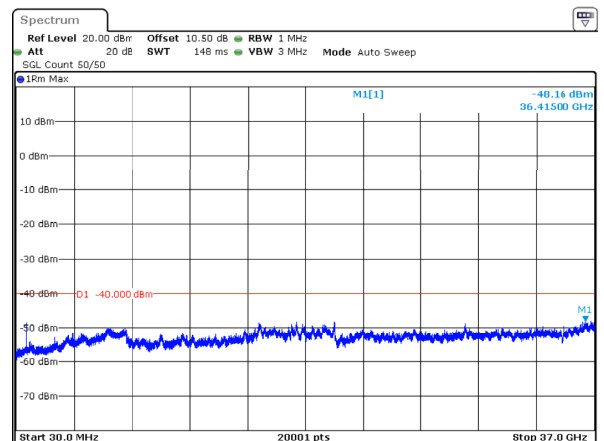


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:51:31

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0 -47.71dBm

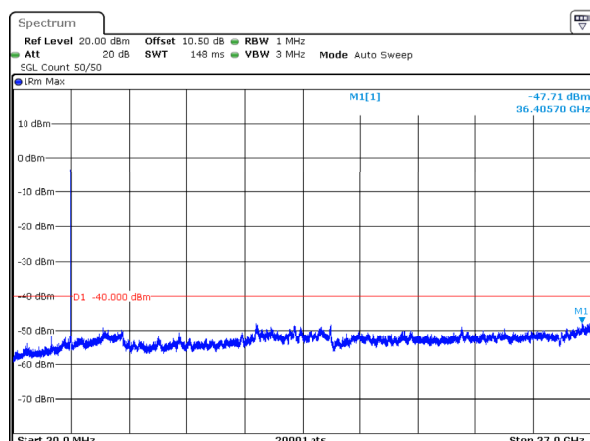


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:52:44

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@0 -48.08dBm

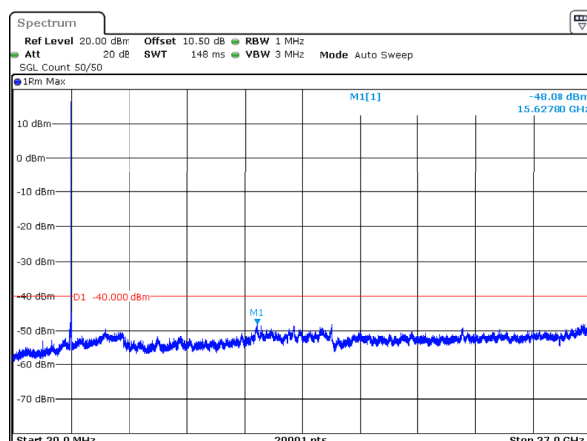


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:04:36

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105 -43.39dBm

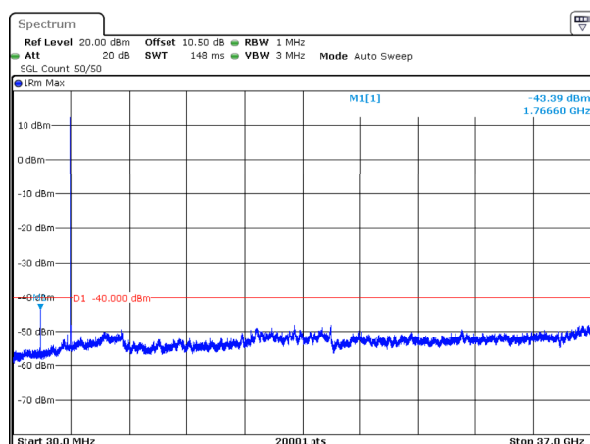


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:05:44

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0 -47.82dBm

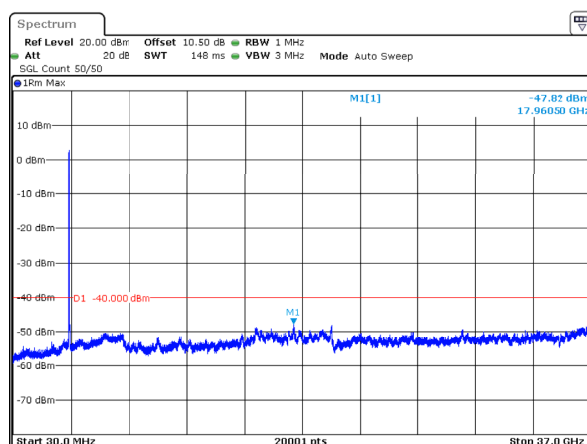


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:10:58

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@0 -48.20dBm

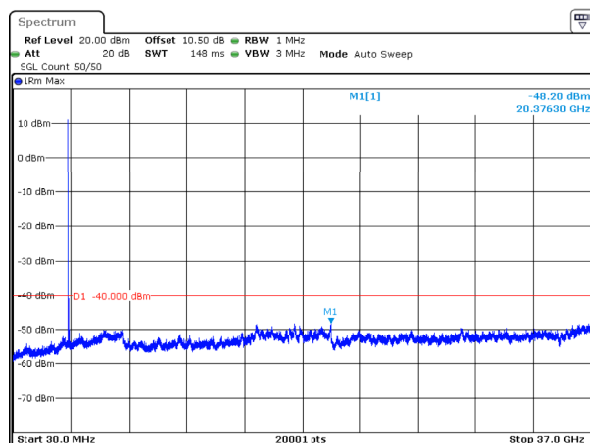


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:08:17

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB1@132 -47.32dBm

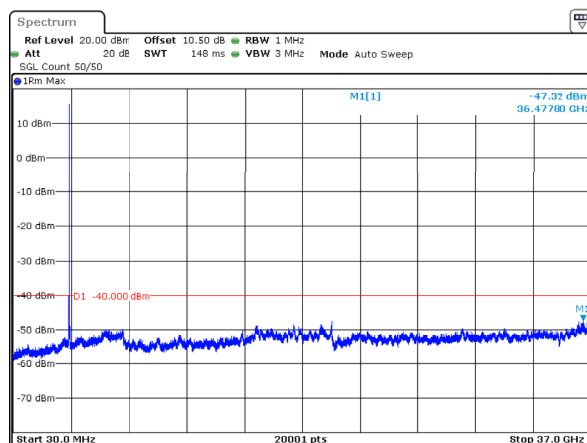


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:09:50

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB128@0 -47.49dBm

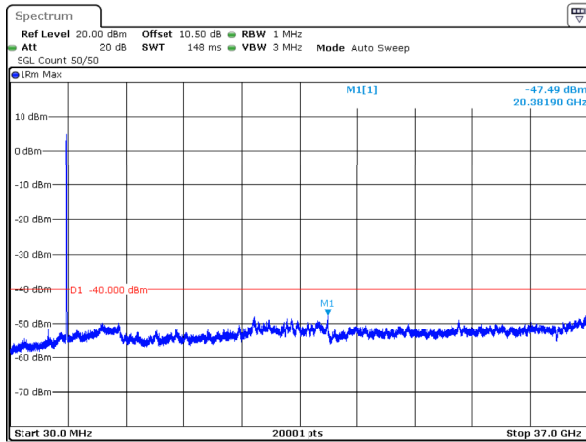


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:14:32

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -48.05dBm

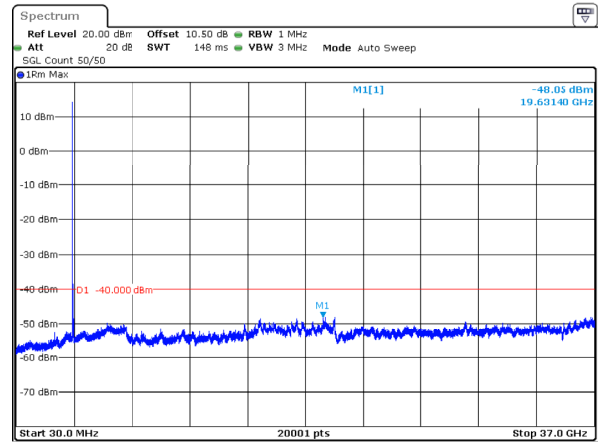


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:12:16

n77_2_50MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@132 -47.74dBm

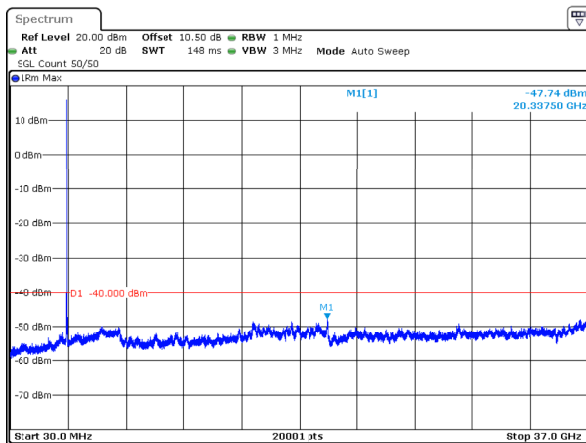


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:13:24

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0 -48.14dBm

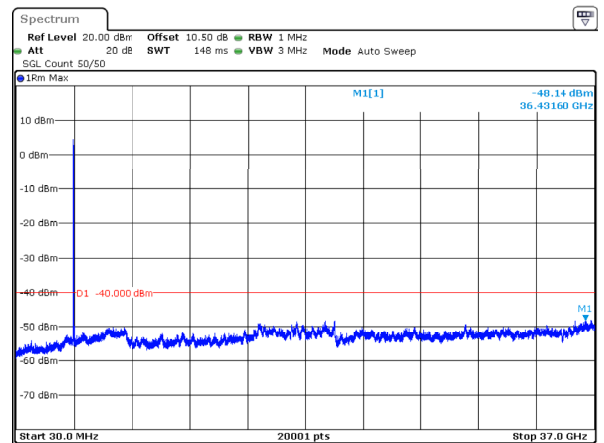


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:18:12

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@0 -47.93dBm

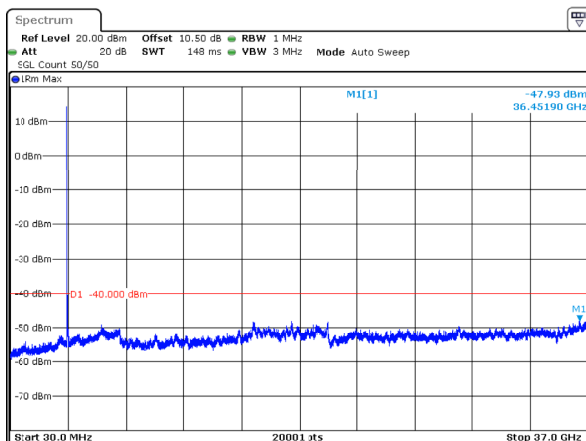


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:15:51

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132 -47.52dBm

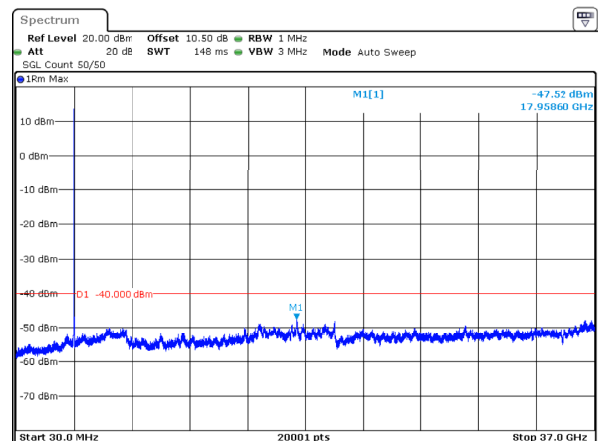


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:17:02

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0 -47.20dBm

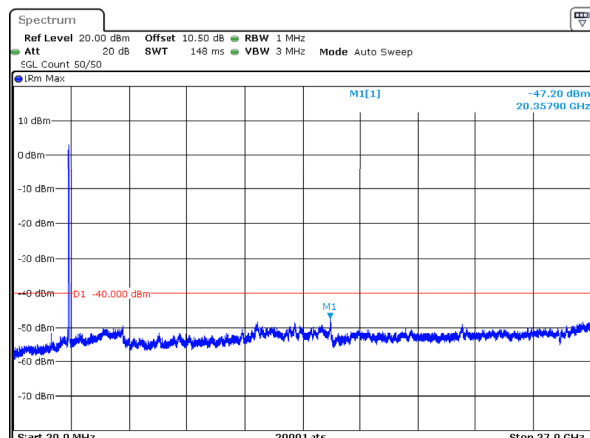


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:21:38

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@0 -46.70dBm

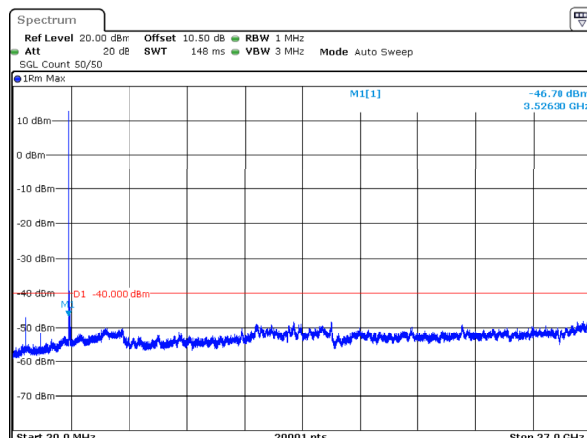


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:19:20

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB1@161 -48dBm

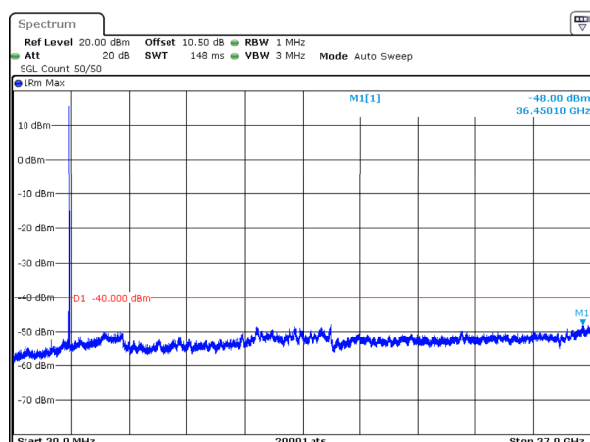


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:20:28

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB162@0 -47.86dBm

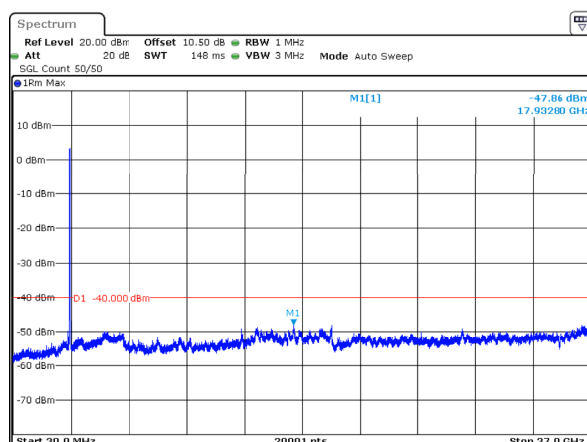


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:25:10

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@0 -47.75dBm

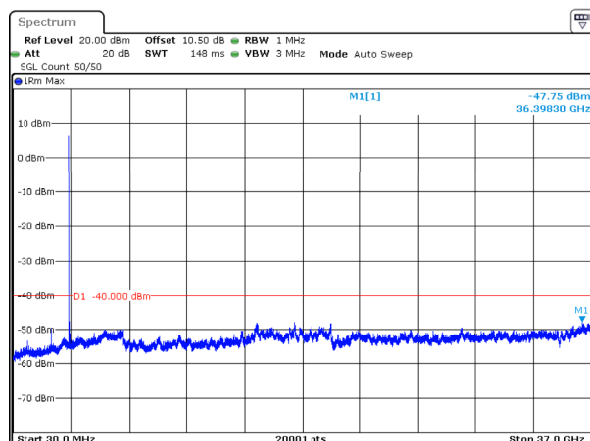


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 15:53:59

n77_2_60MHz_30kHz_3625MHz_DFT-s-OFDM
QPSK_RB1@161 -47.63dBm

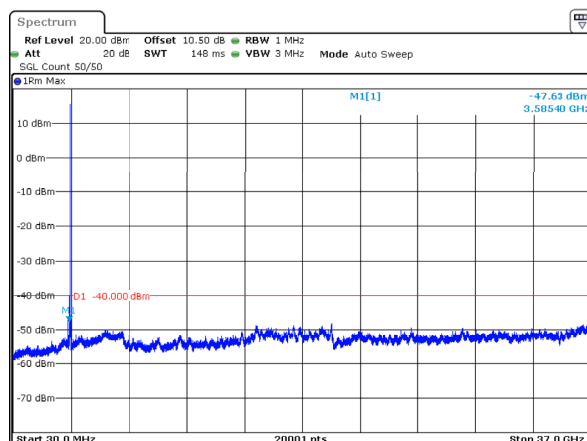


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:24:03

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0 -47.26dBm

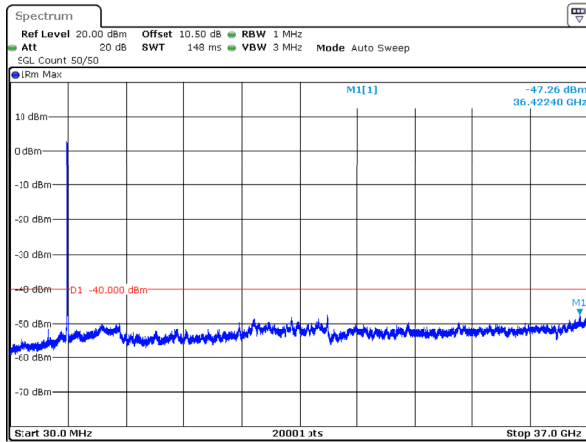


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:28:56

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@0 -44.96dBm

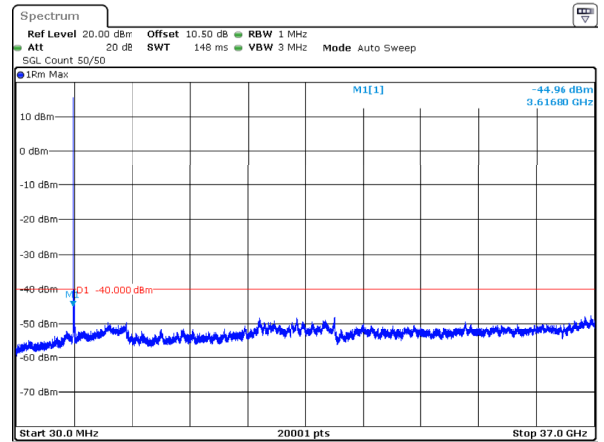


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:26:27

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161 -44.77dBm

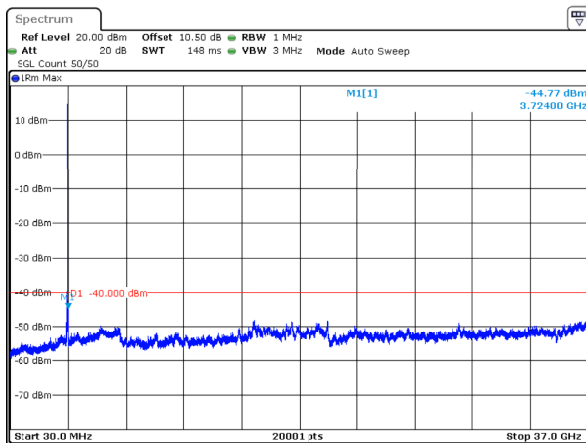


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 2.AUG.2024 11:27:48

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0 -42.64dBm

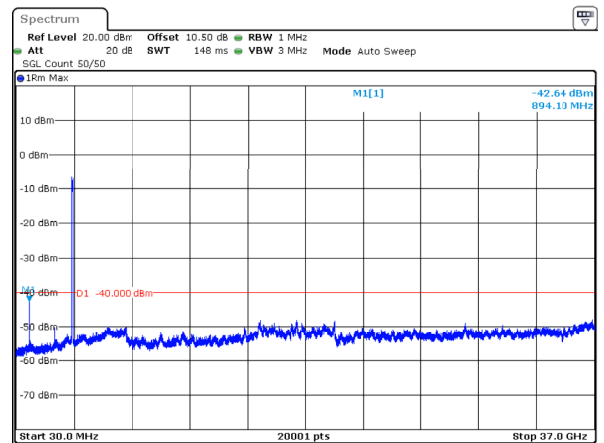


ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 16:07:17

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@0 -48.05dBm

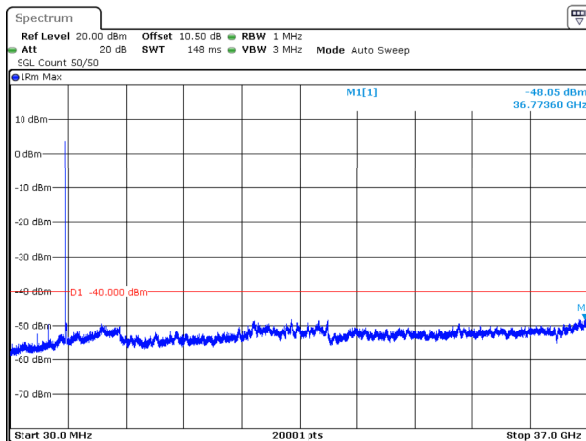

ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 16:05:31

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB1@188 -47.81dBm

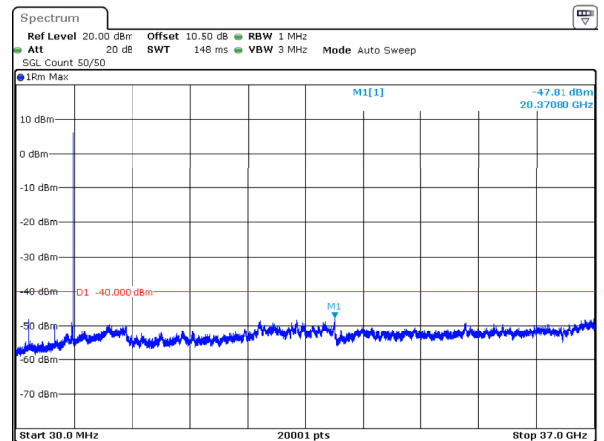

ProjectNo.:2401U82760E-RF Tester:Jim Cheng
Date: 7.AUG.2024 16:06:24