

Test Information:

Sample No.:	2X9P-3	Test Date:	2025/02/19~2025/03/04
Test Site:	RF	Test Mode:	Transmitting
Tester:	Kungfumaster Liang	Test Result:	Pass

Environmental Conditions:

Temperature: (°C)	23.8-24.5	Relative Humidity: (%)	42-52	ATM Pressure: (kPa)	100.4-101.6
----------------------	-----------	---------------------------	-------	------------------------	-------------

Out of band emission, Band Edge

FCC Part 96

n77_2

Mode	Result (MHz)	Limit	Verdict
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-47.046	See Graphs	Pass
n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-46.672	See Graphs	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-45.288	See Graphs	Pass
n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-46.469	See Graphs	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-43.121	See Graphs	Pass
n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-47.095	See Graphs	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-39.278	See Graphs	Pass
n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-46.632	See Graphs	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-47.013	See Graphs	Pass
n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-47.044	See Graphs	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-46.663	See Graphs	Pass
n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-46.415	See Graphs	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-37.963	See Graphs	Pass
n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-47.055	See Graphs	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-37.253	See Graphs	Pass
n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-46.102	See Graphs	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-32.053	See Graphs	Pass
n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-46.677	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-29.904	See Graphs	Pass
n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-46.479	See Graphs	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-38.340	See Graphs	Pass
n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-46.959	See Graphs	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-36.052	See Graphs	Pass
n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-46.329	See Graphs	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-38.173	See Graphs	Pass
n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-46.881	See Graphs	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-31.606	See Graphs	Pass
n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-46.127	See Graphs	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-42.076	See Graphs	Pass
n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-47.126	See Graphs	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-39.935	See Graphs	Pass
n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-46.152	See Graphs	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-26.912	See Graphs	Pass
n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-45.580	See Graphs	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-25.577	See Graphs	Pass
n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-45.782	See Graphs	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-24.932	See Graphs	Pass
n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-42.655	See Graphs	Pass
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-22.580	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-46.121	See Graphs	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-23.363	See Graphs	Pass
n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-43.321	See Graphs	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-21.486	See Graphs	Pass
n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-46.339	See Graphs	Pass

n78_2


Mode	Result (MHz)	Limit	Verdict
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0	-46.899	See Graphs	Pass
n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0	-47.130	See Graphs	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23	-46.616	See Graphs	Pass
n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0	-46.398	See Graphs	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB1@0	-39.398	See Graphs	Pass
n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM QPSK_RB36@0	-46.855	See Graphs	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB1@37	-45.082	See Graphs	Pass
n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM QPSK_RB36@0	-46.590	See Graphs	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0	-44.630	See Graphs	Pass
n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0	-44.755	See Graphs	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50	-45.208	See Graphs	Pass
n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0	-46.478	See Graphs	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0	-38.499	See Graphs	Pass
n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0	-46.919	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77	-35.990	See Graphs	Pass
n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0	-45.735	See Graphs	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0	-33.211	See Graphs	Pass
n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB100@0	-44.996	See Graphs	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB1@105	-28.288	See Graphs	Pass
n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM QPSK_RB100@0	-46.338	See Graphs	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0	-36.700	See Graphs	Pass
n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB128@0	-46.873	See Graphs	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB1@132	-34.394	See Graphs	Pass
n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM QPSK_RB128@0	-46.389	See Graphs	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0	-37.474	See Graphs	Pass
n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB162@0	-46.916	See Graphs	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB1@161	-33.856	See Graphs	Pass
n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM QPSK_RB162@0	-45.584	See Graphs	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0	-40.774	See Graphs	Pass
n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB180@0	-46.861	See Graphs	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB1@188	-39.088	See Graphs	Pass
n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM QPSK_RB180@0	-46.028	See Graphs	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0	-26.143	See Graphs	Pass
n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB216@0	-44.902	See Graphs	Pass
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB1@216	-24.826	See Graphs	Pass

Mode	Result (MHz)	Limit	Verdict
n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM QPSK_RB216@0	-46.103	See Graphs	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0	-23.435	See Graphs	Pass
n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB243@0	-44.631	See Graphs	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB1@244	-23.264	See Graphs	Pass
n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM QPSK_RB243@0	-46.315	See Graphs	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0	-21.670	See Graphs	Pass
n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB270@0	-44.040	See Graphs	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB1@272	-21.362	See Graphs	Pass
n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM QPSK_RB270@0	-46.211	See Graphs	Pass


n77_2

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0

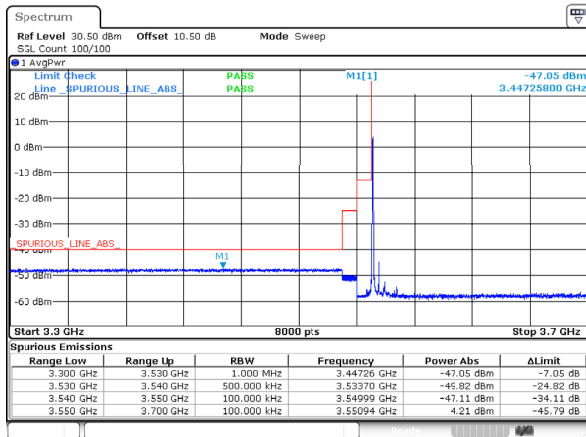


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:24:33

n77_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0

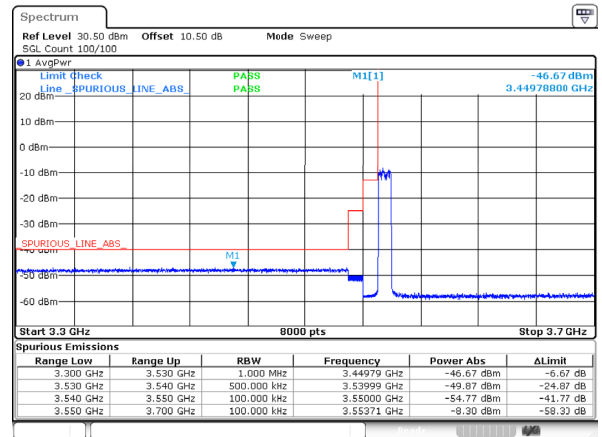


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:25:29

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM
QPSK_RB1@23

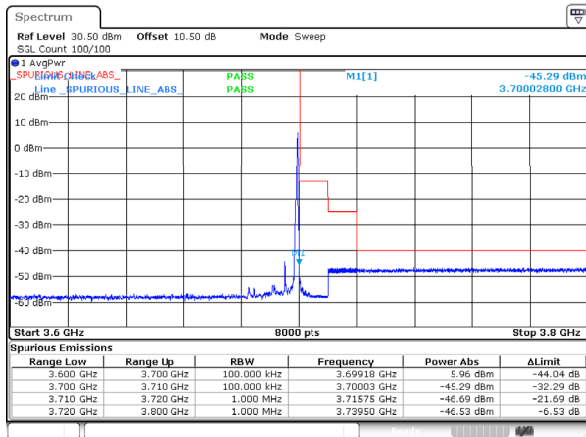


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:26:29

n77_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0

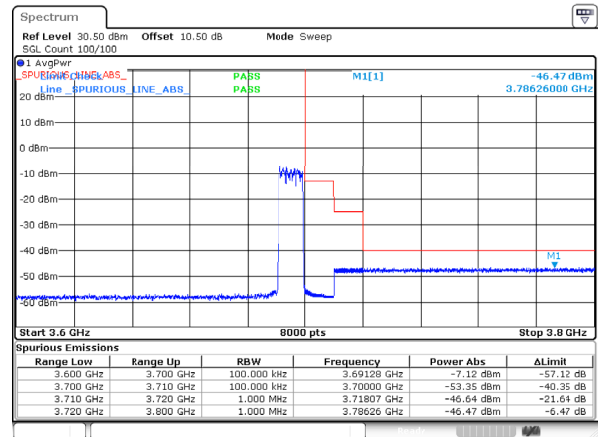


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:27:24

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

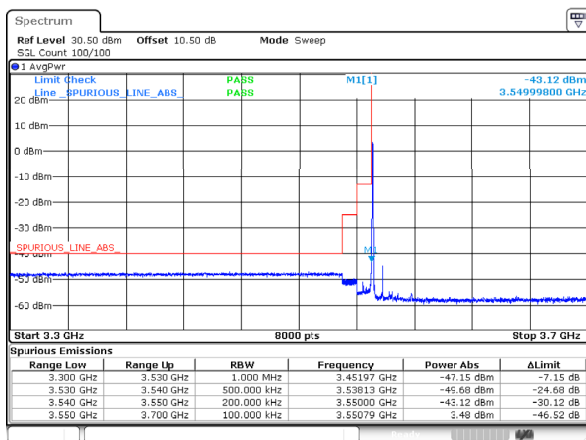


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:28:15

n77_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

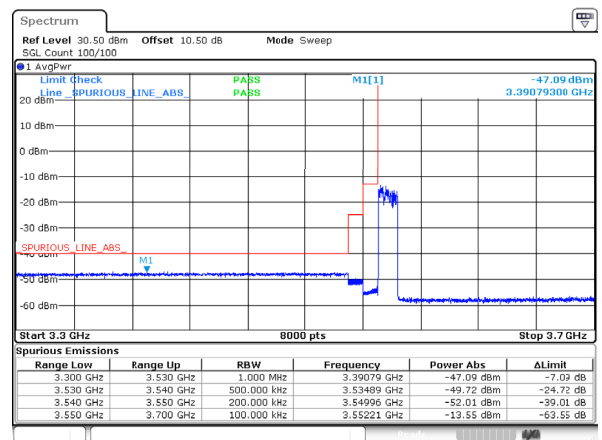


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:28:57

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37

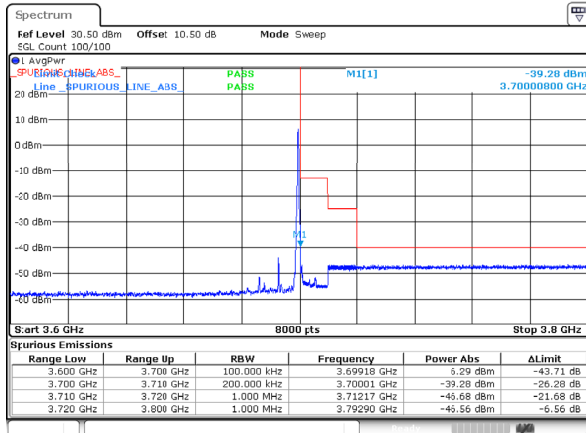


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:29:44

n77_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0

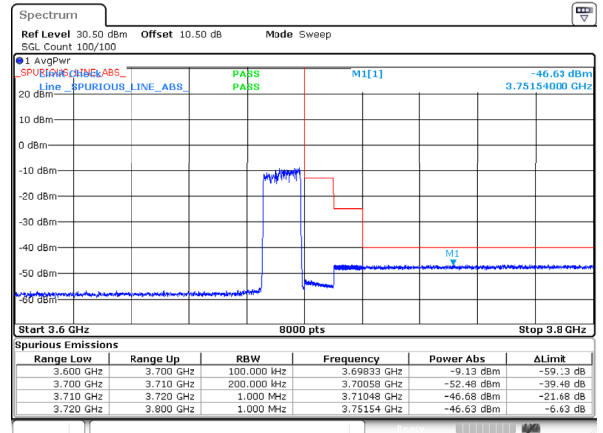


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:30:27

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0

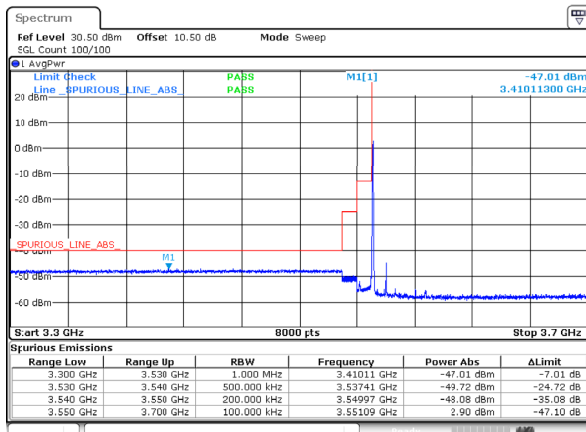


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:35:40

n77_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0

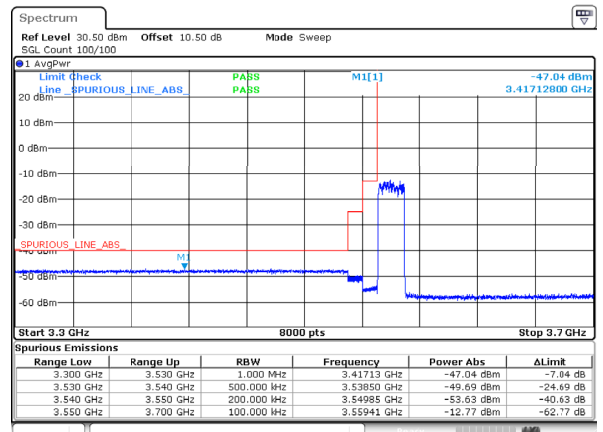


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:36:22

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50

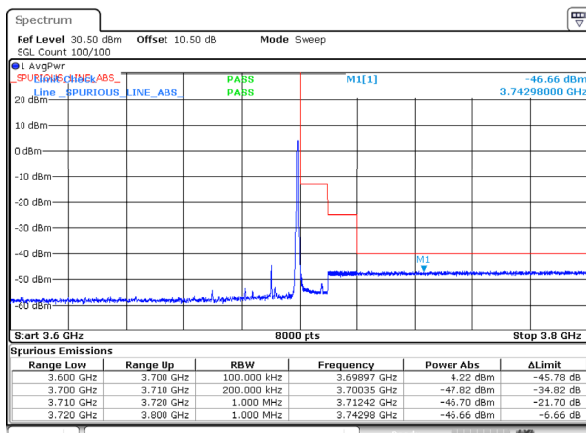


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:37:14

n77_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0

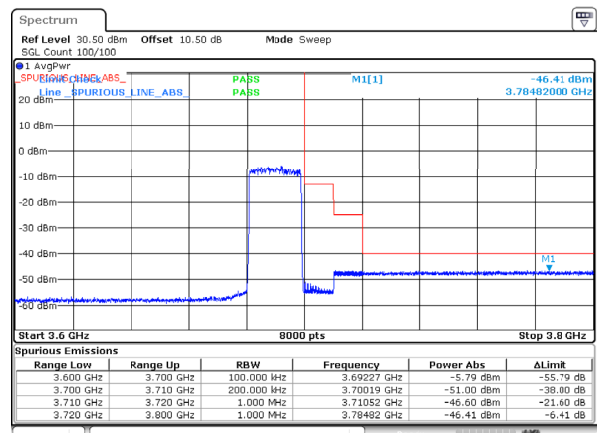


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:37:56

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0

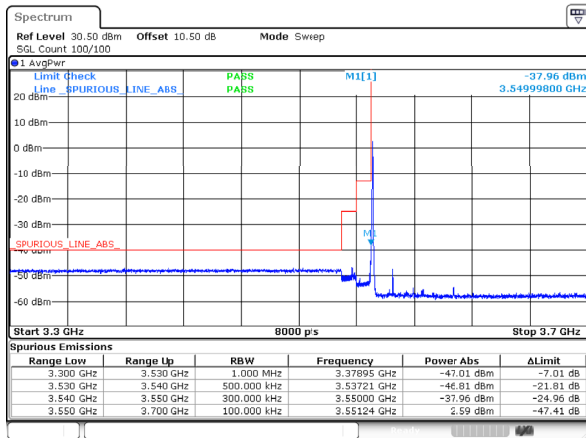


ProjectNo.:2501P28739E-RF Tester:Kungfumaester Liang
Date: 19.FEB.2025 10:38:46

n77_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0

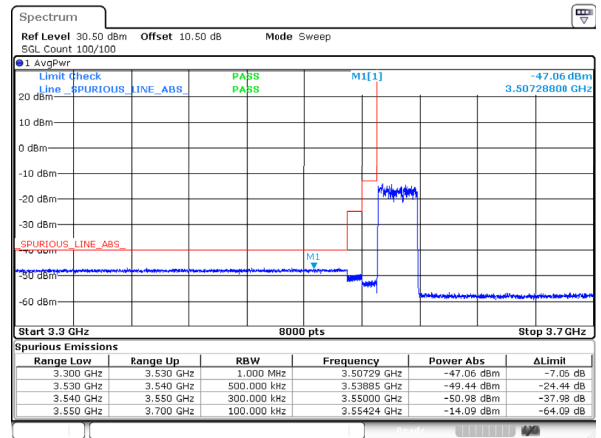


ProjectNo.:2501P28739E-RF Tester:Kungfumaester Liang
Date: 19.FEB.2025 10:39:28

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM
QPSK_RB1@77

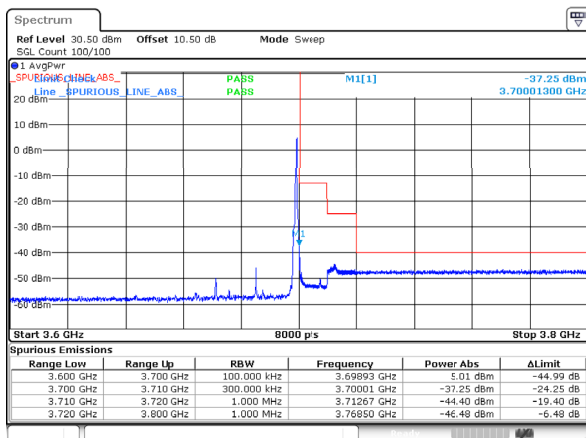


ProjectNo.:2501P28739E-RF Tester:Kungfumaester Liang
Date: 19.FEB.2025 10:40:20

n77_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0

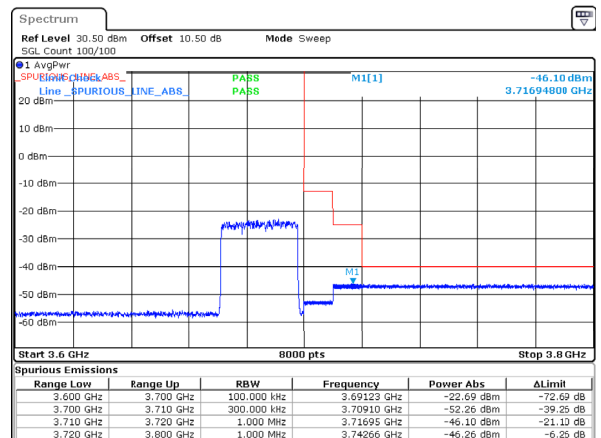


ProjectNo.:2501P28739E-RF Tester:Kungfumaester Liang
Date: 3.MAR.2025 09:15:07

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0

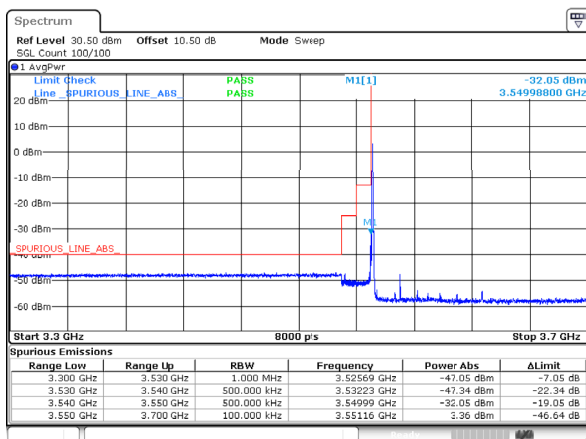


ProjectNo.:2501P28739E-RF Tester:Kungfumaester Liang
Date: 19.FEB.2025 10:41:51

n77_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

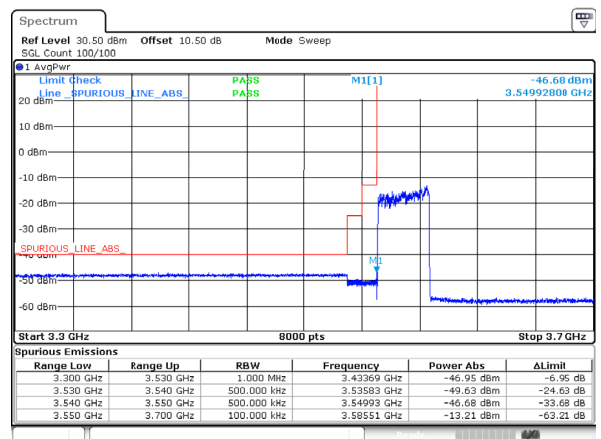


ProjectNo.:2501P28739E-RF Tester:Kungfumaester Liang
Date: 19.FEB.2025 10:42:33

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

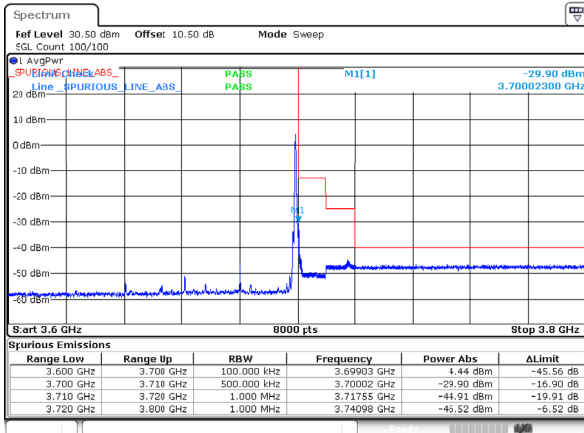


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:43:24

n77_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

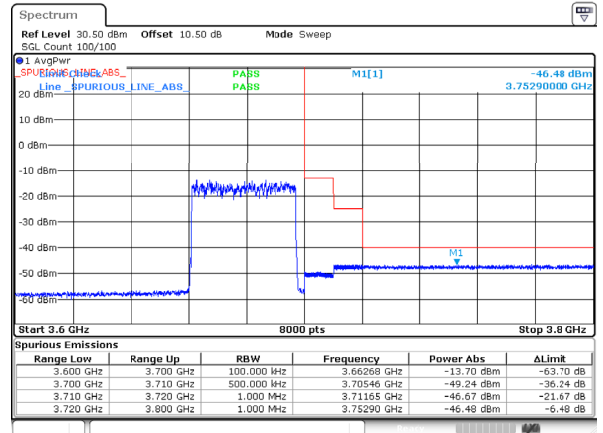


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:44:06

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0

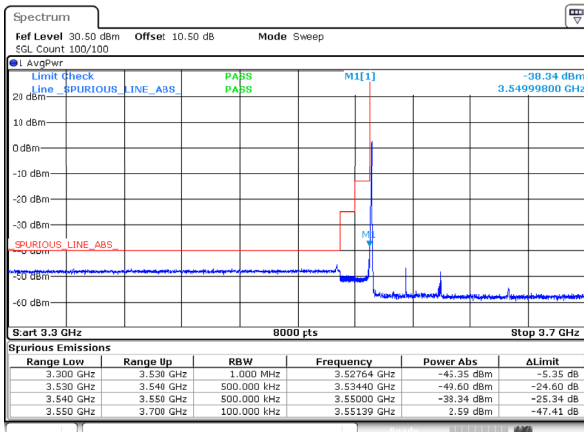


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:44:55

n77_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

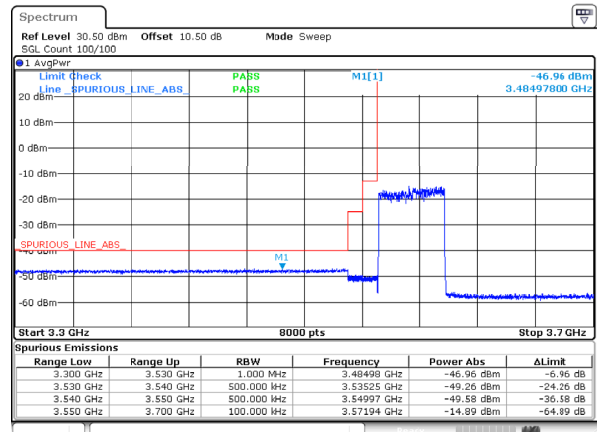


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:45:39

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

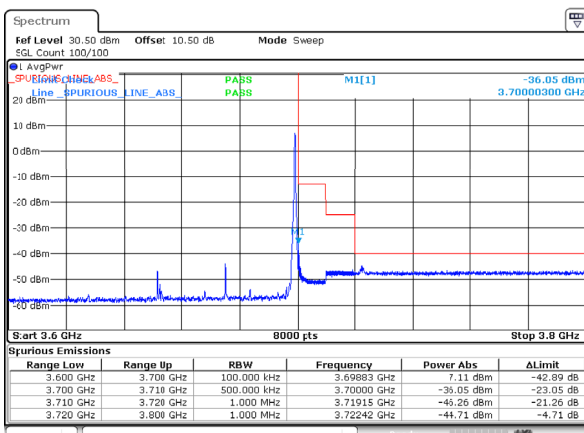


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:46:27

n77_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

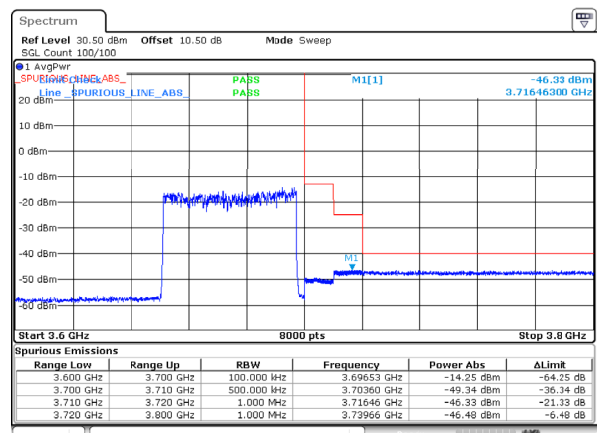


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:47:08

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0

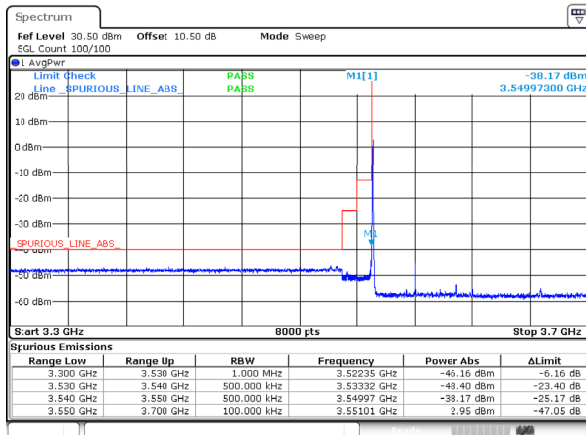


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:47:59

n77_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

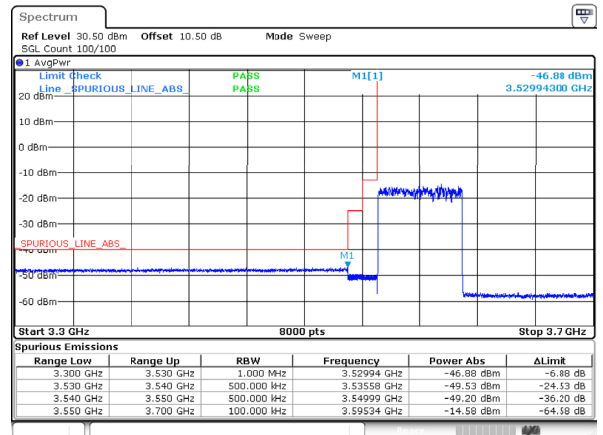


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:48:41

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161

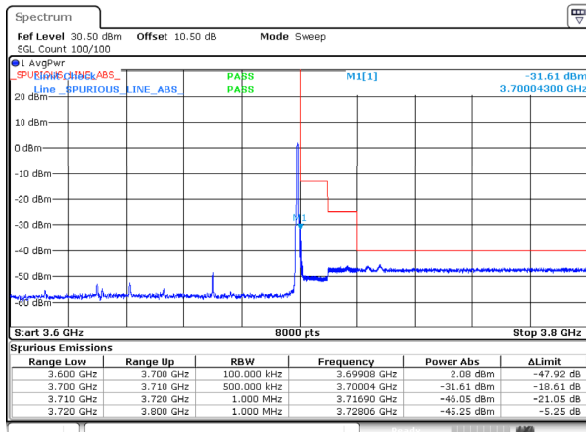


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:49:28

n77_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0

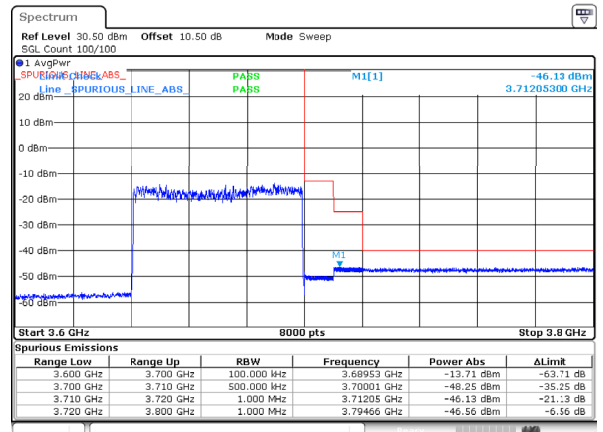


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:50:10

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0

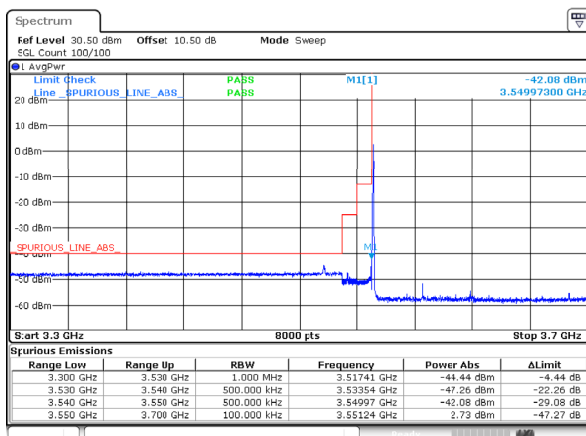


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:50:59

n77_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0

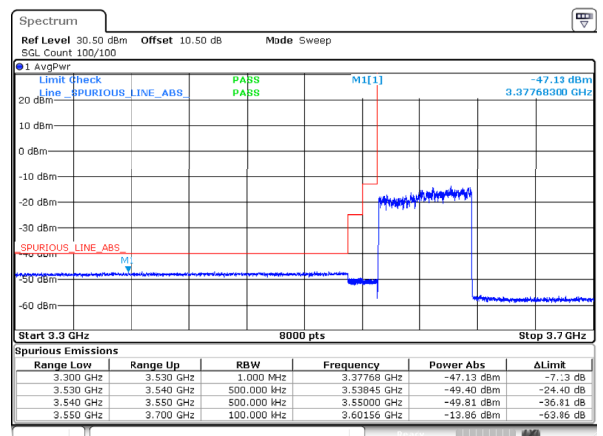


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:51:41

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188

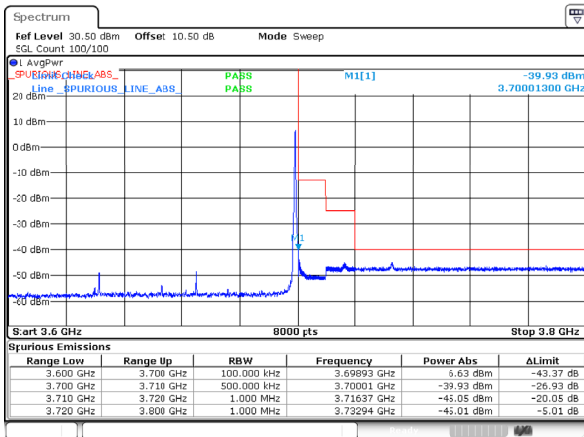


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:52:27

n77_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0

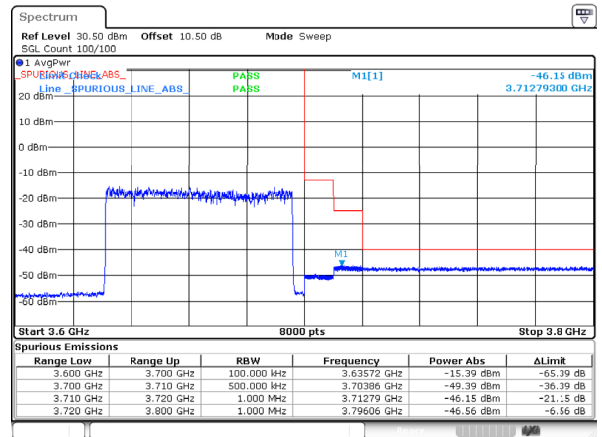


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:53:09

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0

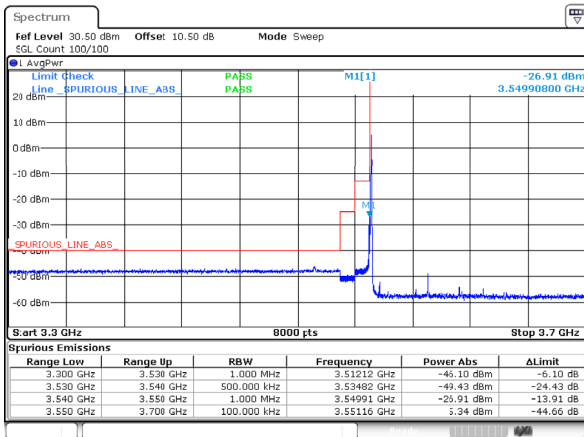


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:53:59

n77_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

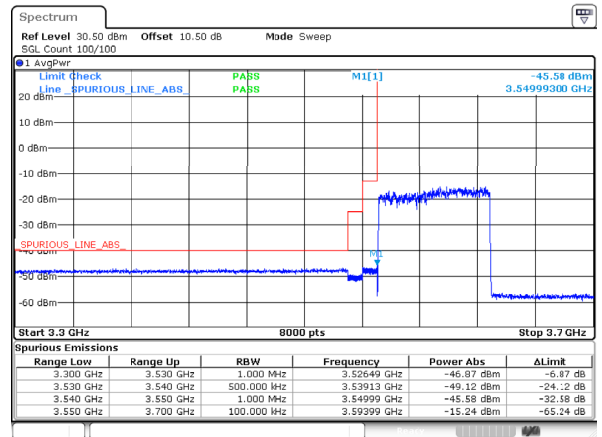


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:54:41

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

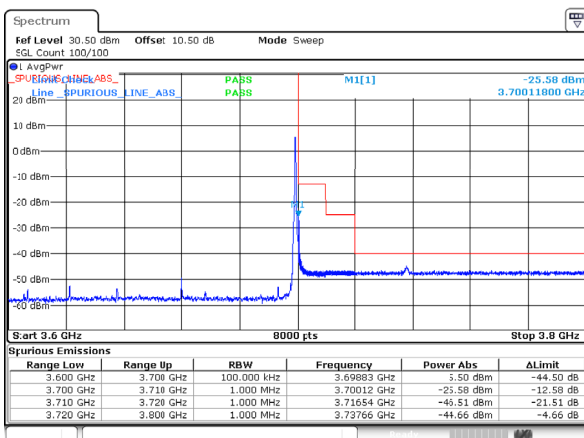


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:55:26

n77_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

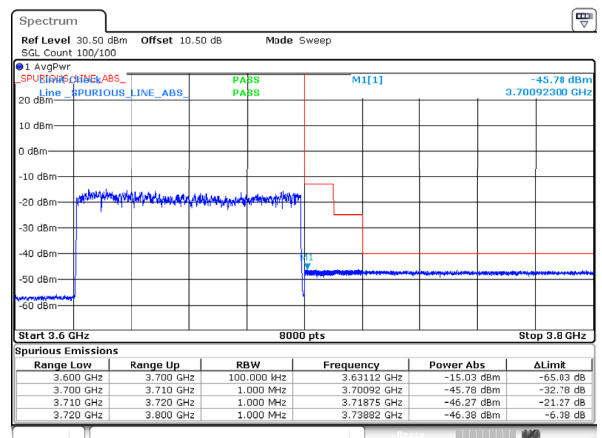


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 10:56:06

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0

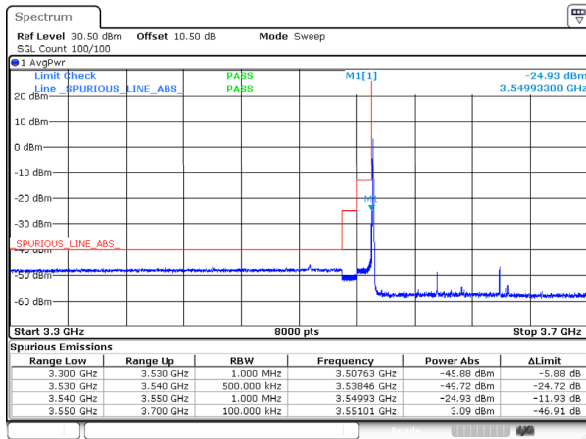


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:56:56

n77_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

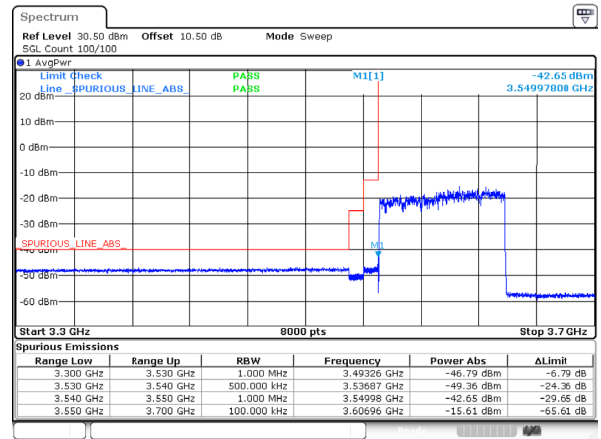


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:57:38

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244

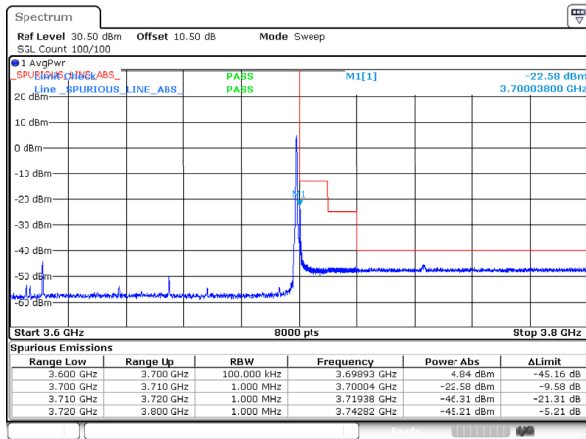


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:58:23

n77_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0

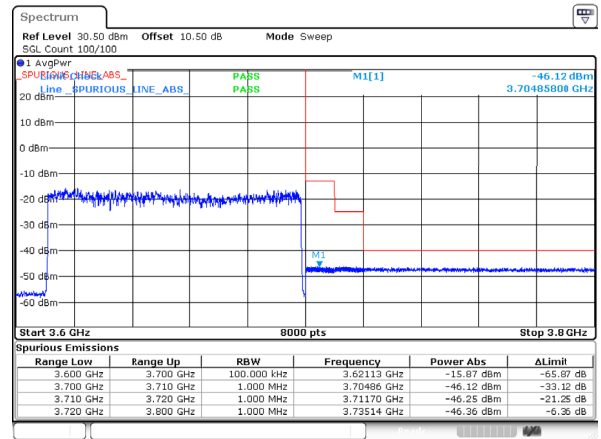


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:59:04

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0

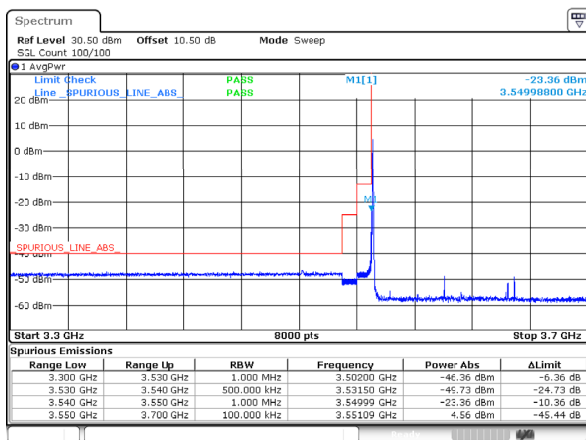


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 10:59:53

n77_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0

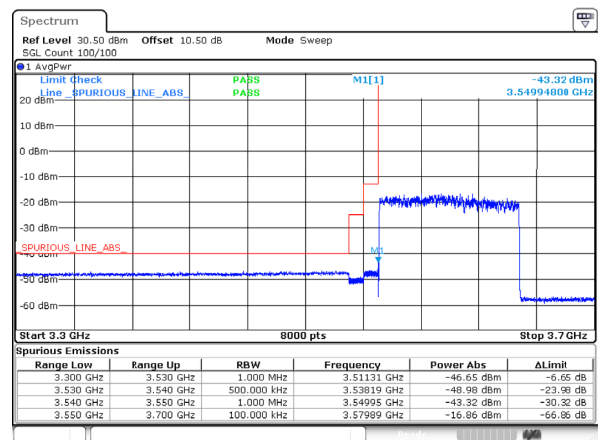


ProjectNo.:2501P28739E-RF Tester:Kungfumaeter Liang
Date: 19.FEB.2025 11:00:34

n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272

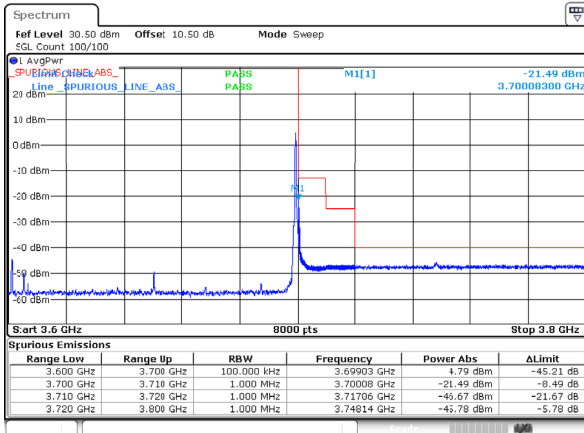

ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 11:01:20


n77_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0

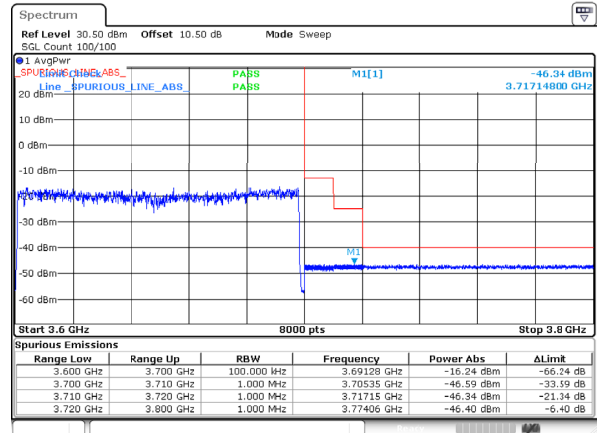

ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 11:02:03


n78_2

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB1@0

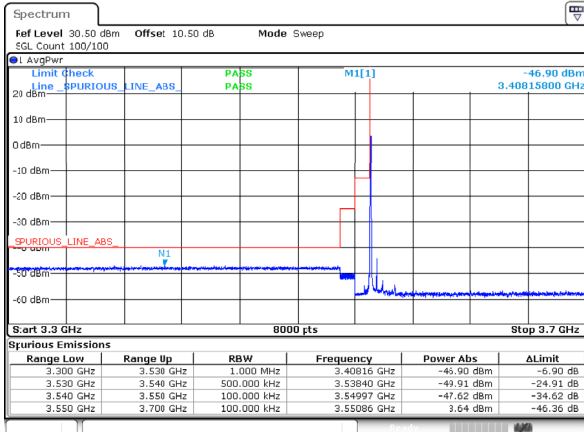


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:16:48

n78_2_10MHz_30kHz_3555MHz_DFT-s-OFDM QPSK_RB24@0

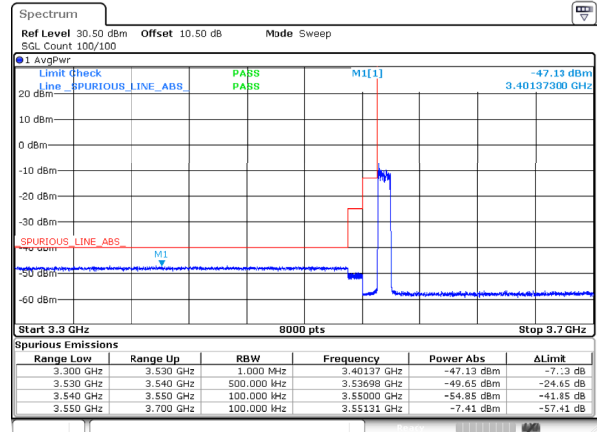


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:17:50

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB1@23

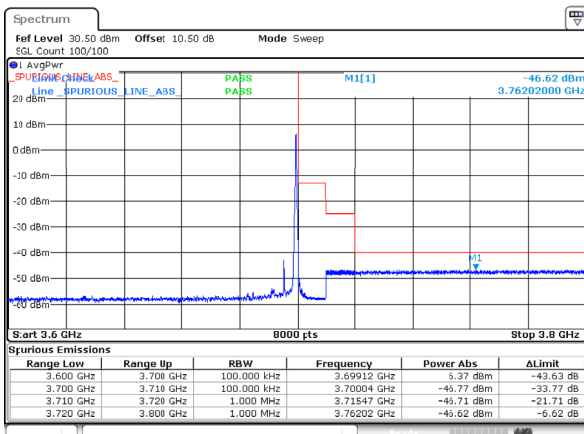


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:18:57

n78_2_10MHz_30kHz_3695MHz_DFT-s-OFDM QPSK_RB24@0

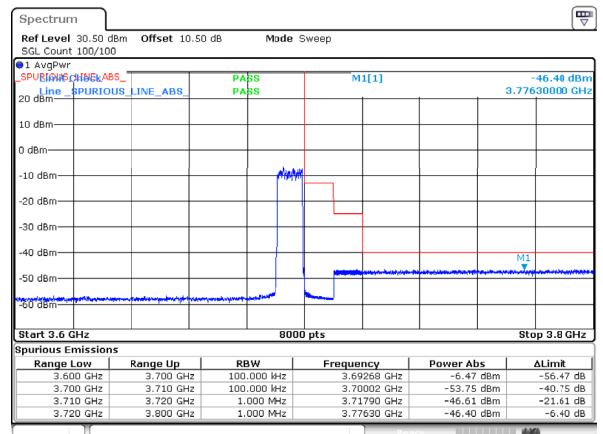


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:19:58

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB1@0

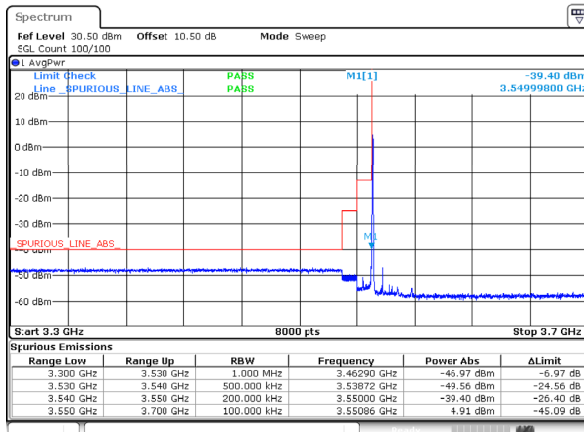


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:20:56

n78_2_15MHz_30kHz_3557.5MHz_DFT-s-OFDM
QPSK_RB36@0

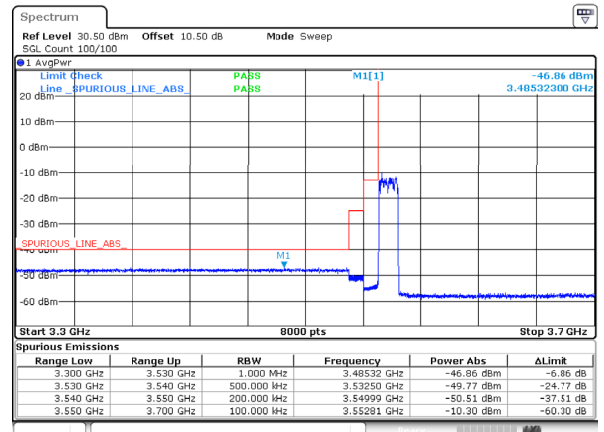


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:21:45

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB1@37

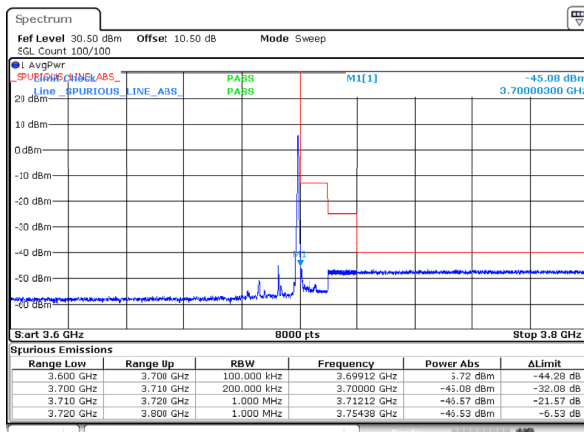


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:22:40

n78_2_15MHz_30kHz_3692.5MHz_DFT-s-OFDM
QPSK_RB36@0

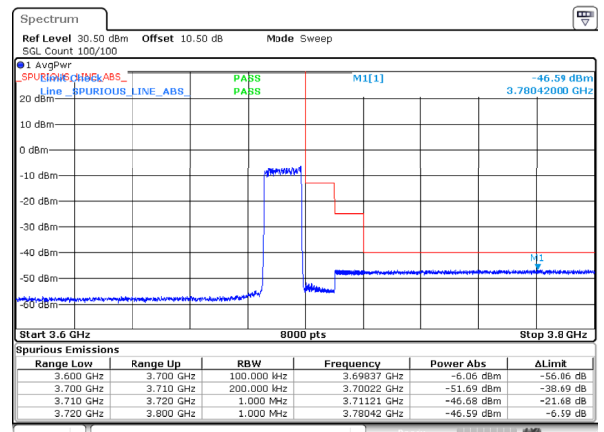


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:23:29

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB1@0

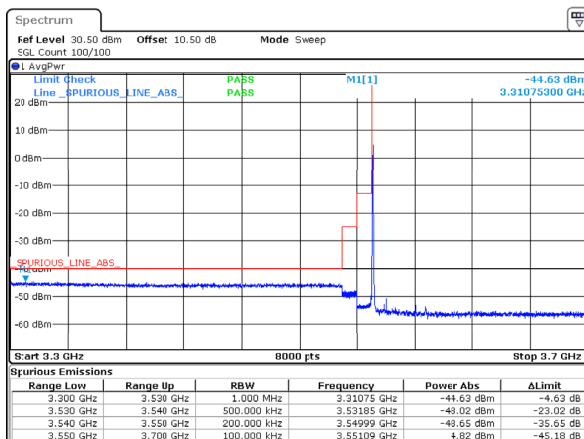


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 4.MAR.2025 10:15:10

n78_2_20MHz_30kHz_3560MHz_DFT-s-OFDM QPSK_RB50@0

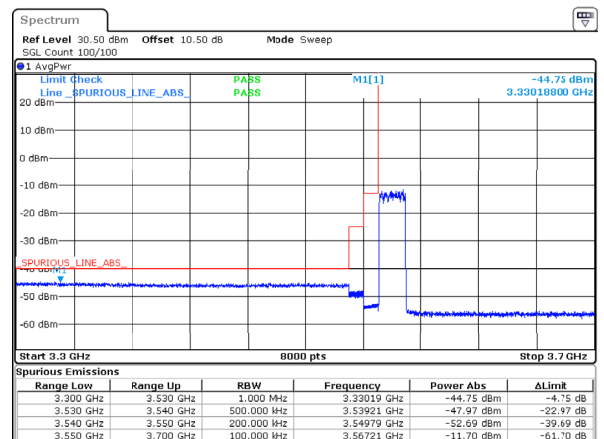


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 4.MAR.2025 10:16:31

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB1@50

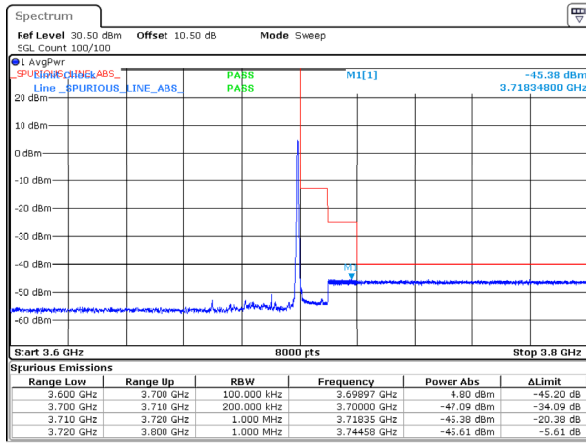


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 4.MAR.2025 10:48:05

n78_2_20MHz_30kHz_3690MHz_DFT-s-OFDM QPSK_RB50@0

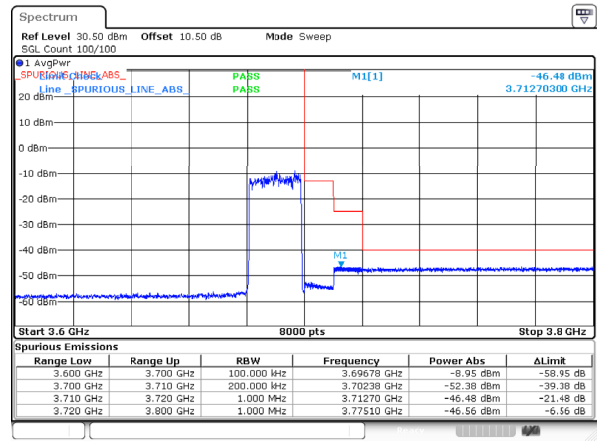


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:33:34

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB1@0

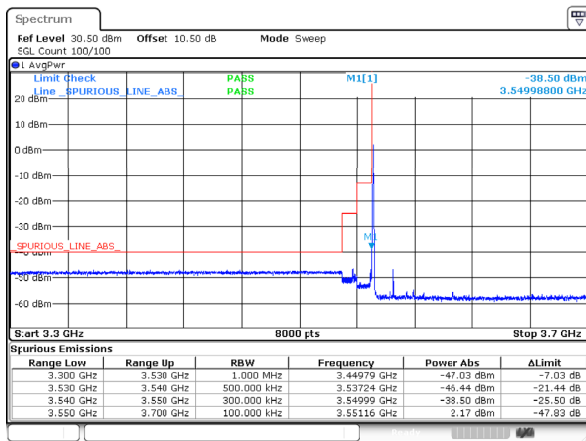


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:34:30

n78_2_30MHz_30kHz_3565MHz_DFT-s-OFDM QPSK_RB75@0

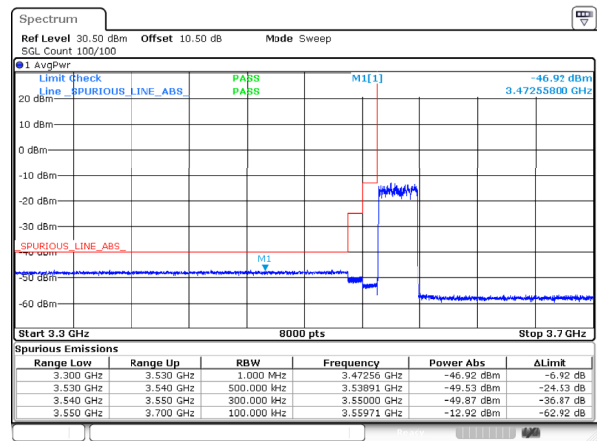


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:35:19

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB1@77

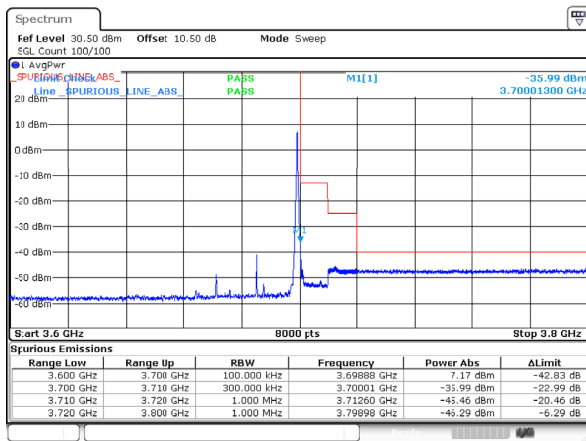


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:36:12

n78_2_30MHz_30kHz_3685MHz_DFT-s-OFDM QPSK_RB75@0

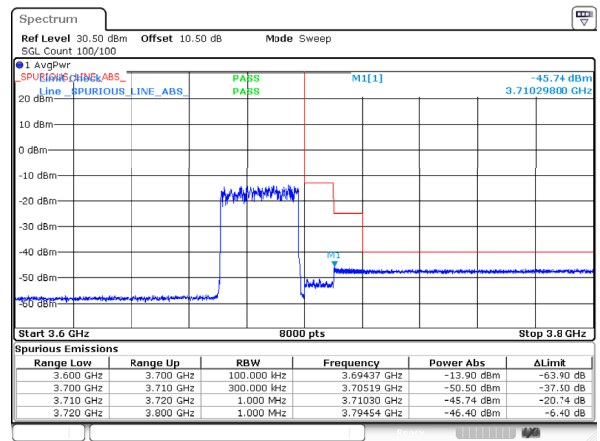


ProjectNo.:2501P28739E-RF Tester:Kungfumaister Liang
Date: 19.FEB.2025 12:37:01

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM QPSK_RB1@0

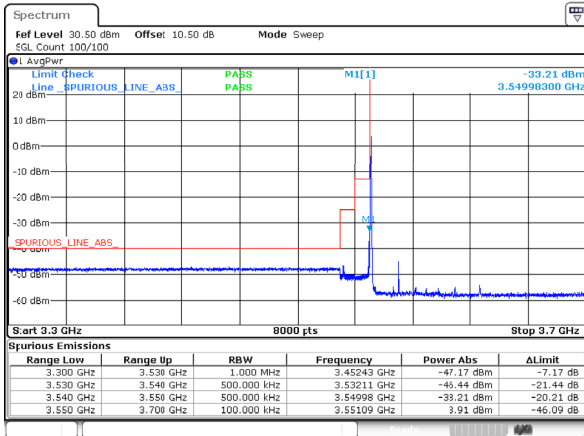


ProjectNo.:2501P28739E-RF Tester:Kungfumastr Liang
Date: 19.FEB.2025 12:37:57

n78_2_40MHz_30kHz_3570MHz_DFT-s-OFDM
QPSK_RB100@0

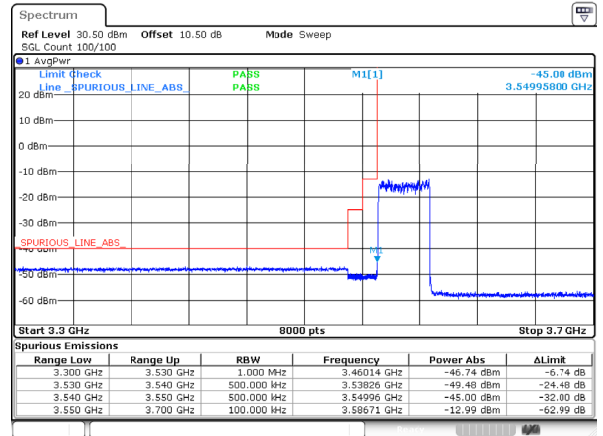


ProjectNo.:2501P28739E-RF Tester:Kungfumastr Liang
Date: 19.FEB.2025 12:38:47

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB1@105

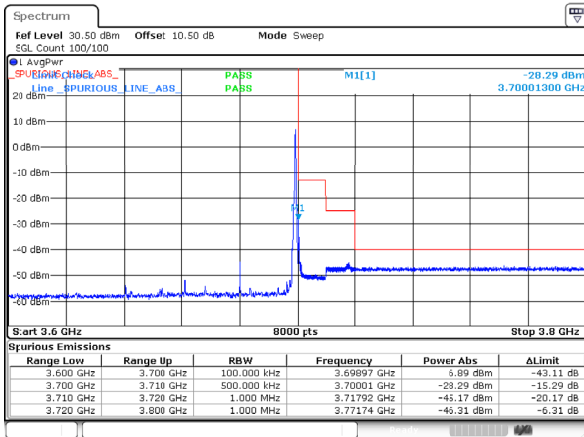


ProjectNo.:2501P28739E-RF Tester:Kungfumastr Liang
Date: 19.FEB.2025 12:39:40

n78_2_40MHz_30kHz_3680MHz_DFT-s-OFDM
QPSK_RB100@0

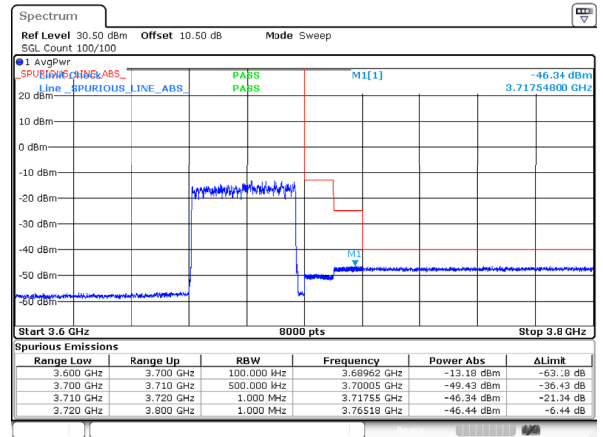


ProjectNo.:2501P28739E-RF Tester:Kungfumastr Liang
Date: 19.FEB.2025 12:40:28

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM QPSK_RB1@0

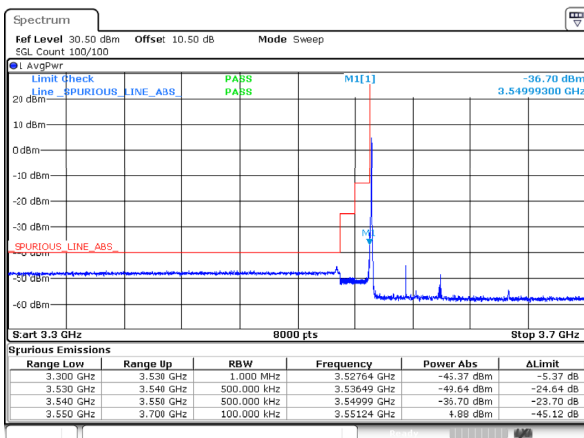


ProjectNo.:2501P28739E-RF Tester:Kungfumastr Liang
Date: 19.FEB.2025 12:41:24

n78_2_50MHz_30kHz_3575MHz_DFT-s-OFDM
QPSK_RB128@0

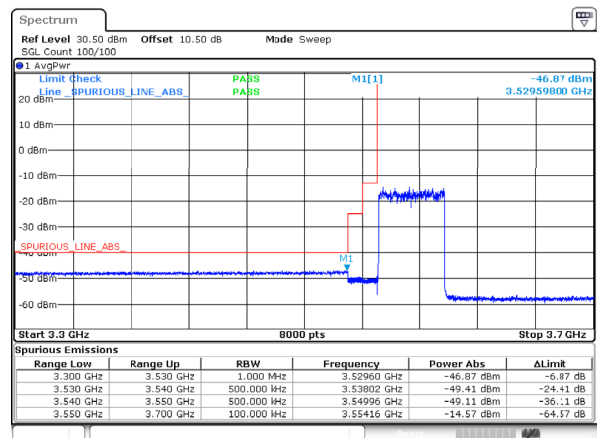


ProjectNo.:2501P28739E-RF Tester:Kungfumastr Liang
Date: 19.FEB.2025 12:42:13

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB1@132

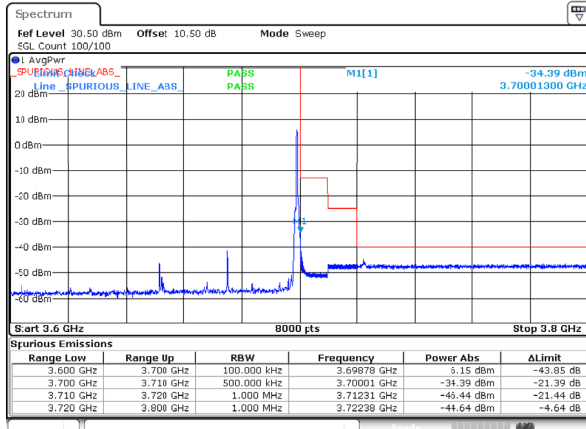


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:43:10

n78_2_50MHz_30kHz_3675MHz_DFT-s-OFDM
QPSK_RB128@0

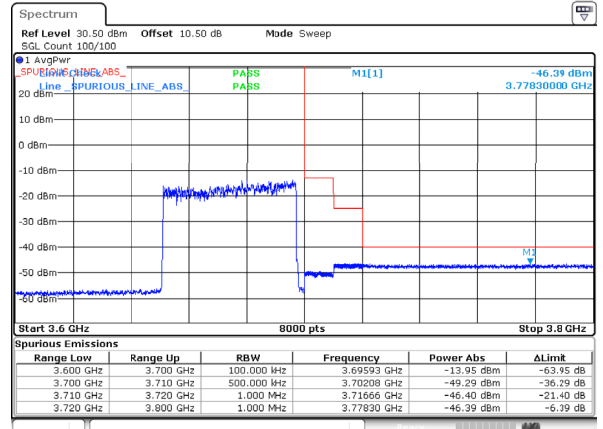


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:44:02

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM QPSK_RB1@0

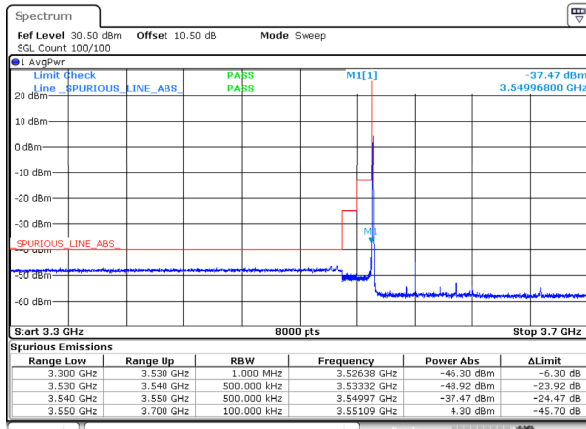


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:45:10

n78_2_60MHz_30kHz_3580MHz_DFT-s-OFDM
QPSK_RB162@0

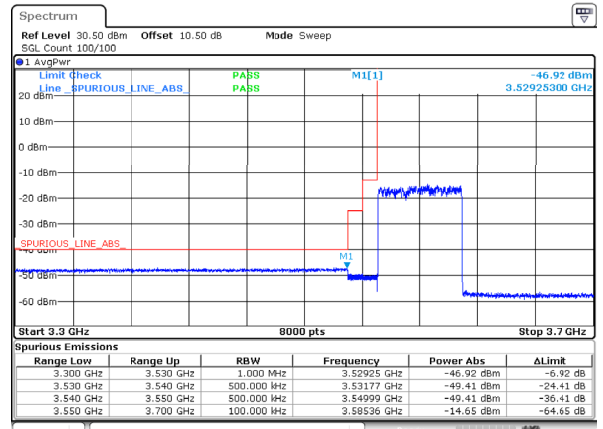


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:46:03

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB1@161

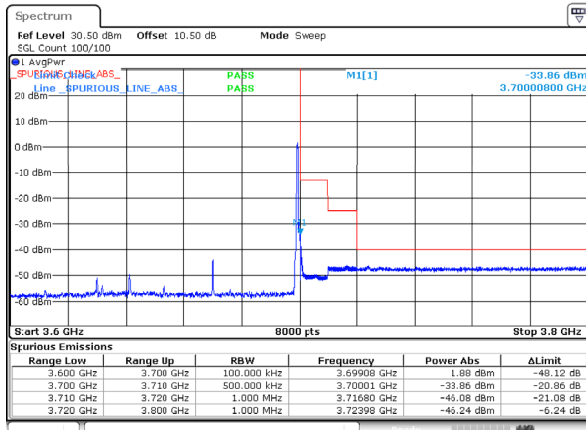


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:47:00

n78_2_60MHz_30kHz_3670MHz_DFT-s-OFDM
QPSK_RB162@0

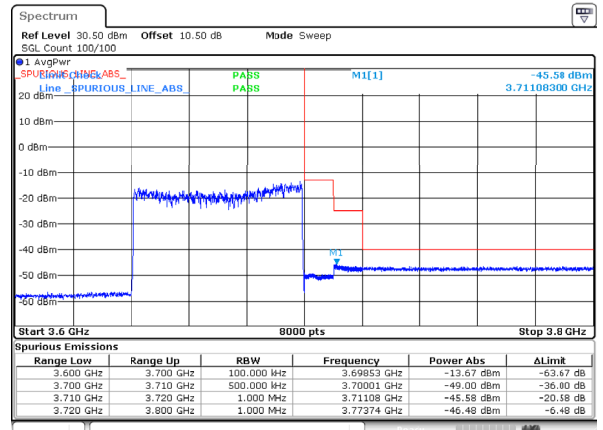


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:47:52

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM QPSK_RB1@0

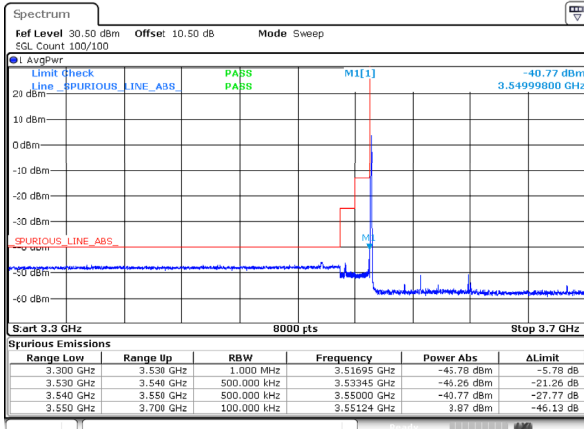


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:48:52

n78_2_70MHz_30kHz_3585MHz_DFT-s-OFDM
QPSK_RB180@0

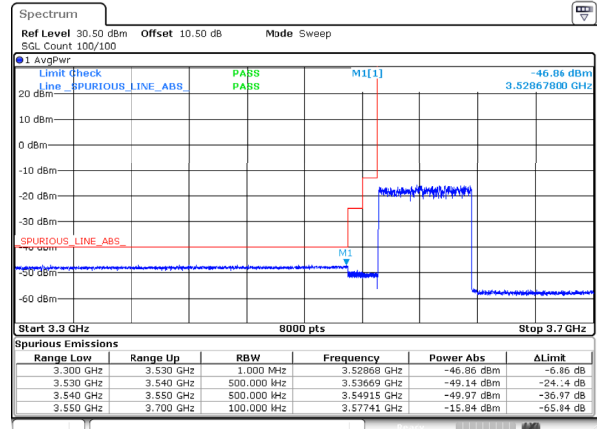


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:49:45

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB1@188

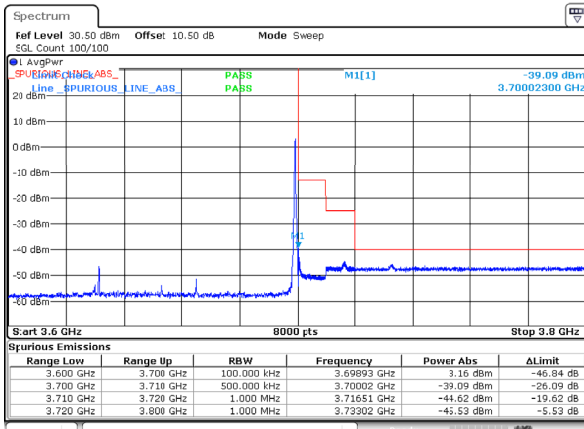


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:50:47

n78_2_70MHz_30kHz_3665MHz_DFT-s-OFDM
QPSK_RB180@0

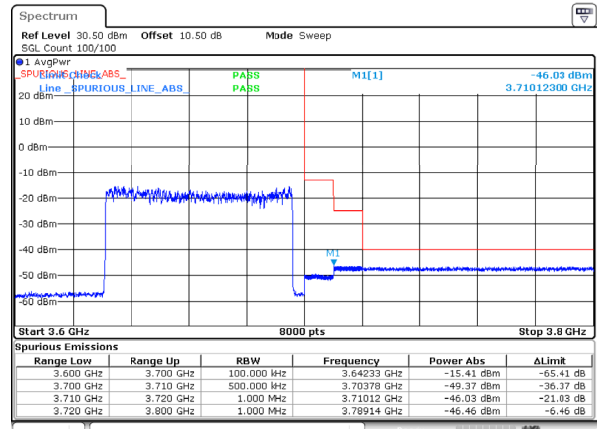


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:51:38

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM QPSK_RB1@0

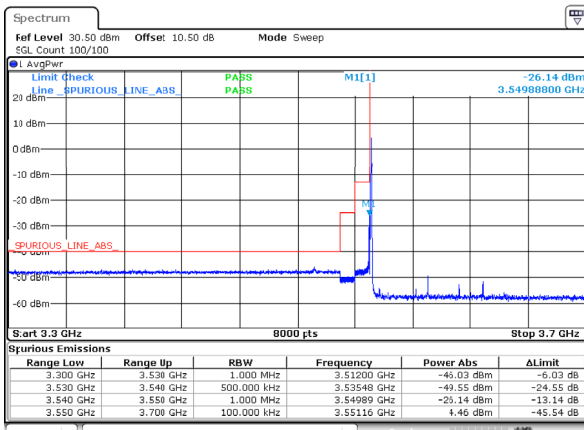


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:52:36

n78_2_80MHz_30kHz_3590MHz_DFT-s-OFDM
QPSK_RB216@0

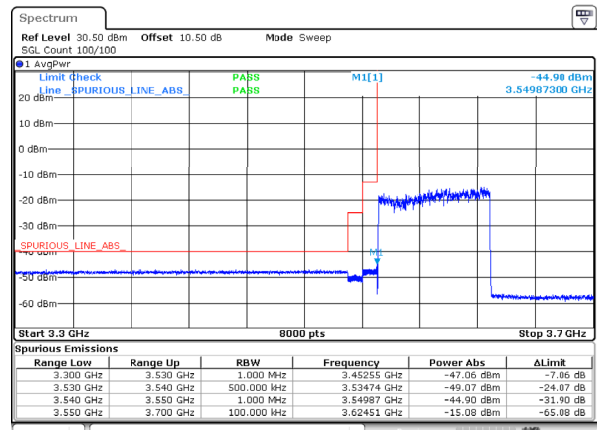


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:53:25

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB1@216

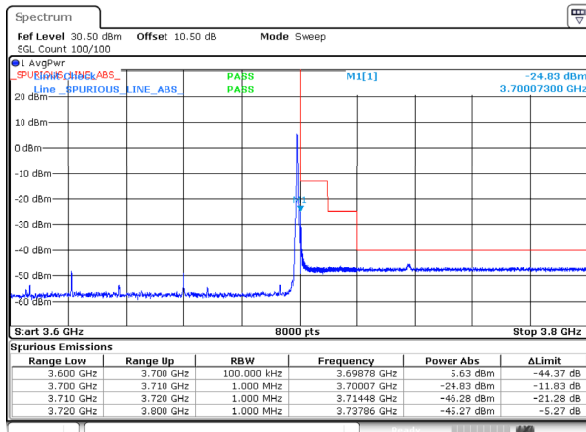


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:54:23

n78_2_80MHz_30kHz_3660MHz_DFT-s-OFDM
QPSK_RB216@0

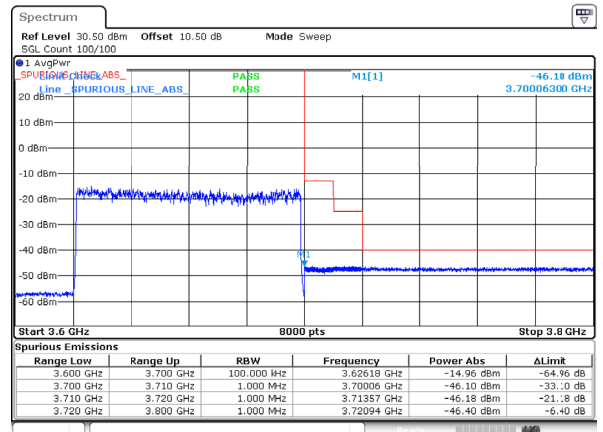


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:55:10

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM QPSK_RB1@0

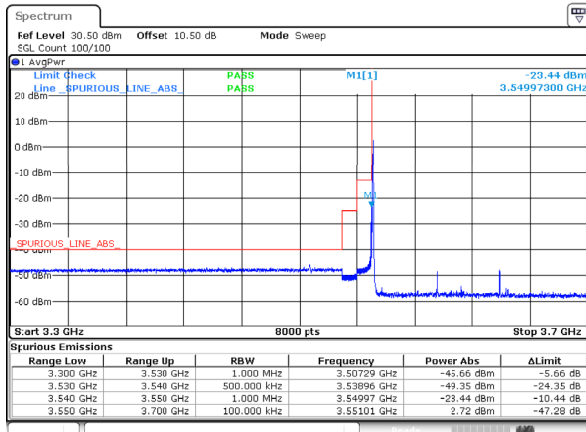


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:56:07

n78_2_90MHz_30kHz_3595MHz_DFT-s-OFDM
QPSK_RB243@0

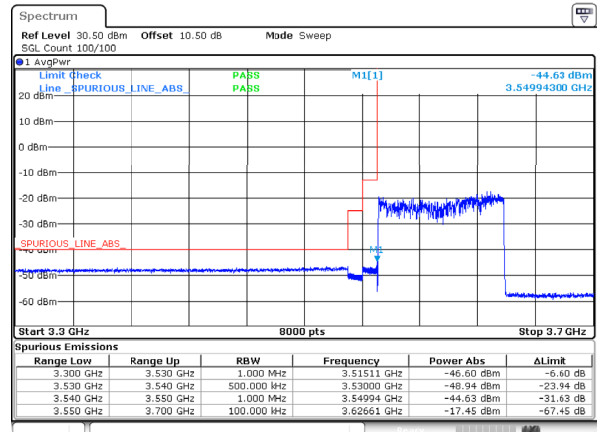


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:56:56

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB1@244

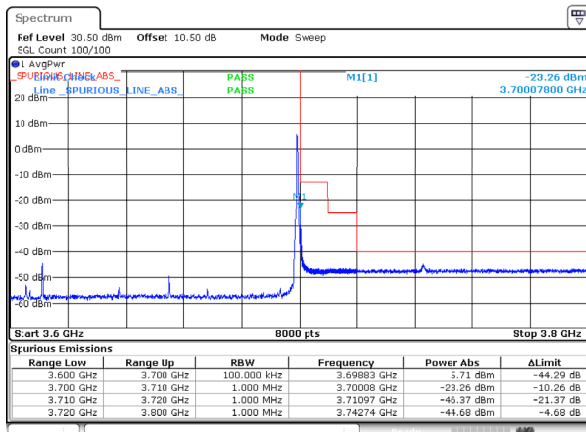


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:57:49

n78_2_90MHz_30kHz_3655MHz_DFT-s-OFDM
QPSK_RB243@0

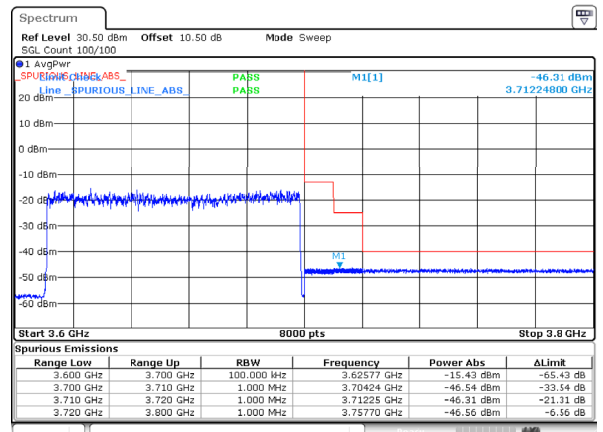


ProjectNo.:2501P28739E-RF Tester:Kungfumaaster Liang
Date: 19.FEB.2025 12:58:37

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM QPSK_RB1@0

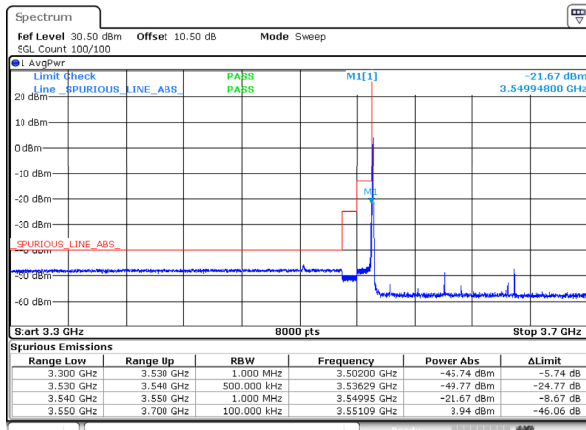


ProjectNo.:2501P28739E-RF Tester:Kungfumaater Liang
Date: 19.FEB.2025 12:59:33

n78_2_100MHz_30kHz_3600MHz_DFT-s-OFDM
QPSK_RB270@0

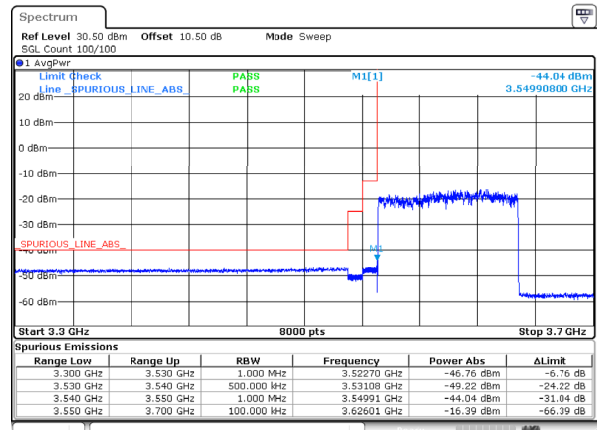


ProjectNo.:2501P28739E-RF Tester:Kungfumaater Liang
Date: 19.FEB.2025 13:00:26

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB1@272

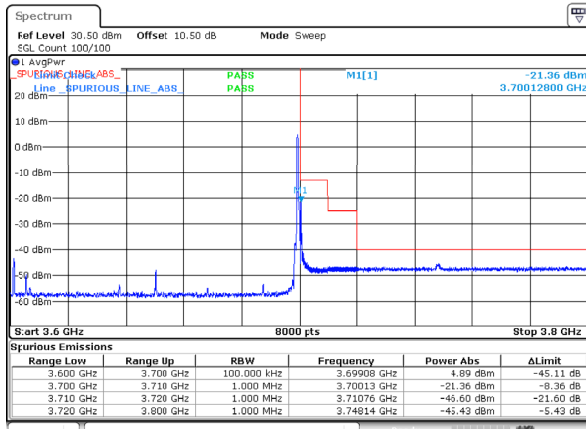

ProjectNo.:2501P28739E-RF Tester:Kungfumaater Liang
Date: 19.FEB.2025 13:01:26

n78_2_100MHz_30kHz_3650MHz_DFT-s-OFDM
QPSK_RB270@0

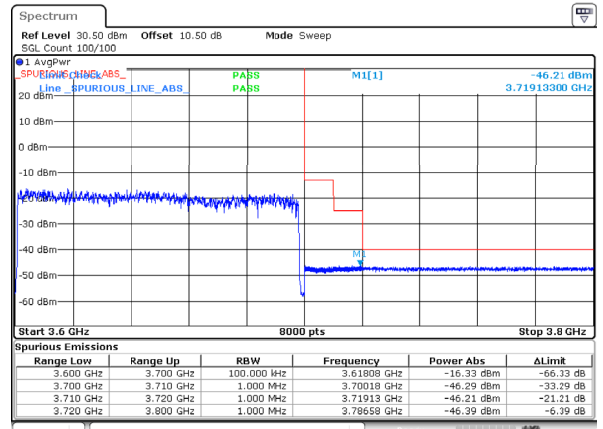

ProjectNo.:2501P28739E-RF Tester:Kungfumaater Liang
Date: 19.FEB.2025 13:02:18