



20MHz_High_QPSK_1@99

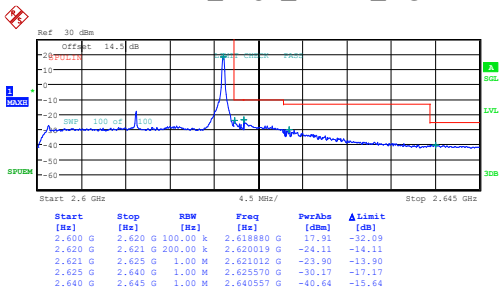


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:13:17

20MHz_High_QPSK_100@0

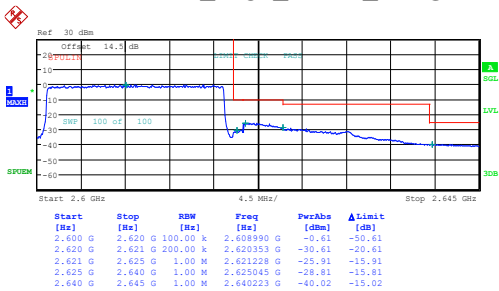


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:16:19

20MHz_High_16QAM_1@99

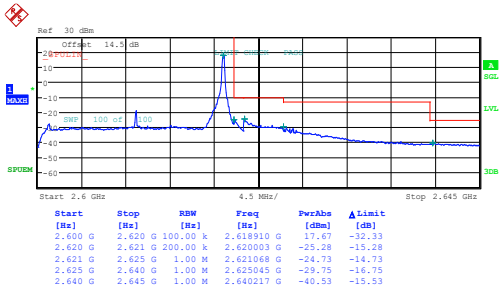

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:19:25


20MHz_High_16QAM_100@0

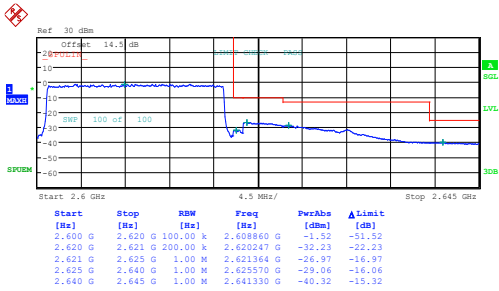

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:22:28


B41_2 , Normal

2_5MHz_Low_QPSK_1@0

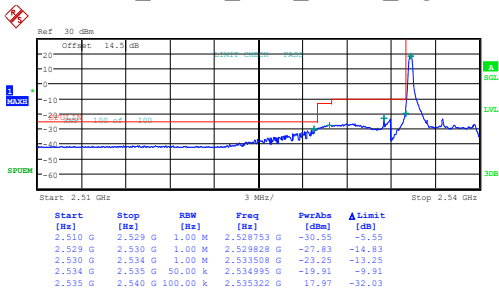


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:26:27

2_5MHz_Low_QPSK_25@0

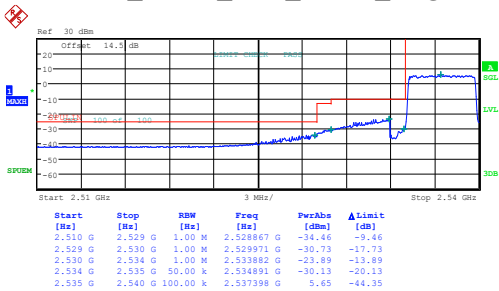


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:29:34

2_5MHz_Low_16QAM_1@0

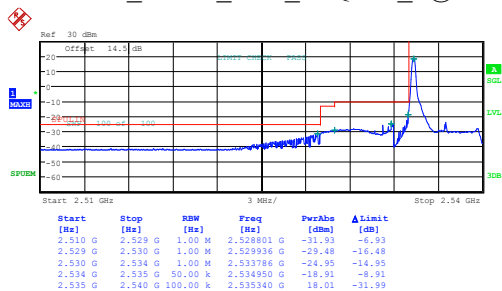


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:32:37

2_5MHz_Low_16QAM_25@0

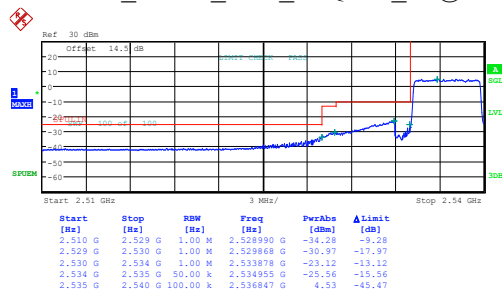


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:35:38

2_5MHz_High_QPSK_1@24

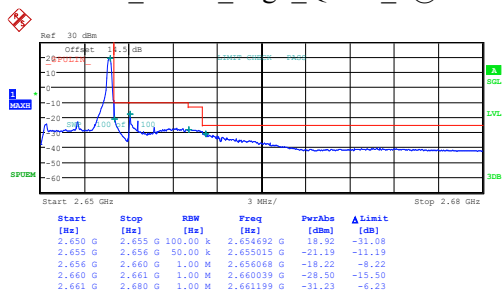


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:39:10

2_5MHz_High_QPSK_25@0

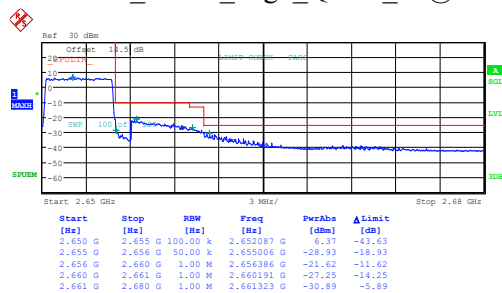


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:42:09

2_5MHz_High_16QAM_1@24

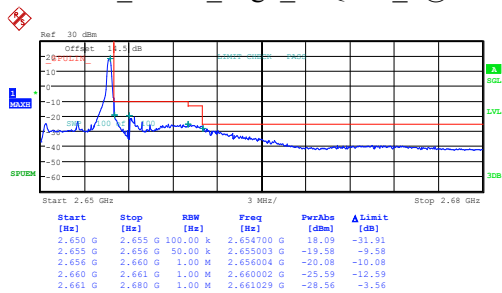


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:45:08

2_5MHz_High_16QAM_25@0

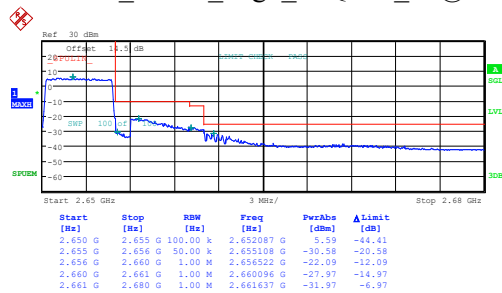


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:48:07

2_10MHz_Low_QPSK_1@0

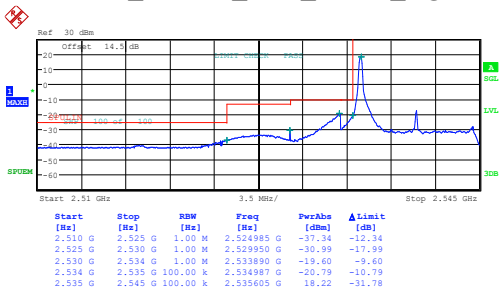


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:52:29

2_10MHz_Low_QPSK_50@0

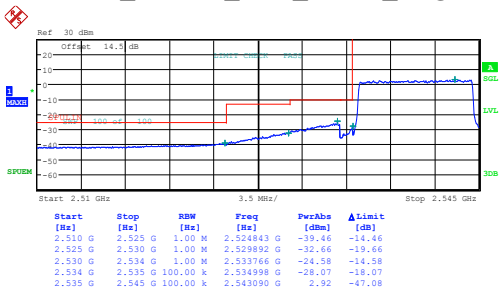


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:55:30

2_10MHz_Low_16QAM_1@0

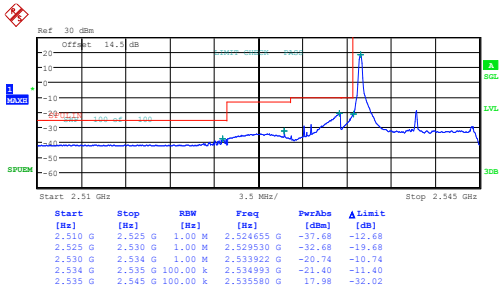


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 15:58:32

2_10MHz_Low_16QAM_50@0

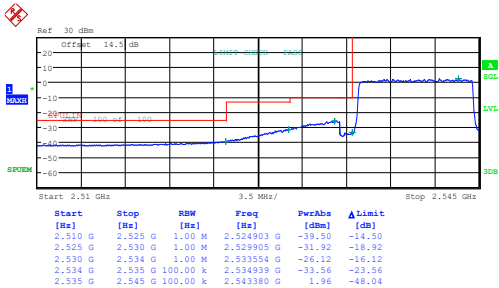


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:01:33

2_10MHz_High_QPSK_1@49

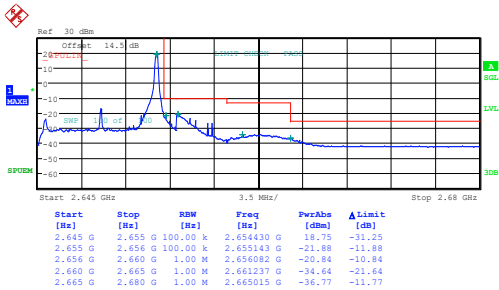


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:05:05

2_10MHz_High_QPSK_50@0

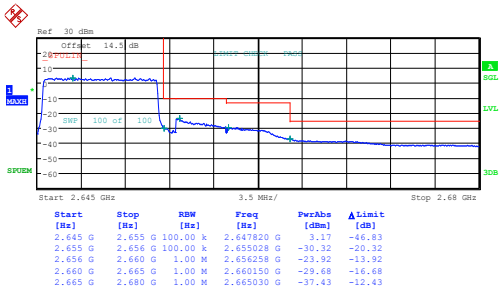


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:08:05

2_10MHz_High_16QAM_1@49

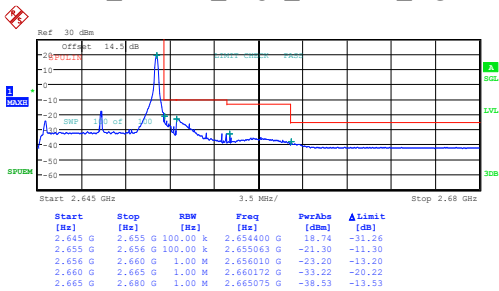


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:11:07

2_10MHz_High_16QAM_50@0

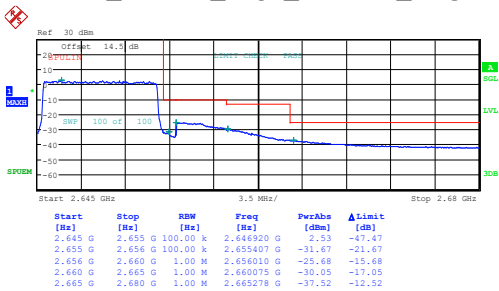


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:17:04

2_15MHz_Low_QPSK_1@0

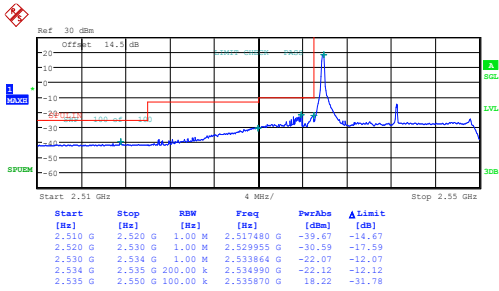


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:21:25

2_15MHz_Low_QPSK_75@0

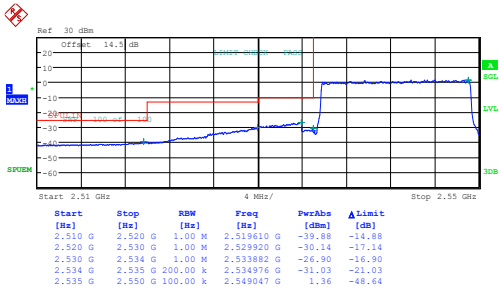


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:24:30

2_15MHz_Low_16QAM_1@0

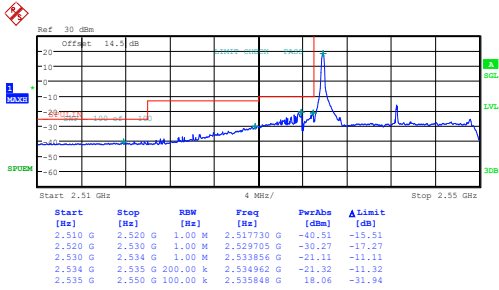


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:27:34

2_15MHz_Low_16QAM_75@0

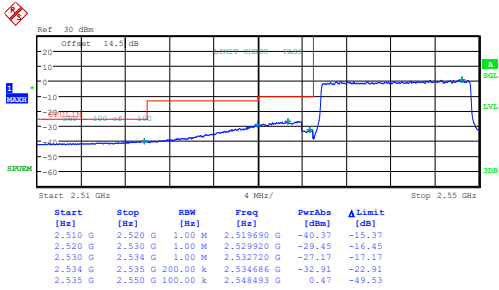


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:30:39

2_15MHz_High_QPSK_1@74

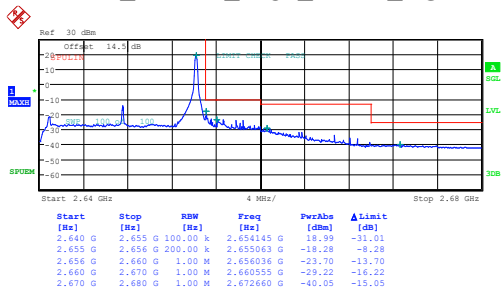


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:34:15

2_15MHz_High_QPSK_75@0

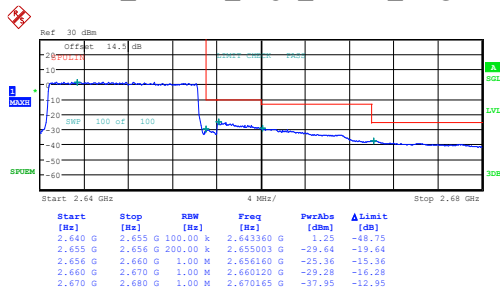


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:37:16

2_15MHz_High_16QAM_1@74

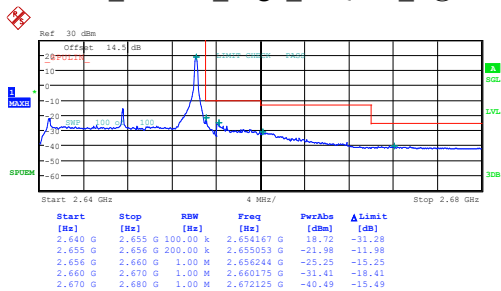


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:40:19

2_15MHz_High_16QAM_75@0

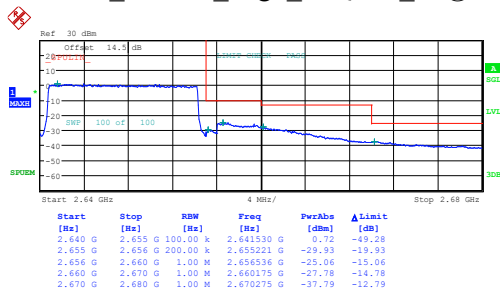


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:43:21

2_20MHz_Low_QPSK_1@0

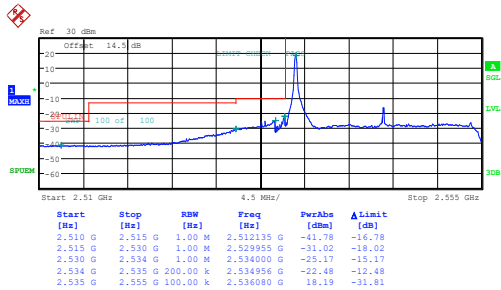


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:47:36

2_20MHz_Low_QPSK_100@0

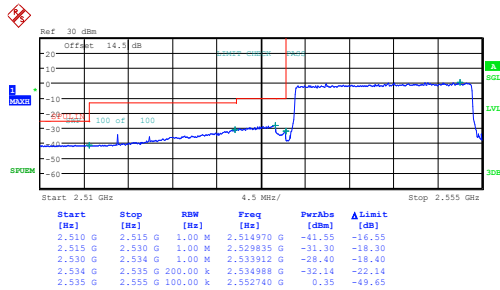


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 16:50:39

2_20MHz_Low_16QAM_1@0

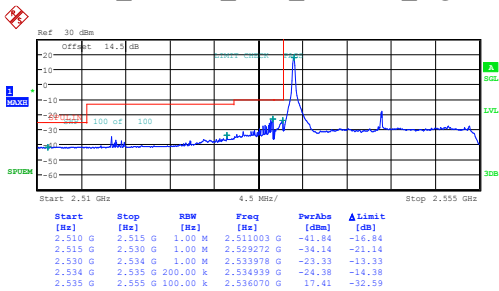


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 17:05:24

2_20MHz_Low_16QAM_100@0

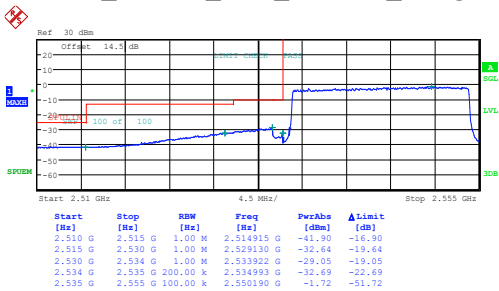


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 17:08:29

2_20MHz_High_QPSK_1@99

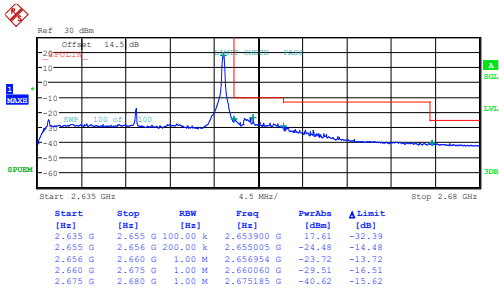


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 17:12:12

2_20MHz_High_QPSK_100@0

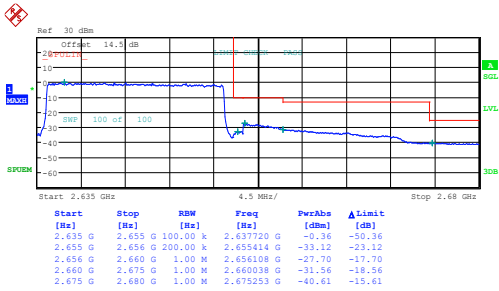


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 17:15:14

2_20MHz_High_16QAM_1@99

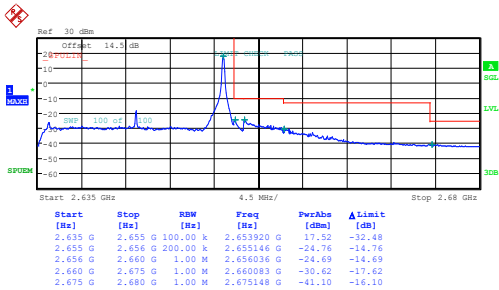

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 17:18:18

2_20MHz_High_16QAM_100@0

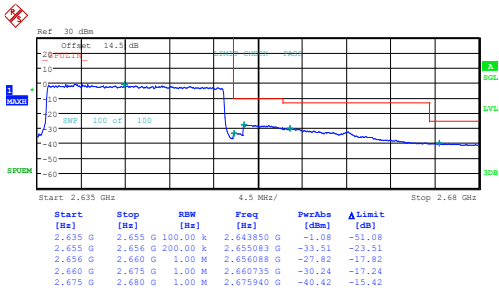

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 17:21:19


Spurious Emissions at Antenna Terminal**FCC Part 22H****B5 , Normal**

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.23	See Graphs	Pass
1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)	-29.02	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-32.92	See Graphs	Pass
1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)	-31.05	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)	-30.62	See Graphs	Pass
1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)	-29.89	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-30.80	See Graphs	Pass
3MHz_Low_QPSK_15@0(30MHz~9.49GHz)	-33.54	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.63	See Graphs	Pass
3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)	-31.93	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~9.49GHz)	-27.24	See Graphs	Pass
3MHz_High_QPSK_15@0(30MHz~9.49GHz)	-32.98	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-31.78	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~9.49GHz)	-32.32	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-32.03	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)	-32.36	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~9.49GHz)	-33.83	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~9.49GHz)	-34.19	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-34.28	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~9.49GHz)	-33.24	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-33.03	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)	-34.57	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~9.49GHz)	-35.19	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~9.49GHz)	-35.04	See Graphs	Pass

Note:1RB was the worst case.


B5 , Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)

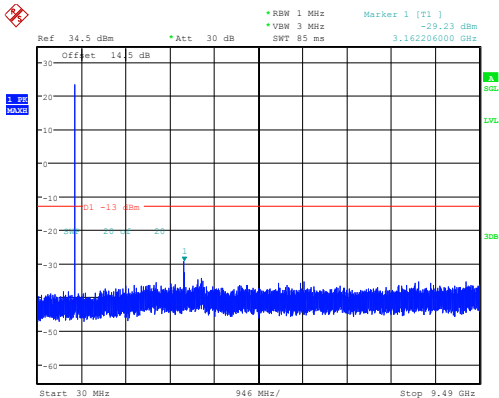


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:37:57

1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)

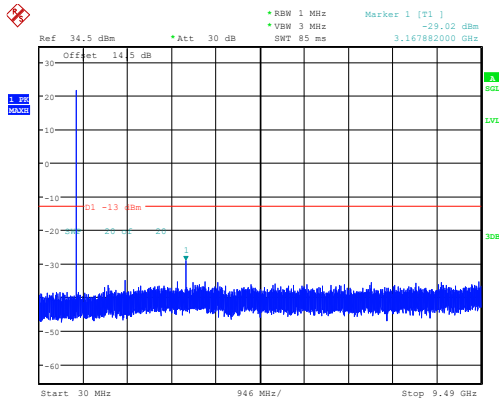


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:38:29

1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

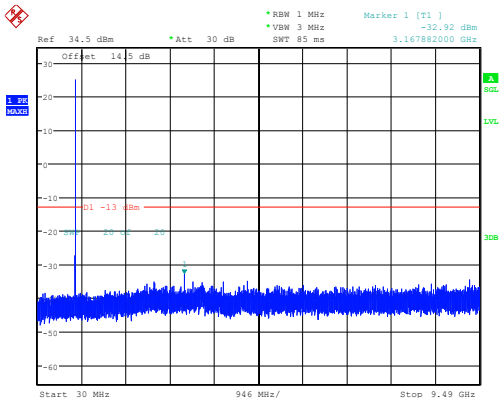


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:39:03

1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)

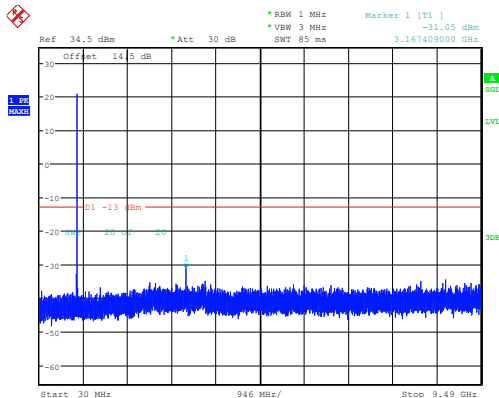


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:39:36

1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)

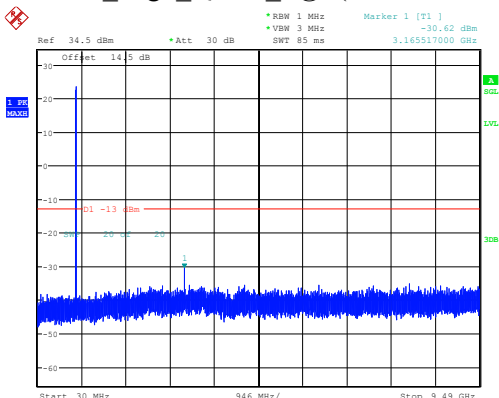


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:40:09

1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)

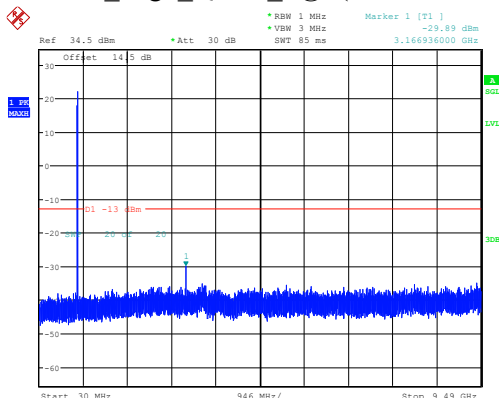


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:40:42

3MHz_Low_QPSK_1@0(30MHz~9.49GHz)

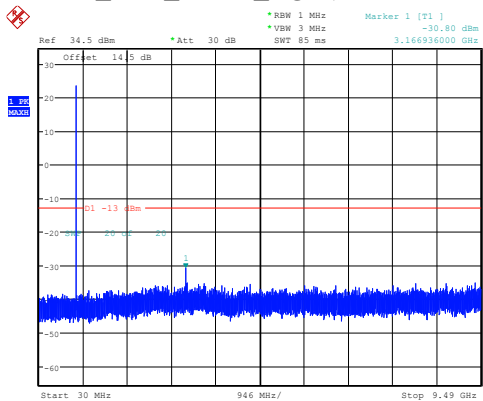


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:41:49

3MHz_Low_QPSK_15@0(30MHz~9.49GHz)

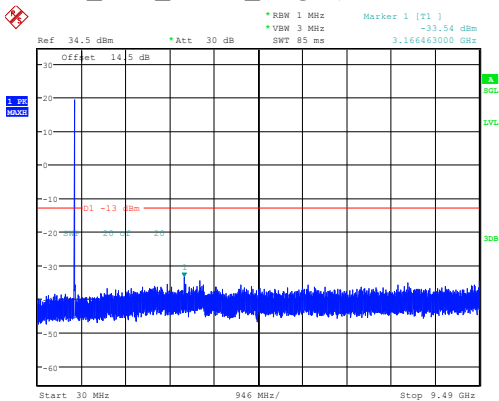


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:42:21

3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

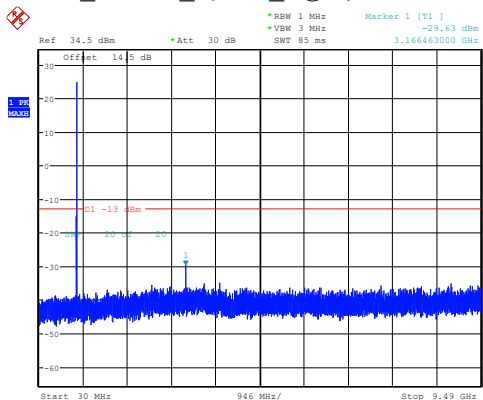


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:42:55

3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)

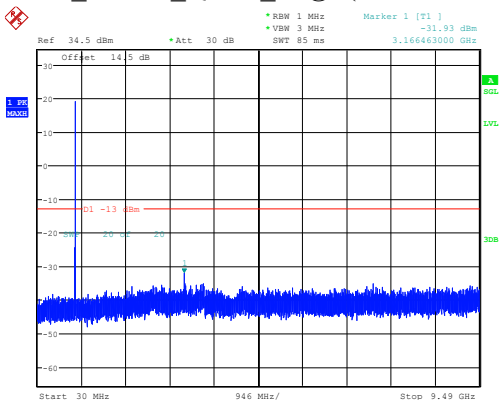


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:43:29

3MHz_High_QPSK_1@0(30MHz~9.49GHz)

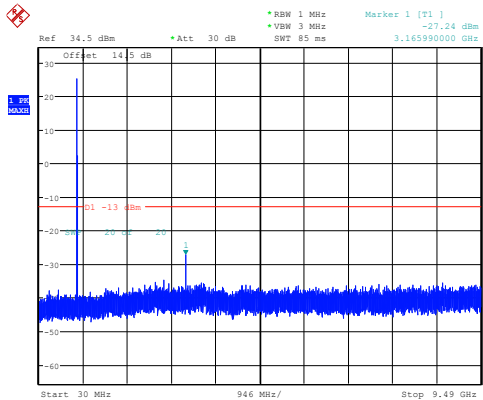


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:44:03

3MHz_High_QPSK_15@0(30MHz~9.49GHz)

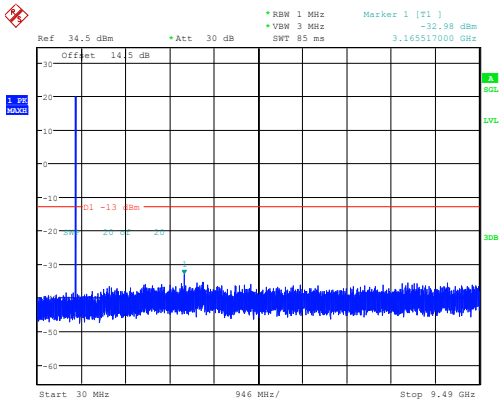


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:44:36

5MHz_Low_QPSK_1@0(30MHz~9.49GHz)

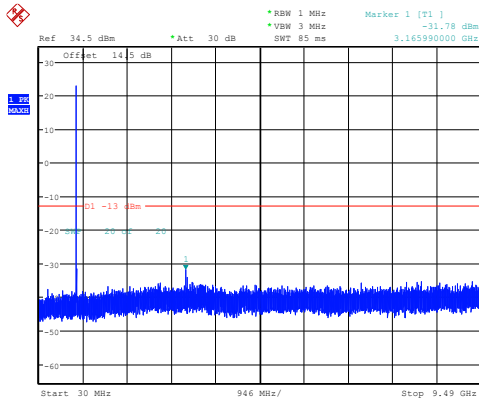


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:45:44

5MHz_Low_QPSK_25@0(30MHz~9.49GHz)

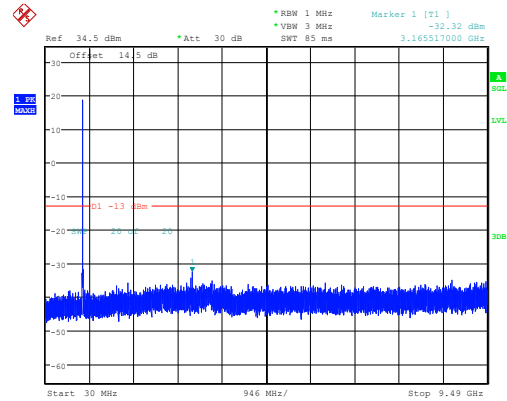


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:46:18

5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

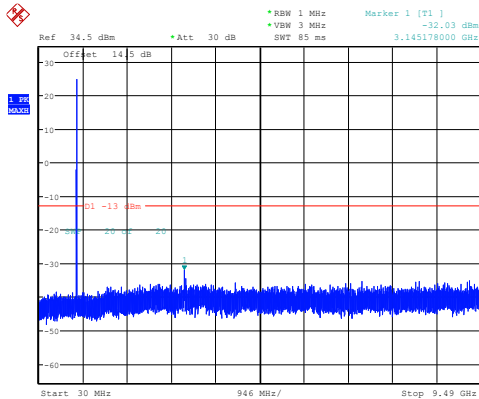


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:46:59

5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)

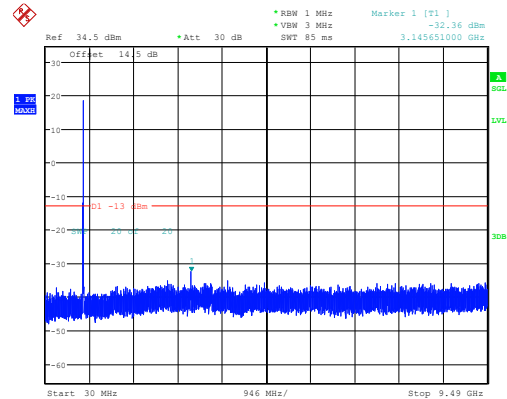


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:47:33

5MHz_High_QPSK_1@0(30MHz~9.49GHz)

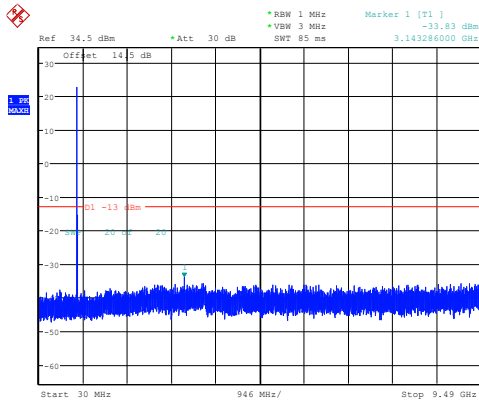


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:48:08

5MHz_High_QPSK_25@0(30MHz~9.49GHz)

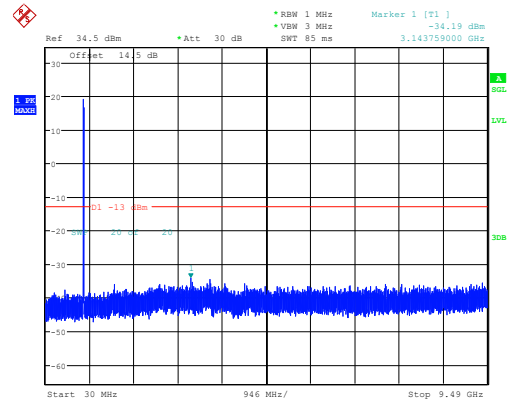


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:48:43

10MHz_Low_QPSK_1@0(30MHz~9.49GHz)

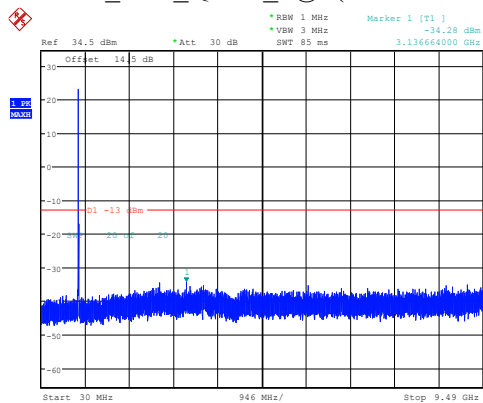


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:49:56

10MHz_Low_QPSK_50@0(30MHz~9.49GHz)

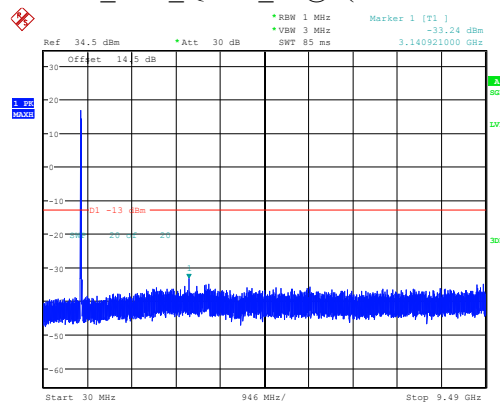


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:50:30

10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

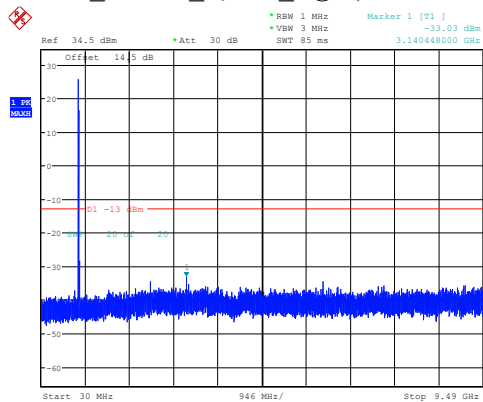


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:51:05

10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)

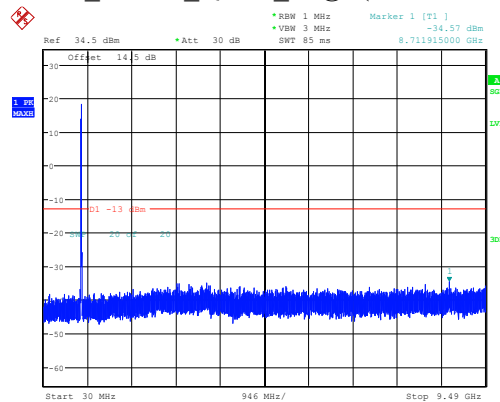


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:51:40

10MHz_High_QPSK_1@0(30MHz~9.49GHz)

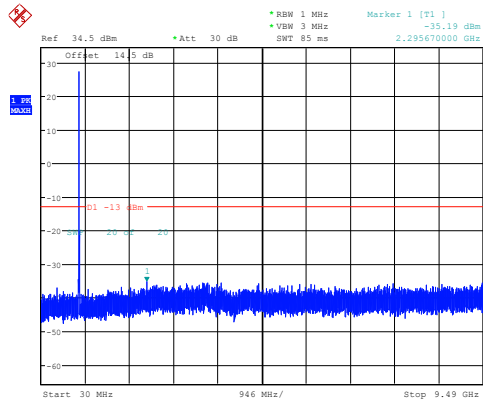

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:52:15

10MHz_High_QPSK_50@0(30MHz~9.49GHz)

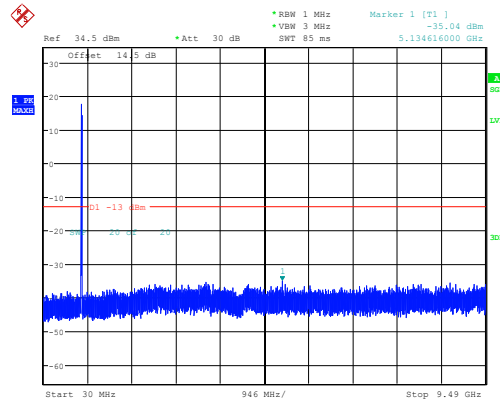

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 7.NOV.2024 20:52:50

FCC Part 24E**B2 , Normal**


Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-30.61	See Graphs	Pass
1.4MHz_Low_QPSK_6@0(30MHz~20.1GHz)	-32.54	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-32.81	See Graphs	Pass
1.4MHz_Middle_QPSK_6@0(30MHz~20.1GHz)	-32.64	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)	-31.19	See Graphs	Pass
1.4MHz_High_QPSK_6@0(30MHz~20.1GHz)	-32.51	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-33.41	See Graphs	Pass
3MHz_Low_QPSK_15@0(30MHz~20.1GHz)	-31.48	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-29.38	See Graphs	Pass
3MHz_Middle_QPSK_15@0(30MHz~20.1GHz)	-30.19	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~20.1GHz)	-31.92	See Graphs	Pass
3MHz_High_QPSK_15@0(30MHz~20.1GHz)	-33.41	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-33.56	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~20.1GHz)	-32.91	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-32.05	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~20.1GHz)	-33.09	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~20.1GHz)	-30.57	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~20.1GHz)	-30.73	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-32.27	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~20.1GHz)	-33.56	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-32.51	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~20.1GHz)	-32.47	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~20.1GHz)	-31.31	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~20.1GHz)	-30.68	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-32.81	See Graphs	Pass
15MHz_Low_QPSK_75@0(30MHz~20.1GHz)	-33.11	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-31.61	See Graphs	Pass
15MHz_Middle_QPSK_75@0(30MHz~20.1GHz)	-33.33	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~20.1GHz)	-28.56	See Graphs	Pass
15MHz_High_QPSK_75@0(30MHz~20.1GHz)	-31.29	See Graphs	Pass

Mode	Value (dBm)	Limit	Verdict
20MHz_Low_QPSK_1@0(30MHz~20.1GHz)	-33.26	See Graphs	Pass
20MHz_Low_QPSK_100@0(30MHz~20.1GHz)	-32.73	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)	-32.76	See Graphs	Pass
20MHz_Middle_QPSK_100@0(30MHz~20.1GHz)	-31.98	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~20.1GHz)	-32.69	See Graphs	Pass
20MHz_High_QPSK_100@0(30MHz~20.1GHz)	-33.12	See Graphs	Pass

Note:1RB was the worst case.


B2 , Normal
1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)

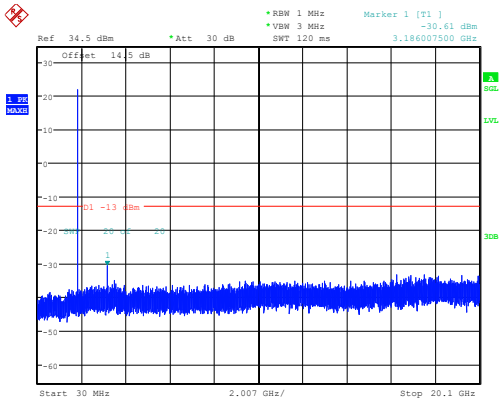


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:09:46

1.4MHz_Low_QPSK_6@0(30MHz~20.1GHz)

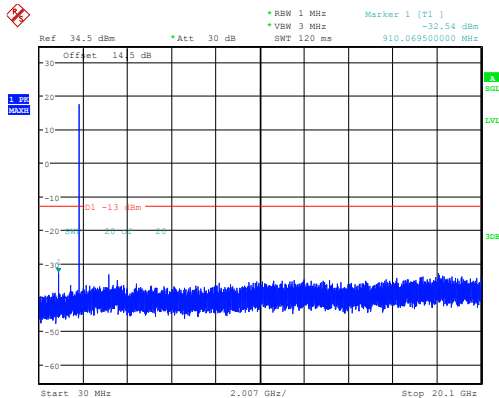


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:10:24

1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

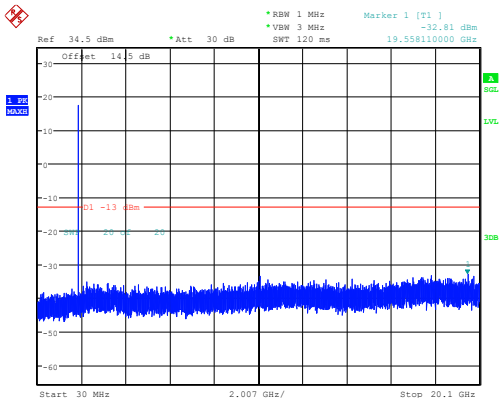


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:11:03

1.4MHz_Middle_QPSK_6@0(30MHz~20.1GHz)

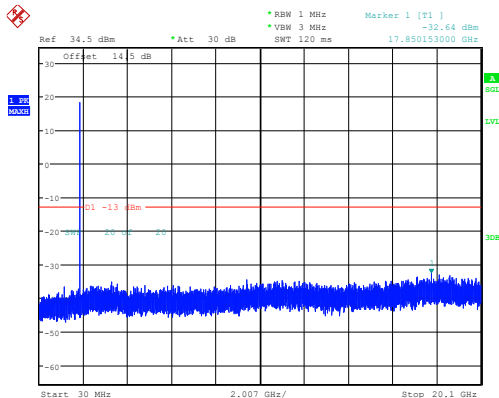


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:11:41

1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)

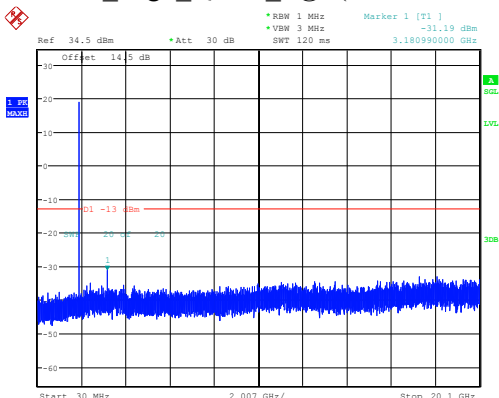


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:12:19

1.4MHz_High_QPSK_6@0(30MHz~20.1GHz)

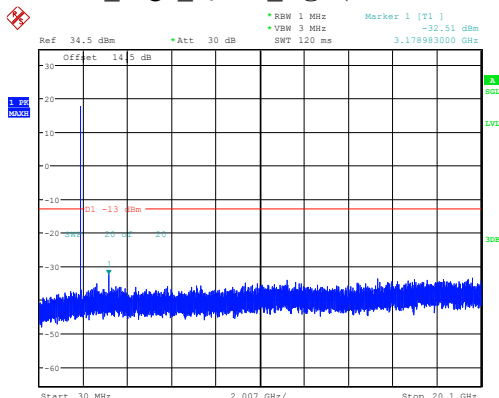


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:12:56

3MHz_Low_QPSK_1@0(30MHz~20.1GHz)

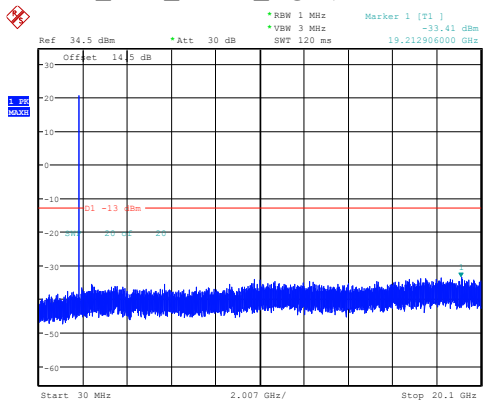


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:14:03

3MHz_Low_QPSK_15@0(30MHz~20.1GHz)

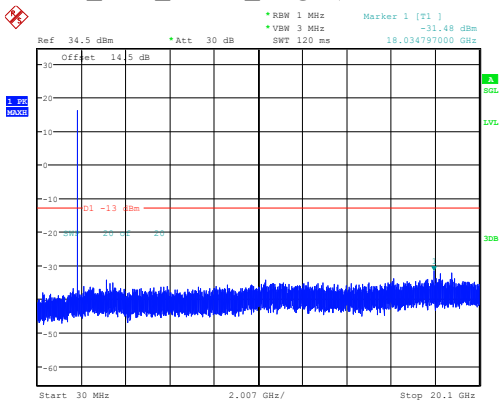


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:14:41

3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

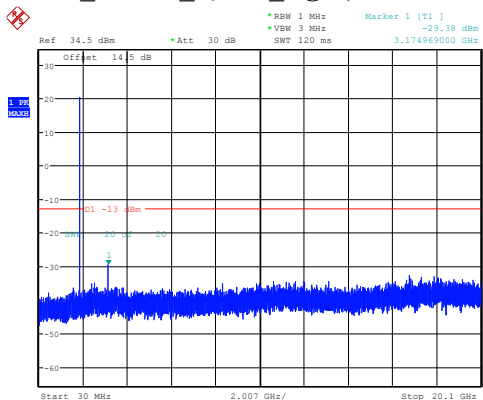


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:15:19

3MHz_Middle_QPSK_15@0(30MHz~20.1GHz)

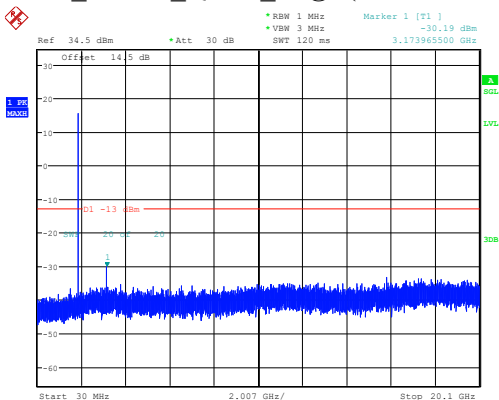


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:15:58

3MHz_High_QPSK_1@0(30MHz~20.1GHz)

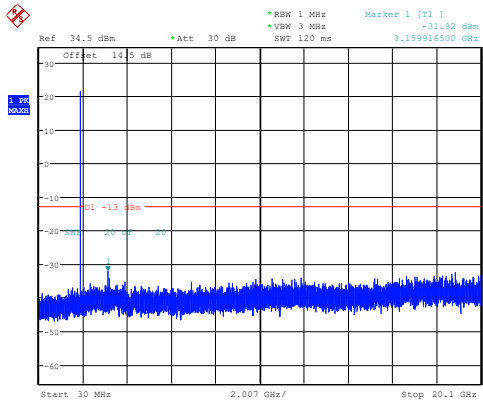


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:16:36

3MHz_High_QPSK_15@0(30MHz~20.1GHz)

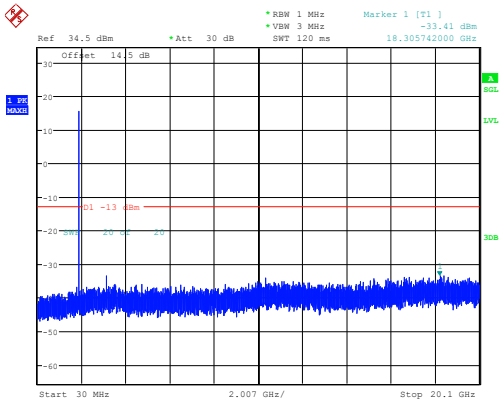


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:17:15

5MHz_Low_QPSK_1@0(30MHz~20.1GHz)

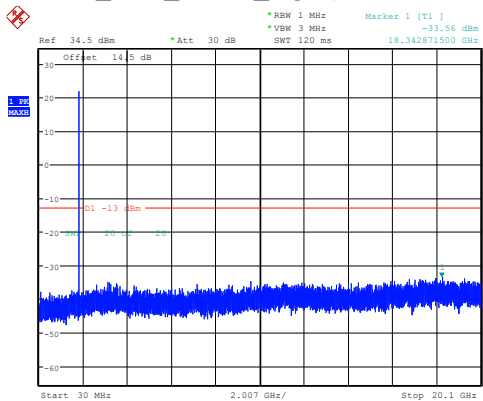


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:18:28

5MHz_Low_QPSK_25@0(30MHz~20.1GHz)

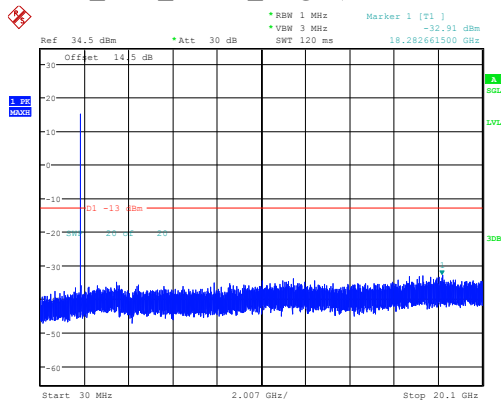


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:19:07

5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

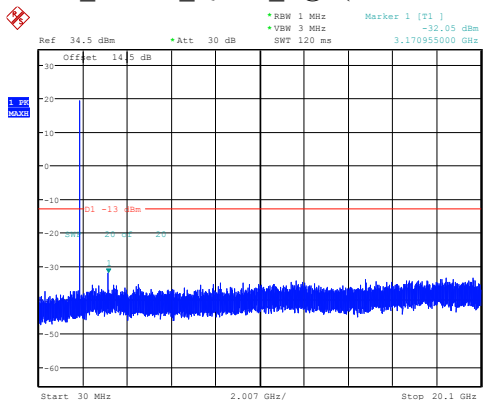


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:19:46

5MHz_Middle_QPSK_25@0(30MHz~20.1GHz)

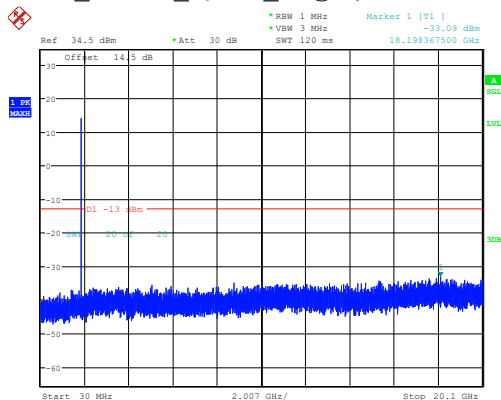


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:20:25

5MHz_High_QPSK_1@0(30MHz~20.1GHz)

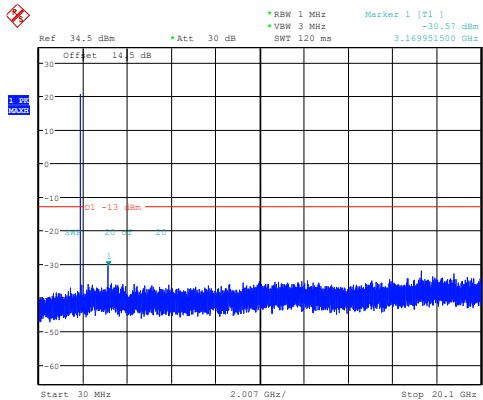


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:21:04

5MHz_High_QPSK_25@0(30MHz~20.1GHz)

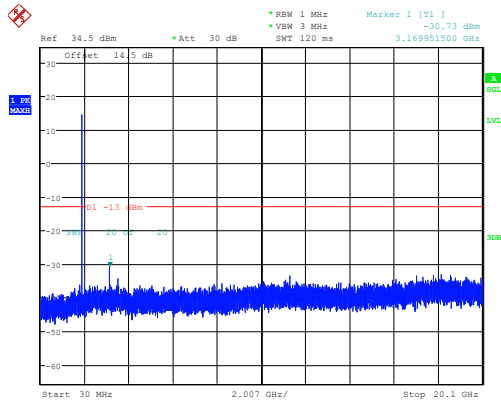


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:21:44

10MHz_Low_QPSK_1@0(30MHz~20.1GHz)

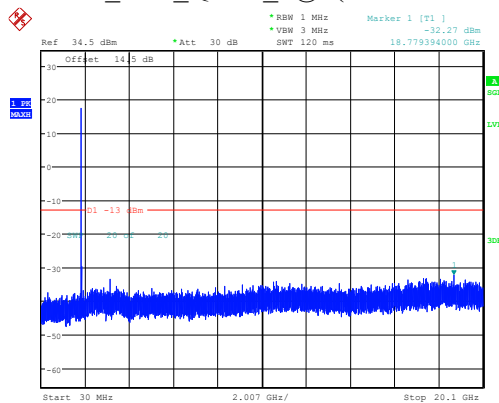


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:22:57

10MHz_Low_QPSK_50@0(30MHz~20.1GHz)

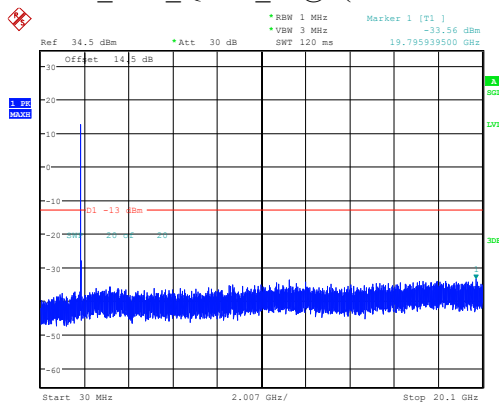


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:23:37

10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

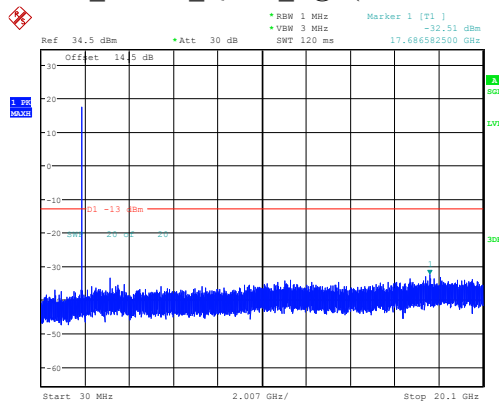


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:24:15

10MHz_Middle_QPSK_50@0(30MHz~20.1GHz)

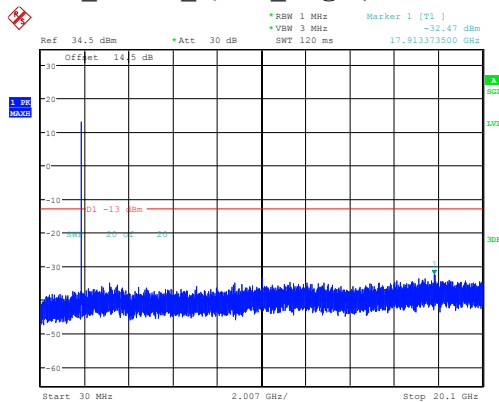


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:24:55

10MHz_High_QPSK_1@0(30MHz~20.1GHz)

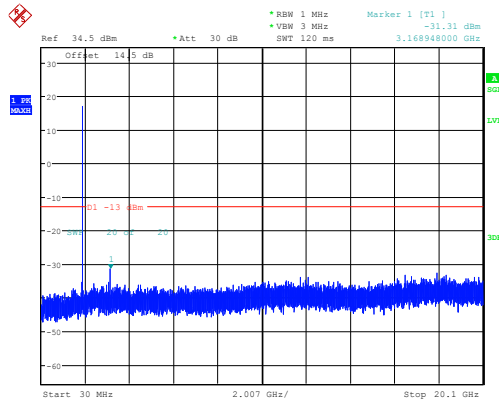


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:25:35

10MHz_High_QPSK_50@0(30MHz~20.1GHz)

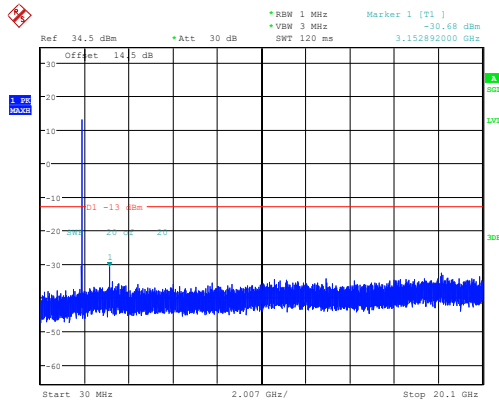


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:26:15

15MHz_Low_QPSK_1@0(30MHz~20.1GHz)

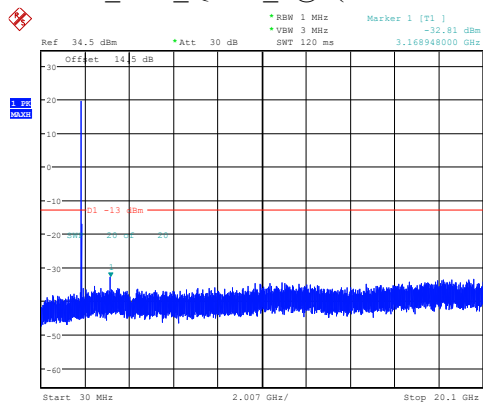


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:27:24

15MHz_Low_QPSK_75@0(30MHz~20.1GHz)

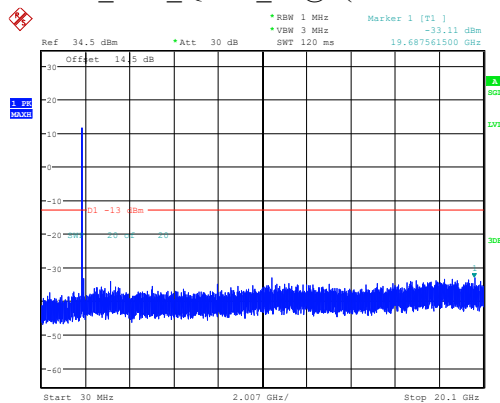


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:28:06

15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

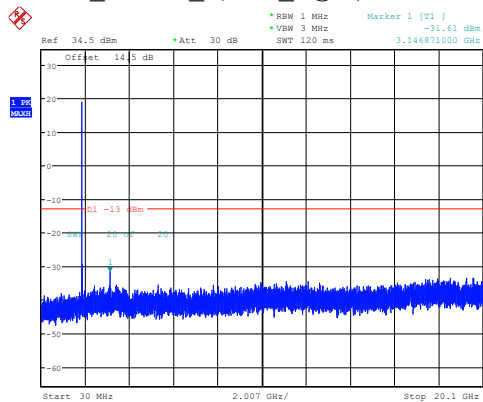


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:28:55

15MHz_Middle_QPSK_75@0(30MHz~20.1GHz)

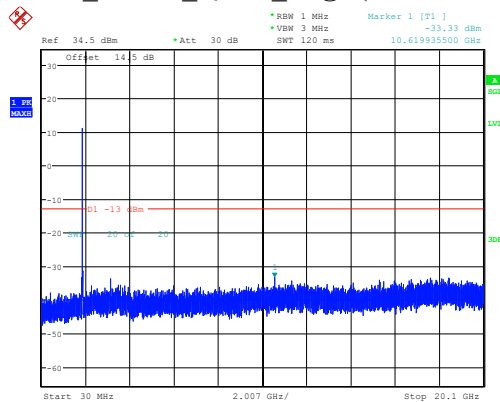


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:29:37

15MHz_High_QPSK_1@0(30MHz~20.1GHz)

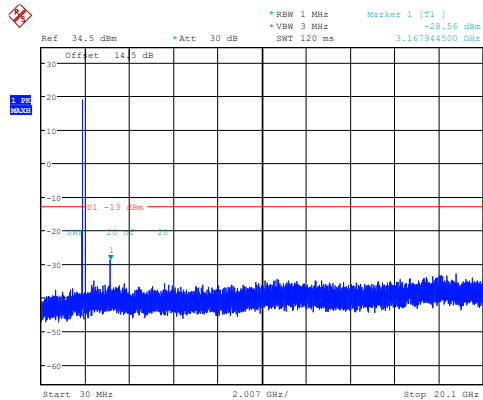


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:30:19

15MHz_High_QPSK_75@0(30MHz~20.1GHz)

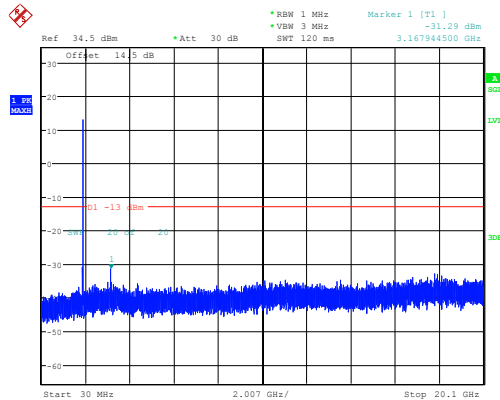


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:31:00

20MHz_Low_QPSK_1@0(30MHz~20.1GHz)

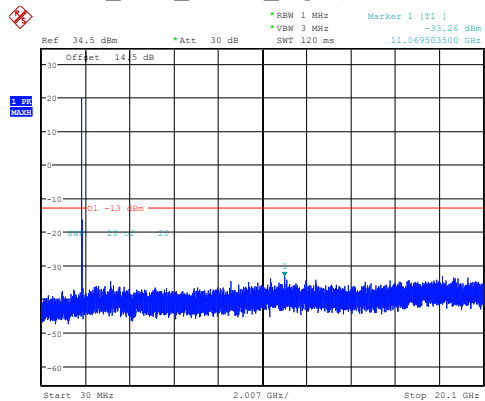


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:32:16

20MHz_Low_QPSK_100@0(30MHz~20.1GHz)

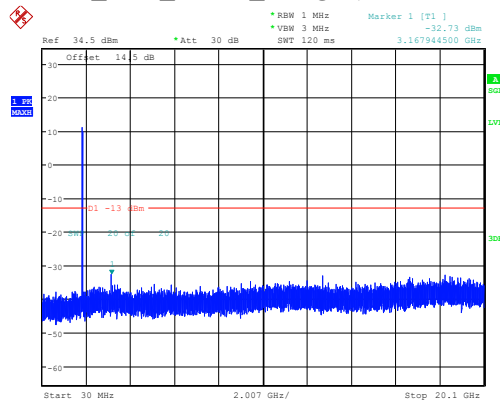


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:32:57

20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)

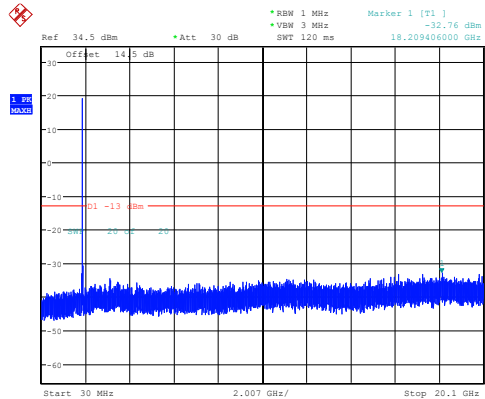


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:33:39

20MHz_Middle_QPSK_100@0(30MHz~20.1GHz)

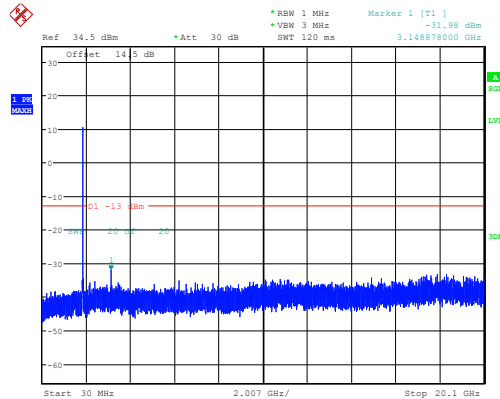


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:34:21

20MHz_High_QPSK_1@0(30MHz~20.1GHz)

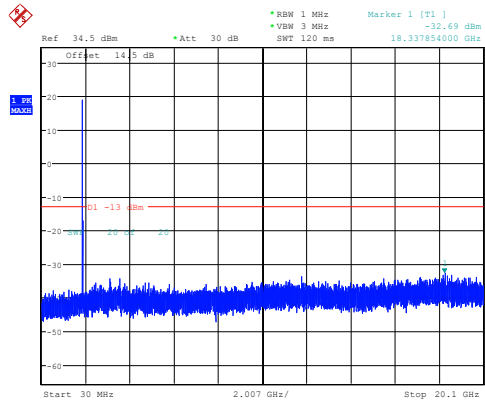

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:35:02

20MHz_High_QPSK_100@0(30MHz~20.1GHz)

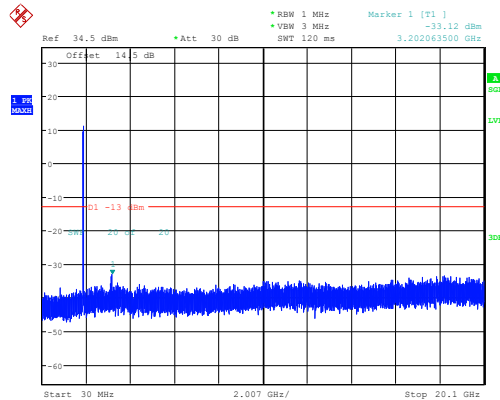

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:35:44

FCC Part 27

B4 , Normal

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.73	See Graphs	Pass
1.4MHz_Low_QPSK_6@0(30MHz~18.55GHz)	-31.72	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-33.05	See Graphs	Pass
1.4MHz_Middle_QPSK_6@0(30MHz~18.55GHz)	-33.38	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)	-33.20	See Graphs	Pass
1.4MHz_High_QPSK_6@0(30MHz~18.55GHz)	-32.82	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-31.80	See Graphs	Pass
3MHz_Low_QPSK_15@0(30MHz~18.55GHz)	-33.35	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-32.25	See Graphs	Pass
3MHz_Middle_QPSK_15@0(30MHz~18.55GHz)	-32.82	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~18.55GHz)	-32.95	See Graphs	Pass
3MHz_High_QPSK_15@0(30MHz~18.55GHz)	-32.72	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-33.04	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~18.55GHz)	-32.21	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-33.23	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~18.55GHz)	-33.27	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~18.55GHz)	-30.83	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~18.55GHz)	-32.36	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-33.09	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~18.55GHz)	-33.32	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-32.23	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~18.55GHz)	-32.69	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~18.55GHz)	-31.45	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~18.55GHz)	-33.11	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-33.34	See Graphs	Pass
15MHz_Low_QPSK_75@0(30MHz~18.55GHz)	-32.93	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-33.21	See Graphs	Pass
15MHz_Middle_QPSK_75@0(30MHz~18.55GHz)	-33.10	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~18.55GHz)	-32.03	See Graphs	Pass
15MHz_High_QPSK_75@0(30MHz~18.55GHz)	-33.15	See Graphs	Pass

Mode	Value (dBm)	Limit	Verdict
20MHz_Low_QPSK_1@0(30MHz~18.55GHz)	-33.56	See Graphs	Pass
20MHz_Low_QPSK_100@0(30MHz~18.55GHz)	-32.93	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)	-33.14	See Graphs	Pass
20MHz_Middle_QPSK_100@0(30MHz~18.55GHz)	-33.35	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~18.55GHz)	-32.05	See Graphs	Pass
20MHz_High_QPSK_100@0(30MHz~18.55GHz)	-32.12	See Graphs	Pass

B7 , Normal

Mode	Value (dBm)	Limit	Verdict
5MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-34.24	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~26.7GHz)	-33.75	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-33.83	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~26.7GHz)	-32.71	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~26.7GHz)	-33.98	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~26.7GHz)	-34.52	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-33.60	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~26.7GHz)	-34.40	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-33.96	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~26.7GHz)	-34.31	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~26.7GHz)	-34.20	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~26.7GHz)	-33.87	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-33.81	See Graphs	Pass
15MHz_Low_QPSK_75@0(30MHz~26.7GHz)	-34.20	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-33.88	See Graphs	Pass
15MHz_Middle_QPSK_75@0(30MHz~26.7GHz)	-34.24	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~26.7GHz)	-34.27	See Graphs	Pass
15MHz_High_QPSK_75@0(30MHz~26.7GHz)	-34.03	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~26.7GHz)	-34.42	See Graphs	Pass
20MHz_Low_QPSK_100@0(30MHz~26.7GHz)	-34.14	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~26.7GHz)	-34.34	See Graphs	Pass
20MHz_Middle_QPSK_100@0(30MHz~26.7GHz)	-34.02	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~26.7GHz)	-33.89	See Graphs	Pass
20MHz_High_QPSK_100@0(30MHz~26.7GHz)	-33.34	See Graphs	Pass

B38 , Normal

Mode	Value (dBm)	Limit	Verdict
5MHz_Low_QPSK_1@0(30MHz~27.2GHz)	-33.44	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~27.2GHz)	-33.92	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~27.2GHz)	-33.93	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~27.2GHz)	-33.90	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~27.2GHz)	-33.06	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~27.2GHz)	-34.06	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~27.2GHz)	-32.46	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~27.2GHz)	-33.68	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~27.2GHz)	-33.40	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~27.2GHz)	-32.90	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~27.2GHz)	-33.66	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~27.2GHz)	-34.16	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~27.2GHz)	-34.05	See Graphs	Pass
15MHz_Low_QPSK_75@0(30MHz~27.2GHz)	-33.45	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~27.2GHz)	-33.85	See Graphs	Pass
15MHz_Middle_QPSK_75@0(30MHz~27.2GHz)	-33.96	See Graphs	Pass
15MHz_High_QPSK_1@0(30MHz~27.2GHz)	-33.61	See Graphs	Pass
15MHz_High_QPSK_75@0(30MHz~27.2GHz)	-34.14	See Graphs	Pass
20MHz_Low_QPSK_1@0(30MHz~27.2GHz)	-33.67	See Graphs	Pass
20MHz_Low_QPSK_100@0(30MHz~27.2GHz)	-33.65	See Graphs	Pass
20MHz_Middle_QPSK_1@0(30MHz~27.2GHz)	-33.51	See Graphs	Pass
20MHz_Middle_QPSK_100@0(30MHz~27.2GHz)	-34.04	See Graphs	Pass
20MHz_High_QPSK_1@0(30MHz~27.2GHz)	-33.79	See Graphs	Pass
20MHz_High_QPSK_100@0(30MHz~27.2GHz)	-34.19	See Graphs	Pass

B41_2 , Normal

Mode	Value (dBm)	Limit	Verdict
2_5MHz_Low_QPSK_1@0(30MHz~27.55GHz)	-33.70	See Graphs	Pass
2_5MHz_Low_QPSK_25@0(30MHz~27.55GHz)	-33.61	See Graphs	Pass
2_5MHz_Middle_QPSK_1@0(30MHz~27.55GHz)	-33.67	See Graphs	Pass
2_5MHz_Middle_QPSK_25@0(30MHz~27.55GHz)	-34.38	See Graphs	Pass
2_5MHz_High_QPSK_1@0(30MHz~27.55GHz)	-32.58	See Graphs	Pass


Mode	Value (dBm)	Limit	Verdict
2_5MHz_High_QPSK_25@0(30MHz~27.55GHz)	-33.77	See Graphs	Pass
2_10MHz_Low_QPSK_1@0(30MHz~27.55GHz)	-33.37	See Graphs	Pass
2_10MHz_Low_QPSK_50@0(30MHz~27.55GHz)	-33.77	See Graphs	Pass
2_10MHz_Middle_QPSK_1@0(30MHz~27.55GHz)	-33.84	See Graphs	Pass
2_10MHz_Middle_QPSK_50@0(30MHz~27.55GHz)	-33.60	See Graphs	Pass
2_10MHz_High_QPSK_1@0(30MHz~27.55GHz)	-33.85	See Graphs	Pass
2_10MHz_High_QPSK_50@0(30MHz~27.55GHz)	-33.79	See Graphs	Pass
2_15MHz_Low_QPSK_1@0(30MHz~27.55GHz)	-33.68	See Graphs	Pass
2_15MHz_Low_QPSK_75@0(30MHz~27.55GHz)	-33.76	See Graphs	Pass
2_15MHz_Middle_QPSK_1@0(30MHz~27.55GHz)	-33.89	See Graphs	Pass
2_15MHz_Middle_QPSK_75@0(30MHz~27.55GHz)	-33.89	See Graphs	Pass
2_15MHz_High_QPSK_1@0(30MHz~27.55GHz)	-34.09	See Graphs	Pass
2_15MHz_High_QPSK_75@0(30MHz~27.55GHz)	-33.82	See Graphs	Pass
2_20MHz_Low_QPSK_1@0(30MHz~27.55GHz)	-33.80	See Graphs	Pass
2_20MHz_Low_QPSK_100@0(30MHz~27.55GHz)	-33.45	See Graphs	Pass
2_20MHz_Middle_QPSK_1@0(30MHz~27.55GHz)	-34.11	See Graphs	Pass
2_20MHz_Middle_QPSK_100@0(30MHz~27.55GHz)	-33.11	See Graphs	Pass
2_20MHz_High_QPSK_1@0(30MHz~27.55GHz)	-34.25	See Graphs	Pass
2_20MHz_High_QPSK_100@0(30MHz~27.55GHz)	-34.13	See Graphs	Pass

Note:1RB was the worst case.

B4 , Normal


1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)

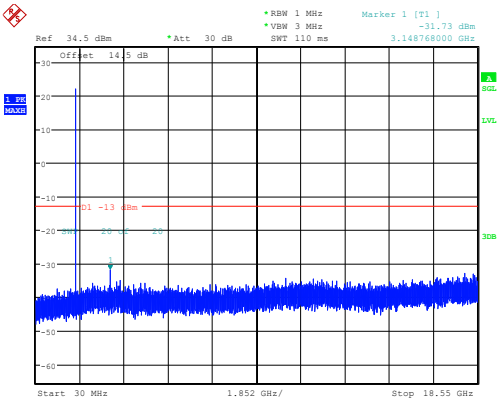


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:36:46

1.4MHz_Low_QPSK_6@0(30MHz~18.55GHz)

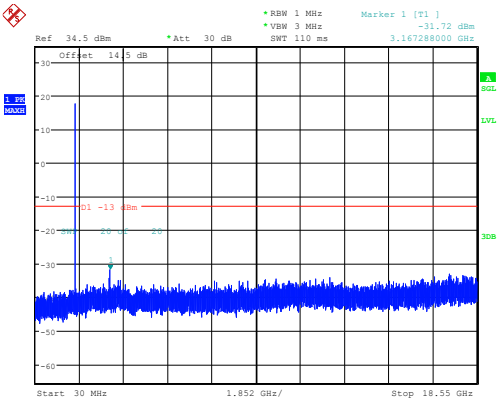


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:37:25

1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

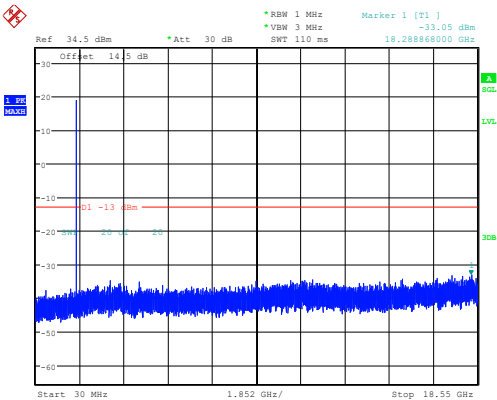


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:38:11

1.4MHz_Middle_QPSK_6@0(30MHz~18.55GHz)

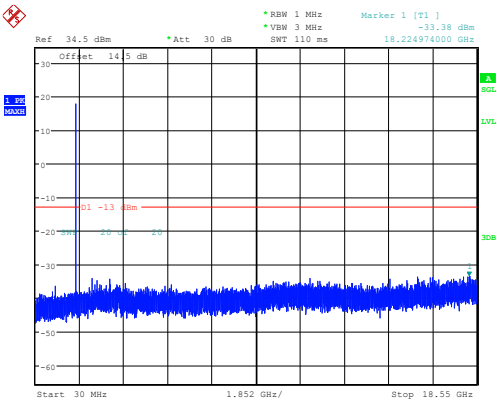


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:38:49

1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)

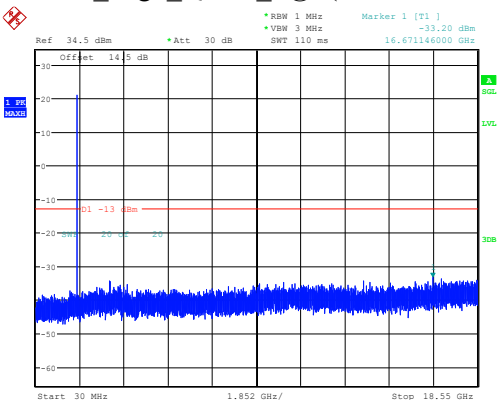


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:39:28

1.4MHz_High_QPSK_6@0(30MHz~18.55GHz)

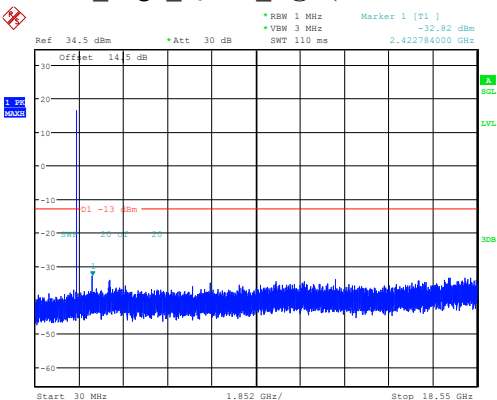


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:40:07

3MHz_Low_QPSK_1@0(30MHz~18.55GHz)

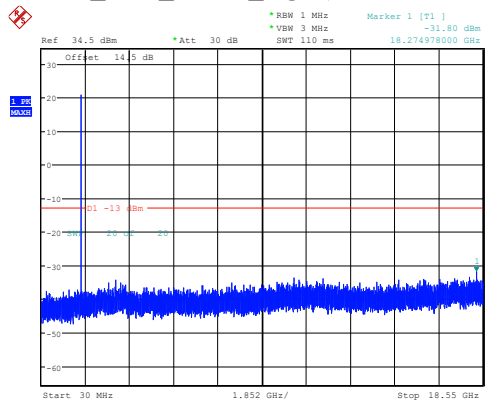


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:41:18

3MHz_Low_QPSK_15@0(30MHz~18.55GHz)

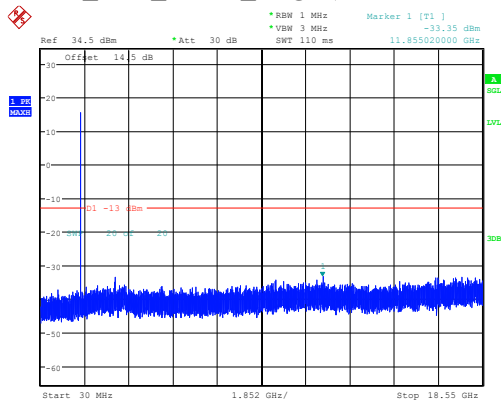


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:41:57

3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

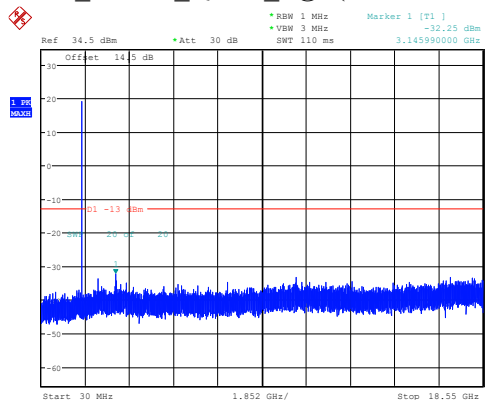


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:42:36

3MHz_Middle_QPSK_15@0(30MHz~18.55GHz)

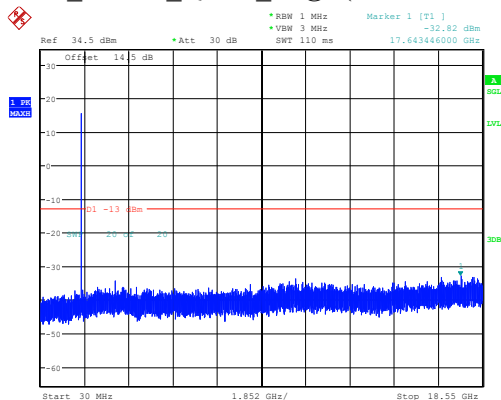


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:43:15

3MHz_High_QPSK_1@0(30MHz~18.55GHz)

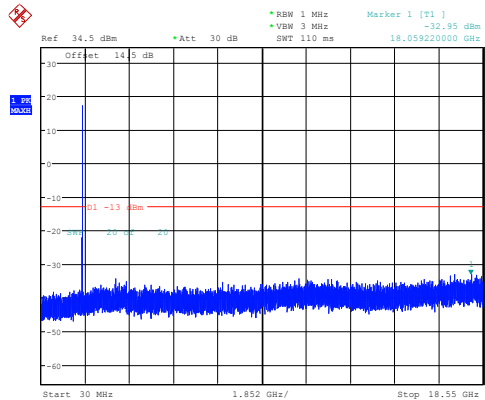


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:43:53

3MHz_High_QPSK_15@0(30MHz~18.55GHz)

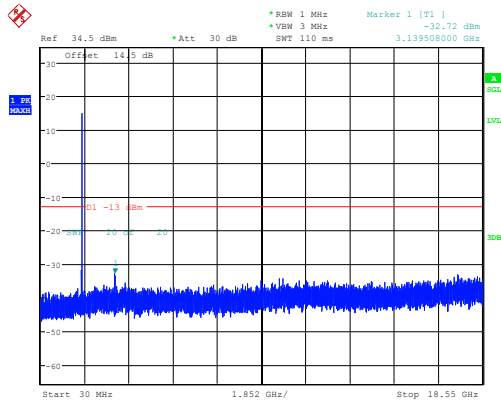


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:44:32

5MHz_Low_QPSK_1@0(30MHz~18.55GHz)

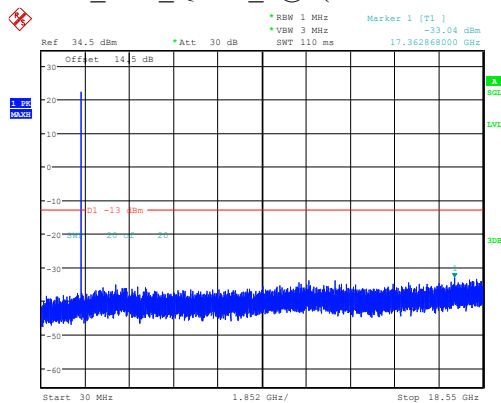


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:45:42

5MHz_Low_QPSK_25@0(30MHz~18.55GHz)

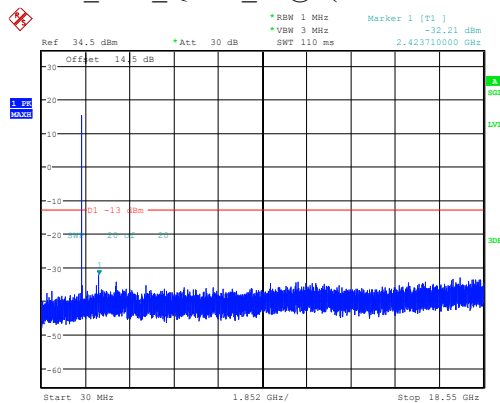


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:46:21

5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

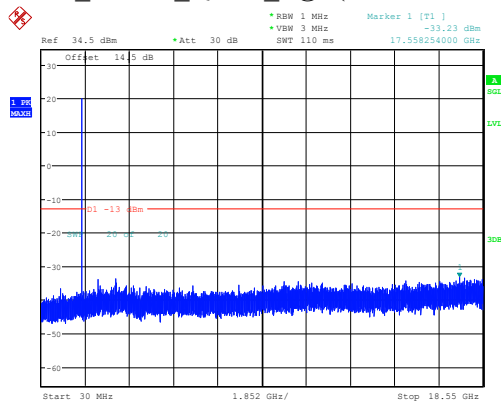


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:47:00

5MHz_Middle_QPSK_25@0(30MHz~18.55GHz)

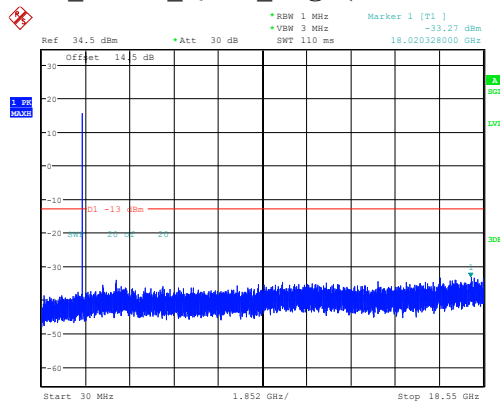


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:47:40

5MHz_High_QPSK_1@0(30MHz~18.55GHz)

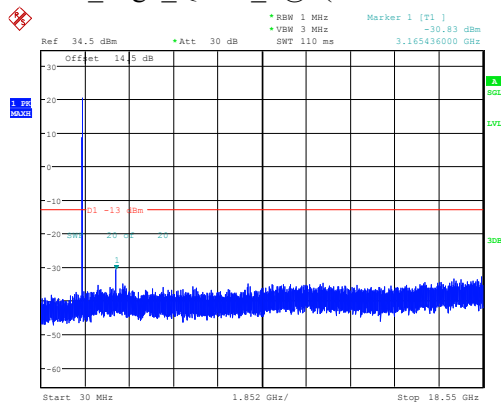


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:48:26

5MHz_High_QPSK_25@0(30MHz~18.55GHz)

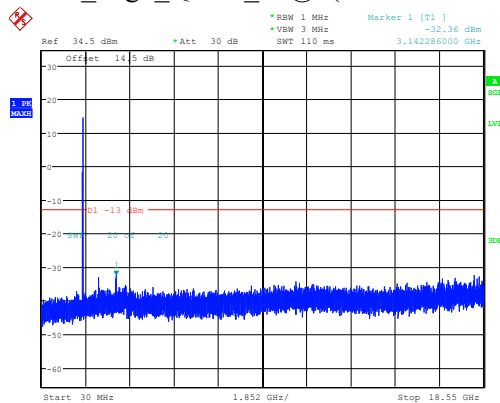


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:49:05

10MHz_Low_QPSK_1@0(30MHz~18.55GHz)

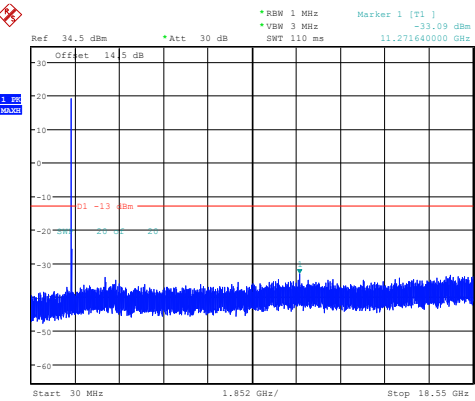


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:50:14

10MHz_Low_QPSK_50@0(30MHz~18.55GHz)

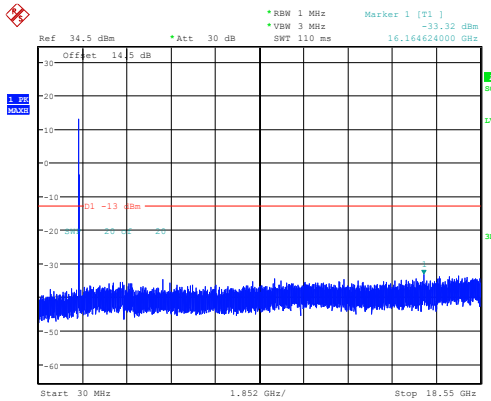


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:50:55

10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

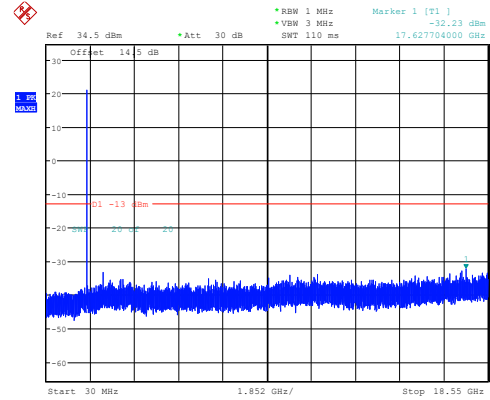


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:51:33

10MHz_Middle_QPSK_50@0(30MHz~18.55GHz)

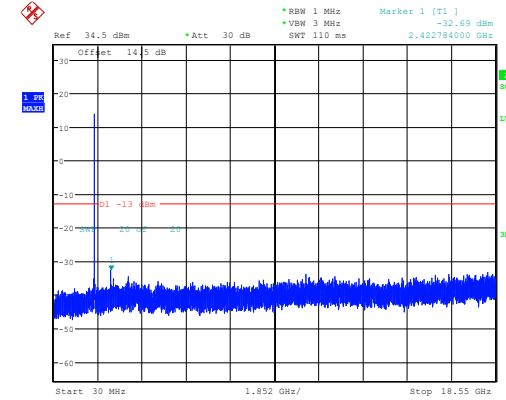


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:52:14

10MHz_High_QPSK_1@0(30MHz~18.55GHz)

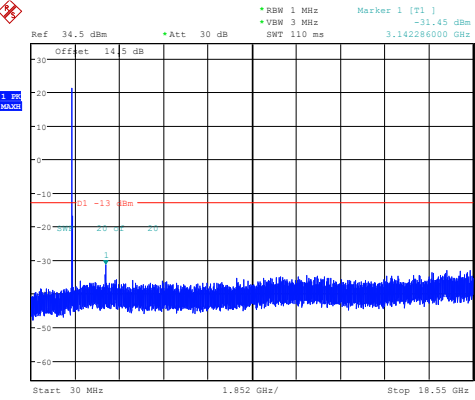


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:52:53

10MHz_High_QPSK_50@0(30MHz~18.55GHz)

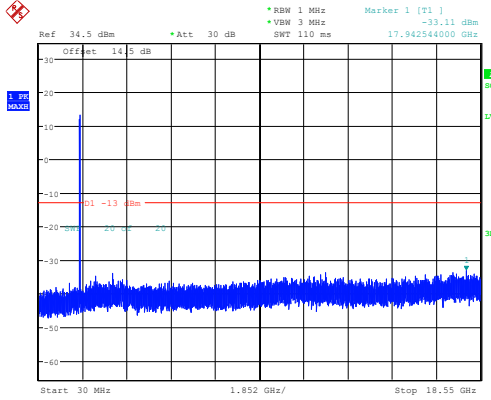


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:53:34

15MHz_Low_QPSK_1@0(30MHz~18.55GHz)

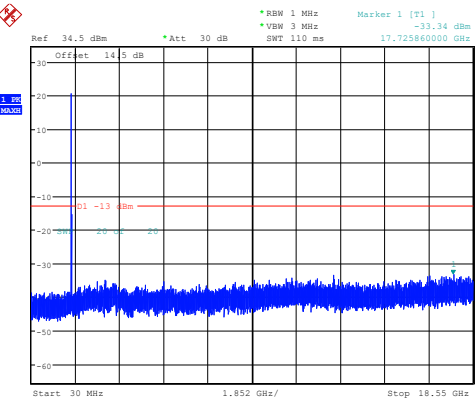


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:54:45

15MHz_Low_QPSK_75@0(30MHz~18.55GHz)

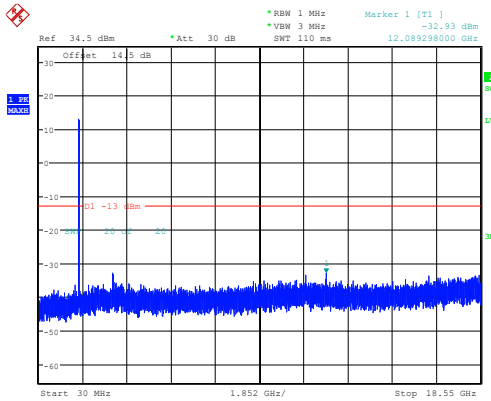


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:55:27

15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

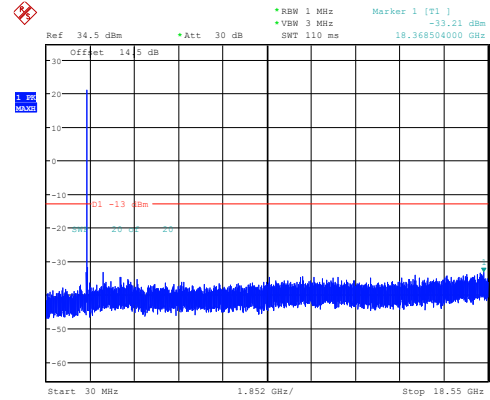


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:56:09

15MHz_Middle_QPSK_75@0(30MHz~18.55GHz)

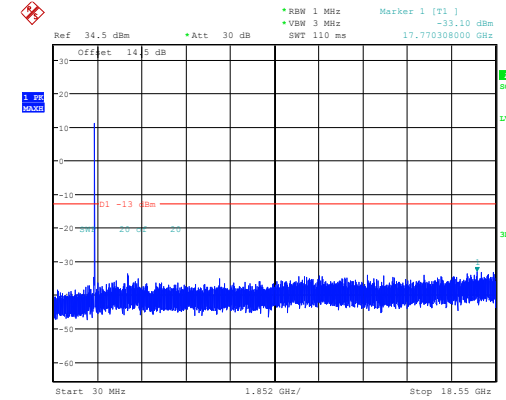


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:56:51

15MHz_High_QPSK_1@0(30MHz~18.55GHz)

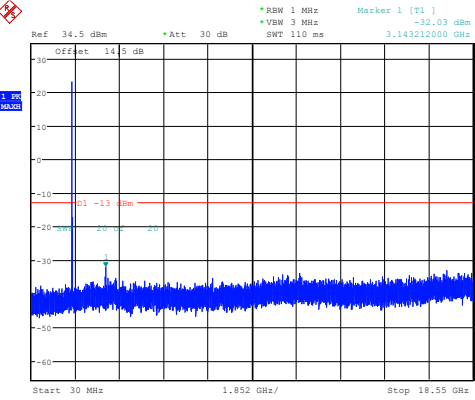


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:57:33

15MHz_High_QPSK_75@0(30MHz~18.55GHz)

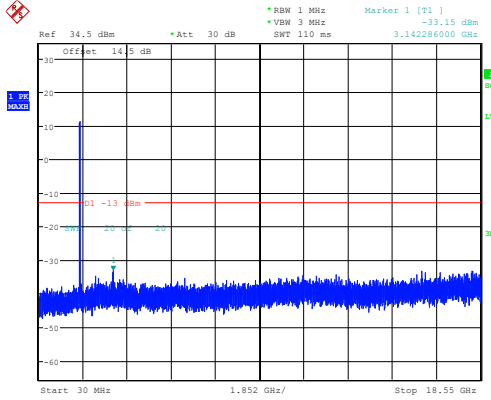


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:58:21

20MHz_Low_QPSK_1@0(30MHz~18.55GHz)

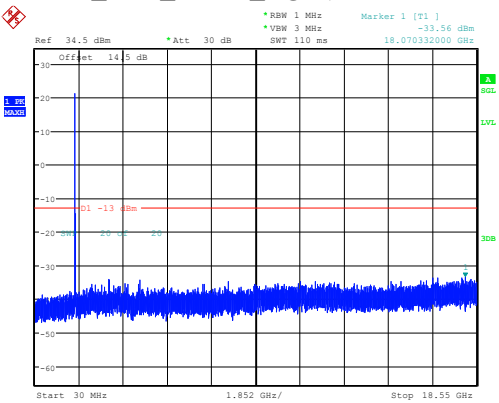


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 08:59:35

20MHz_Low_QPSK_100@0(30MHz~18.55GHz)

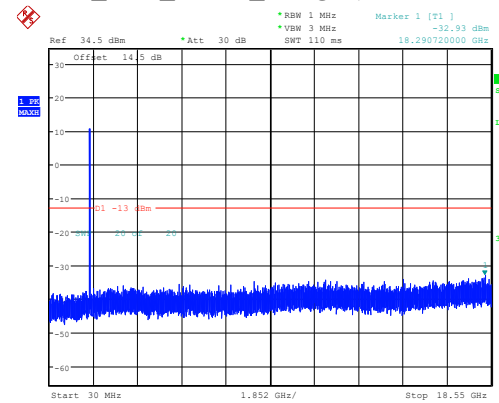


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 09:00:17

20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)

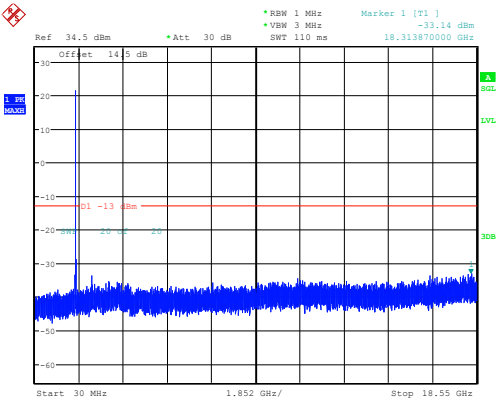


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 09:00:59

20MHz_Middle_QPSK_100@0(30MHz~18.55GHz)

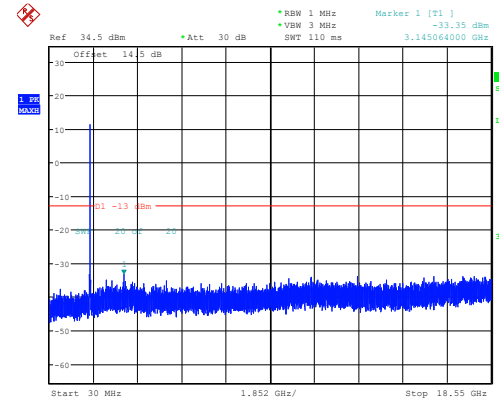


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 09:01:42

20MHz_High_QPSK_1@0(30MHz~18.55GHz)

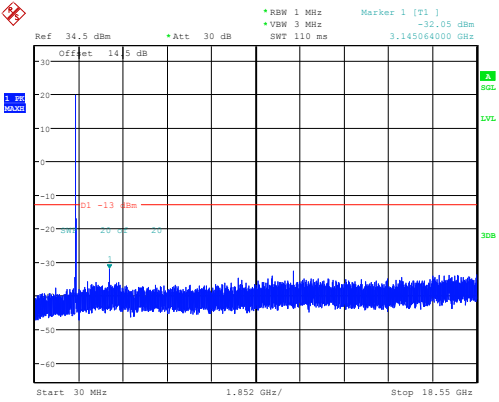

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 09:02:24


20MHz_High_QPSK_100@0(30MHz~18.55GHz)

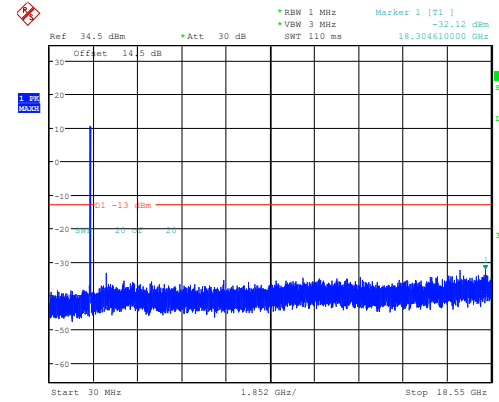

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 8.NOV.2024 09:03:06


B7 , Normal
1RB was the worst case

5MHz_Low_QPSK_1@0(30MHz~26.7GHz)

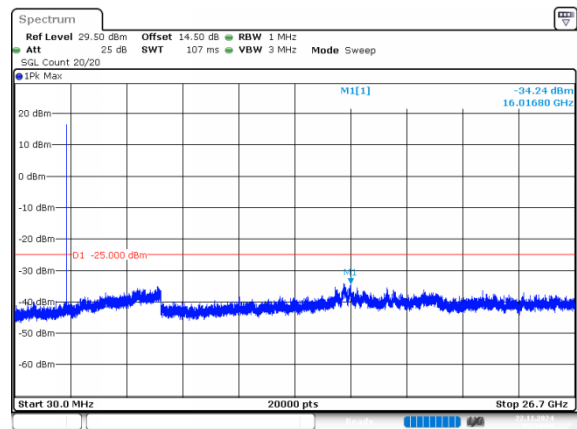


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:34:04

5MHz_Low_QPSK_25@0(30MHz~26.7GHz)

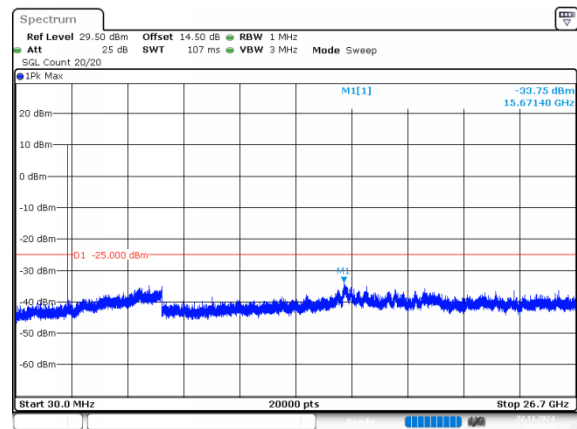


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:34:37

5MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

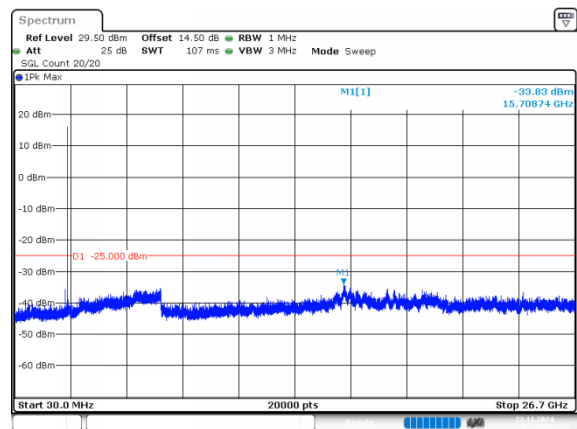


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:35:09

5MHz_Middle_QPSK_25@0(30MHz~26.7GHz)

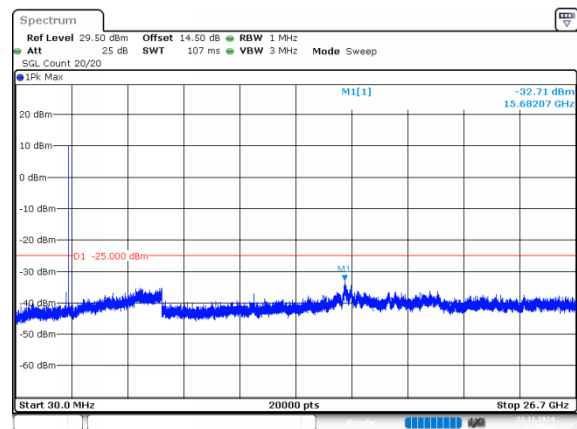


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:35:41

5MHz_High_QPSK_1@0(30MHz~26.7GHz)

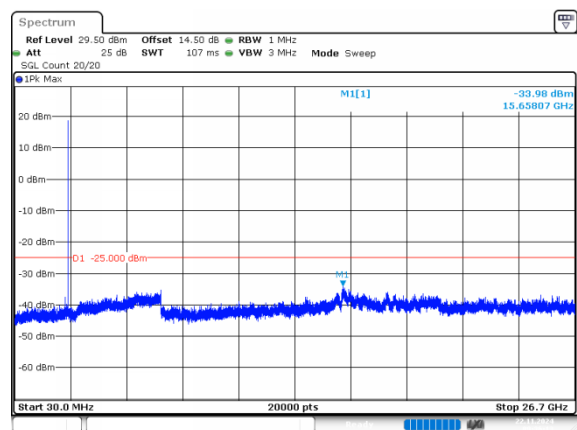


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:36:13

5MHz_High_QPSK_25@0(30MHz~26.7GHz)

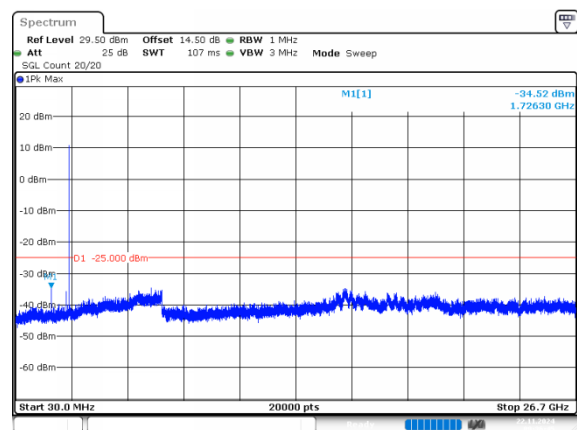


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:36:46

10MHz_Low_QPSK_1@0(30MHz~26.7GHz)

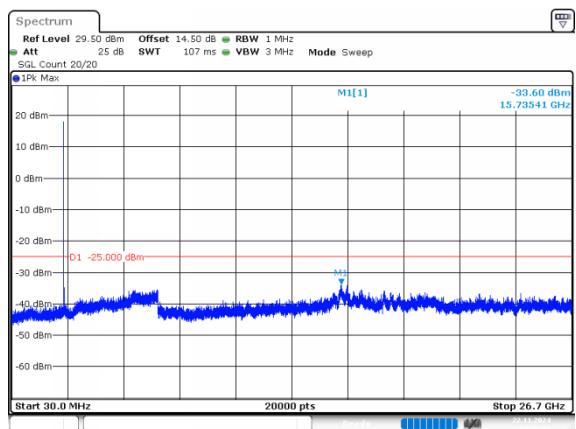


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:38:01

10MHz_Low_QPSK_50@0(30MHz~26.7GHz)

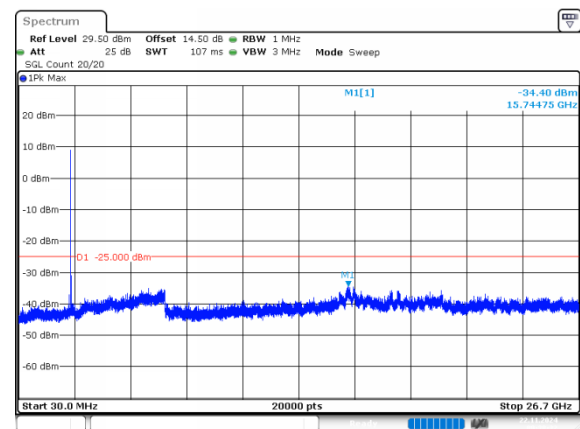


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:38:33

10MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

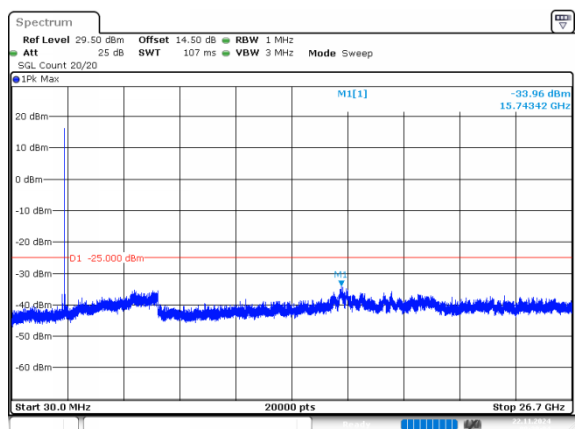


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:39:05

10MHz_Middle_QPSK_50@0(30MHz~26.7GHz)

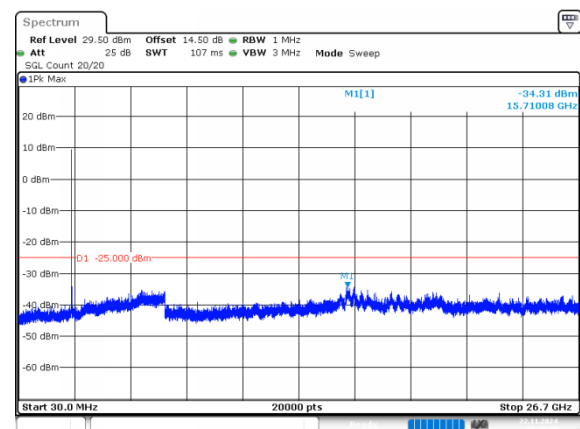


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:39:38

10MHz_High_QPSK_1@0(30MHz~26.7GHz)

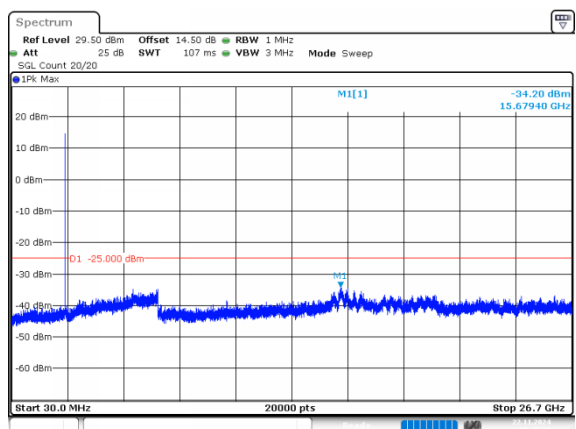


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:40:11

10MHz_High_QPSK_50@0(30MHz~26.7GHz)

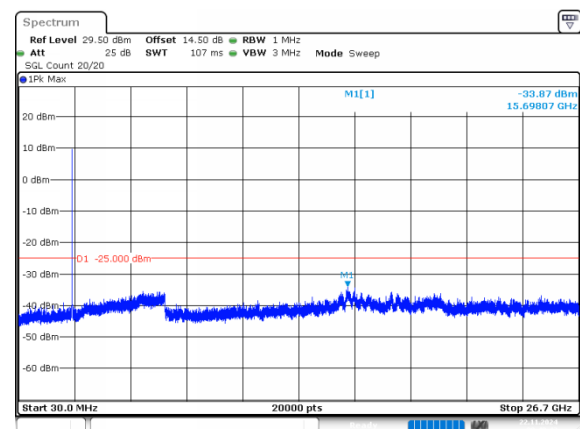


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:40:43

15MHz_Low_QPSK_1@0(30MHz~26.7GHz)

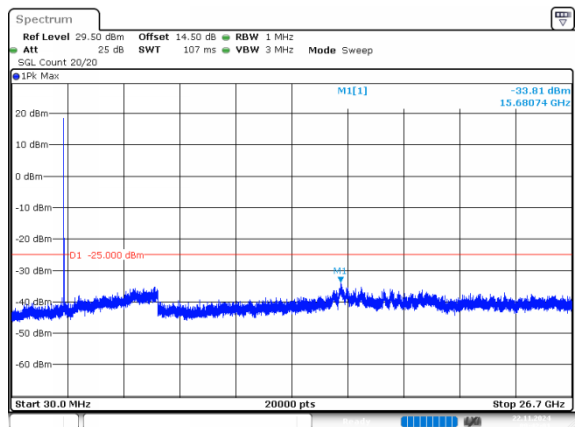


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:42:02

15MHz_Low_QPSK_75@0(30MHz~26.7GHz)

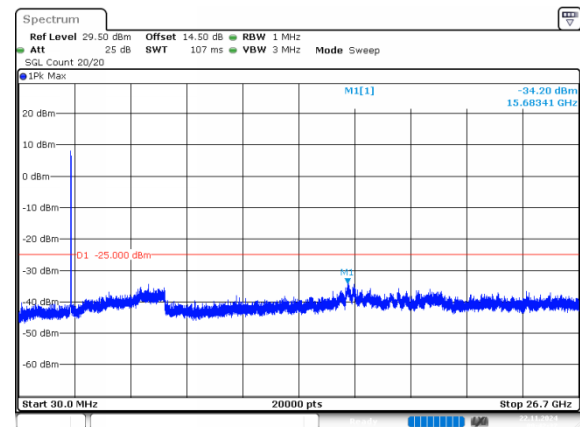


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:42:38

15MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

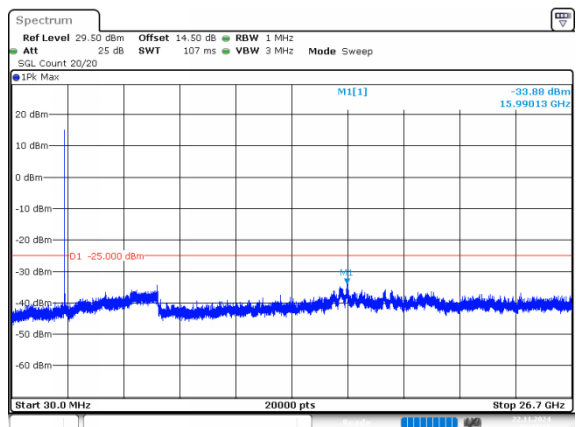


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:43:11

15MHz_Middle_QPSK_75@0(30MHz~26.7GHz)

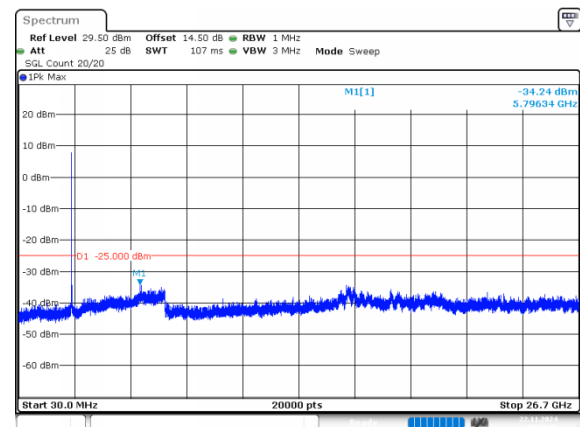


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:43:46

15MHz_High_QPSK_1@0(30MHz~26.7GHz)

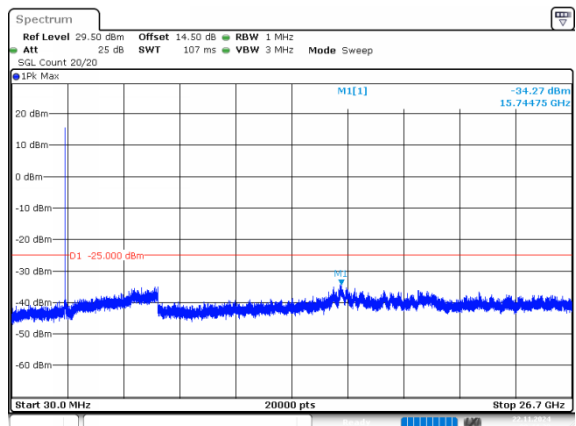


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:44:29

15MHz_High_QPSK_75@0(30MHz~26.7GHz)

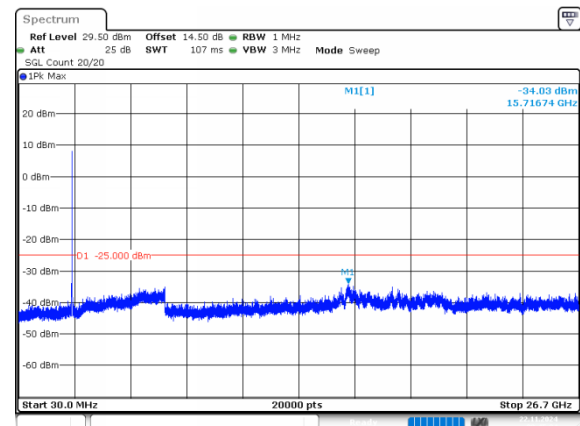


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:45:05

20MHz_Low_QPSK_1@0(30MHz~26.7GHz)

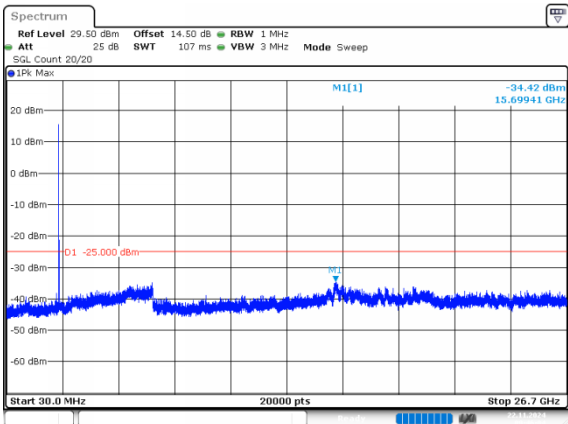


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:46:05

20MHz_Low_QPSK_100@0(30MHz~26.7GHz)

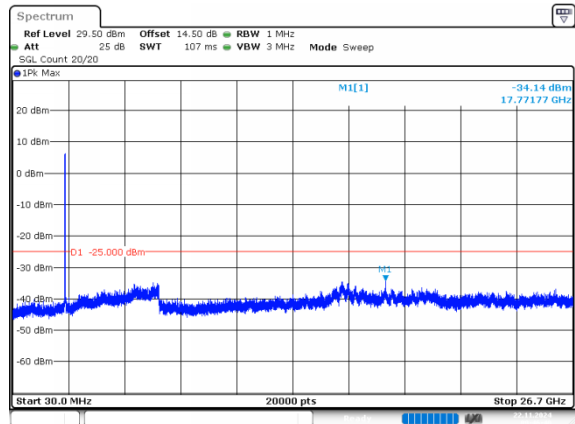


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:46:40

20MHz_Middle_QPSK_1@0(30MHz~26.7GHz)

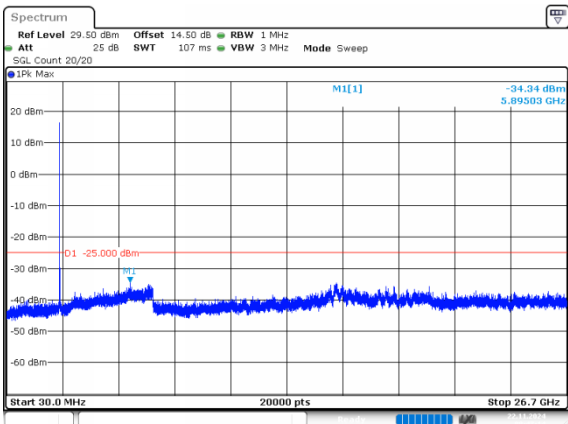


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:47:14

20MHz_Middle_QPSK_100@0(30MHz~26.7GHz)

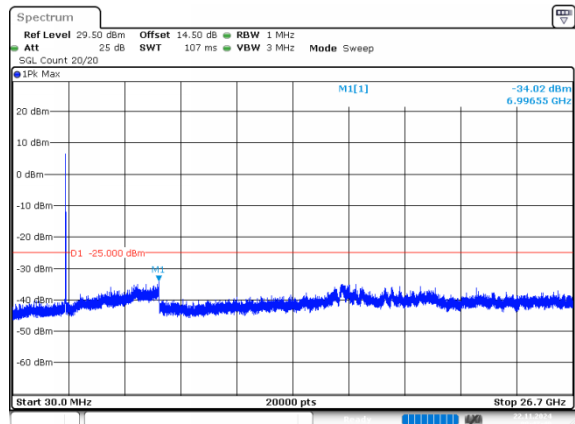


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:47:49

20MHz_High_QPSK_1@0(30MHz~26.7GHz)

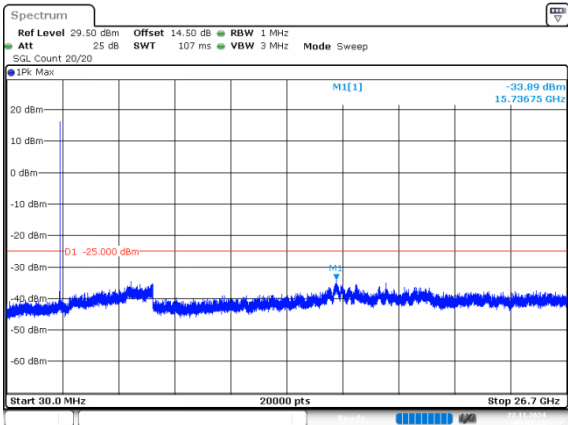

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:48:24


20MHz_High_QPSK_100@0(30MHz~26.7GHz)

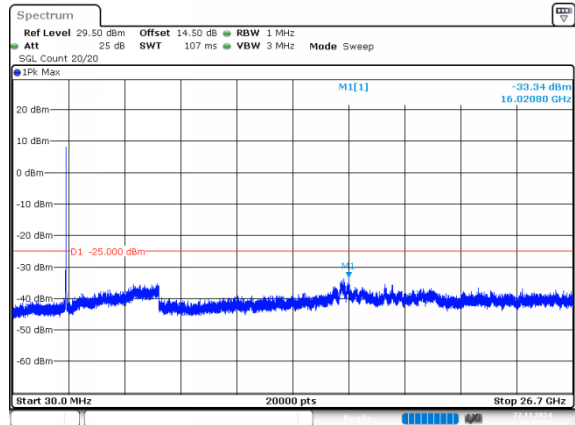

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 22.NOV.2024 09:48:59


B38 , Normal
1RB was the worst case

5MHz_Low_QPSK_1@0(30MHz~27.2GHz)

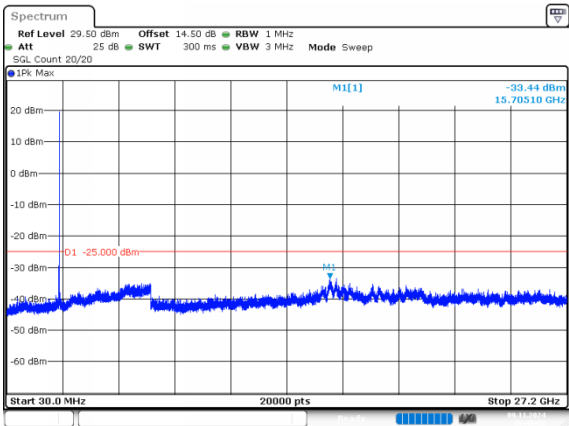


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:42:51

5MHz_Low_QPSK_25@0(30MHz~27.2GHz)

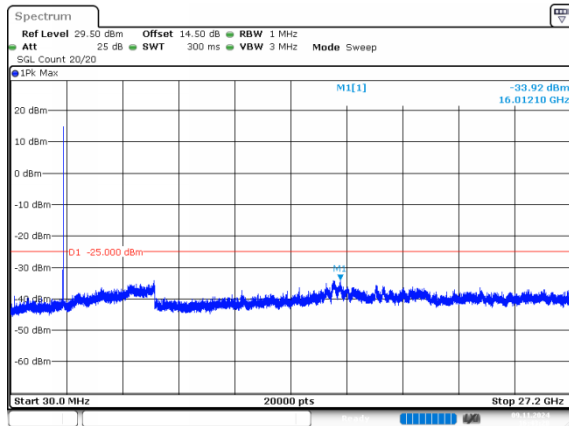


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:43:29

5MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

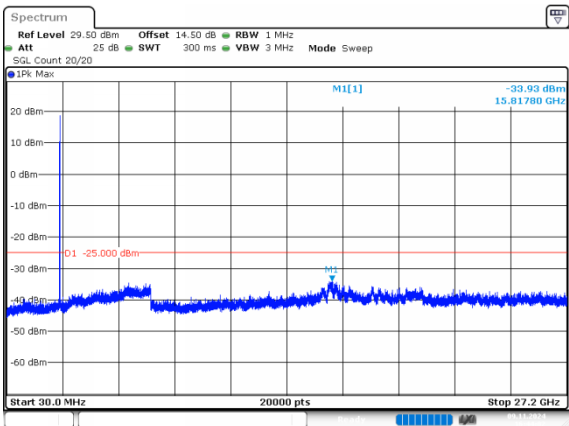


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:44:02

5MHz_Middle_QPSK_25@0(30MHz~27.2GHz)

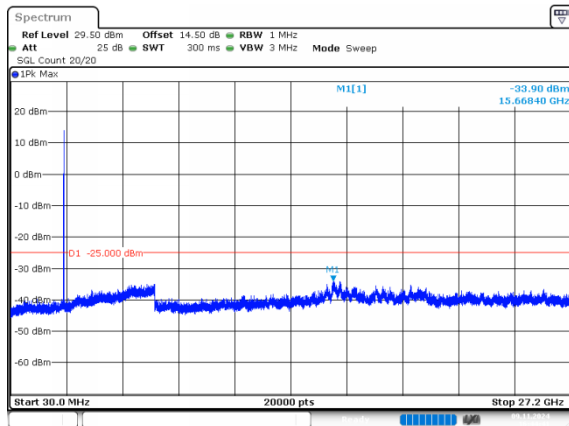


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:44:42

5MHz_High_QPSK_1@0(30MHz~27.2GHz)

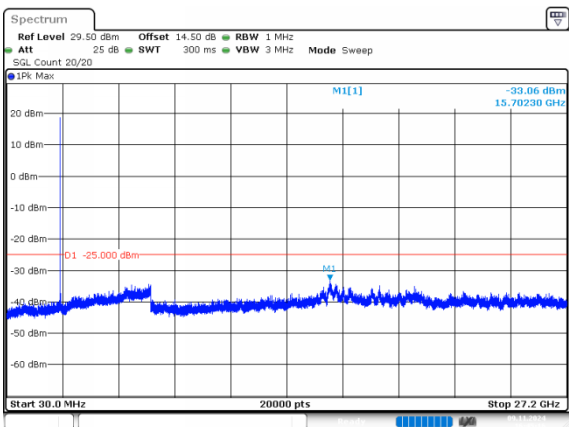


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:45:16

5MHz_High_QPSK_25@0(30MHz~27.2GHz)

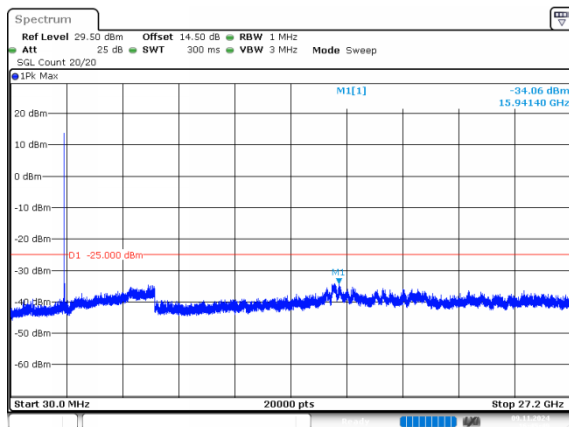


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:45:50

10MHz_Low_QPSK_1@0(30MHz~27.2GHz)

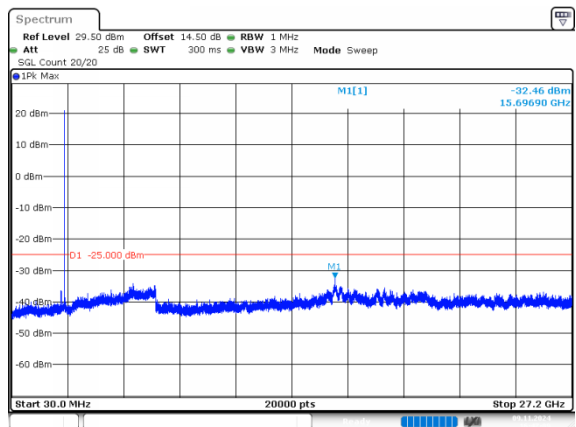


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:47:09

10MHz_Low_QPSK_50@0(30MHz~27.2GHz)

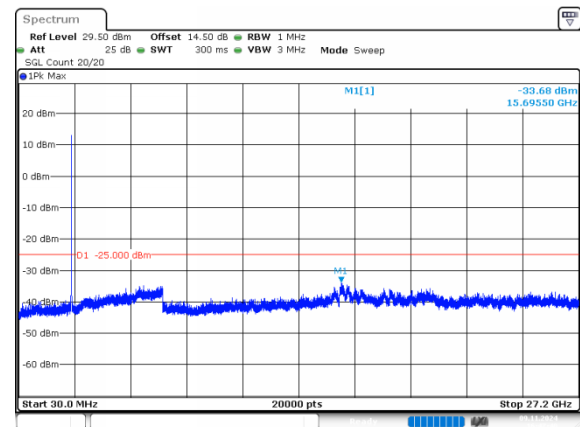


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:47:41

10MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

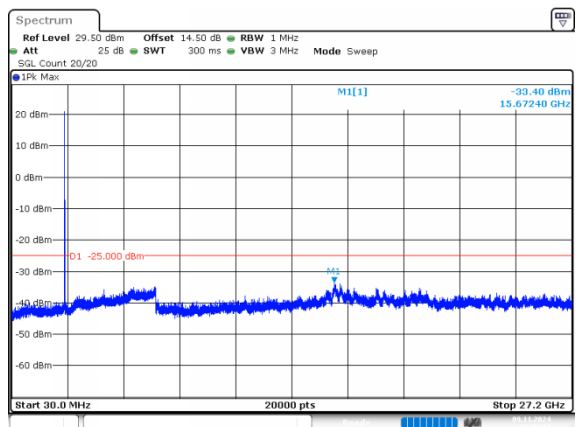


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:48:12

10MHz_Middle_QPSK_50@0(30MHz~27.2GHz)

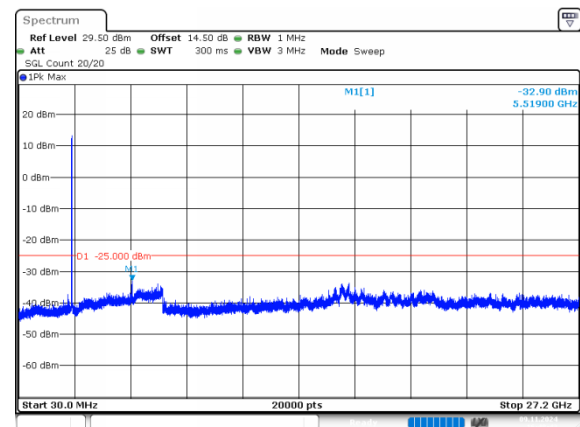


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:48:44

10MHz_High_QPSK_1@0(30MHz~27.2GHz)

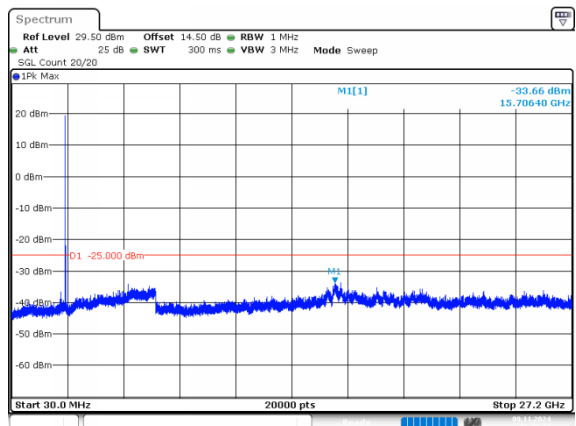


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:49:17

10MHz_High_QPSK_50@0(30MHz~27.2GHz)

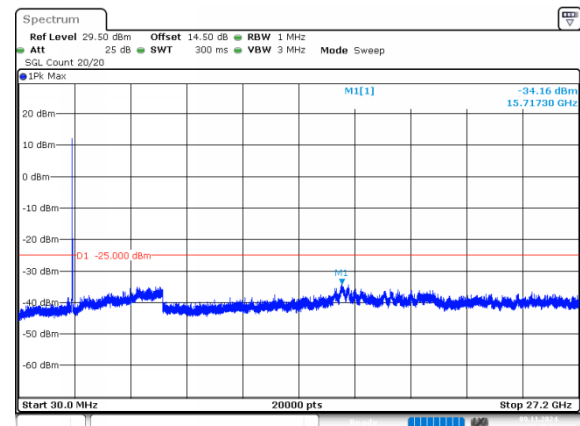


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:49:50

15MHz_Low_QPSK_1@0(30MHz~27.2GHz)

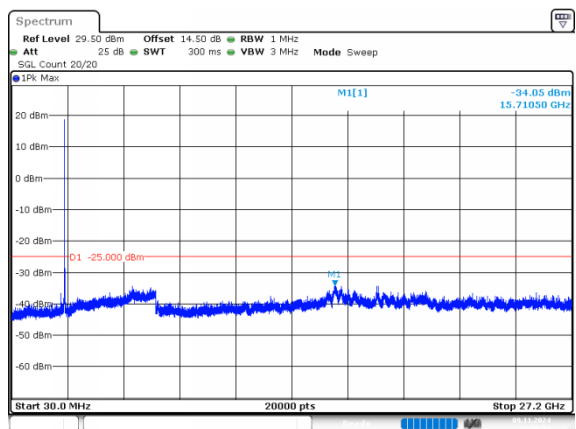


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:50:55

15MHz_Low_QPSK_75@0(30MHz~27.2GHz)

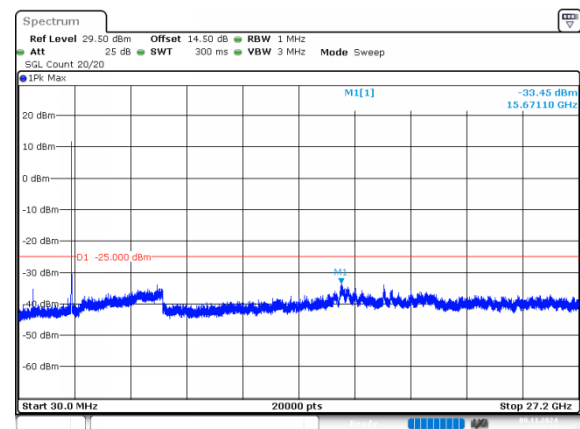


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:51:29

15MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

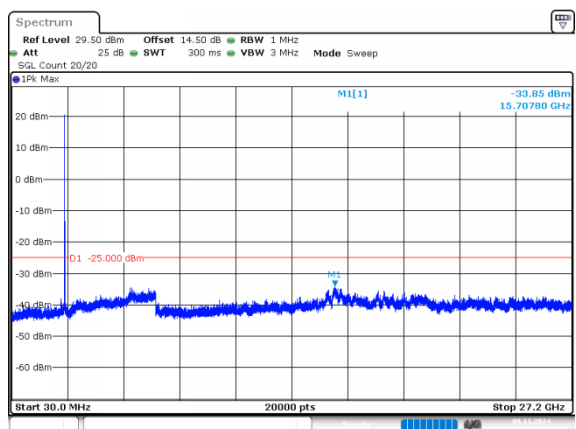


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:52:06

15MHz_Middle_QPSK_75@0(30MHz~27.2GHz)

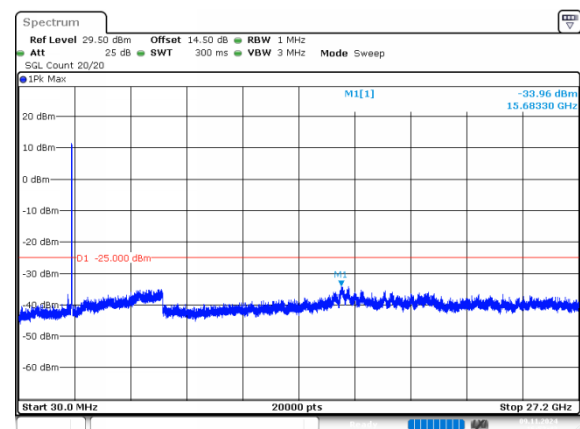


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:52:44

15MHz_High_QPSK_1@0(30MHz~27.2GHz)

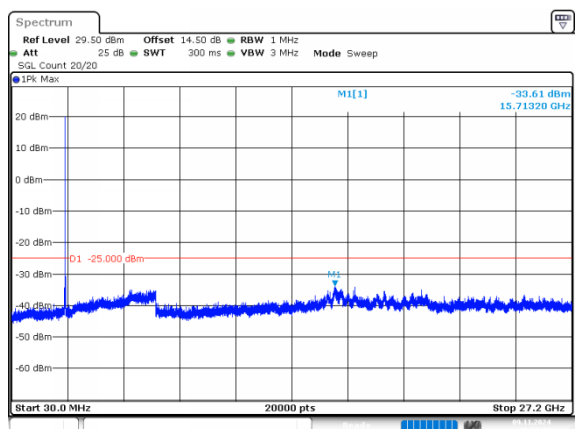


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:53:23

15MHz_High_QPSK_75@0(30MHz~27.2GHz)

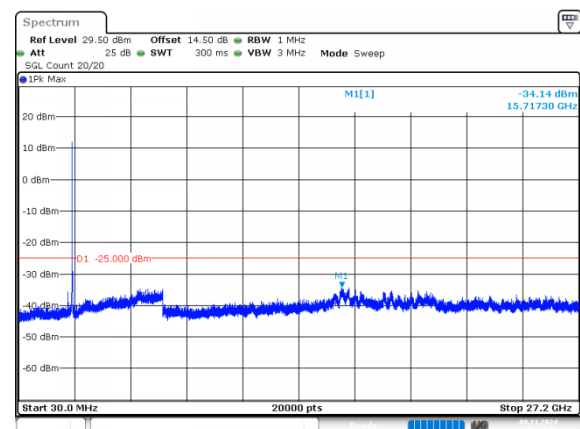


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 16:54:06

20MHz_Low_QPSK_1@0(30MHz~27.2GHz)

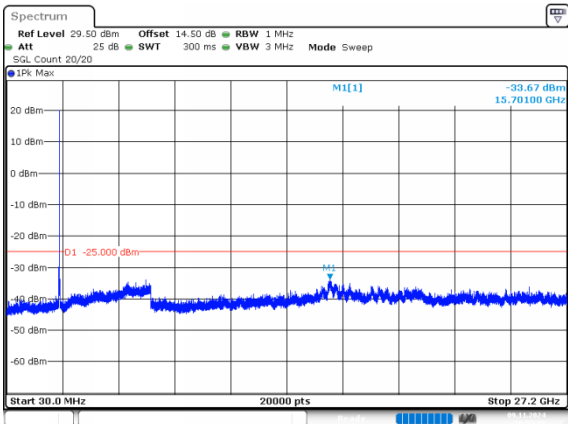


ProjectNo.:2403Y100558E-RF Tester:Leo LI
Date: 9.NOV.2024 16:55:28

20MHz_Low_QPSK_100@0(30MHz~27.2GHz)

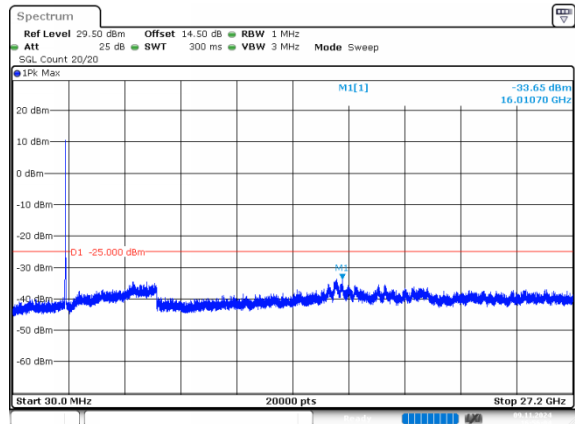


ProjectNo.:2403Y100558E-RF Tester:Leo LI
Date: 9.NOV.2024 16:56:05

20MHz_Middle_QPSK_1@0(30MHz~27.2GHz)

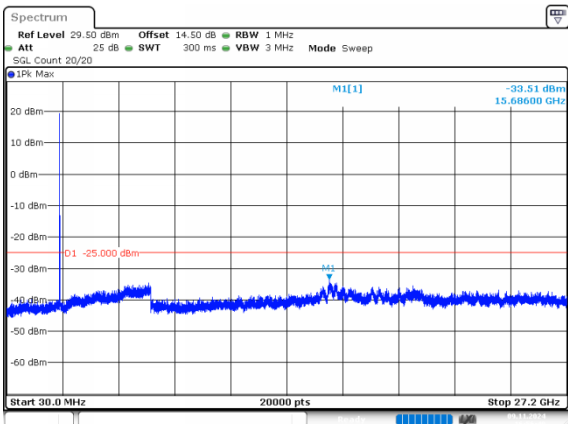


ProjectNo.:2403Y100558E-RF Tester:Leo LI
Date: 9.NOV.2024 16:56:40

20MHz_Middle_QPSK_100@0(30MHz~27.2GHz)

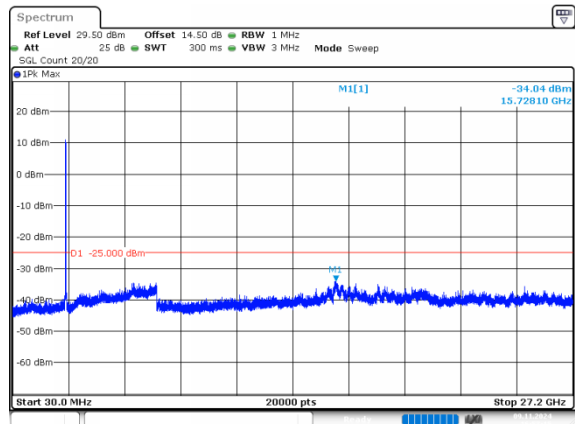


ProjectNo.:2403Y100558E-RF Tester:Leo LI
Date: 9.NOV.2024 16:57:16

20MHz_High_QPSK_1@0(30MHz~27.2GHz)

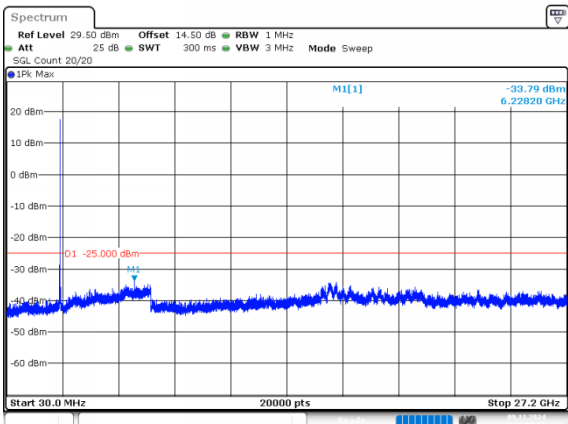

ProjectNo.:2403Y100558E-RF Tester:Leo LI
Date: 9.NOV.2024 16:57:51


20MHz_High_QPSK_100@0(30MHz~27.2GHz)

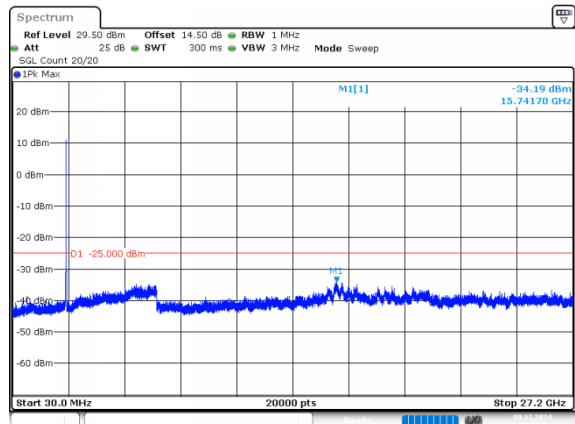


ProjectNo.:2403Y100558E-RF Tester:Leo LI
Date: 9.NOV.2024 16:58:25

B41_2 , Normal
1RB was the worst case


2_5MHz_Low_QPSK_1@0(30MHz~27.55GHz)

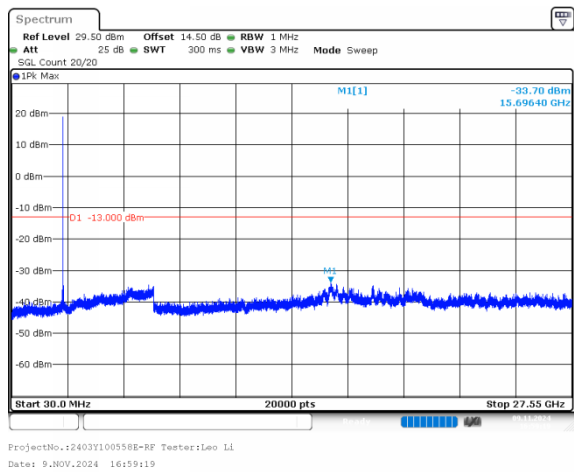


2_5MHz_Low_QPSK_25@0(30MHz~27.55GHz)

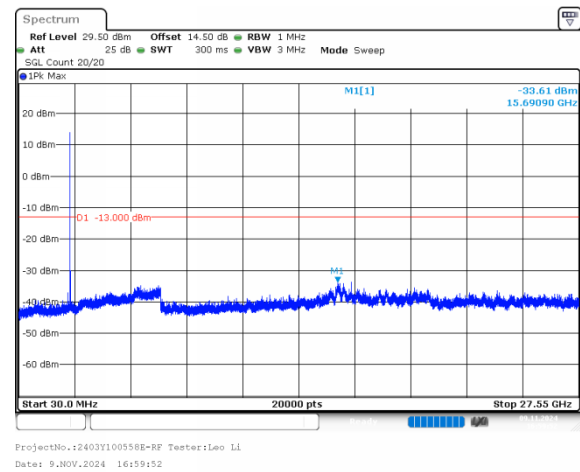


2_5MHz_Middle_QPSK_1@0(30MHz~27.55GHz)

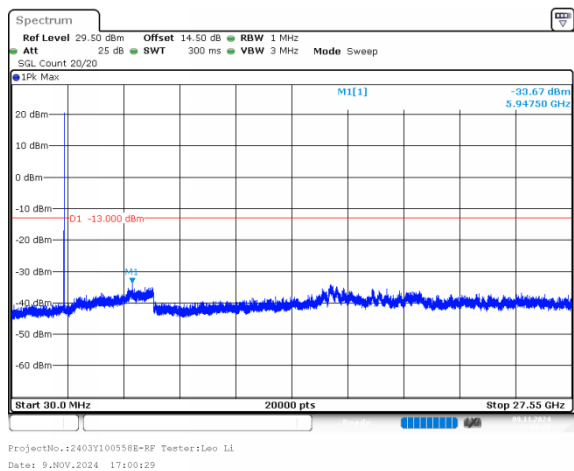


2_5MHz_Middle_QPSK_25@0(30MHz~27.55GHz)

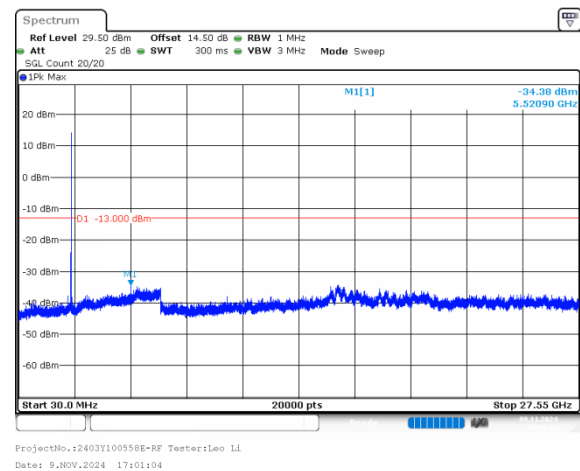


2_5MHz_High_QPSK_1@0(30MHz~27.55GHz)

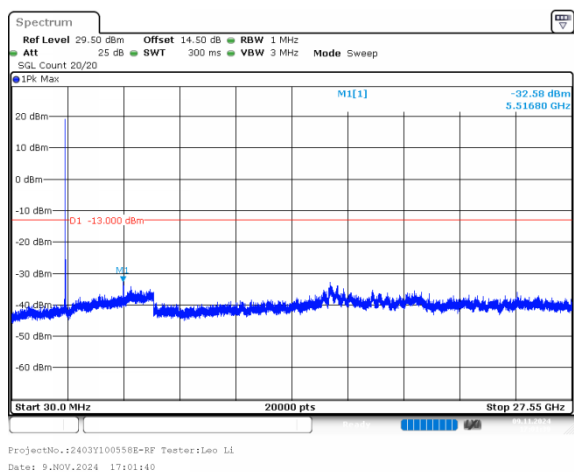

2_5MHz_High_QPSK_25@0(30MHz~27.55GHz)

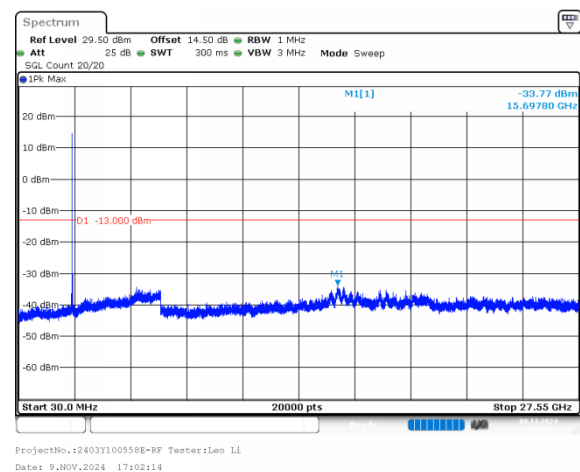


2_10MHz_Low_QPSK_1@0(30MHz~27.55GHz)

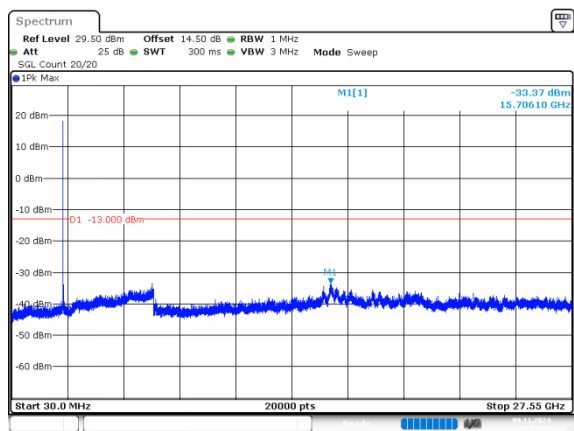


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:03:17

2_10MHz_Low_QPSK_50@0(30MHz~27.55GHz)

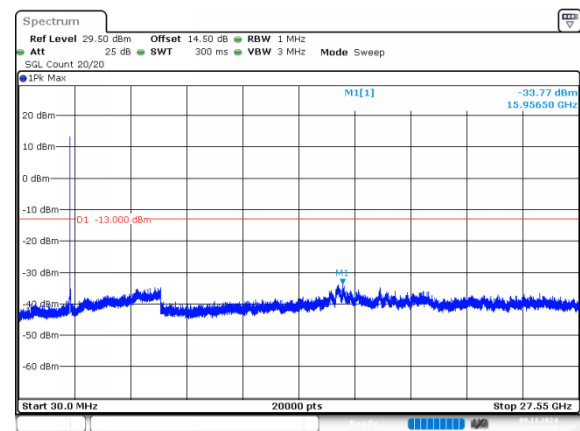


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:03:50

2_10MHz_Middle_QPSK_1@0(30MHz~27.55GHz)

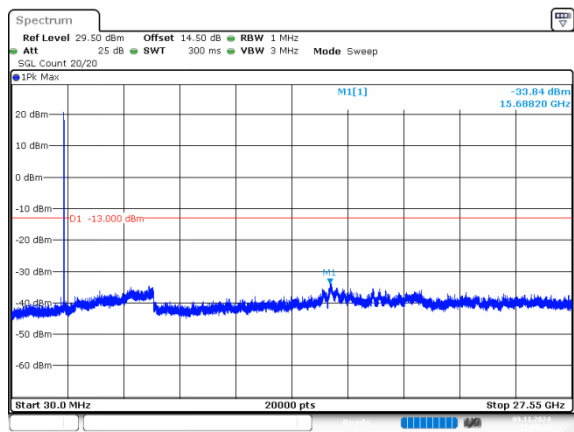


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:04:24

2_10MHz_Middle_QPSK_50@0(30MHz~27.55GHz)

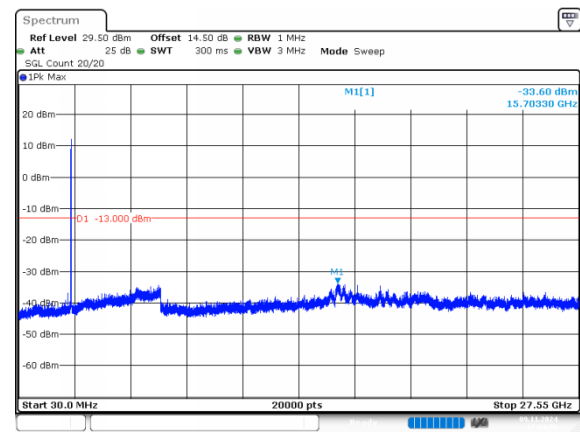


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:04:57

2_10MHz_High_QPSK_1@0(30MHz~27.55GHz)

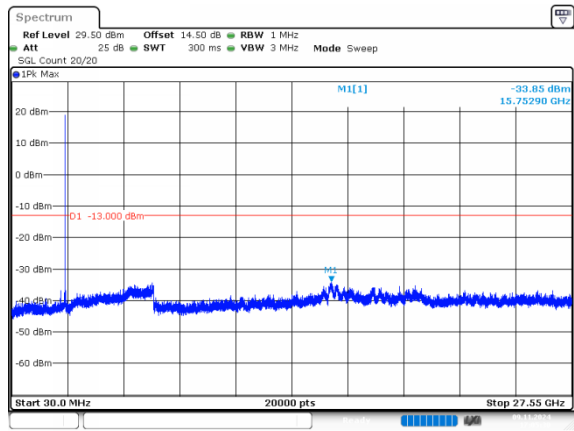


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:05:30

2_10MHz_High_QPSK_50@0(30MHz~27.55GHz)

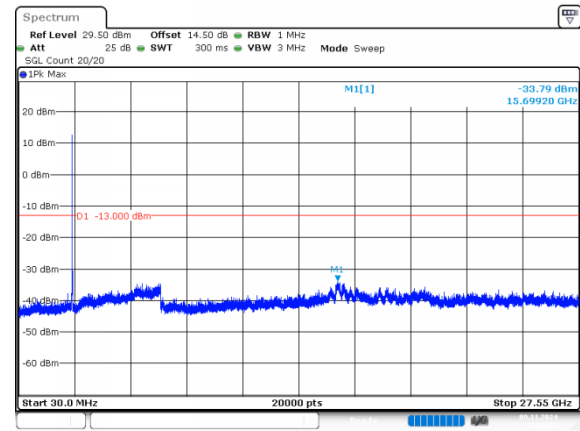


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:06:03

2_15MHz_Low_QPSK_1@0(30MHz~27.55GHz)

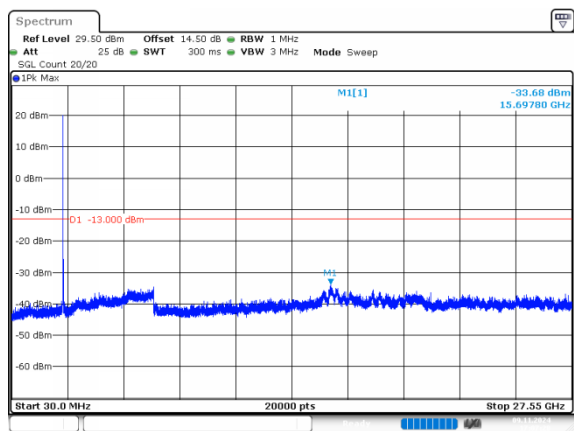


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:07:29

2_15MHz_Low_QPSK_75@0(30MHz~27.55GHz)

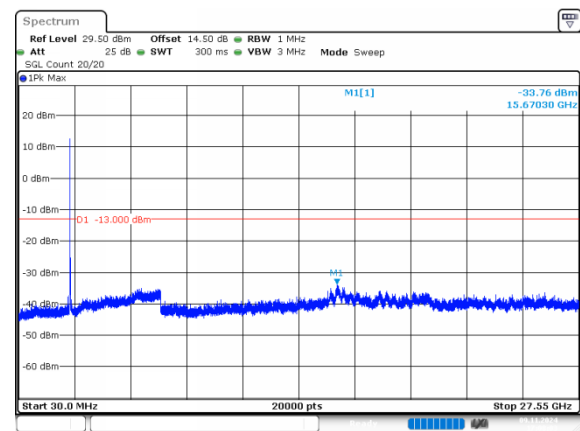


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:08:04

2_15MHz_Middle_QPSK_1@0(30MHz~27.55GHz)

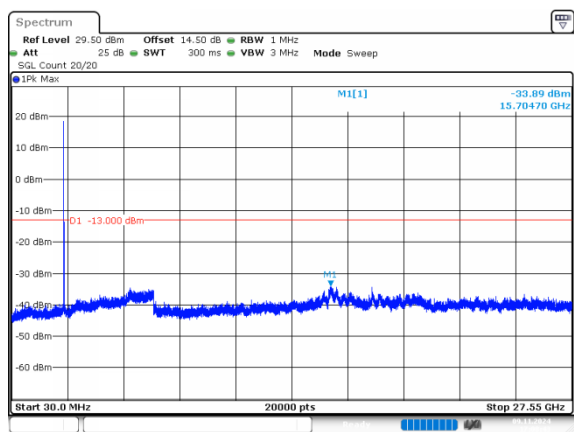


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:08:43

2_15MHz_Middle_QPSK_75@0(30MHz~27.55GHz)

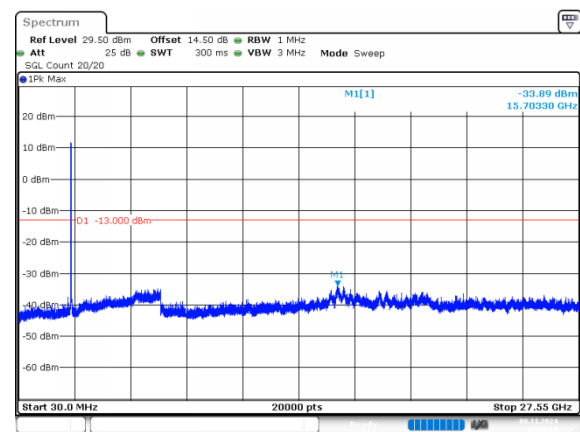


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:09:19

2_15MHz_High_QPSK_1@0(30MHz~27.55GHz)

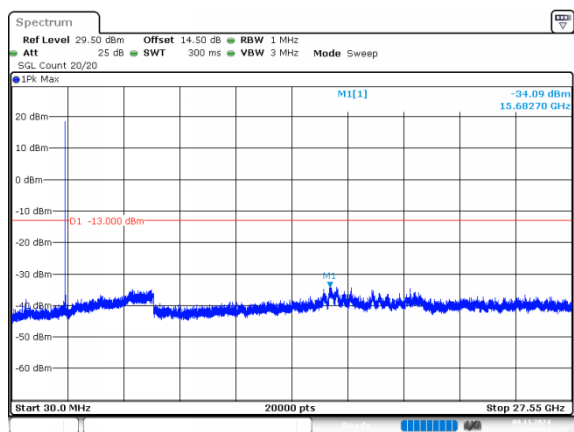


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:09:53

2_15MHz_High_QPSK_75@0(30MHz~27.55GHz)

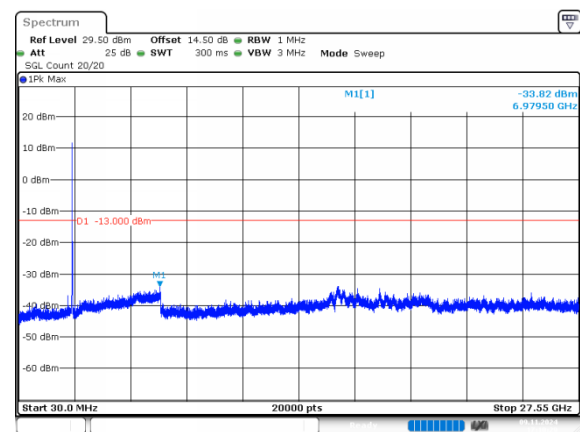


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:10:30

2_20MHz_Low_QPSK_1@0(30MHz~27.55GHz)

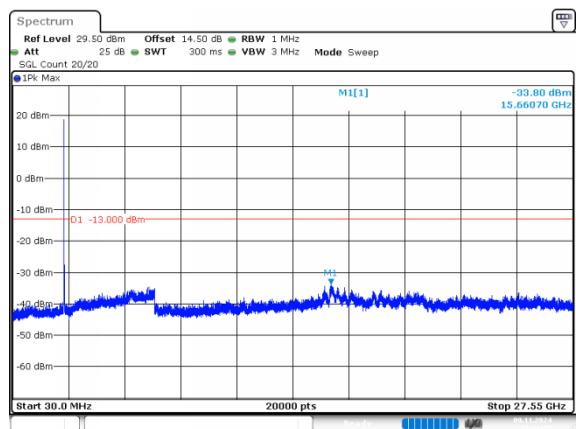


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:11:18

2_20MHz_Low_QPSK_100@0(30MHz~27.55GHz)

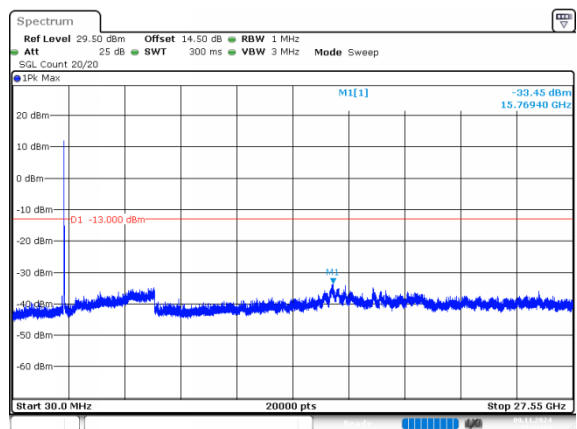


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:12:14

2_20MHz_Middle_QPSK_1@0(30MHz~27.55GHz)

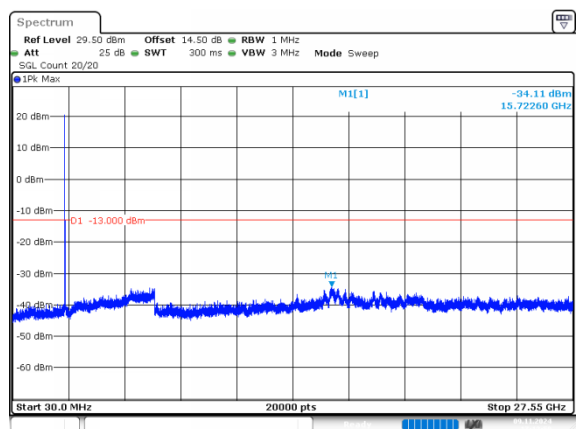


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:12:51

2_20MHz_Middle_QPSK_100@0(30MHz~27.55GHz)

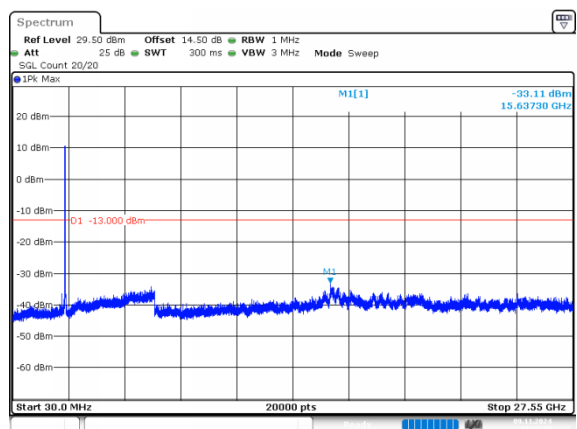


ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:13:25

2_20MHz_High_QPSK_1@0(30MHz~27.55GHz)

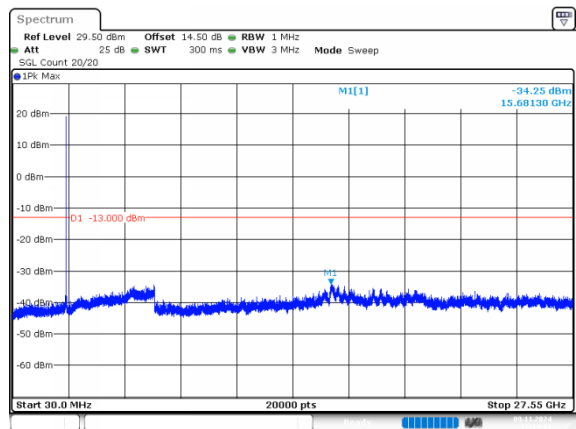

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:14:11

2_20MHz_High_QPSK_100@0(30MHz~27.55GHz)

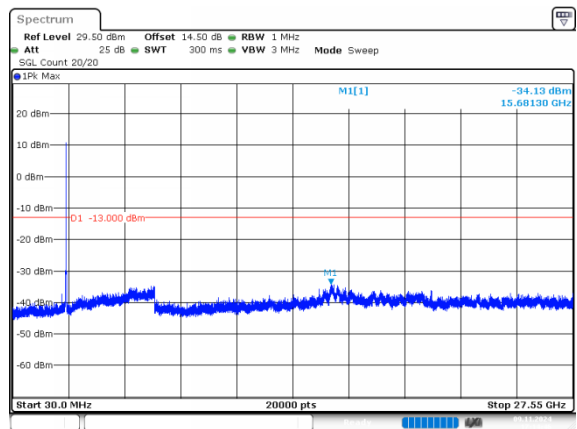

ProjectNo.:2403Y100558E-RF Tester:Leo Li
Date: 9.NOV.2024 17:14:47