

Appendix Test Data

Report No.:	1812C50357812504	Test Sample No.:	1-2-2
Start Test Date:	2025-08-13	Finish Test Date:	2025-08-14
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	26.7°C	Relative Humidity:	58%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	25.960	5167.440	5193.400	---	---
11A	Ant1	5220	24.960	5207.120	5232.080	---	---
11A	Ant1	5240	26.440	5226.320	5252.760	---	---
11A	Ant1	5745	26.720	5730.880	5757.600	---	---
11A	Ant1	5785	26.120	5772.280	5798.400	---	---
11A	Ant1	5825	25.480	5812.160	5837.640	---	---
11N20SISO	Ant1	5180	27.240	5167.240	5194.480	---	---
11N20SISO	Ant1	5220	26.280	5207.240	5233.520	---	---
11N20SISO	Ant1	5240	26.320	5226.960	5253.280	---	---
11N20SISO	Ant1	5745	26.560	5731.360	5757.920	---	---
11N20SISO	Ant1	5785	27.000	5771.320	5798.320	---	---
11N20SISO	Ant1	5825	26.920	5811.440	5838.360	---	---
11N40SISO	Ant1	5190	45.440	5167.680	5213.120	---	---
11N40SISO	Ant1	5230	47.840	5205.520	5253.360	---	---
11N40SISO	Ant1	5755	45.680	5732.360	5778.040	---	---
11N40SISO	Ant1	5795	45.760	5772.360	5818.120	---	---
11AC20SISO	Ant1	5180	26.400	5166.440	5192.840	---	---
11AC20SISO	Ant1	5220	25.880	5206.920	5232.800	---	---
11AC20SISO	Ant1	5240	27.760	5225.920	5253.680	---	---
11AC20SISO	Ant1	5745	26.840	5731.080	5757.920	---	---
11AC20SISO	Ant1	5785	26.320	5771.960	5798.280	---	---
11AC20SISO	Ant1	5825	26.480	5811.960	5838.440	---	---
11AC40SISO	Ant1	5190	45.840	5167.200	5213.040	---	---
11AC40SISO	Ant1	5230	45.840	5207.040	5252.880	---	---
11AC40SISO	Ant1	5755	46.720	5731.000	5777.720	---	---

11AC40SISO	Ant1	5795	45.440	5772.760	5818.200	---	---
11AX20SISO	Ant1	5180	25.680	5167.760	5193.440	---	---
11AX20SISO	Ant1	5220	27.240	5207.400	5234.640	---	---
11AX20SISO	Ant1	5240	27.240	5227.320	5254.560	---	---
11AX20SISO	Ant1	5745	26.600	5732.560	5759.160	---	---
11AX20SISO	Ant1	5785	27.000	5772.240	5799.240	---	---
11AX20SISO	Ant1	5825	26.880	5812.760	5839.640	---	---
11AX40SISO	Ant1	5190	45.760	5166.880	5212.640	---	---
11AX40SISO	Ant1	5230	44.400	5207.680	5252.080	---	---
11AX40SISO	Ant1	5755	44.320	5733.000	5777.320	---	---
11AX40SISO	Ant1	5795	45.440	5772.200	5817.640	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com









Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




11AC20SISO-Ant1-5240



11AC20SISO-Ant1-5745



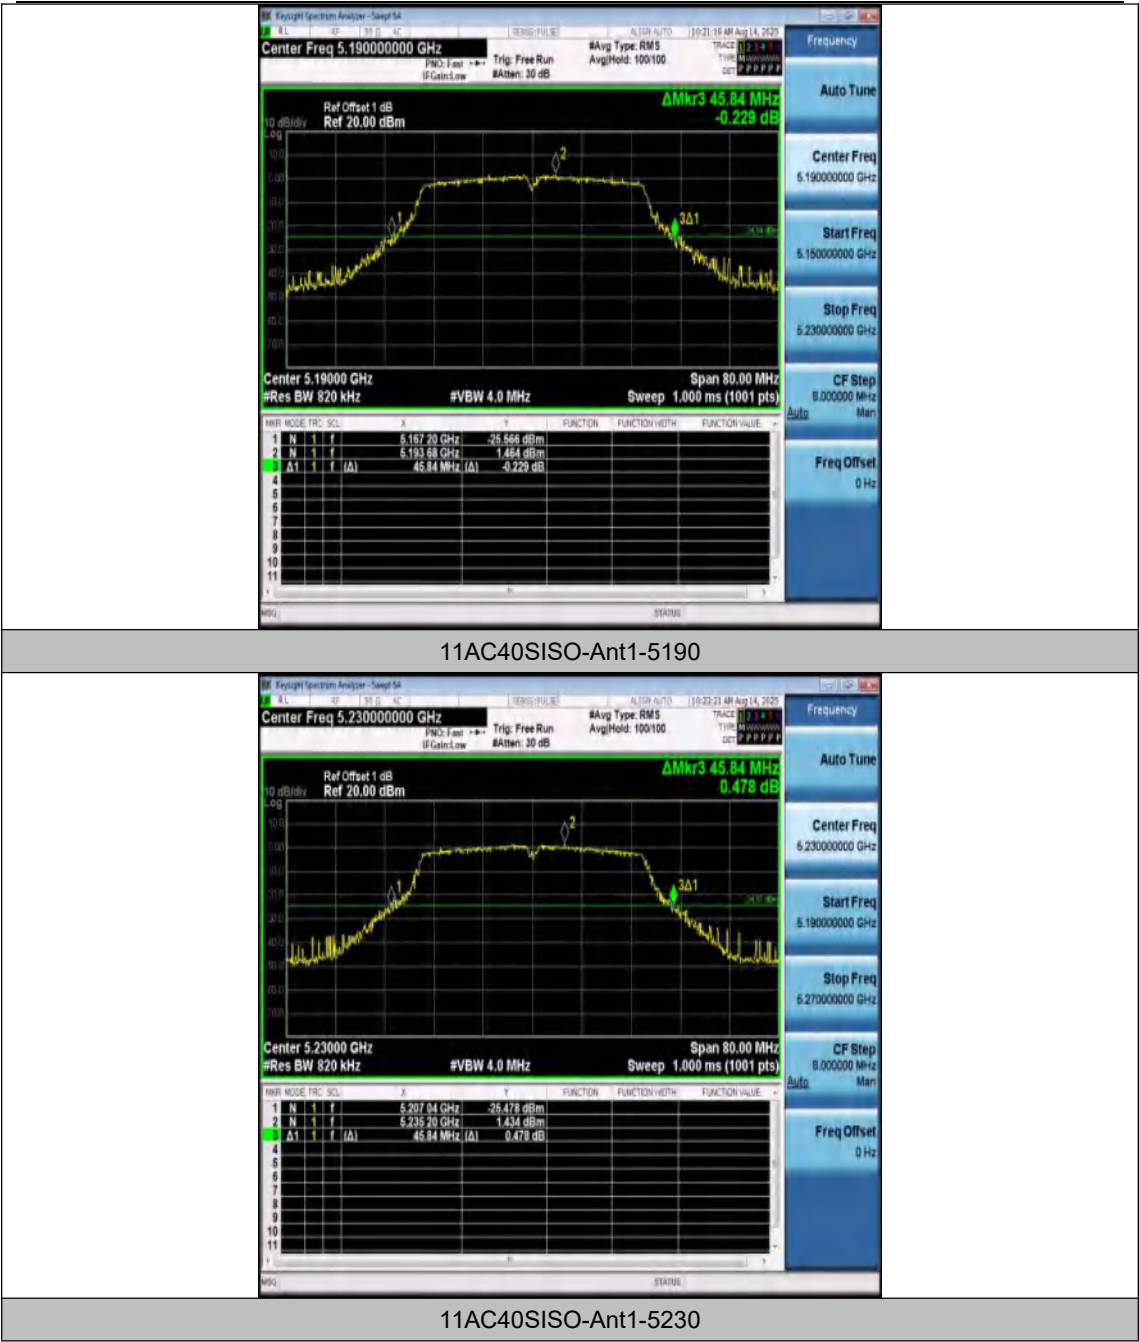




Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





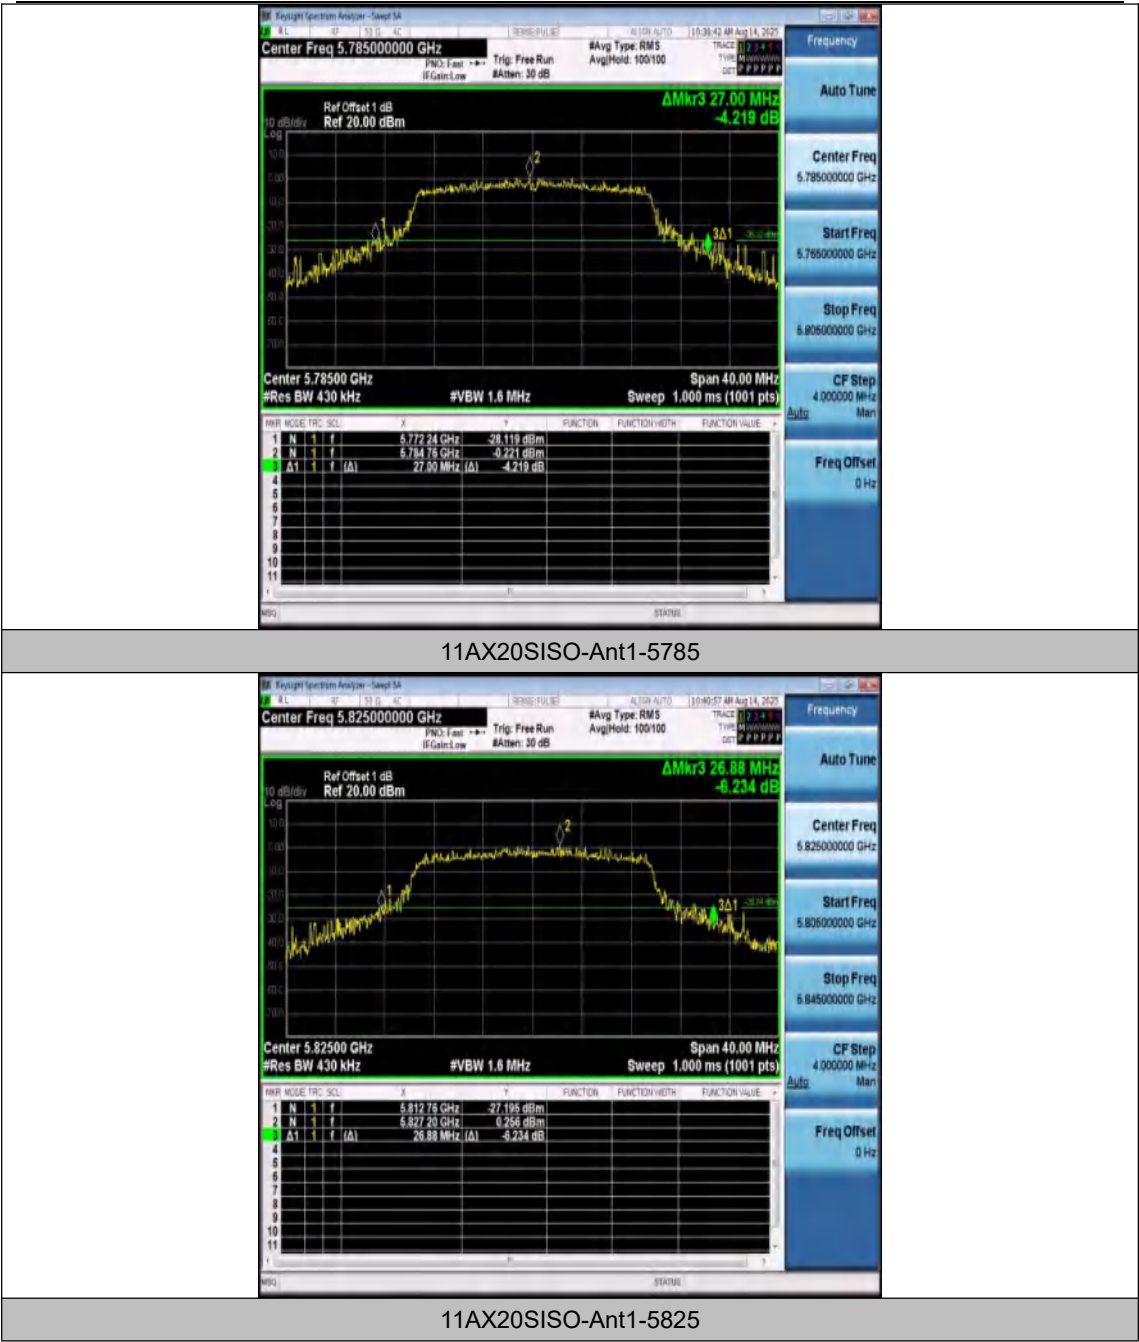

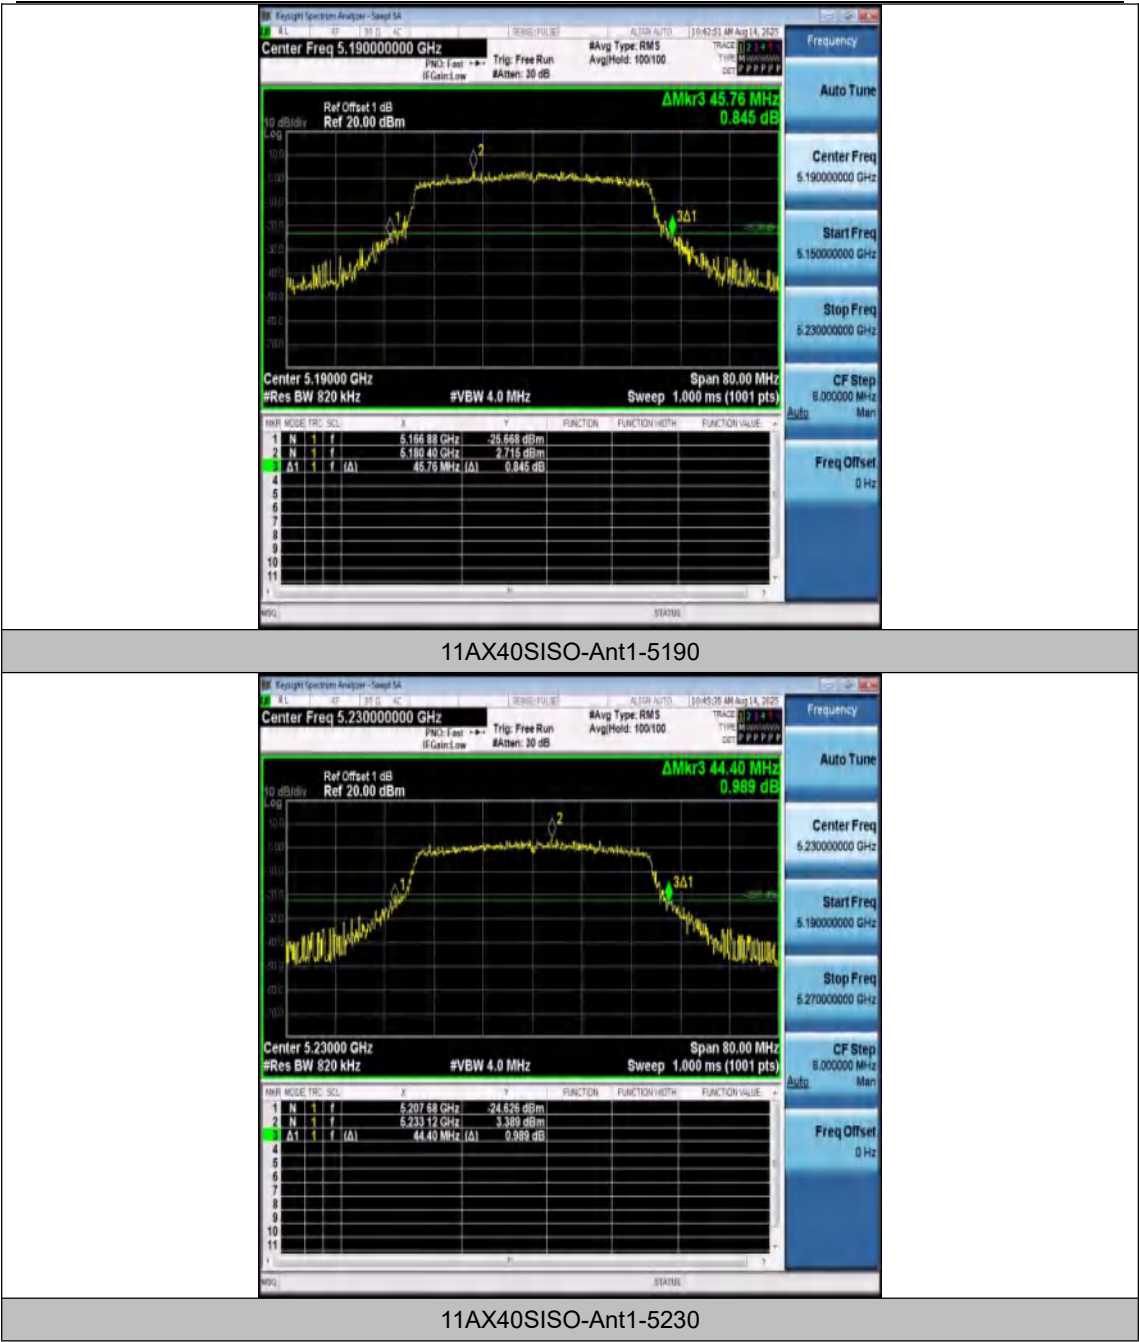

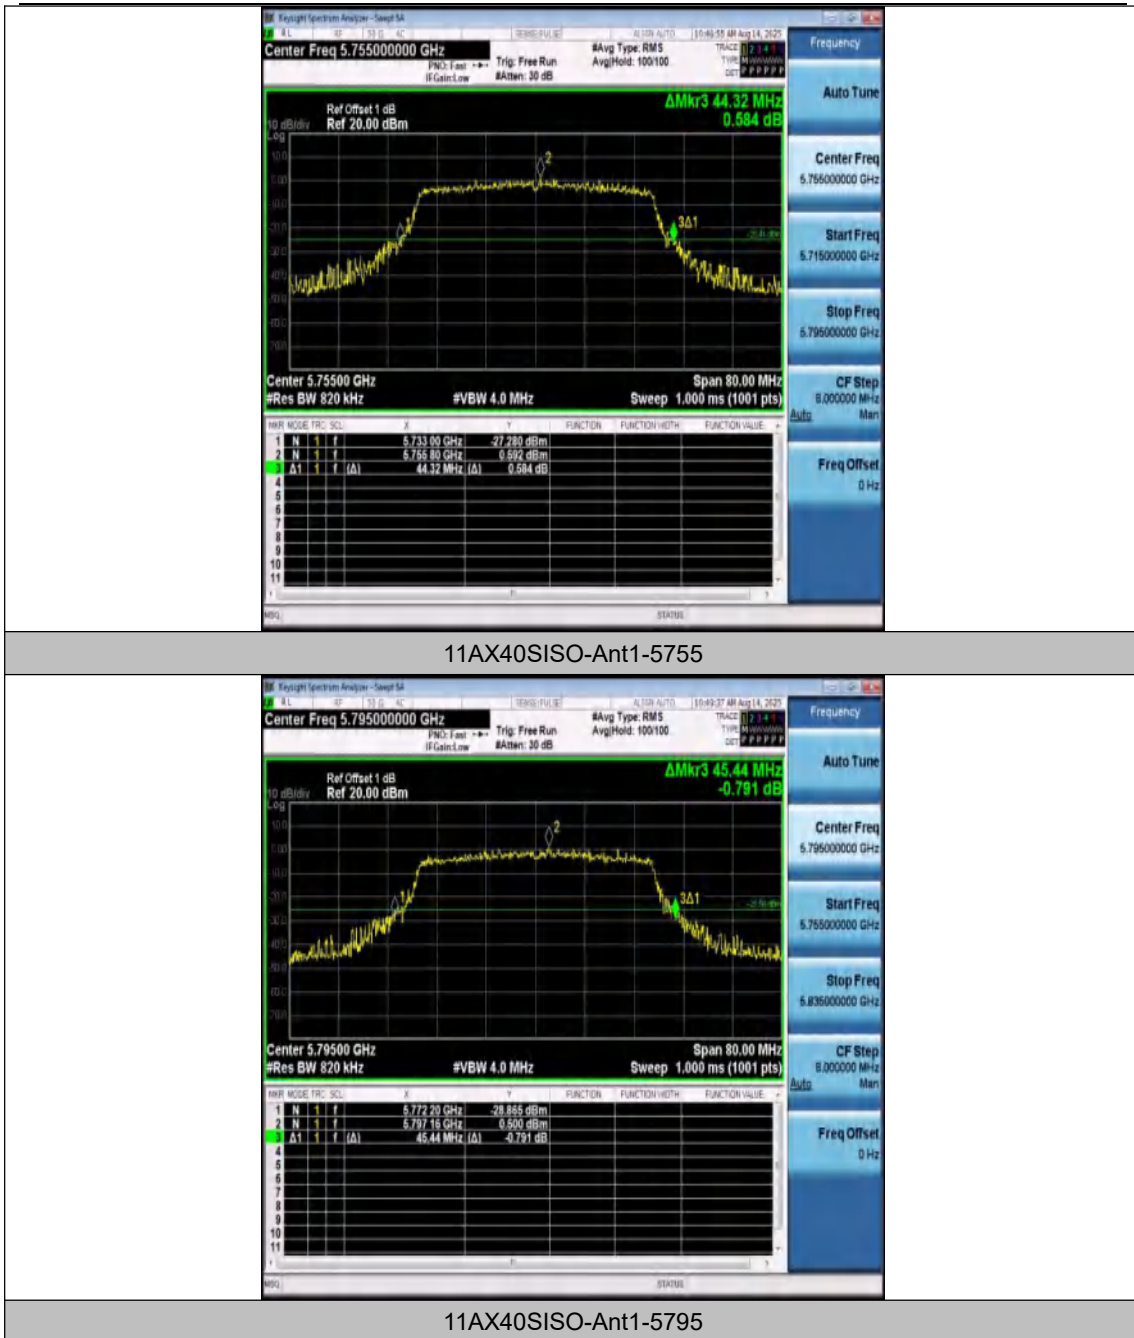

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.199	5171.4102	5188.6092	---	---
11A	Ant1	5220	17.230	5211.3478	5228.5778	---	---
11A	Ant1	5240	17.159	5231.3860	5248.5450	---	---
11A	Ant1	5745	17.274	5736.3708	5753.6448	---	---
11A	Ant1	5785	17.304	5776.4011	5793.7051	---	---
11A	Ant1	5825	17.212	5816.4467	5833.6587	---	---
11N20SISO	Ant1	5180	18.300	5170.9499	5189.2499	---	---
11N20SISO	Ant1	5220	18.355	5210.8777	5229.2327	---	---
11N20SISO	Ant1	5240	18.360	5230.8672	5249.2272	---	---
11N20SISO	Ant1	5745	18.259	5735.9563	5754.2153	---	---
11N20SISO	Ant1	5785	18.301	5775.9323	5794.2333	---	---
11N20SISO	Ant1	5825	18.226	5816.0321	5834.2581	---	---
11N40SISO	Ant1	5190	36.489	5171.9122	5208.4012	---	---
11N40SISO	Ant1	5230	36.514	5211.7799	5248.2939	---	---
11N40SISO	Ant1	5755	36.570	5736.8151	5773.3851	---	---
11N40SISO	Ant1	5795	36.621	5776.8763	5813.4973	---	---
11AC20SISO	Ant1	5180	18.345	5170.9121	5189.2571	---	---
11AC20SISO	Ant1	5220	18.303	5210.9036	5229.2066	---	---
11AC20SISO	Ant1	5240	18.309	5230.8899	5249.1989	---	---
11AC20SISO	Ant1	5745	18.298	5735.9097	5754.2077	---	---
11AC20SISO	Ant1	5785	18.257	5775.9581	5794.2151	---	---
11AC20SISO	Ant1	5825	18.352	5815.9241	5834.2761	---	---
11AC40SISO	Ant1	5190	36.653	5171.8225	5208.4755	---	---
11AC40SISO	Ant1	5230	36.624	5211.6866	5248.3106	---	---
11AC40SISO	Ant1	5755	36.579	5736.7631	5773.3421	---	---
11AC40SISO	Ant1	5795	36.569	5776.8512	5813.4202	---	---
11AX20SISO	Ant1	5180	19.235	5170.5131	5189.7481	---	---
11AX20SISO	Ant1	5220	19.194	5210.4323	5229.6263	---	---
11AX20SISO	Ant1	5240	19.072	5230.4829	5249.5549	---	---
11AX20SISO	Ant1	5745	19.186	5735.4511	5754.6371	---	---
11AX20SISO	Ant1	5785	19.115	5775.5611	5794.6761	---	---
11AX20SISO	Ant1	5825	19.243	5815.4723	5834.7153	---	---
11AX40SISO	Ant1	5190	37.749	5171.2401	5208.9891	---	---
11AX40SISO	Ant1	5230	37.686	5211.1562	5248.8422	---	---
11AX40SISO	Ant1	5755	37.946	5736.0608	5774.0068	---	---
11AX40SISO	Ant1	5795	37.911	5776.1463	5814.0573	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

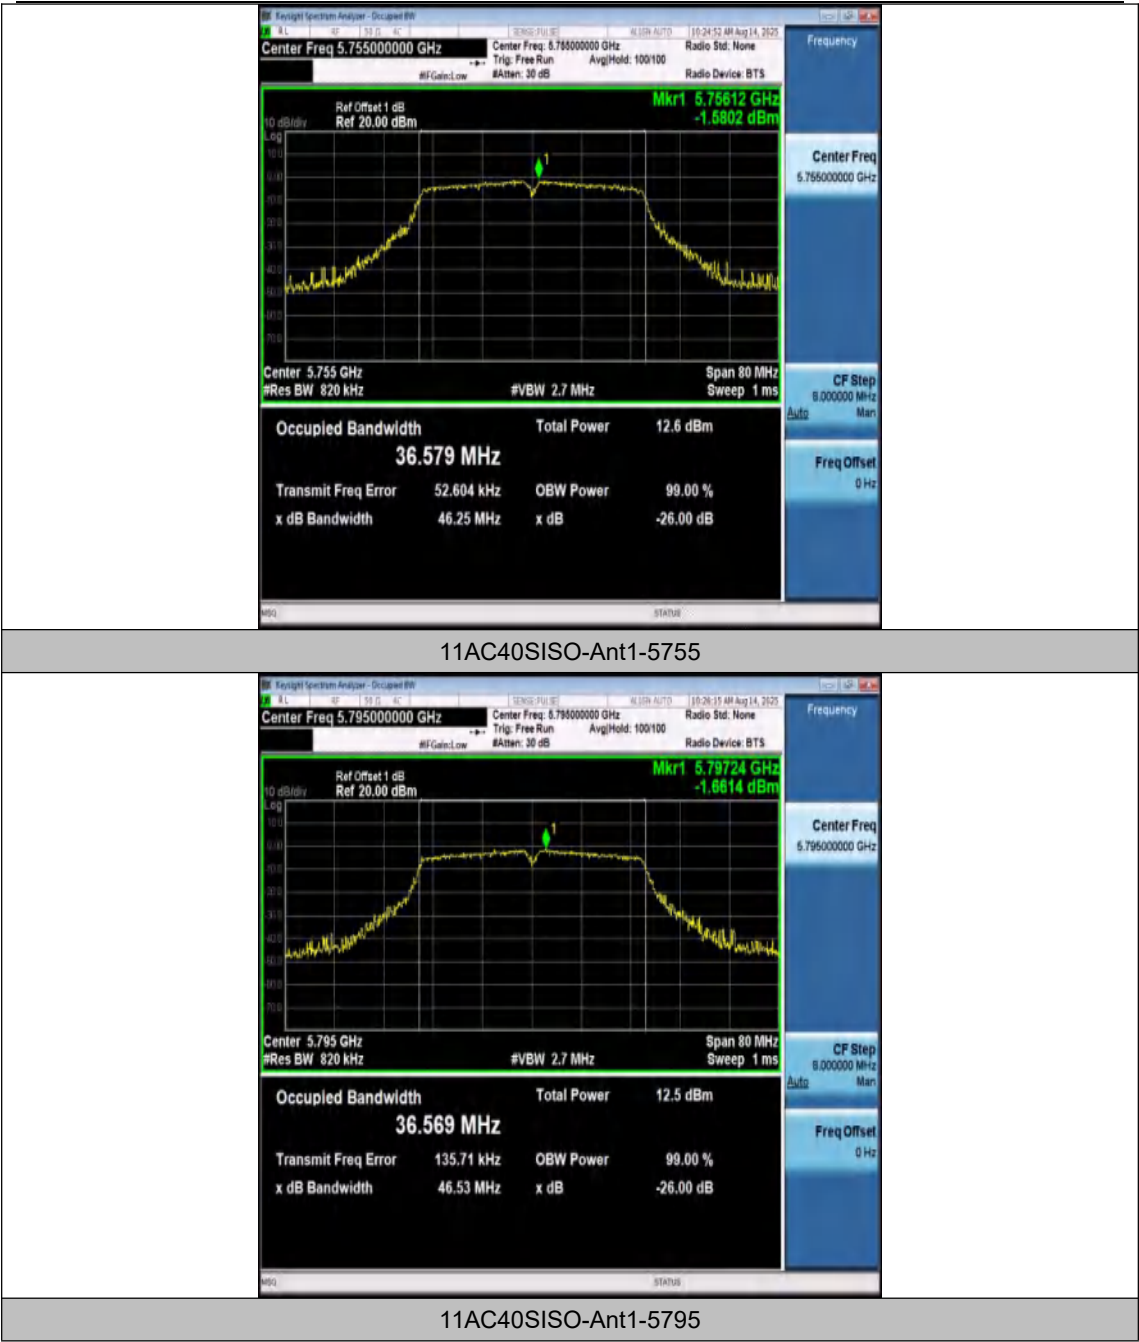


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



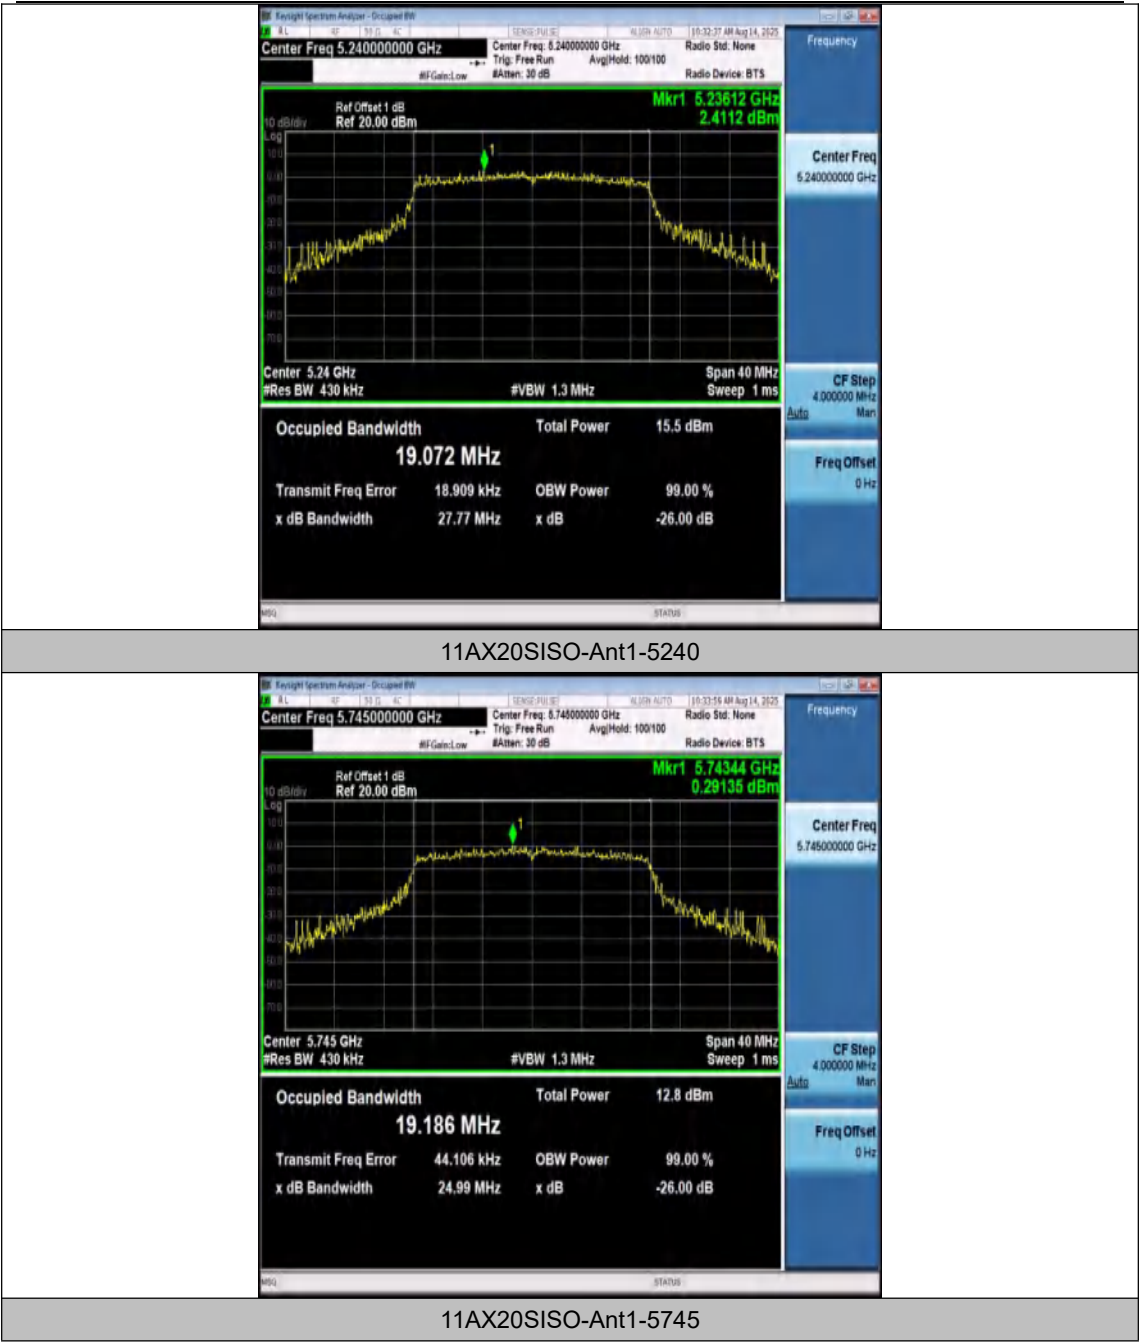




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

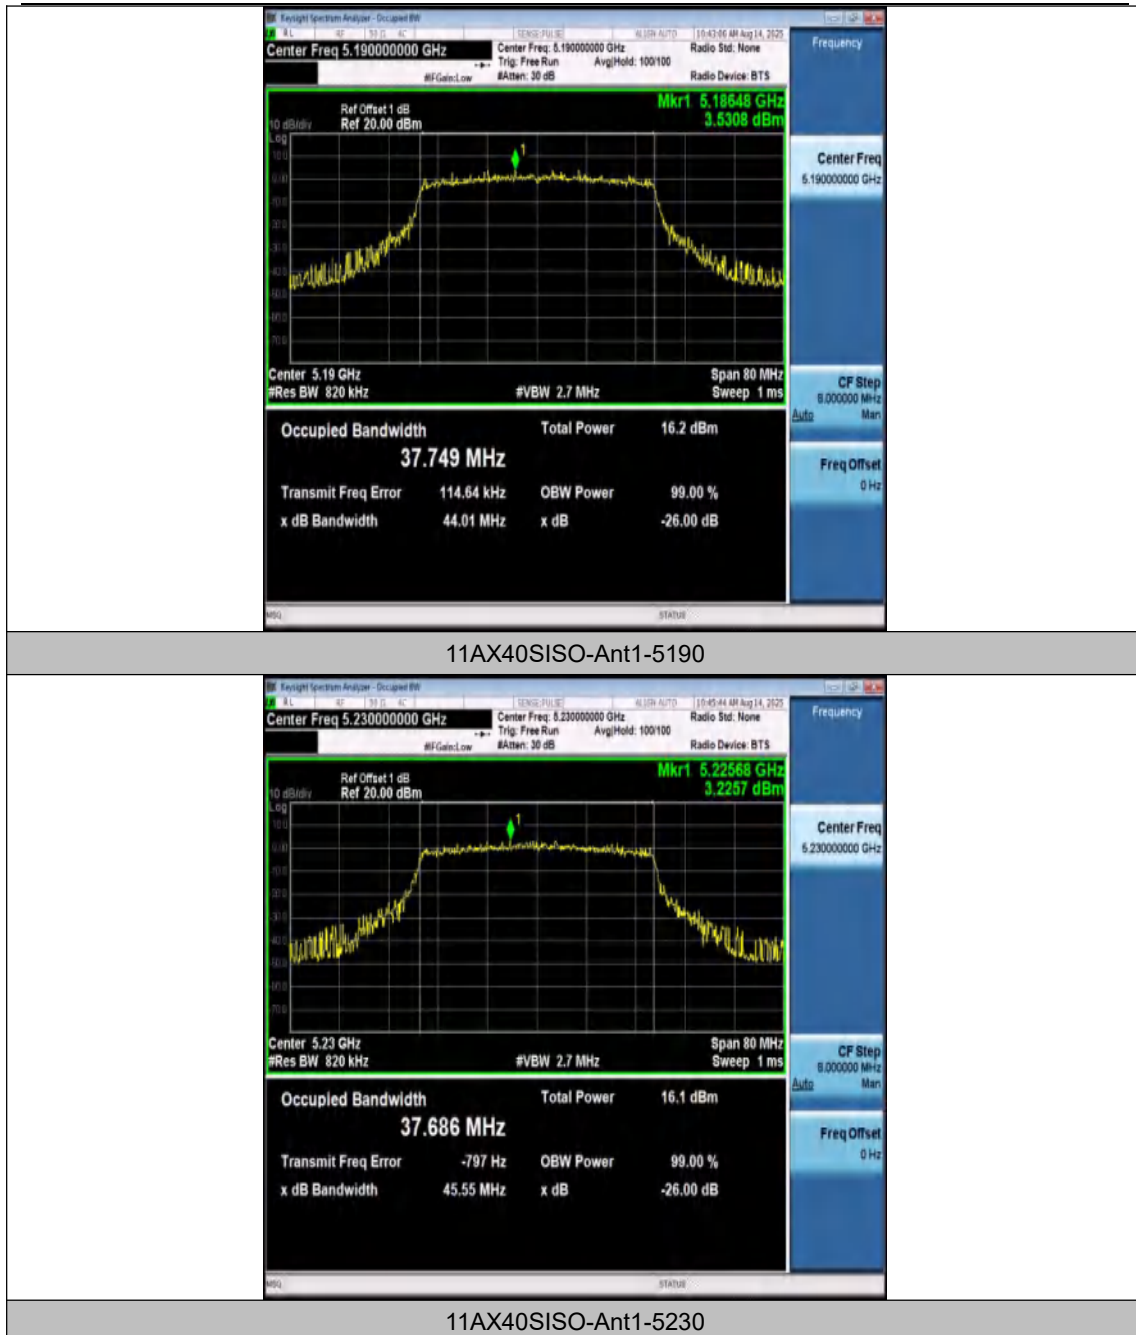

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

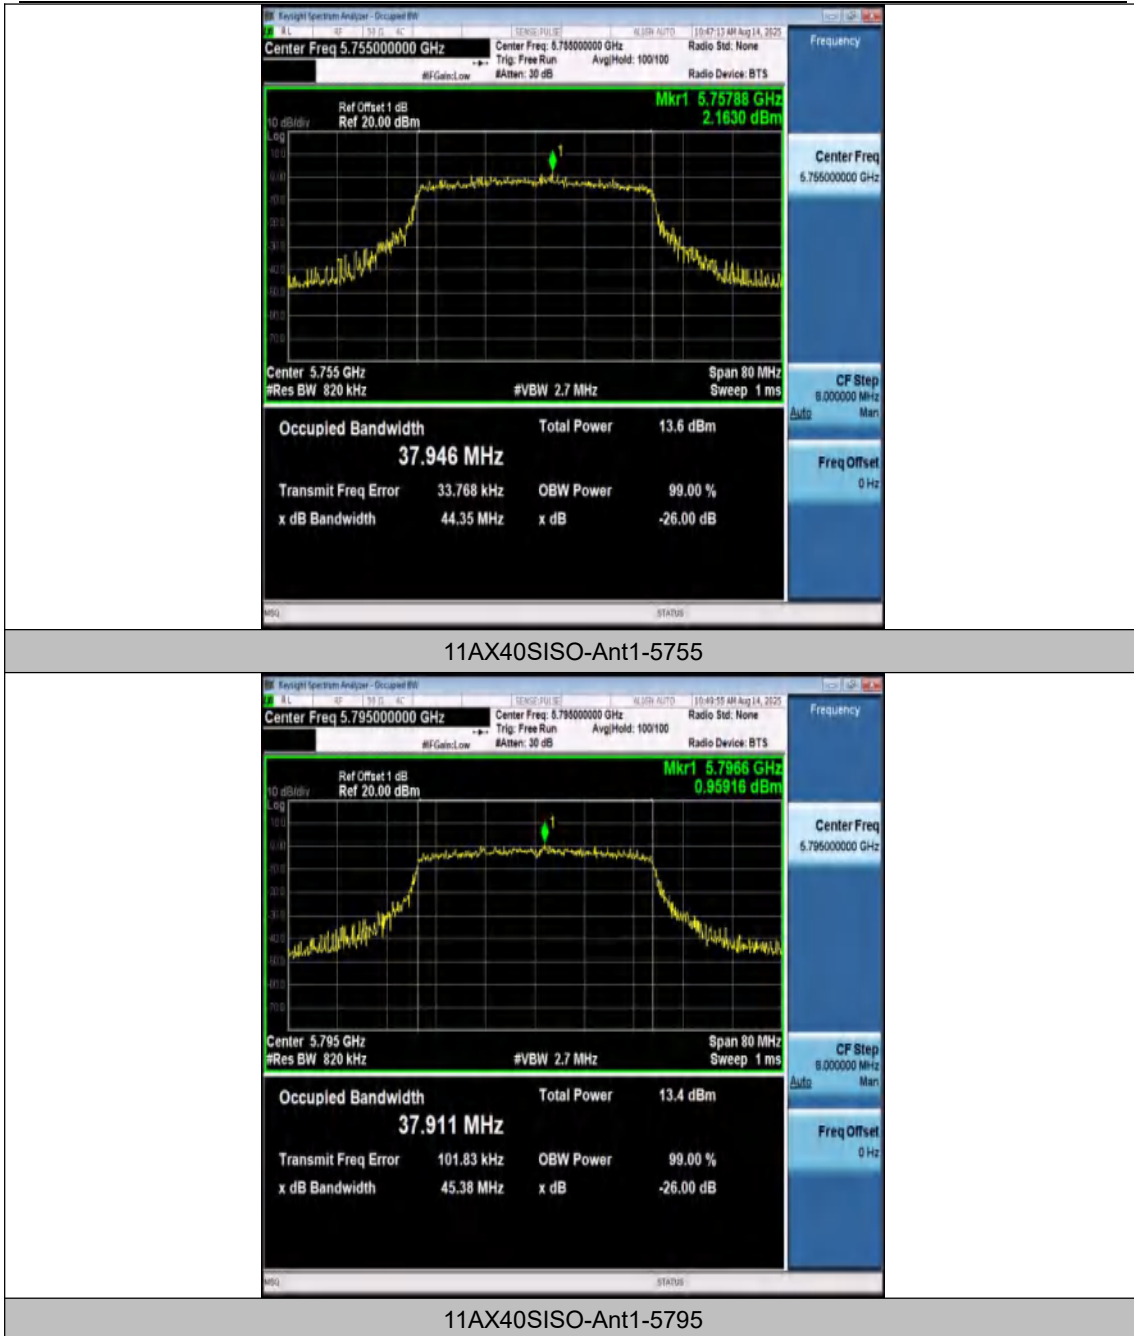

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A3: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency [MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.040	5736.880	5752.920	0.5	PASS
11A	Ant1	5785	16.000	5777.160	5793.160	0.5	PASS
11A	Ant1	5825	15.400	5817.320	5832.720	0.5	PASS
11N20SISO	Ant1	5745	15.360	5737.200	5752.560	0.5	PASS
11N20SISO	Ant1	5785	14.920	5777.640	5792.560	0.5	PASS
11N20SISO	Ant1	5825	15.720	5817.520	5833.240	0.5	PASS
11N40SISO	Ant1	5755	35.120	5737.480	5772.600	0.5	PASS
11N40SISO	Ant1	5795	33.840	5778.760	5812.600	0.5	PASS
11AC20SISO	Ant1	5745	15.600	5737.160	5752.760	0.5	PASS
11AC20SISO	Ant1	5785	17.040	5776.560	5793.600	0.5	PASS
11AC20SISO	Ant1	5825	15.960	5817.240	5833.200	0.5	PASS
11AC40SISO	Ant1	5755	33.760	5737.480	5771.240	0.5	PASS
11AC40SISO	Ant1	5795	35.120	5777.480	5812.600	0.5	PASS
11AX20SISO	Ant1	5745	15.600	5736.920	5752.520	0.5	PASS
11AX20SISO	Ant1	5785	15.600	5777.520	5793.120	0.5	PASS
11AX20SISO	Ant1	5825	18.200	5815.880	5834.080	0.5	PASS
11AX40SISO	Ant1	5755	34.080	5738.440	5772.520	0.5	PASS
11AX40SISO	Ant1	5795	35.120	5777.480	5812.600	0.5	PASS

Test Graphs B4



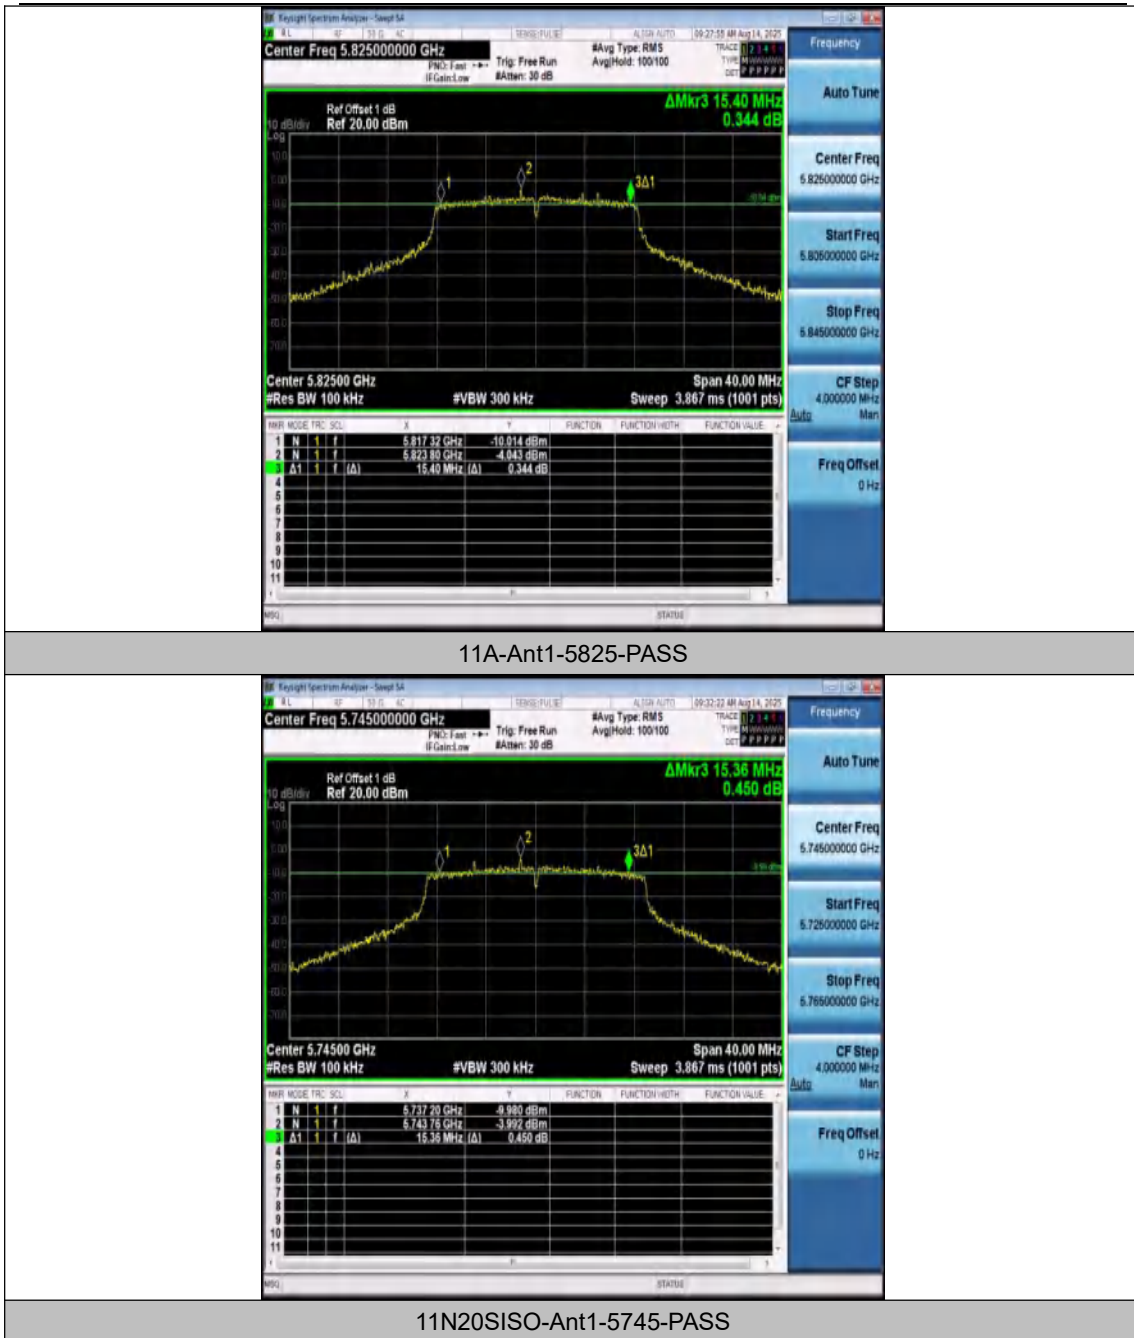










Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

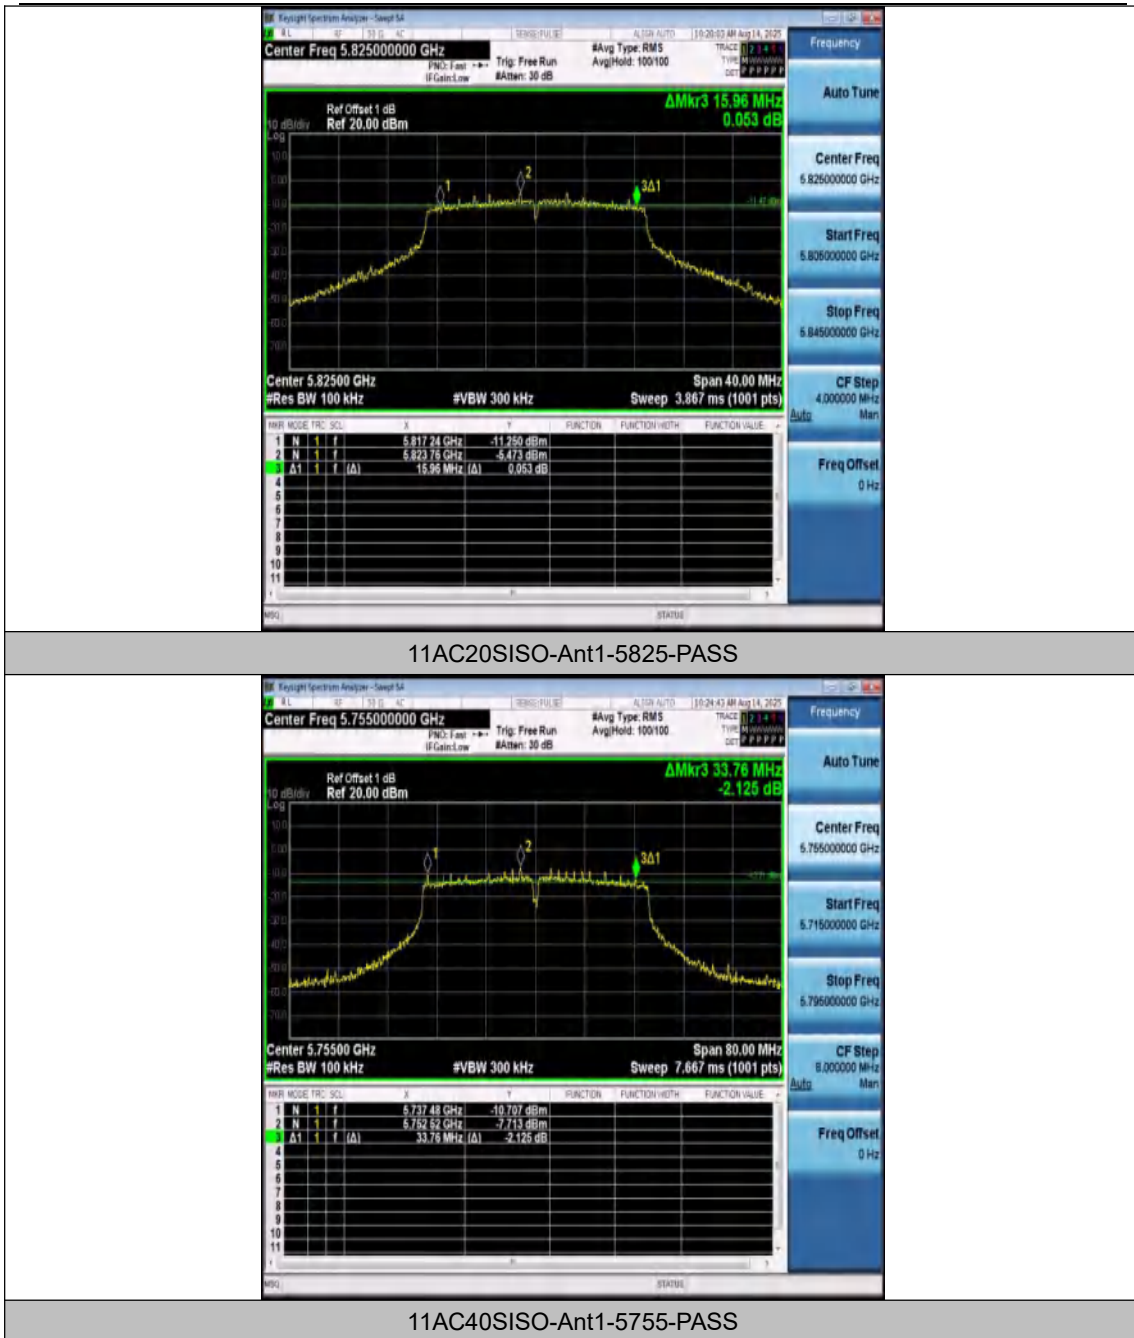

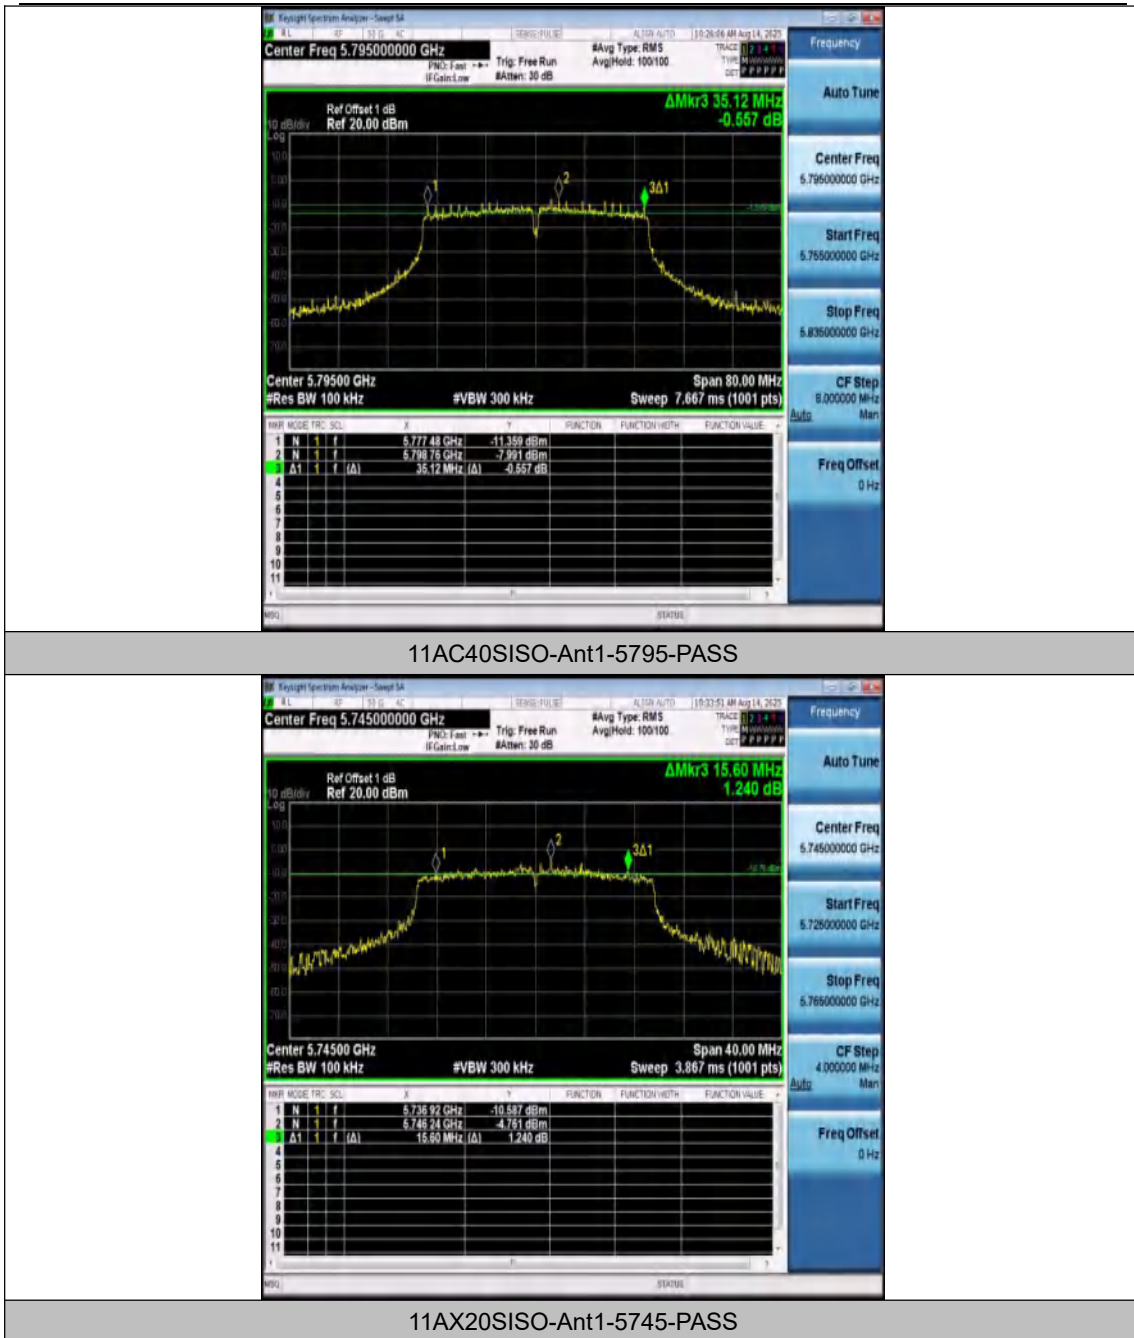

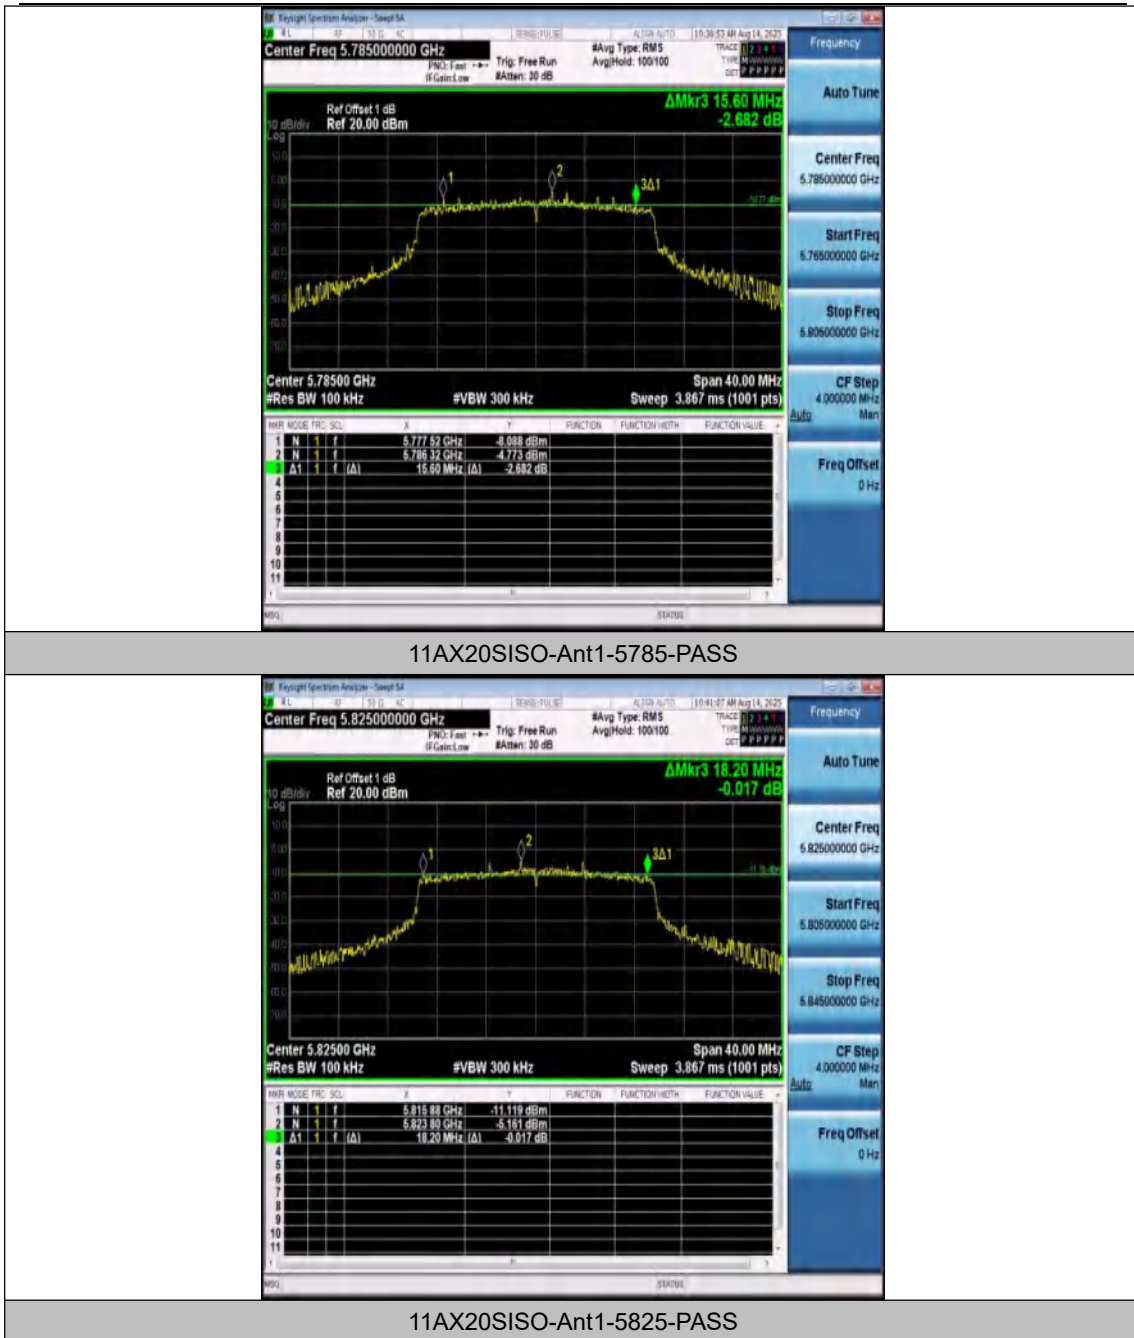

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	2.04	2.26	90.27	0.44	0.49
11A	Ant1	5220	2.04	2.26	90.27	0.44	0.49
11A	Ant1	5240	2.03	2.18	93.12	0.31	0.49
11A	Ant1	5745	2.04	2.27	89.87	0.46	0.49
11A	Ant1	5785	2.03	2.22	91.44	0.39	0.49
11A	Ant1	5825	2.03	2.21	91.86	0.37	0.49
11N20SISO	Ant1	5180	1.89	2.02	93.56	0.29	0.53
11N20SISO	Ant1	5220	1.89	2.15	87.91	0.56	0.53
11N20SISO	Ant1	5240	1.89	2.10	90.00	0.46	0.53
11N20SISO	Ant1	5745	1.90	2.55	74.51	1.28	0.53
11N20SISO	Ant1	5785	1.90	2.01	94.53	0.24	0.53
11N20SISO	Ant1	5825	1.89	2.11	89.57	0.48	0.53
11N40SISO	Ant1	5190	0.93	1.09	85.32	0.69	1.08
11N40SISO	Ant1	5230	0.93	1.17	79.49	1.00	1.08
11N40SISO	Ant1	5755	0.93	1.15	80.87	0.92	1.08
11N40SISO	Ant1	5795	0.93	2.15	43.26	3.64	1.08
11AC20SISO	Ant1	5180	1.90	2.03	93.60	0.29	0.53
11AC20SISO	Ant1	5220	1.90	2.10	90.48	0.43	0.53
11AC20SISO	Ant1	5240	1.90	2.14	88.79	0.52	0.53
11AC20SISO	Ant1	5745	1.90	2.12	89.62	0.48	0.53
11AC20SISO	Ant1	5785	1.90	2.07	91.79	0.37	0.53
11AC20SISO	Ant1	5825	1.90	2.12	89.62	0.48	0.53
11AC40SISO	Ant1	5190	0.93	1.10	84.55	0.73	1.08
11AC40SISO	Ant1	5230	0.94	1.16	81.03	0.91	1.06
11AC40SISO	Ant1	5755	0.93	1.17	79.49	1.00	1.08
11AC40SISO	Ant1	5795	0.94	1.20	78.33	1.06	1.06
11AX20SISO	Ant1	5180	1.45	1.57	92.36	0.35	0.69
11AX20SISO	Ant1	5220	1.46	1.64	89.02	0.51	0.68
11AX20SISO	Ant1	5240	1.46	1.68	86.90	0.61	0.68
11AX20SISO	Ant1	5745	1.46	1.63	89.57	0.48	0.68
11AX20SISO	Ant1	5785	1.46	1.68	86.90	0.61	0.68
11AX20SISO	Ant1	5825	1.46	1.67	87.43	0.58	0.68
11AX40SISO	Ant1	5190	0.76	0.94	80.85	0.92	1.32
11AX40SISO	Ant1	5230	0.76	0.94	80.85	0.92	1.32
11AX40SISO	Ant1	5755	0.76	1.08	70.37	1.53	1.32
11AX40SISO	Ant1	5795	0.76	0.99	76.77	1.15	1.32


Test Graphs

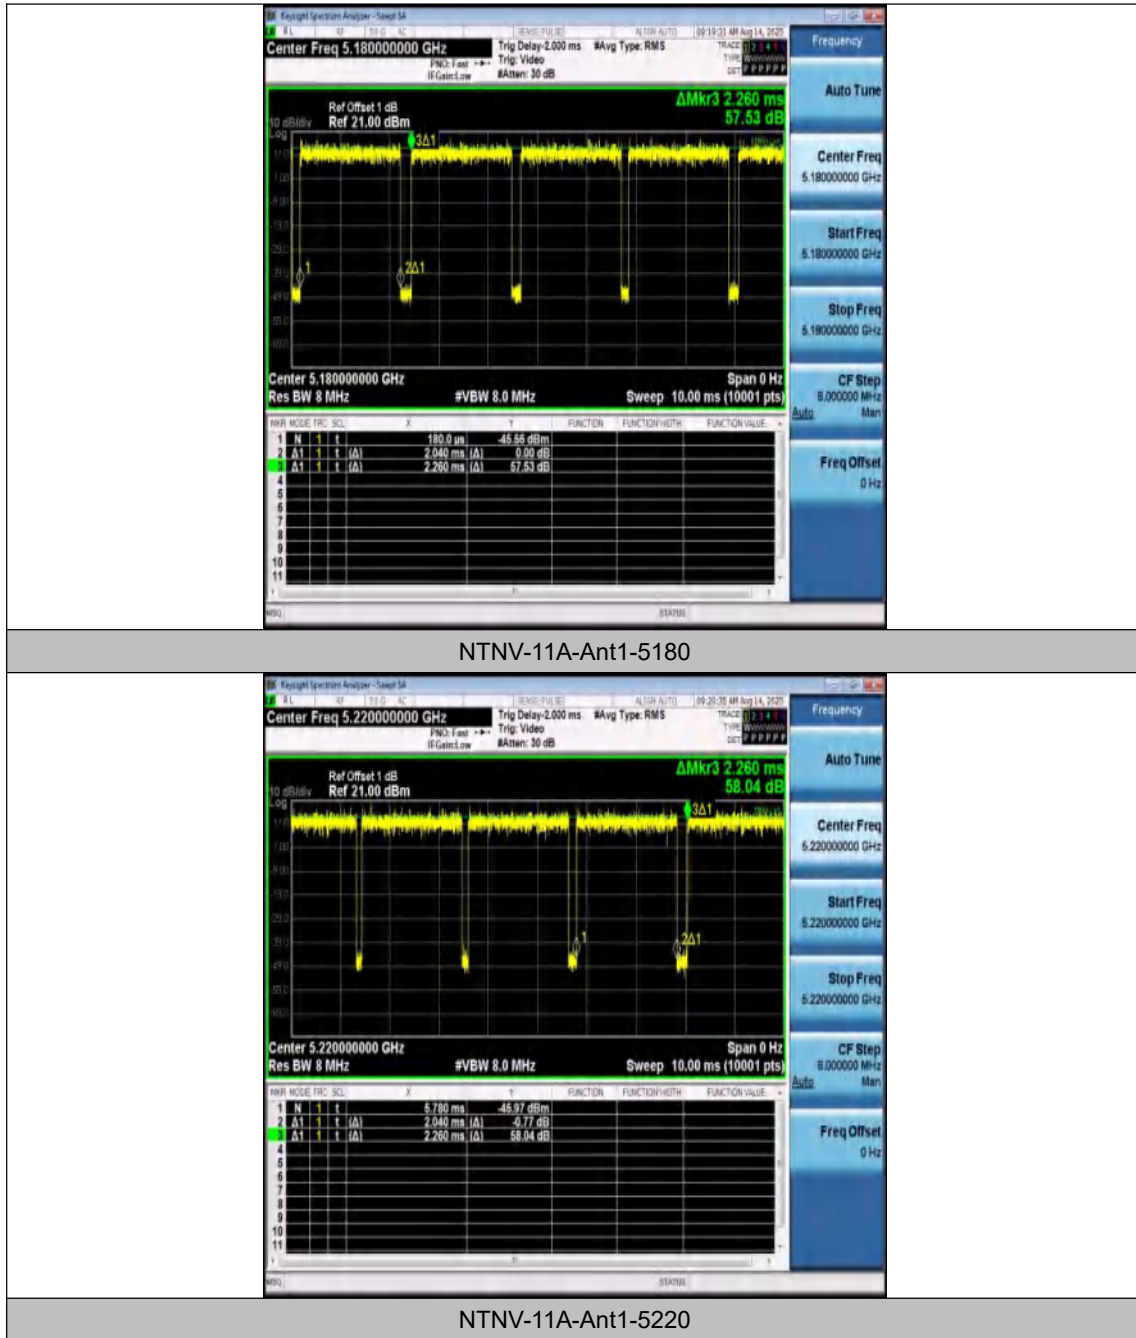



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

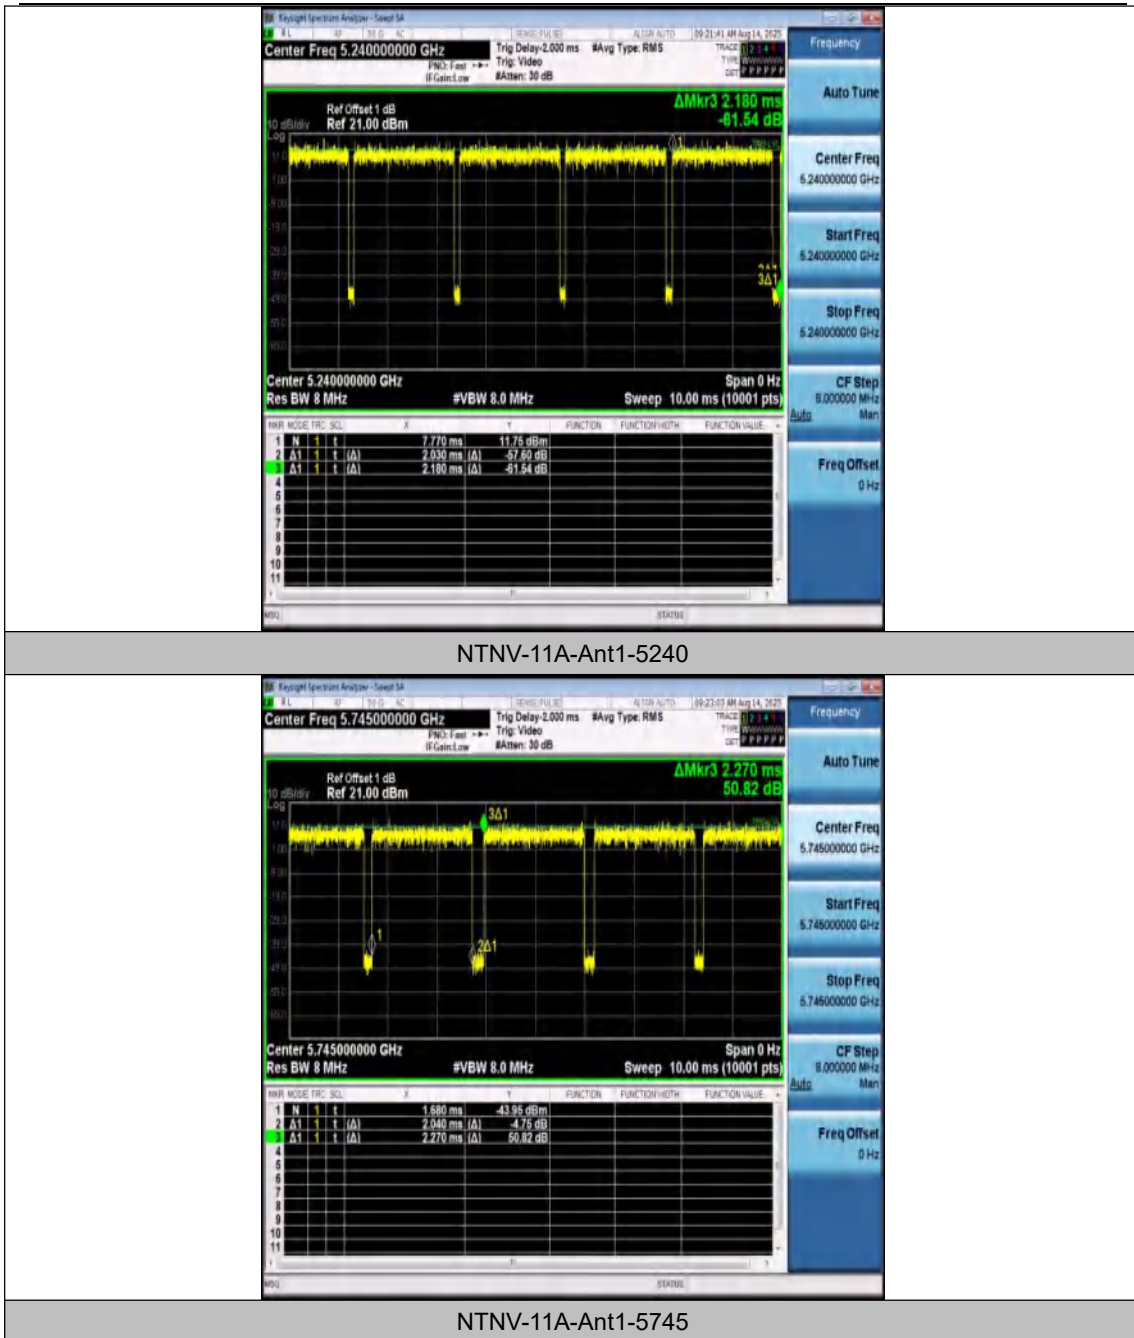

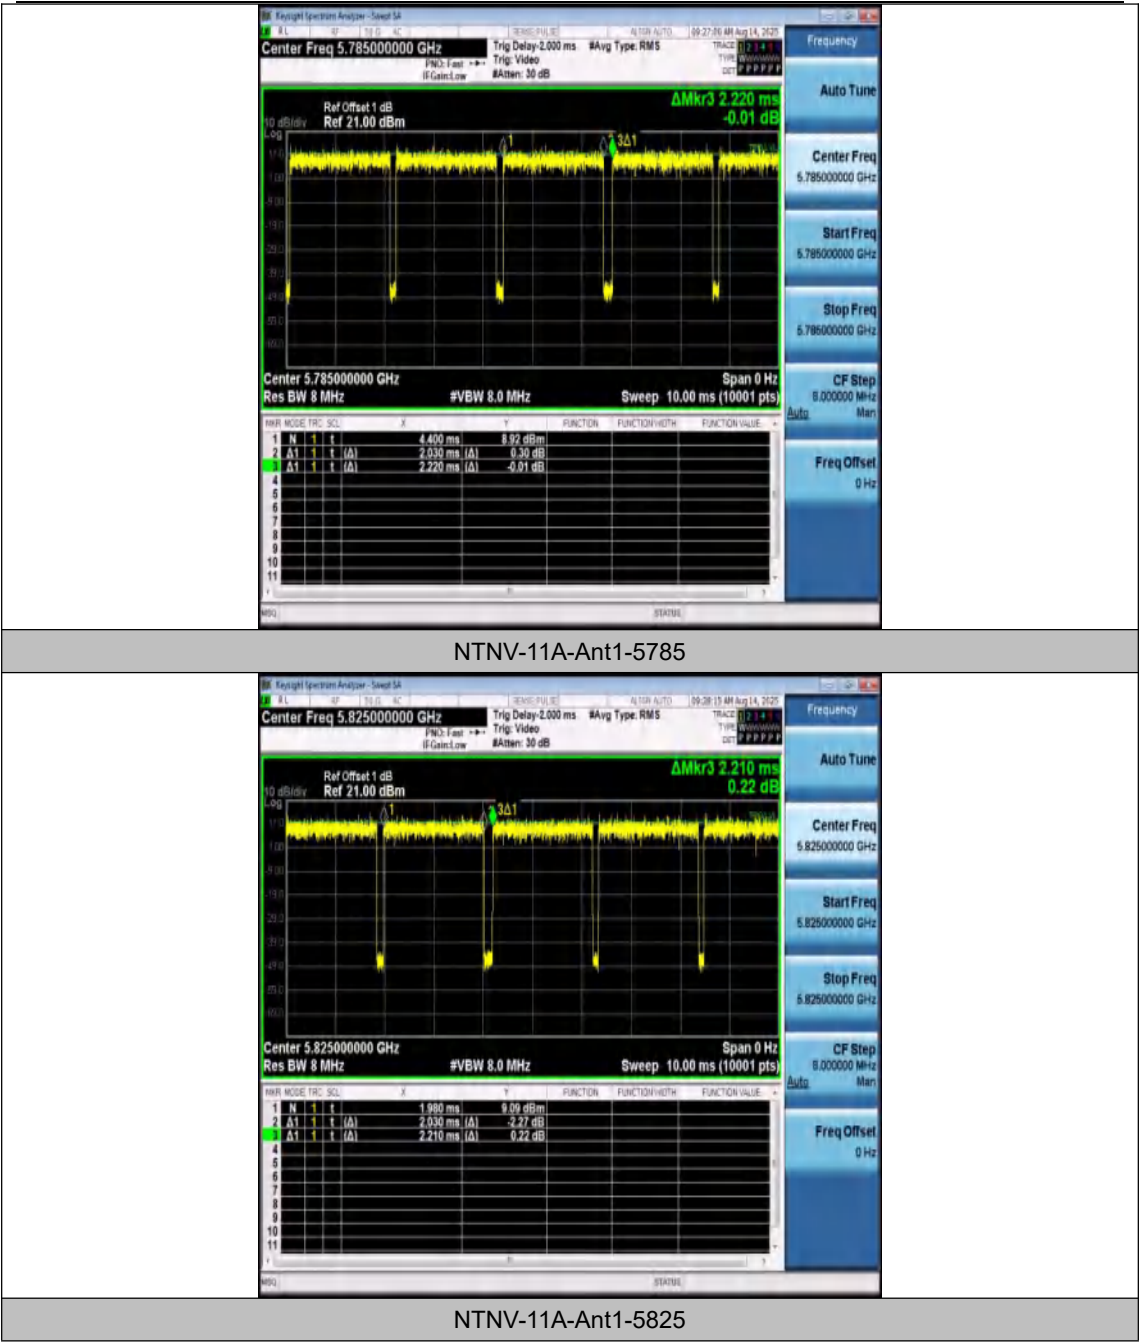


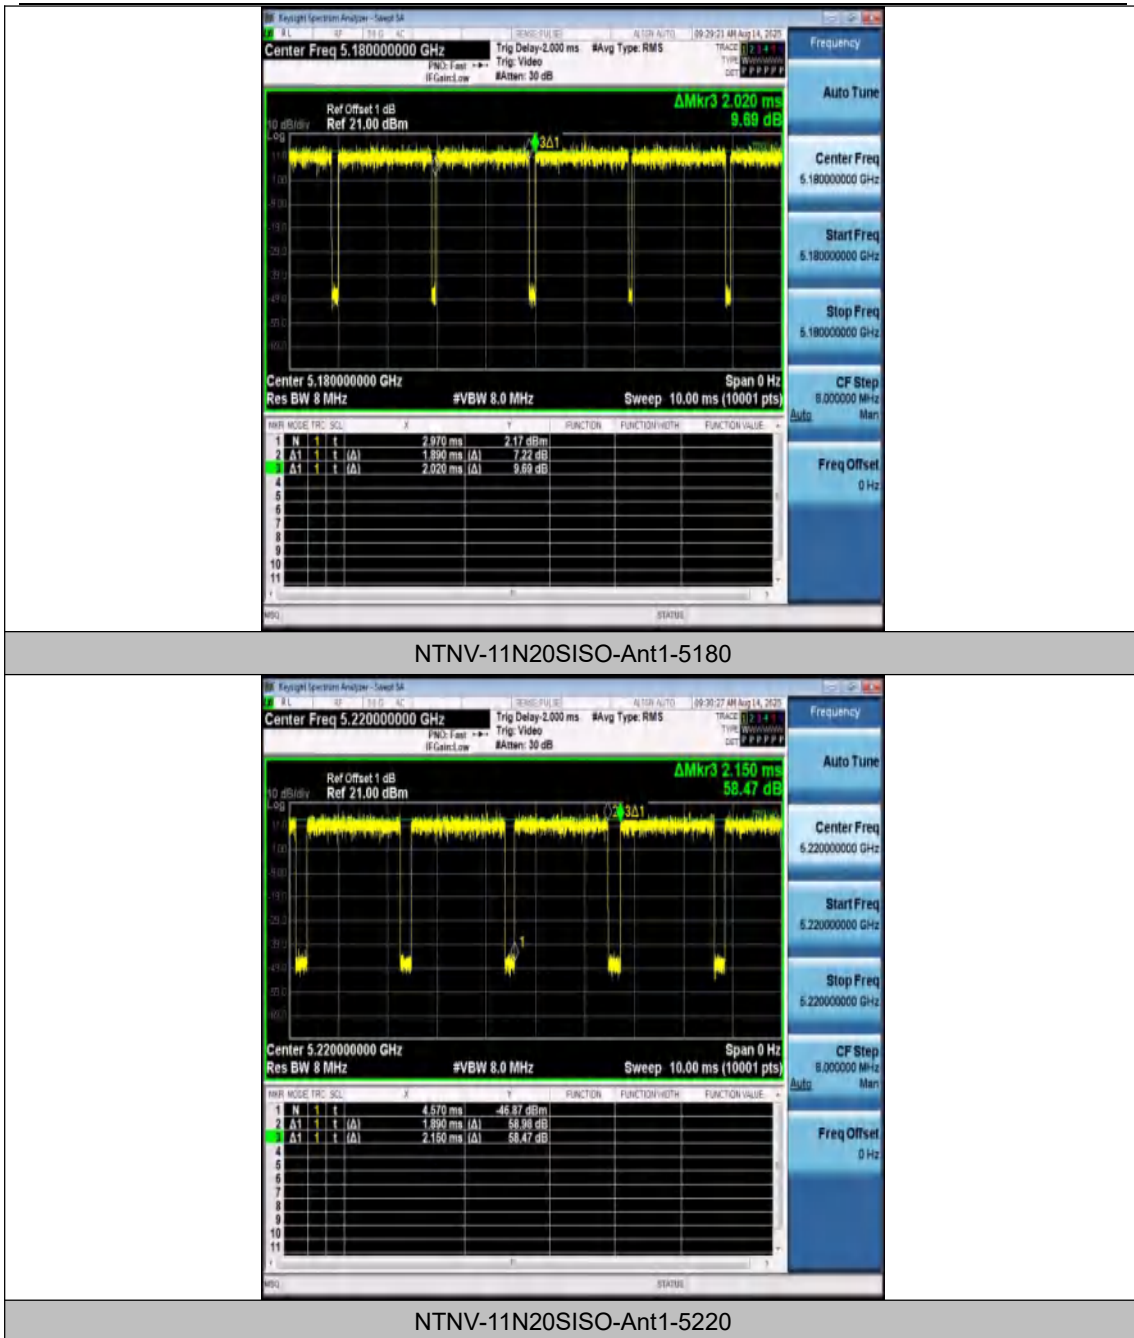


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

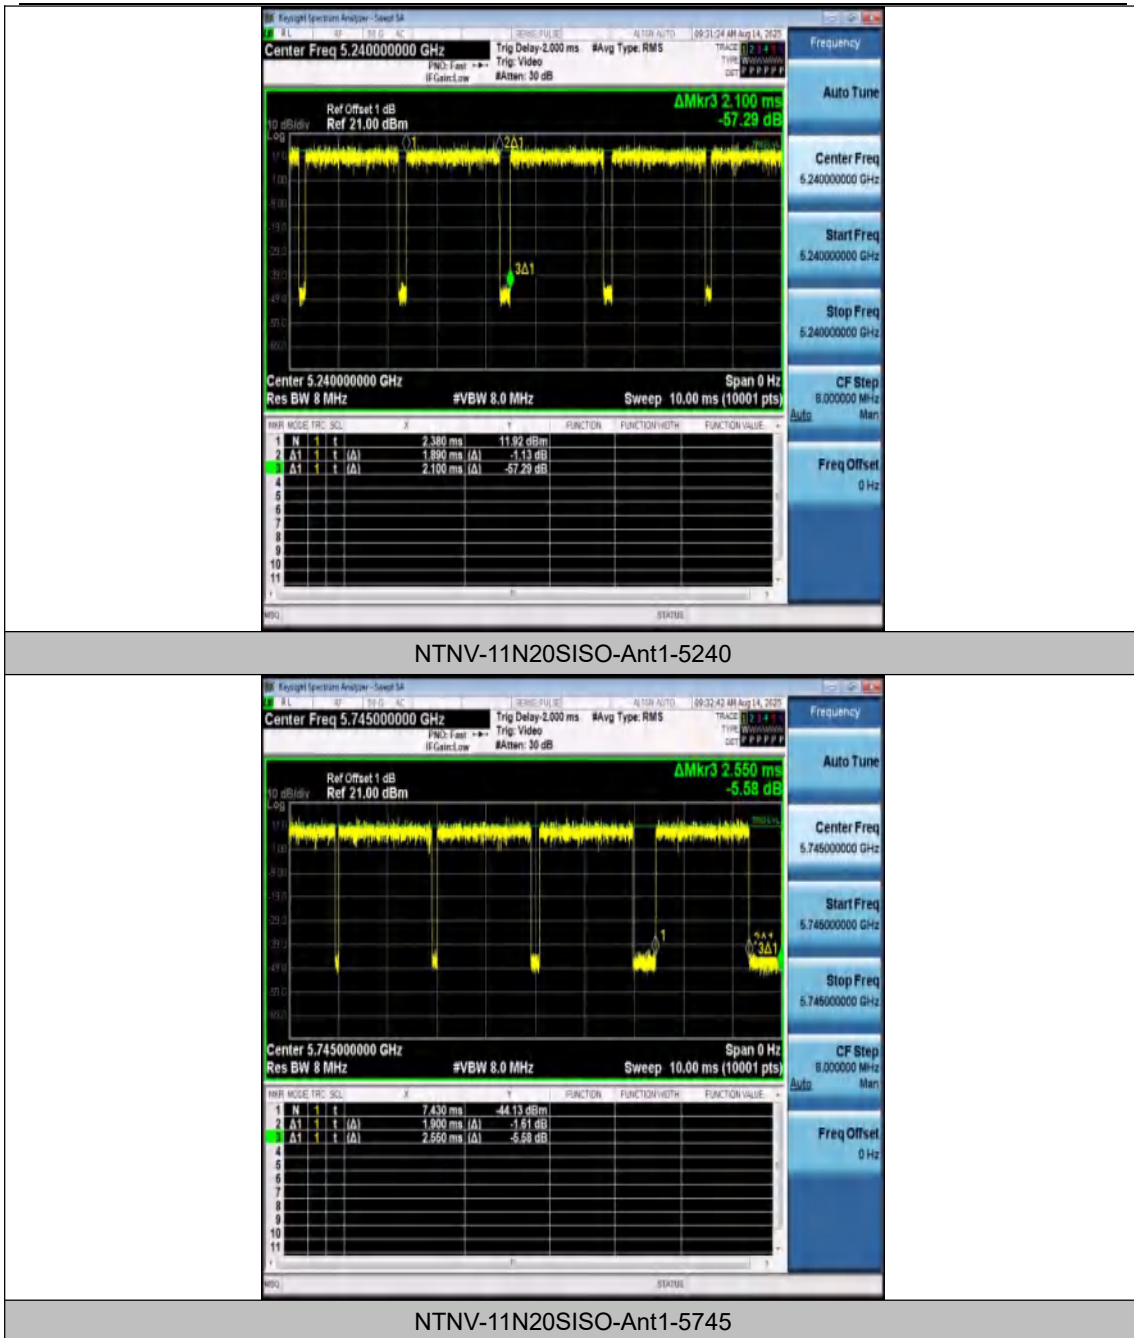


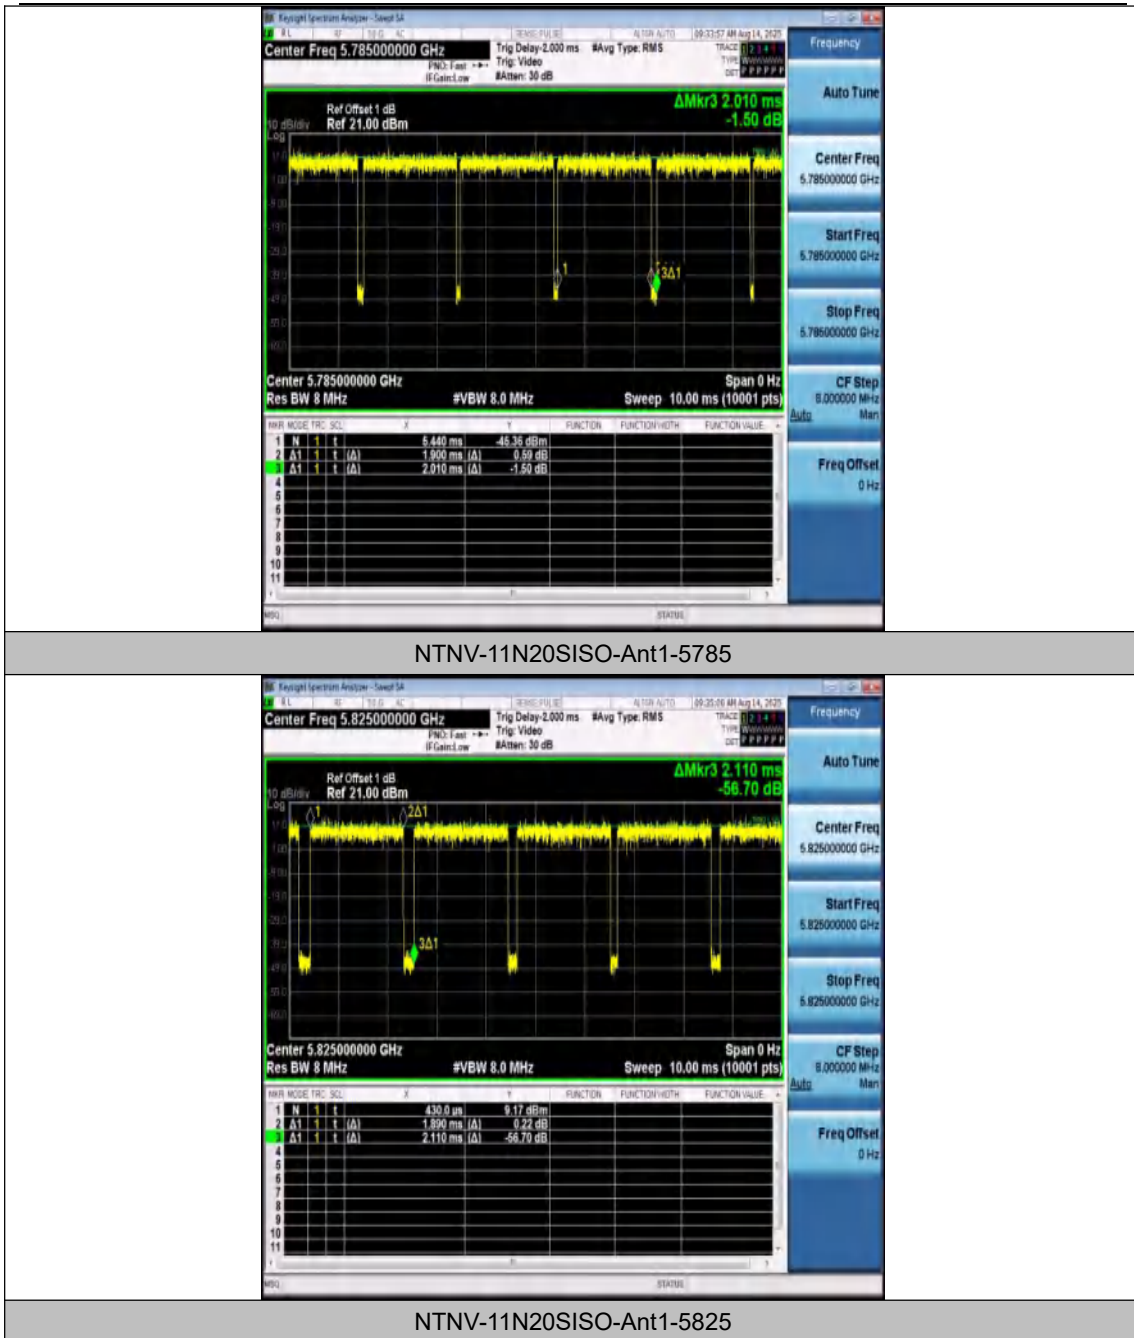

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

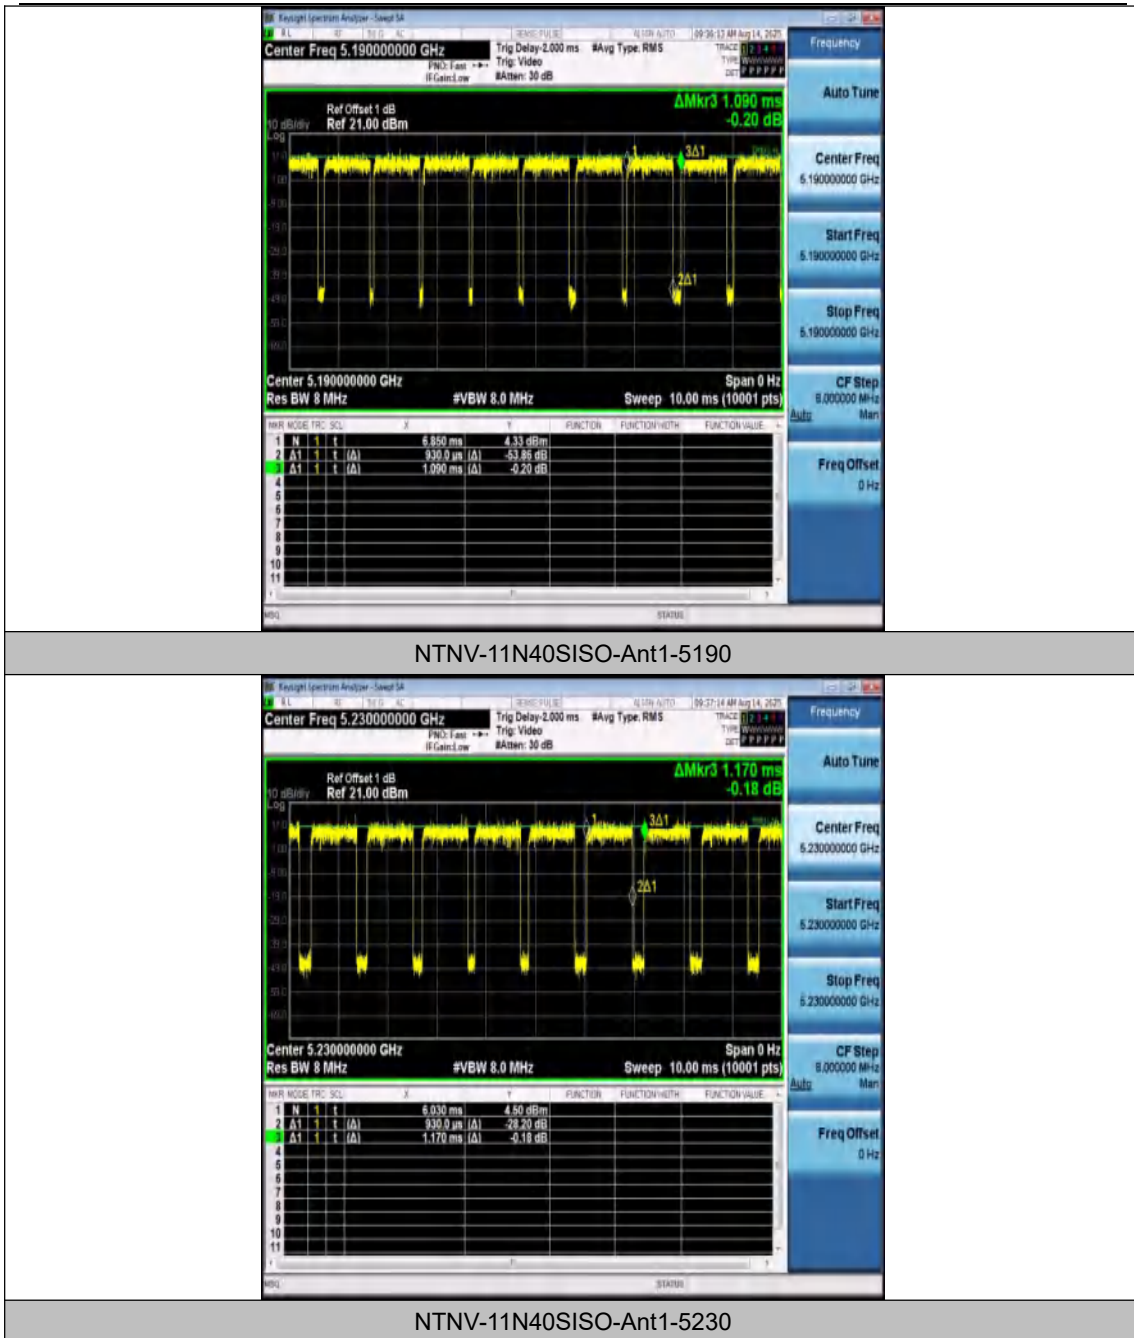



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

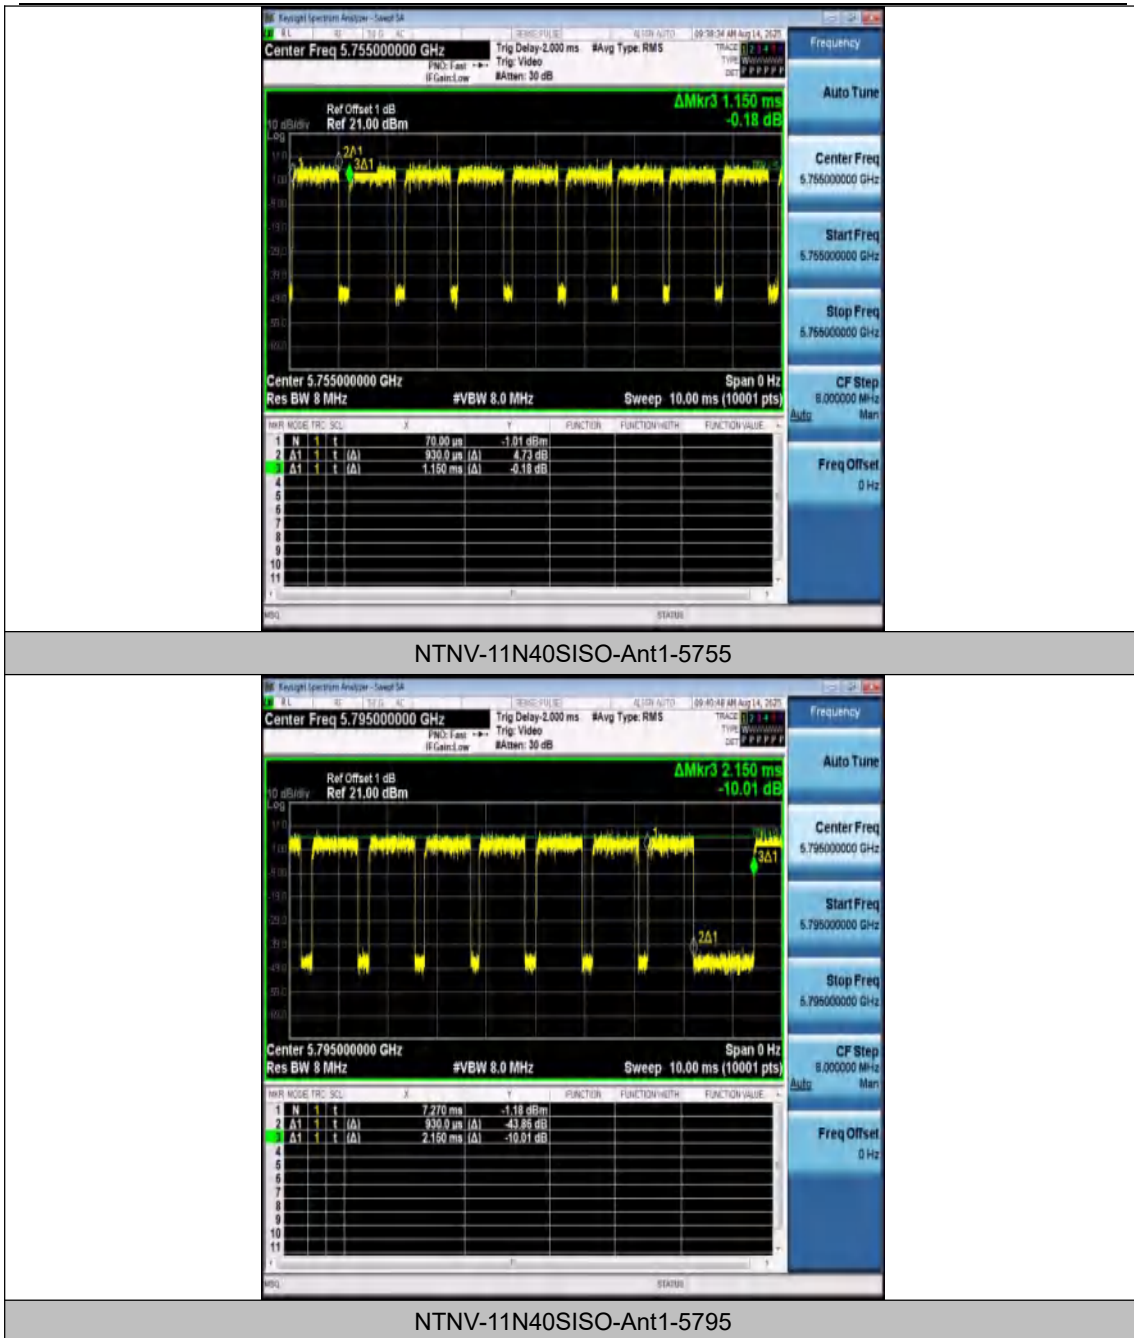


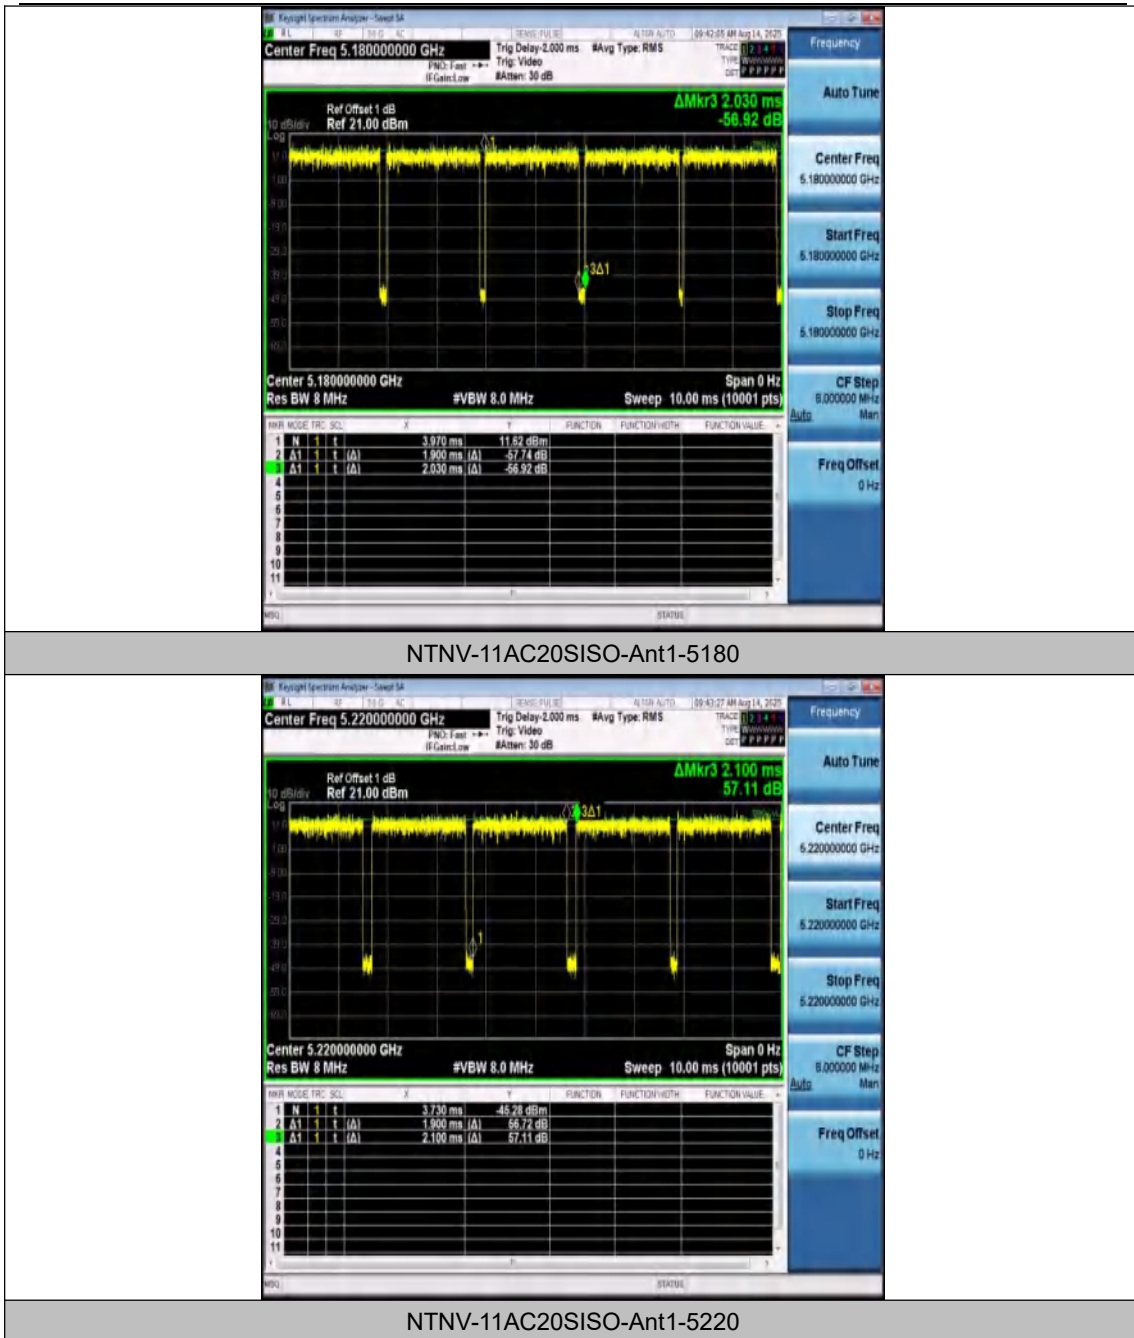

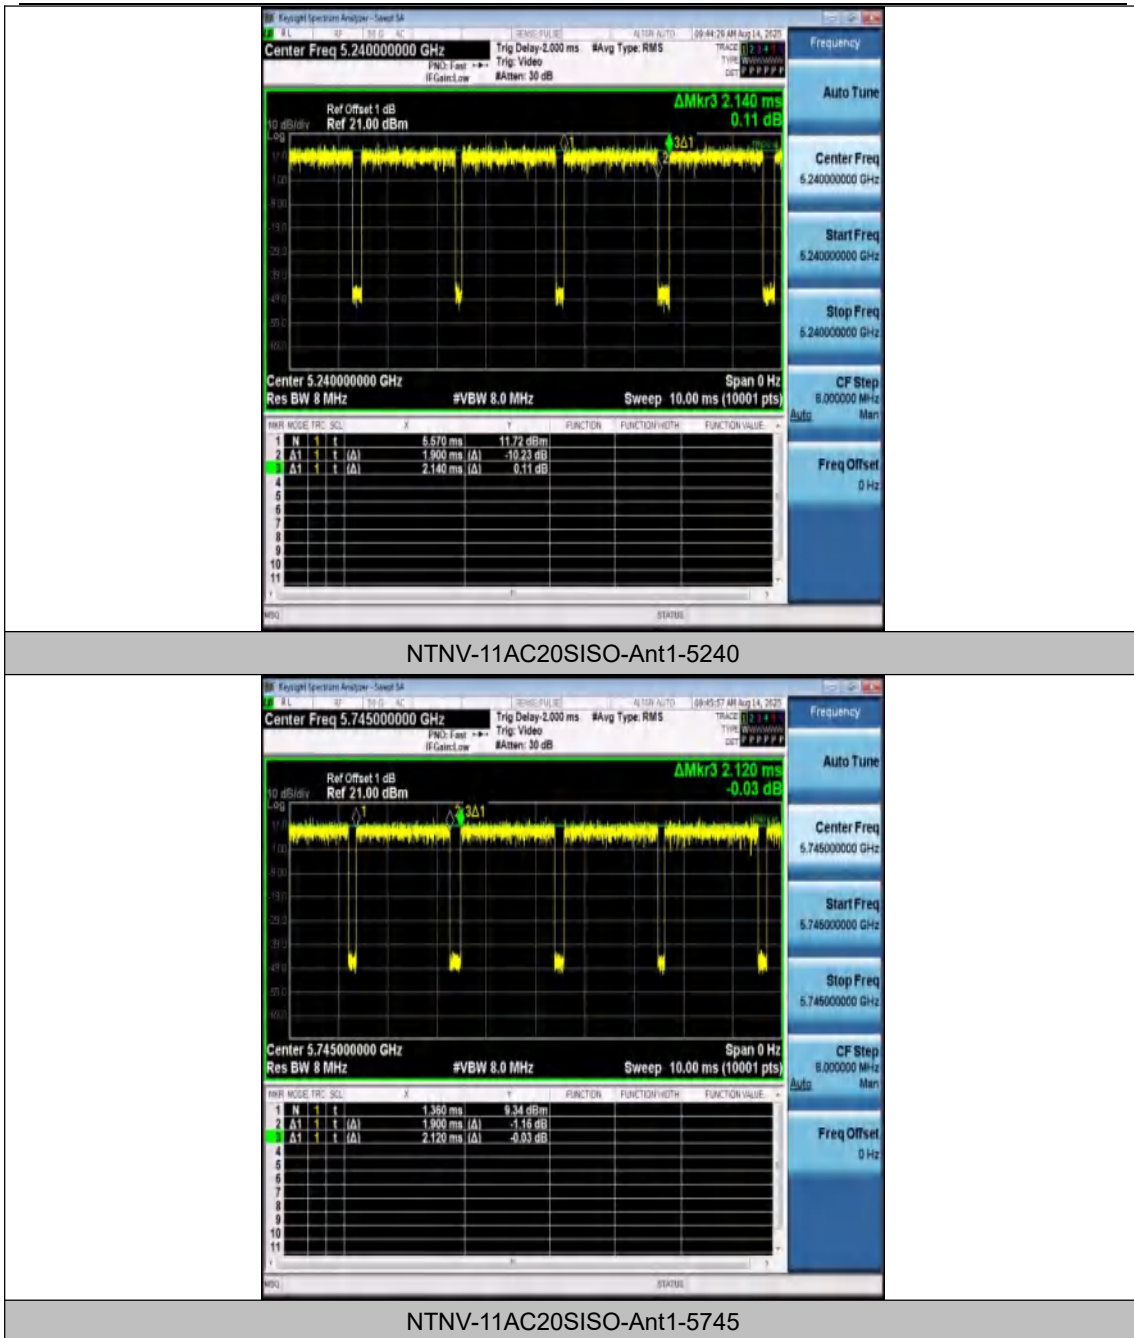

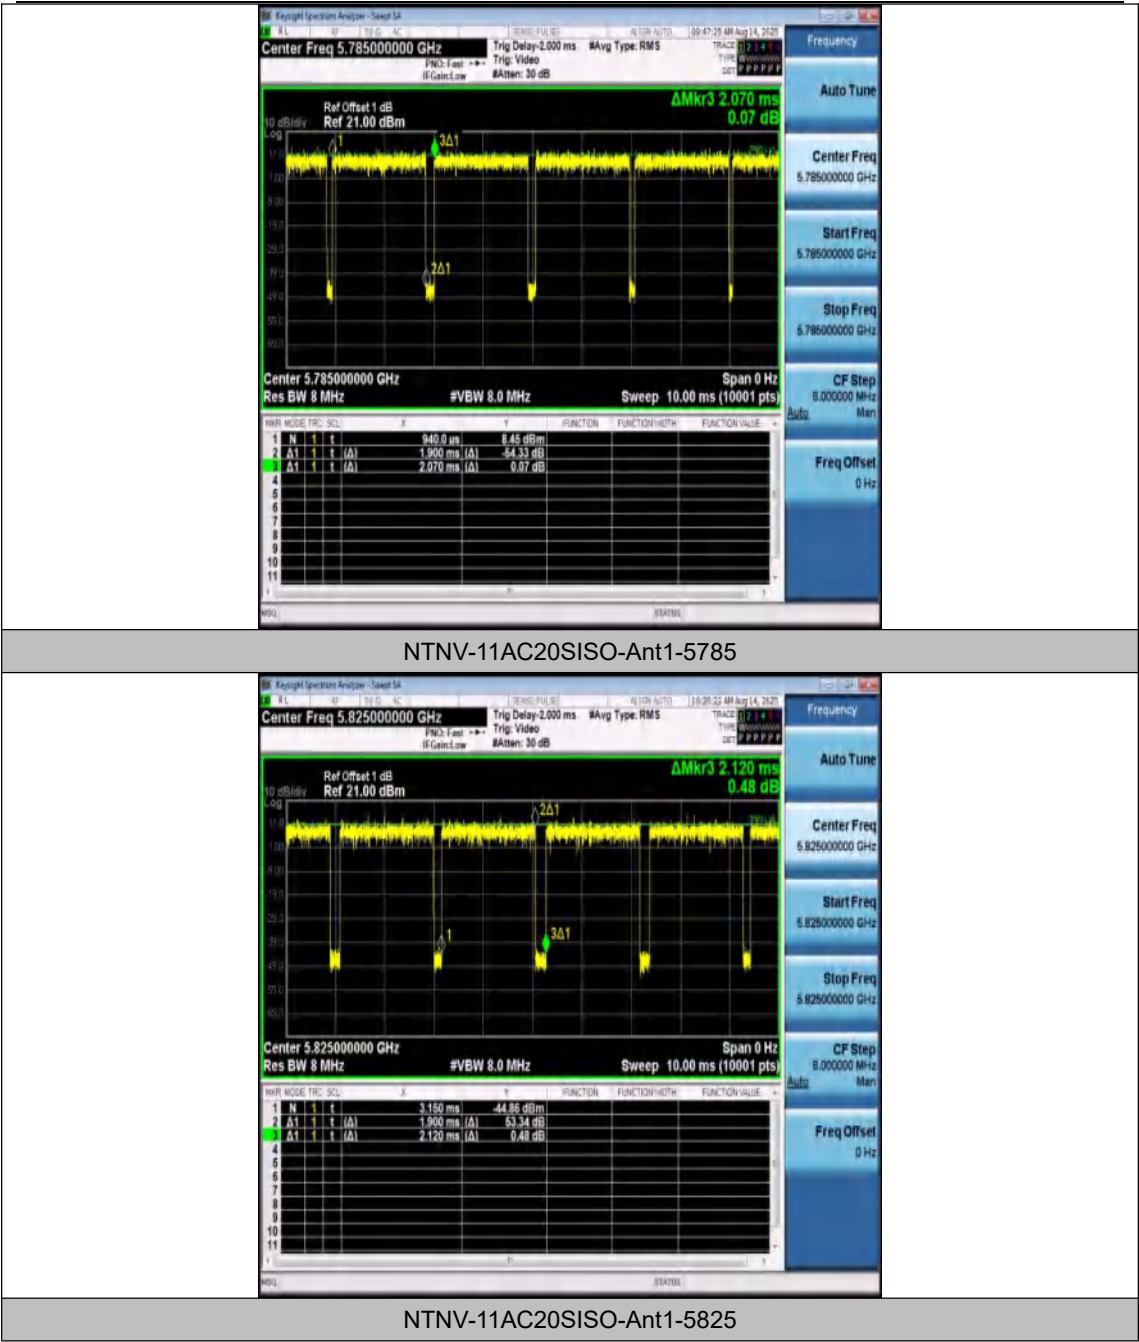

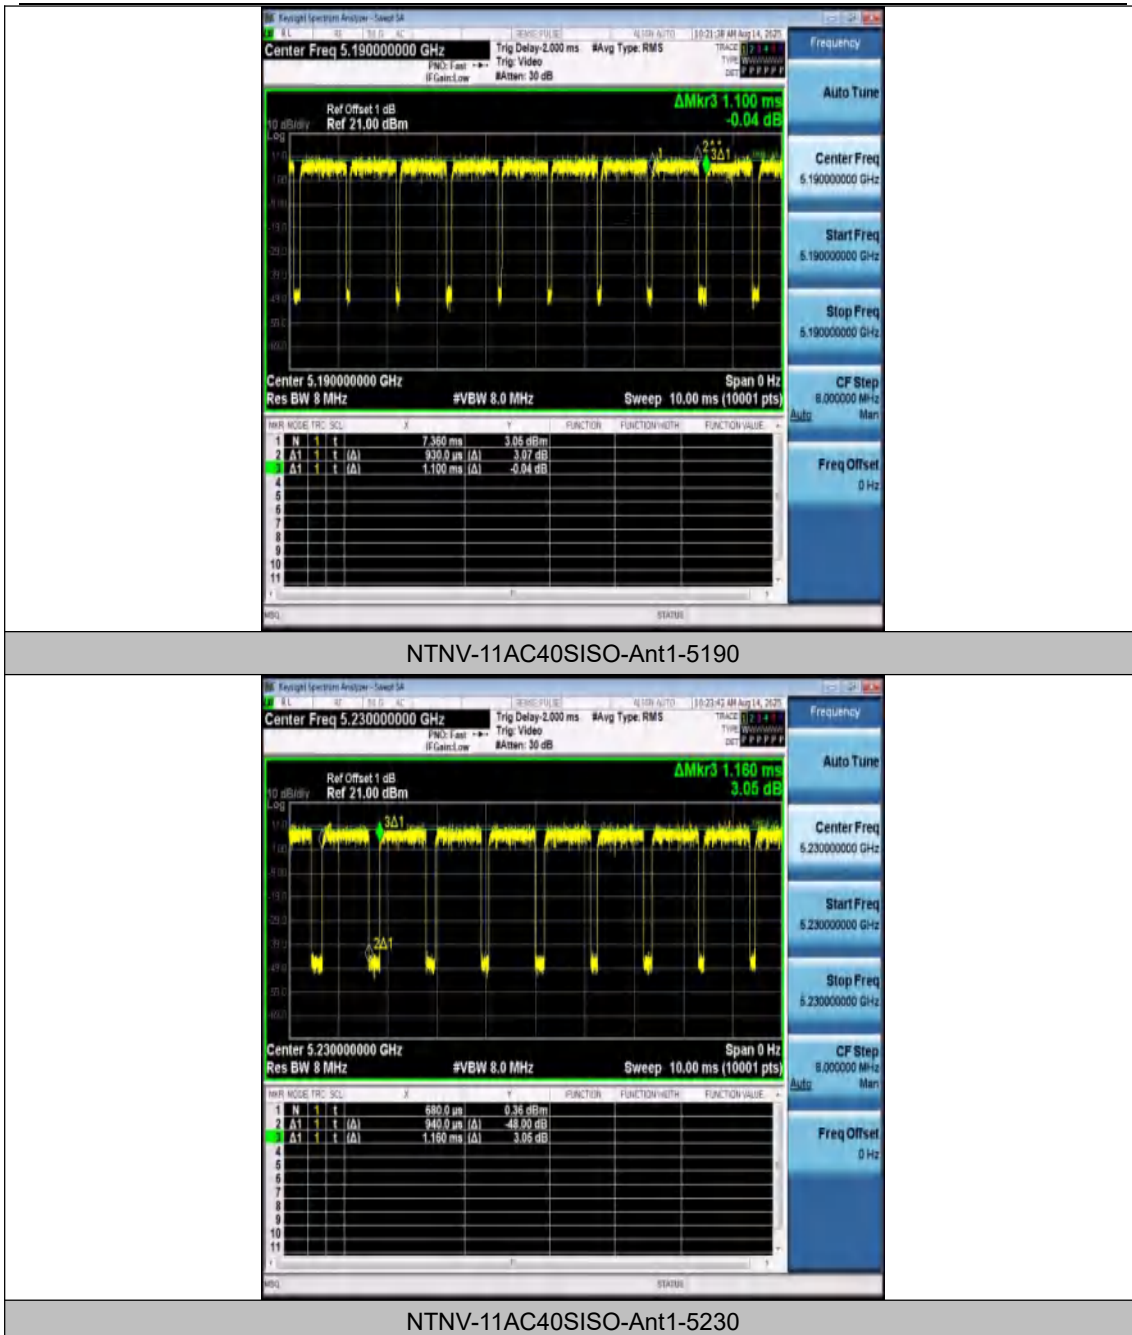


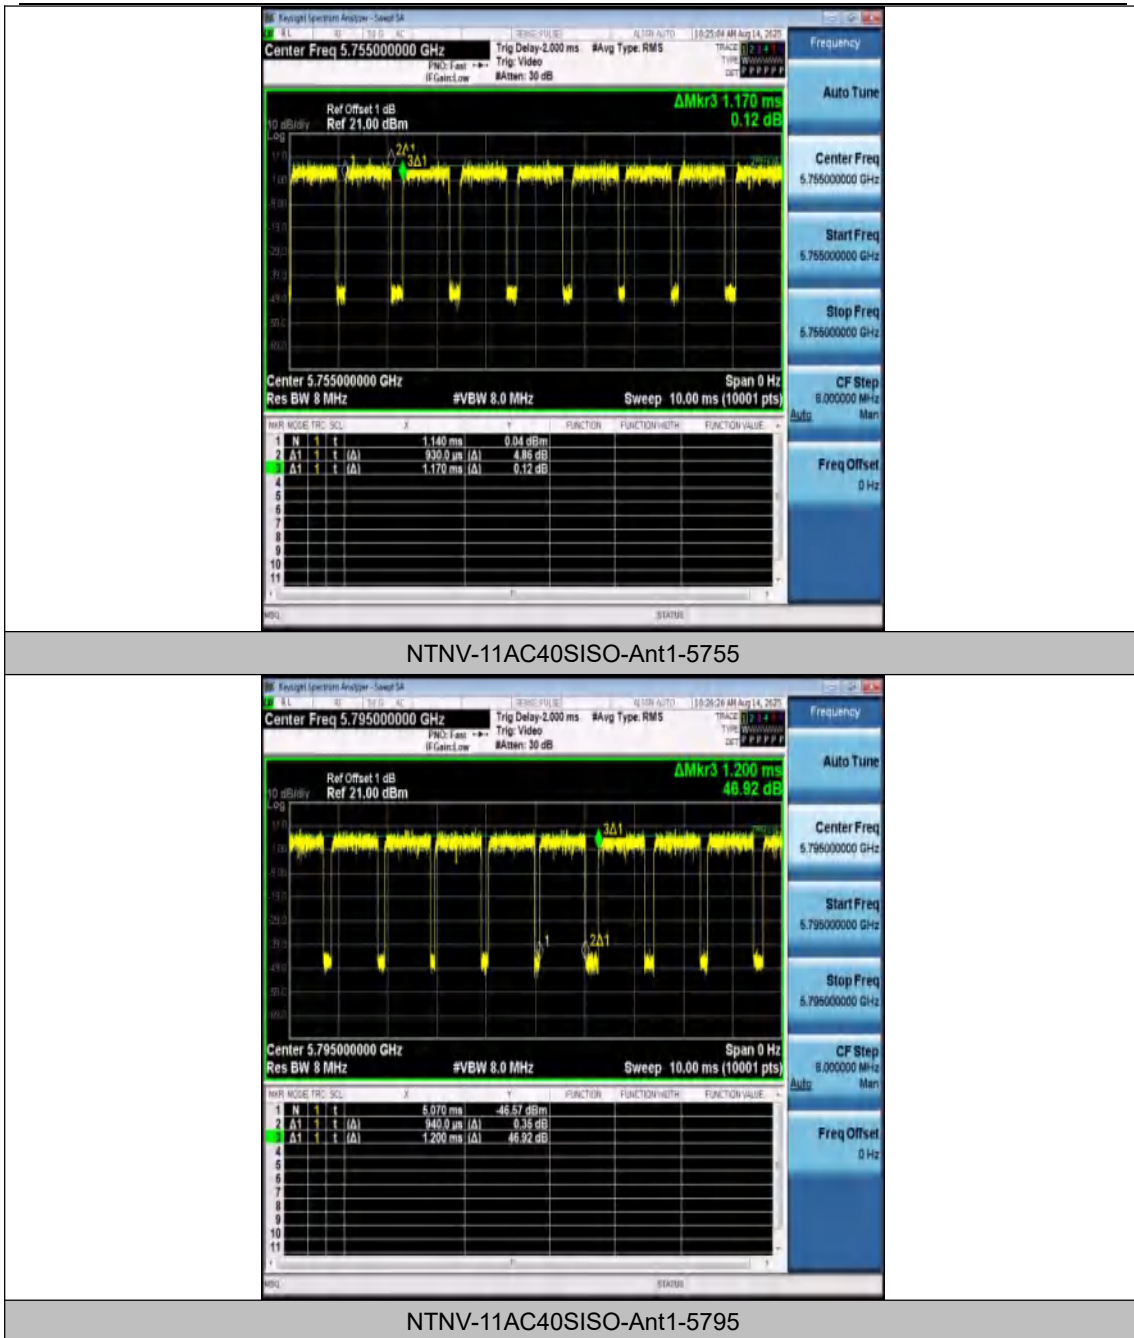



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

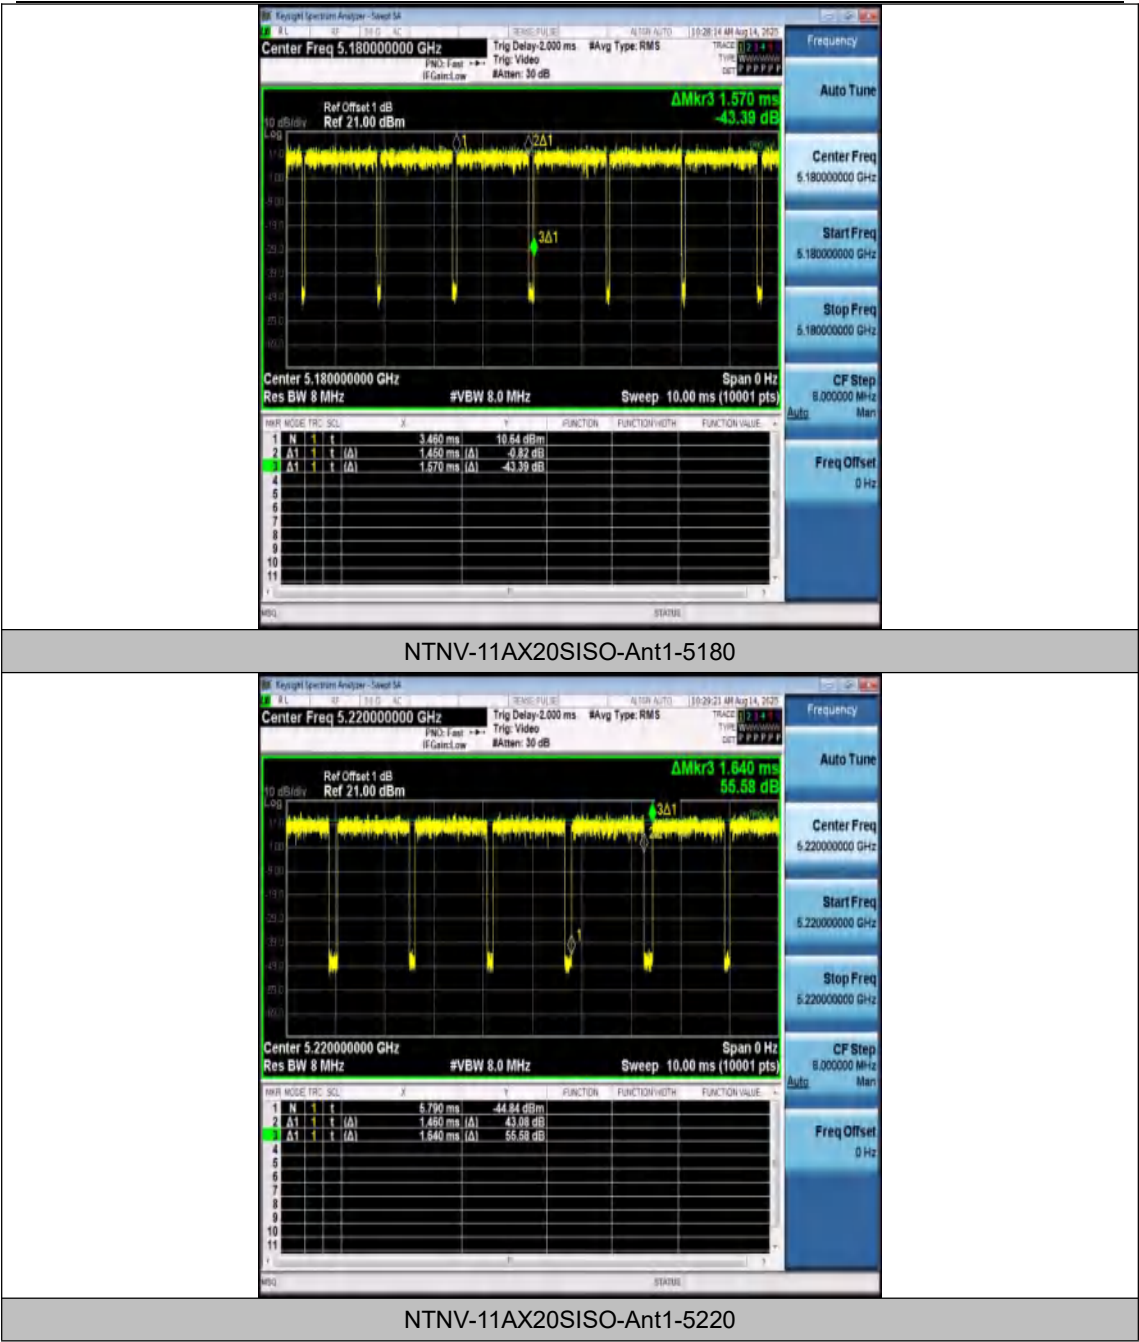

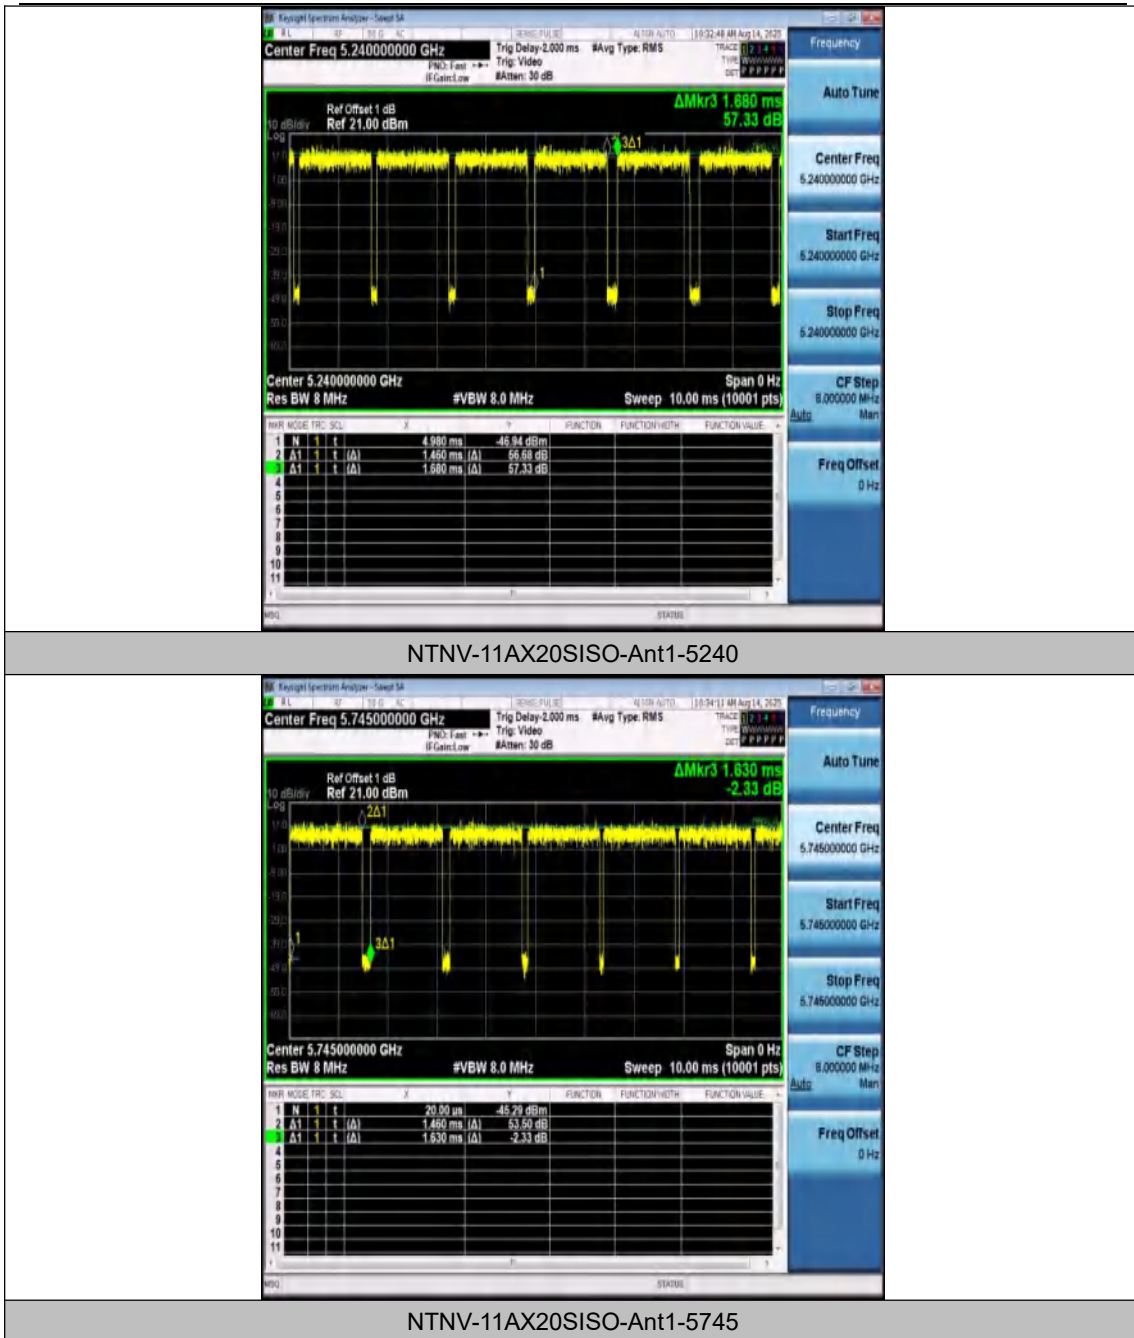

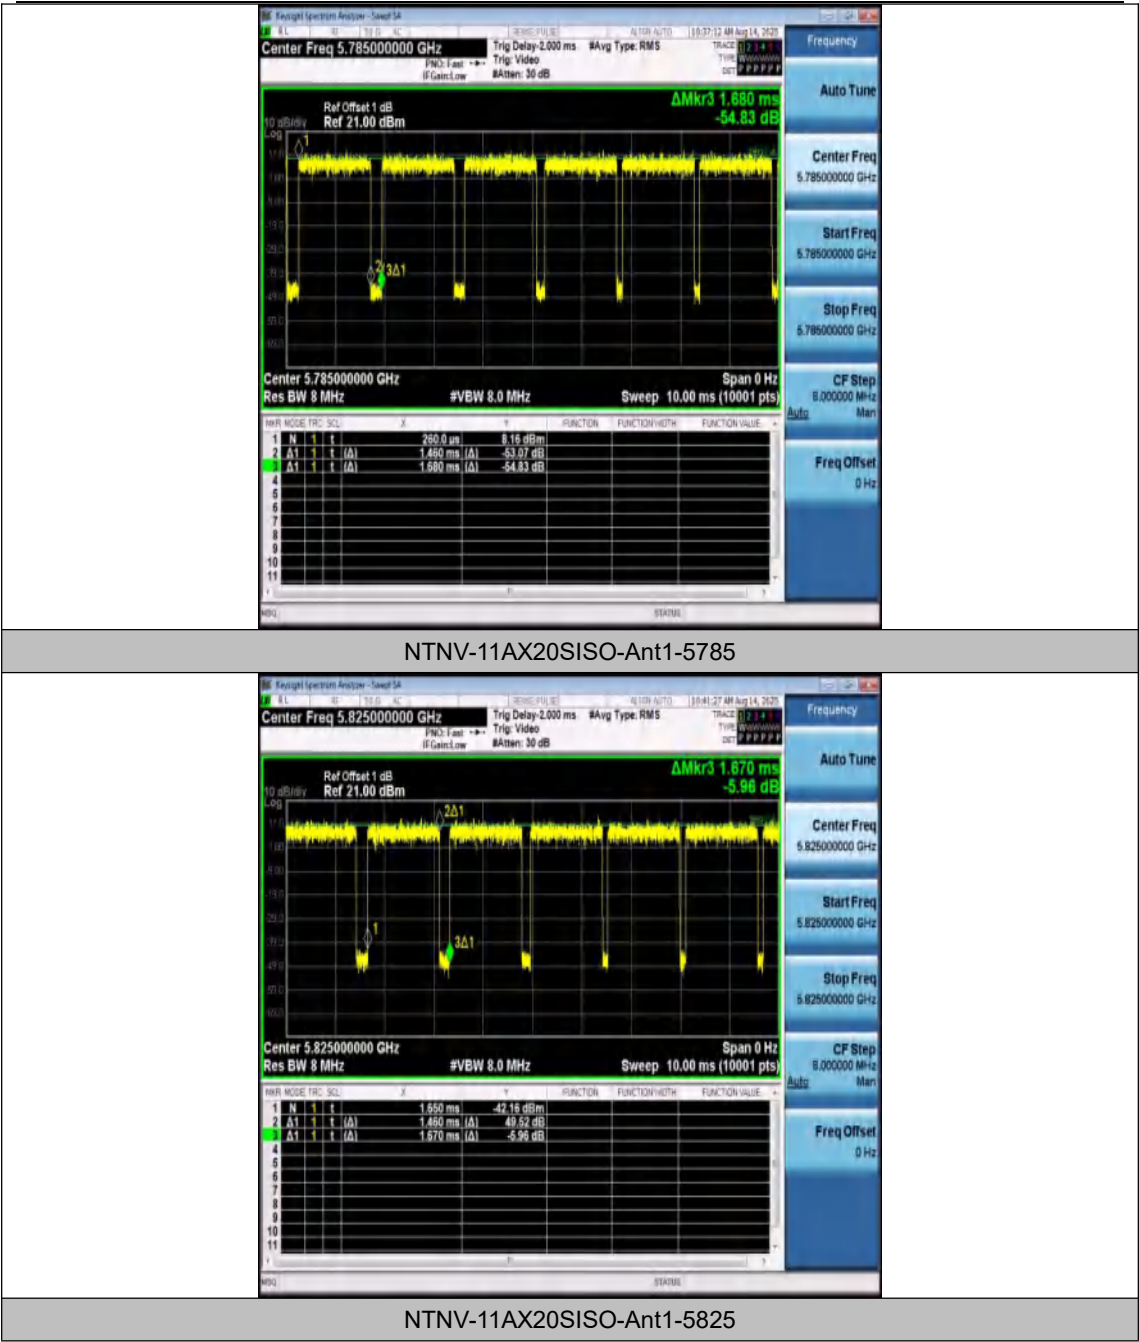

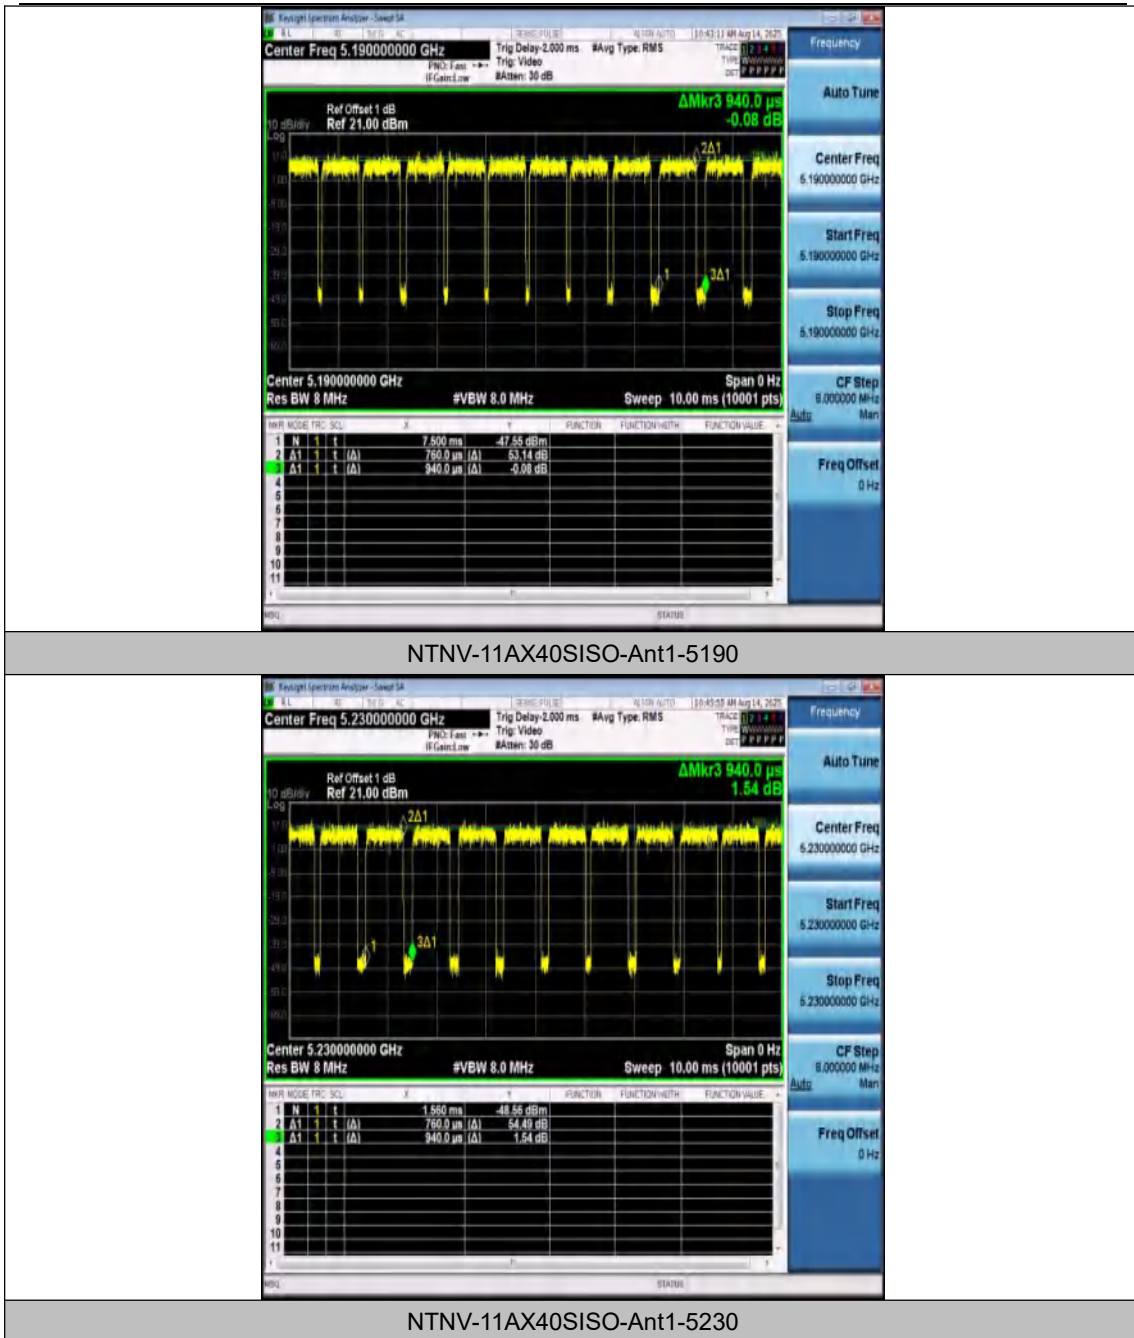

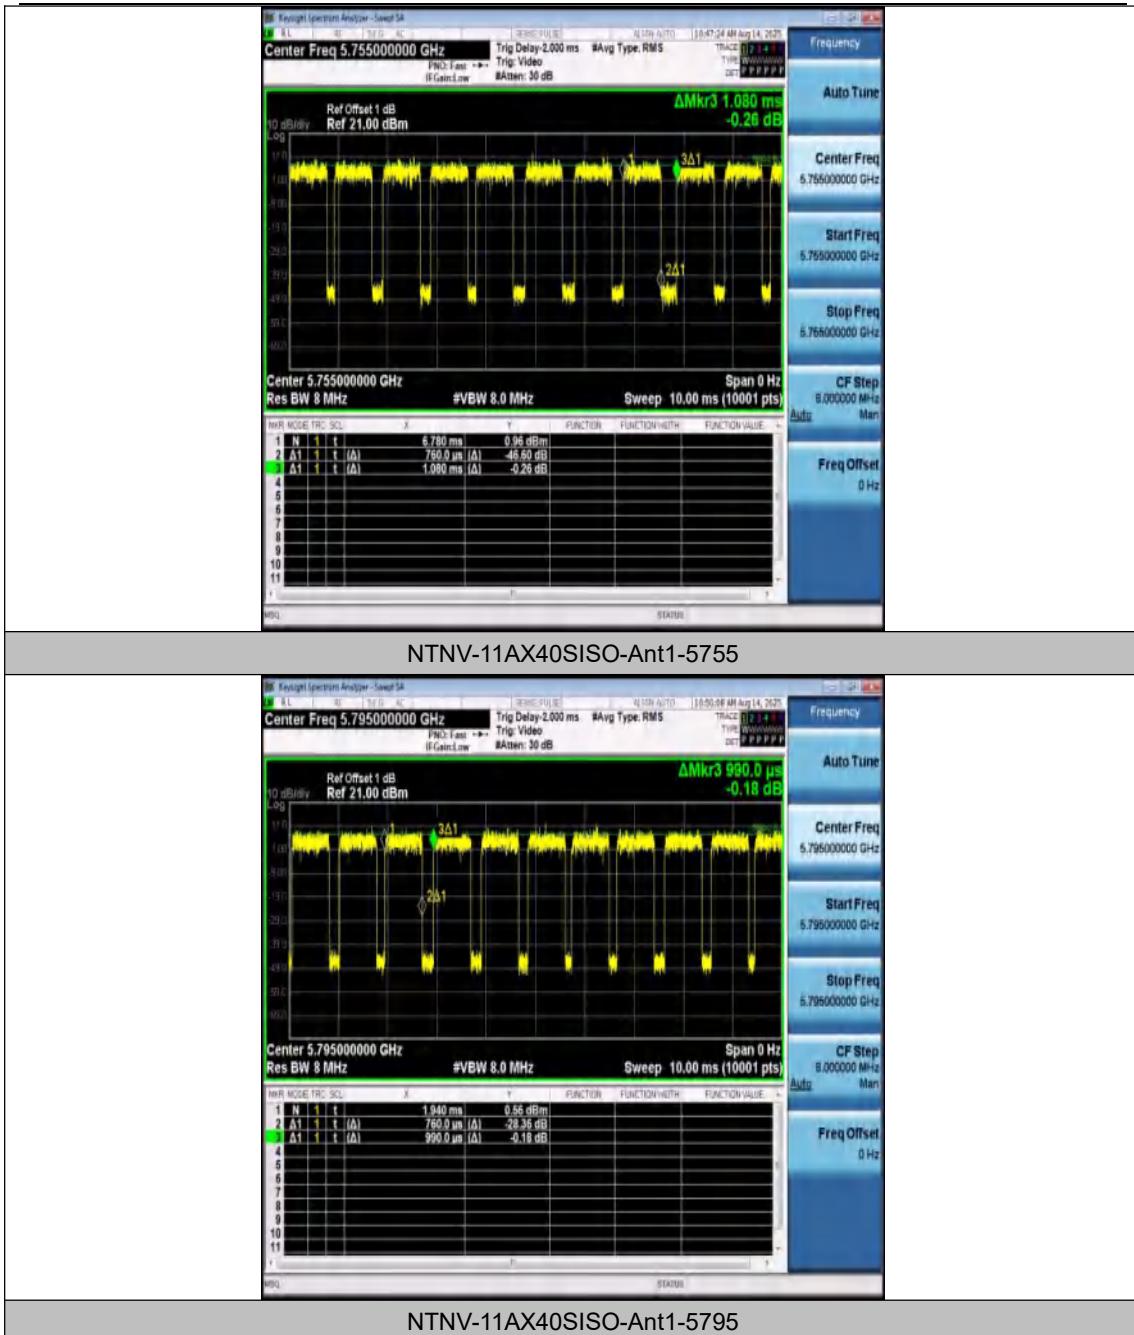

Appendix C: Maximum Conducted Output Power


Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Set Power	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	---	14.26	90.27	0.44	14.70	≤23.98	PASS
11A	Ant1	5220	---	14.32	90.27	0.44	14.76	≤23.98	PASS
11A	Ant1	5240	---	14.05	93.12	0.31	14.36	≤23.98	PASS
11A	Ant1	5745	---	11.33	89.87	0.46	11.79	≤30.00	PASS
11A	Ant1	5785	---	11.11	91.44	0.39	11.50	≤30.00	PASS
11A	Ant1	5825	---	11.25	91.86	0.37	11.62	≤30.00	PASS
11N20SISO	Ant1	5180	---	14.18	93.56	0.29	14.47	≤23.98	PASS
11N20SISO	Ant1	5220	---	14.30	87.91	0.56	14.86	≤23.98	PASS
11N20SISO	Ant1	5240	---	14.04	90.00	0.46	14.50	≤23.98	PASS
11N20SISO	Ant1	5745	---	11.17	74.51	1.28	12.45	≤30.00	PASS
11N20SISO	Ant1	5785	---	10.92	94.53	0.24	11.16	≤30.00	PASS
11N20SISO	Ant1	5825	---	11.18	89.57	0.48	11.66	≤30.00	PASS
11N40SISO	Ant1	5190	---	14.17	85.32	0.69	14.86	≤23.98	PASS
11N40SISO	Ant1	5230	---	13.91	79.49	1.00	14.91	≤23.98	PASS
11N40SISO	Ant1	5755	---	9.37	80.87	0.92	10.29	≤30.00	PASS
11N40SISO	Ant1	5795	---	9.11	43.26	3.64	12.75	≤30.00	PASS
11AC20SISO	Ant1	5180	---	14.24	93.60	0.29	14.53	≤23.98	PASS
11AC20SISO	Ant1	5220	---	14.44	90.48	0.43	14.87	≤23.98	PASS
11AC20SISO	Ant1	5240	---	14.07	88.79	0.52	14.59	≤23.98	PASS
11AC20SISO	Ant1	5745	---	11.35	89.62	0.48	11.83	≤30.00	PASS
11AC20SISO	Ant1	5785	---	10.90	91.79	0.37	11.27	≤30.00	PASS
11AC20SISO	Ant1	5825	---	10.37	89.62	0.48	10.85	≤30.00	PASS
11AC40SISO	Ant1	5190	---	12.97	84.55	0.73	13.70	≤23.98	PASS
11AC40SISO	Ant1	5230	---	12.81	81.03	0.91	13.72	≤23.98	PASS
11AC40SISO	Ant1	5755	---	10.17	79.49	1.00	11.17	≤30.00	PASS
11AC40SISO	Ant1	5795	---	10.08	78.33	1.06	11.14	≤30.00	PASS
11AX20SISO	Ant1	5180	---	13.82	92.36	0.35	14.17	≤23.98	PASS
11AX20SISO	Ant1	5220	---	13.97	89.02	0.51	14.48	≤23.98	PASS
11AX20SISO	Ant1	5240	---	13.59	86.90	0.61	14.20	≤23.98	PASS
11AX20SISO	Ant1	5745	---	11.04	89.57	0.48	11.52	≤30.00	PASS
11AX20SISO	Ant1	5785	---	10.63	86.90	0.61	11.24	≤30.00	PASS
11AX20SISO	Ant1	5825	---	11.01	87.43	0.58	11.59	≤30.00	PASS
11AX40SISO	Ant1	5190	---	13.64	80.85	0.92	14.56	≤23.98	PASS
11AX40SISO	Ant1	5230	---	13.37	80.85	0.92	14.29	≤23.98	PASS

11AX40SISO	Ant1	5755	---	11.10	70.37	1.53	12.63	≤30.00	PASS
11AX40SISO	Ant1	5795	---	10.91	76.77	1.15	12.06	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs Channel Power

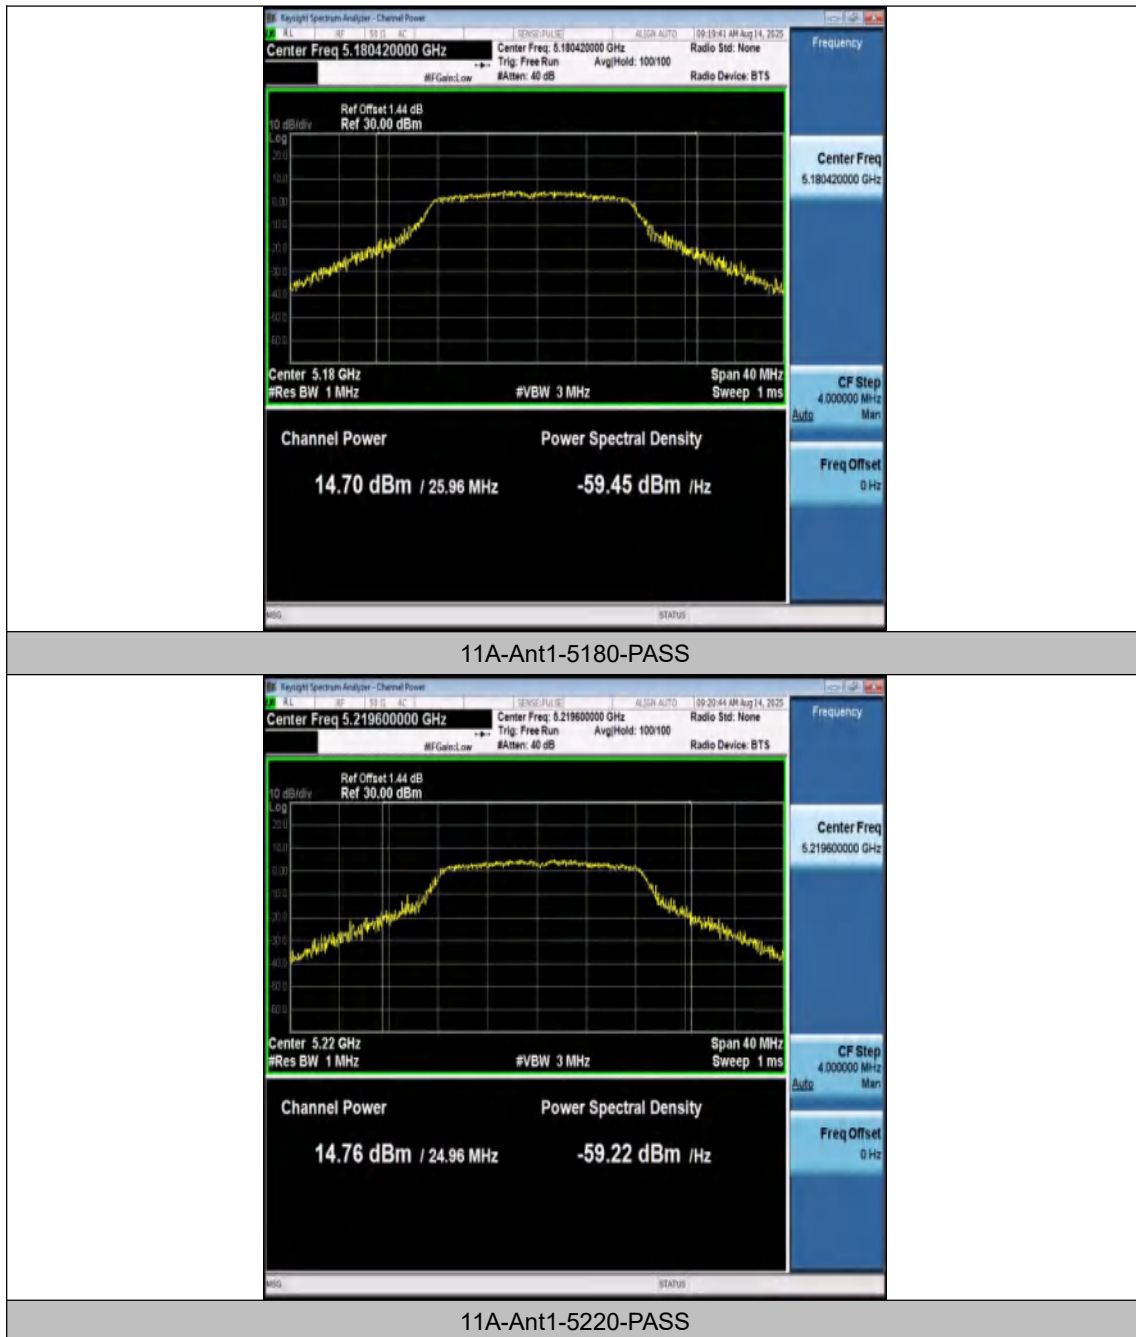


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

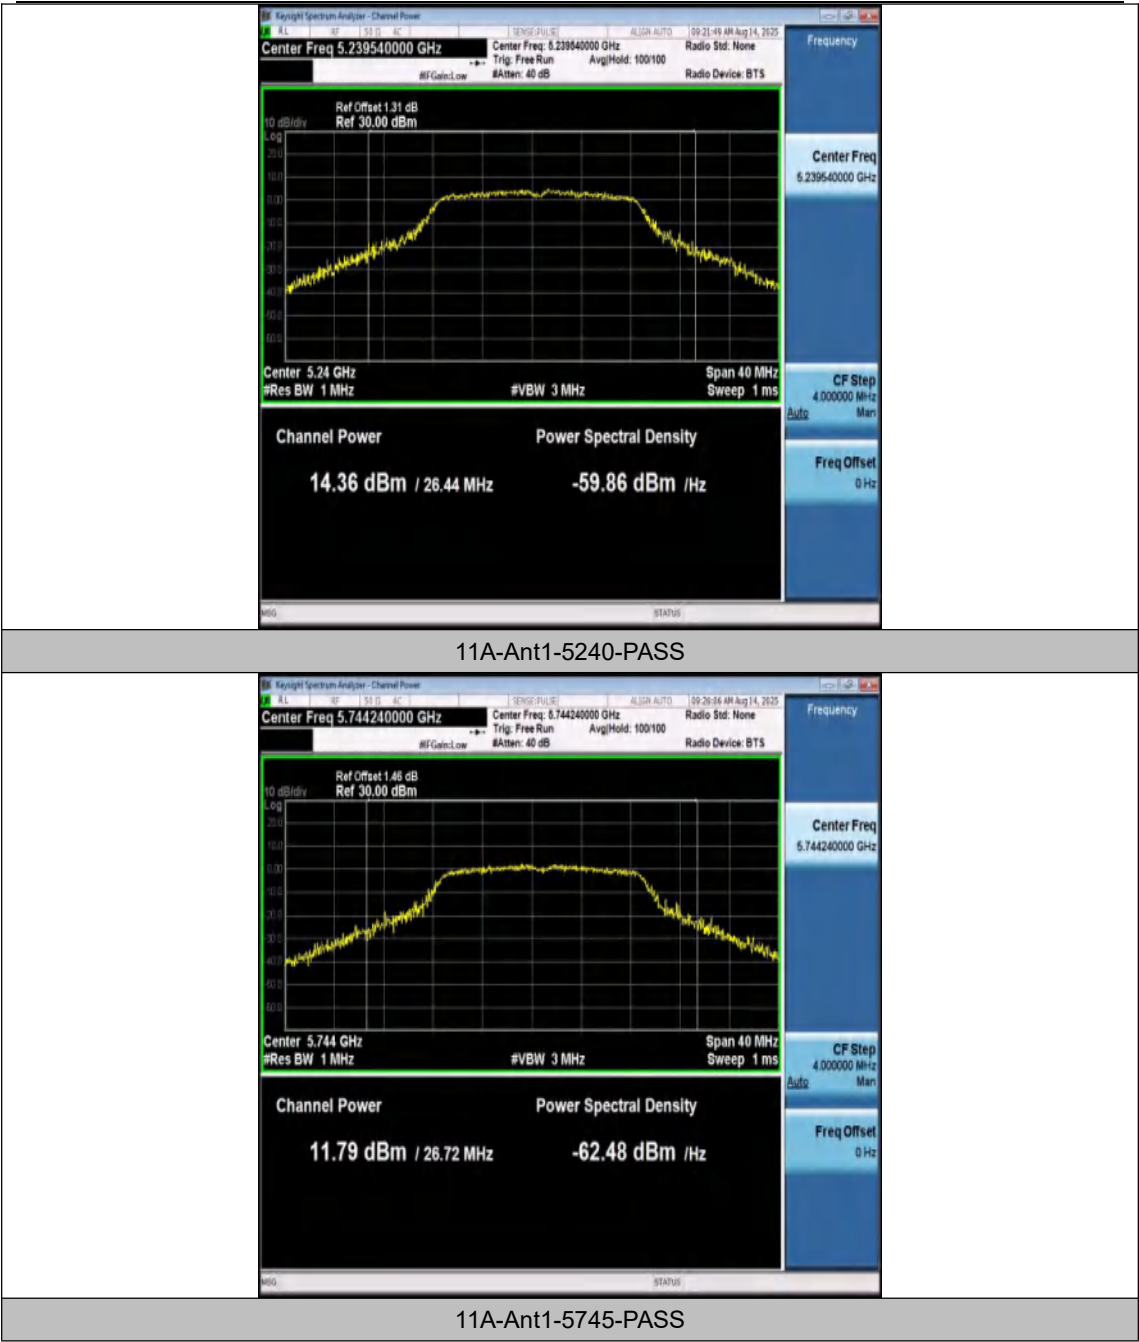


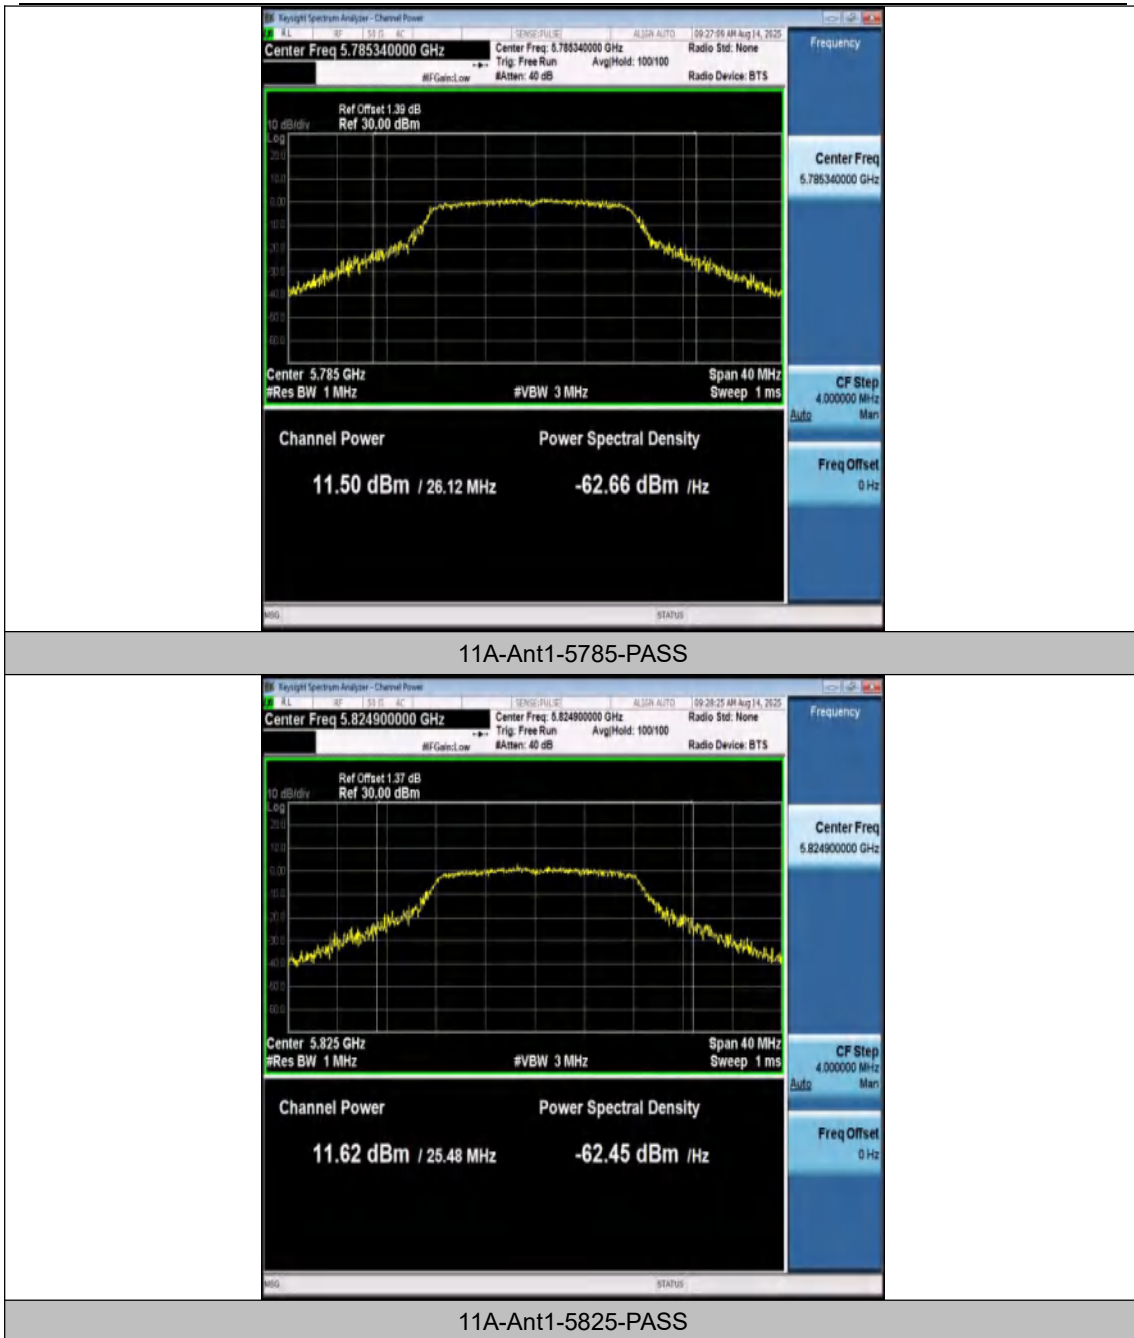

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

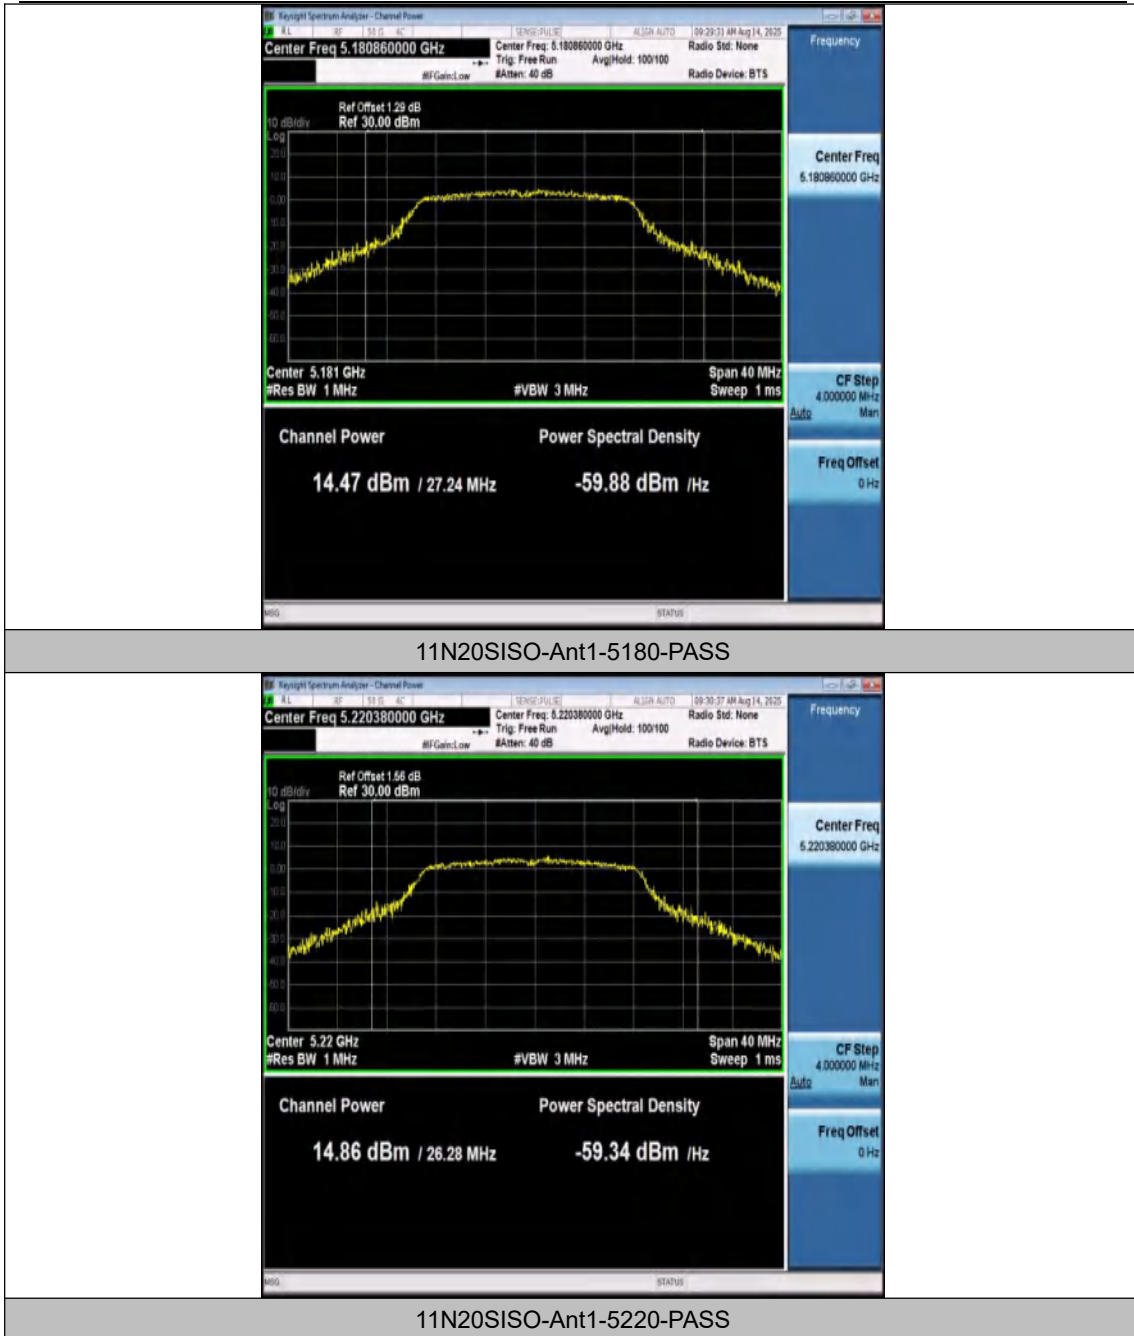

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

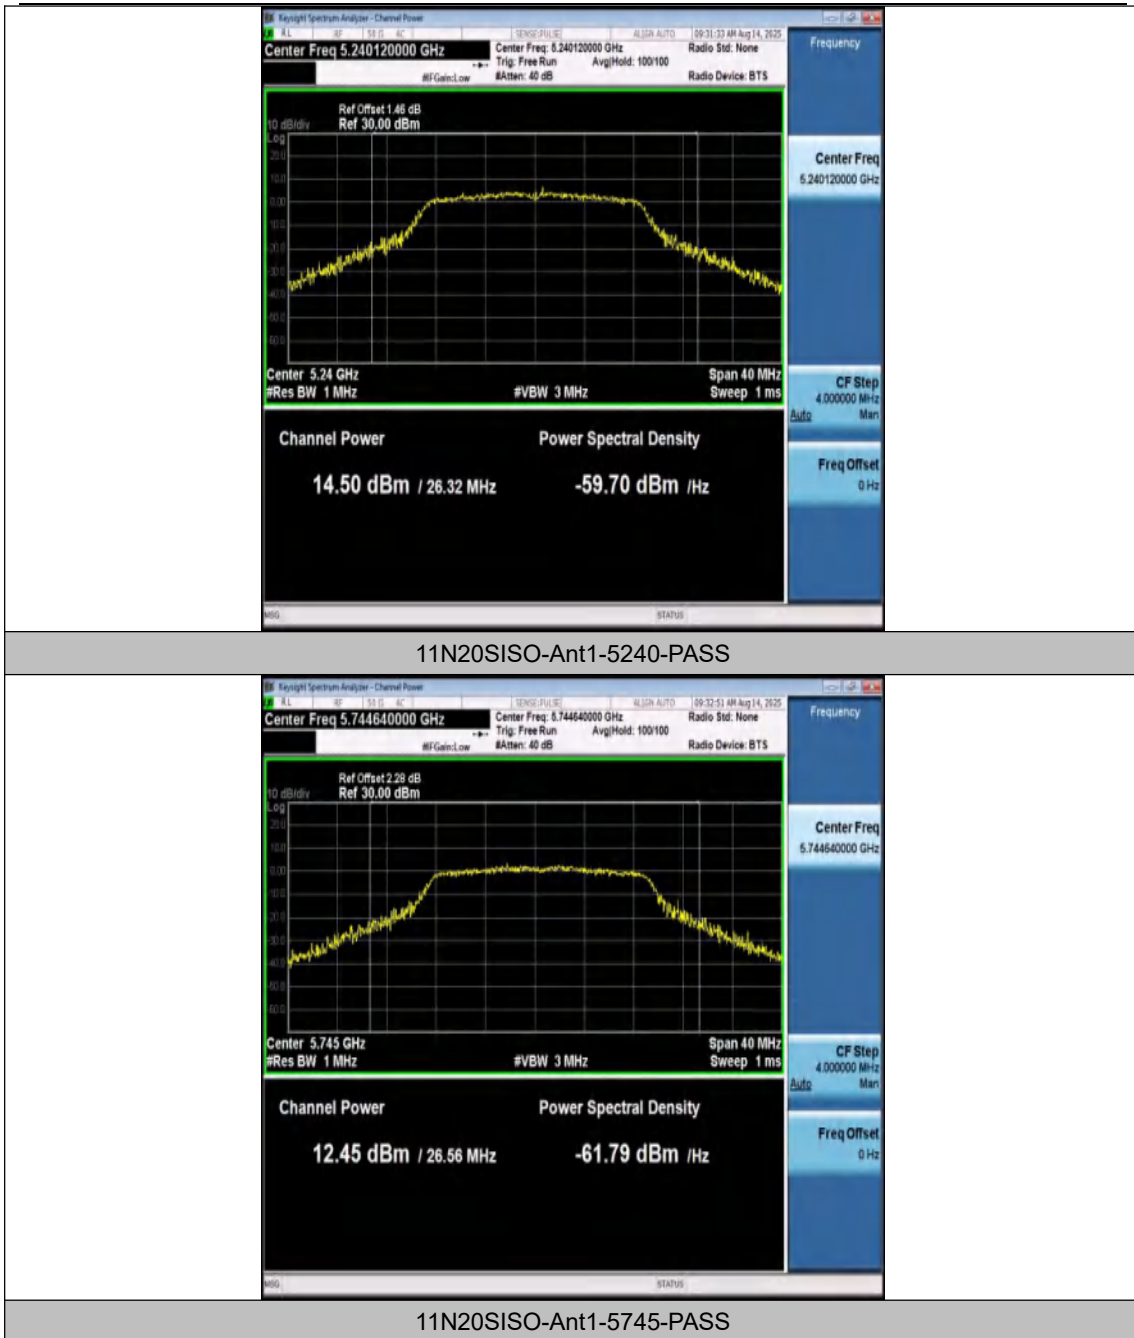

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

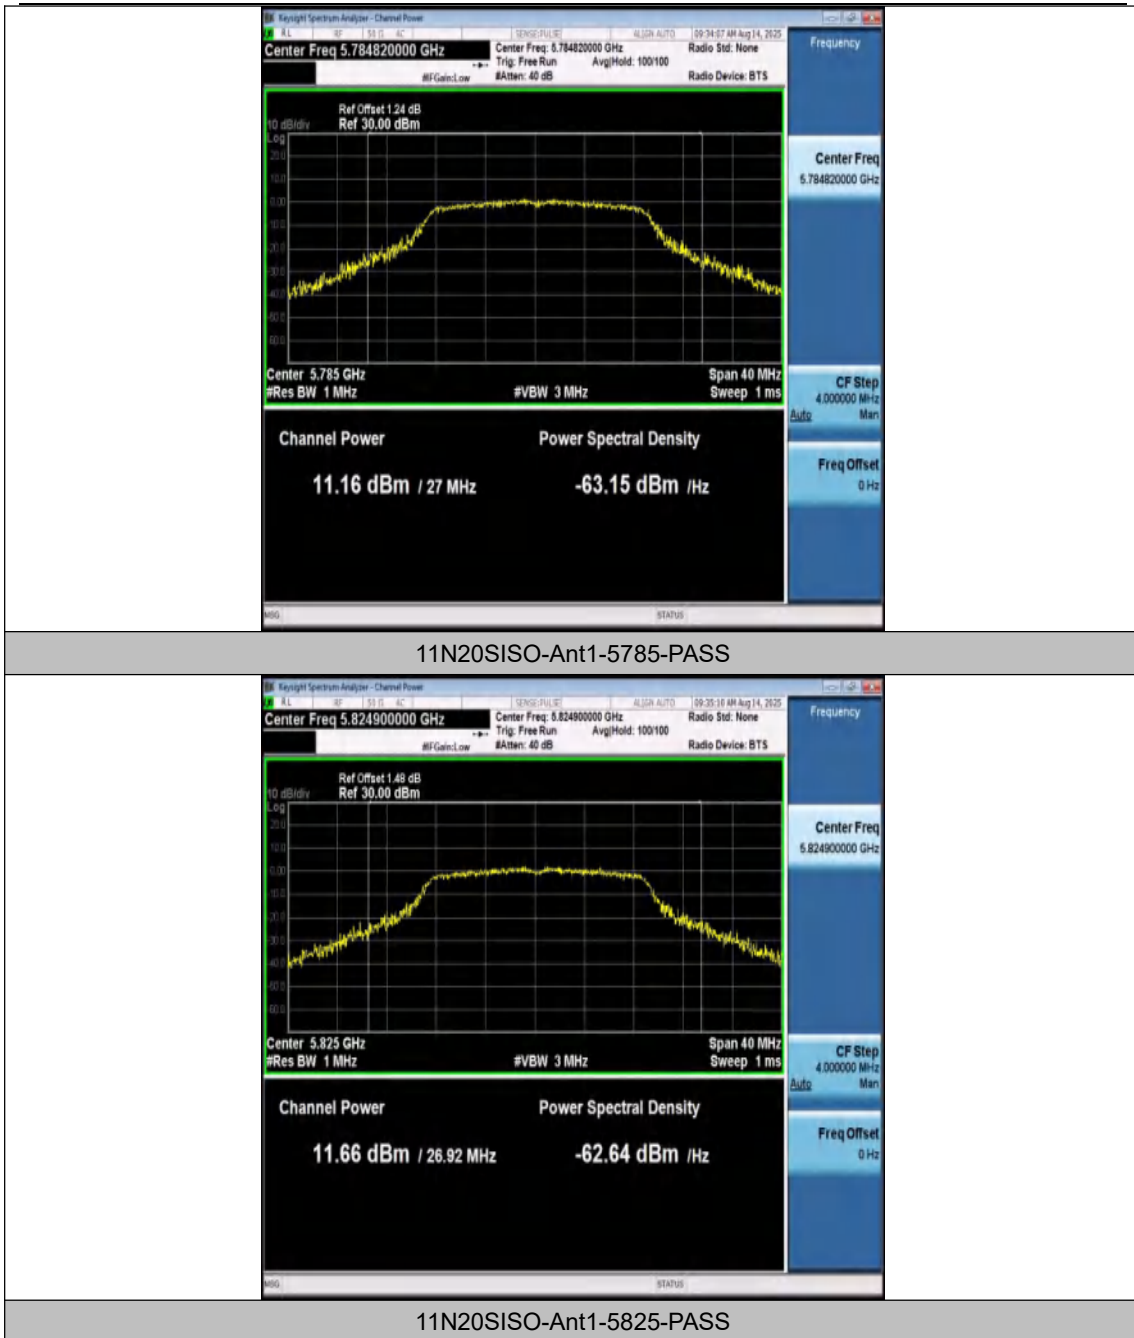


Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

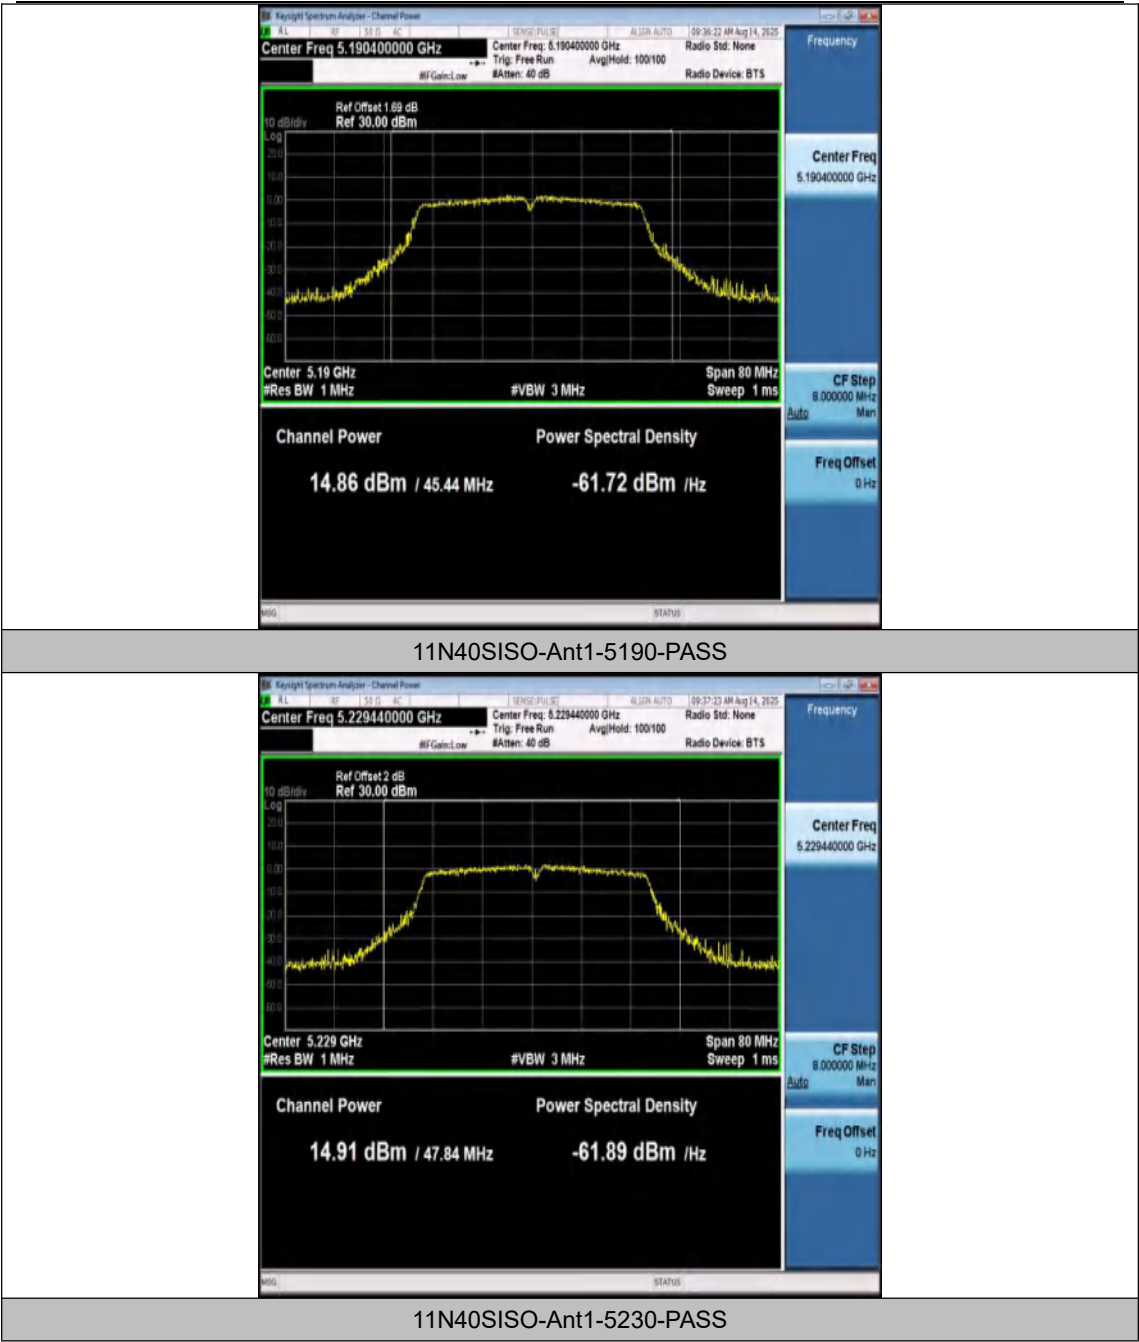


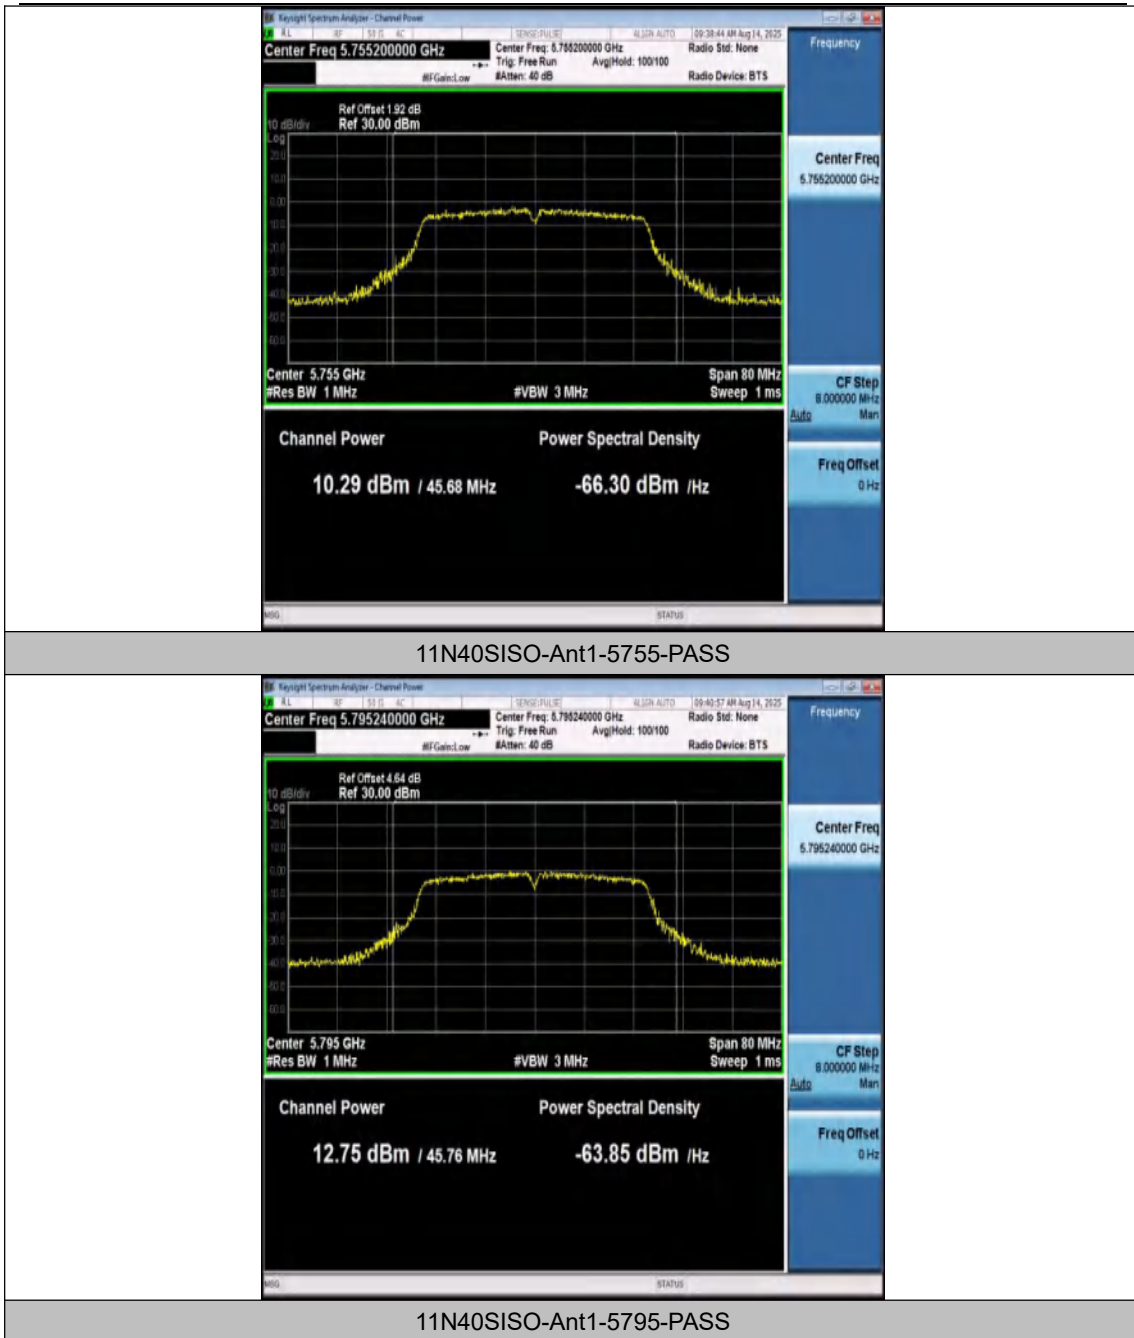

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

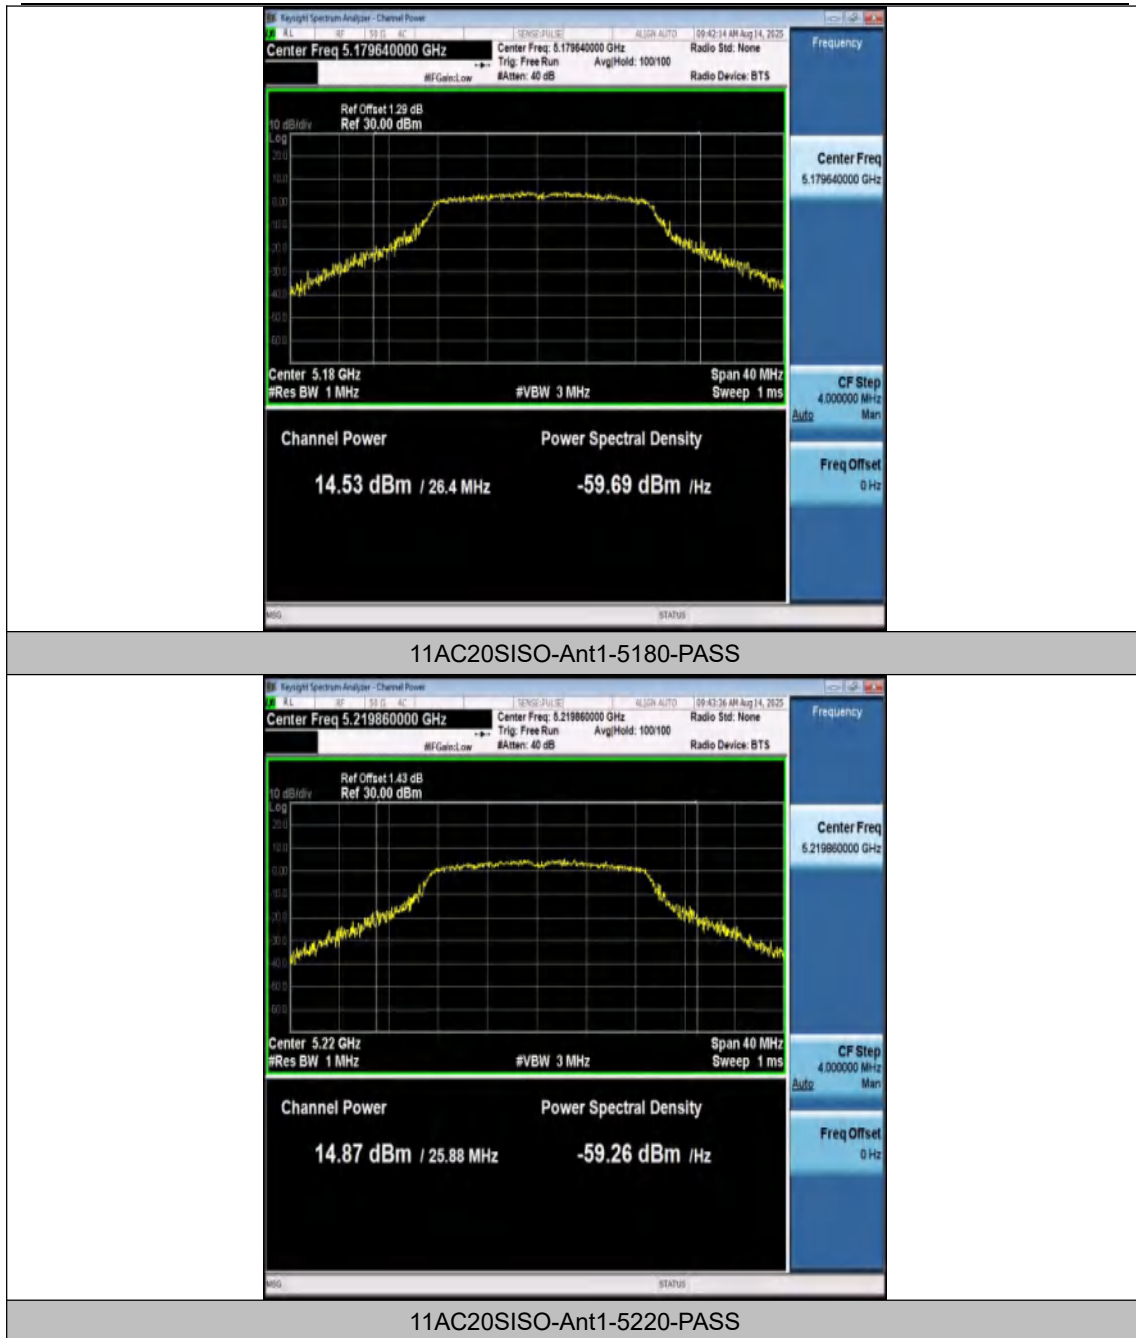

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

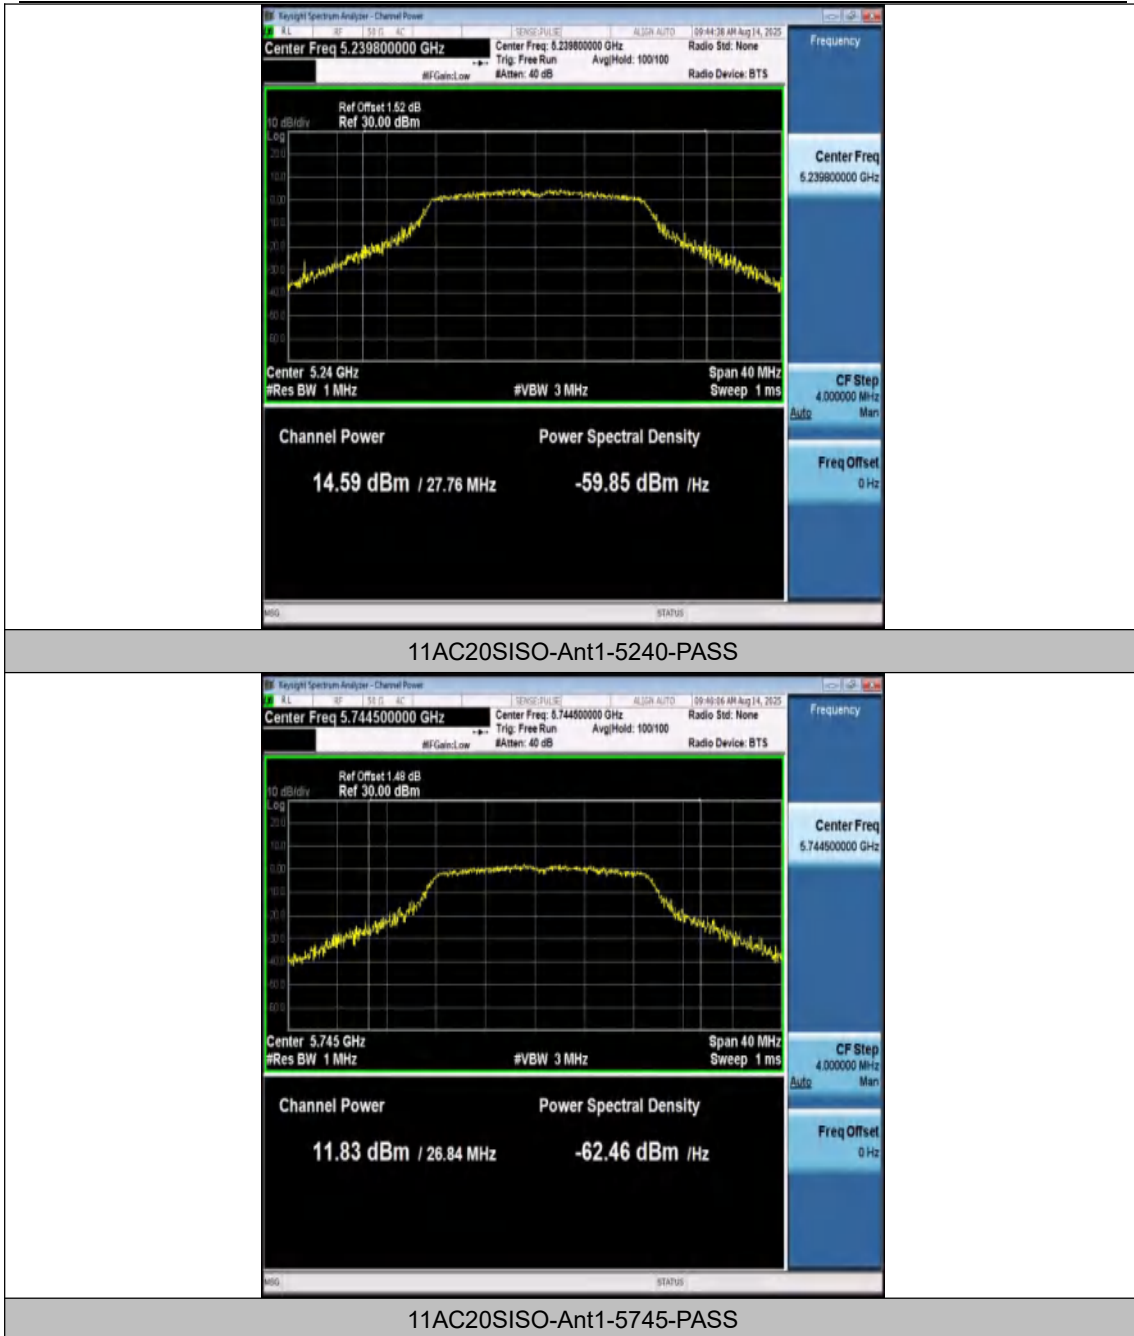

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

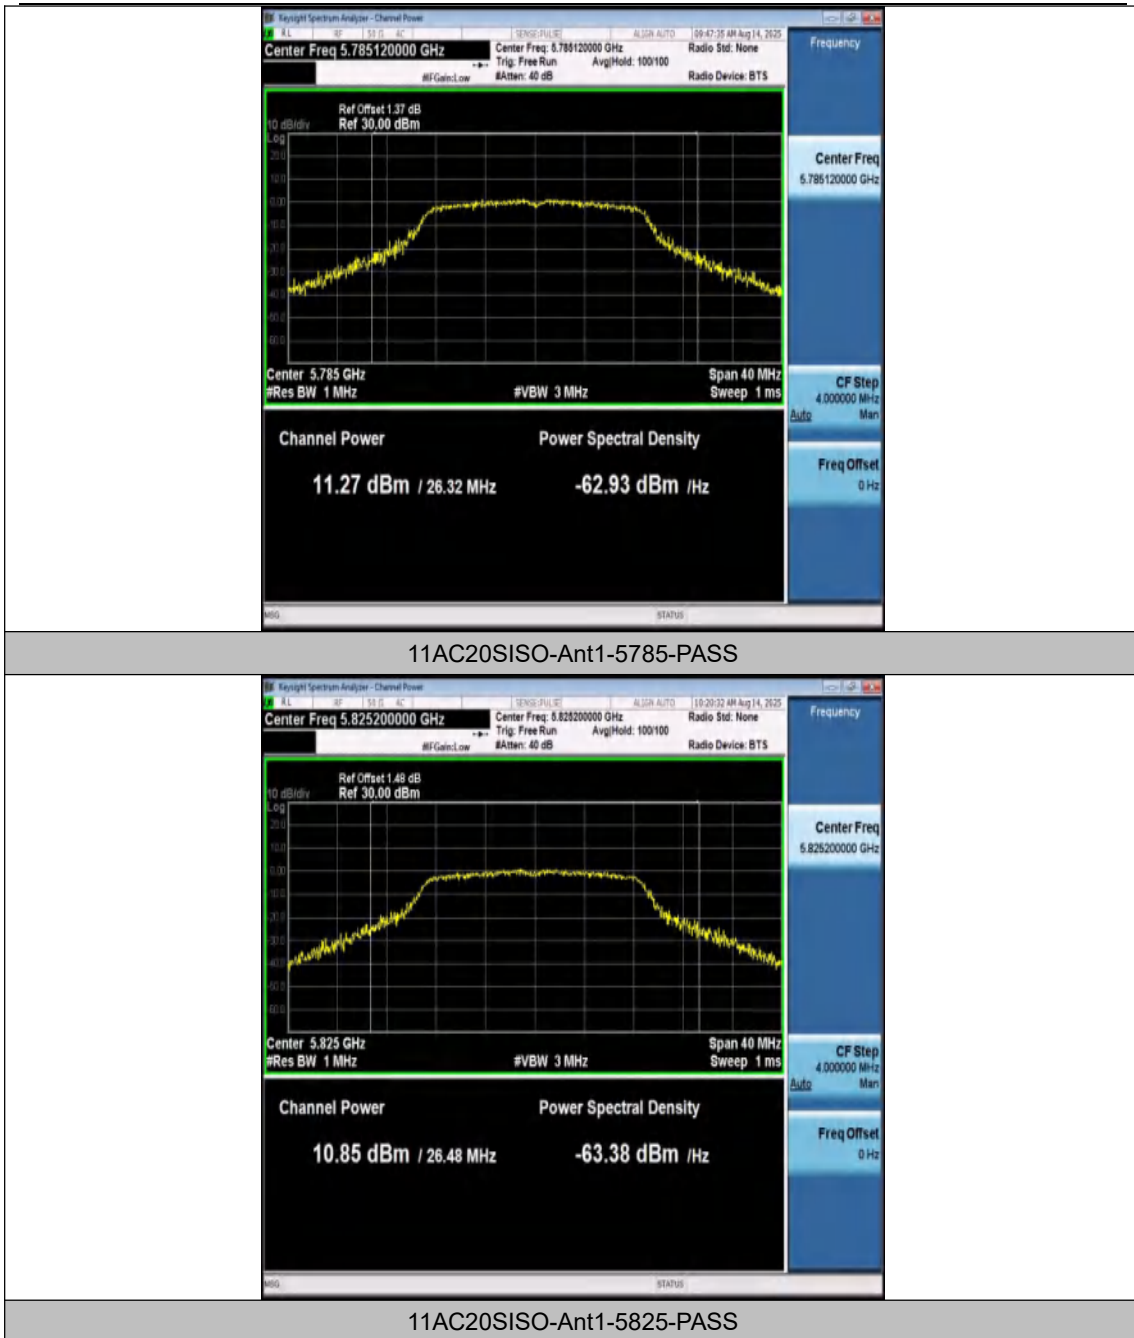

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

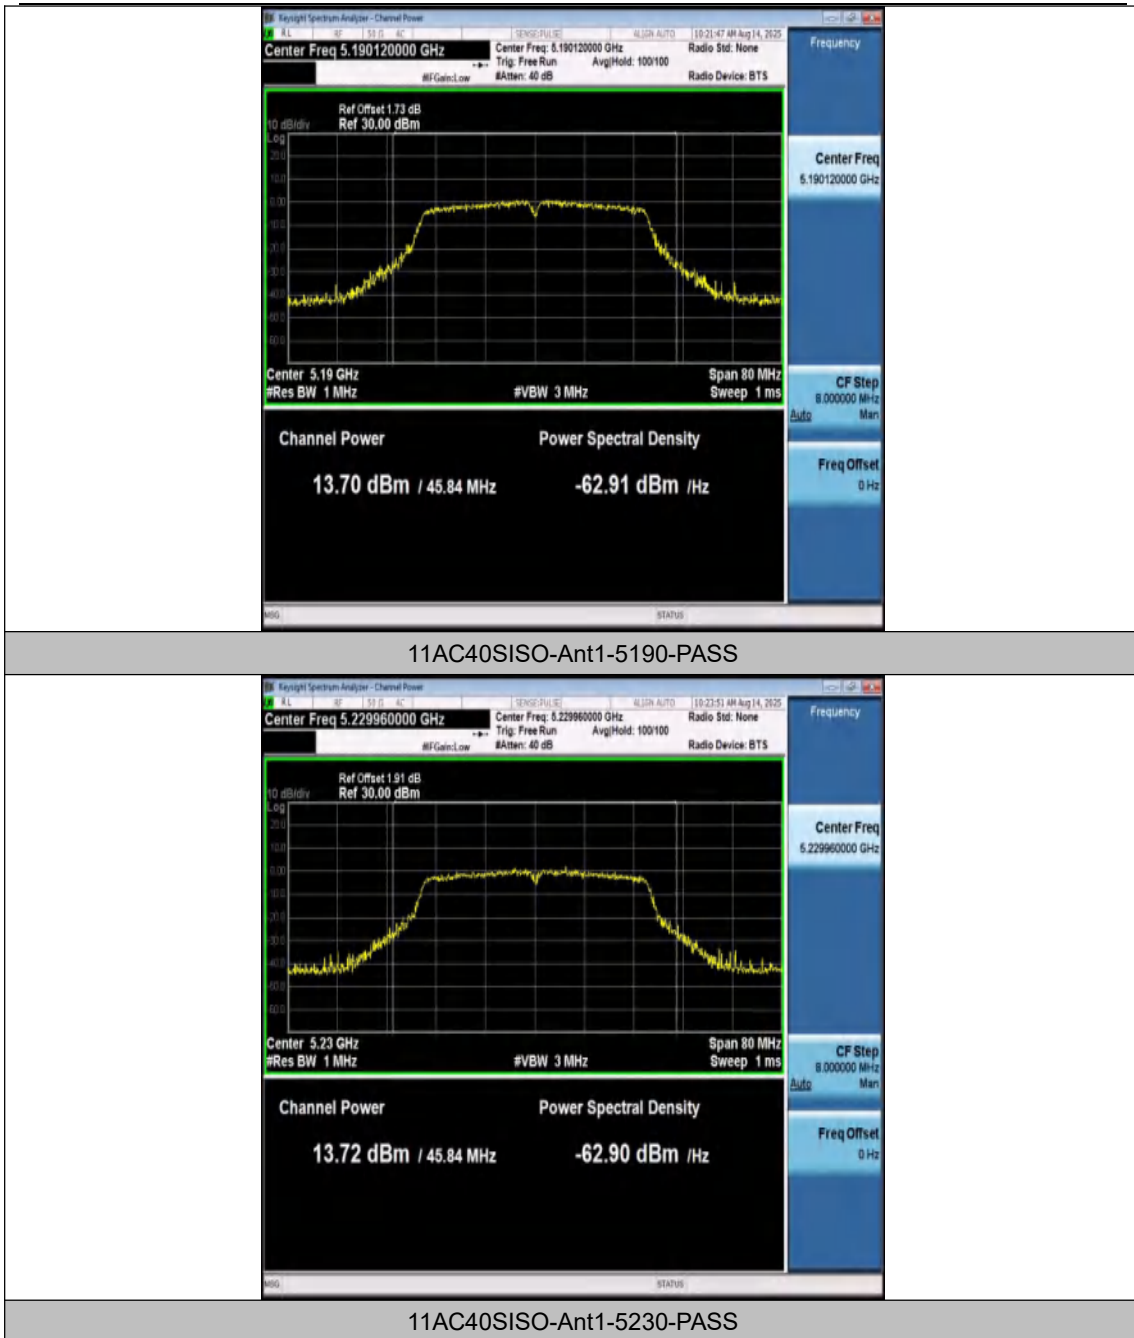

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

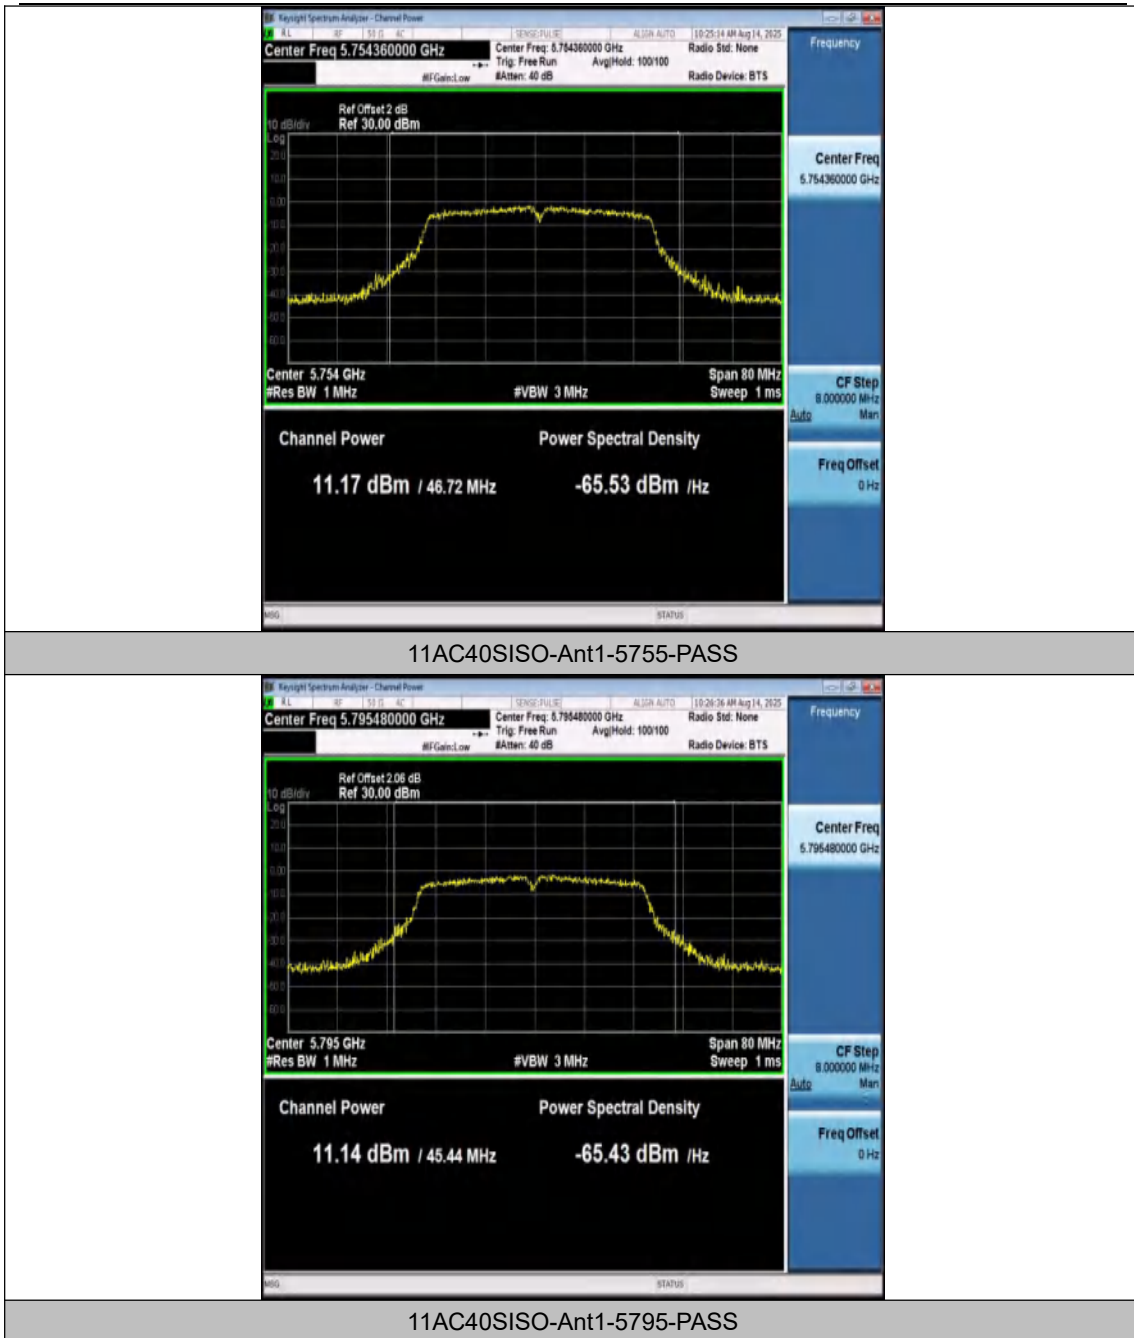

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

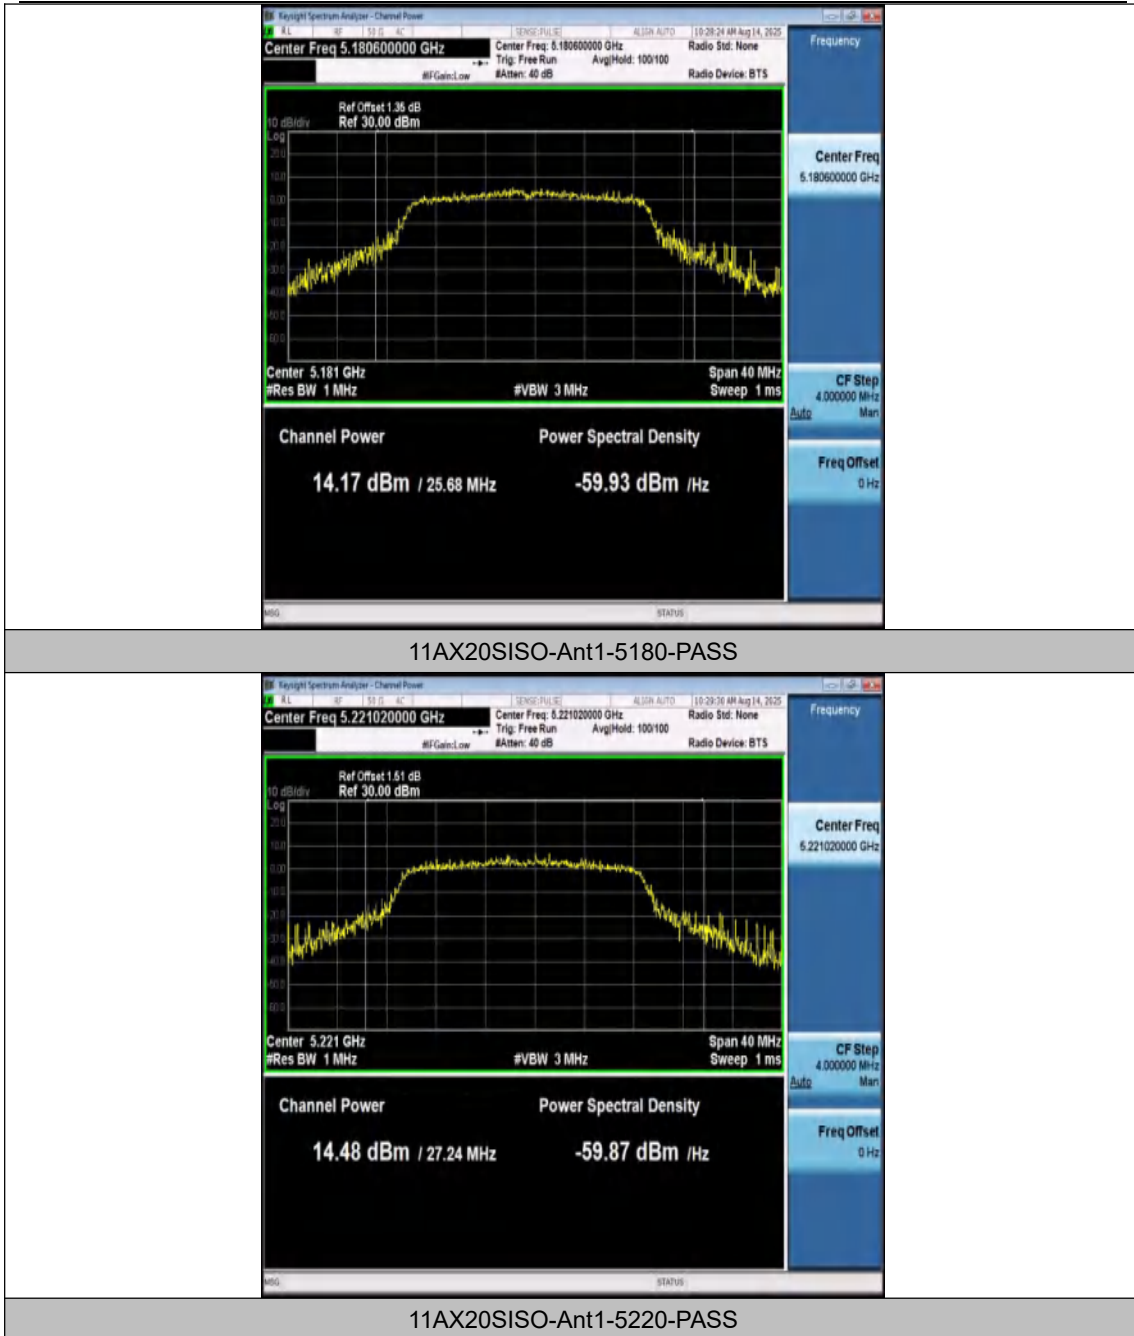

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

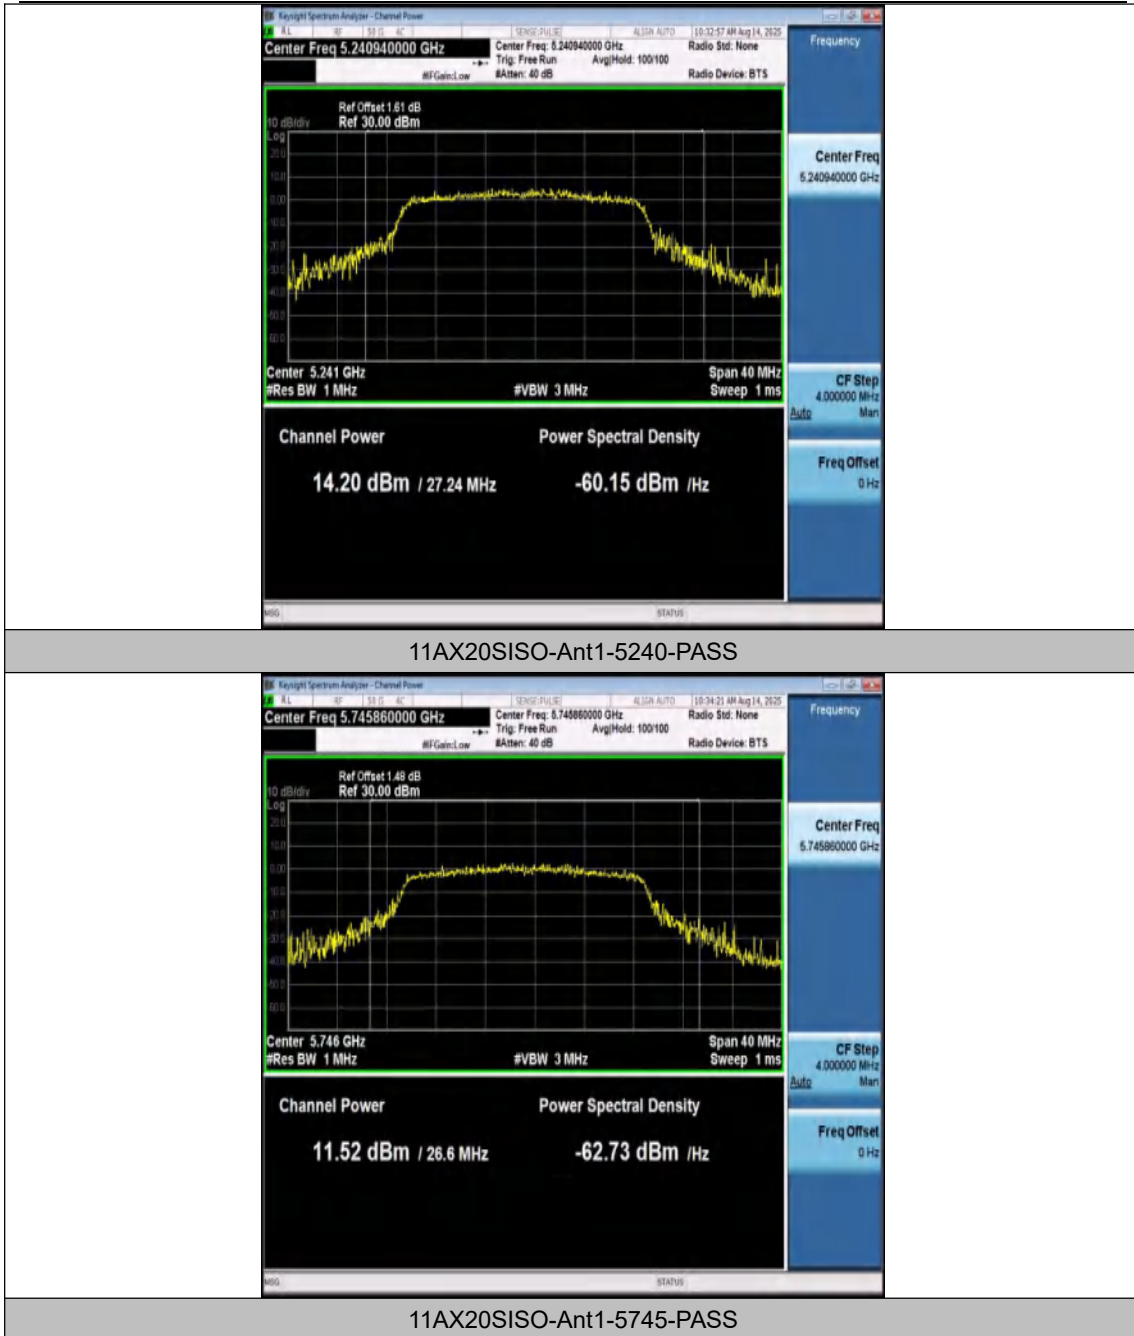

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

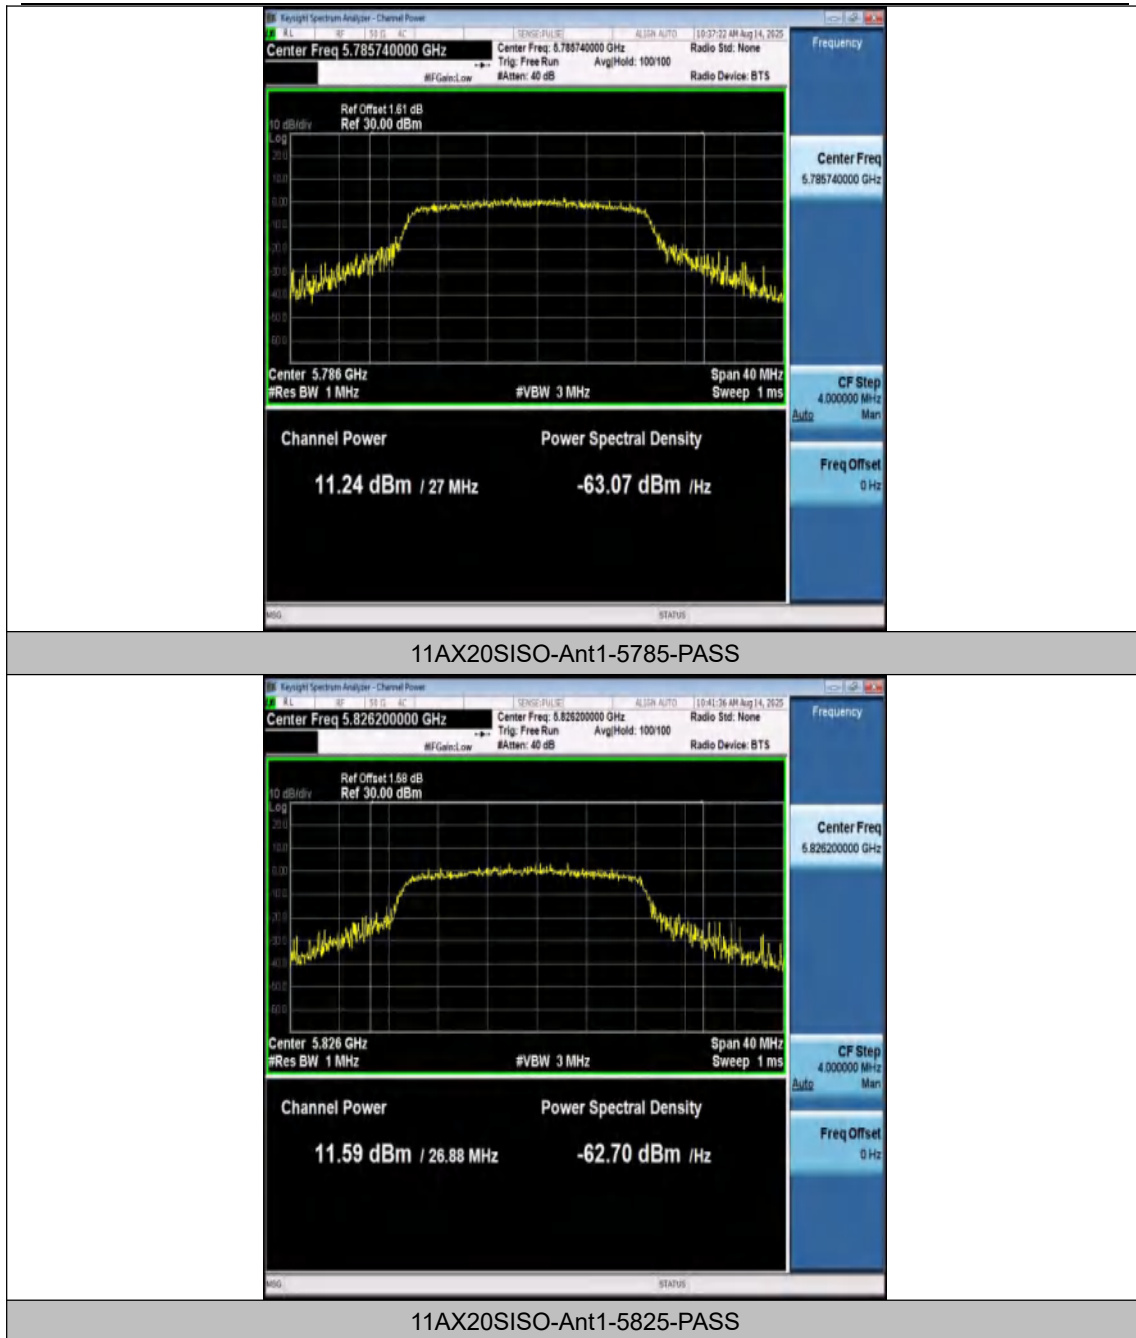


Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

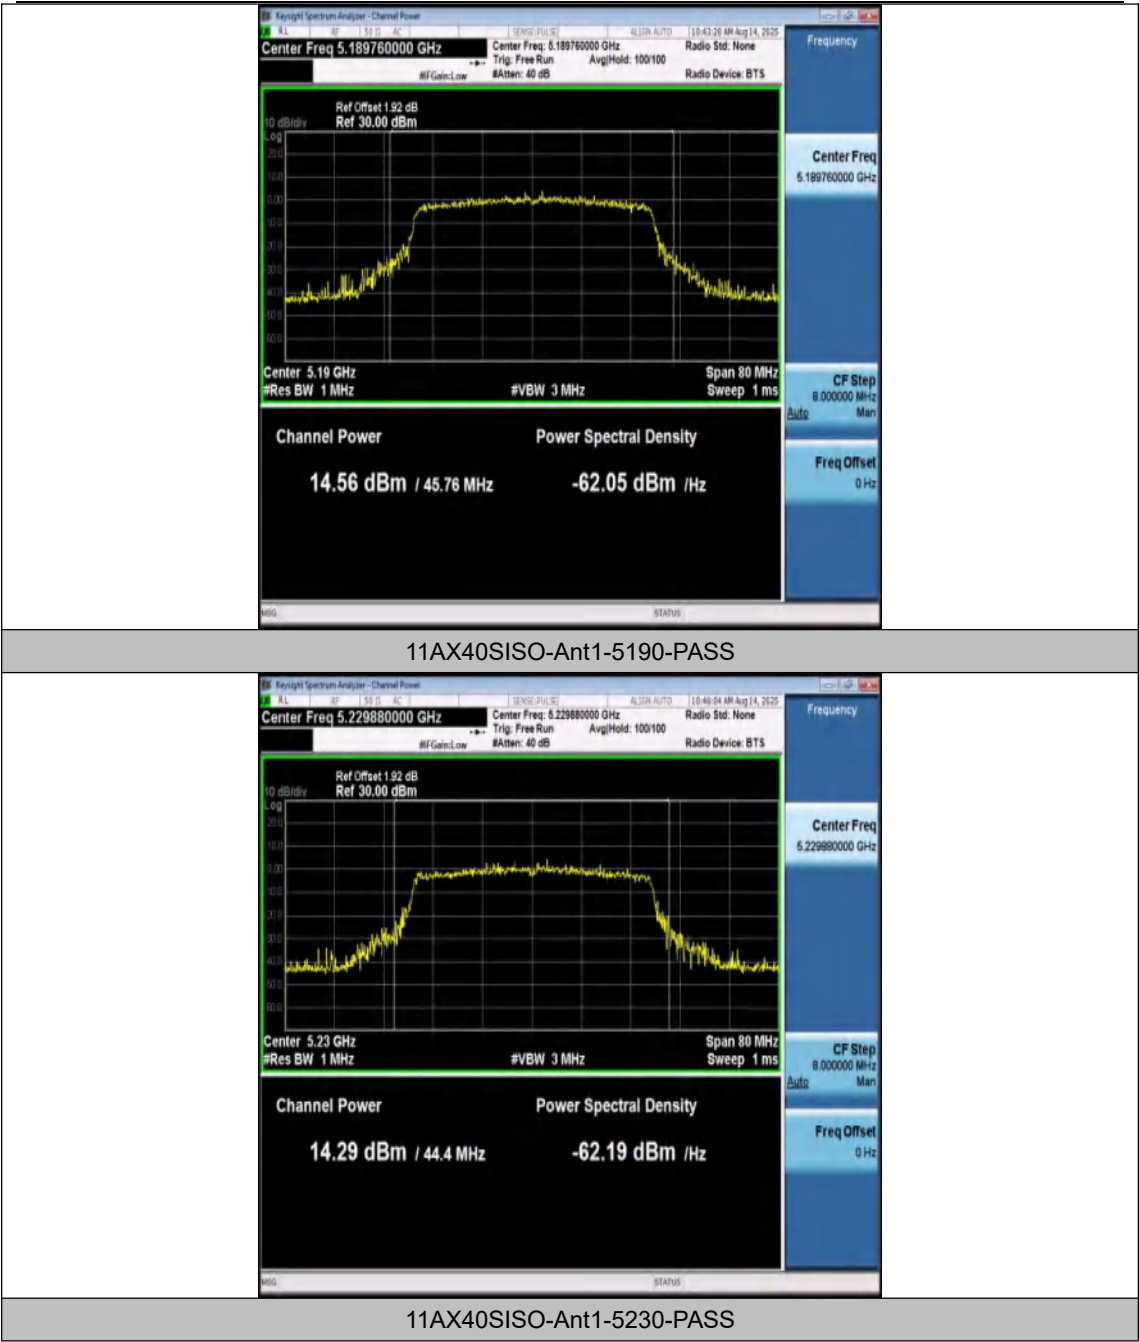

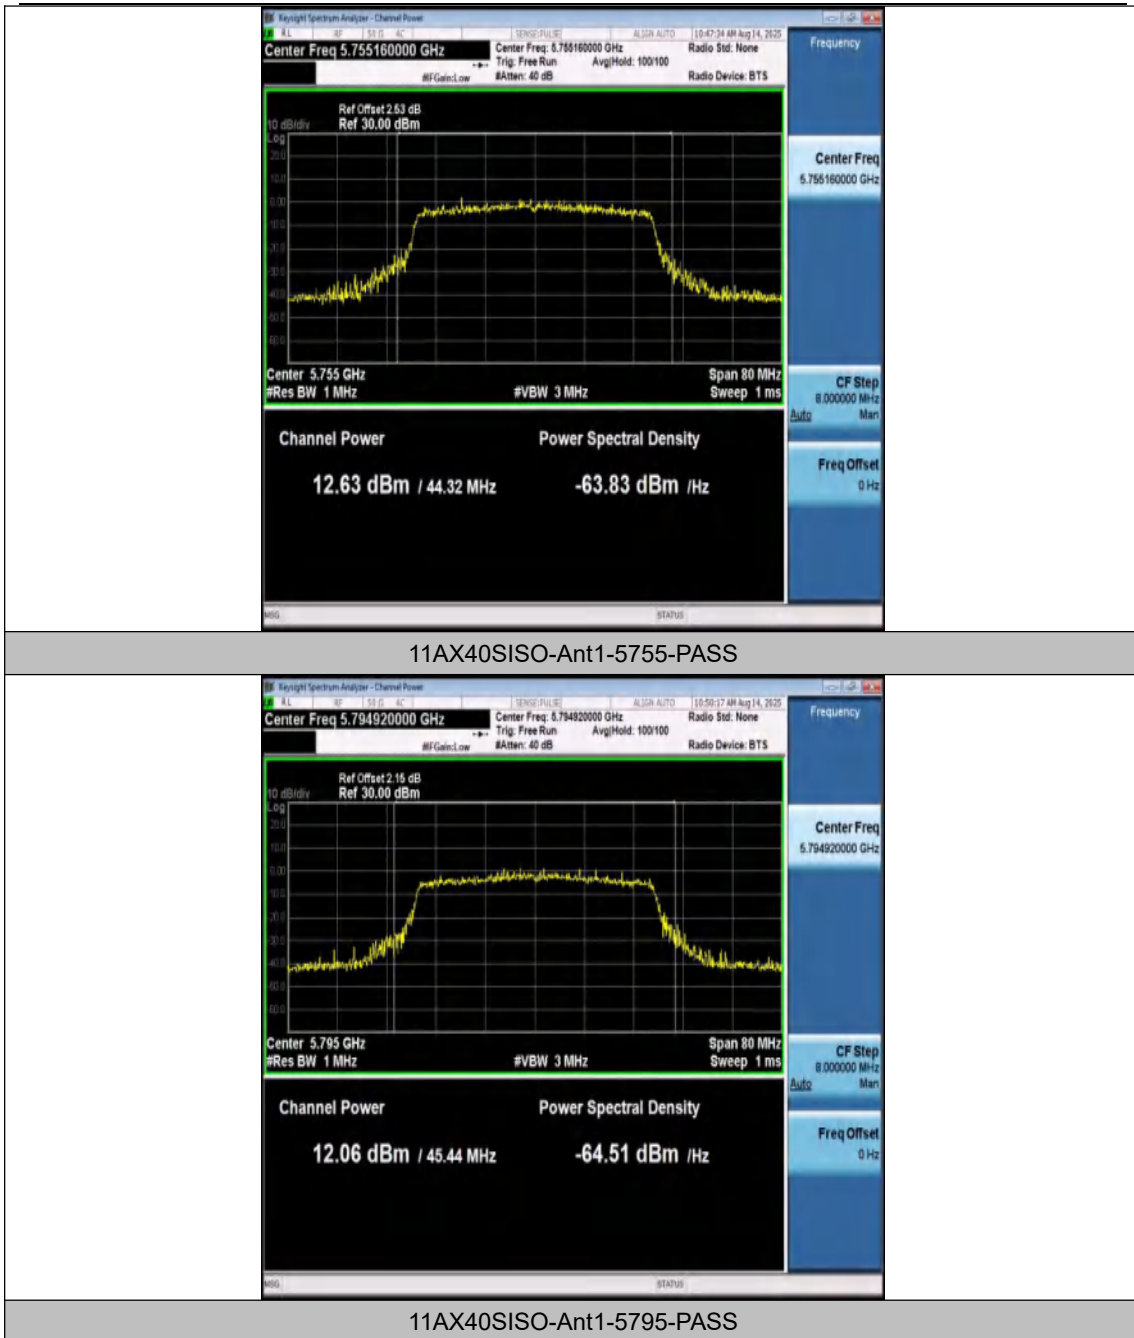

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm /MHz]	DC Factor [dBm]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-0.67	0.44	-0.23	≤11.00	PASS
11A	Ant1	5220	-0.88	0.44	-0.44	≤11.00	PASS
11A	Ant1	5240	-0.88	0.31	-0.57	≤11.00	PASS
11N20SISO	Ant1	5180	-1.25	0.29	-0.96	≤11.00	PASS
11N20SISO	Ant1	5220	-1.10	0.56	-0.54	≤11.00	PASS
11N20SISO	Ant1	5240	-1.28	0.46	-0.82	≤11.00	PASS
11N40SISO	Ant1	5190	-4.18	0.69	-3.49	≤11.00	PASS
11N40SISO	Ant1	5230	-4.70	1.00	-3.70	≤11.00	PASS
11AC20SISO	Ant1	5180	-0.93	0.29	-0.64	≤11.00	PASS
11AC20SISO	Ant1	5220	-1.11	0.43	-0.68	≤11.00	PASS
11AC20SISO	Ant1	5240	-1.21	0.52	-0.69	≤11.00	PASS
11AC40SISO	Ant1	5190	-5.19	0.73	-4.46	≤11.00	PASS
11AC40SISO	Ant1	5230	-6.11	0.91	-5.20	≤11.00	PASS
11AX20SISO	Ant1	5180	-2.56	0.35	-2.21	≤11.00	PASS
11AX20SISO	Ant1	5220	-2.23	0.51	-1.72	≤11.00	PASS
11AX20SISO	Ant1	5240	-2.80	0.61	-2.19	≤11.00	PASS
11AX40SISO	Ant1	5190	-5.35	0.92	-4.43	≤11.00	PASS
11AX40SISO	Ant1	5230	-6.22	0.92	-5.30	≤11.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


Test Result B4

Test Mode	Antenna	Frequency[MHz]	Reading Result [dBm/510KHz]	DC Factor [dBm]	Result [dBm/510 KHz]	Result [dBm/500 KHz]	Limit [dBm/500 KHz]	Verdict
11A	Ant1	5745	-8.52	0.46	-8.15	-8.24	≤30.00	PASS
11A	Ant1	5785	-6.62	0.39	-6.32	-6.41	≤30.00	PASS
11A	Ant1	5825	-6.61	0.37	-6.33	-6.42	≤30.00	PASS
11N20SISO	Ant1	5745	-6.77	1.28	-5.58	-5.67	≤30.00	PASS
11N20SISO	Ant1	5785	-7.27	0.24	-7.12	-7.21	≤30.00	PASS
11N20SISO	Ant1	5825	-6.78	0.48	-6.39	-6.48	≤30.00	PASS
11N40SISO	Ant1	5755	-11.93	0.92	-11.10	-11.19	≤30.00	PASS
11N40SISO	Ant1	5795	-12.41	3.64	-8.86	-8.95	≤30.00	PASS
11AC20SISO	Ant1	5745	-6.90	0.48	-6.51	-6.60	≤30.00	PASS
11AC20SISO	Ant1	5785	-7.18	0.37	-6.90	-6.99	≤30.00	PASS
11AC20SISO	Ant1	5825	-7.61	0.48	-7.22	-7.31	≤30.00	PASS
11AC40SISO	Ant1	5755	-11.26	1.00	-10.35	-10.44	≤30.00	PASS
11AC40SISO	Ant1	5795	-11.36	1.06	-10.39	-10.48	≤30.00	PASS
11AX20SISO	Ant1	5745	-8.18	0.48	-7.79	-7.88	≤30.00	PASS
11AX20SISO	Ant1	5785	-8.40	0.61	-7.88	-7.97	≤30.00	PASS
11AX20SISO	Ant1	5825	-8.04	0.58	-7.55	-7.64	≤30.00	PASS
11AX40SISO	Ant1	5755	-11.52	1.53	-10.08	-10.17	≤30.00	PASS
11AX40SISO	Ant1	5795	-11.23	1.15	-10.17	-10.26	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.

2. Result [dBm/500KHz]=Result [dBm/510KHz]+10*LOG10(500/510)


Test Graphs B1

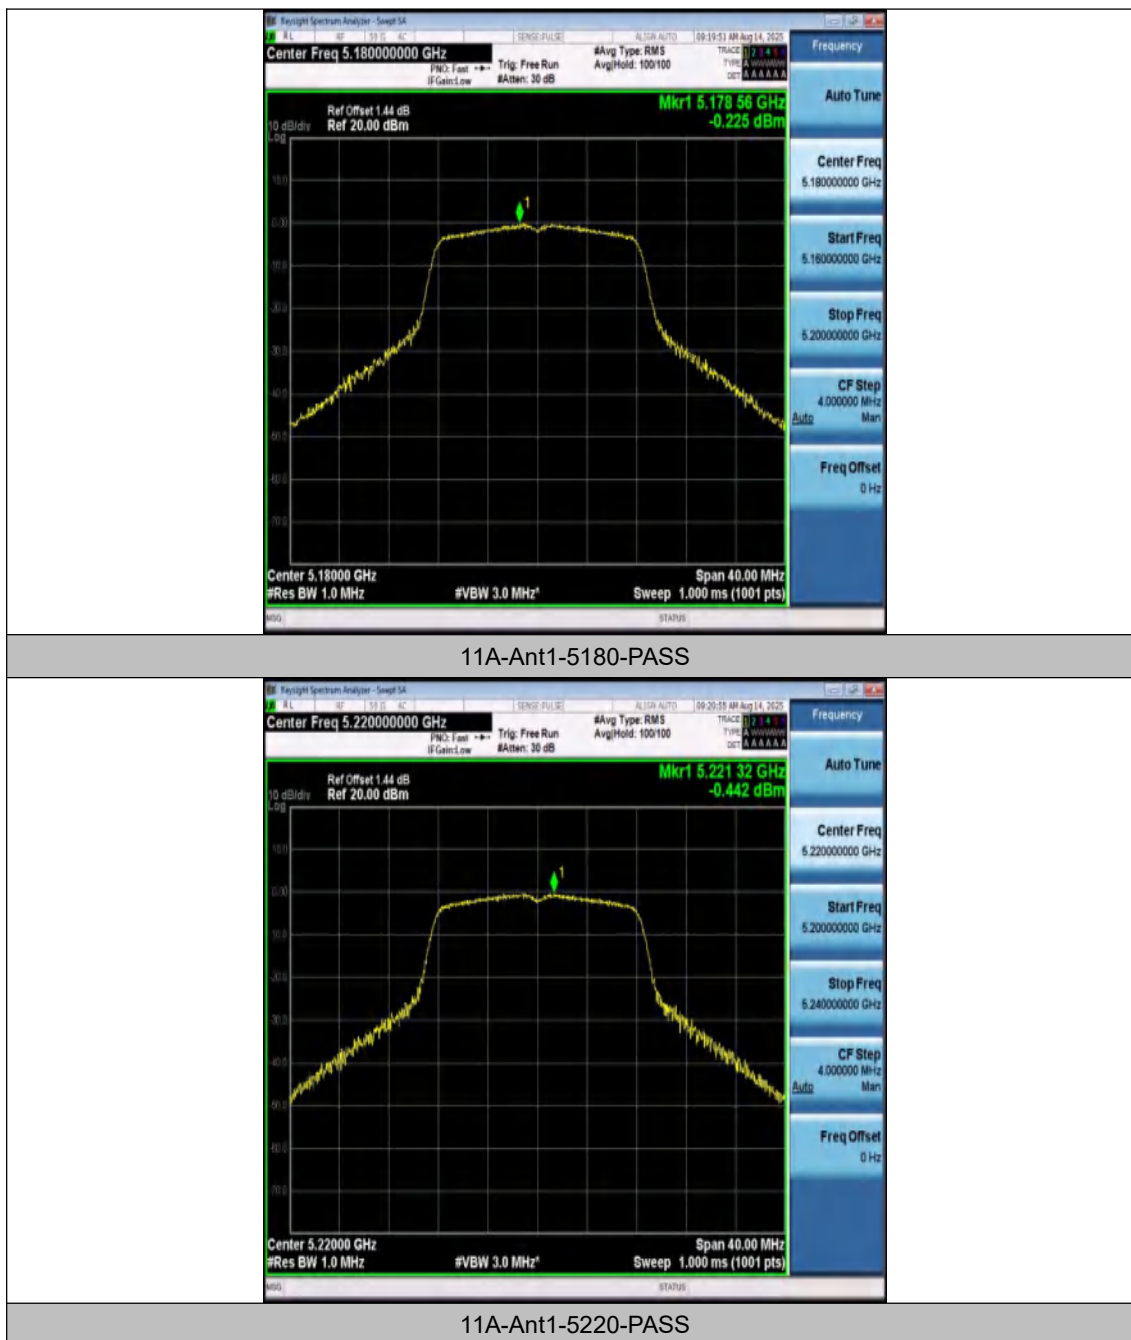

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

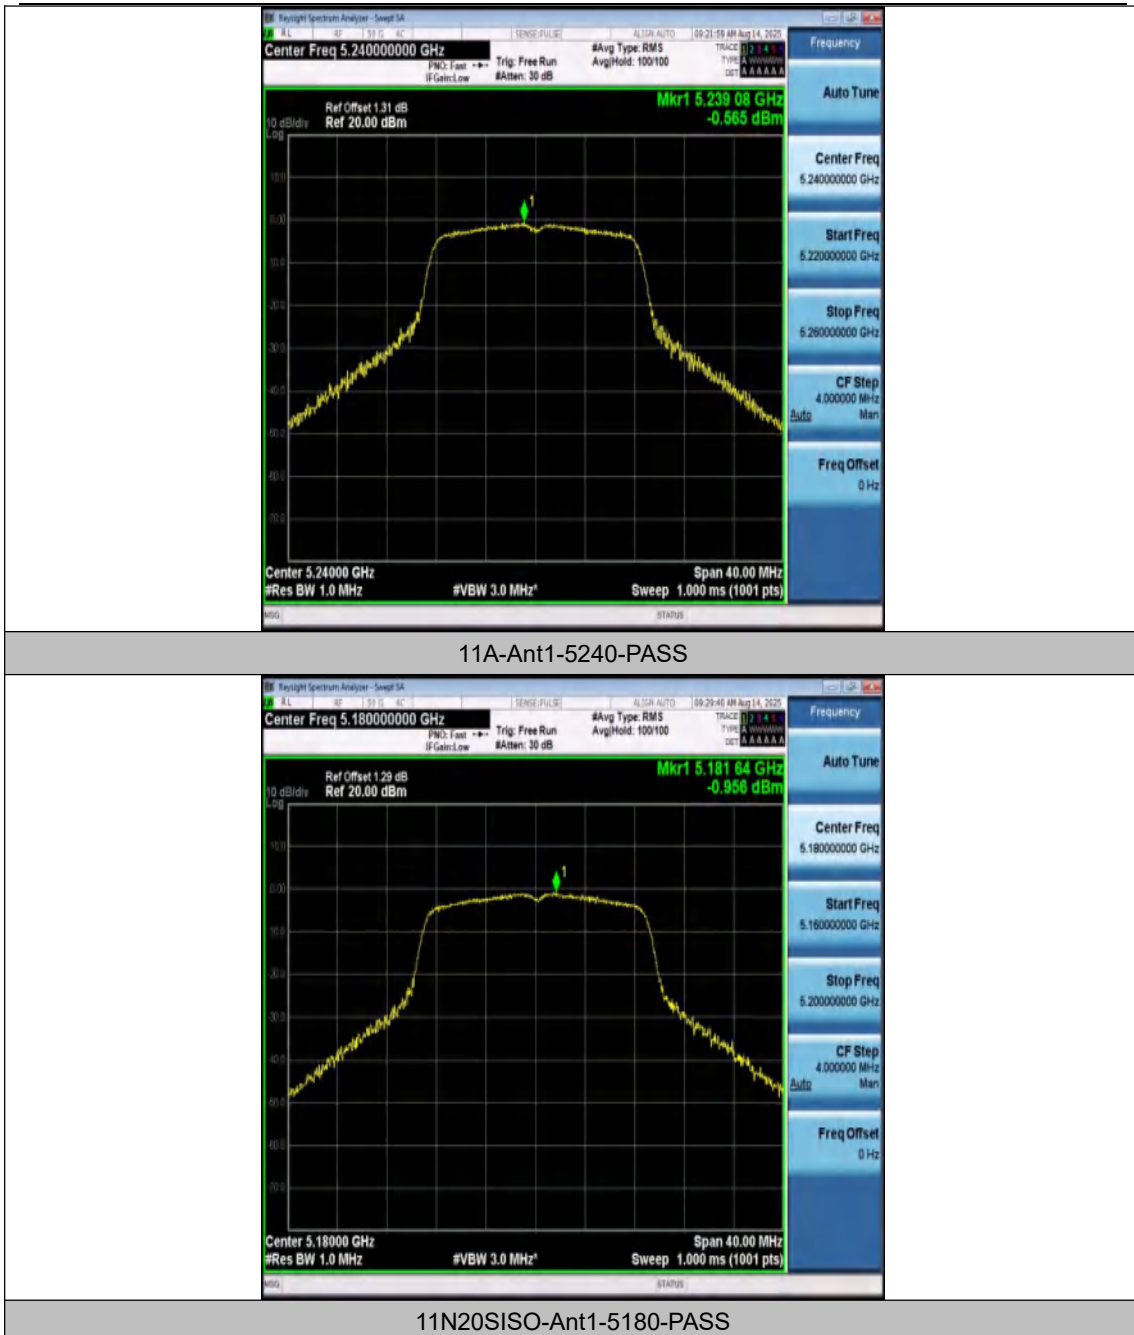

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

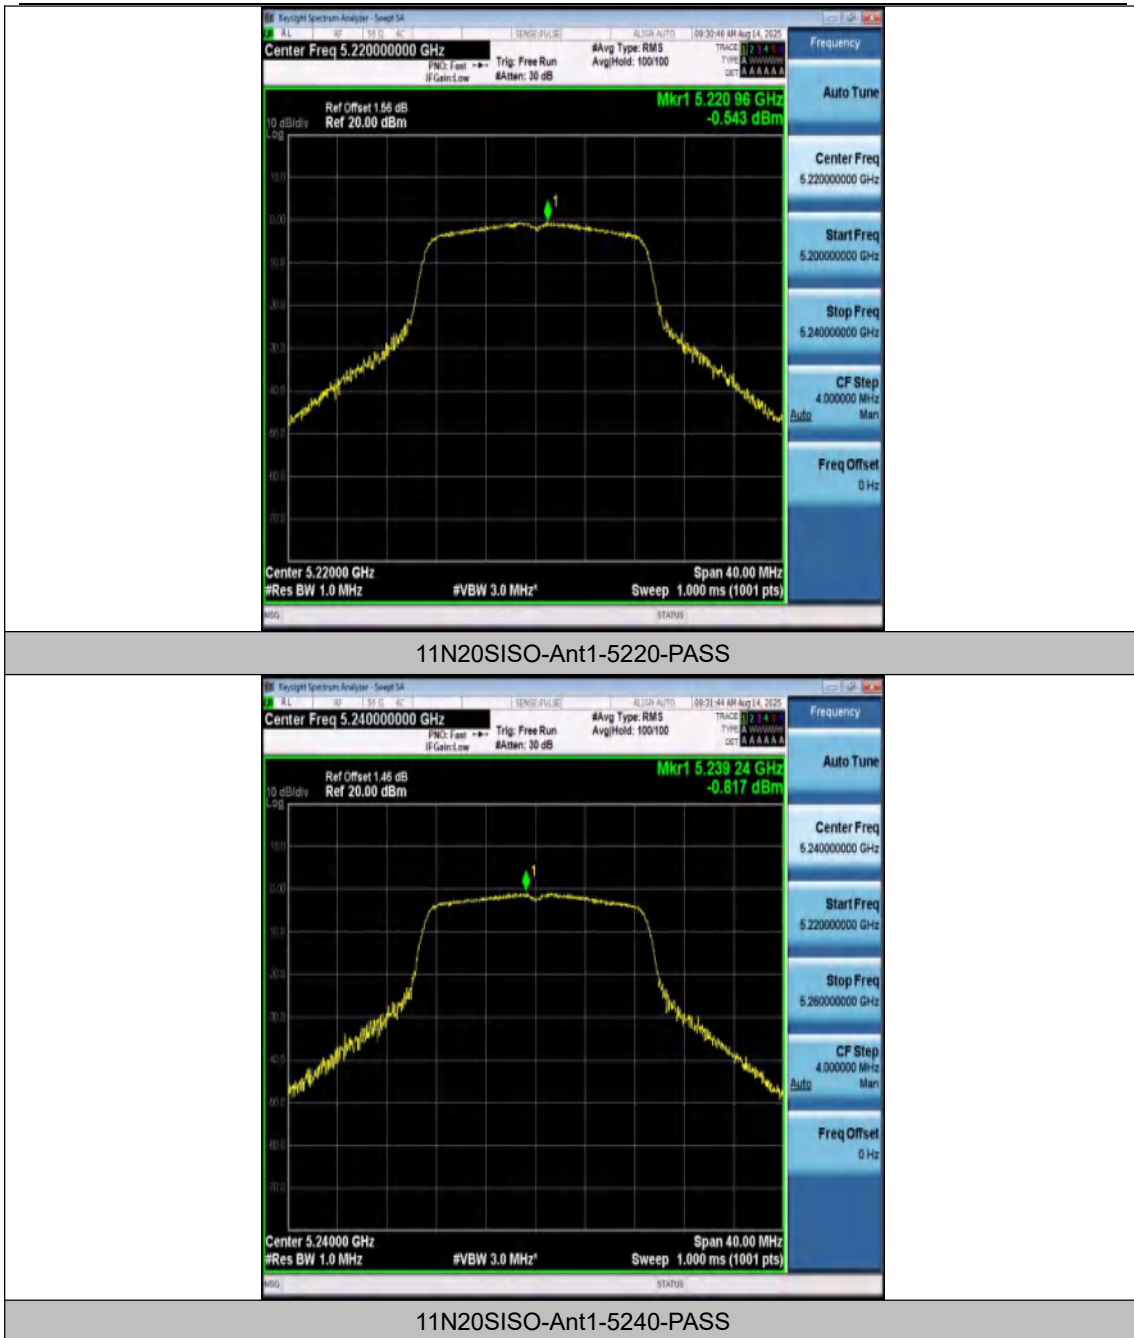

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

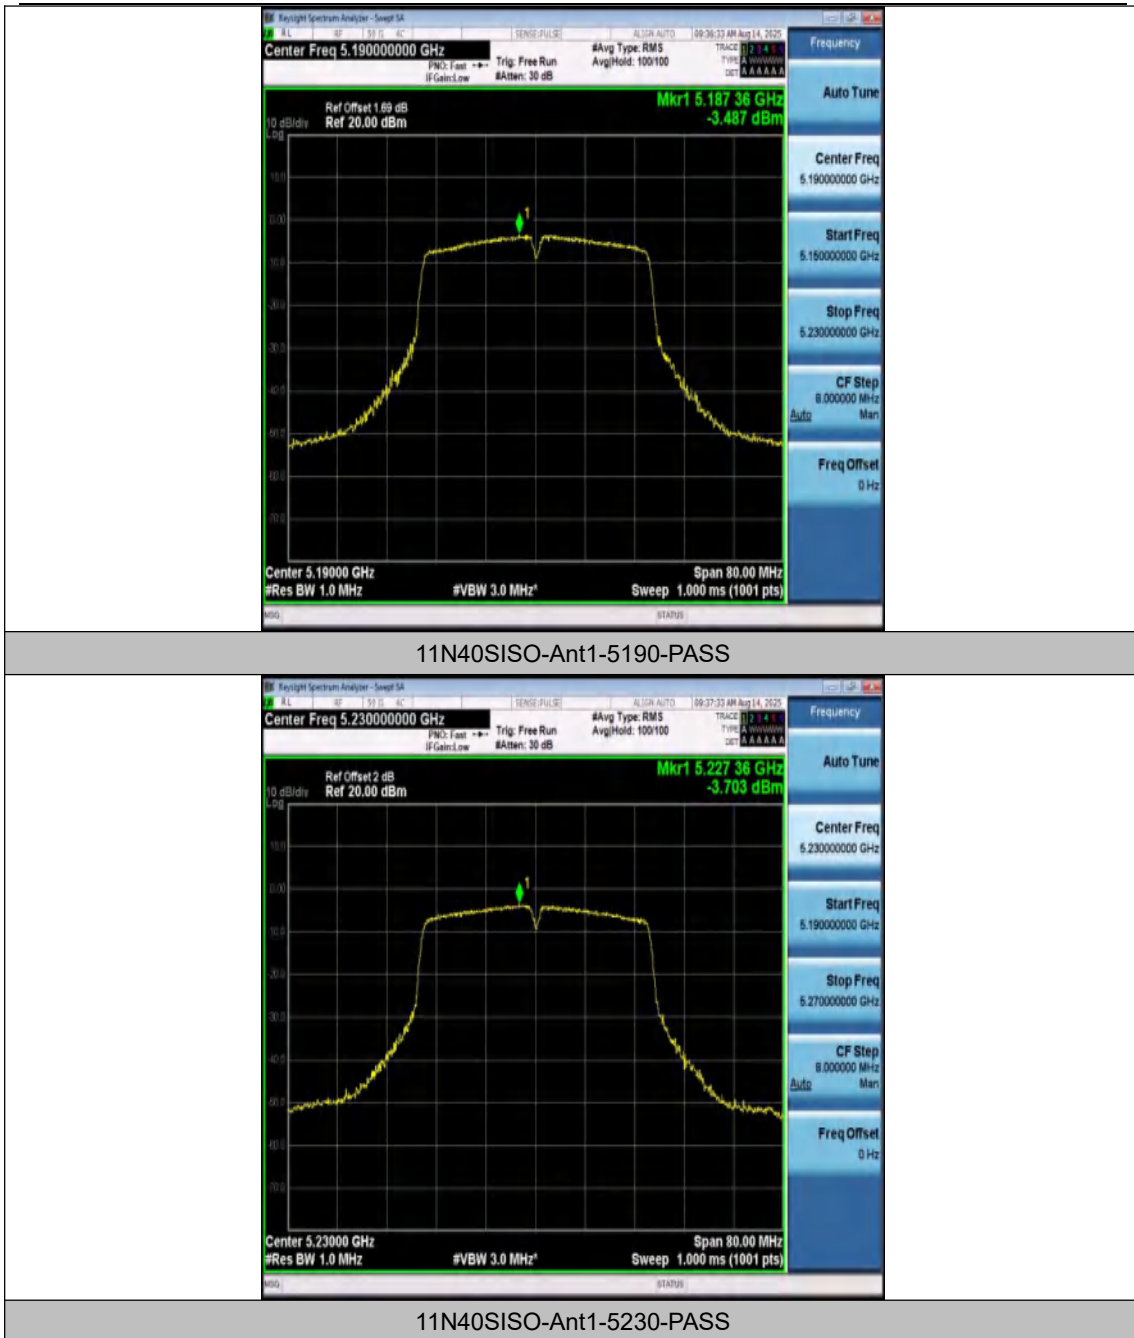

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

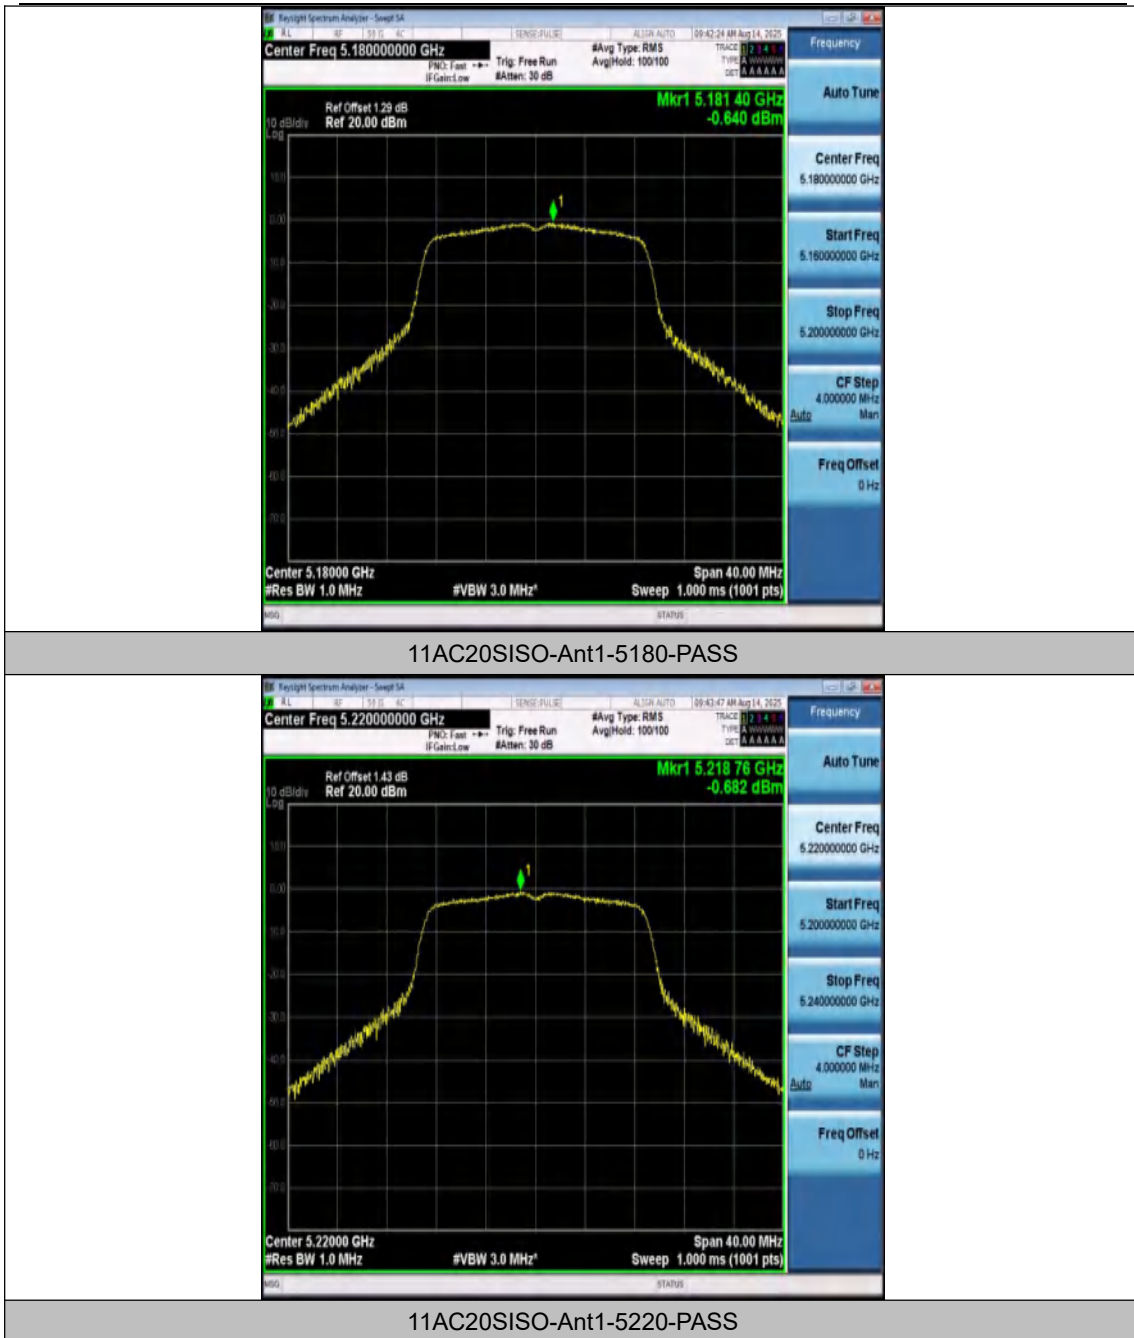

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

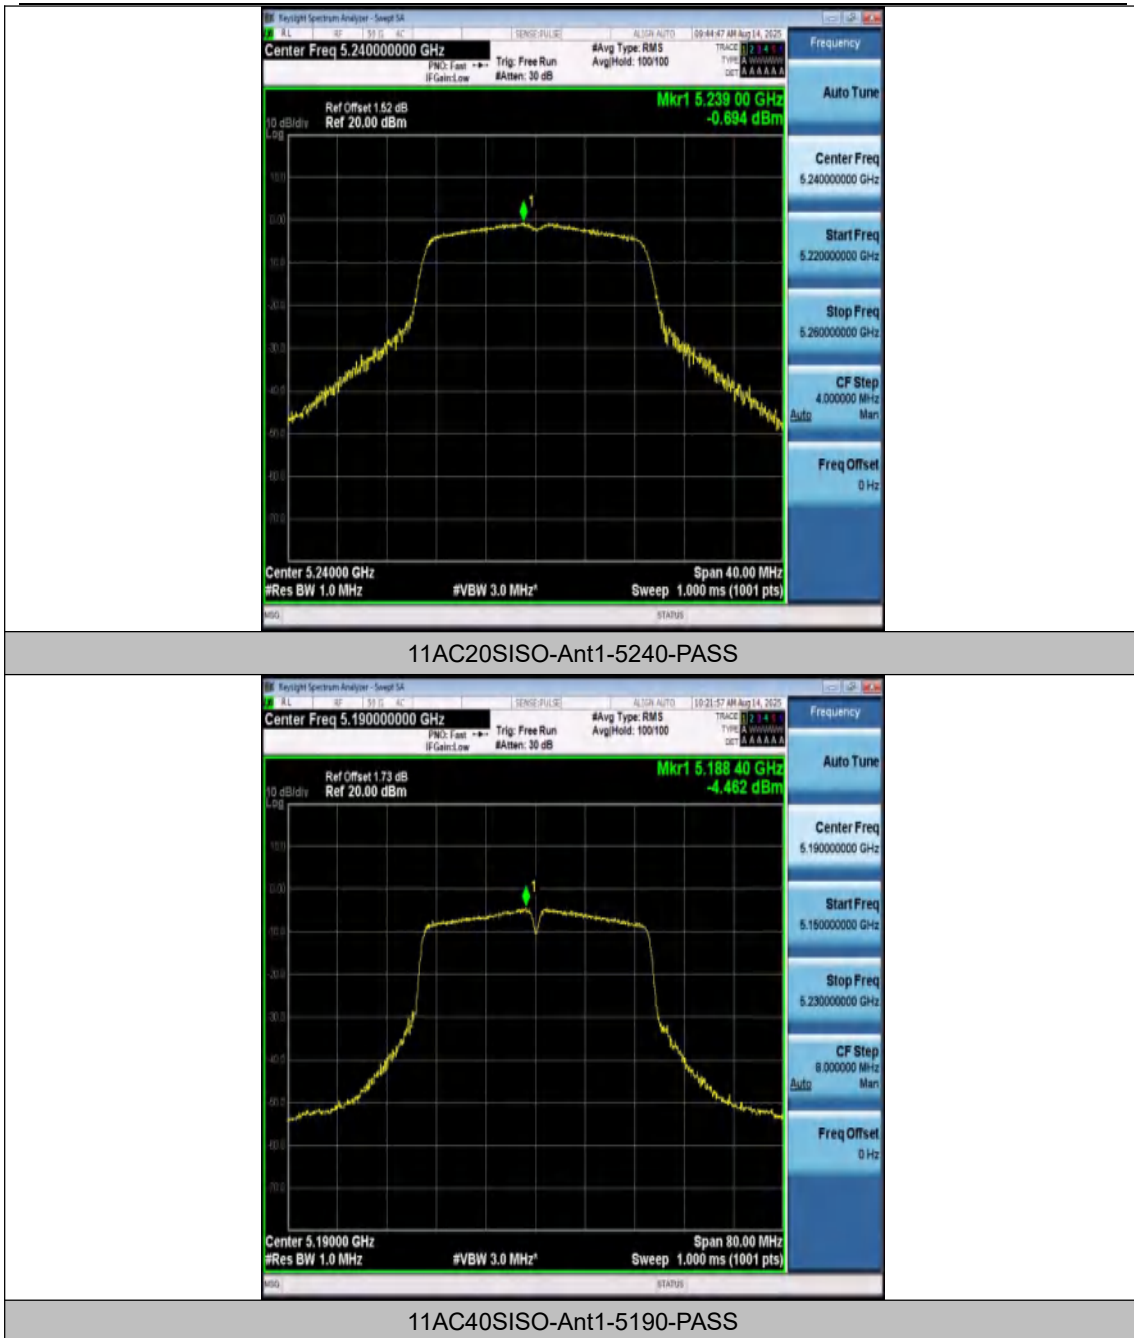

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

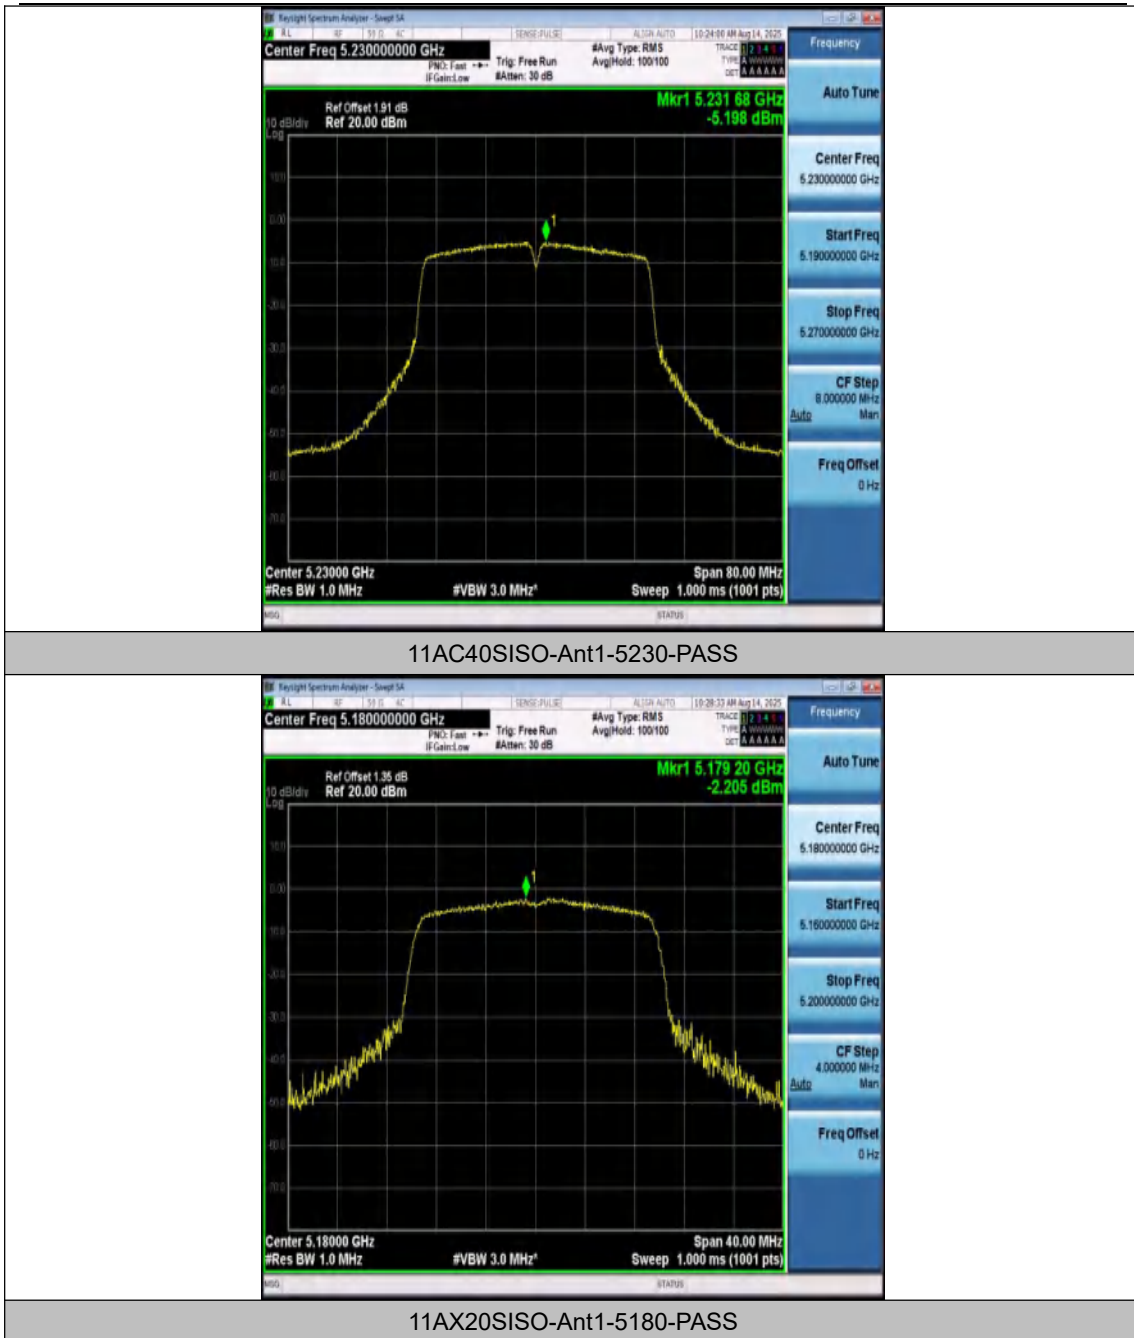

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

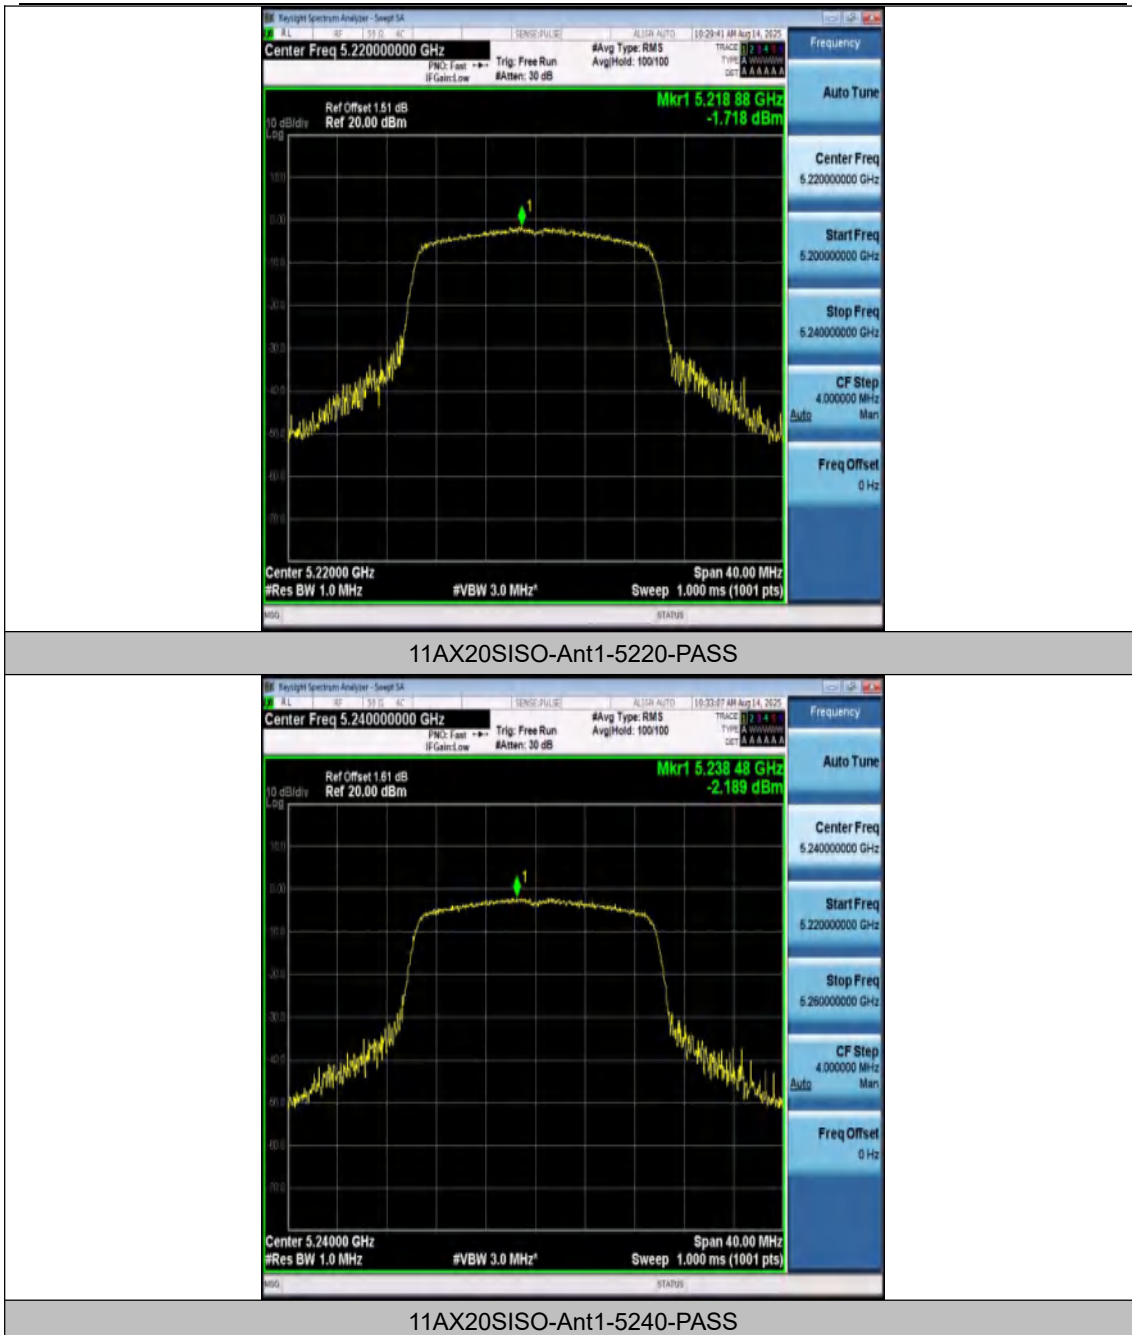

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

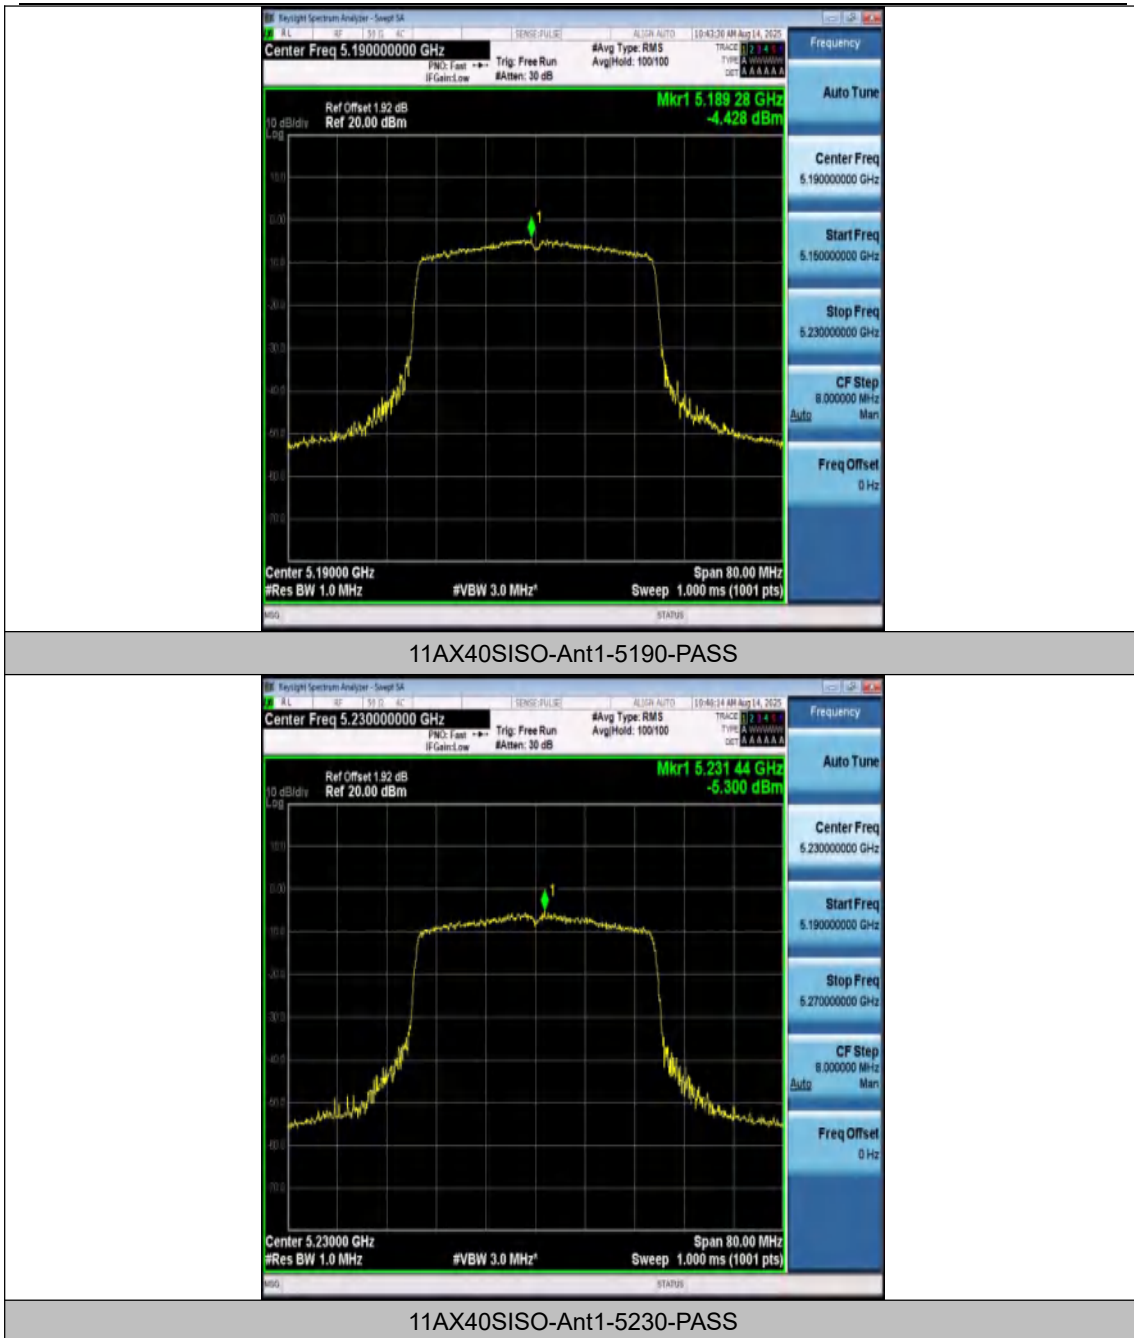



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test GraphsB4

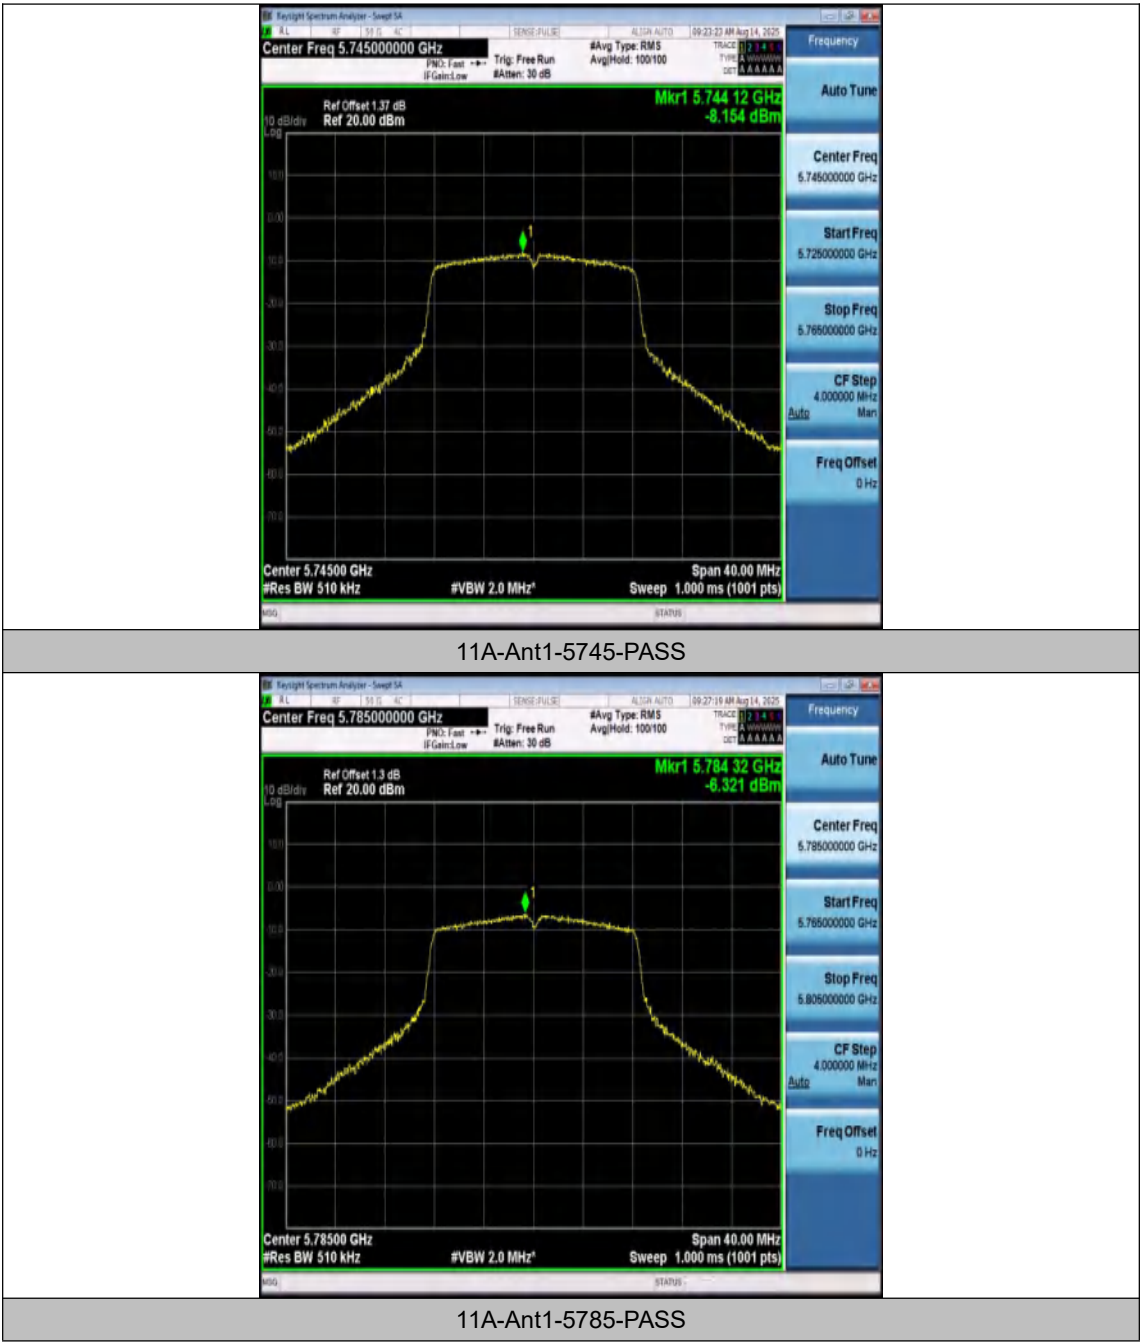


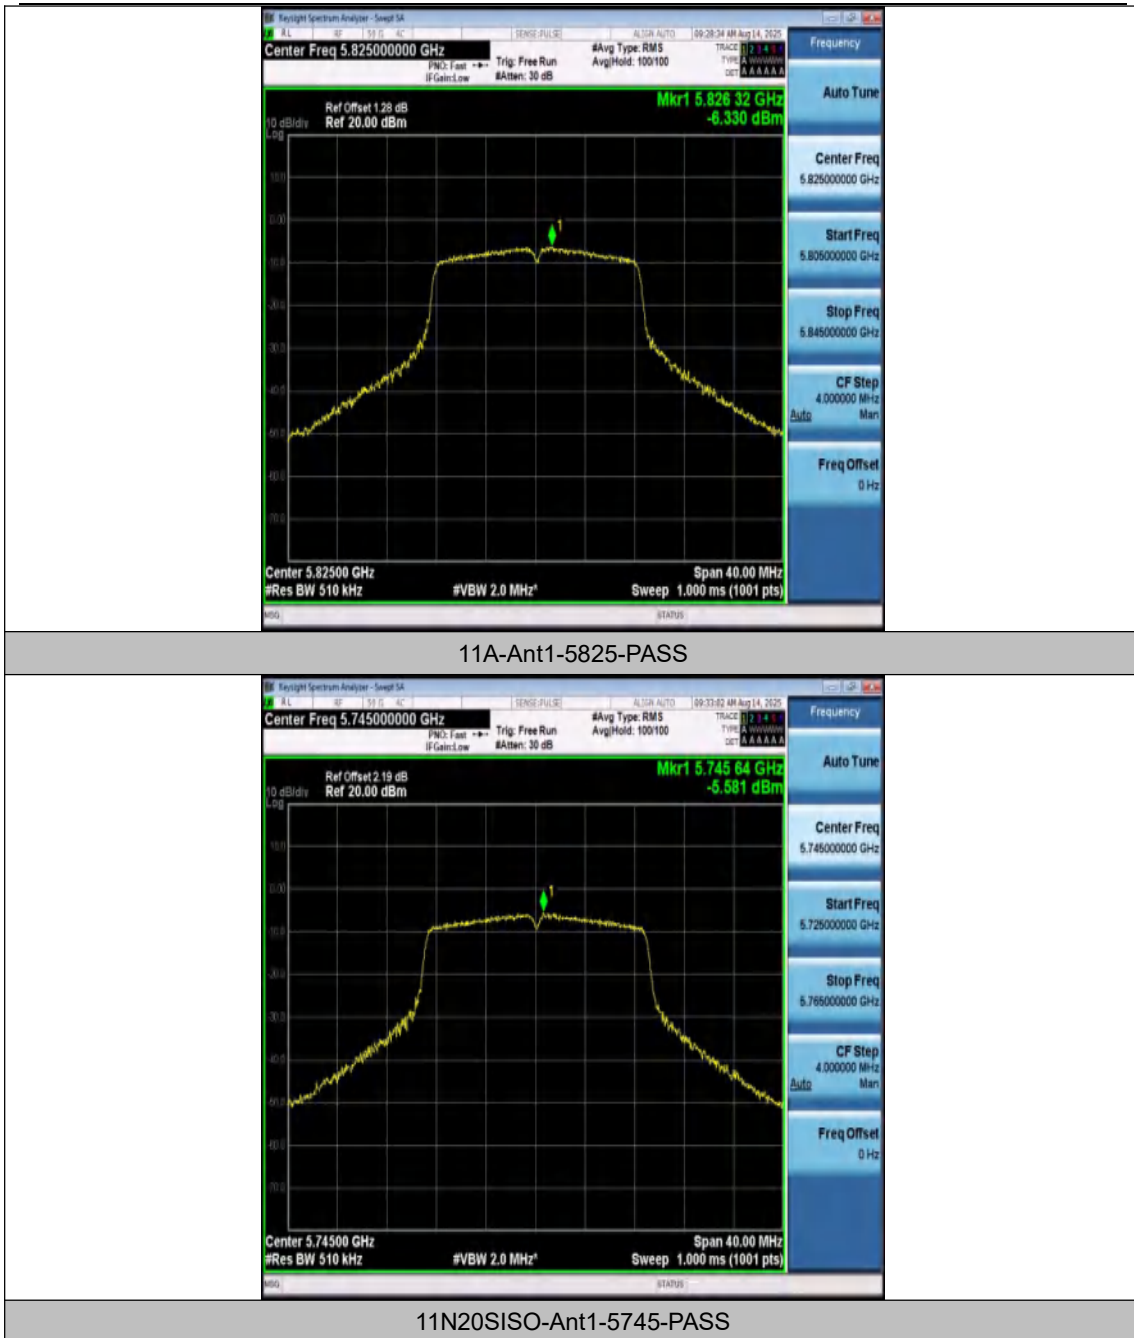

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

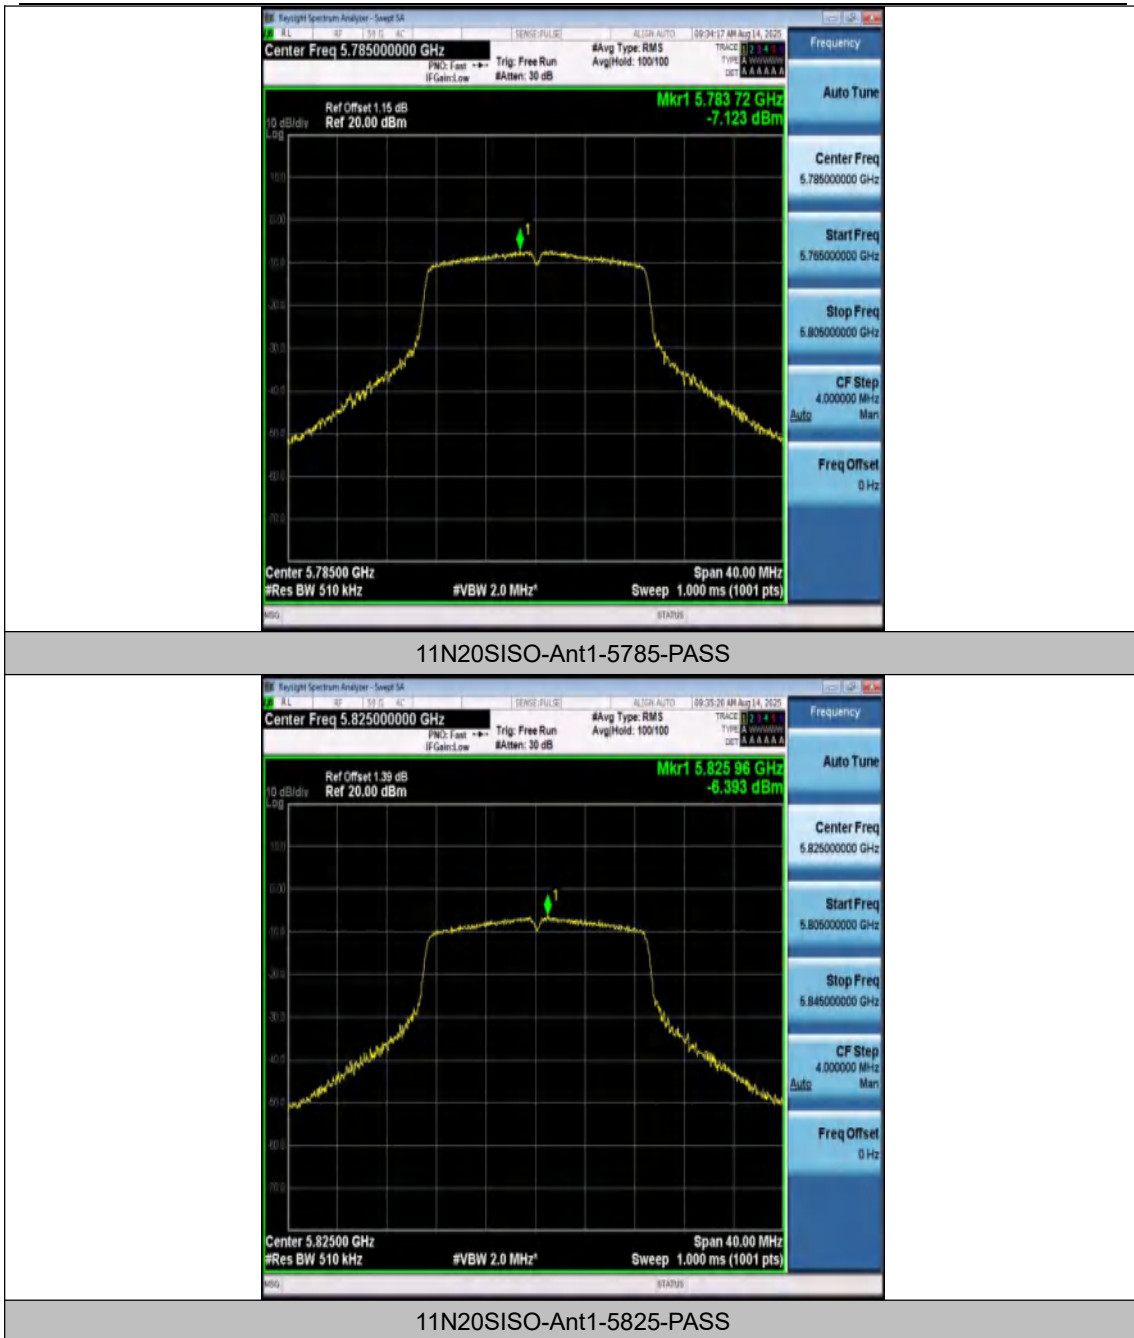

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

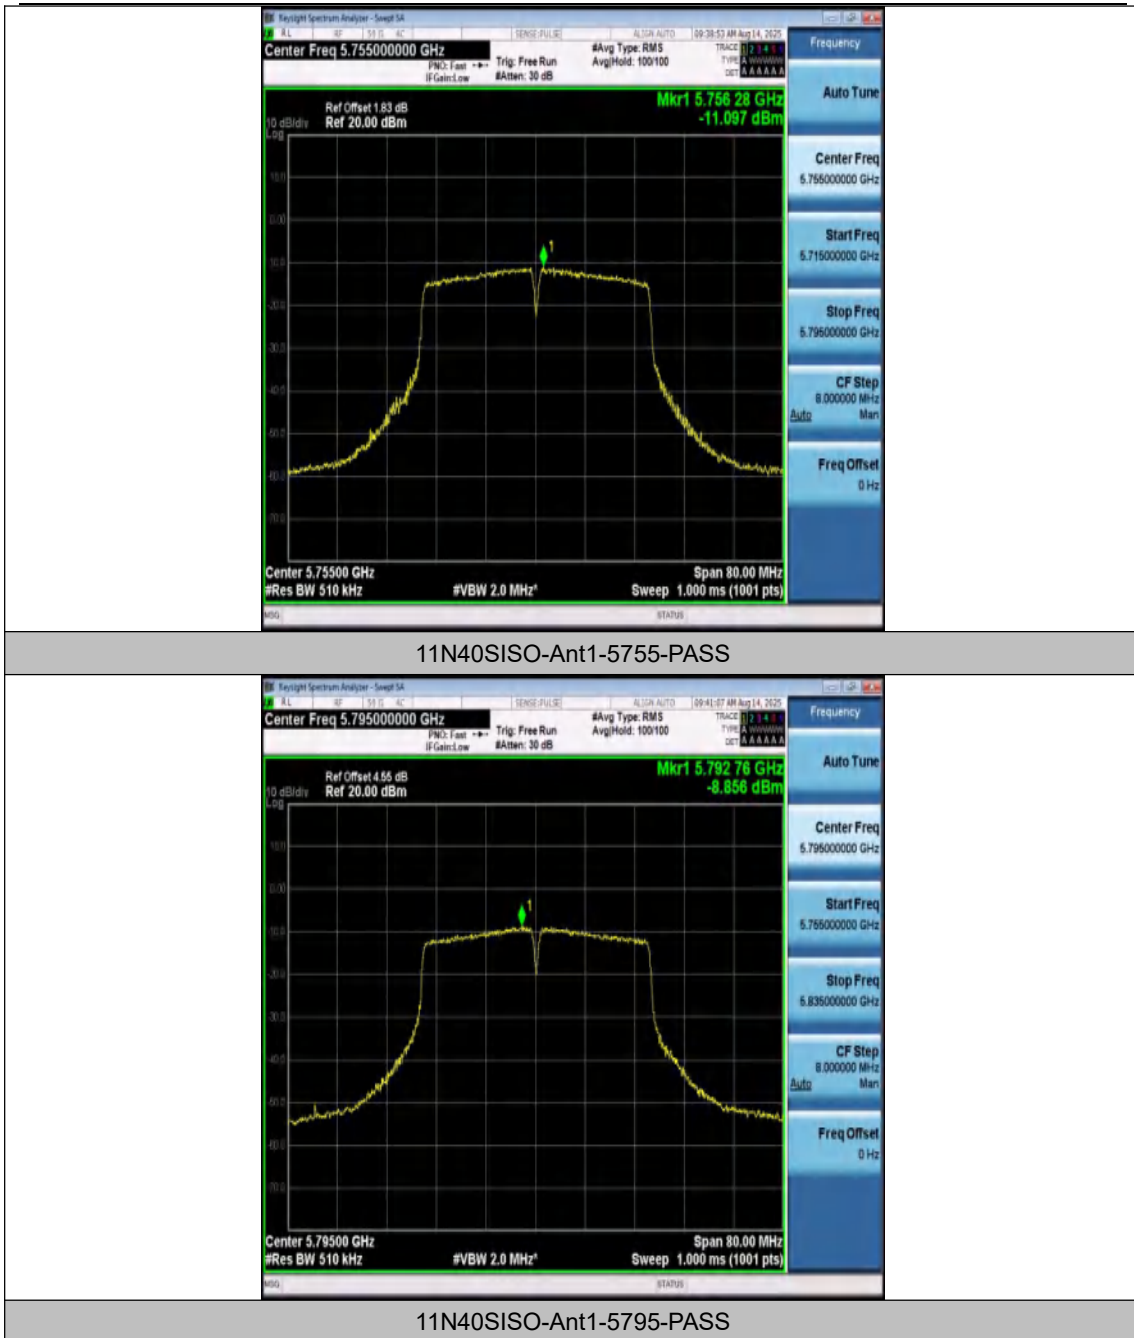

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

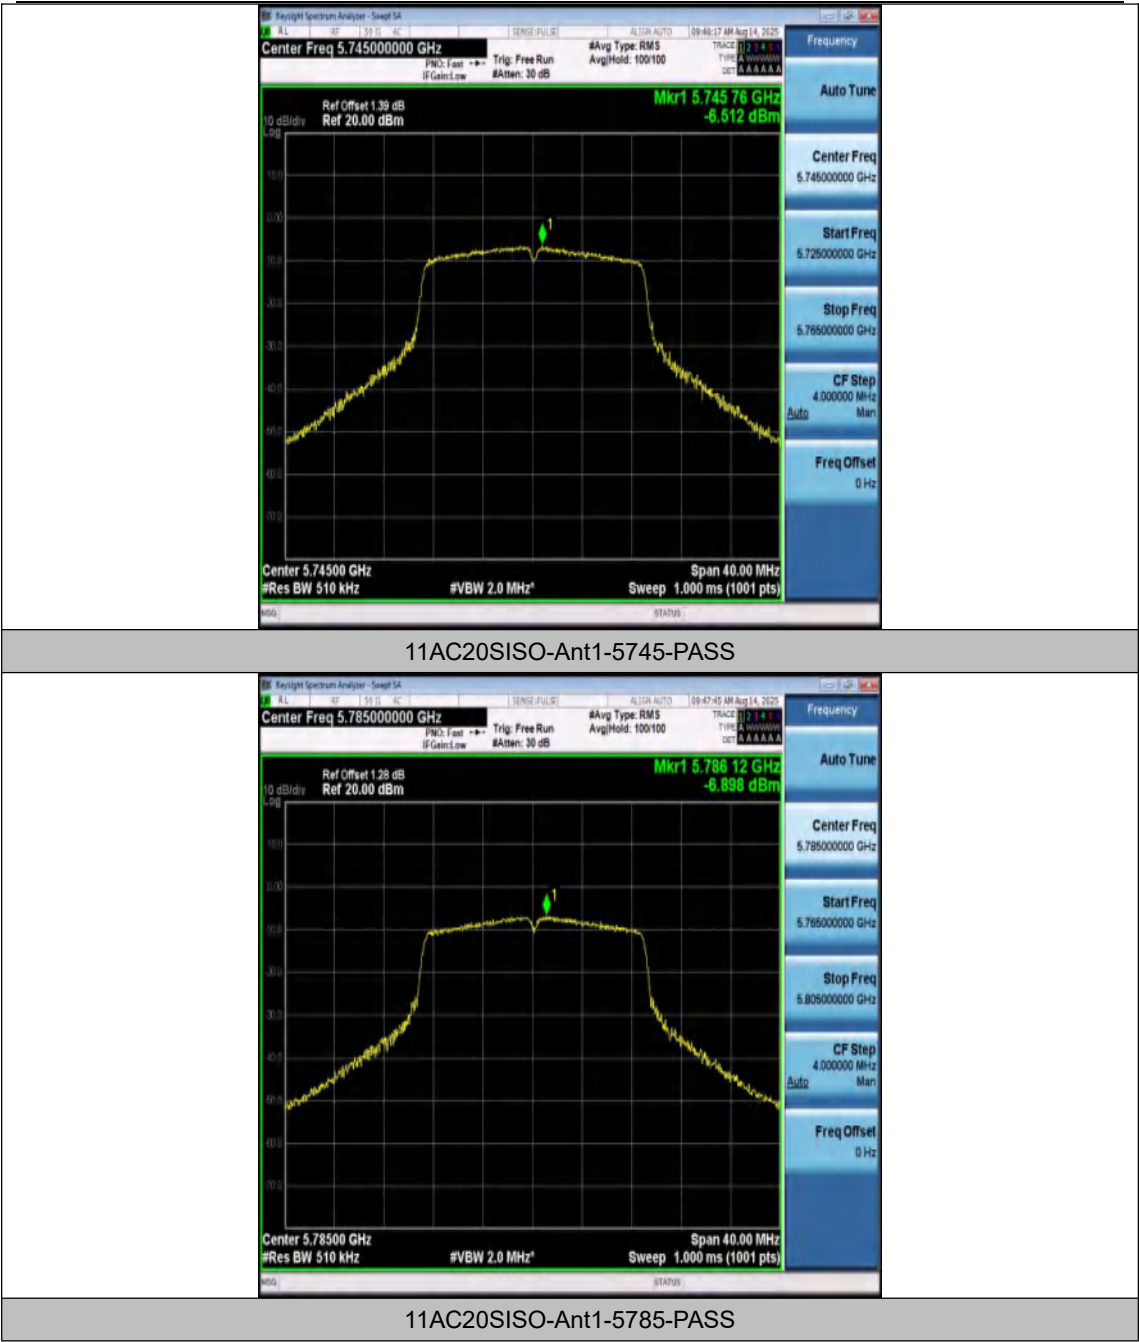

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

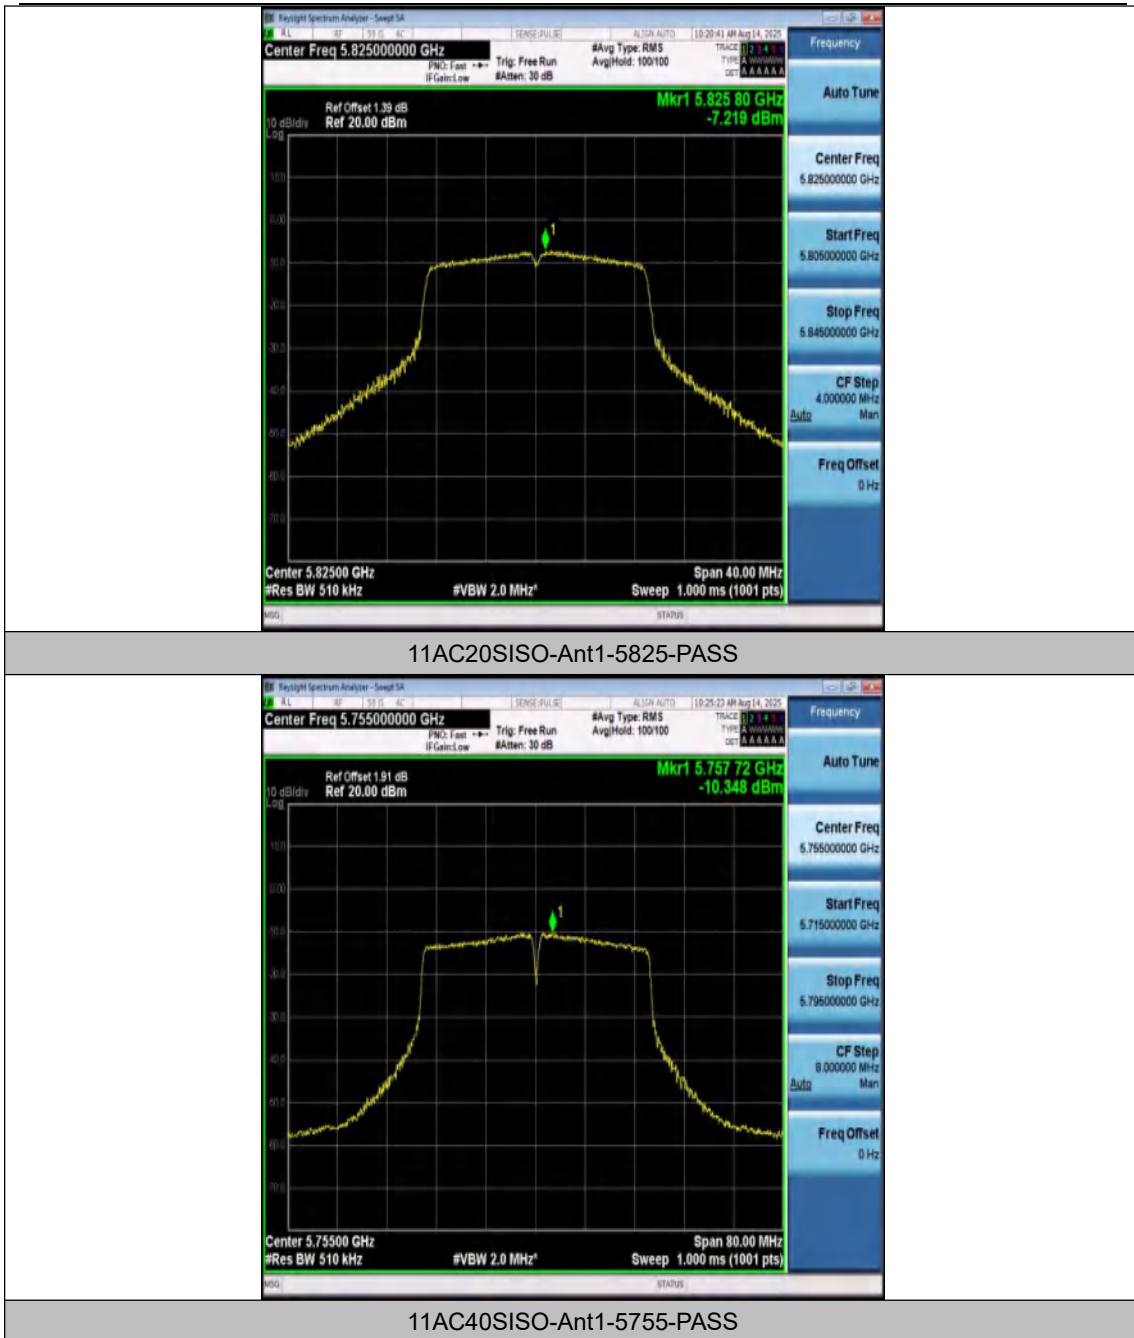

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

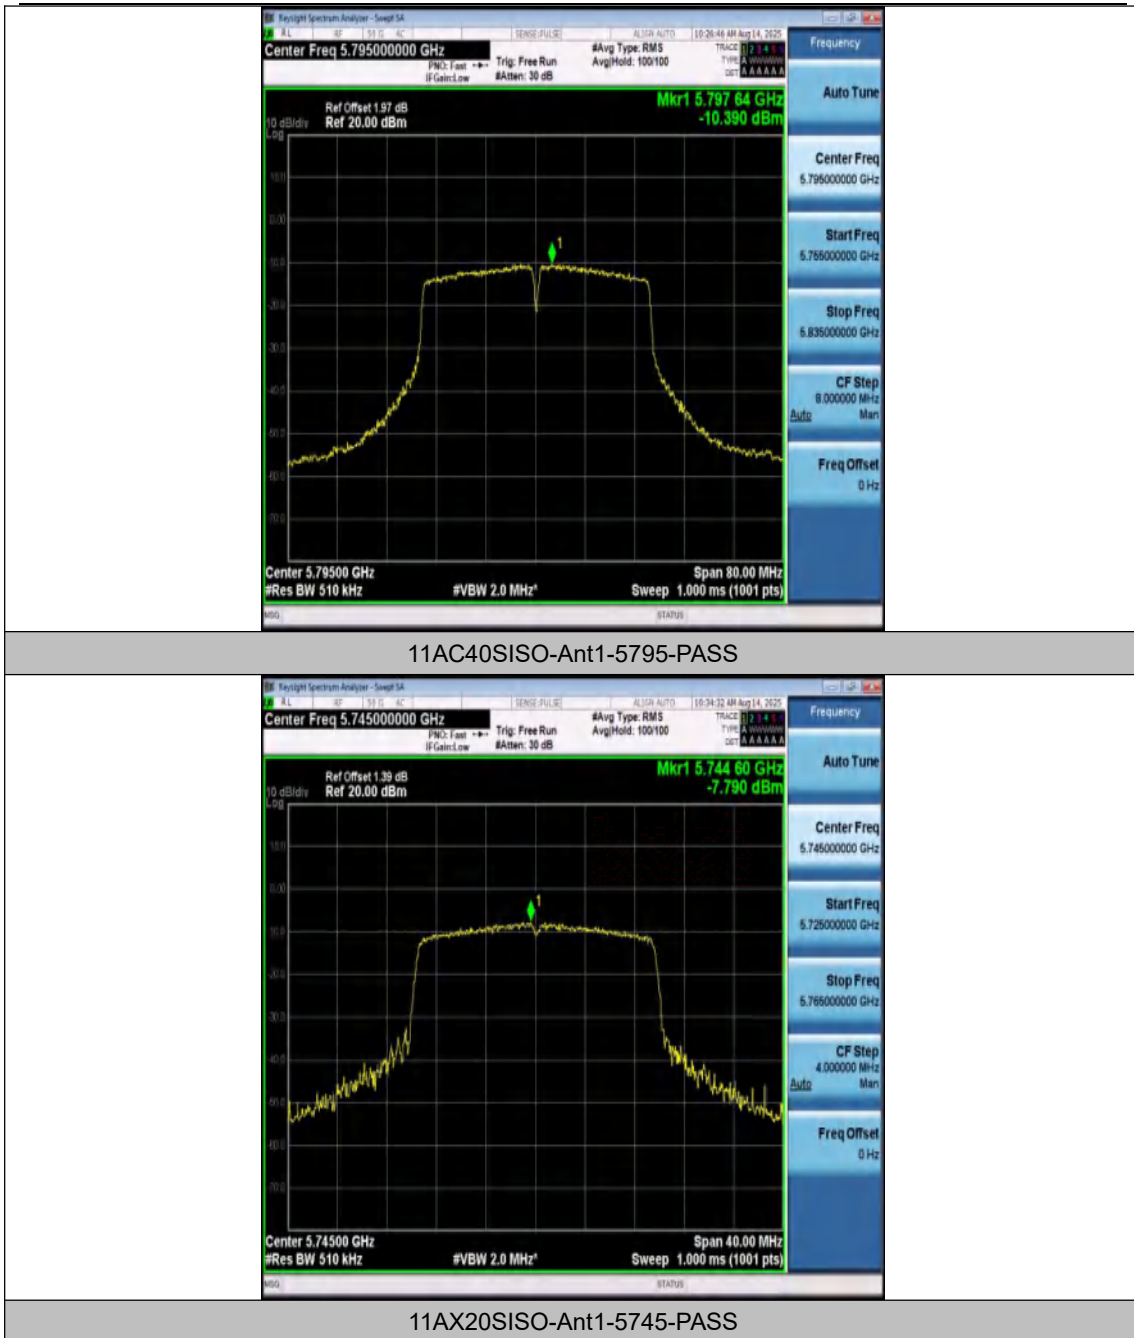

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

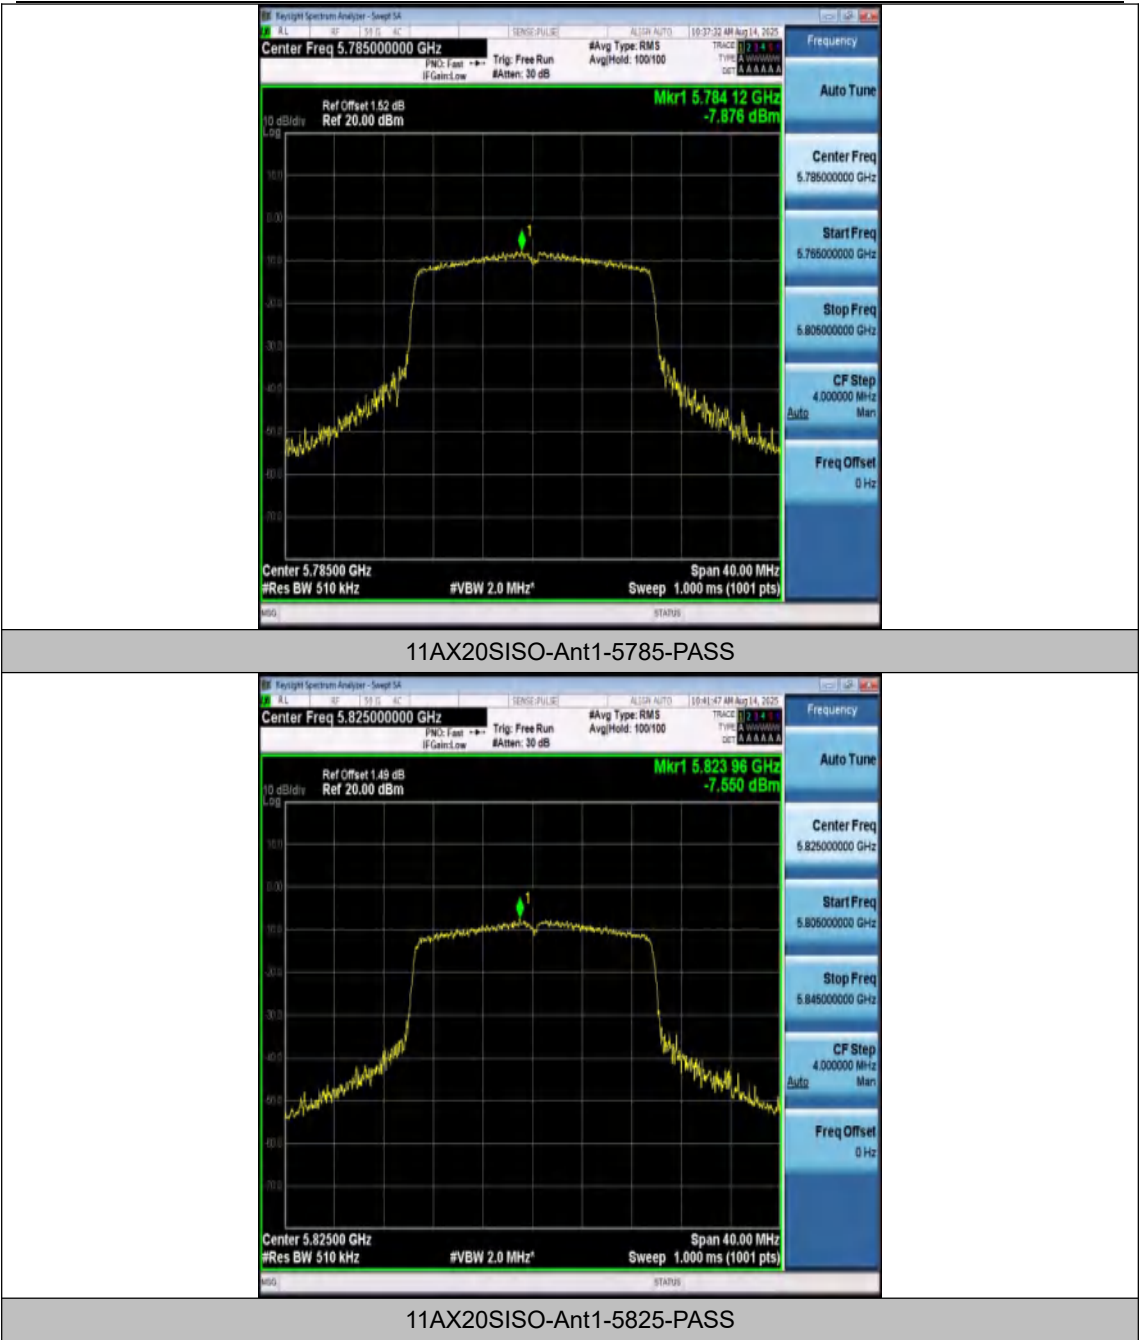

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

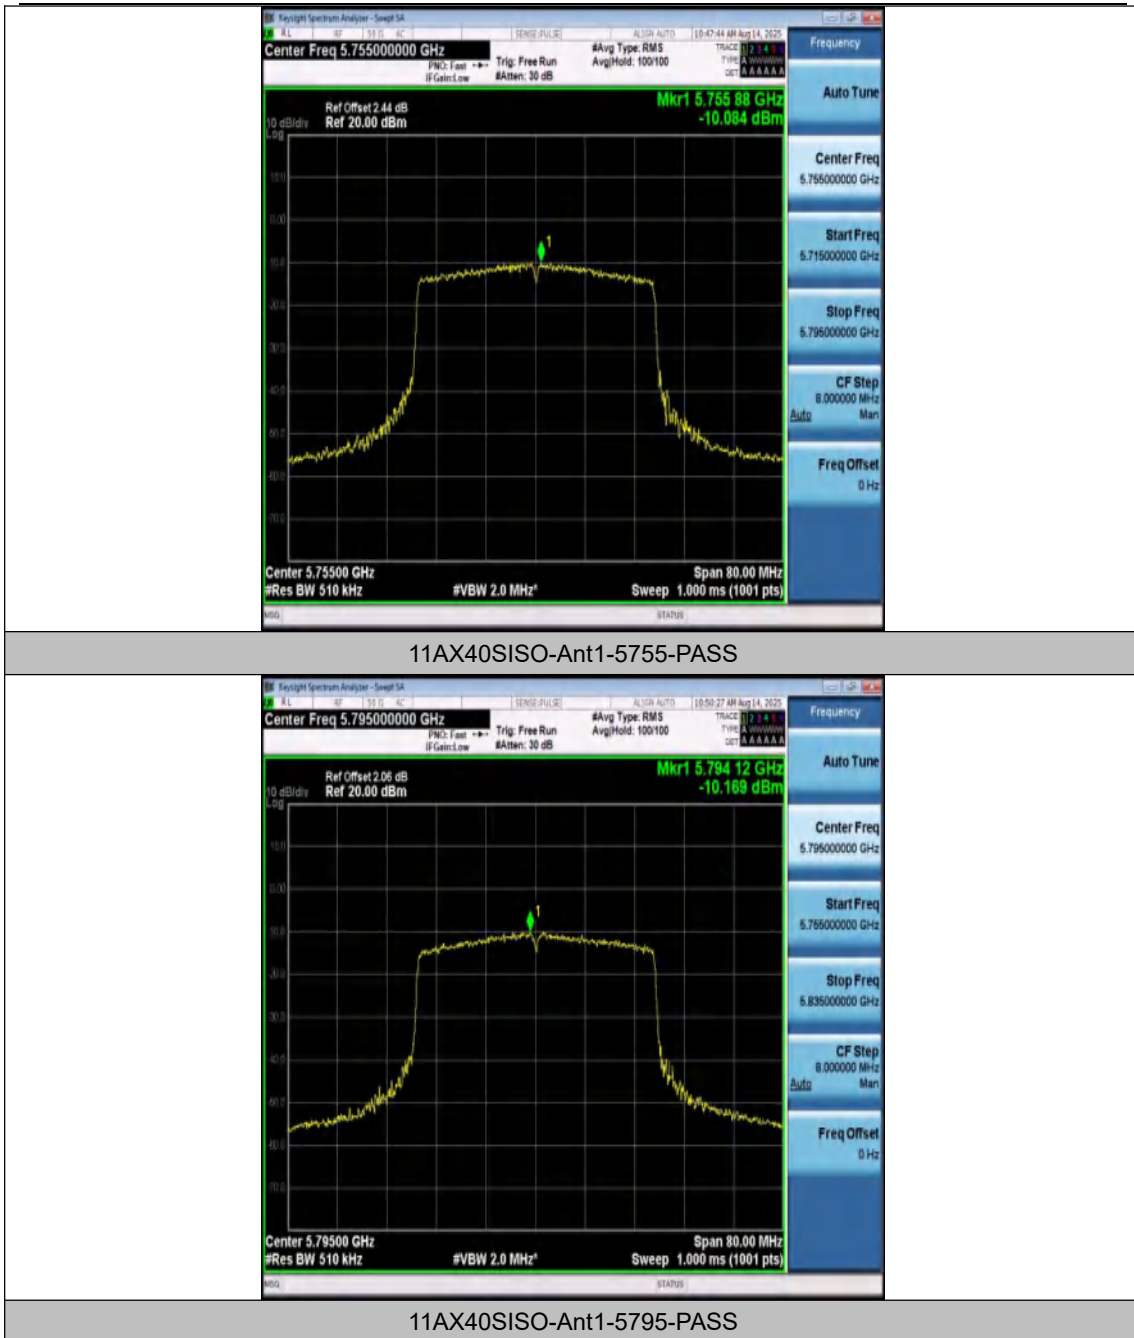

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-37.44	≤-27	PASS
11A	Ant1	High	5240	-49.06	≤-27	PASS
11N20SISO	Ant1	Low	5180	-46.81	≤-27	PASS
11N20SISO	Ant1	High	5240	-48.44	≤-27	PASS
11N40SISO	Ant1	Low	5190	-35.99	≤-27	PASS
11N40SISO	Ant1	High	5230	-48.84	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-46.67	≤-27	PASS
11AC20SISO	Ant1	High	5240	-49.11	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-43.28	≤-27	PASS
11AC40SISO	Ant1	High	5230	-48.19	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-46.72	≤-27	PASS
11AX20SISO	Ant1	High	5240	-48.51	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-46.07	≤-27	PASS
11AX40SISO	Ant1	High	5230	-49.42	≤-27	PASS

Remark:

1. The margin plus the antenna gain also meets the limit.
2. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-42.06	≤17.65	PASS
11A	Ant1	Low	5745	5700~5720	-45.62	≤11.09	PASS
11A	Ant1	Low	5745	5650~5700	-49.75	≤-26.53	PASS
11A	Ant1	Low	5745	5760~5650	-48.88	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-36.25	≤16.34	PASS
11A	Ant1	High	5825	5855~5875	-35.46	≤11.12	PASS
11A	Ant1	High	5825	5875~5925	-38.06	≤-26.21	PASS
11A	Ant1	High	5825	5925~5935	-37.44	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-36.9	≤19.75	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-37.87	≤14.11	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-50.51	≤-26.96	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-47.96	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-36.79	≤16.34	PASS
11N20SISO	Ant1	High	5825	5855~5875	-36.94	≤10.81	PASS
11N20SISO	Ant1	High	5825	5875~5925	-37.9	≤-24.01	PASS
11N20SISO	Ant1	High	5825	5925~5935	-36.45	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-37.82	≤18.81	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-40.61	≤14.94	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-50.66	≤-26.80	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-49.54	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-47.87	≤15.66	PASS
11N40SISO	Ant1	High	5795	5855~5875	-48.54	≤10.43	PASS
11N40SISO	Ant1	High	5795	5875~5925	-46.5	≤-26.83	PASS
11N40SISO	Ant1	High	5795	5925~5935	-45.32	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-39.59	≤18.44	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-45.2	≤10.38	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-48.72	≤-25.85	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-48.79	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-45.73	≤16.03	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-47.24	≤10.02	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-49.99	≤-26.51	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-48.53	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-42.99	≤15.74	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-38.59	≤15.24	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-49.95	≤-25.80	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-49.11	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-48.32	≤15.66	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-48.56	≤10.80	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-46.91	≤-26.34	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AC40SISO	Ant1	High	5795	5925~5935	-45.93	≤ -27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-29.57	≤ 22.37	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-46.02	≤ 10.86	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-49.57	≤ -25.93	PASS
11AX20SISO	Ant1	Low	5745	5760~5650	-49.81	≤ -27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-39.88	≤ 16.03	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-36.92	≤ 11.19	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-40.77	≤ -26.91	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-37.71	≤ -27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-36.18	≤ 16.04	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-39.37	≤ 15.47	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-50.05	≤ -26.80	PASS
11AX40SISO	Ant1	Low	5755	5780~5650	-49.47	≤ -27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-48.03	≤ 15.66	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-48.46	≤ 10.89	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-48.61	≤ -25.85	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-49.06	≤ -27	PASS


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

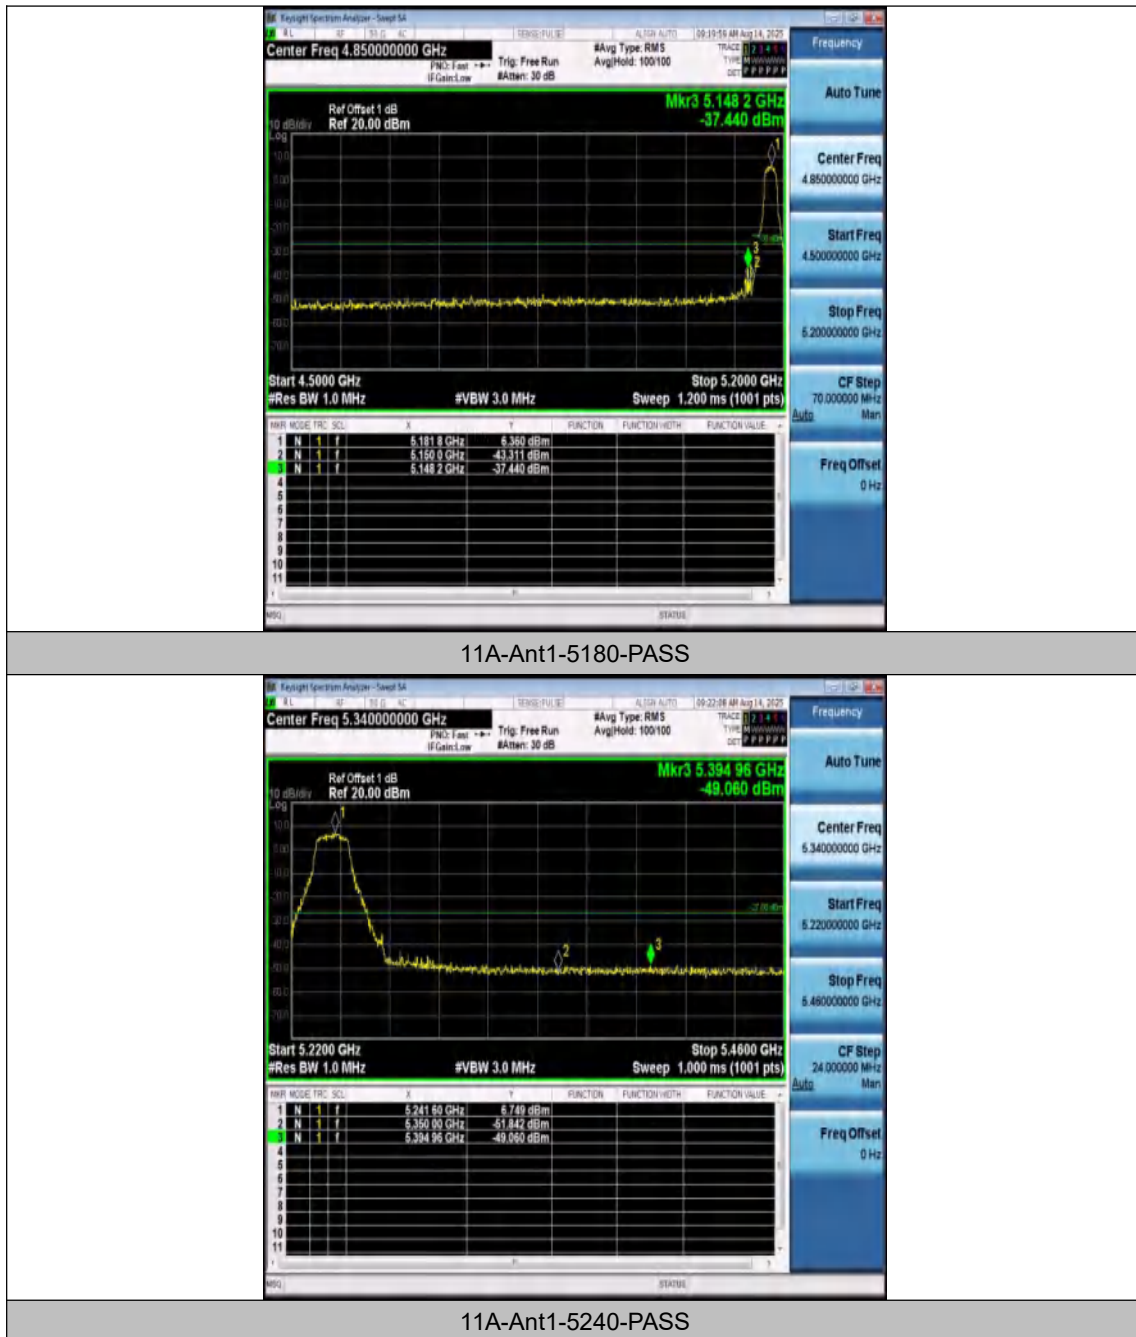


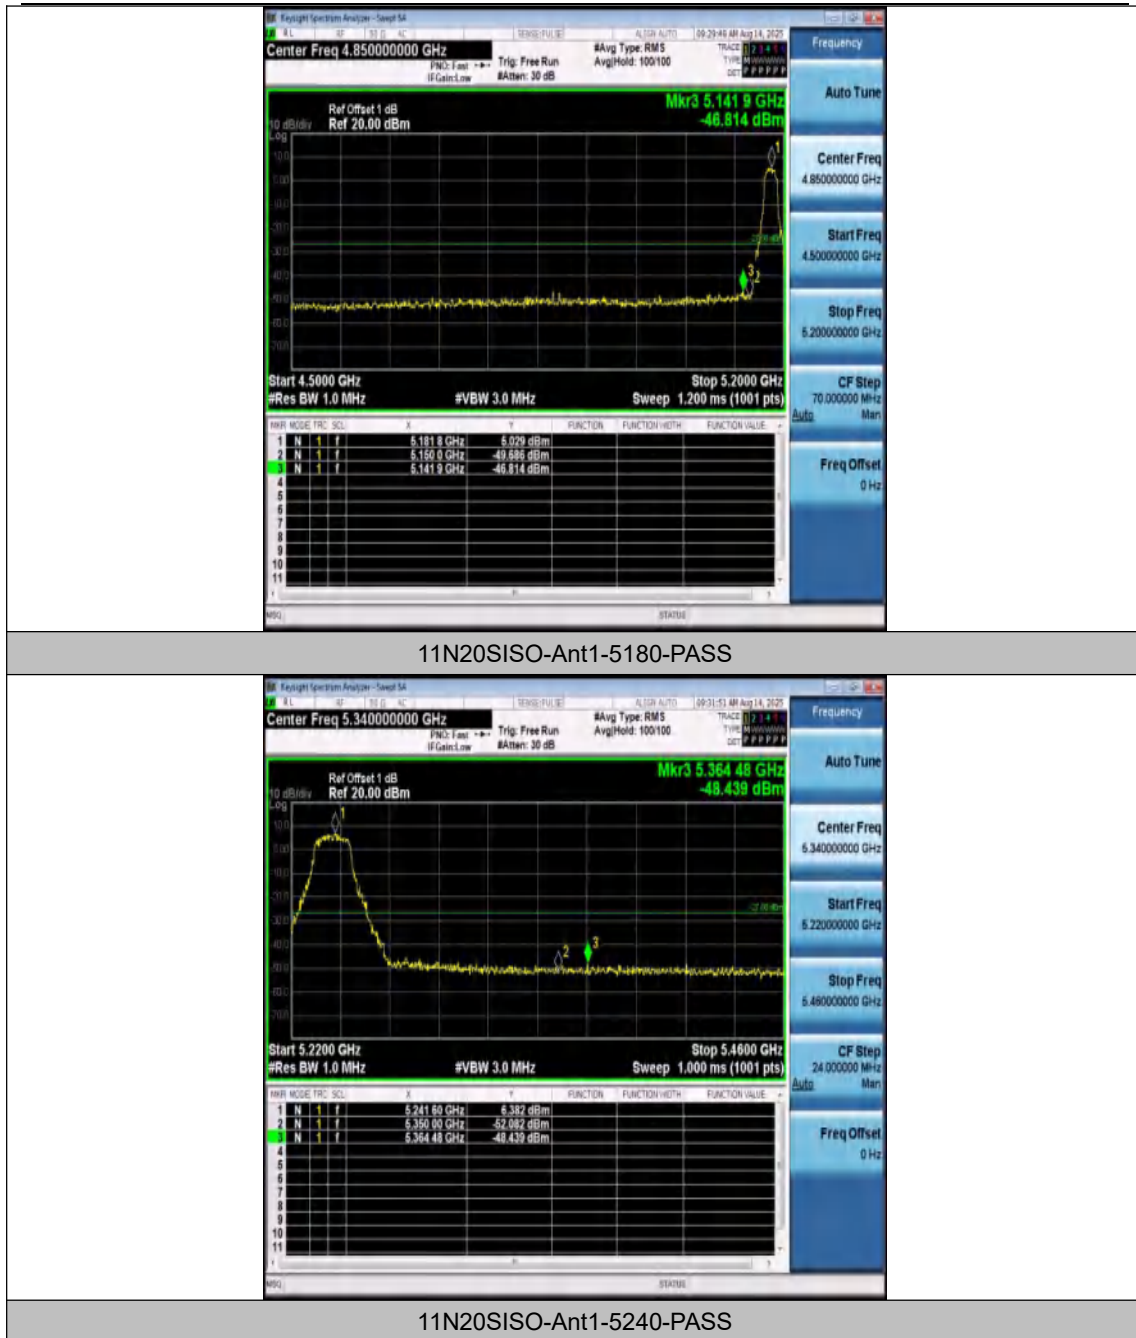


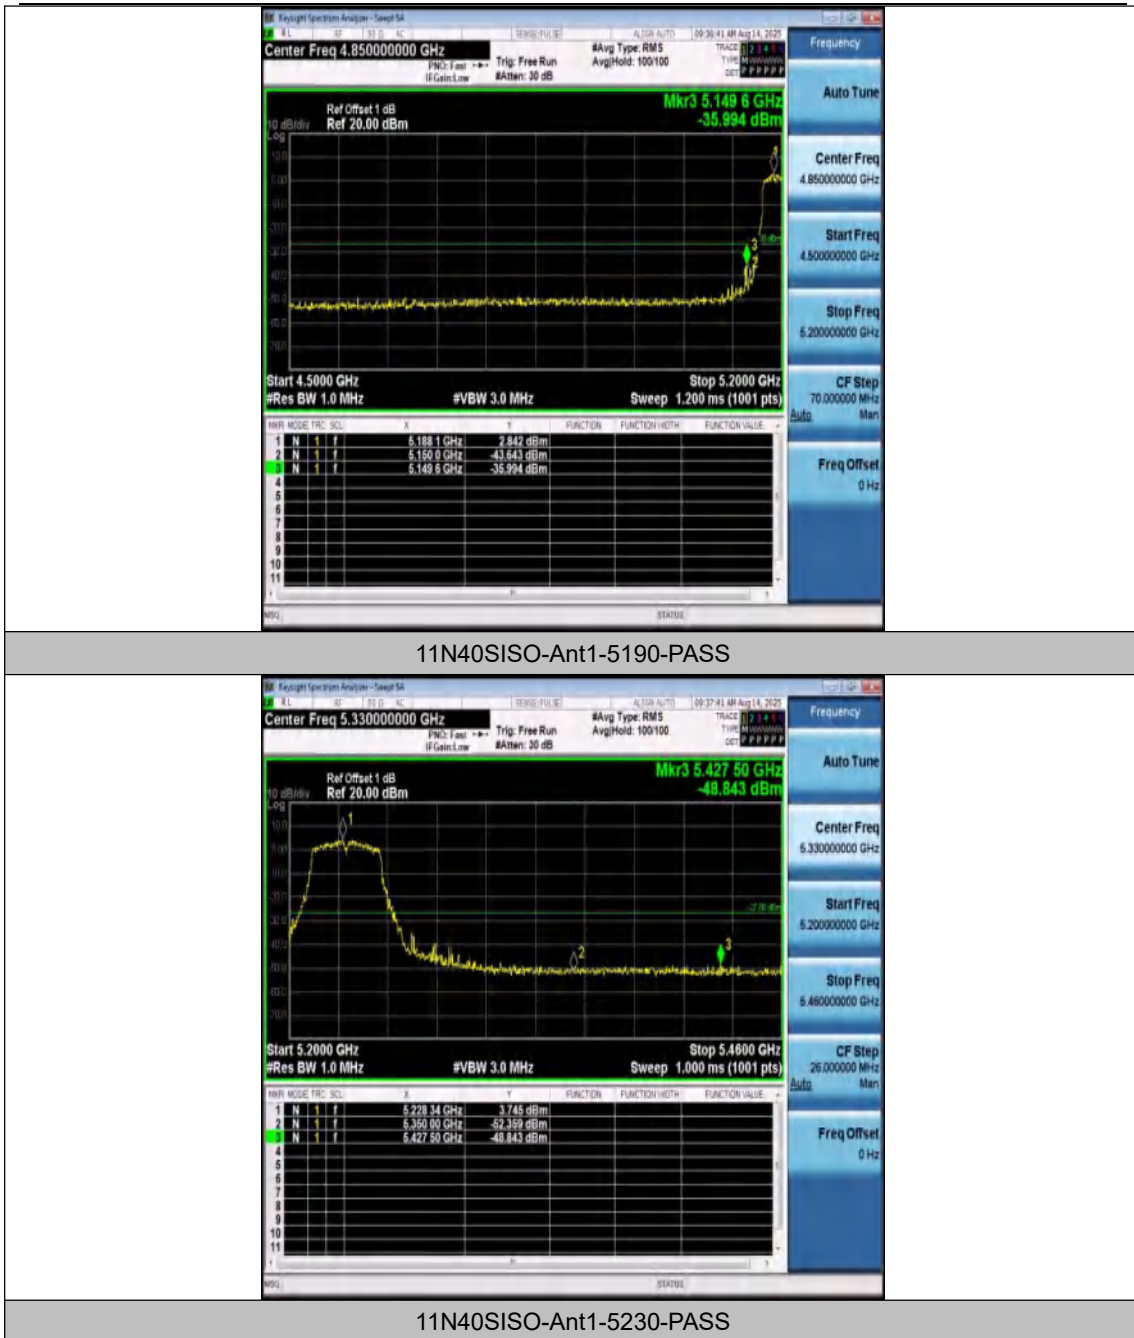

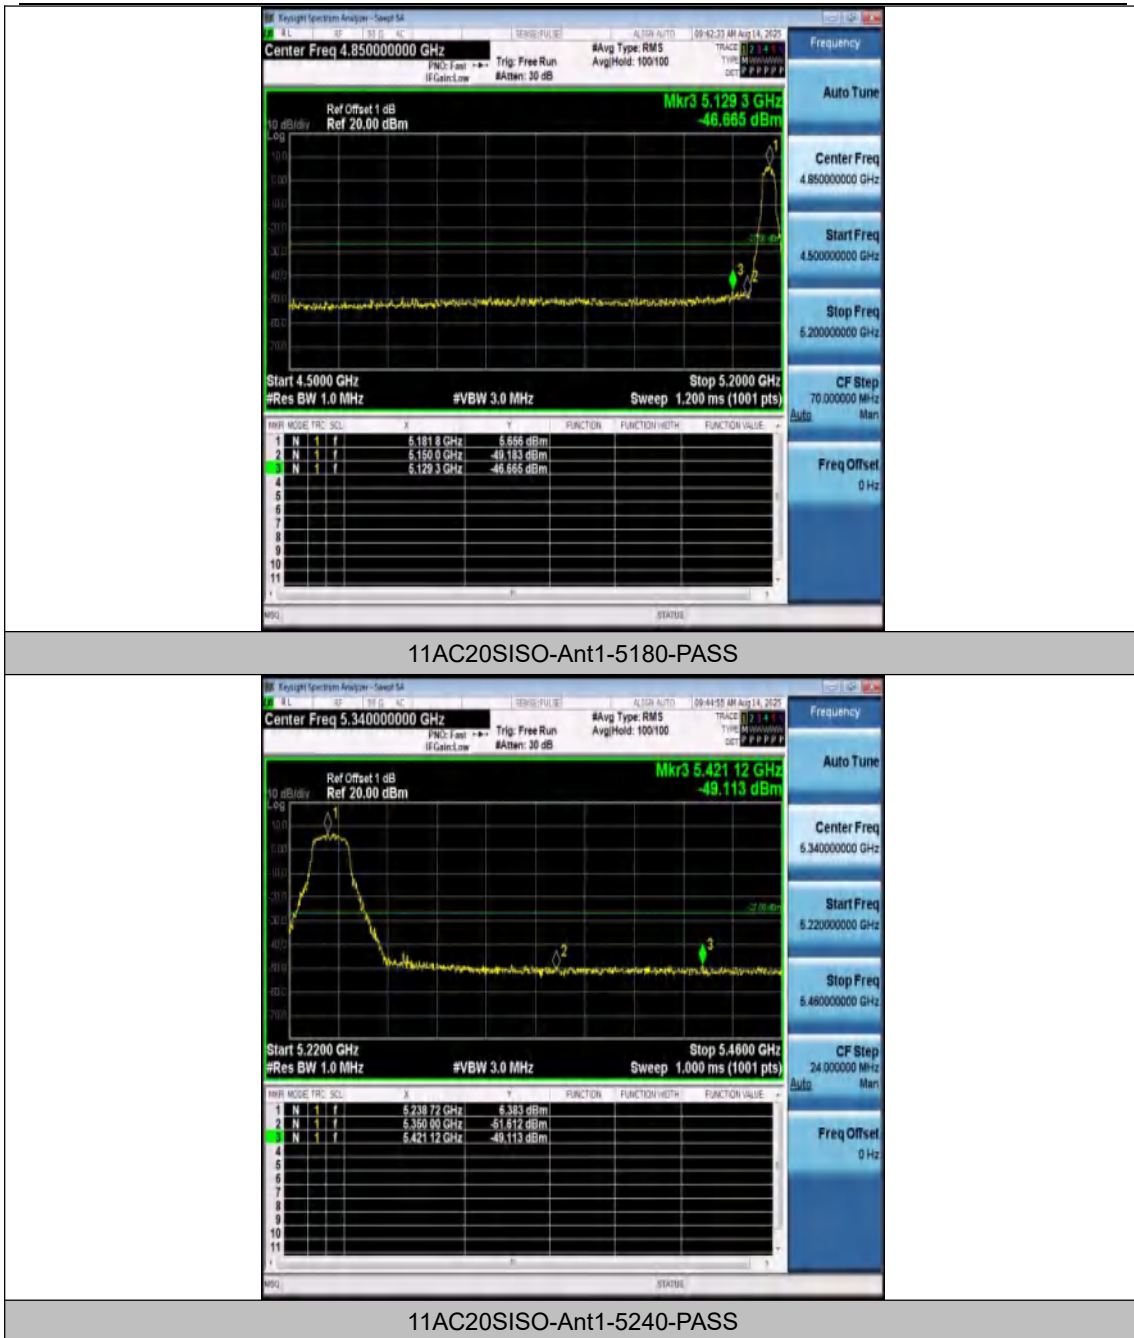

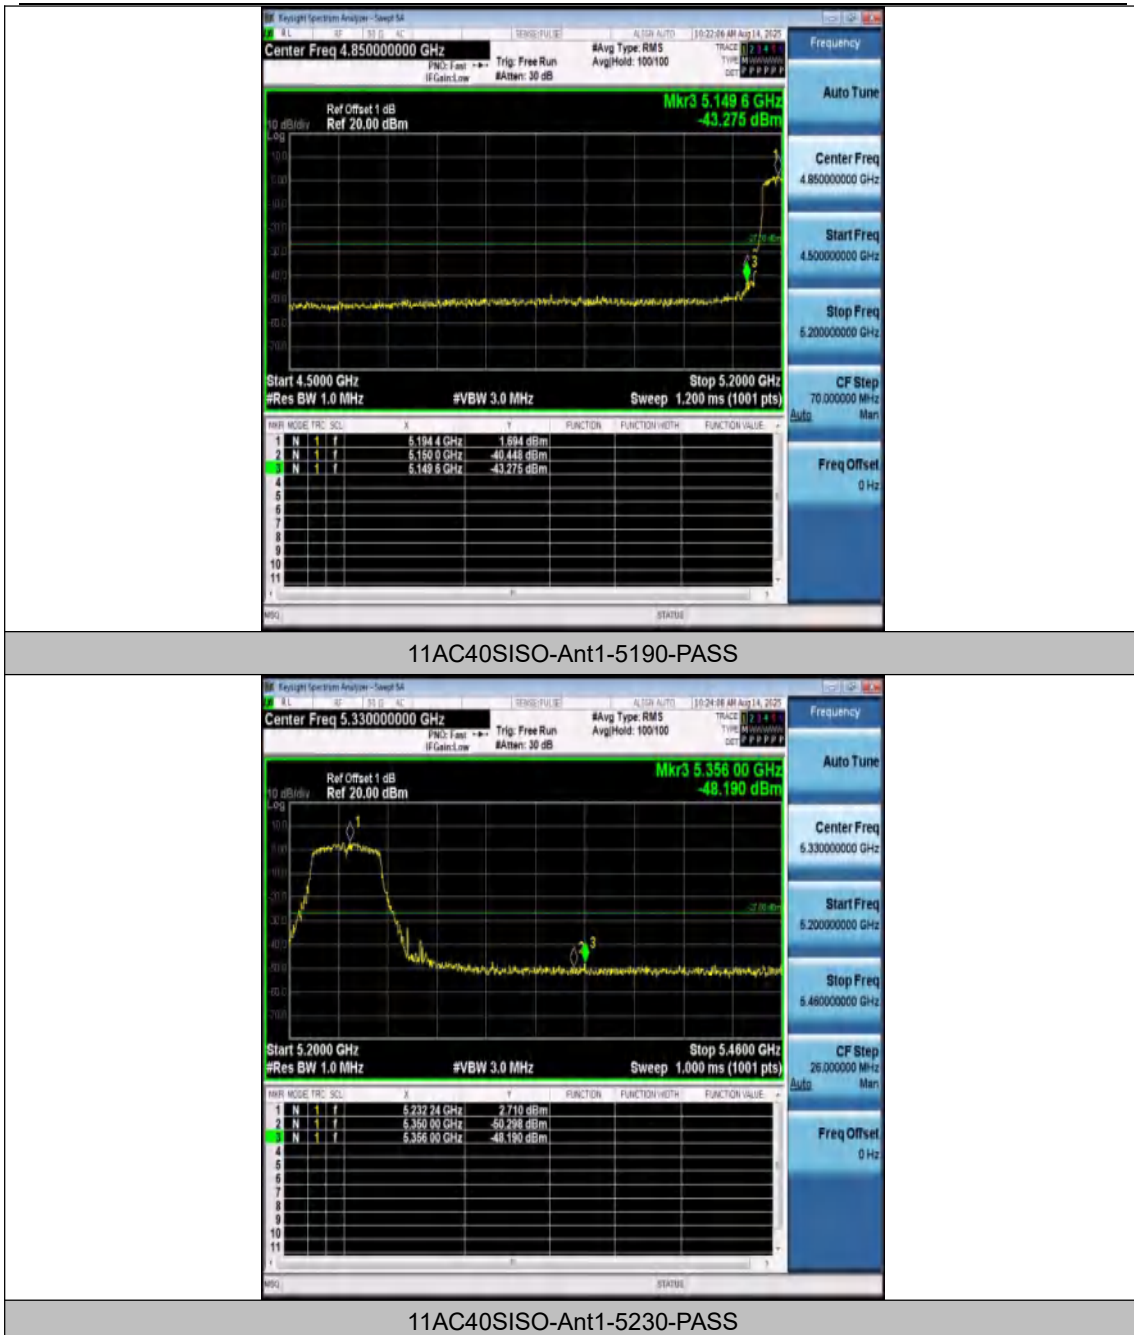

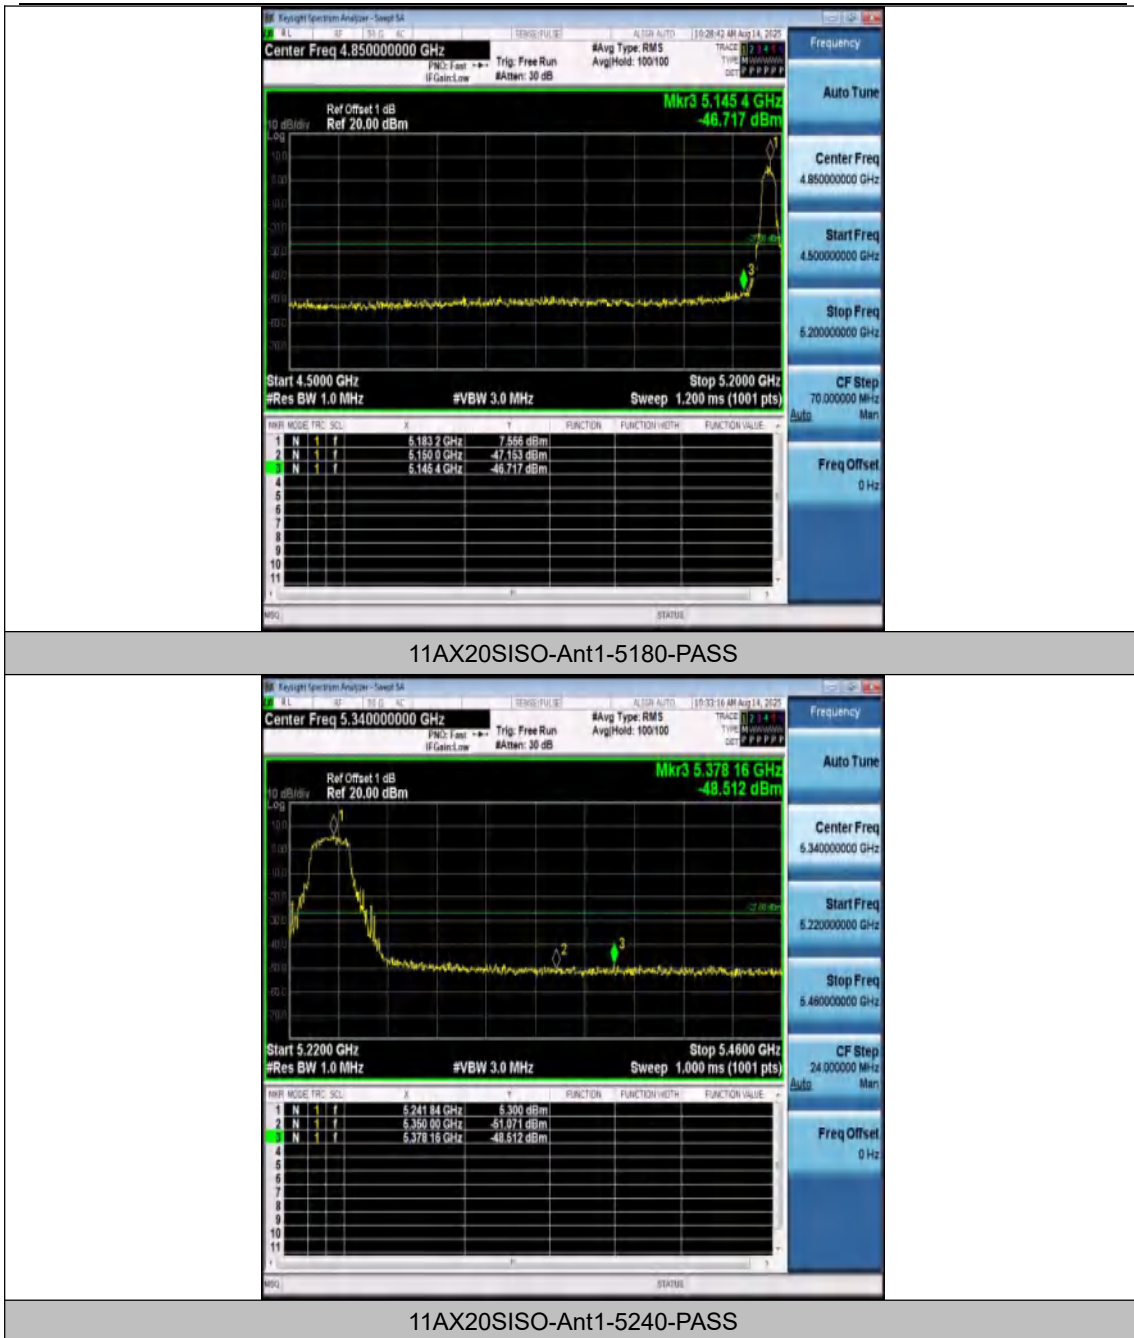

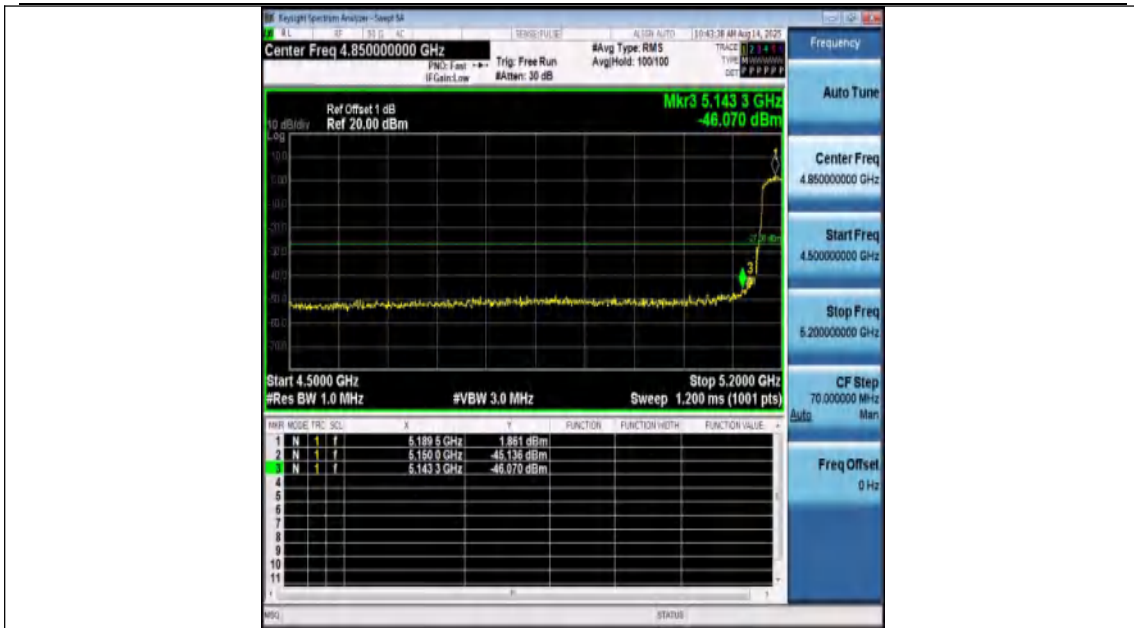


11AX40SISO-Ant1-5190-PASS



11AX40SISO-Ant1-5230-PASS

Test Graphs B4

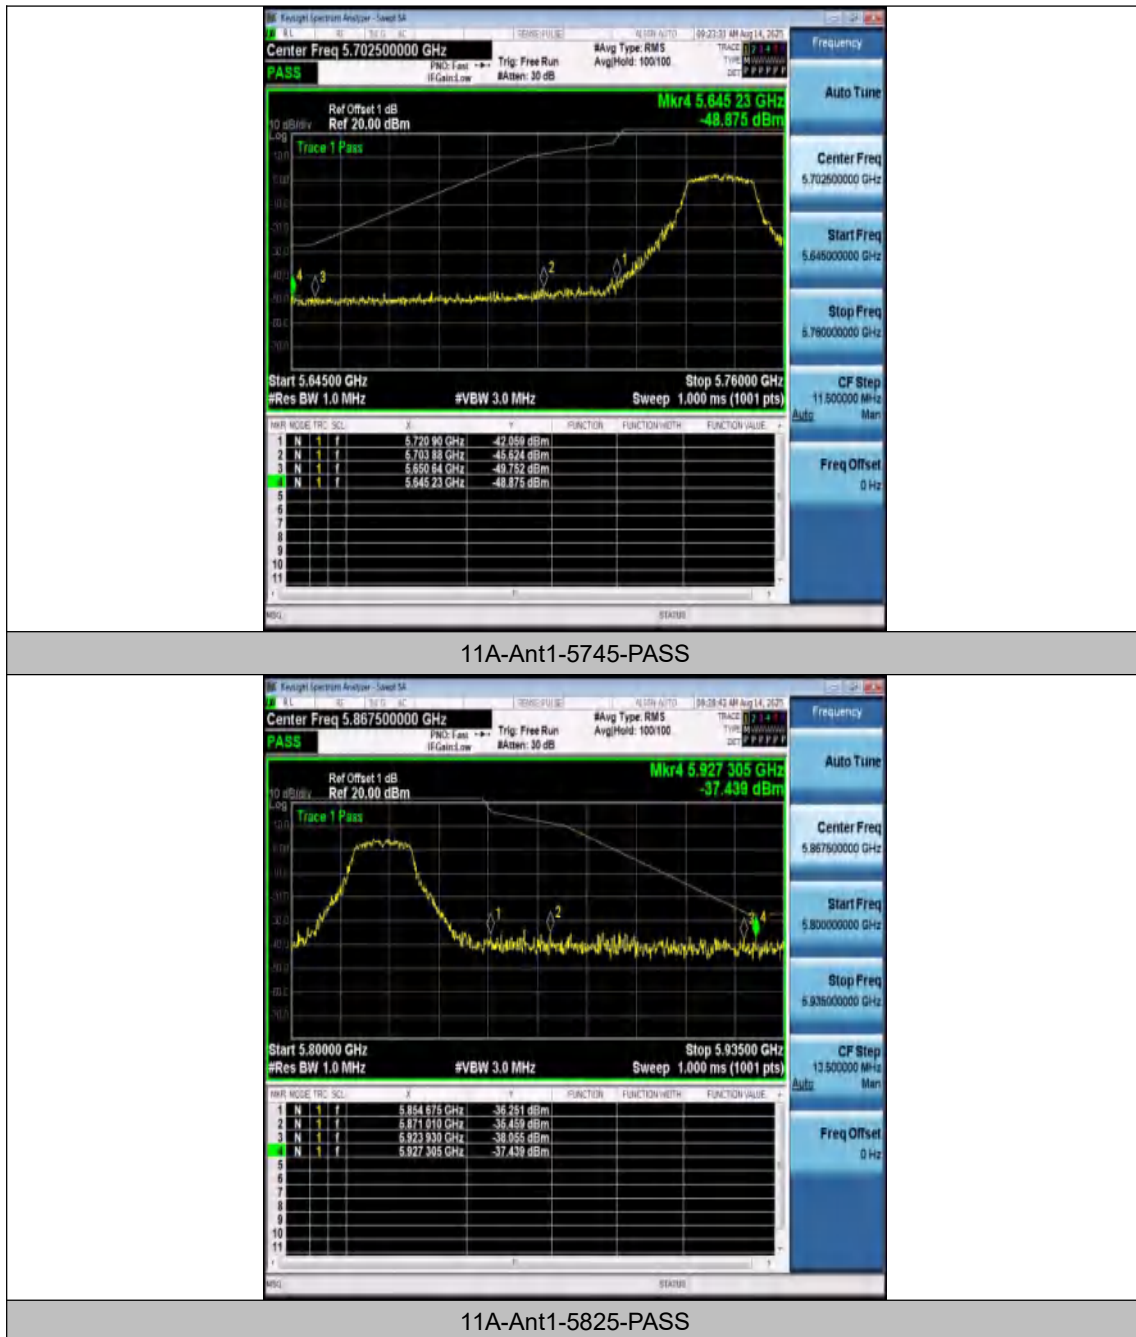




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



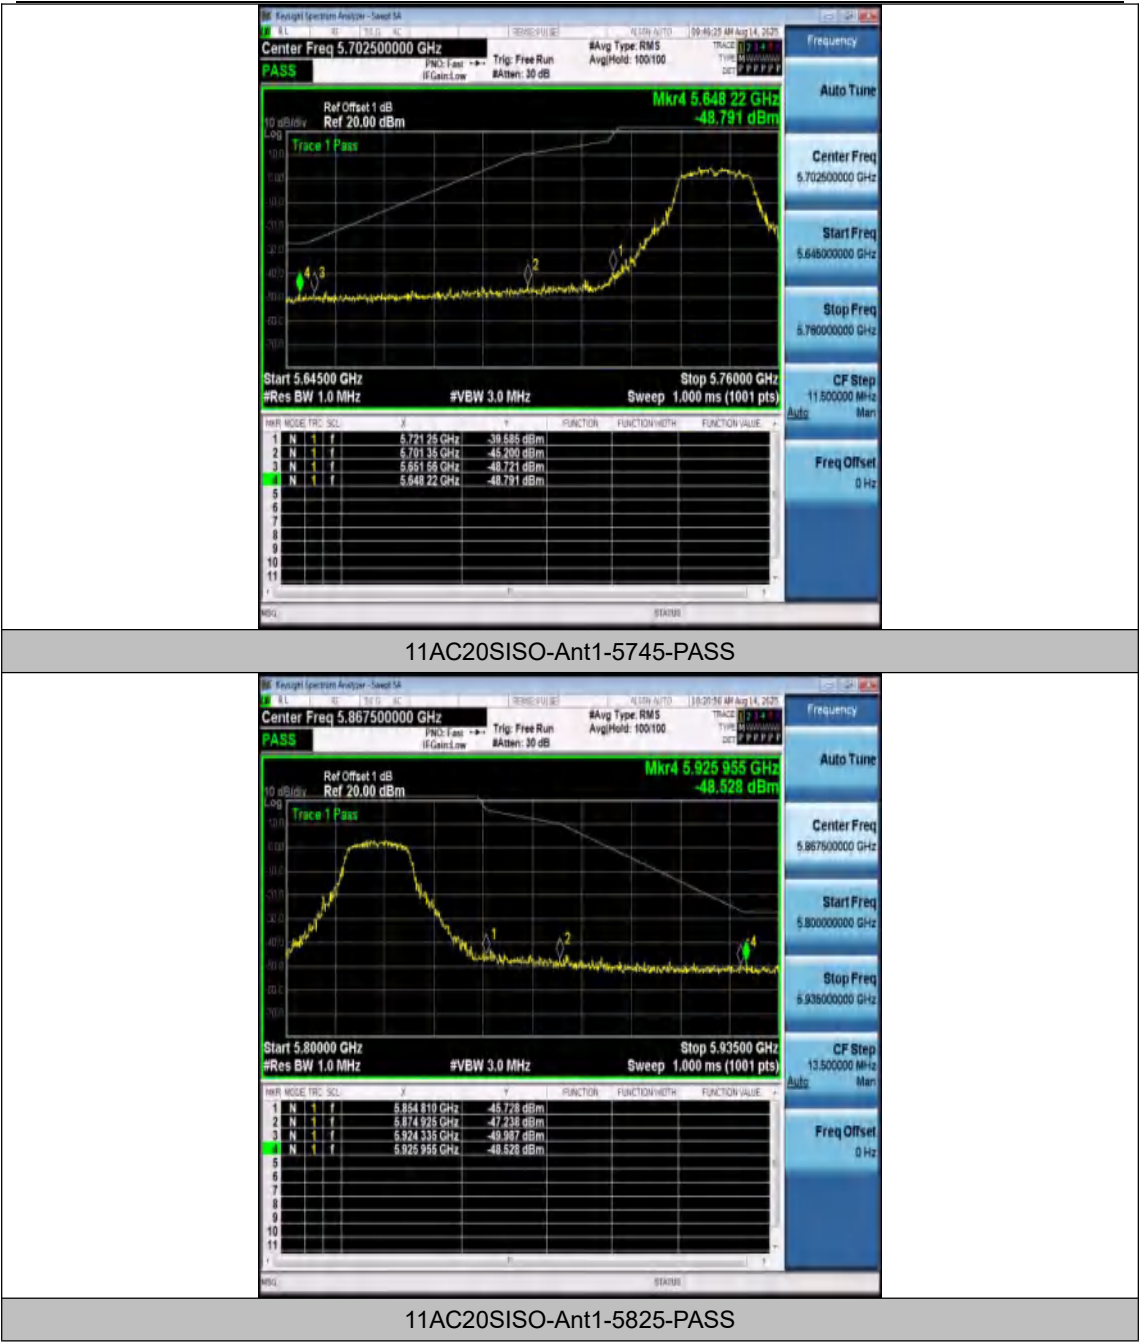




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

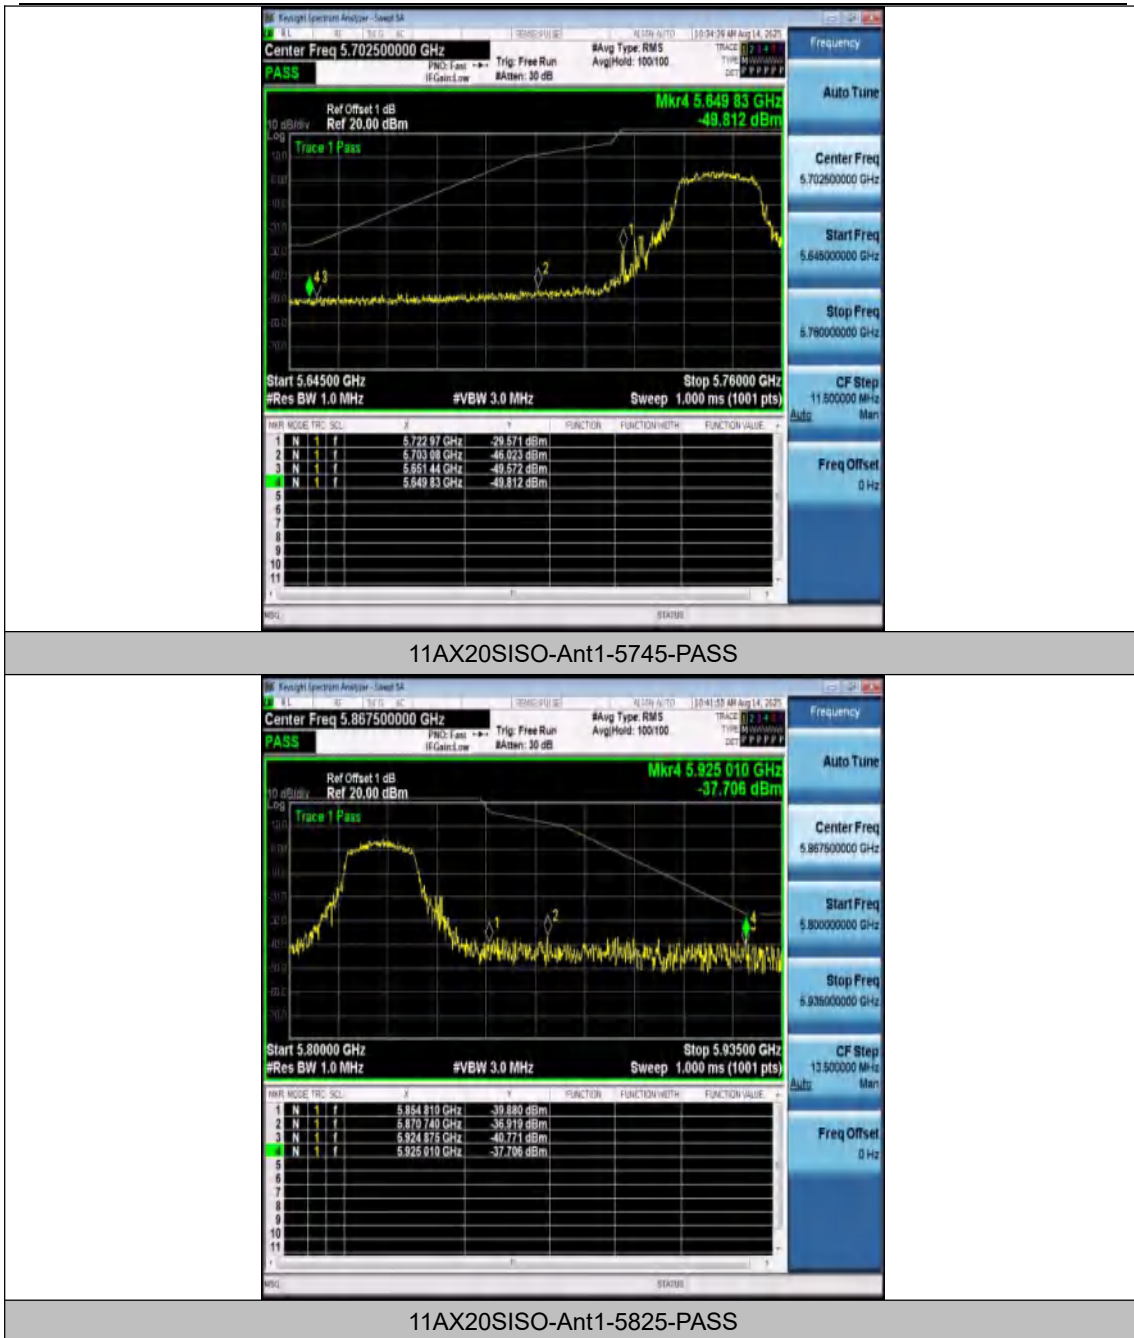

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



---END---