





## Restrict Band NVNT ax40 5270MHz Ant0 Peak

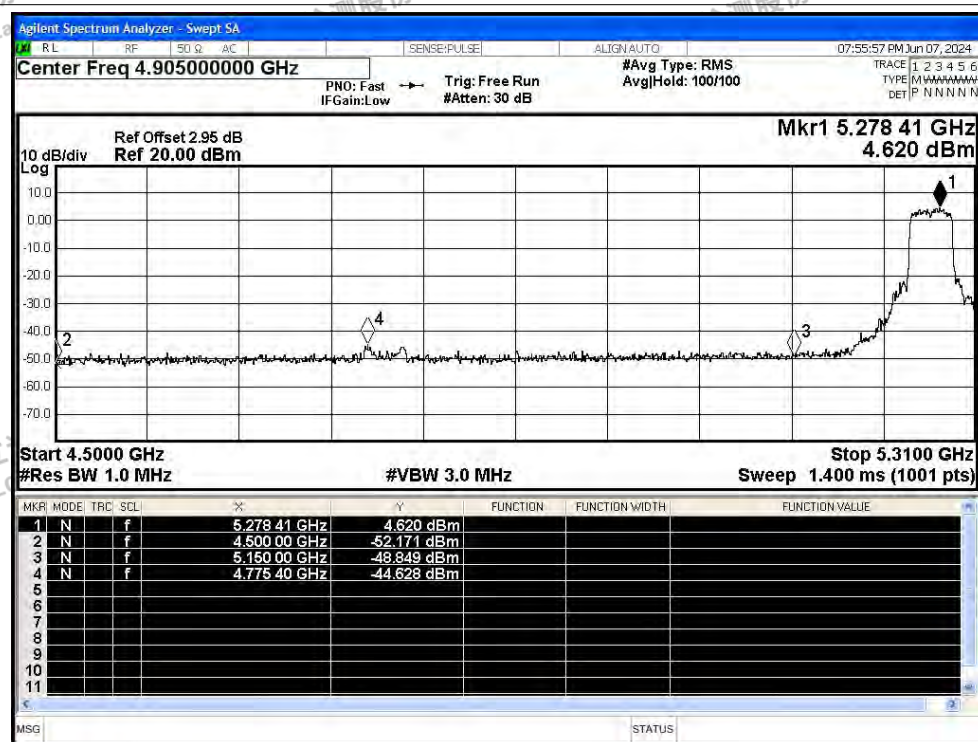

## Restrict Band NVNT ax40 5270MHz Ant0 Average

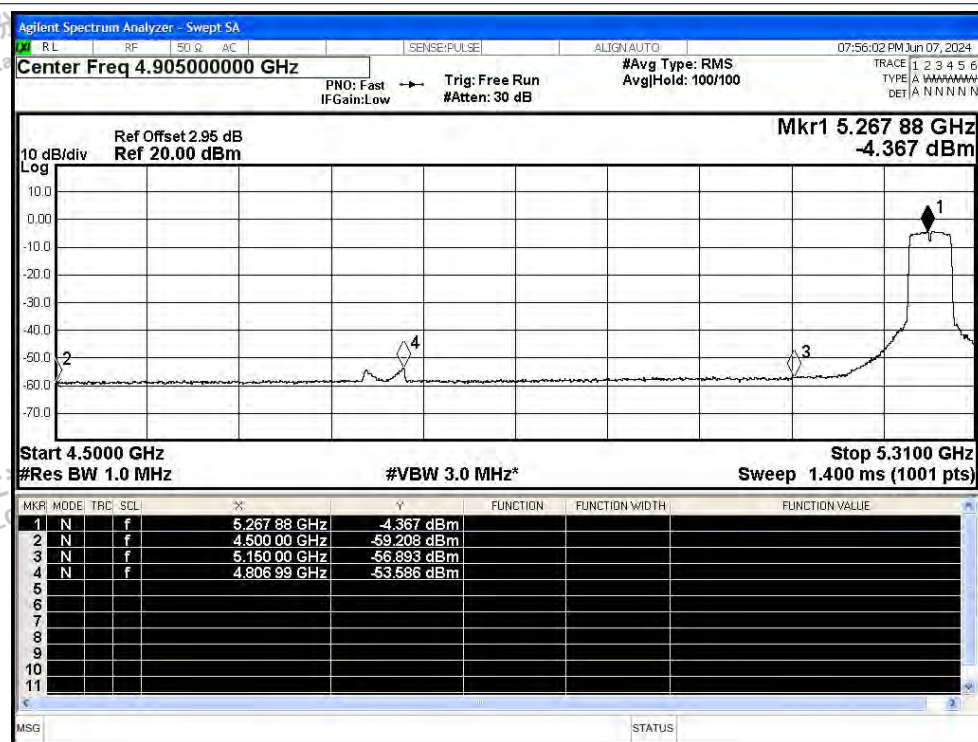

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5310MHz Ant0 Peak

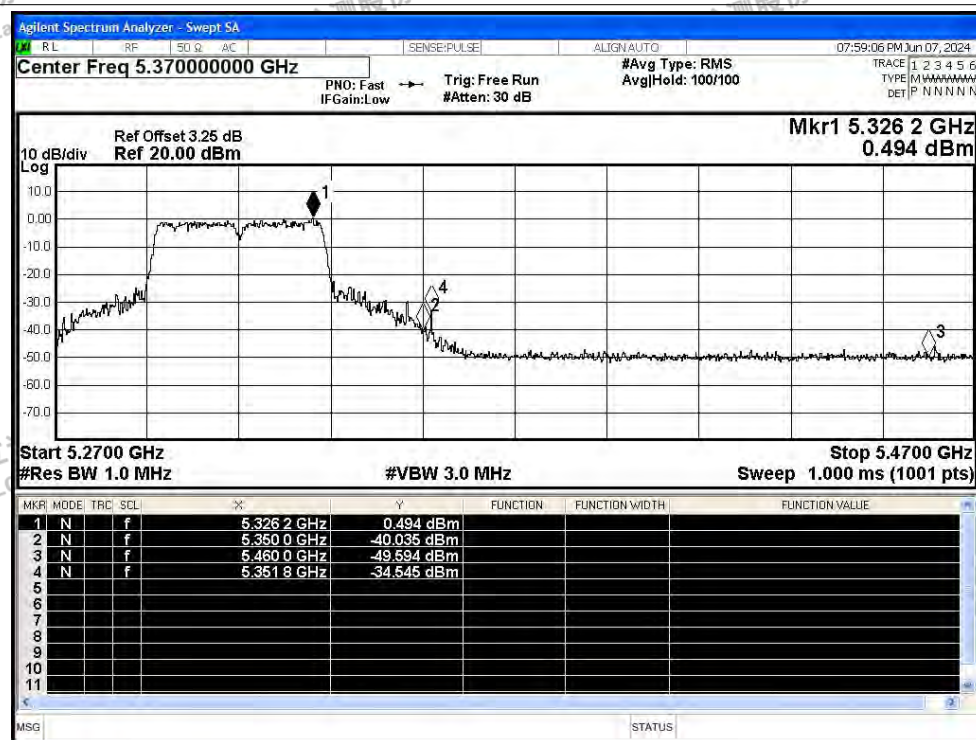

## Restrict Band NVNT ax40 5310MHz Ant0 Average

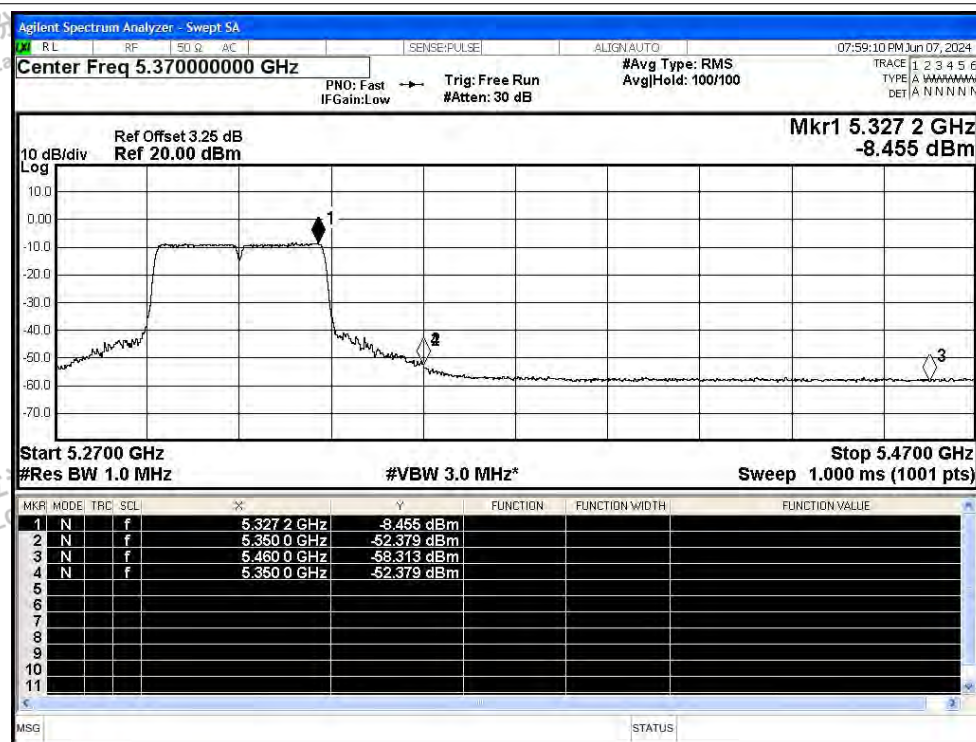

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5290MHz Ant0 Peak

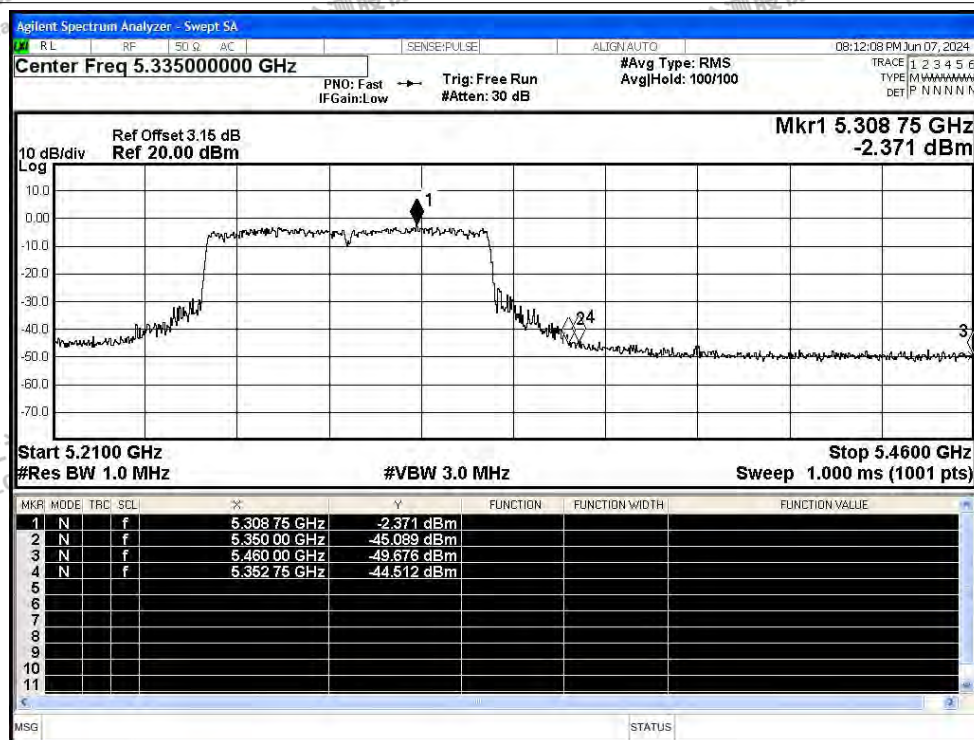

## Restrict Band NVNT ax80 5290MHz Ant0 Average

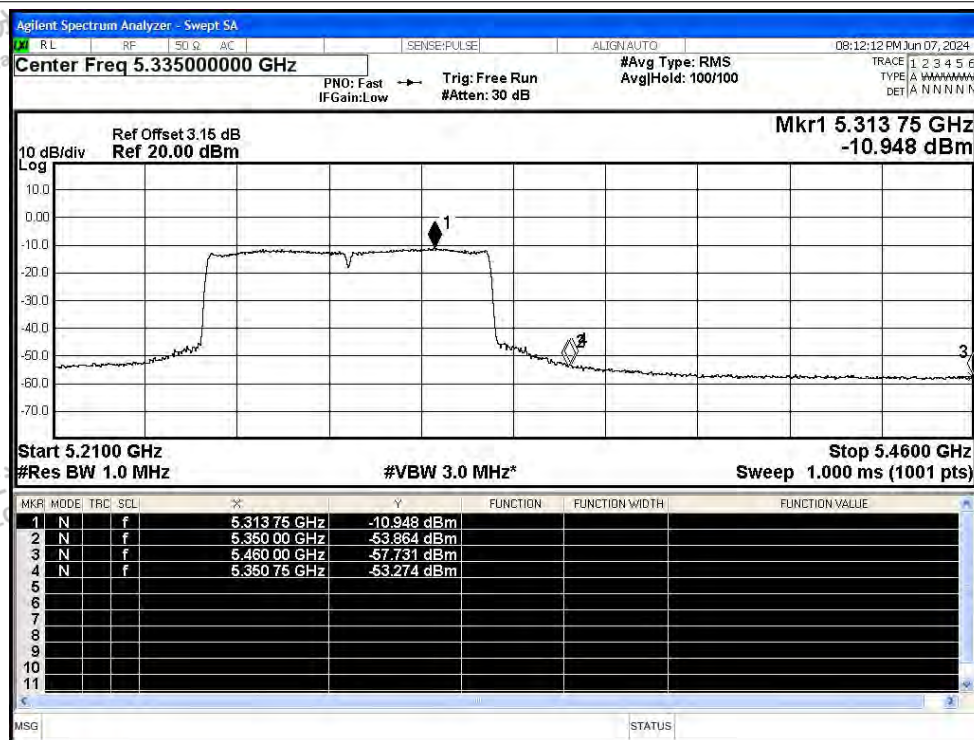

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ax80 5290MHz Ant0 Peak

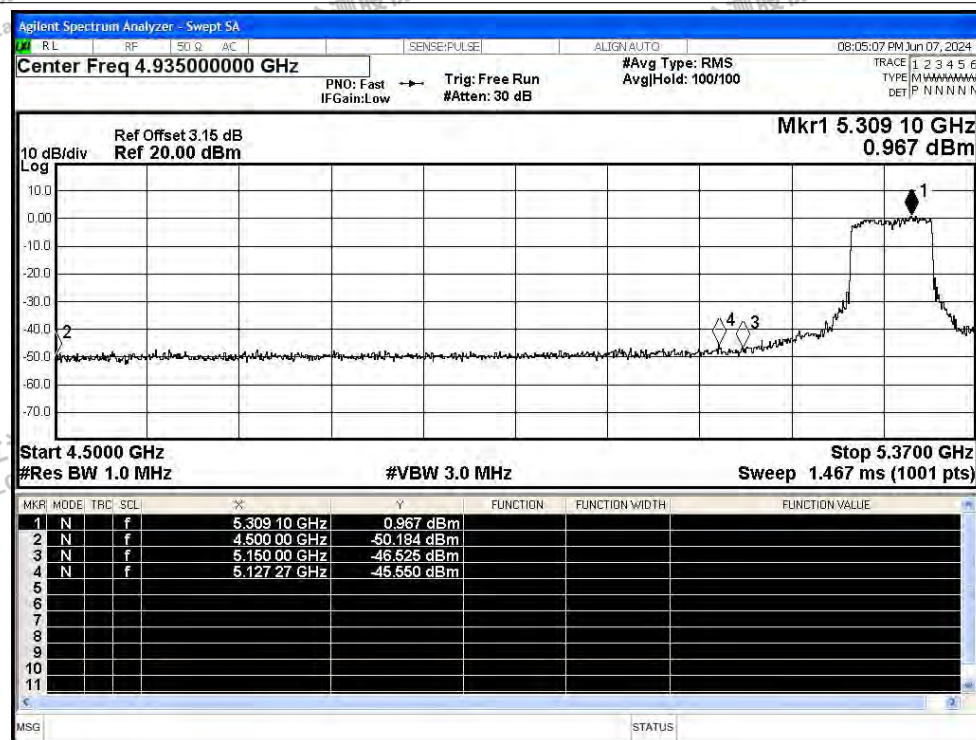

## Restrict Band NVNT ax80 5290MHz Ant0 Average

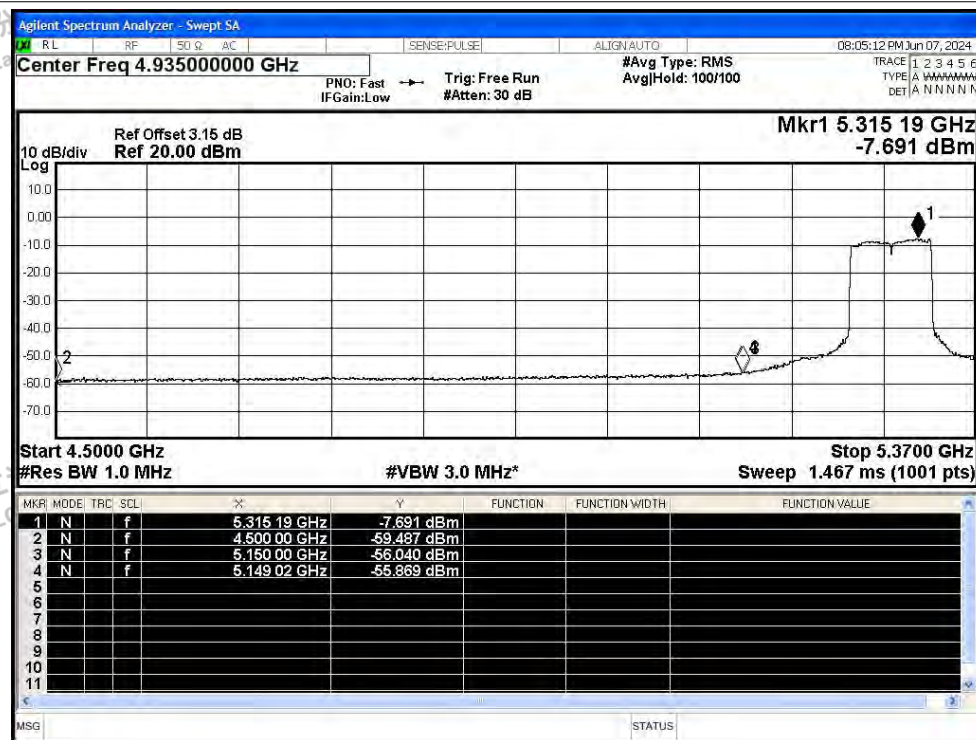

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency<br>(MHz) | Antenna | Spur Freq<br>(MHz) | Power<br>(dBm) | Gain<br>(dBi) | Duty<br>Factor<br>(dB) | E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|---------|--------------------|----------------|---------------|------------------------|---------------|----------|-------------------|---------|
| NVNT      | a    | 5260               | Ant1    | 4500               | -51.81         | 3.18          | -                      | 46.60         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5260               | Ant1    | 4500               | -58.91         | 3.18          | 0.24                   | 39.74         | Average  | 54                | Pass    |
| NVNT      | a    | 5260               | Ant1    | 4773.78            | -45.97         | 3.18          | -                      | 52.44         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5260               | Ant1    | 4772.22            | -55.45         | 3.18          | 0.24                   | 43.20         | Average  | 54                | Pass    |
| NVNT      | a    | 5260               | Ant1    | 5150               | -47.67         | 3.18          | -                      | 50.74         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5260               | Ant1    | 5150               | -56.87         | 3.18          | 0.24                   | 41.78         | Average  | 54                | Pass    |
| NVNT      | a    | 5320               | Ant1    | 5350               | -45.54         | 3.18          | -                      | 52.87         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5320               | Ant1    | 5350               | -54.38         | 3.18          | 0.24                   | 44.27         | Average  | 54                | Pass    |
| NVNT      | a    | 5320               | Ant1    | 5351.4             | -41.17         | 3.18          | -                      | 57.24         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5320               | Ant1    | 5350.8             | -53.86         | 3.18          | 0.24                   | 44.79         | Average  | 54                | Pass    |
| NVNT      | a    | 5320               | Ant1    | 5460               | -48.84         | 3.18          | -                      | 49.57         | Peak     | 68.2              | Pass    |
| NVNT      | a    | 5320               | Ant1    | 5460               | -57.59         | 3.18          | 0.24                   | 41.06         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | Ant1    | 4500               | -51.26         | 3.18          | -                      | 47.15         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | Ant1    | 4500               | -59.13         | 3.18          | 0.28                   | 39.56         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | Ant1    | 4775.34            | -45.63         | 3.18          | -                      | 52.78         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | Ant1    | 4773               | -55.42         | 3.18          | 0.28                   | 43.27         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | Ant1    | 5150               | -48.05         | 3.18          | -                      | 50.36         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | Ant1    | 5150               | -56.19         | 3.18          | 0.28                   | 42.5          | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | Ant1    | 5350               | -40.84         | 3.18          | -                      | 57.57         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | Ant1    | 5350               | -52.62         | 3.18          | 0.28                   | 46.07         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | Ant1    | 5353.8             | -33.59         | 3.18          | -                      | 64.82         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | Ant1    | 5351.6             | -51.25         | 3.18          | 0.28                   | 47.44         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | Ant1    | 5460               | -50.33         | 3.18          | -                      | 48.08         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | Ant1    | 5460               | -57.75         | 3.18          | 0.28                   | 40.94         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | Ant1    | 4500               | -50.66         | 3.18          | -                      | 47.75         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | Ant1    | 4500               | -58.76         | 3.18          | 0.12                   | 39.77         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | Ant1    | 4806.99            | -44.65         | 3.18          | -                      | 53.76         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | Ant1    | 4806.99            | -52.58         | 3.18          | 0.12                   | 45.95         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | Ant1    | 5150               | -47.32         | 3.18          | -                      | 51.09         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | Ant1    | 5150               | -56.8          | 3.18          | 0.12                   | 41.73         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | Ant1    | 5350               | -39.71         | 3.18          | -                      | 58.7          | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | Ant1    | 5351               | -52.67         | 3.18          | 0.12                   | 45.86         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | Ant1    | 5460               | -49.84         | 3.18          | -                      | 48.57         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | Ant1    | 5460               | -58.03         | 3.18          | 0.12                   | 40.5          | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | Ant1    | 4500               | -51.45         | 3.18          | -                      | 46.96         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | Ant1    | 4500               | -59.08         | 3.18          | 0.28                   | 39.61         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | Ant1    | 4788.6             | -45.34         | 3.18          | -                      | 53.07         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | Ant1    | 4787.82            | -55.49         | 3.18          | 0.28                   | 43.2          | Average  | 54                | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ac20 | 5260 | Ant1 | 5150    | -46.63 | 3.18 | -    | 51.78 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5260 | Ant1 | 5150    | -56.62 | 3.18 | 0.28 | 42.07 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350    | -41.03 | 3.18 | -    | 57.38 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350    | -53.71 | 3.18 | 0.28 | 44.98 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350.4  | -38.45 | 3.18 | -    | 59.96 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350.8  | -53.29 | 3.18 | 0.28 | 45.4  | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5460    | -49.05 | 3.18 | -    | 49.36 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5460    | -57.81 | 3.18 | 0.28 | 40.88 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4500    | -50.89 | 3.18 | -    | 47.52 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4500    | -59.23 | 3.18 | 0.12 | 39.3  | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4807.8  | -45.26 | 3.18 | -    | 53.15 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4806.99 | -52.56 | 3.18 | 0.12 | 45.97 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant1 | 5150    | -48.88 | 3.18 | -    | 49.53 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 5150    | -57.28 | 3.18 | 0.12 | 41.25 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350    | -44.16 | 3.18 | -    | 54.25 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350    | -52.62 | 3.18 | 0.12 | 45.91 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350.4  | -40.37 | 3.18 | -    | 58.04 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350.4  | -52.16 | 3.18 | 0.12 | 46.37 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5460    | -50.42 | 3.18 | -    | 47.99 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5460    | -57.89 | 3.18 | 0.12 | 40.64 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 4500    | -48.92 | 3.18 | -    | 49.49 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 4500    | -58.68 | 3.18 | 0.25 | 39.98 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5138.58 | -46.25 | 3.18 | -    | 52.16 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5148.15 | -56.12 | 3.18 | 0.25 | 42.54 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5150    | -47.13 | 3.18 | -    | 51.28 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5150    | -56.38 | 3.18 | 0.25 | 42.28 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350    | -45.93 | 3.18 | -    | 52.48 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350    | -54.11 | 3.18 | 0.25 | 44.55 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350.25 | -42.11 | 3.18 | -    | 56.3  | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350.5  | -53.92 | 3.18 | 0.25 | 44.74 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5460    | -47.96 | 3.18 | -    | 50.45 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5460    | -58.11 | 3.18 | 0.25 | 40.55 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4500    | -51.1  | 3.18 | -    | 47.31 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4500    | -59.33 | 3.18 | 0.28 | 39.36 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4788.6  | -46.1  | 3.18 | -    | 52.31 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4787.82 | -55.77 | 3.18 | 0.28 | 42.92 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant1 | 5150    | -48.18 | 3.18 | -    | 50.23 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 5150    | -57.25 | 3.18 | 0.28 | 41.44 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5350    | -40.92 | 3.18 | -    | 57.49 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5350    | -52.35 | 3.18 | 0.28 | 46.34 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5351.4  | -37.49 | 3.18 | -    | 60.92 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5460    | -57.73 | 3.18 | 0.28 | 40.96 | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ax40 | 5270 | Ant1 | 4500    | -50.95 | 3.18 | -    | 47.46 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4500    | -59.01 | 3.18 | 0.12 | 39.52 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4806.99 | -45.21 | 3.18 | -    | 53.2  | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4806.99 | -53.7  | 3.18 | 0.12 | 44.83 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | Ant1 | 5150    | -47.81 | 3.18 | -    | 50.6  | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 5150    | -57.52 | 3.18 | 0.12 | 41.01 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5350    | -41    | 3.18 | -    | 57.41 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5350    | -54.09 | 3.18 | 0.12 | 44.44 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5351.4  | -40.28 | 3.18 | -    | 58.13 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5351.4  | -53.41 | 3.18 | 0.12 | 45.12 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5460    | -49.79 | 3.18 | -    | 48.62 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5460    | -57.52 | 3.18 | 0.12 | 41.01 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5350    | -42.21 | 3.18 | -    | 56.2  | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5350    | -52.23 | 3.18 | 0.25 | 46.43 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5352.5  | -42.07 | 3.18 | -    | 56.34 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5460    | -58.32 | 3.18 | 0.25 | 40.34 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 4500    | -51.24 | 3.18 | -    | 47.17 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 4500    | -58.76 | 3.18 | 0.25 | 39.9  | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5125.53 | -46.29 | 3.18 | -    | 52.12 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5145.54 | -56.1  | 3.18 | 0.25 | 42.56 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5150    | -47.75 | 3.18 | -    | 50.66 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5150    | -56.76 | 3.18 | 0.25 | 41.9  | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity






## Test Graphs

## Restrict Band NVNT a 5260MHz Ant1 Peak

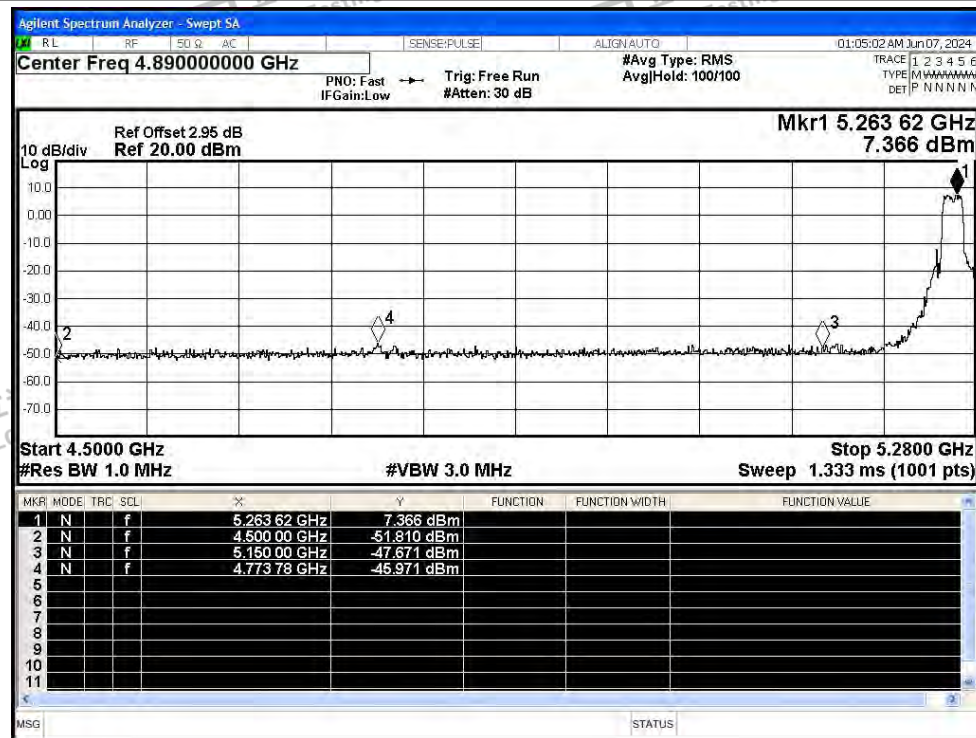

## Restrict Band NVNT a 5260MHz Ant1 Average

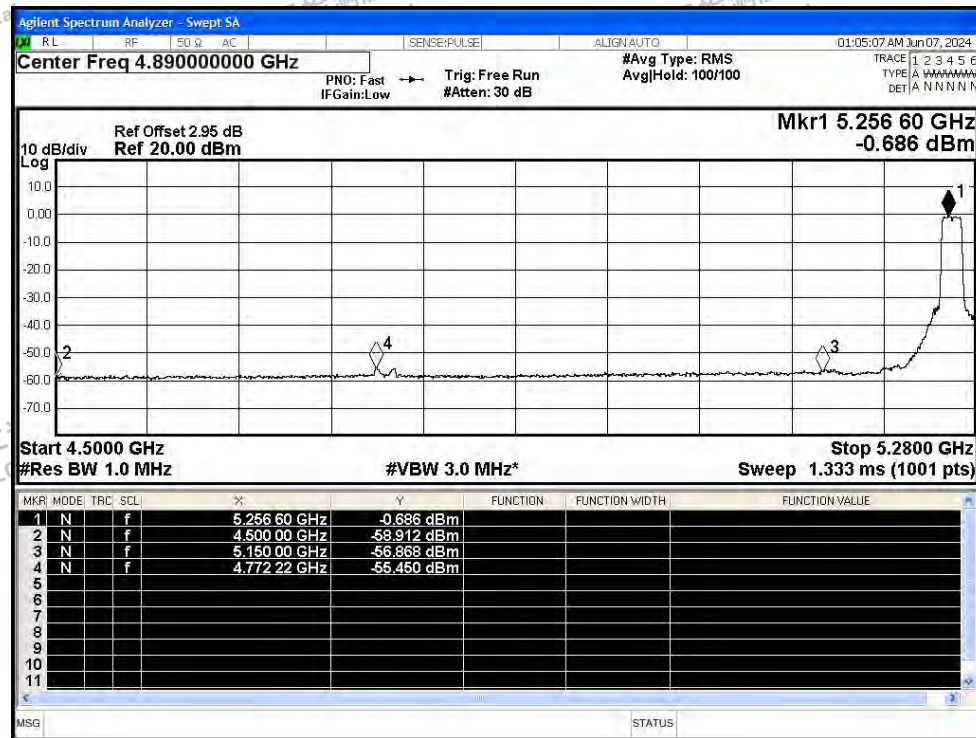

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT a 5320MHz Ant1 Peak

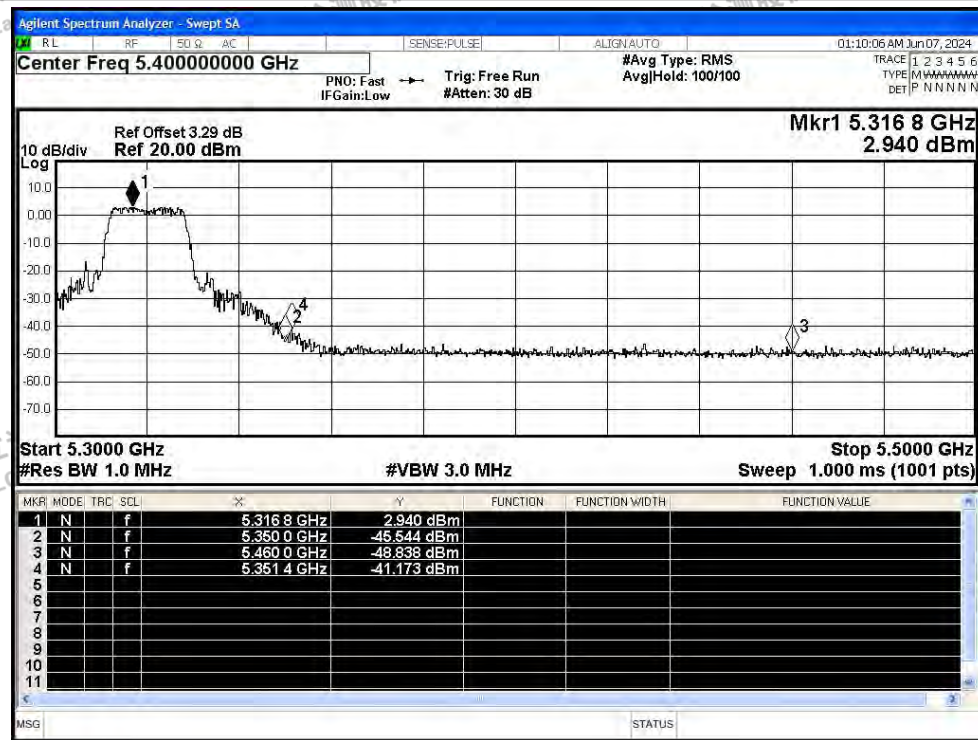

## Restrict Band NVNT a 5320MHz Ant1 Average

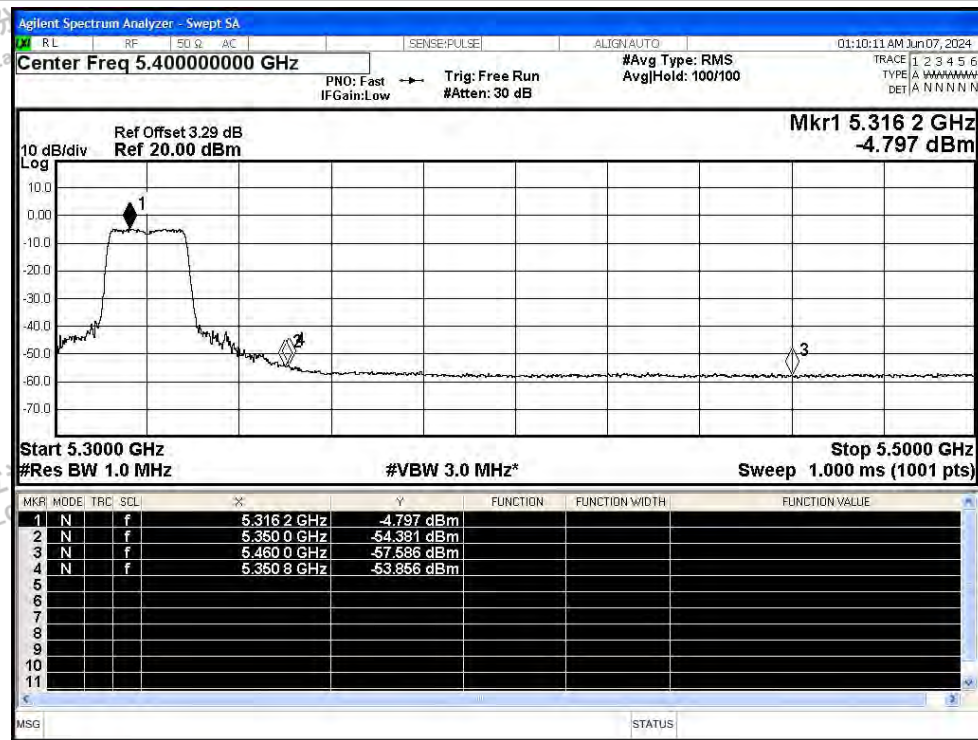

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5260MHz Ant1 Peak

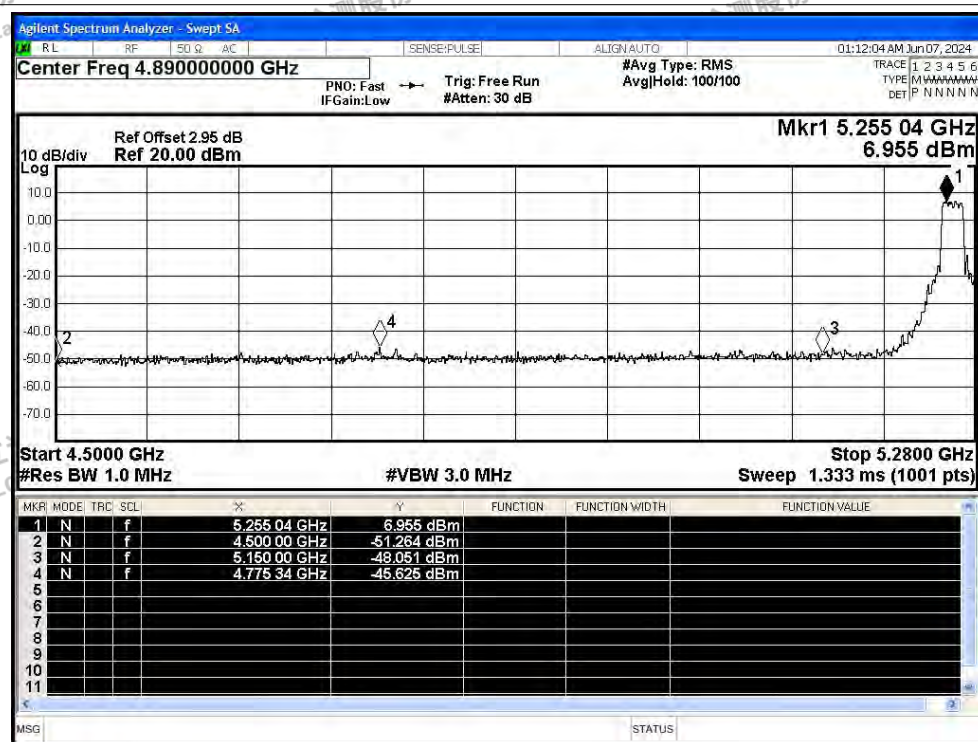

## Restrict Band NVNT n20 5260MHz Ant1 Average

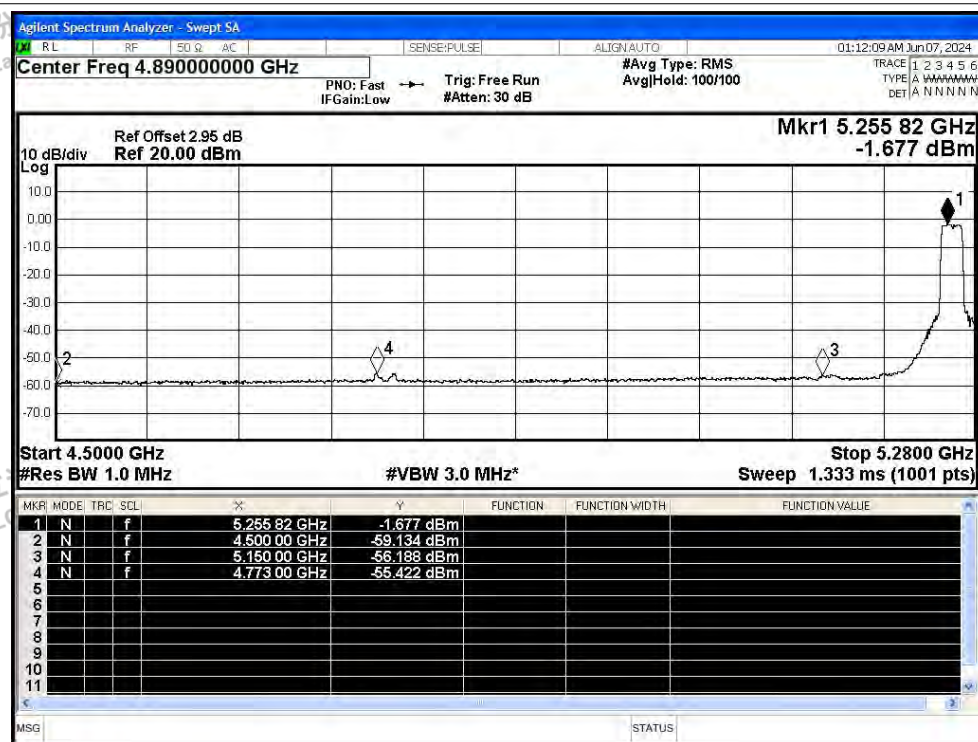

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5320MHz Ant1 Peak

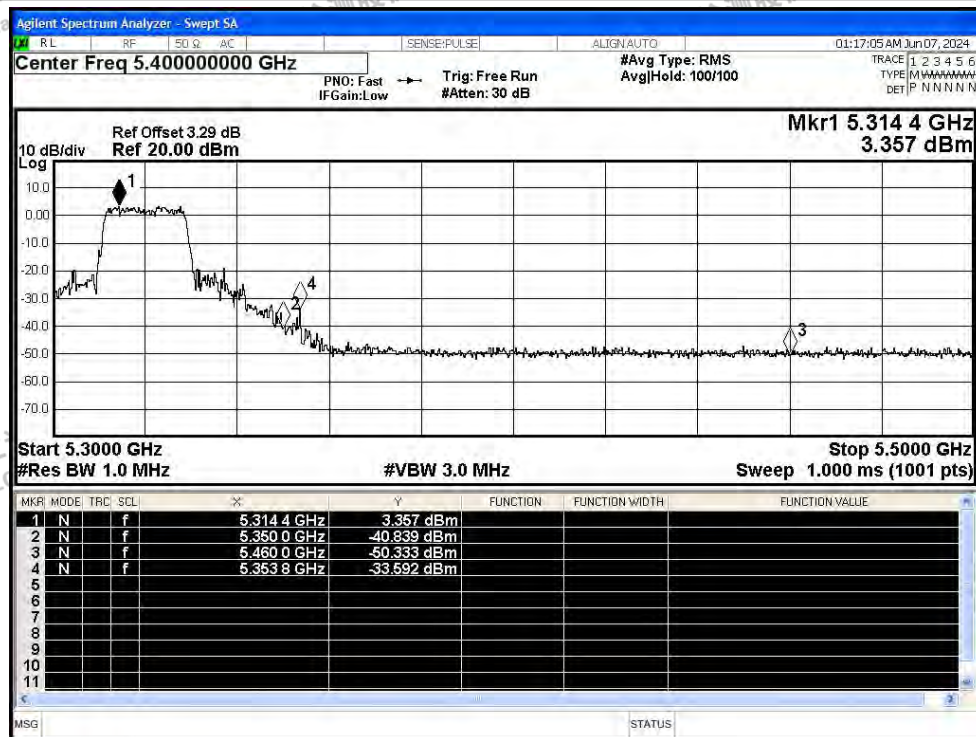

## Restrict Band NVNT n20 5320MHz Ant1 Average

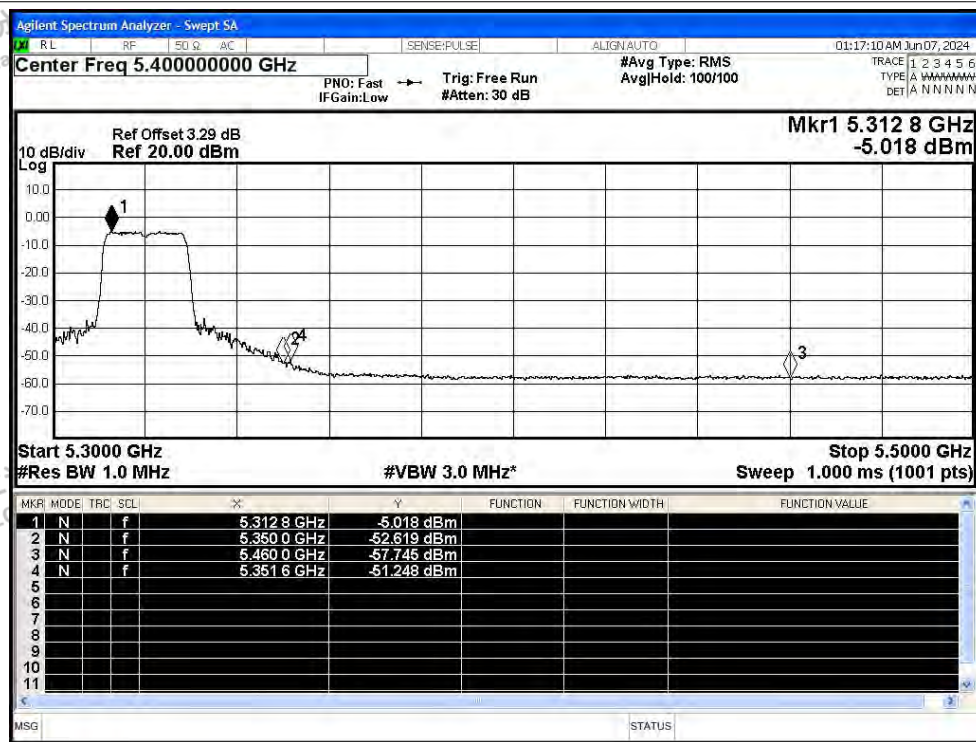

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT n40 5270MHz Ant1 Peak

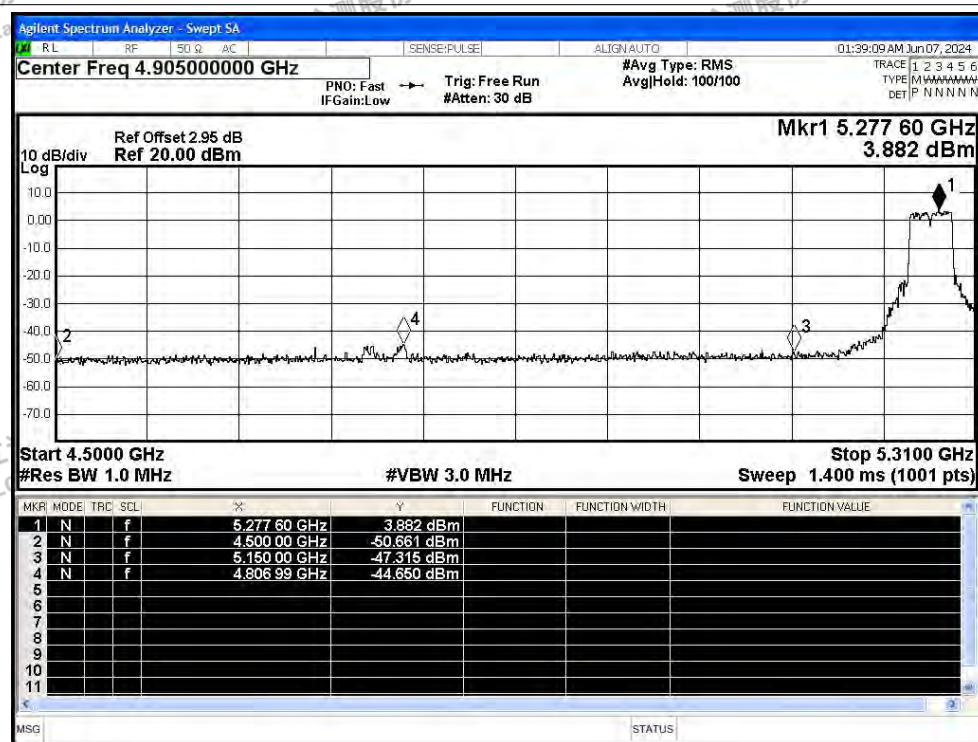

## Restrict Band NVNT n40 5270MHz Ant1 Average



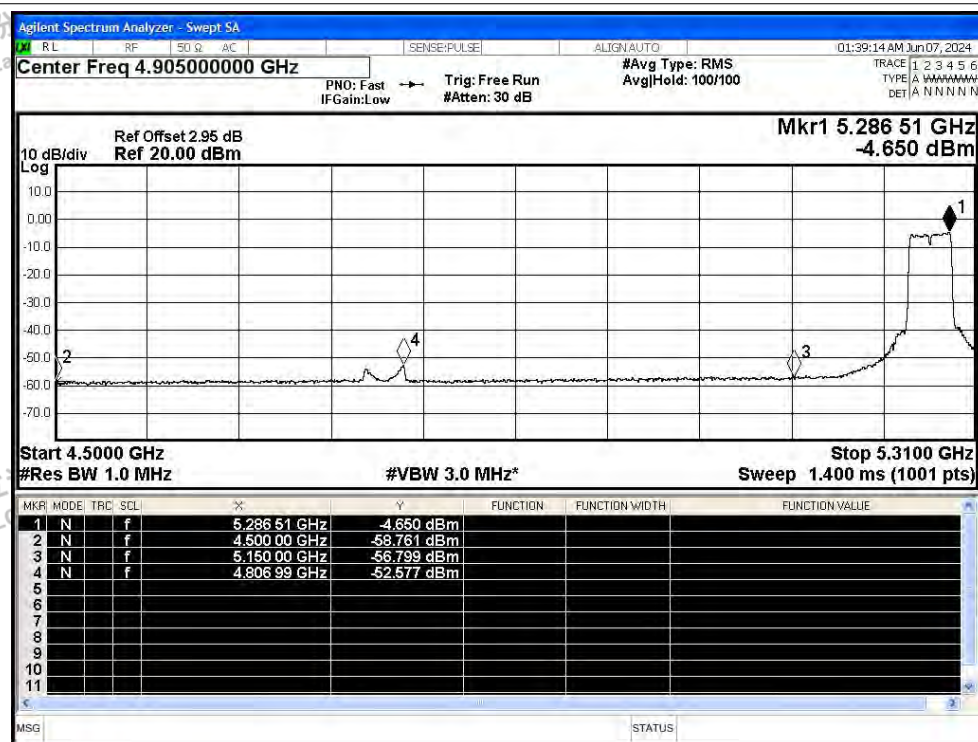


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

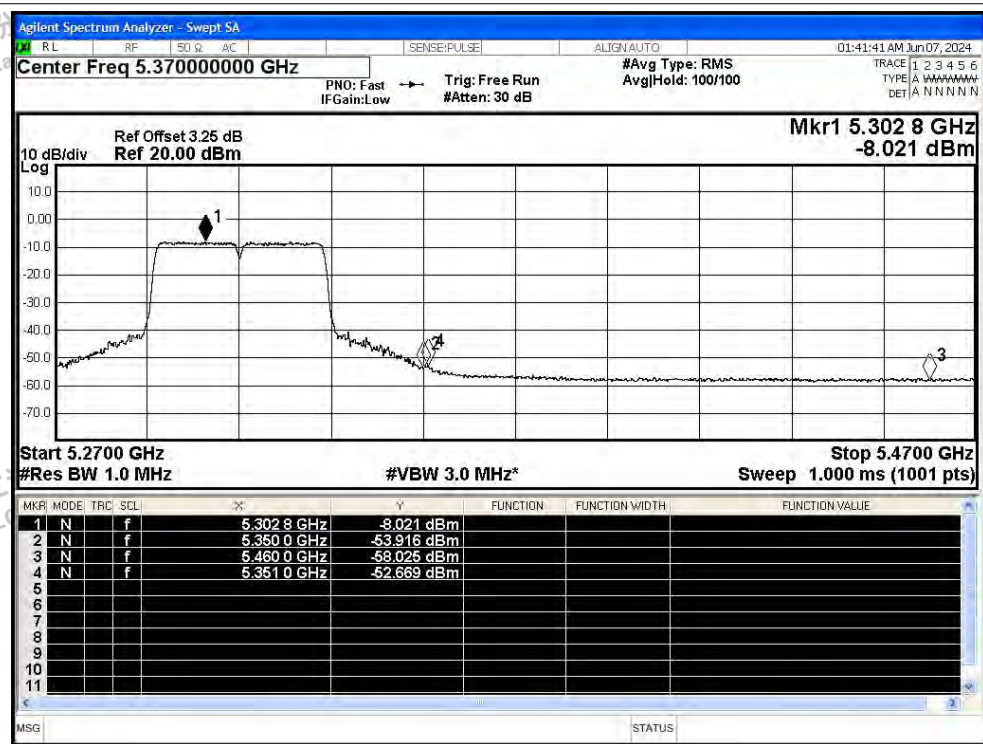




## Restrict Band NVNT ac20 5260MHz Ant1 Peak

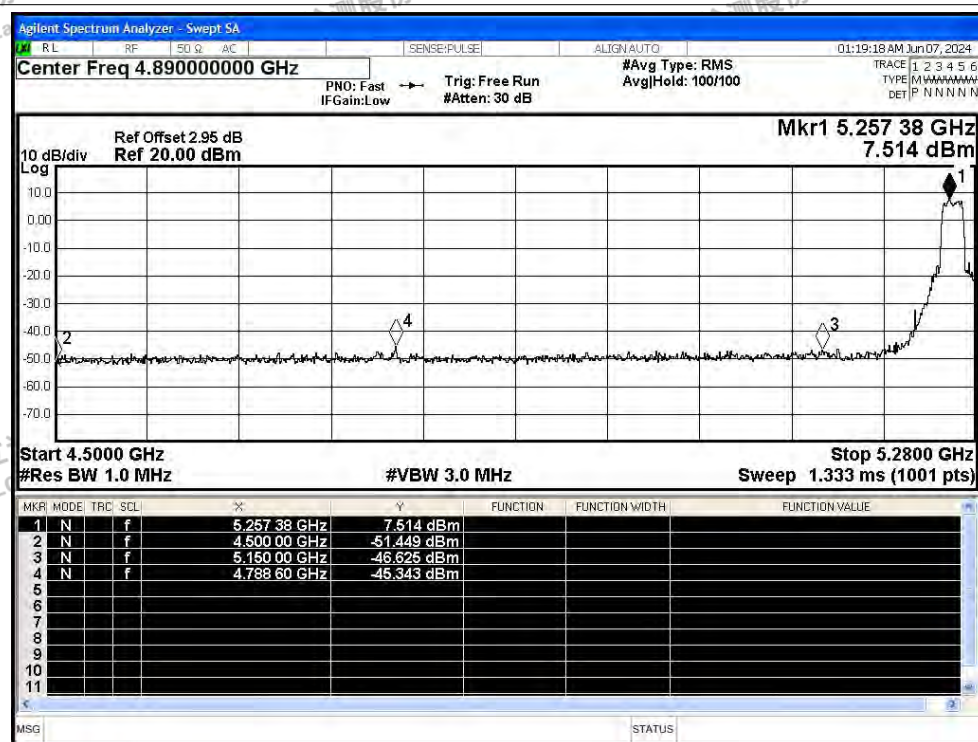

## Restrict Band NVNT ac20 5260MHz Ant1 Average

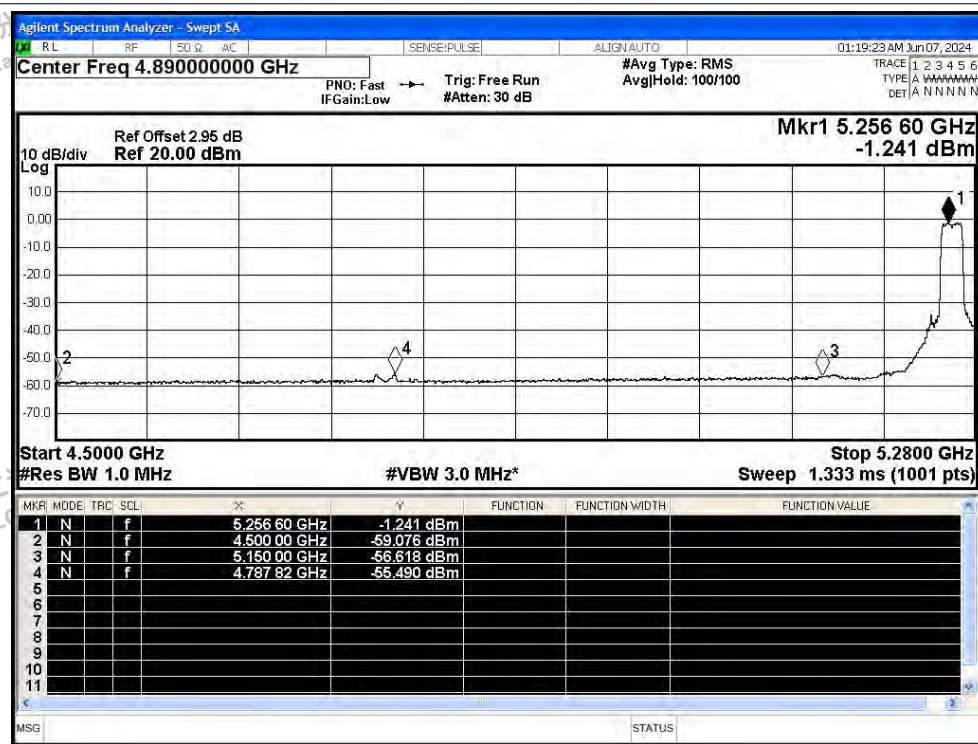

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ac20 5320MHz Ant1 Peak

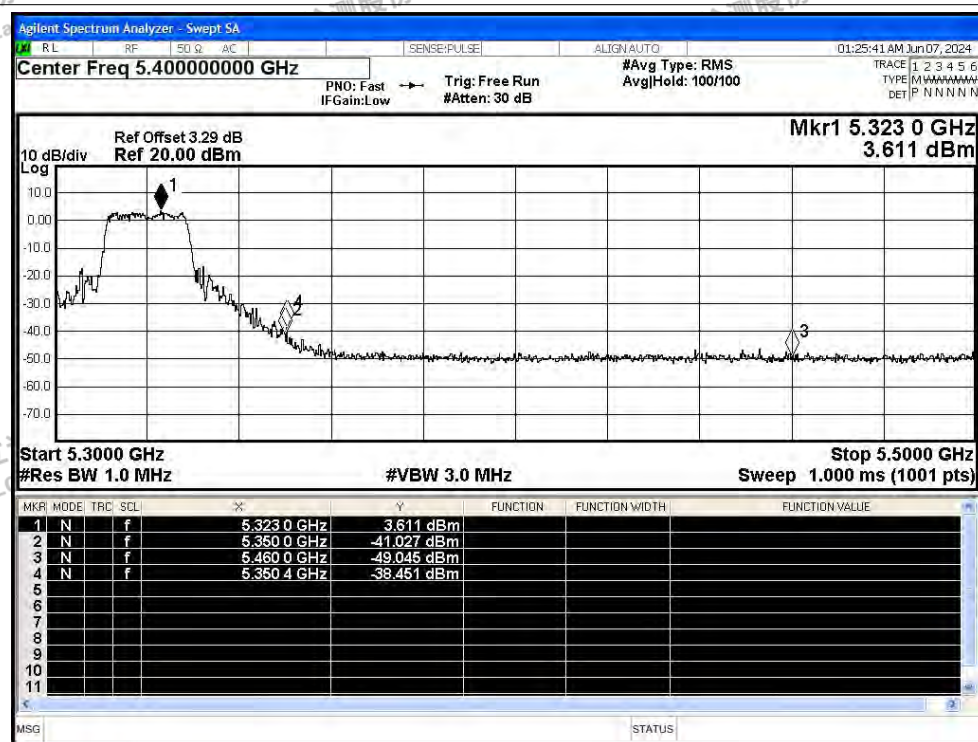

## Restrict Band NVNT ac20 5320MHz Ant1 Average

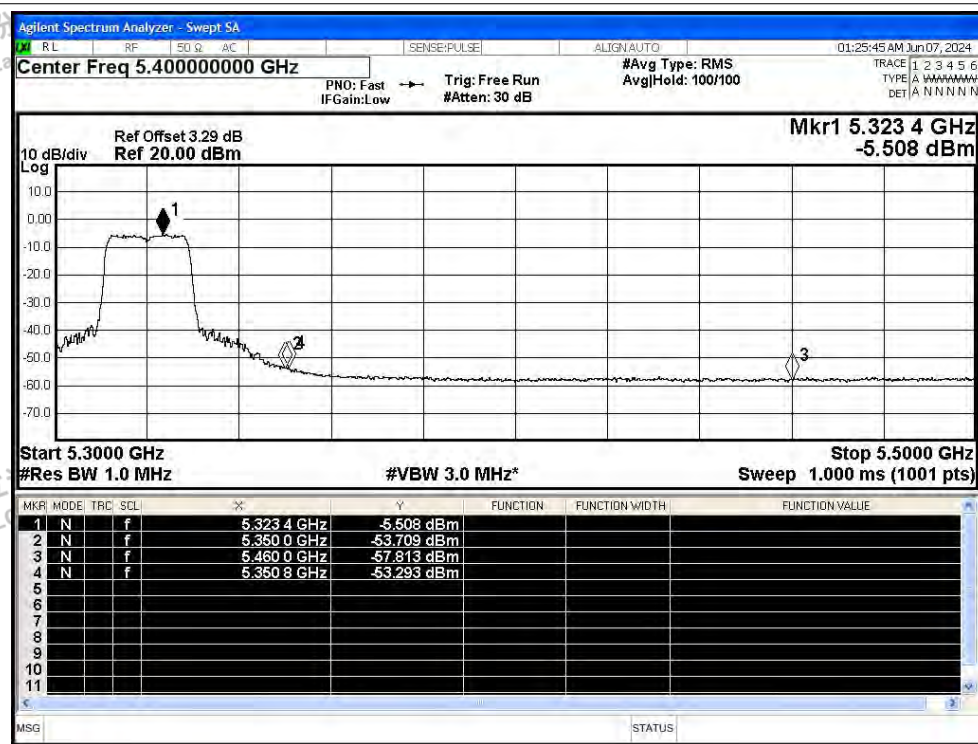

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5270MHz Ant1 Peak

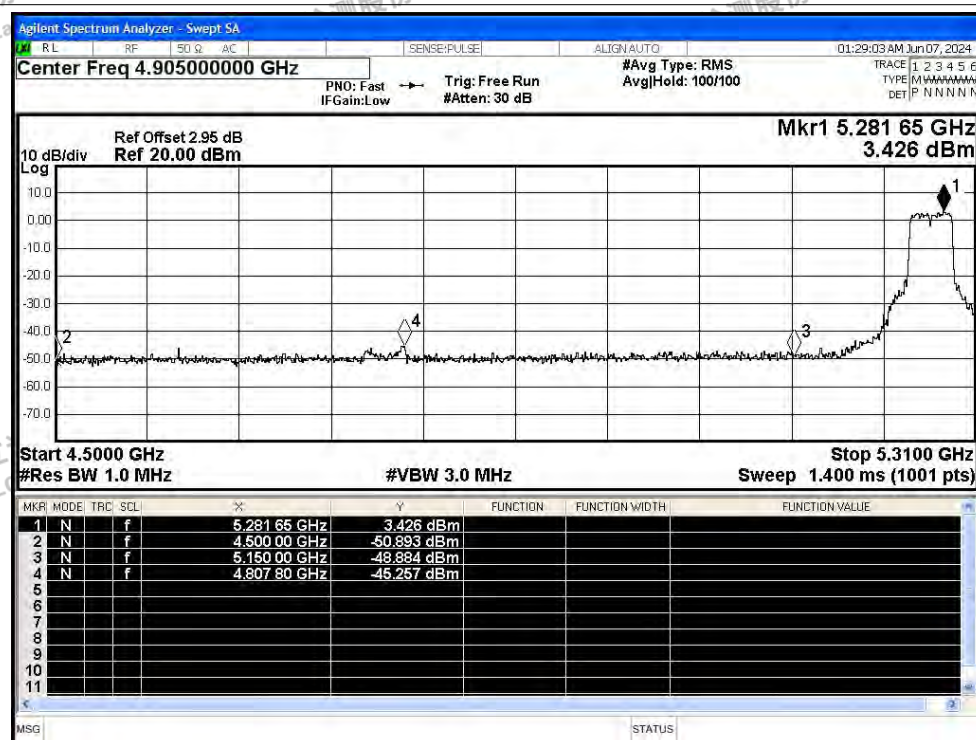

## Restrict Band NVNT ac40 5270MHz Ant1 Average

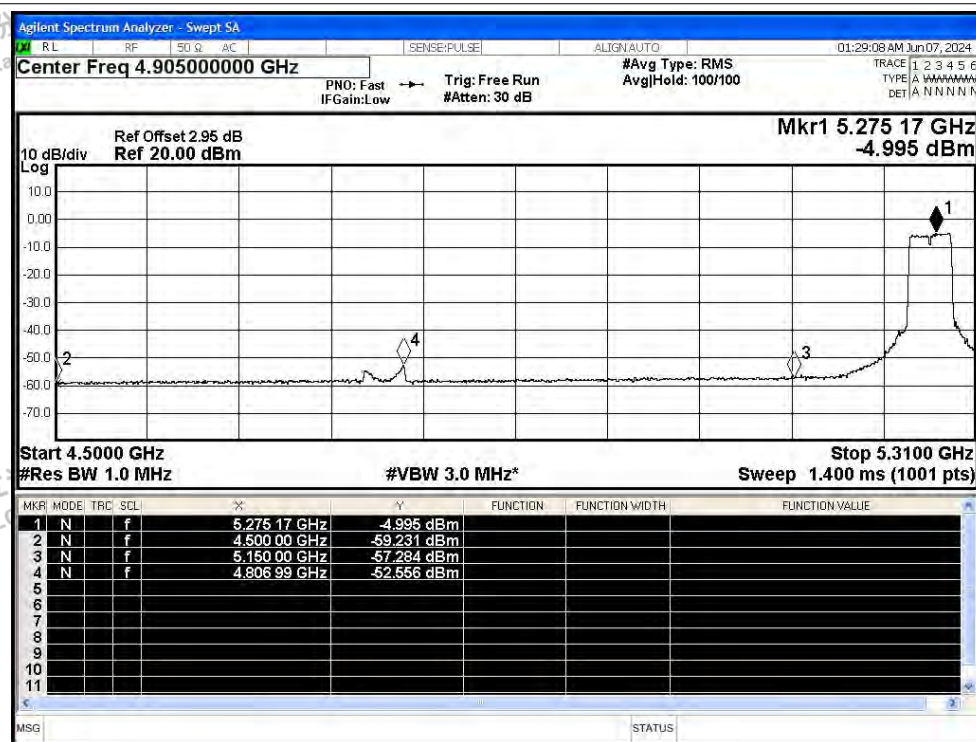

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5310MHz Ant1 Peak

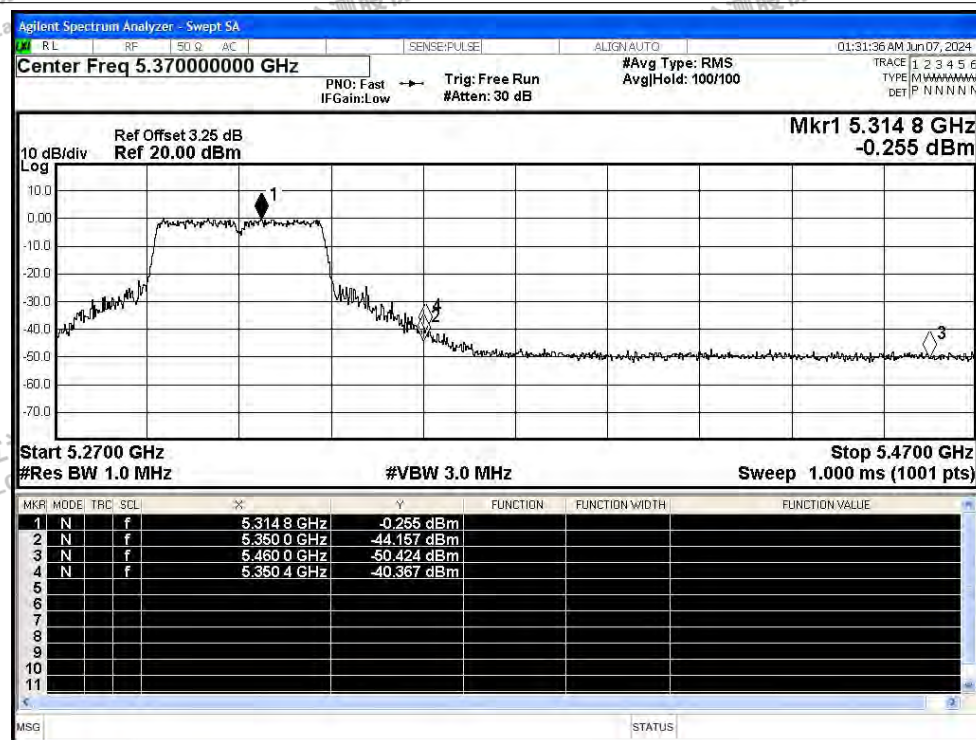

## Restrict Band NVNT ac40 5310MHz Ant1 Average

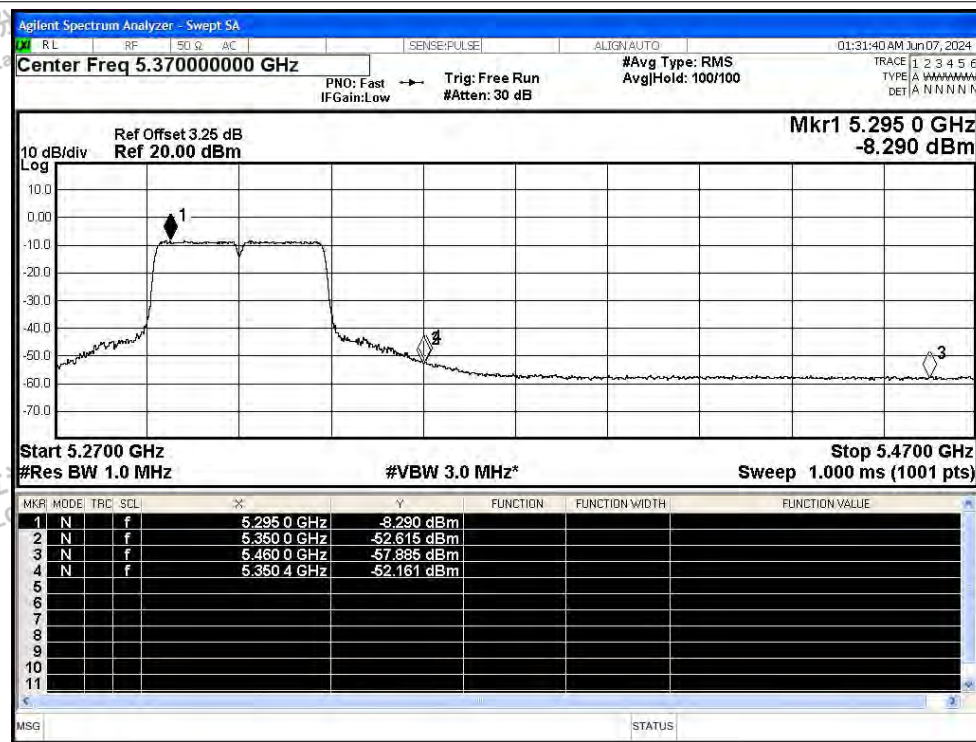

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ac80 5290MHz Ant1 Peak

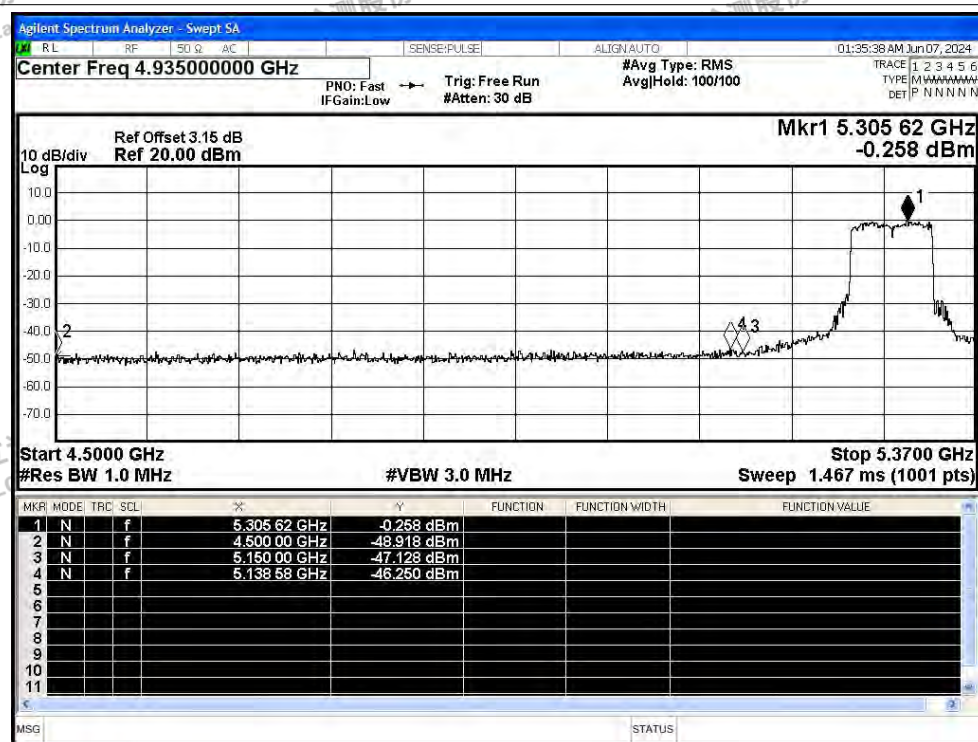

## Restrict Band NVNT ac80 5290MHz Ant1 Average

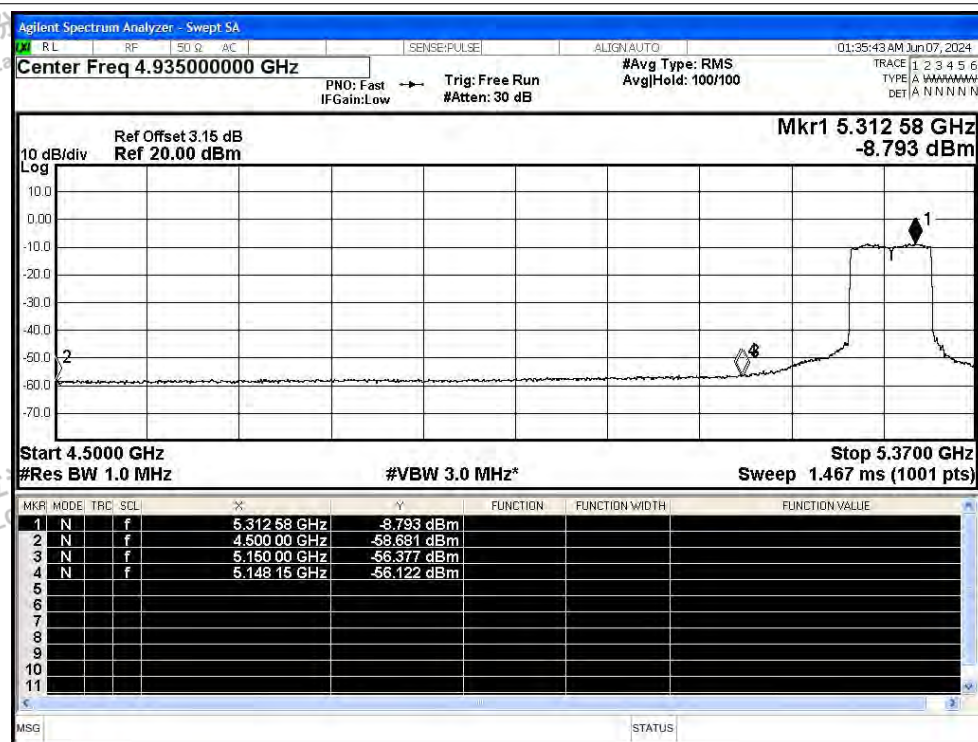

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5290MHz Ant1 Peak

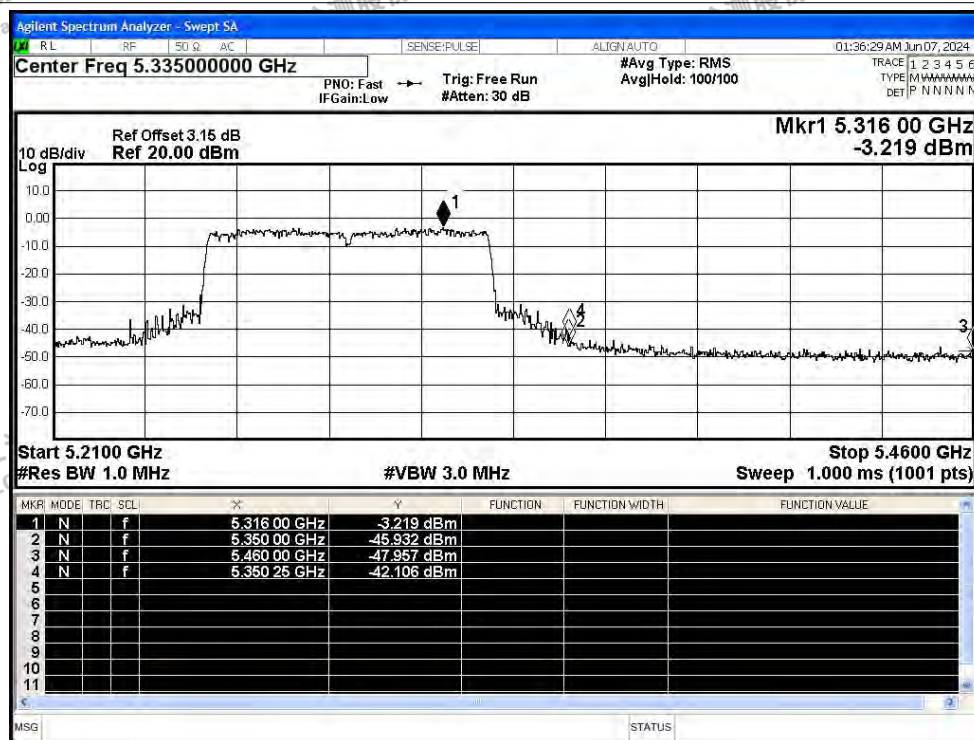

## Restrict Band NVNT ac80 5290MHz Ant1 Average

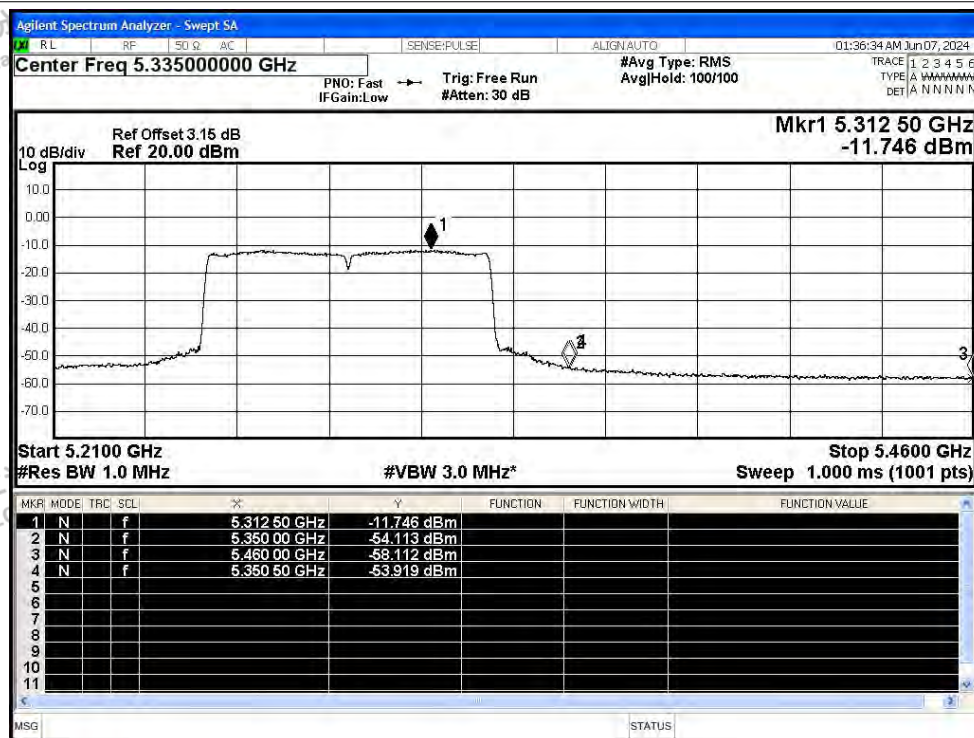

## Test Graphs

## Restrict Band NVNT ax20 5260MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

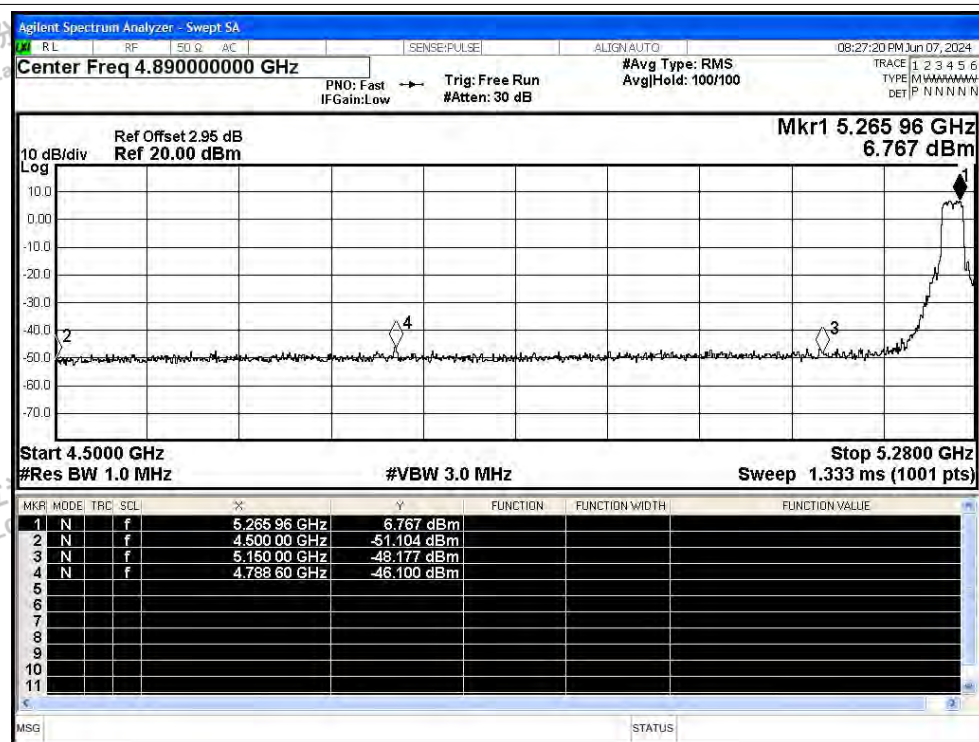

Restrict Band NVNT ax20 5260MHz Ant1 Average

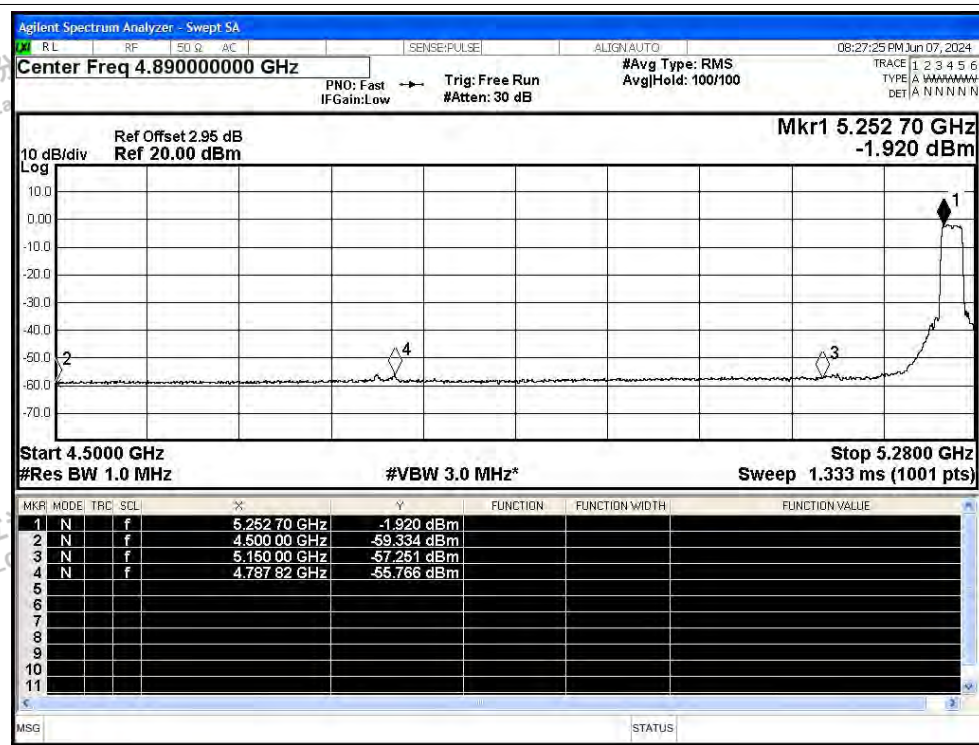



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




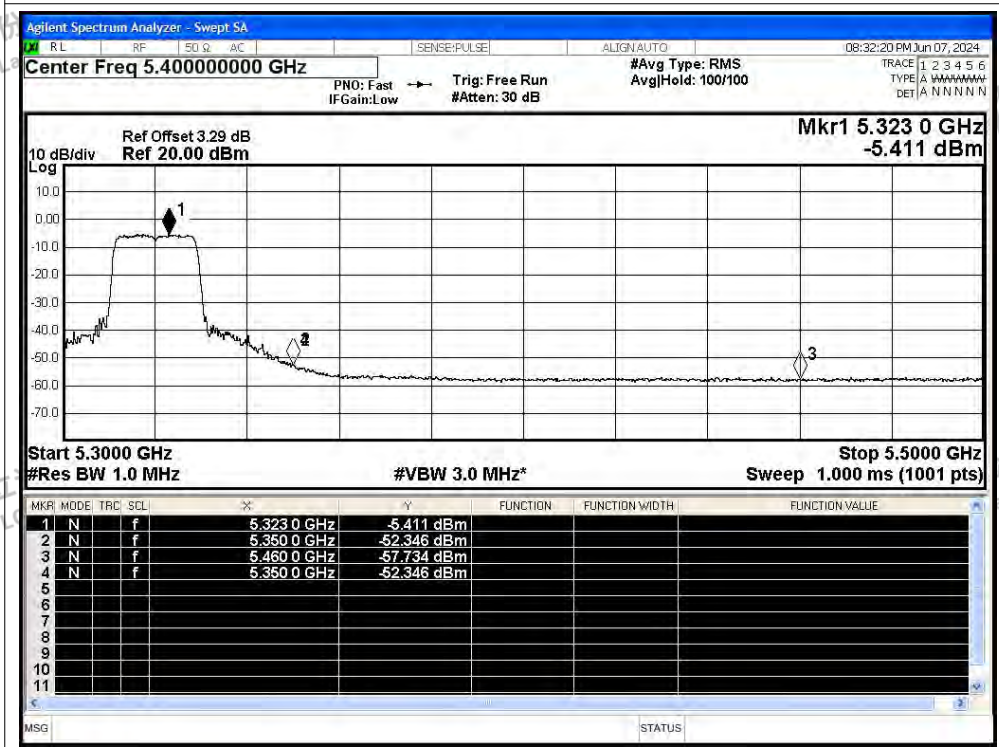


Scan code to check authenticity



## Restrict Band NVNT ax40 5270MHz Ant1 Peak

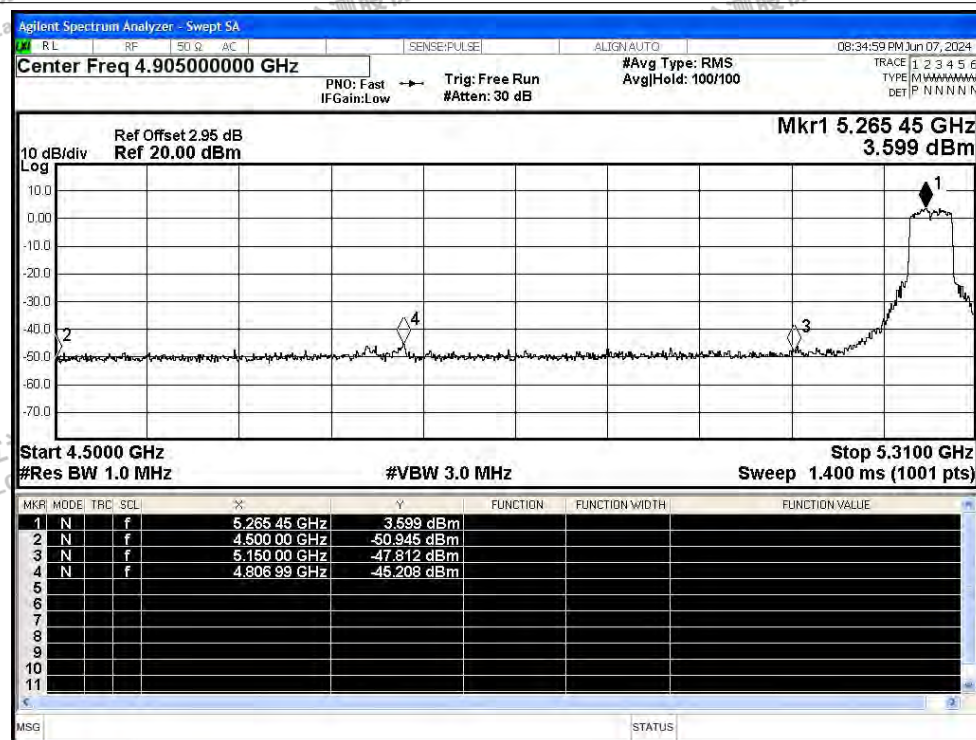

## Restrict Band NVNT ax40 5270MHz Ant1 Average

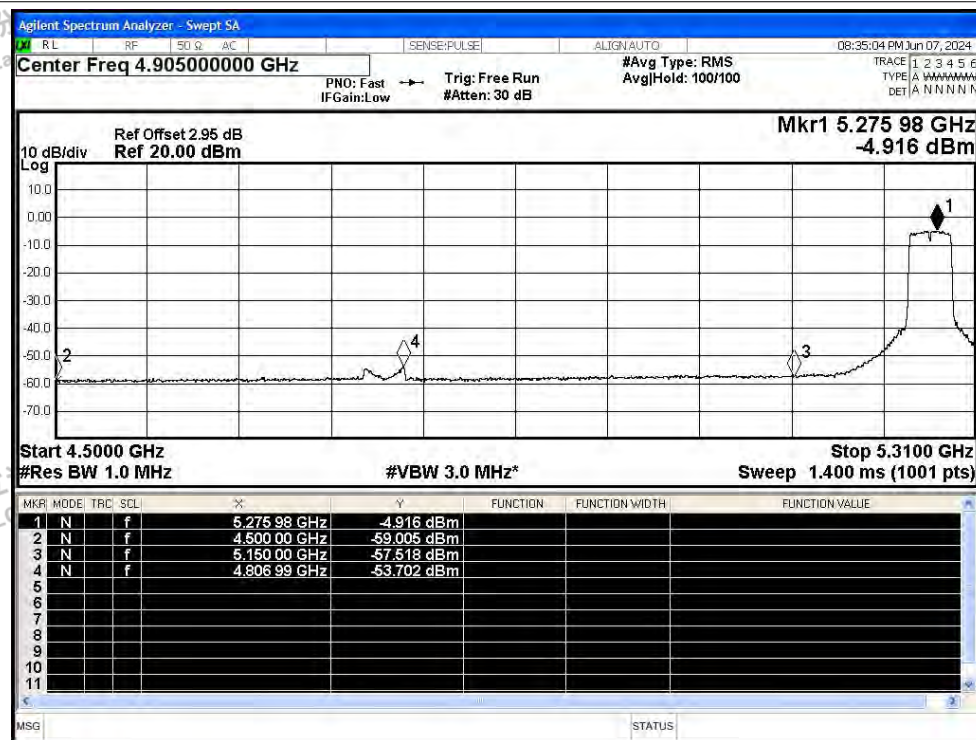

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5310MHz Ant1 Peak

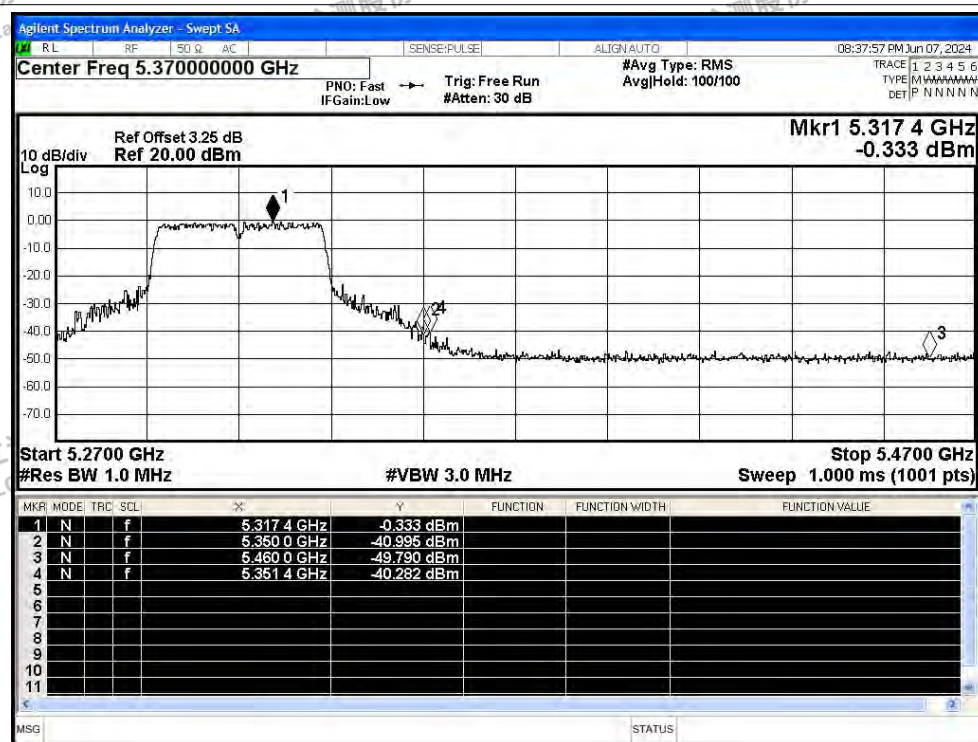

## Restrict Band NVNT ax40 5310MHz Ant1 Average

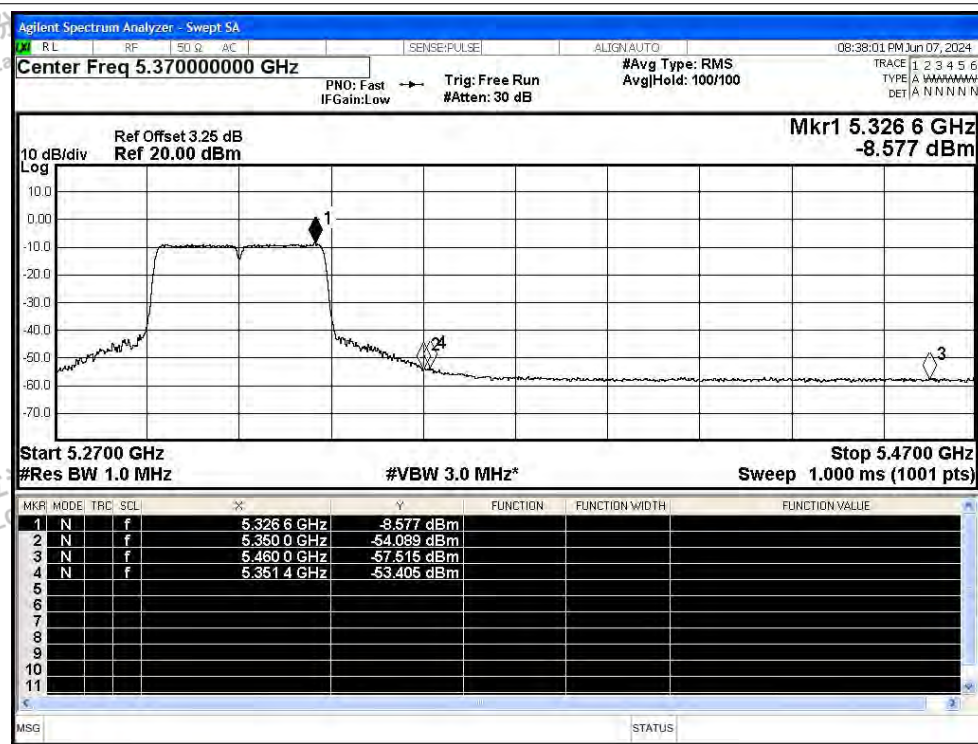

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ax80 5290MHz Ant1 Peak

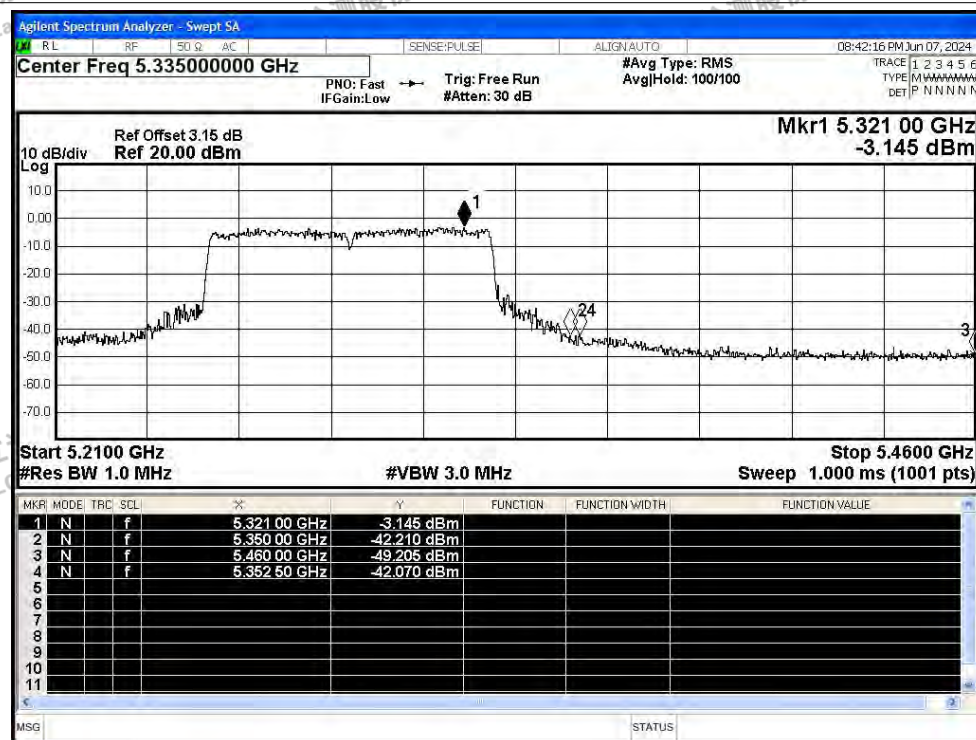

## Restrict Band NVNT ax80 5290MHz Ant1 Average

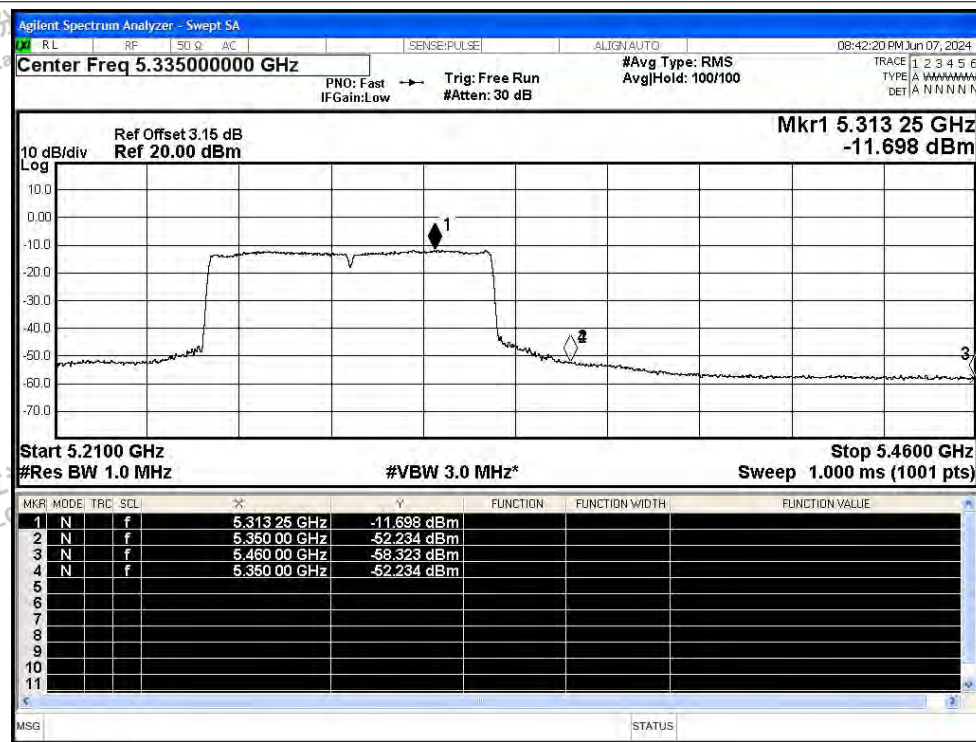

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5290MHz Ant1 Peak

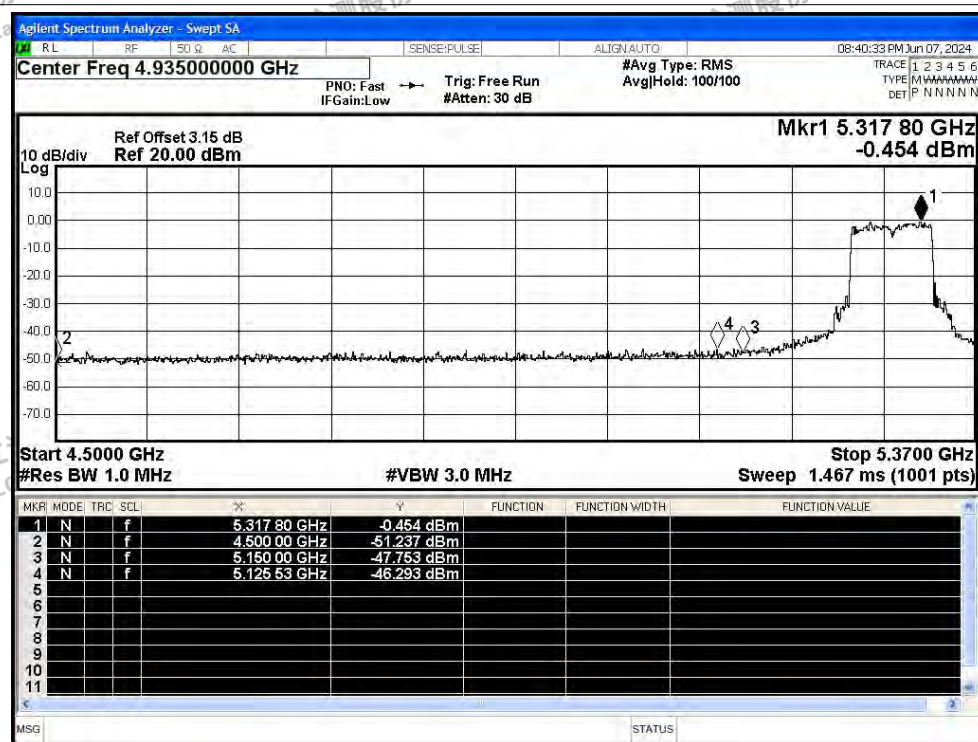

## Restrict Band NVNT ax80 5290MHz Ant1 Average

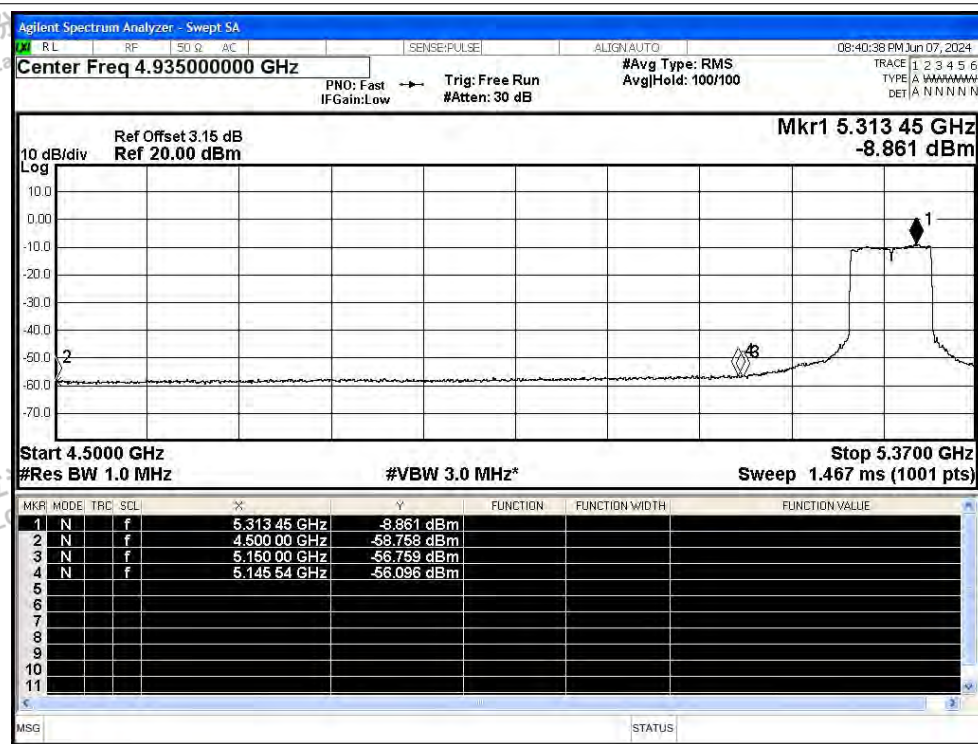

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## MIMO

| Condition | Mode | Frequency<br>(MHz) | Spur Freq<br>(MHz) | ANT0<br>Power<br>(dBm) | ANT1<br>Power<br>(dBm) | Gain<br>(dBi) | E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|--------------------|------------------------|------------------------|---------------|---------------|----------|-------------------|---------|
| NVNT      | n20  | 5260               | 4500               | -52.27                 | -50.66                 | 6.19          | 53.04         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | 4500               | -58.82                 | -58.76                 | 6.19          | 45.64         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | 5109.18            | -46                    | -44.65                 | 6.19          | 59.16         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | 4787.82            | -55.25                 | -52.58                 | 6.19          | 50.71         | Average  | 54                | Pass    |
| NVNT      | n20  | 5260               | 5150               | -48.6                  | -47.32                 | 6.19          | 56.51         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5260               | 5150               | -56.87                 | -56.8                  | 6.19          | 47.59         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | 5350               | -40.21                 | -39.71                 | 6.19          | 64.48         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | 5350               | -52.86                 | -52.67                 | 6.19          | 51.66         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | 5354               | -35.33                 | -49.84                 | 6.19          | 66.24         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | 5350.2             | -51.57                 | -58.03                 | 6.19          | 50.73         | Average  | 54                | Pass    |
| NVNT      | n20  | 5320               | 5460               | -50.69                 | -51.45                 | 6.19          | 53.37         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5320               | 5460               | -57.91                 | -59.08                 | 6.19          | 45.97         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | 4500               | -51.73                 | -45.34                 | 6.19          | 56.98         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | 4500               | -58.81                 | -55.49                 | 6.19          | 47.59         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | 4872.6             | -46.55                 | -46.63                 | 6.19          | 57.84         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | 5079.15            | -56.96                 | -56.62                 | 6.19          | 47.64         | Average  | 54                | Pass    |
| NVNT      | n40  | 5270               | 5150               | -48.21                 | -41.03                 | 6.19          | 61.15         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5270               | 5150               | -57.57                 | -53.71                 | 6.19          | 49.20         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | 5350               | -45.85                 | -38.45                 | 6.19          | 63.69         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | 5350               | -56.41                 | -53.29                 | 6.19          | 49.85         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | 5351.6             | -45.03                 | -49.05                 | 6.19          | 57.84         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | 5351.6             | -55.42                 | -57.81                 | 6.19          | 47.98         | Average  | 54                | Pass    |
| NVNT      | n40  | 5310               | 5460               | -50.35                 | -50.89                 | 6.19          | 53.82         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5310               | 5460               | -58.2                  | -59.23                 | 6.19          | 45.74         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | 4500               | -51.06                 | -45.26                 | 6.19          | 57.17         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | 4500               | -59.02                 | -52.56                 | 6.19          | 49.68         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | 5063.94            | -46.62                 | -48.88                 | 6.19          | 56.82         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | 5076.42            | -56.7                  | -57.28                 | 6.19          | 47.45         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5260               | 5150               | -49.17                 | -44.16                 | 6.19          | 58.45         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5260               | 5150               | -57.6                  | -52.62                 | 6.19          | 50.00         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | 5350               | -43.23                 | -40.37                 | 6.19          | 62.86         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | 5350               | -56.74                 | -52.16                 | 6.19          | 50.56         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | 5353.8             | -41.61                 | -50.42                 | 6.19          | 60.34         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | 5351.2             | -55.55                 | -57.89                 | 6.19          | 47.86         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5320               | 5460               | -48.03                 | -48.92                 | 6.19          | 55.98         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5320               | 5460               | -57.67                 | -58.68                 | 6.19          | 46.28         | Average  | 54                | Pass    |
| NVNT      | ac40 | 5270               | 4500               | -50.82                 | -46.25                 | 6.19          | 56.47         | Peak     | 68.2              | Pass    |
| NVNT      | ac40 | 5270               | 4500               | -58.88                 | -56.12                 | 6.19          | 47.14         | Average  | 54                | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





|      |      |      |         |        |        |      |       |         |      |      |
|------|------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ac40 | 5270 | 4806.18 | -47.16 | -47.13 | 6.19 | 57.28 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | 4806.99 | -56.44 | -56.38 | 6.19 | 48.02 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | 5150    | -49.02 | -45.93 | 6.19 | 57.22 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | 5150    | -57.6  | -54.11 | 6.19 | 48.91 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5350    | -44.28 | -42.11 | 6.19 | 61.37 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5350    | -55.83 | -53.92 | 6.19 | 49.66 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5351.4  | -42.07 | -47.96 | 6.19 | 60.34 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5350.6  | -55.57 | -58.11 | 6.19 | 47.77 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | 5460    | -50.47 | -51.1  | 6.19 | 53.65 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | 5460    | -58.42 | -59.33 | 6.19 | 45.58 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 4500    | -51.44 | -46.1  | 6.19 | 56.43 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 4500    | -58.99 | -55.77 | 6.19 | 47.34 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5140.32 | -45.58 | -48.18 | 6.19 | 57.74 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5139.45 | -55.97 | -57.25 | 6.19 | 47.86 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5150    | -45.91 | -40.92 | 6.19 | 61.69 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5150    | -55.99 | -52.35 | 6.19 | 50.63 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5350    | -40.79 | -37.49 | 6.19 | 65.59 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5350    | -50.16 | -57.73 | 6.19 | 51.96 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | 5387.25 | -38.63 | -50.95 | 6.19 | 63.03 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | 5460    | -57.39 | -59.01 | 6.19 | 46.30 | Peak    | 54   | Pass |
| NVNT | ax20 | 5260 | 4500    | -51.35 | -45.21 | 6.19 | 57.15 | Average | 68.2 | Pass |
| NVNT | ax20 | 5260 | 4500    | -60.05 | -53.7  | 6.19 | 48.62 | Peak    | 54   | Pass |
| NVNT | ax20 | 5260 | 4773    | -45.35 | -47.81 | 6.19 | 58.02 | Average | 68.2 | Pass |
| NVNT | ax20 | 5260 | 4772.22 | -55.33 | -57.52 | 6.19 | 48.14 | Peak    | 54   | Pass |
| NVNT | ax20 | 5260 | 5150    | -48.68 | -41    | 6.19 | 61.10 | Average | 68.2 | Pass |
| NVNT | ax20 | 5260 | 5150    | -56.59 | -54.09 | 6.19 | 49.27 | Peak    | 54   | Pass |
| NVNT | ax20 | 5320 | 5350    | -36.49 | -40.28 | 6.19 | 66.44 | Average | 68.2 | Pass |
| NVNT | ax20 | 5320 | 5350    | -52.72 | -53.41 | 6.19 | 51.38 | Peak    | 54   | Pass |
| NVNT | ax20 | 5320 | 5460    | -51.03 | -49.79 | 6.19 | 54.06 | Average | 68.2 | Pass |
| NVNT | ax20 | 5320 | 5460    | -58.28 | -57.52 | 6.19 | 46.54 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | 4500    | -52.17 | -42.21 | 6.19 | 59.63 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | 4500    | -59.21 | -52.23 | 6.19 | 49.98 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | 4775.4  | -44.63 | -42.07 | 6.19 | 61.26 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | 4806.99 | -53.59 | -58.32 | 6.19 | 49.09 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | 5150    | -48.85 | -51.24 | 6.19 | 54.55 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | 5150    | -56.89 | -58.76 | 6.19 | 46.70 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | 5350    | -40.03 | -46.29 | 6.19 | 62.31 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | 5350    | -52.38 | -56.1  | 6.19 | 50.57 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | 5351.8  | -34.55 | -47.75 | 6.19 | 67.03 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | 5460    | -58.31 | -56.76 | 6.19 | 46.96 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | 5350    | -45.09 | -56.1  | 6.19 | 56.66 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | 5350    | -53.86 | -50.75 | 6.19 | 52.40 | Peak    | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |         |        |        |      |       |         |      |      |
|------|------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ax80 | 5290 | 5352.75 | -44.51 | -56.76 | 6.19 | 57.16 | Average | 68.2 | Pass |
| NVNT | ax80 | 5290 | 5350.75 | -53.27 | -53.79 | 6.19 | 50.91 | Peak    | 54   | Pass |
| NVNT | ax80 | 5290 | 5460    | -49.68 | -37.42 | 6.19 | 64.25 | Average | 68.2 | Pass |
| NVNT | ax80 | 5290 | 5460    | -57.73 | -53.92 | 6.19 | 49.01 | Peak    | 54   | Pass |
| NVNT | ax80 | 5290 | 4500    | -50.18 | -51.26 | 6.19 | 53.74 | Average | 68.2 | Pass |
| NVNT | ax80 | 5290 | 4500    | -59.49 | -59.13 | 6.19 | 45.12 | Peak    | 54   | Pass |
| NVNT | ax80 | 5290 | 5127.27 | -45.55 | -45.63 | 6.19 | 58.84 | Average | 68.2 | Pass |
| NVNT | ax80 | 5290 | 5149.02 | -55.87 | -55.42 | 6.19 | 48.79 | Peak    | 54   | Pass |
| NVNT | ax80 | 5290 | 5150    | -46.53 | -48.05 | 6.19 | 57.20 | Average | 68.2 | Pass |
| NVNT | ax80 | 5290 | 5150    | -56.04 | -56.19 | 6.19 | 48.31 | Peak    | 54   | Pass |





## E.5 Frequency Stability

| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | ac20 | 5260            | Ant0    | 5260                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5300            | Ant0    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | ac20 | 5320            | Ant0    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ac40 | 5270            | Ant0    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5310            | Ant0    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5290            | Ant0    | 5290                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5260            | Ant0    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ax20 | 5300            | Ant0    | 5299.98                  | -20000               | -3.77           | 25          | Pass    |
| NVNT      | ax20 | 5320            | Ant0    | 5320                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5270            | Ant0    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5310            | Ant0    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax80 | 5290            | Ant0    | 5290                     | 0                    | 0               | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity






## Test Graphs

Freq. Stability NVNT ac20 5260MHz Ant0

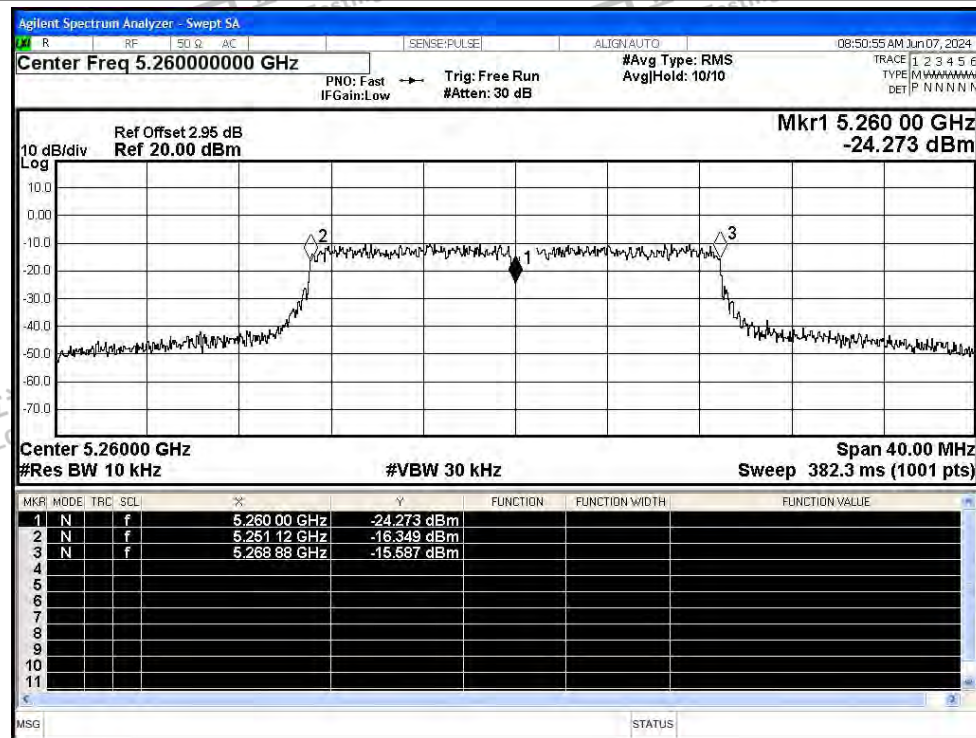

Freq. Stability NVNT ac20 5300MHz Ant0

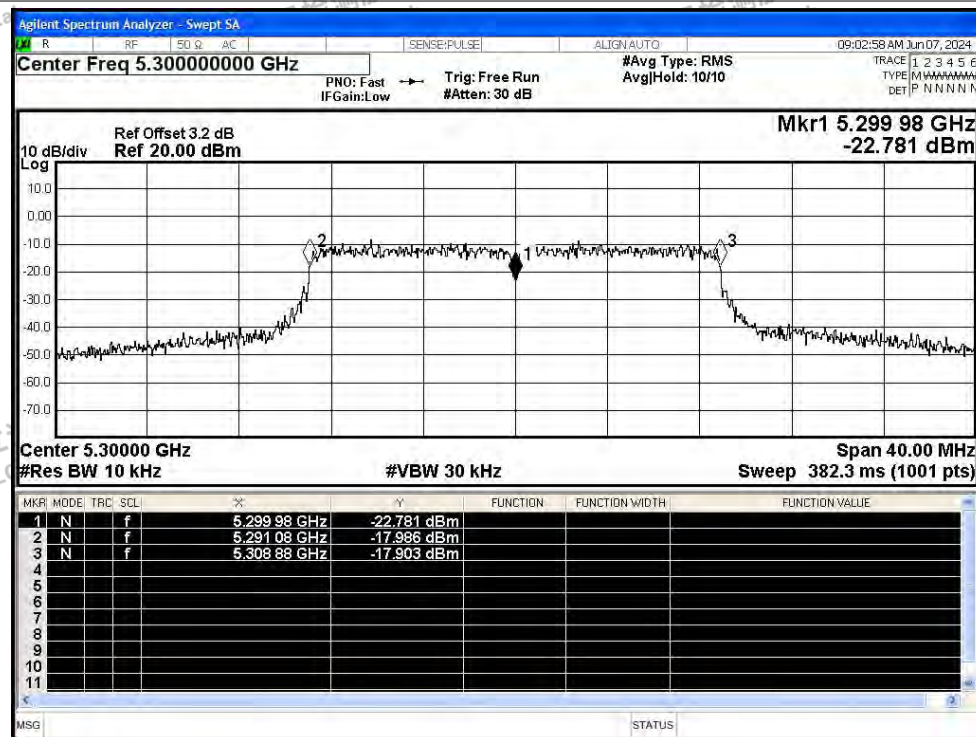

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5320MHz Ant0

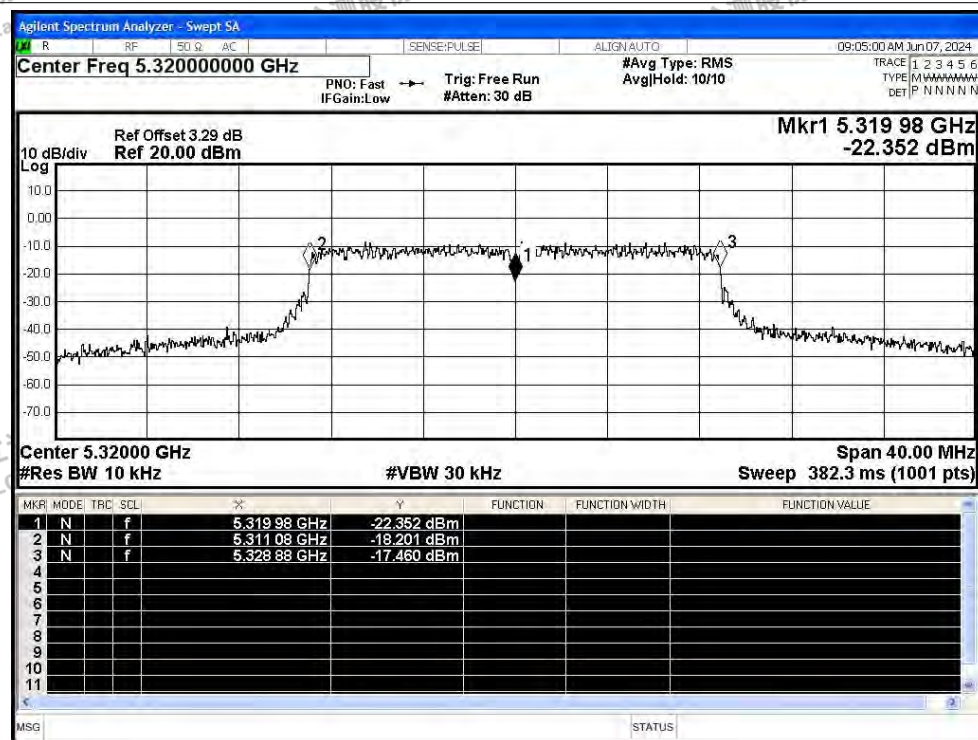

## Freq. Stability NVNT ac40 5270MHz Ant0

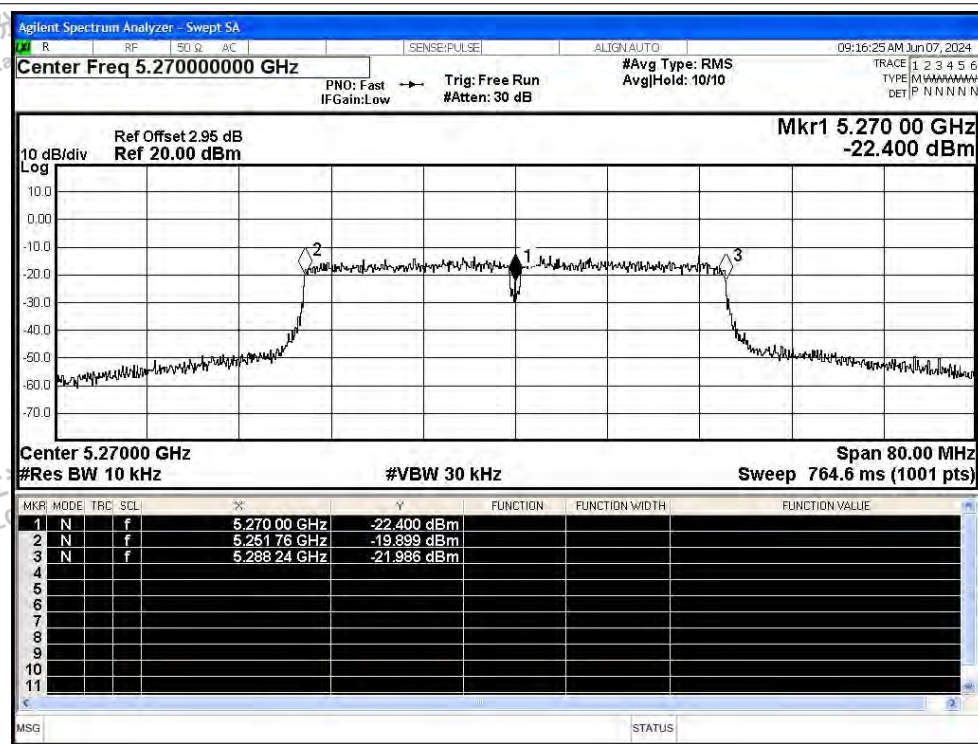

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5310MHz Ant0

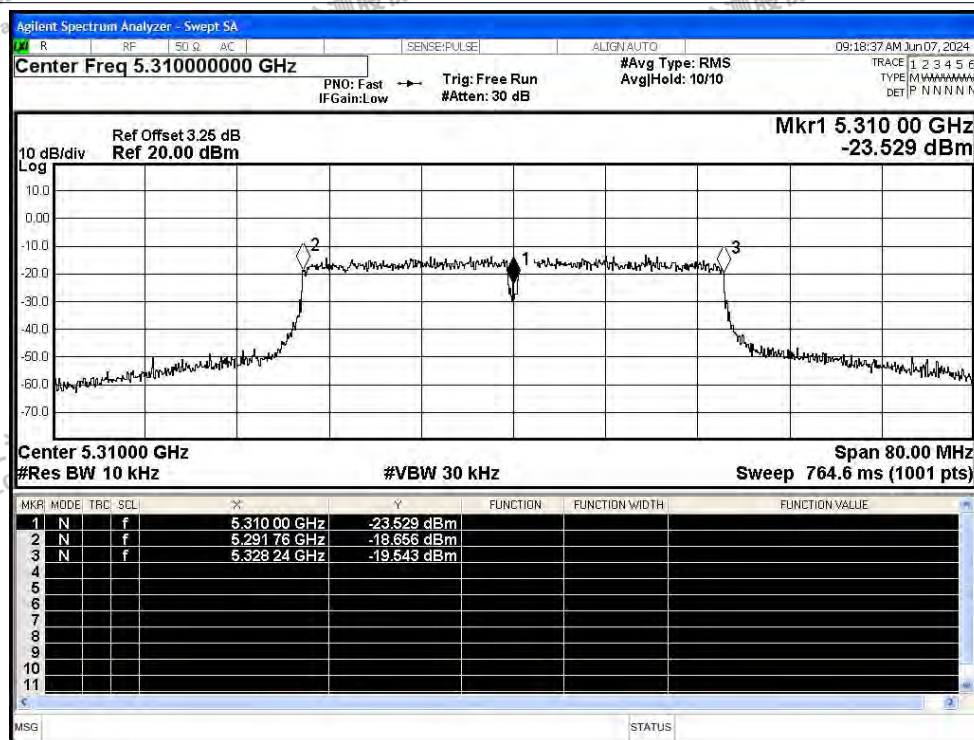

## Freq. Stability NVNT ac80 5290MHz Ant0

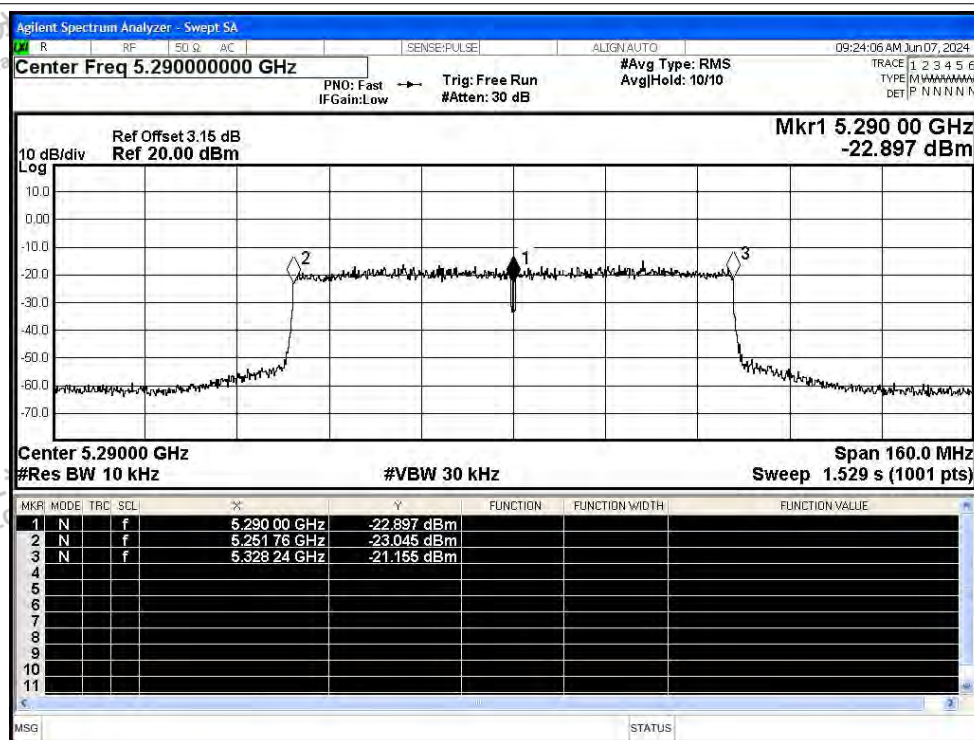

## Test Graphs

## Freq. Stability NVNT ax20 5260MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



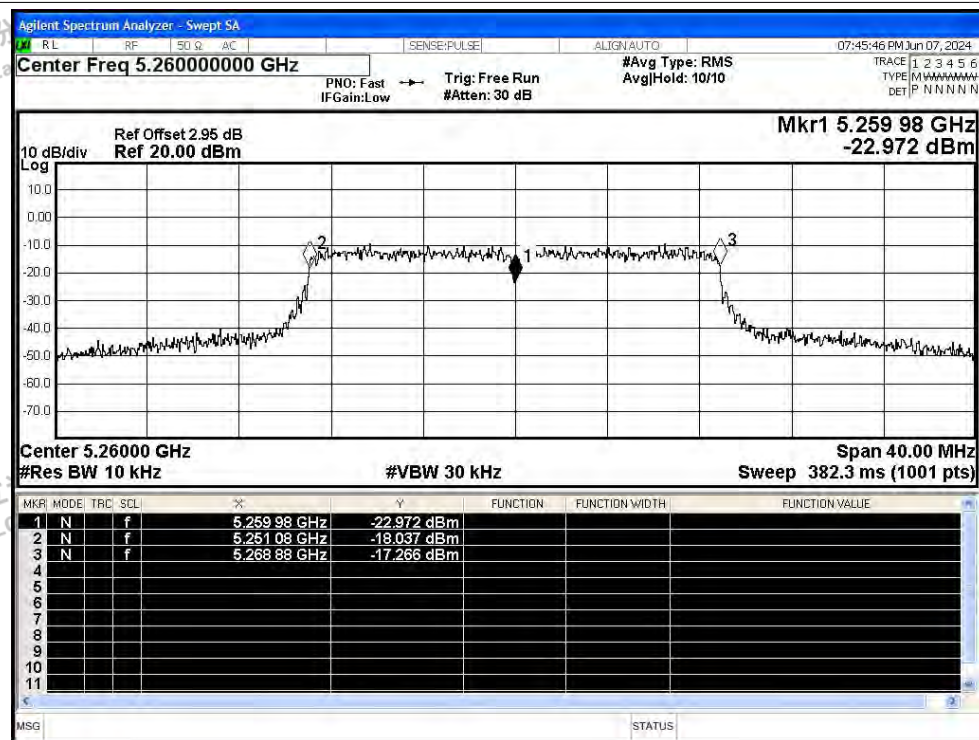

Freq. Stability NVNT ax20 5300MHz Ant0

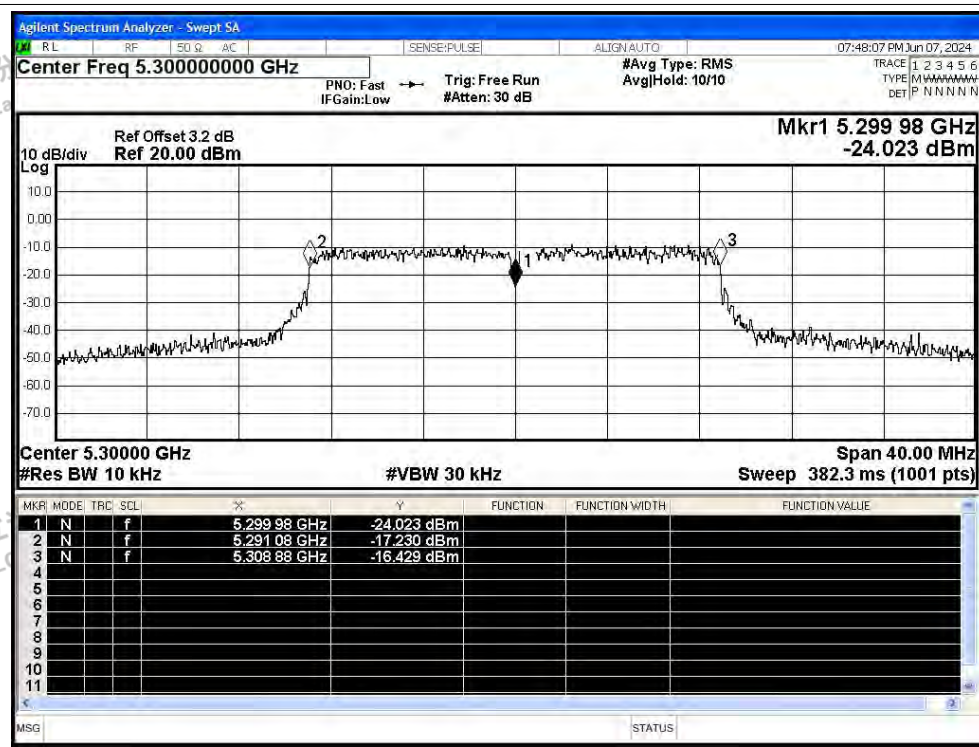

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5320MHz Ant0

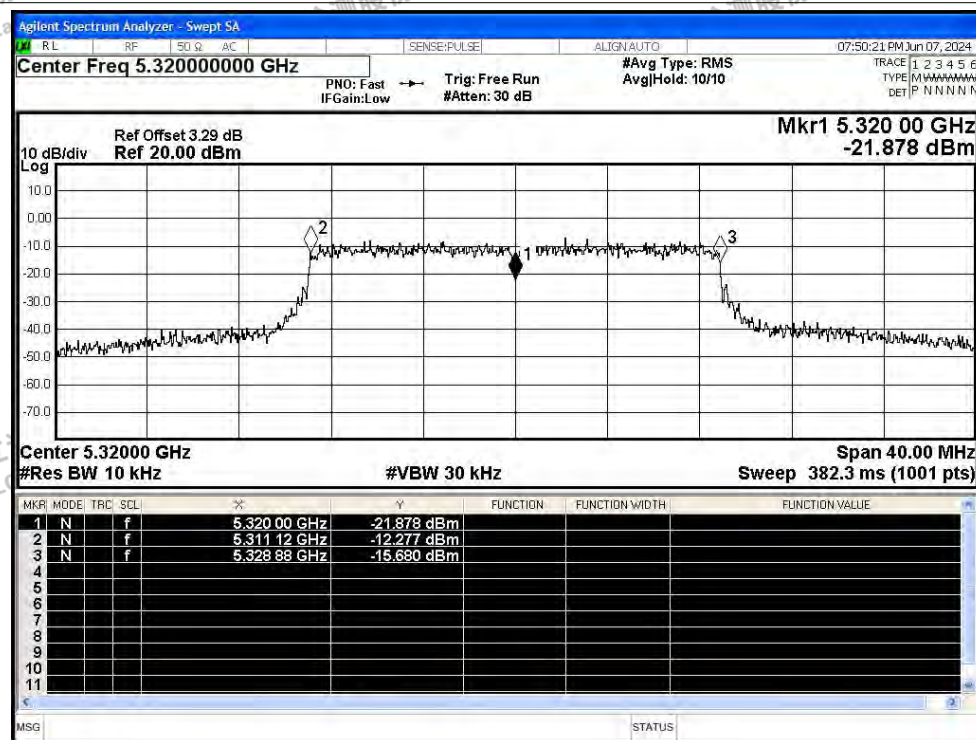

## Freq. Stability NVNT ax40 5270MHz Ant0

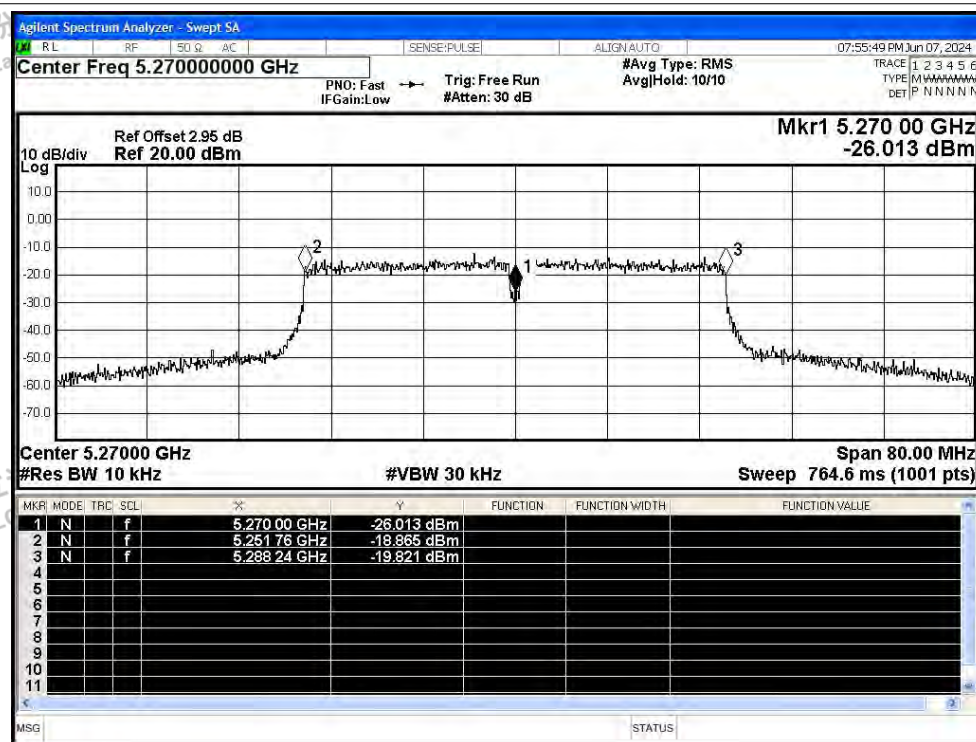

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5310MHz Ant0

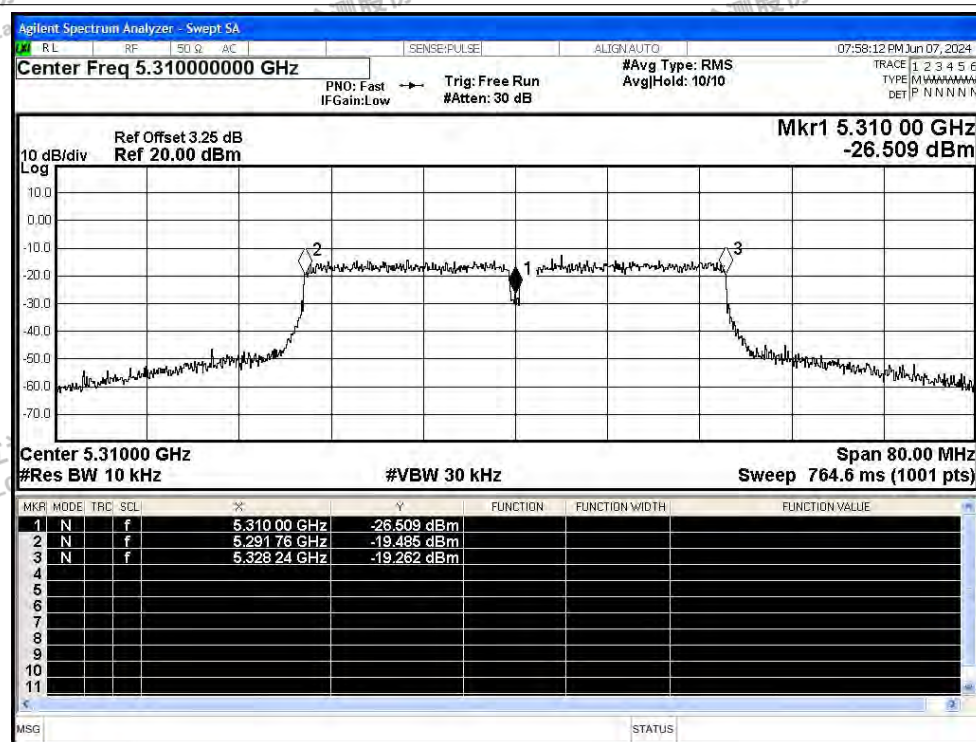

## Freq. Stability NVNT ax80 5290MHz Ant0

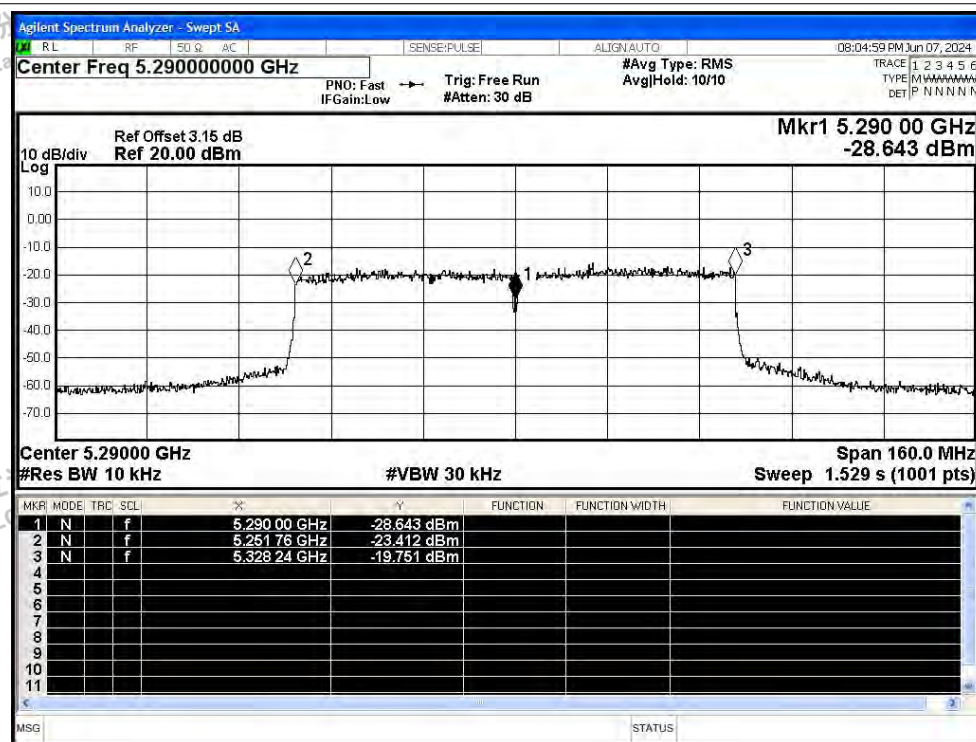

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | ac20 | 5260            | Ant1    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ac20 | 5300            | Ant1    | 5299.96                  | -40000               | -7.55           | 25          | Pass    |
| NVNT      | ac20 | 5320            | Ant1    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ac40 | 5270            | Ant1    | 5269.96                  | -40000               | -7.59           | 25          | Pass    |
| NVNT      | ac40 | 5310            | Ant1    | 5310                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5290            | Ant1    | 5290                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5260            | Ant1    | 5259.98                  | -20000               | -3.8            | 25          | Pass    |
| NVNT      | ax20 | 5300            | Ant1    | 5300                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5320            | Ant1    | 5319.98                  | -20000               | -3.76           | 25          | Pass    |
| NVNT      | ax40 | 5270            | Ant1    | 5270                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5310            | Ant1    | 5310.04                  | 40000                | 7.53            | 25          | Pass    |
| NVNT      | ax80 | 5290            | Ant1    | 5290                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

Freq. Stability NVNT ac20 5260MHz Ant1

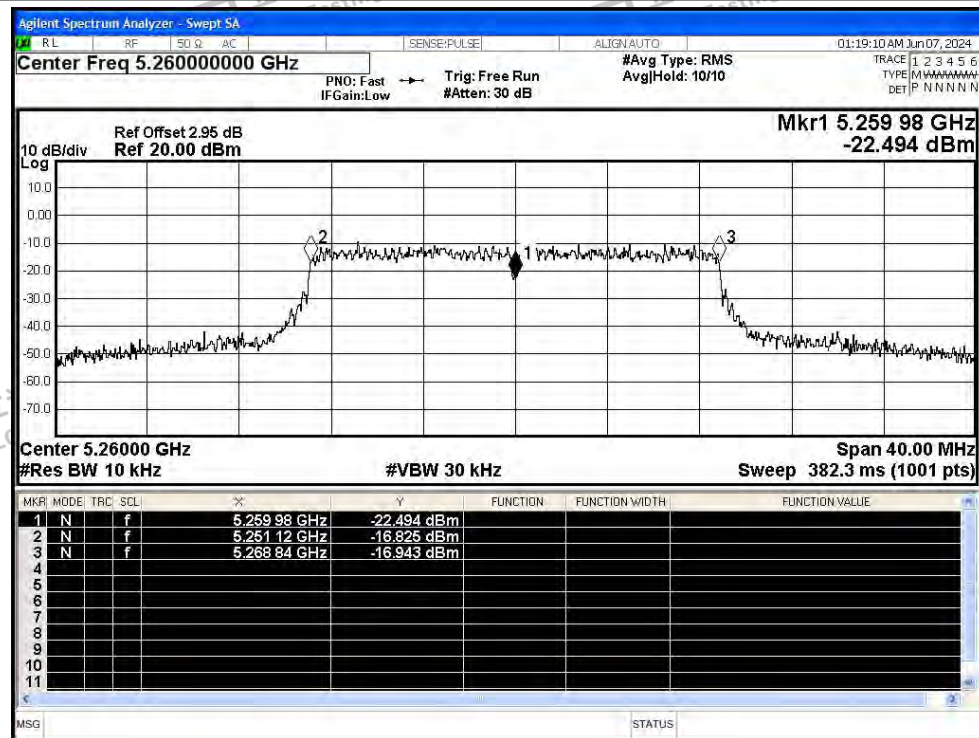

Freq. Stability NVNT ac20 5300MHz Ant1

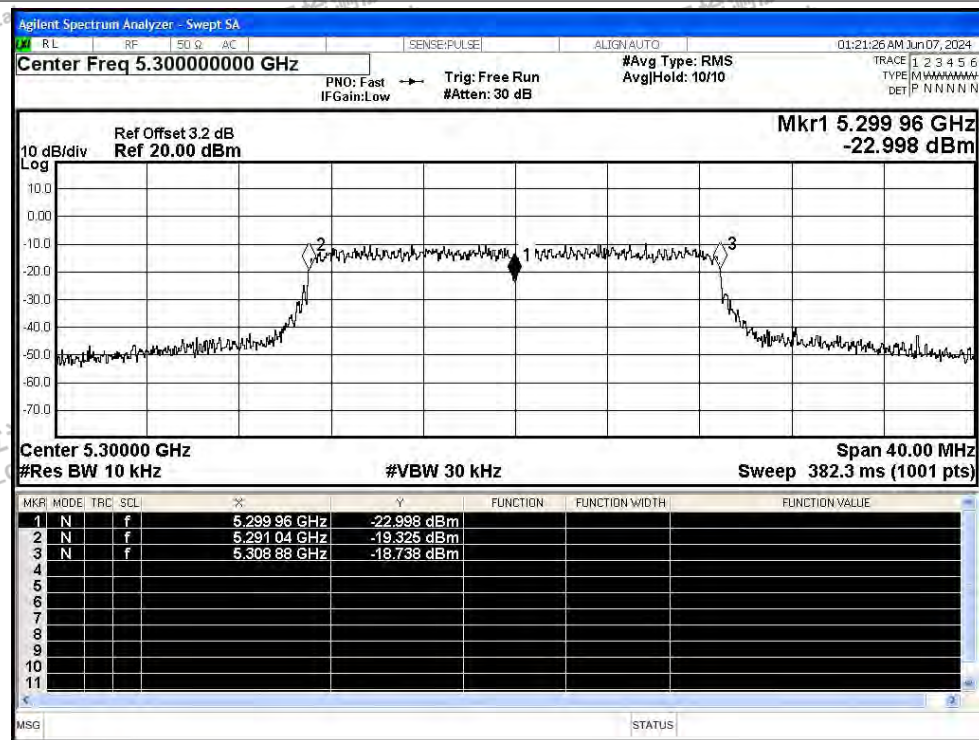

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5320MHz Ant1

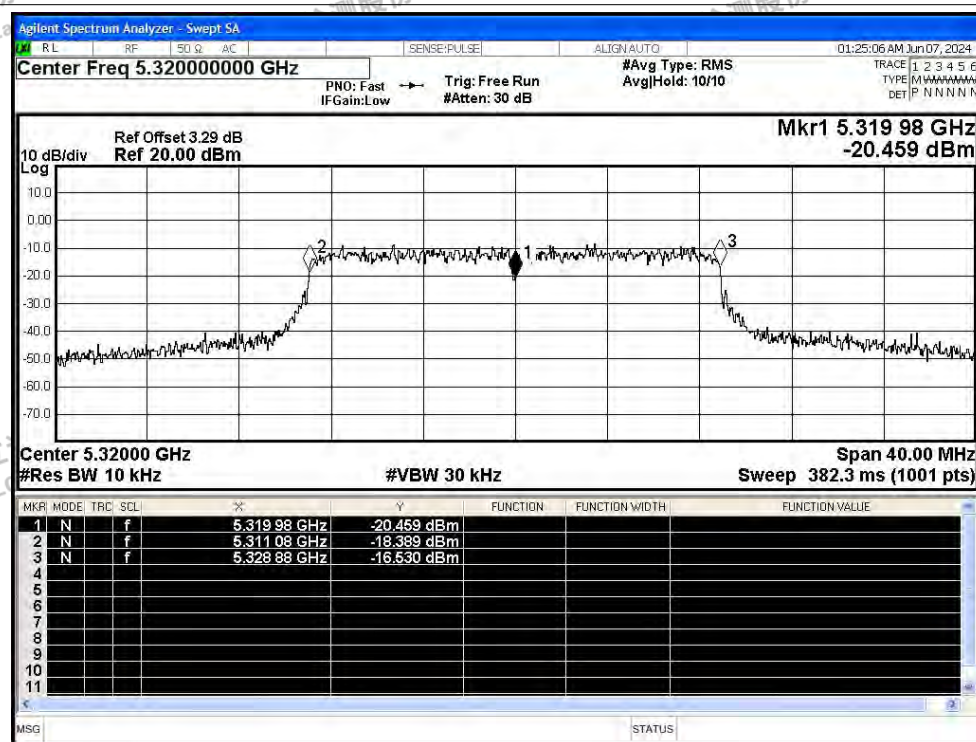

## Freq. Stability NVNT ac40 5270MHz Ant1

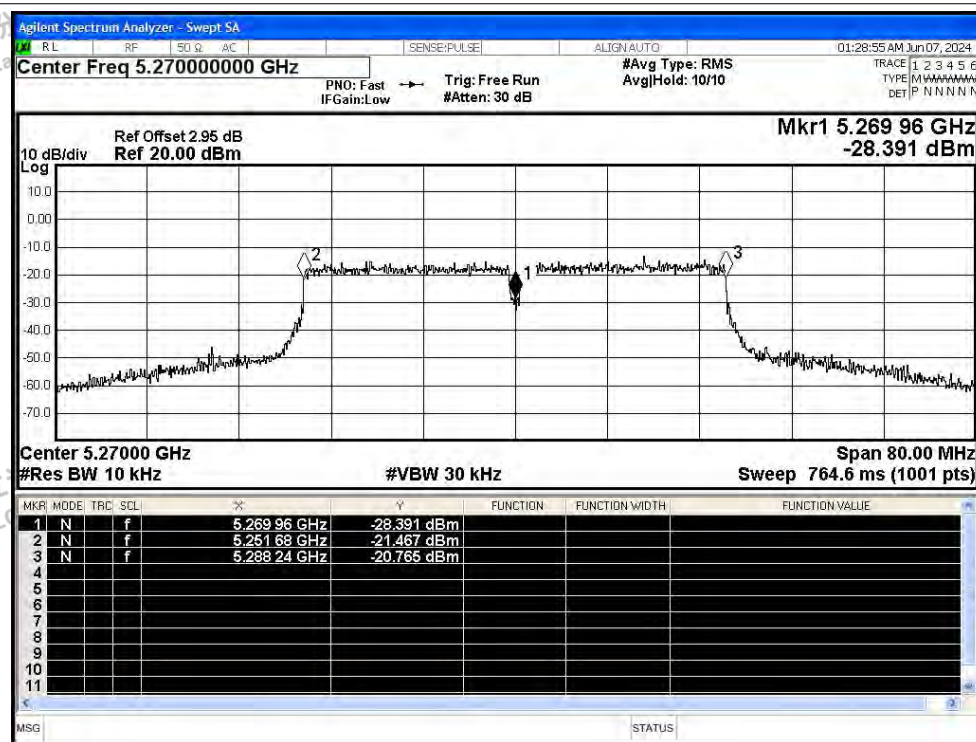

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ac40 5310MHz Ant1

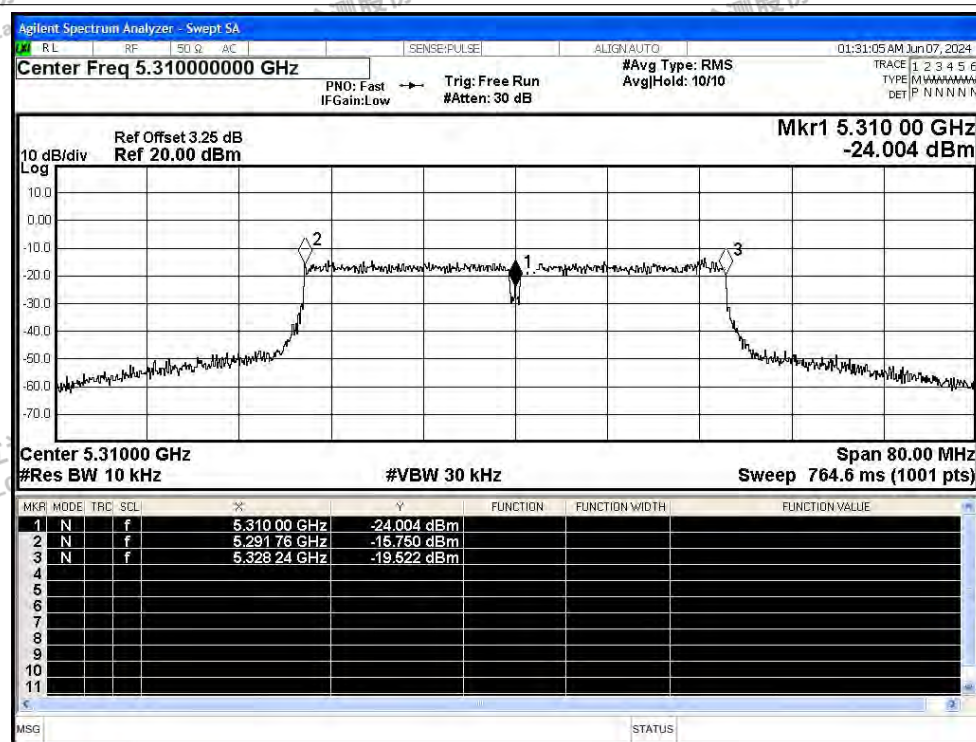

## Freq. Stability NVNT ac80 5290MHz Ant1

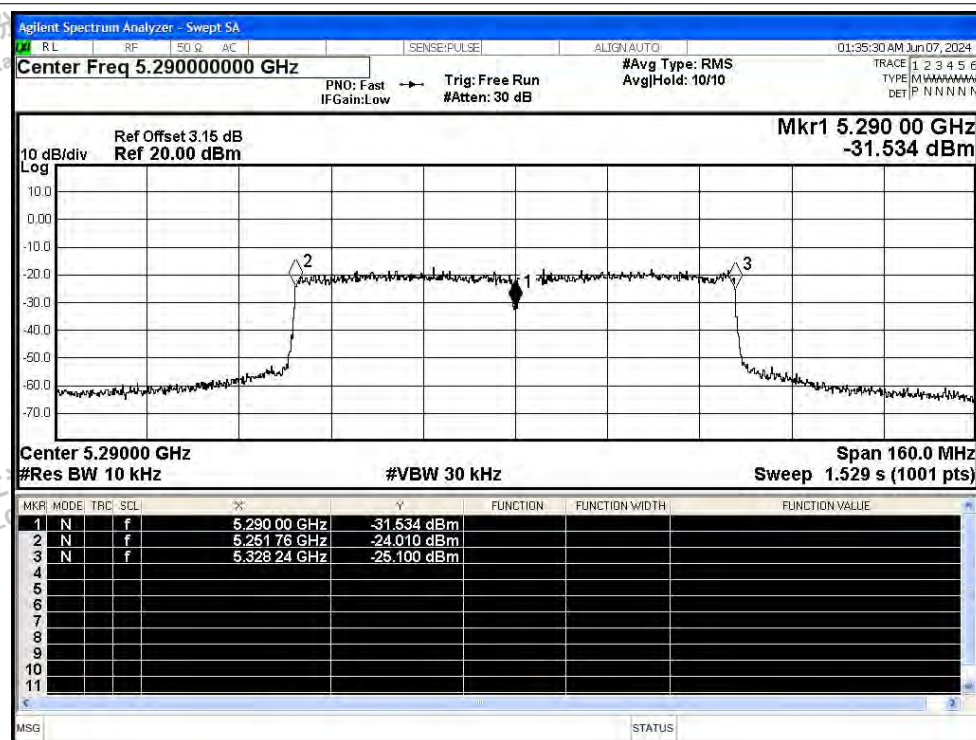

## Test Graphs

## Freq. Stability NVNT ax20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

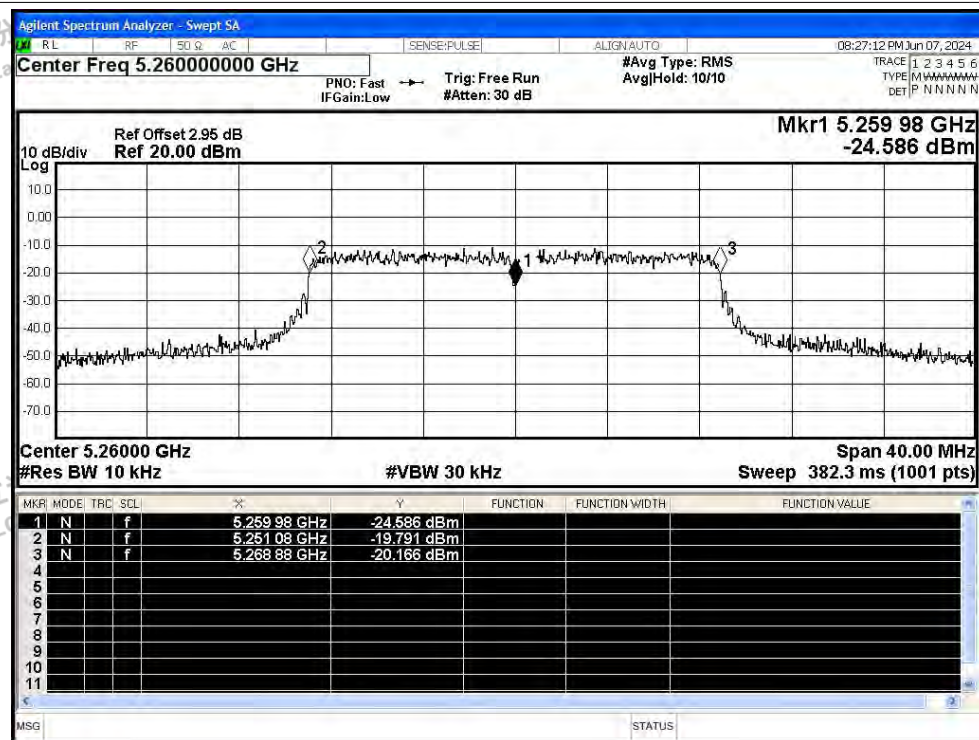

Freq. Stability NVNT ax20 5300MHz Ant1

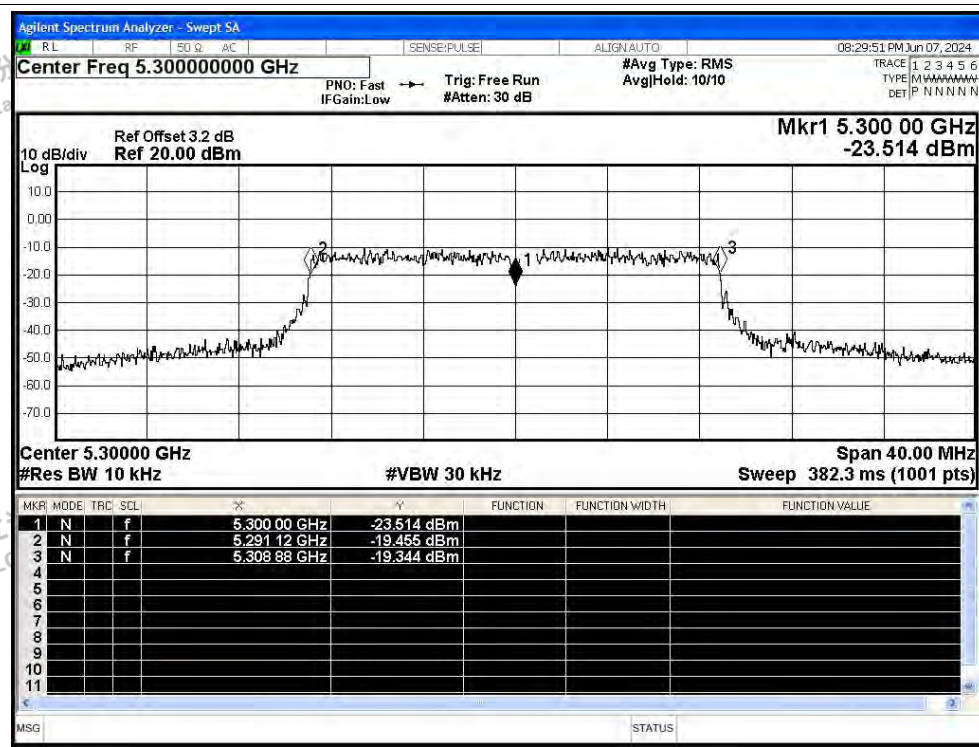

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5320MHz Ant1

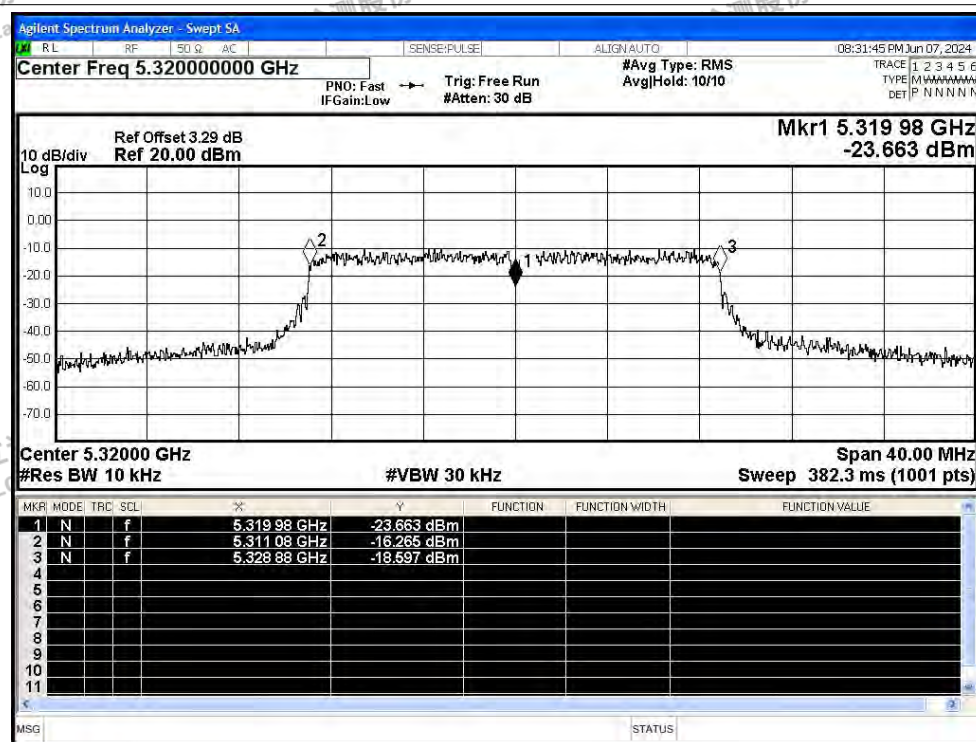

## Freq. Stability NVNT ax40 5270MHz Ant1

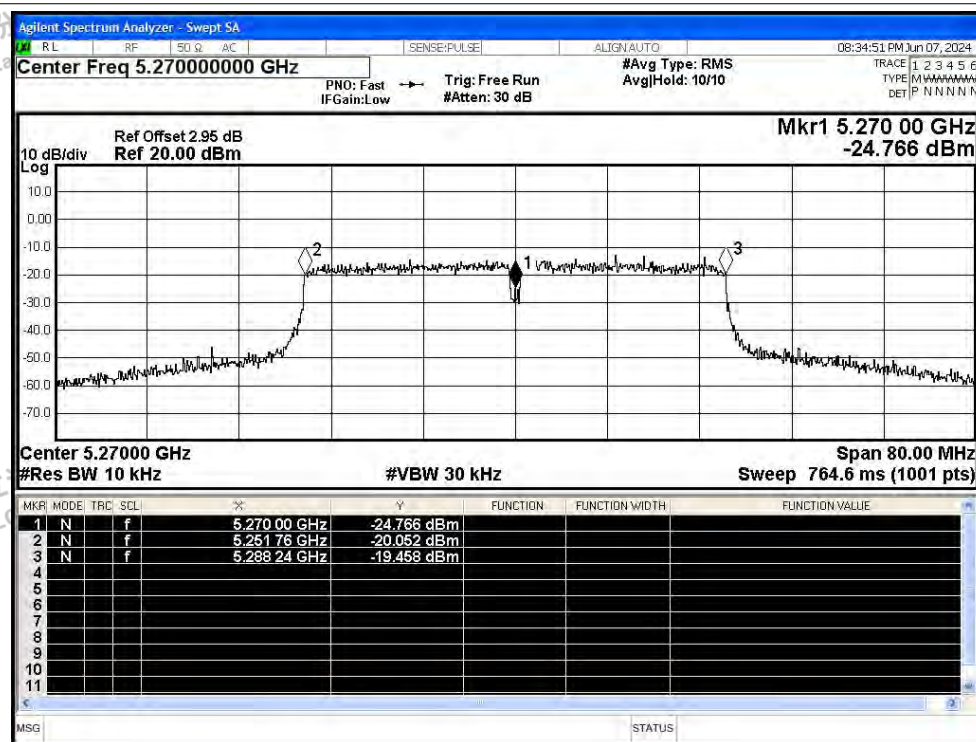

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ax40 5310MHz Ant1

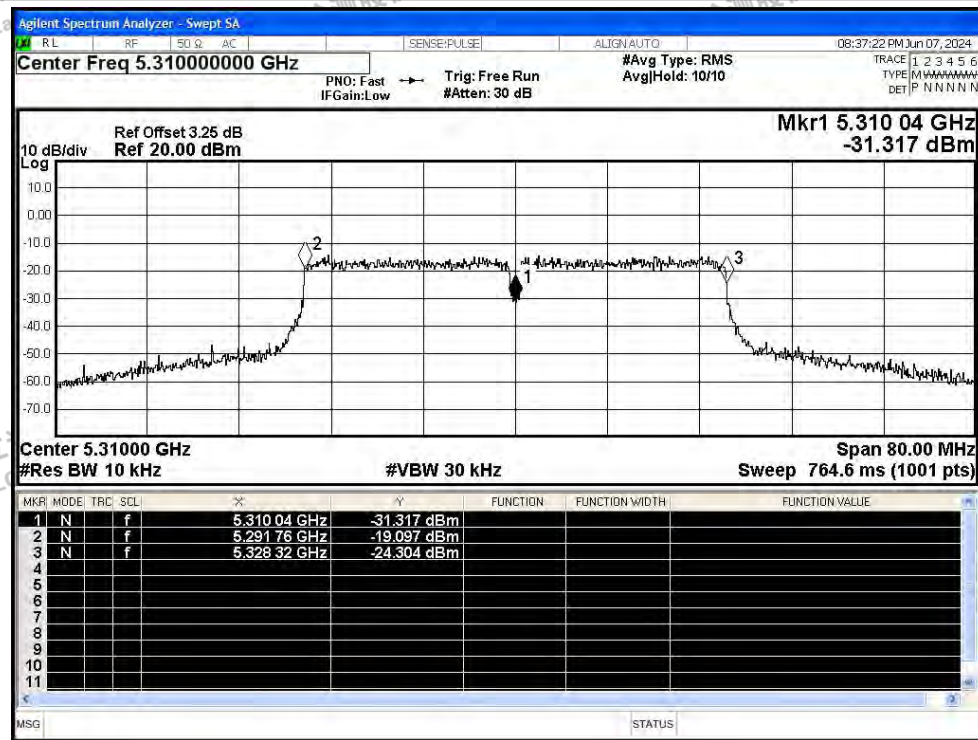

## Freq. Stability NVNT ax80 5290MHz Ant1

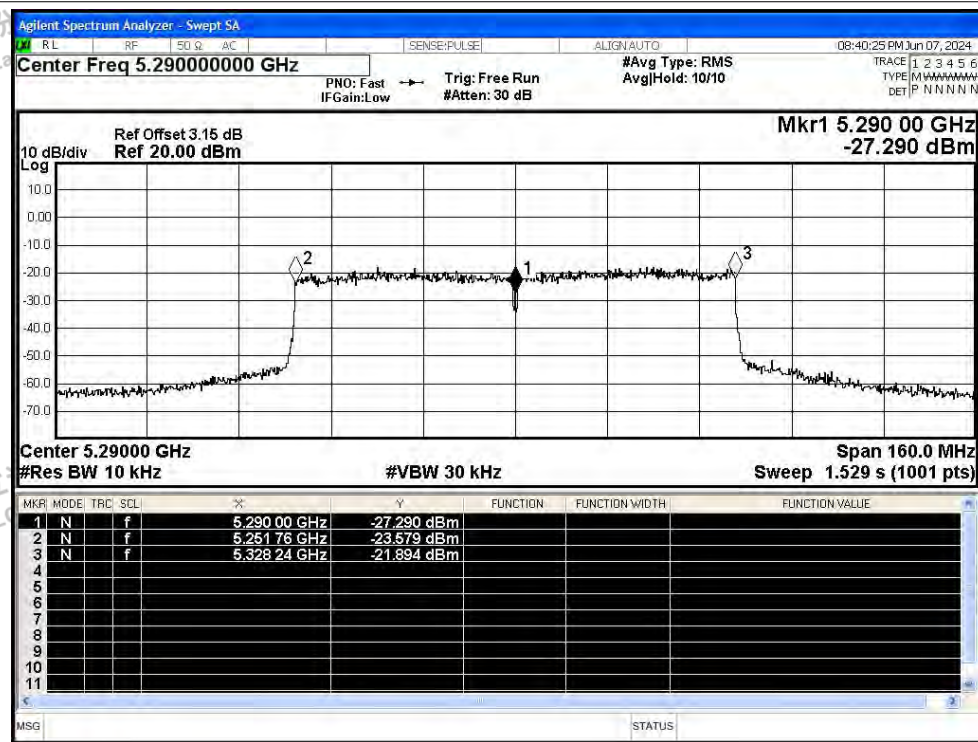

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.6 Duty Cycle

| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5260            | Ant0    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a    | 5300            | Ant0    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5320            | Ant0    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5260            | Ant0    | 93.67          | 0.28                   | 1.07      |
| NVNT      | n20  | 5300            | Ant0    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5320            | Ant0    | 93.67          | 0.28                   | 1.07      |
| NVNT      | n40  | 5270            | Ant0    | 90.3           | 0.44                   | 1.73      |
| NVNT      | n40  | 5310            | Ant0    | 90.14          | 0.45                   | 1.74      |
| NVNT      | ac20 | 5260            | Ant0    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5300            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5320            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5270            | Ant0    | 90.2           | 0.45                   | 1.72      |
| NVNT      | ac40 | 5310            | Ant0    | 90.36          | 0.44                   | 1.72      |
| NVNT      | ac80 | 5290            | Ant0    | 88.52          | 0.53                   | 2.06      |
| NVNT      | ax20 | 5260            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5300            | Ant0    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5320            | Ant0    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax40 | 5270            | Ant0    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax40 | 5310            | Ant0    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ax80 | 5290            | Ant0    | 94.41          | 0.25                   | 0.97      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5260MHz Ant0

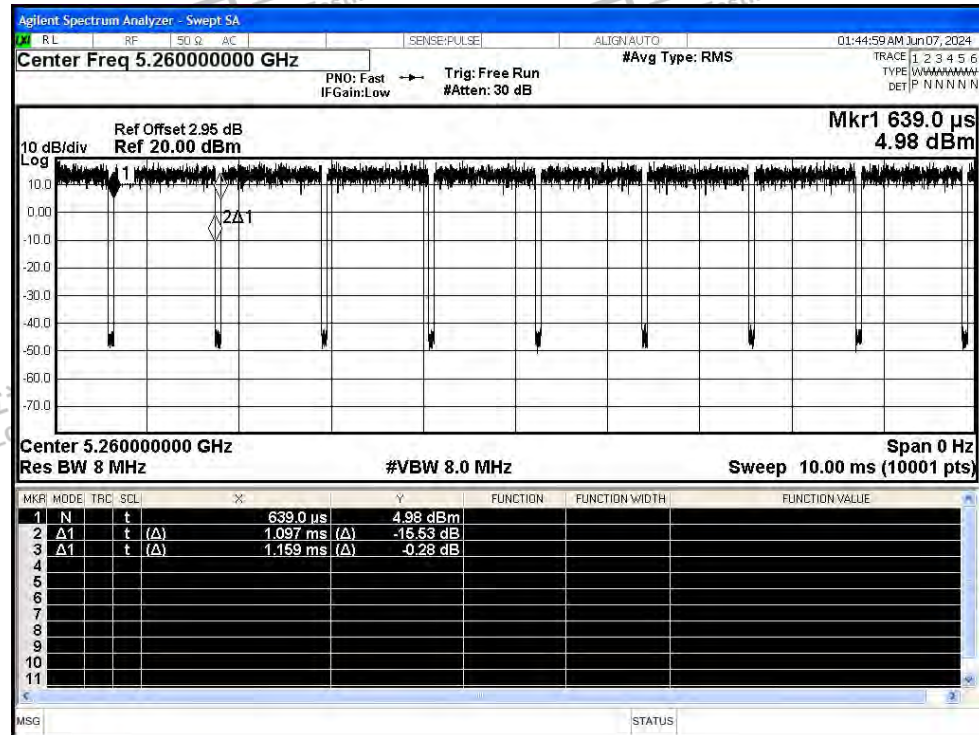

## Duty Cycle NVNT a 5300MHz Ant0

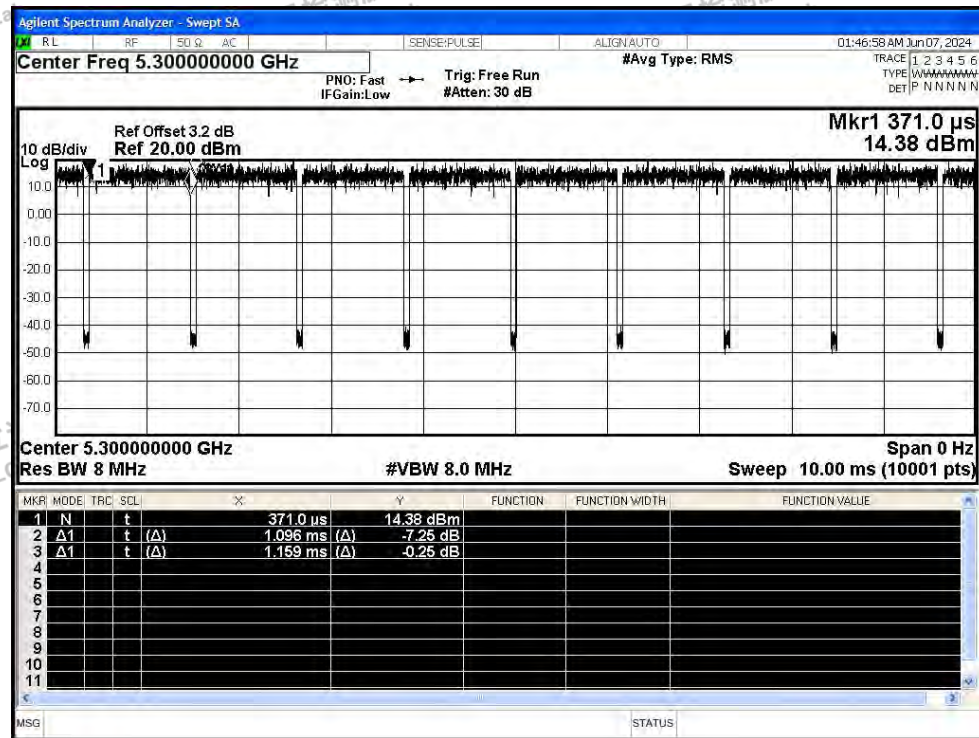

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Duty Cycle NVNT a 5320MHz Ant0

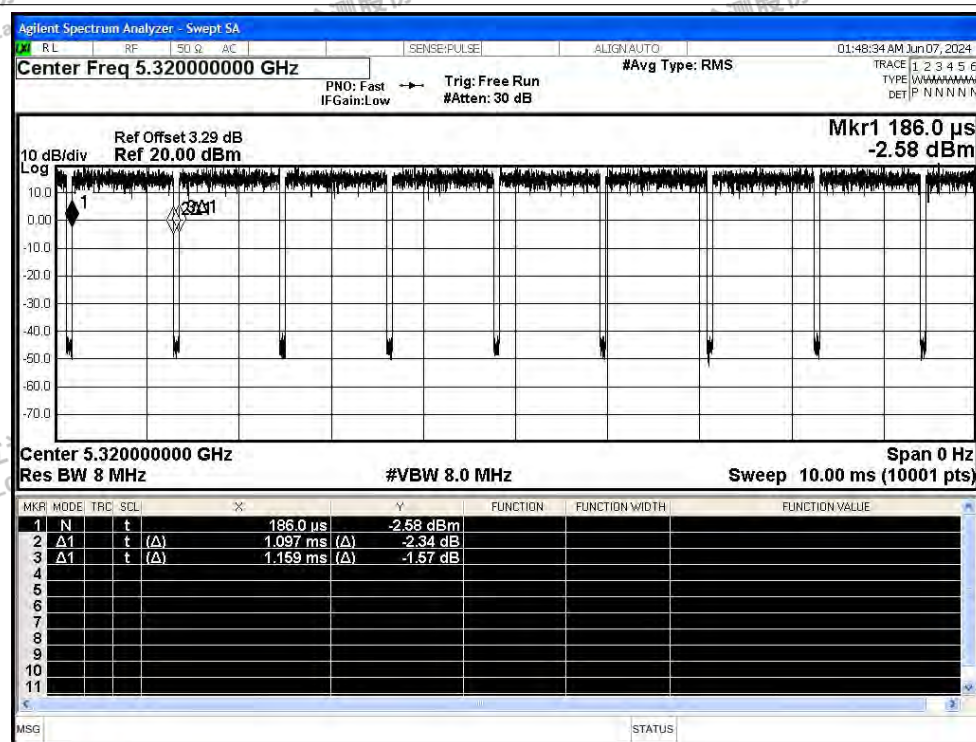

## Duty Cycle NVNT n20 5260MHz Ant0

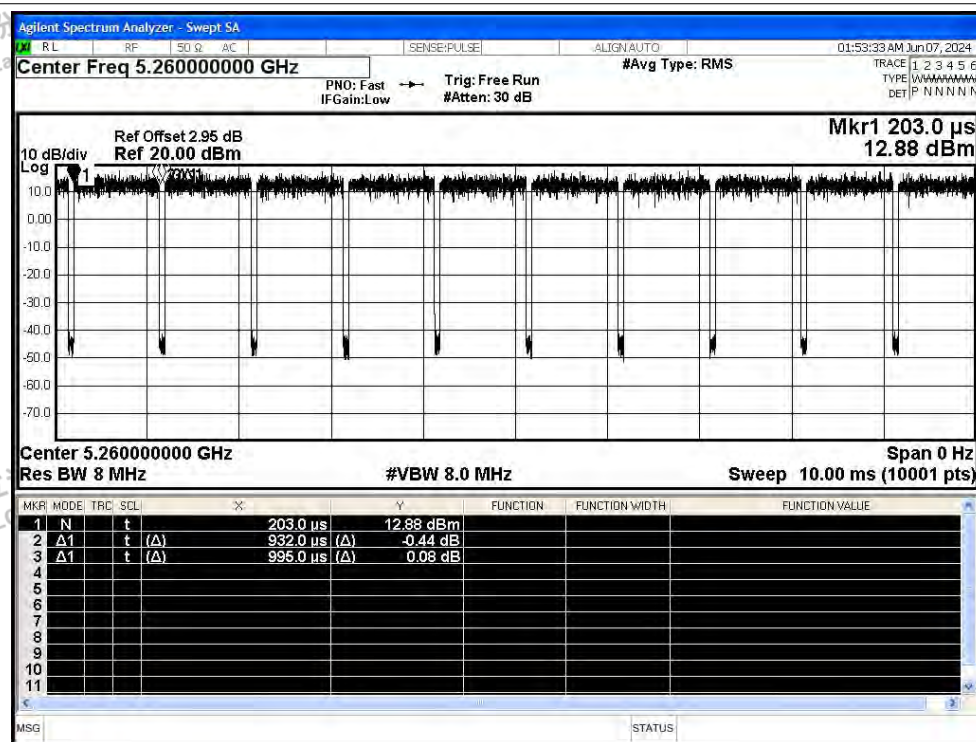

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5300MHz Ant0

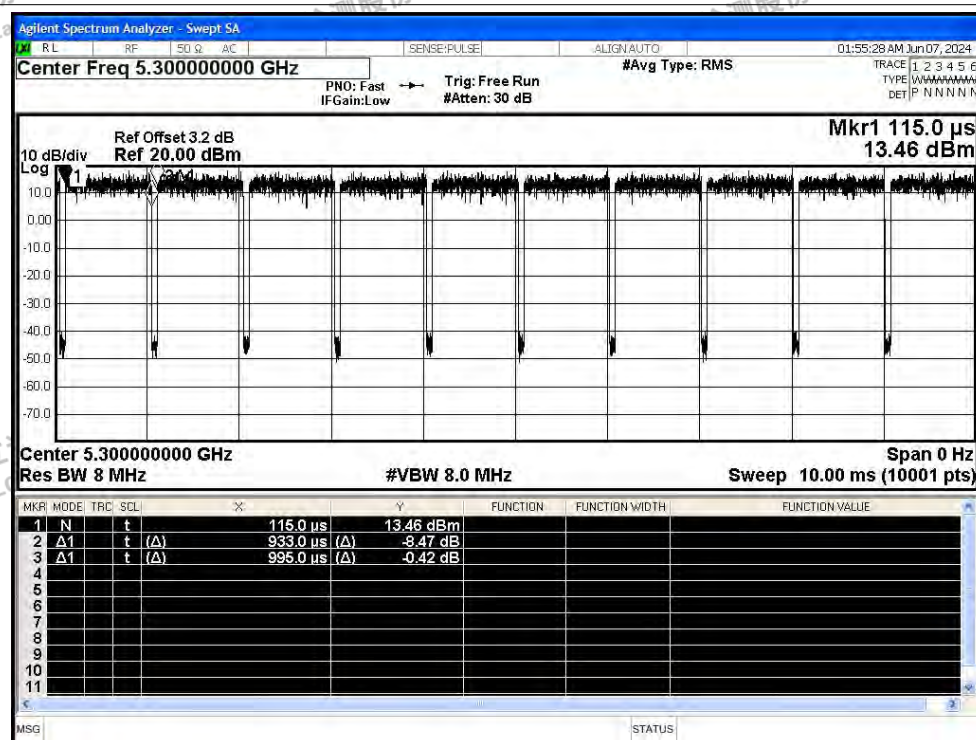

## Duty Cycle NVNT n20 5320MHz Ant0

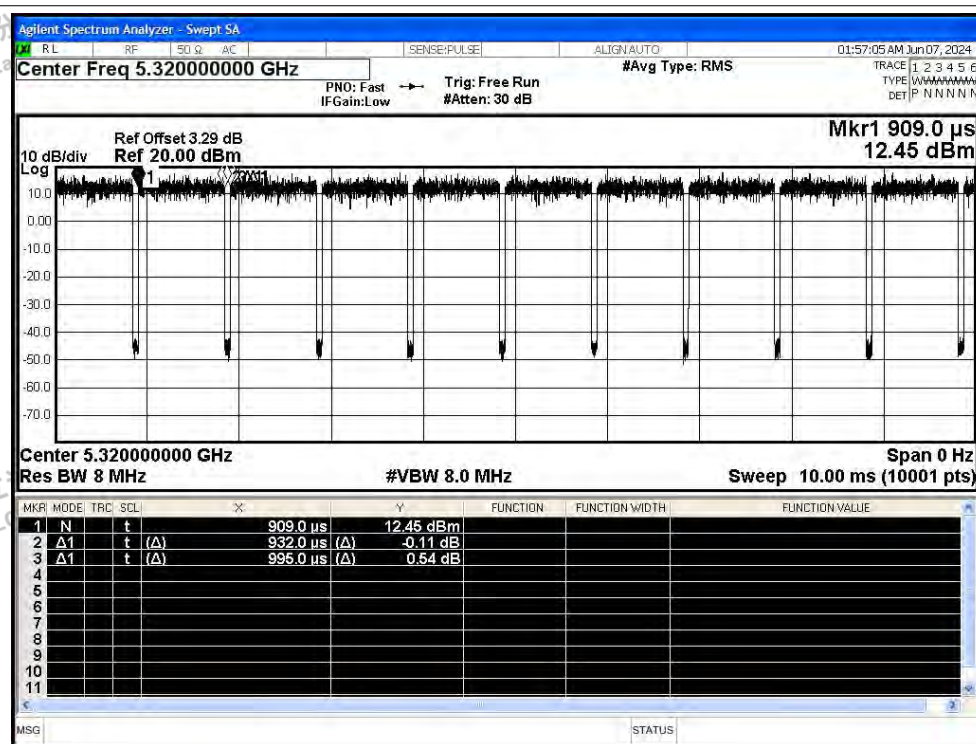

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5270MHz Ant0

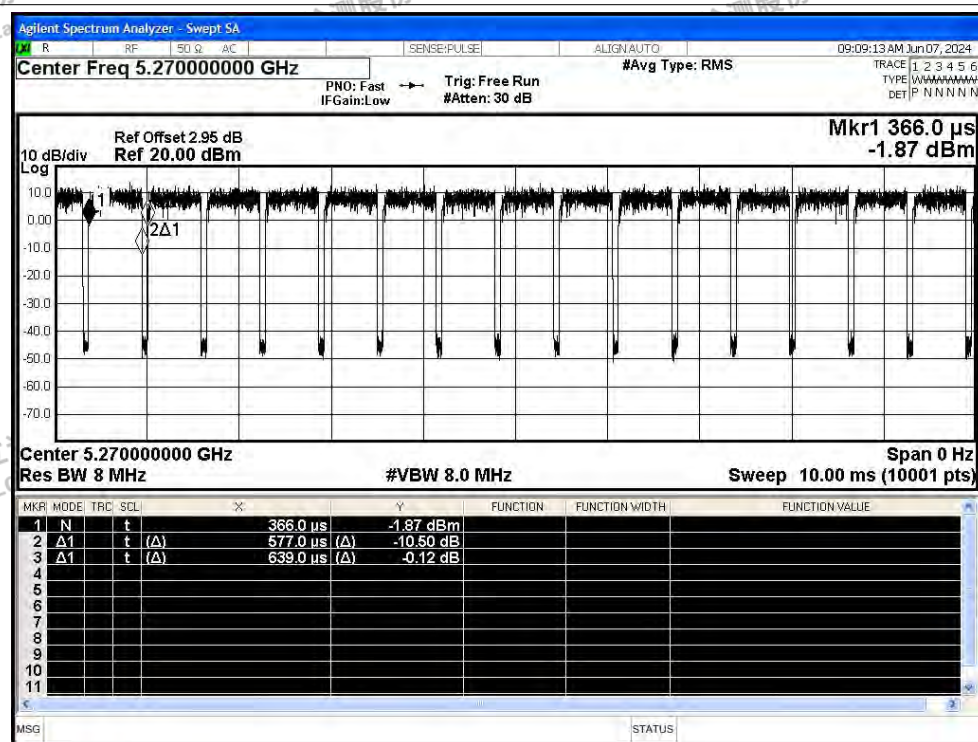

## Duty Cycle NVNT n40 5310MHz Ant0

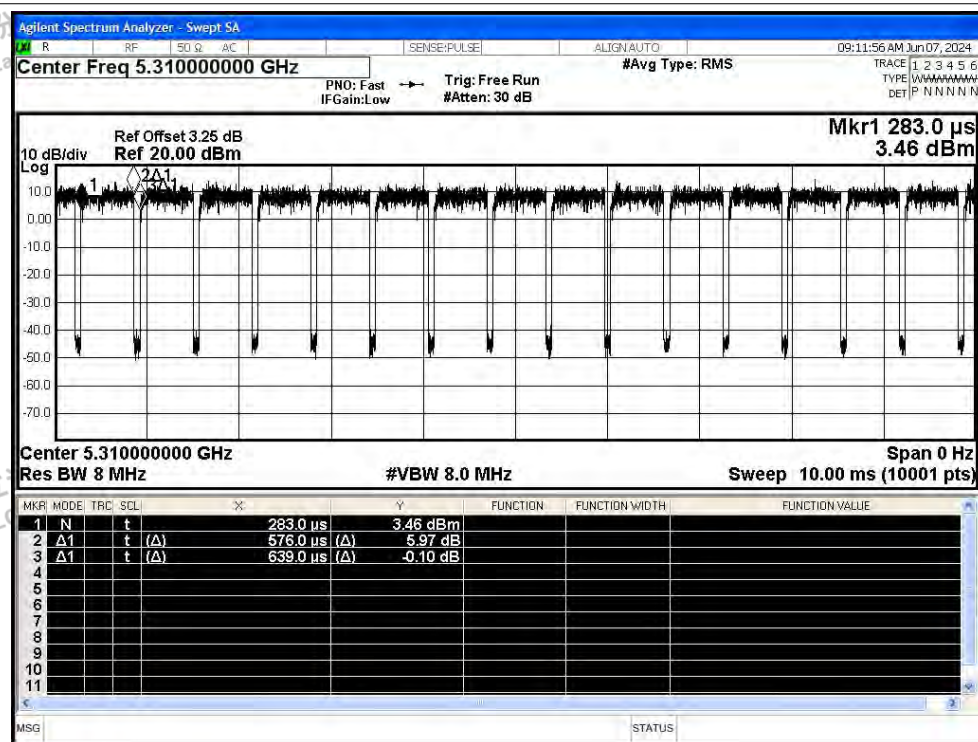

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Duty Cycle NVNT ac20 5260MHz Ant0

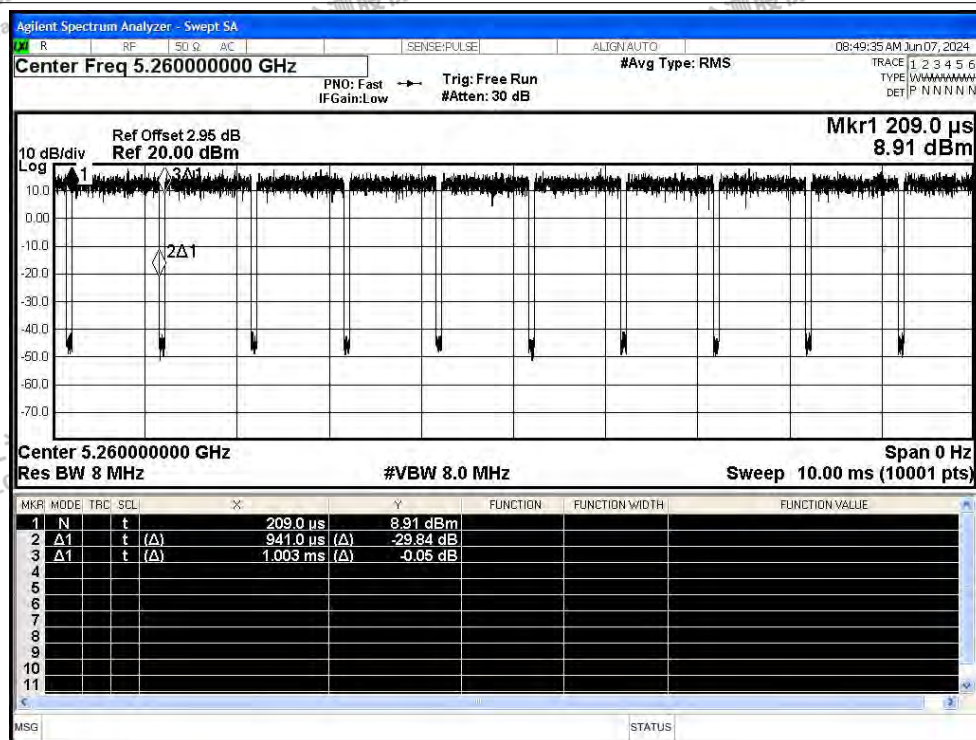

## Duty Cycle NVNT ac20 5300MHz Ant0

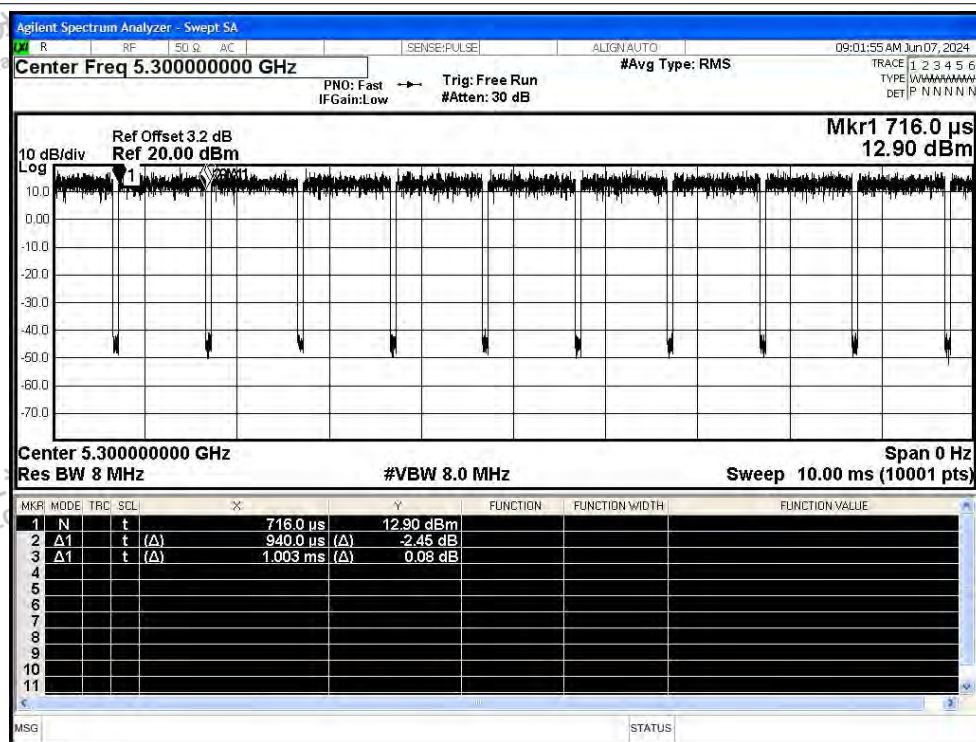

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5320MHz Ant0

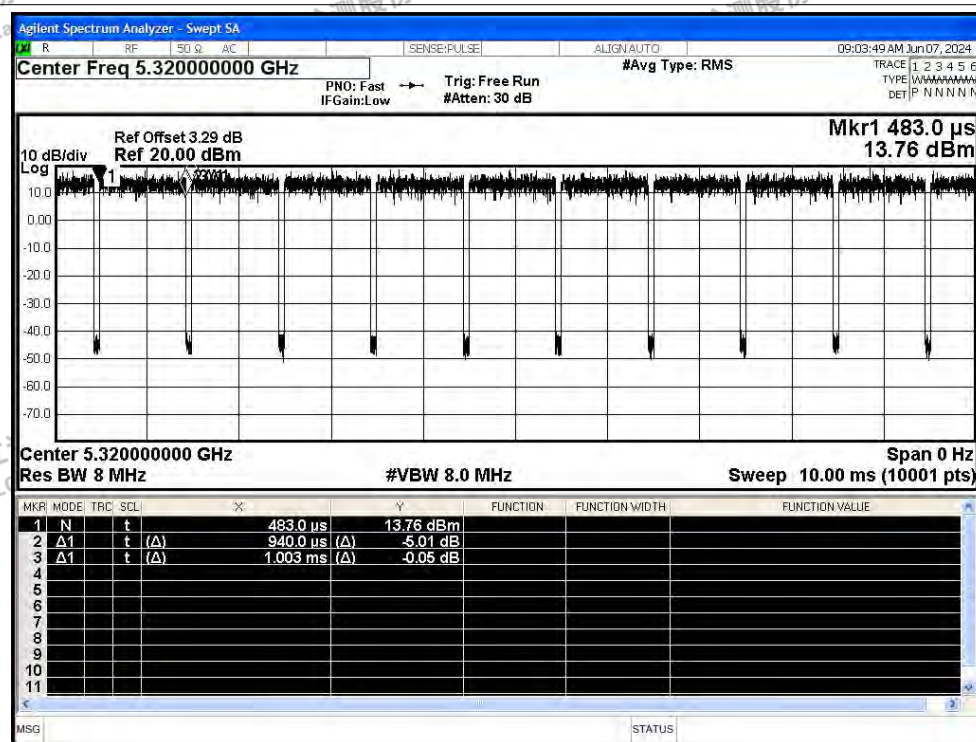

## Duty Cycle NVNT ac40 5270MHz Ant0

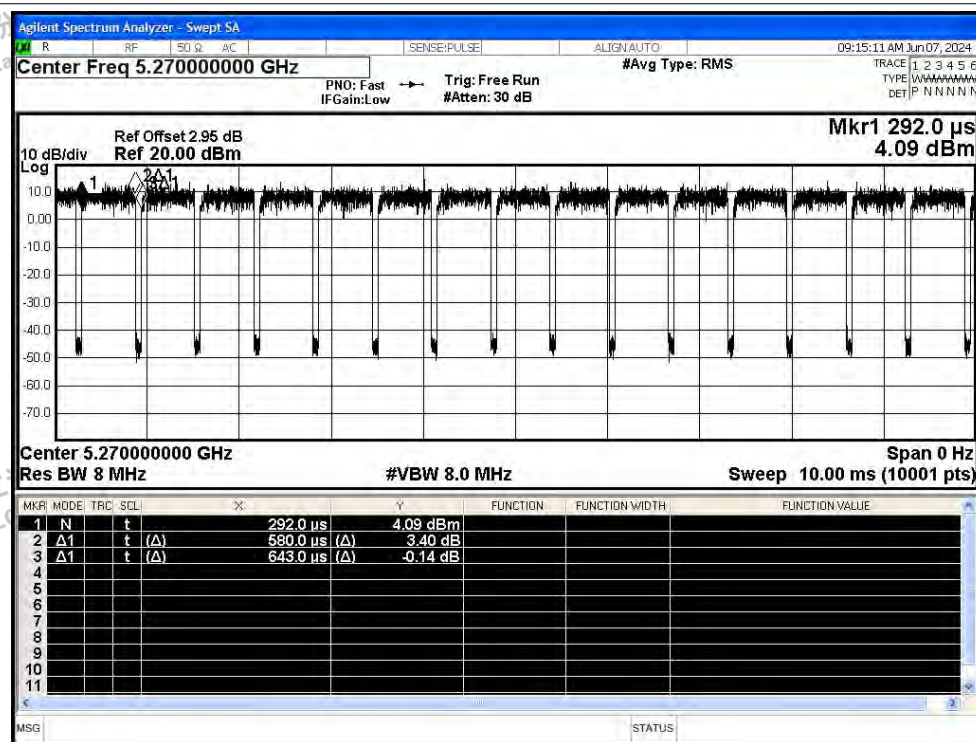

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Duty Cycle NVNT ac40 5310MHz Ant0

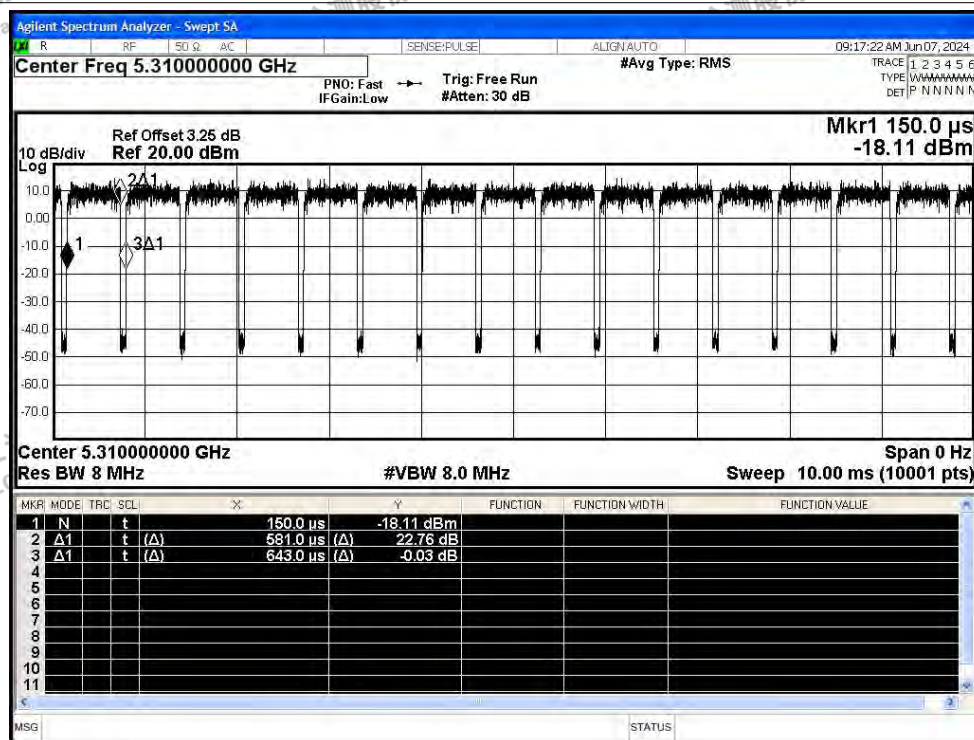

## Duty Cycle NVNT ac80 5290MHz Ant0

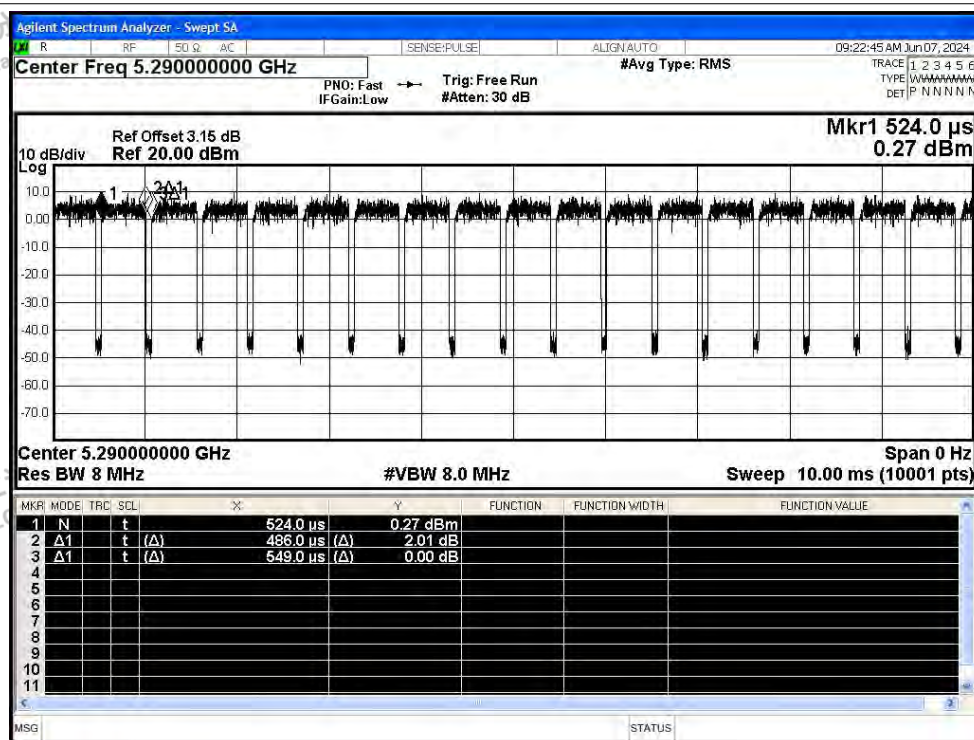

## Test Graphs

## Duty Cycle NVNT ax20 5260MHz Ant0




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



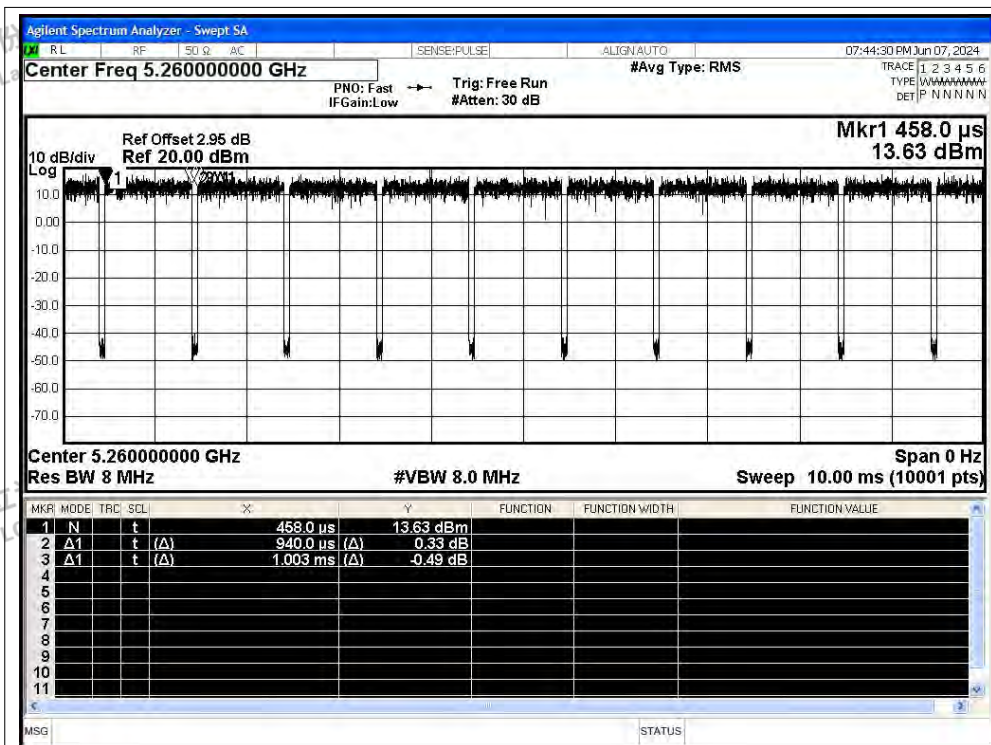

Duty Cycle NVNT ax20 5300MHz Ant0

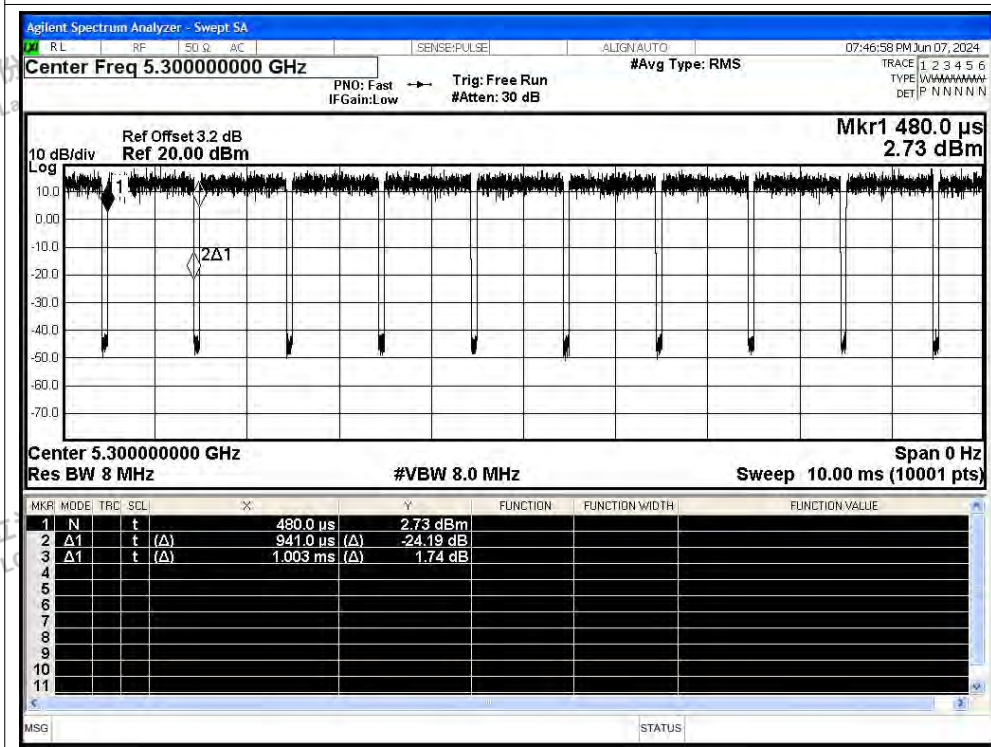

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5320MHz Ant0

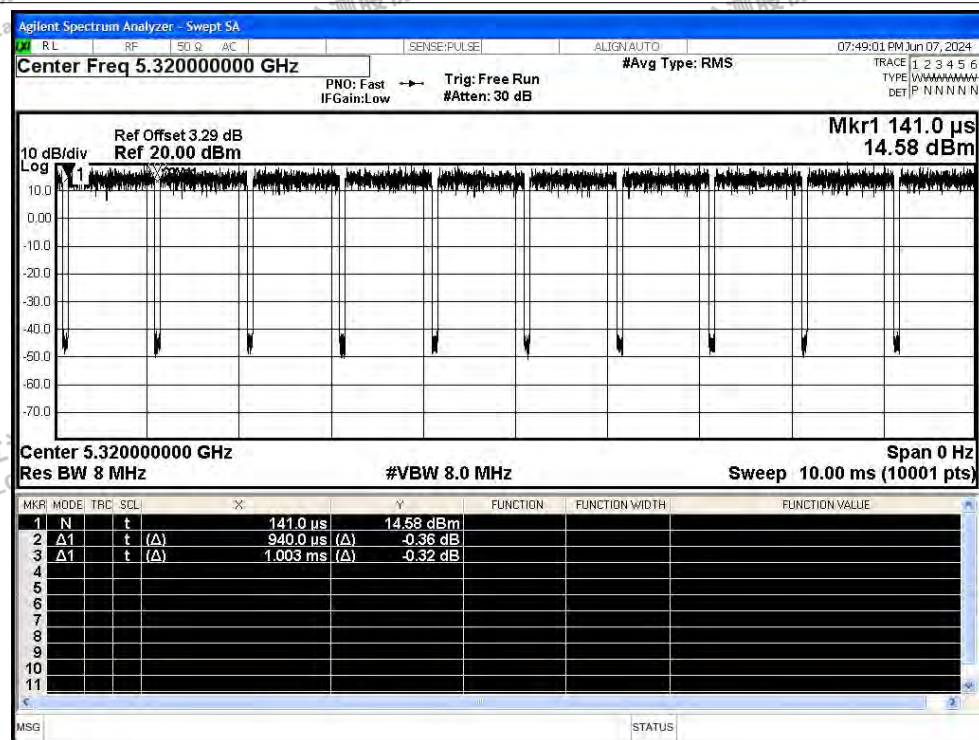

## Duty Cycle NVNT ax40 5270MHz Ant0

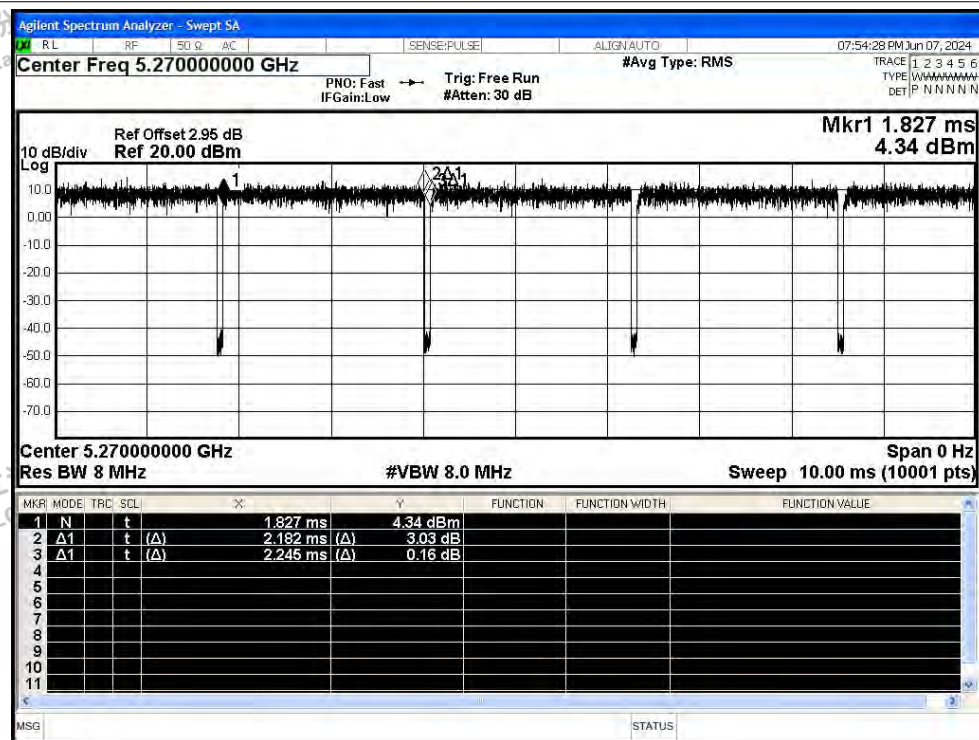

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5310MHz Ant0

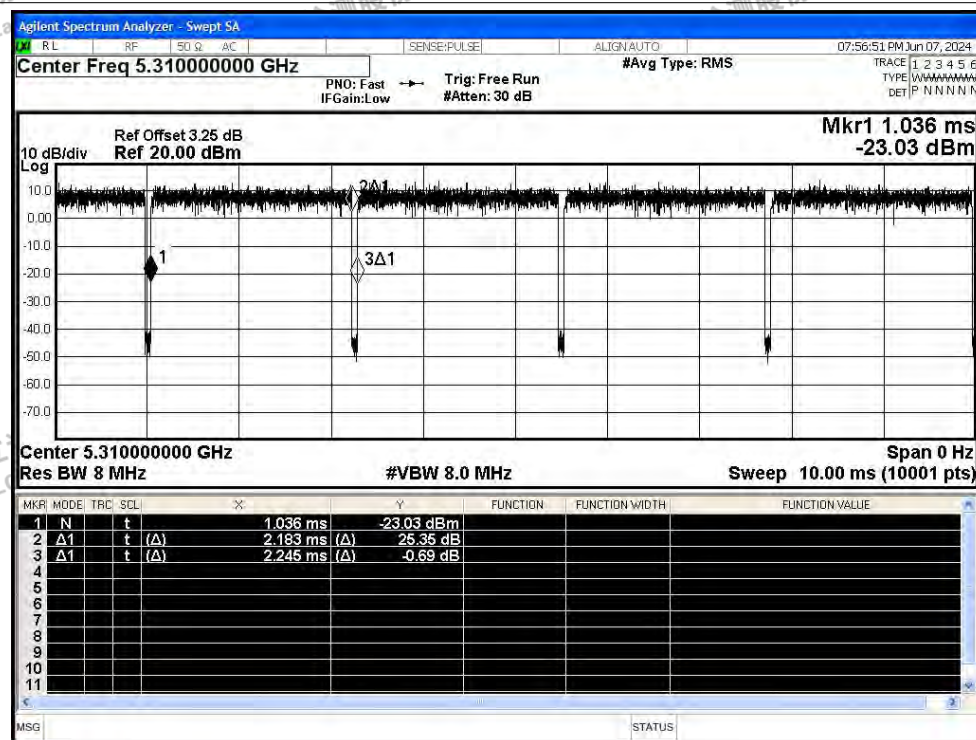

## Duty Cycle NVNT ax80 5290MHz Ant0

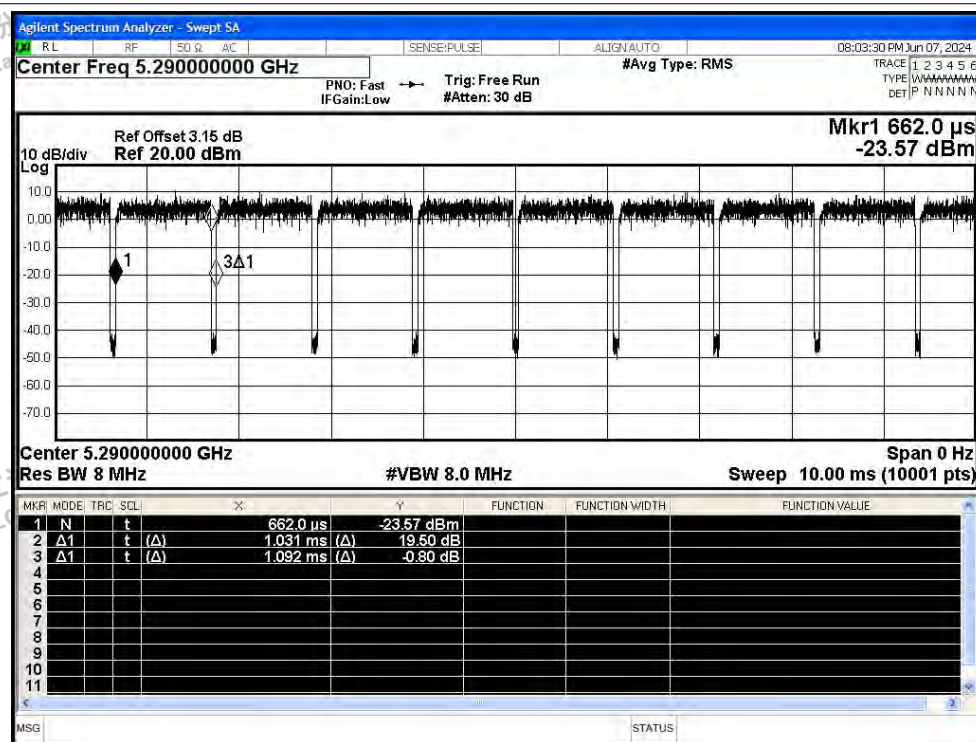

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5260            | Ant1    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a    | 5300            | Ant1    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a    | 5320            | Ant1    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5260            | Ant1    | 93.67          | 0.28                   | 1.07      |
| NVNT      | n20  | 5300            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n20  | 5320            | Ant1    | 93.77          | 0.28                   | 1.07      |
| NVNT      | n40  | 5270            | Ant1    | 97.23          | 0.12                   | 0.46      |
| NVNT      | n40  | 5310            | Ant1    | 97.23          | 0.12                   | 0.46      |
| NVNT      | ac20 | 5260            | Ant1    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5300            | Ant1    | 93.82          | 0.28                   | 1.06      |
| NVNT      | ac20 | 5320            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ac40 | 5270            | Ant1    | 97.24          | 0.12                   | 0.46      |
| NVNT      | ac40 | 5310            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ac80 | 5290            | Ant1    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ax20 | 5260            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5300            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax20 | 5320            | Ant1    | 93.72          | 0.28                   | 1.06      |
| NVNT      | ax40 | 5270            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax40 | 5310            | Ant1    | 97.19          | 0.12                   | 0.46      |
| NVNT      | ax80 | 5290            | Ant1    | 94.32          | 0.25                   | 0.97      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5260MHz Ant1

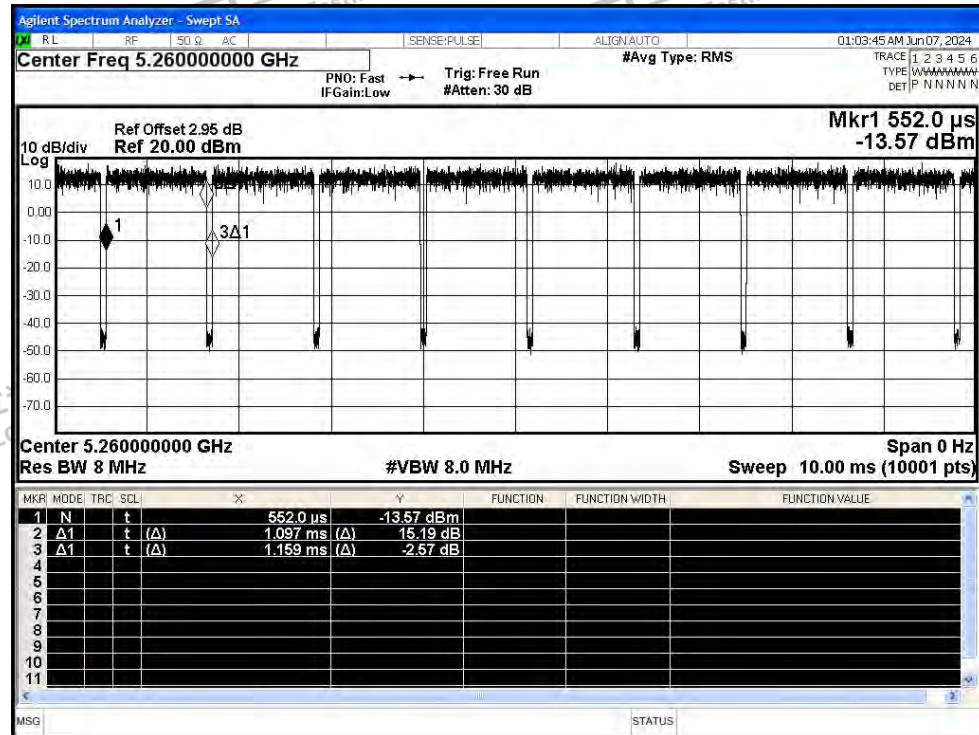

## Duty Cycle NVNT a 5300MHz Ant1

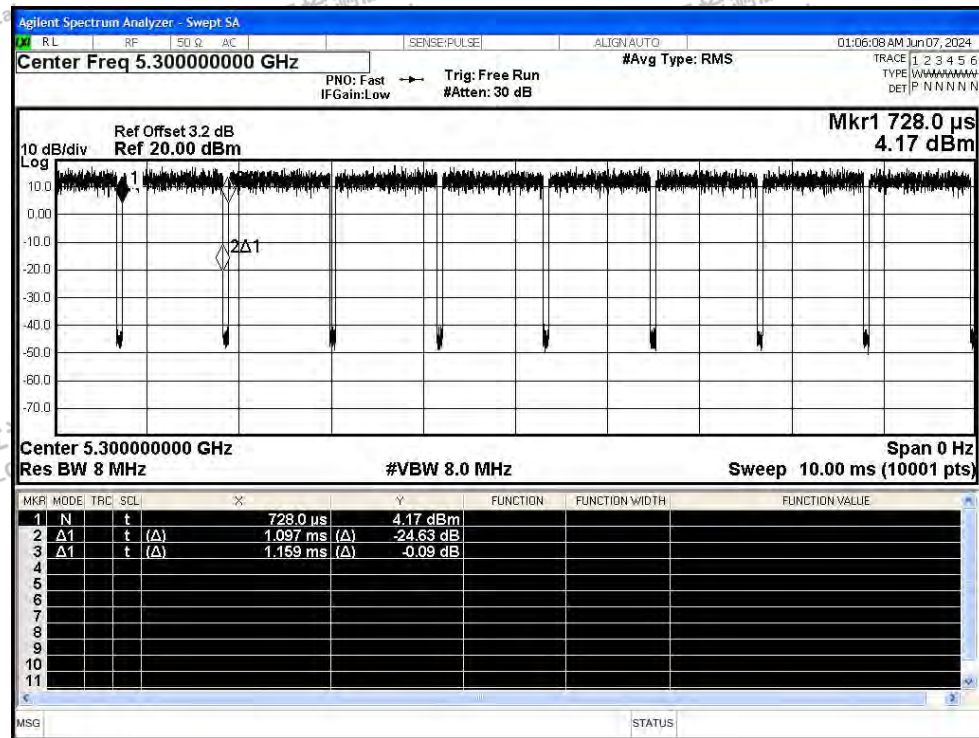

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity