



Band7	10MHz	QPSK	20800	1RB#0	20000~27000	-35.39	PASS
Band7	10MHz	16QAM	20800	1RB#0	0.009~0.15	-70.10	PASS
Band7	10MHz	16QAM	20800	1RB#0	0.15~30	-62.14	PASS
Band7	10MHz	16QAM	20800	1RB#0	30~1000	-62.16	PASS
Band7	10MHz	16QAM	20800	1RB#0	1000~20000	-33.08	PASS
Band7	10MHz	16QAM	20800	1RB#0	20000~27000	-35.20	PASS
Band7	10MHz	QPSK	21100	1RB#0	0.009~0.15	-67.48	PASS
Band7	10MHz	QPSK	21100	1RB#0	0.15~30	-62.86	PASS
Band7	10MHz	QPSK	21100	1RB#0	30~1000	-61.92	PASS
Band7	10MHz	QPSK	21100	1RB#0	1000~20000	-33.48	PASS
Band7	10MHz	QPSK	21100	1RB#0	20000~27000	-35.30	PASS
Band7	10MHz	16QAM	21100	1RB#0	0.009~0.15	-69.75	PASS
Band7	10MHz	16QAM	21100	1RB#0	0.15~30	-61.14	PASS
Band7	10MHz	16QAM	21100	1RB#0	30~1000	-62.32	PASS
Band7	10MHz	16QAM	21100	1RB#0	1000~20000	-33.38	PASS
Band7	10MHz	16QAM	21100	1RB#0	20000~27000	-34.90	PASS
Band7	10MHz	QPSK	21400	1RB#0	0.009~0.15	-67.93	PASS
Band7	10MHz	QPSK	21400	1RB#0	0.15~30	-61.10	PASS
Band7	10MHz	QPSK	21400	1RB#0	30~1000	-62.22	PASS
Band7	10MHz	QPSK	21400	1RB#0	1000~20000	-33.52	PASS
Band7	10MHz	QPSK	21400	1RB#0	20000~27000	-35.70	PASS
Band7	10MHz	16QAM	21400	1RB#0	0.009~0.15	-66.90	PASS
Band7	10MHz	16QAM	21400	1RB#0	0.15~30	-60.13	PASS
Band7	10MHz	16QAM	21400	1RB#0	30~1000	-62.22	PASS
Band7	10MHz	16QAM	21400	1RB#0	1000~20000	-32.95	PASS
Band7	10MHz	16QAM	21400	1RB#0	20000~27000	-35.52	PASS
Band7	15MHz	QPSK	20825	1RB#0	0.009~0.15	-67.66	PASS
Band7	15MHz	QPSK	20825	1RB#0	0.15~30	-63.87	PASS
Band7	15MHz	QPSK	20825	1RB#0	30~1000	-62.01	PASS
Band7	15MHz	QPSK	20825	1RB#0	1000~20000	-33.29	PASS
Band7	15MHz	QPSK	20825	1RB#0	20000~27000	-35.20	PASS
Band7	15MHz	16QAM	20825	1RB#0	0.009~0.15	-68.33	PASS
Band7	15MHz	16QAM	20825	1RB#0	0.15~30	-62.58	PASS
Band7	15MHz	16QAM	20825	1RB#0	30~1000	-62.23	PASS
Band7	15MHz	16QAM	20825	1RB#0	1000~20000	-33.53	PASS
Band7	15MHz	16QAM	20825	1RB#0	20000~27000	-34.45	PASS
Band7	15MHz	QPSK	21100	1RB#0	0.009~0.15	-66.18	PASS
Band7	15MHz	QPSK	21100	1RB#0	0.15~30	-62.25	PASS
Band7	15MHz	QPSK	21100	1RB#0	30~1000	-62.16	PASS
Band7	15MHz	QPSK	21100	1RB#0	1000~20000	-33.13	PASS






Band7	15MHz	QPSK	21100	1RB#0	20000~27000	-35.28	PASS
Band7	15MHz	16QAM	21100	1RB#0	0.009~0.15	-68.57	PASS
Band7	15MHz	16QAM	21100	1RB#0	0.15~30	-61.71	PASS
Band7	15MHz	16QAM	21100	1RB#0	30~1000	-61.80	PASS
Band7	15MHz	16QAM	21100	1RB#0	1000~20000	-33.30	PASS
Band7	15MHz	16QAM	21100	1RB#0	20000~27000	-35.04	PASS
Band7	15MHz	QPSK	21375	1RB#0	0.009~0.15	-67.56	PASS
Band7	15MHz	QPSK	21375	1RB#0	0.15~30	-61.95	PASS
Band7	15MHz	QPSK	21375	1RB#0	30~1000	-62.32	PASS
Band7	15MHz	QPSK	21375	1RB#0	1000~20000	-33.10	PASS
Band7	15MHz	QPSK	21375	1RB#0	20000~27000	-35.41	PASS
Band7	15MHz	16QAM	21375	1RB#0	0.009~0.15	-68.49	PASS
Band7	15MHz	16QAM	21375	1RB#0	0.15~30	-60.30	PASS
Band7	15MHz	16QAM	21375	1RB#0	30~1000	-62.29	PASS
Band7	15MHz	16QAM	21375	1RB#0	1000~20000	-33.42	PASS
Band7	15MHz	16QAM	21375	1RB#0	20000~27000	-35.00	PASS
Band7	20MHz	QPSK	20850	1RB#0	0.009~0.15	-68.32	PASS
Band7	20MHz	QPSK	20850	1RB#0	0.15~30	-63.14	PASS
Band7	20MHz	QPSK	20850	1RB#0	30~1000	-61.90	PASS
Band7	20MHz	QPSK	20850	1RB#0	1000~20000	-33.33	PASS
Band7	20MHz	QPSK	20850	1RB#0	20000~27000	-35.23	PASS
Band7	20MHz	16QAM	20850	1RB#0	0.009~0.15	-67.92	PASS
Band7	20MHz	16QAM	20850	1RB#0	0.15~30	-63.06	PASS
Band7	20MHz	16QAM	20850	1RB#0	30~1000	-62.50	PASS
Band7	20MHz	16QAM	20850	1RB#0	1000~20000	-33.07	PASS
Band7	20MHz	16QAM	20850	1RB#0	20000~27000	-35.45	PASS
Band7	20MHz	QPSK	21100	1RB#0	0.009~0.15	-68.41	PASS
Band7	20MHz	QPSK	21100	1RB#0	0.15~30	-62.82	PASS
Band7	20MHz	QPSK	21100	1RB#0	30~1000	-62.12	PASS
Band7	20MHz	QPSK	21100	1RB#0	1000~20000	-33.42	PASS
Band7	20MHz	QPSK	21100	1RB#0	20000~27000	-35.32	PASS
Band7	20MHz	16QAM	21100	1RB#0	0.009~0.15	-67.71	PASS
Band7	20MHz	16QAM	21100	1RB#0	0.15~30	-62.14	PASS
Band7	20MHz	16QAM	21100	1RB#0	30~1000	-61.84	PASS
Band7	20MHz	16QAM	21100	1RB#0	1000~20000	-33.32	PASS
Band7	20MHz	16QAM	21100	1RB#0	20000~27000	-35.12	PASS
Band7	20MHz	QPSK	21350	1RB#0	0.009~0.15	-67.19	PASS
Band7	20MHz	QPSK	21350	1RB#0	0.15~30	-61.91	PASS
Band7	20MHz	QPSK	21350	1RB#0	30~1000	-62.06	PASS
Band7	20MHz	QPSK	21350	1RB#0	1000~20000	-33.08	PASS






Band7	20MHz	QPSK	21350	1RB#0	20000~27000	-34.78	PASS
Band7	20MHz	16QAM	21350	1RB#0	0.009~0.15	-66.00	PASS
Band7	20MHz	16QAM	21350	1RB#0	0.15~30	-62.61	PASS
Band7	20MHz	16QAM	21350	1RB#0	30~1000	-62.32	PASS
Band7	20MHz	16QAM	21350	1RB#0	1000~20000	-33.16	PASS
Band7	20MHz	16QAM	21350	1RB#0	20000~27000	-35.40	PASS


Test Graphs

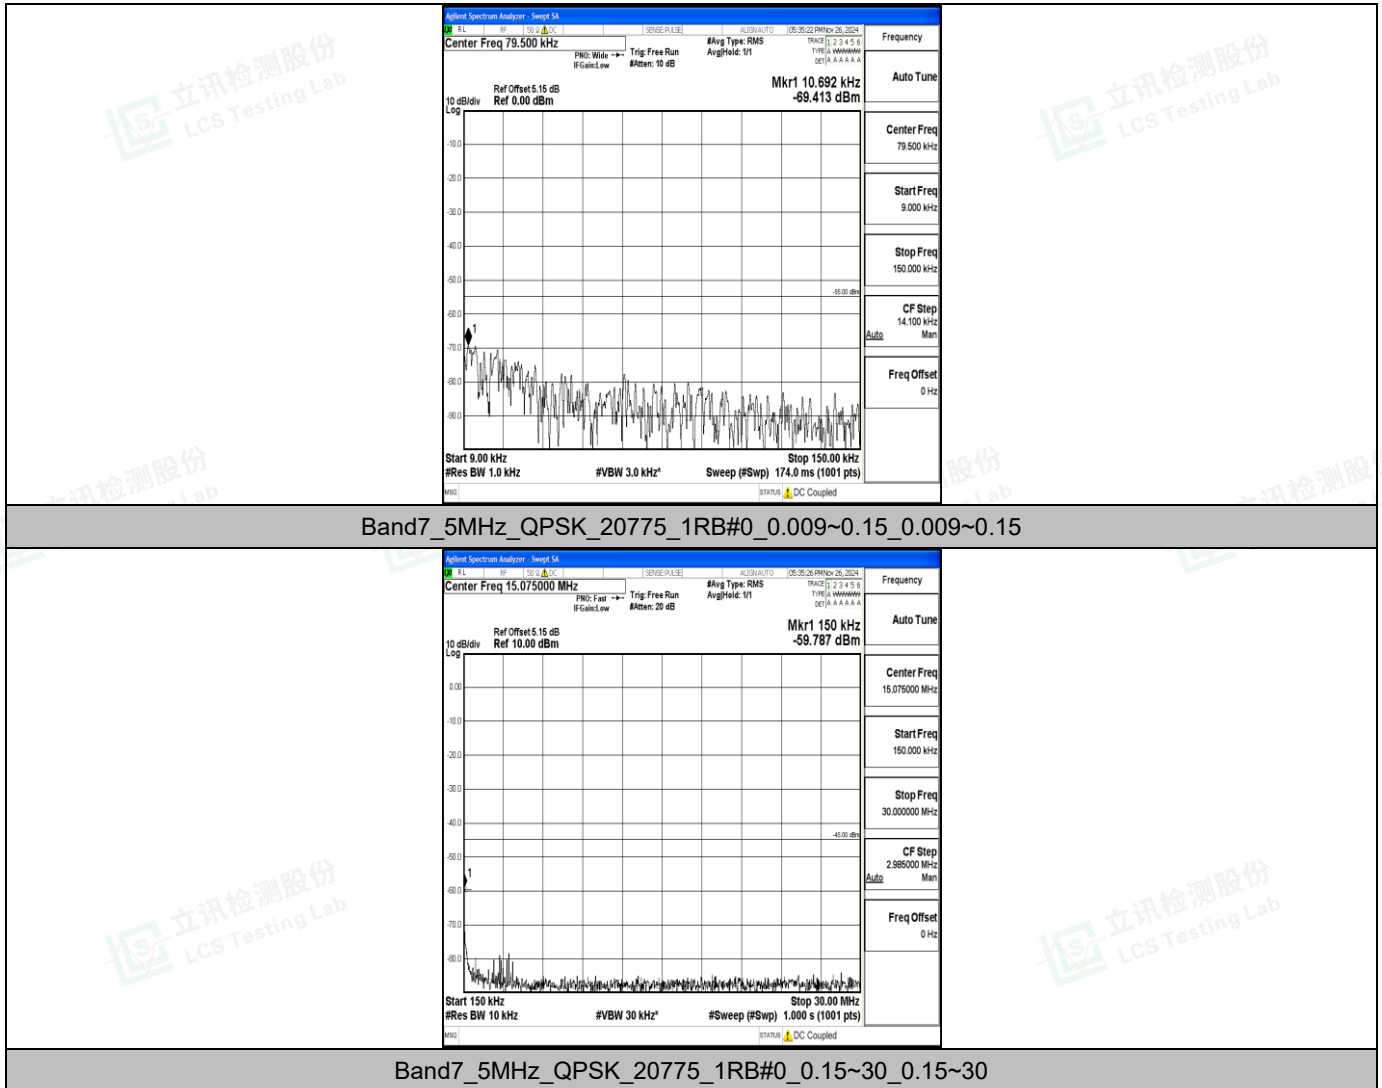


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

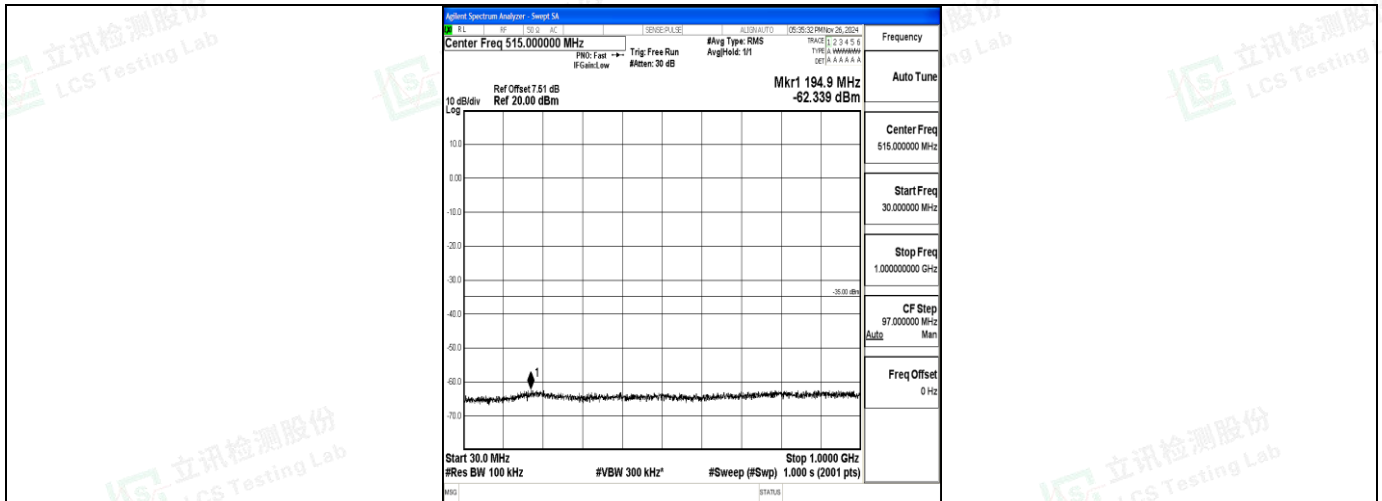

Band7_5MHz_QPSK_20775_1RB#0_30~1000_30~1000

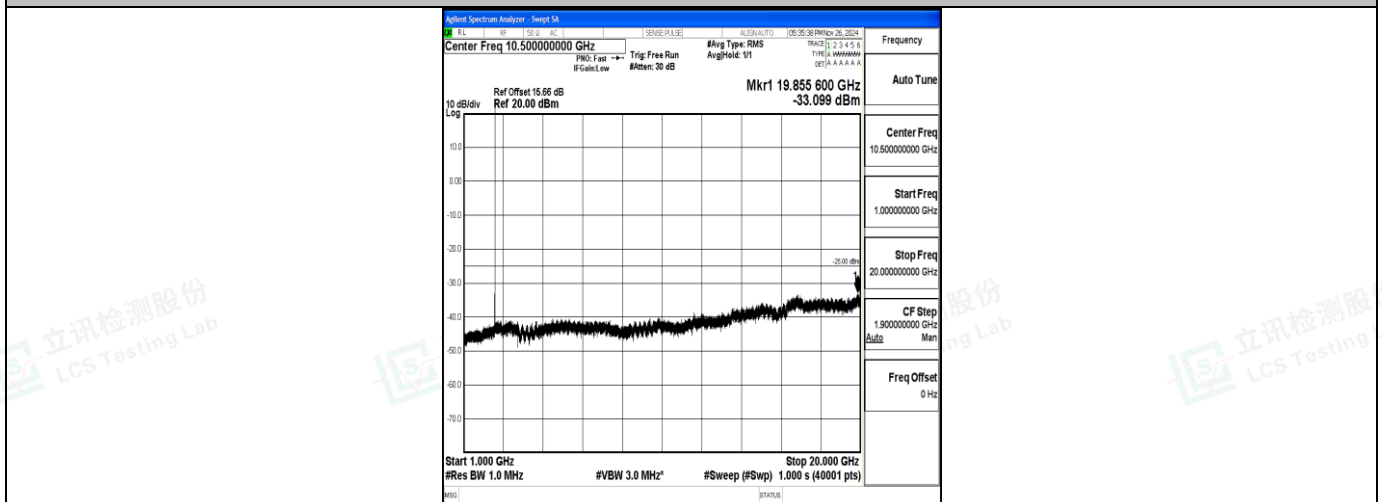


Band7_5MHz_QPSK_20775_1RB#0_1000~20000_1000~20000

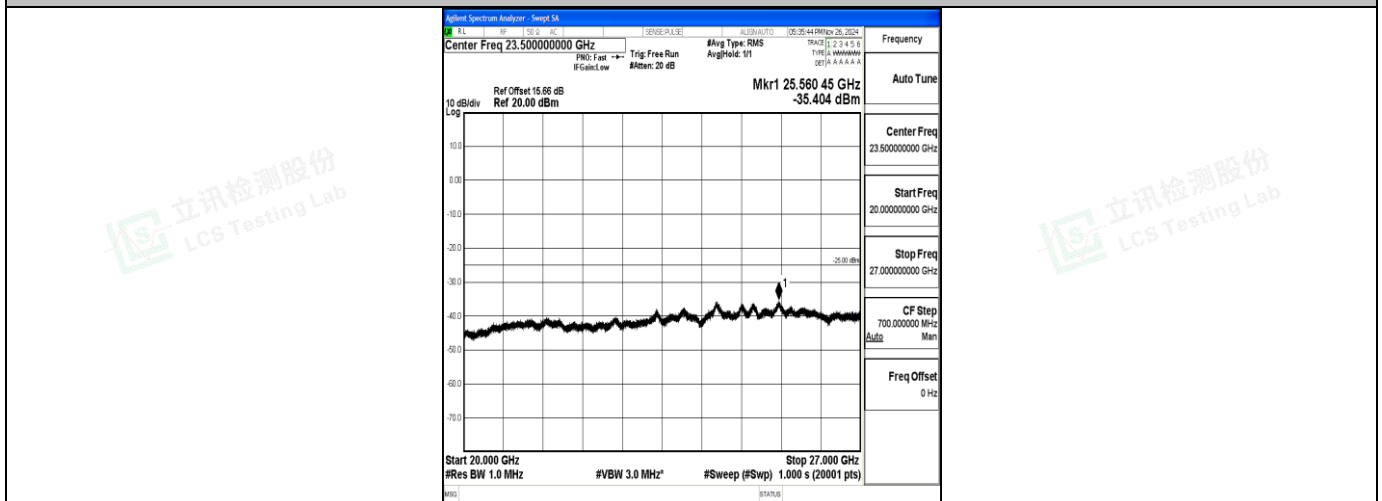


Band7_5MHz_QPSK_20775_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

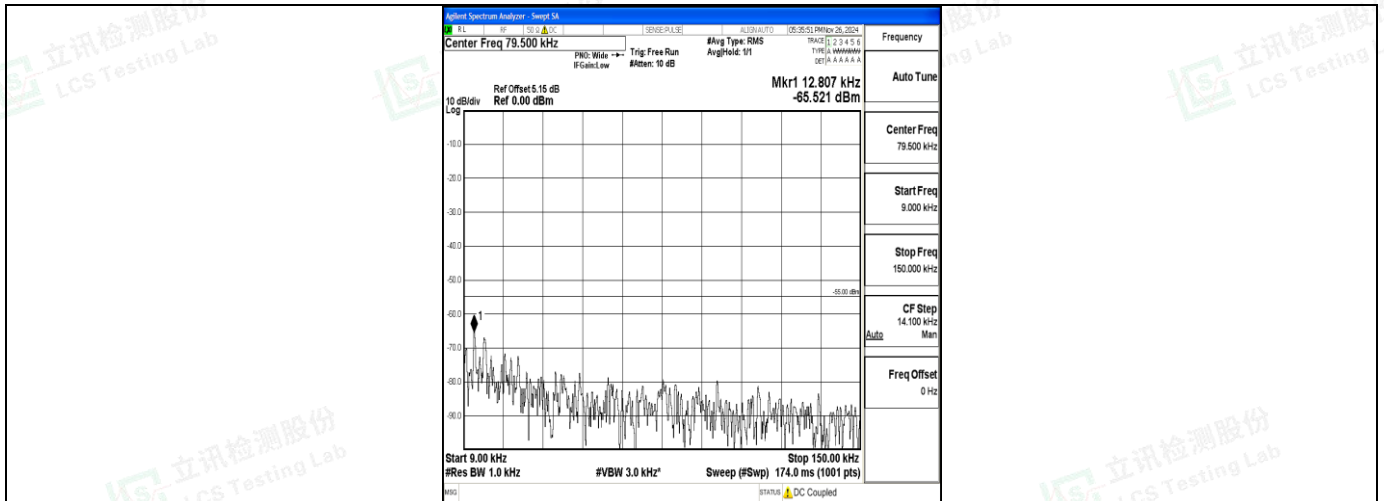

Band7_5MHz_16QAM_20775_1RB#0_0.009~0.15_0.009~0.15

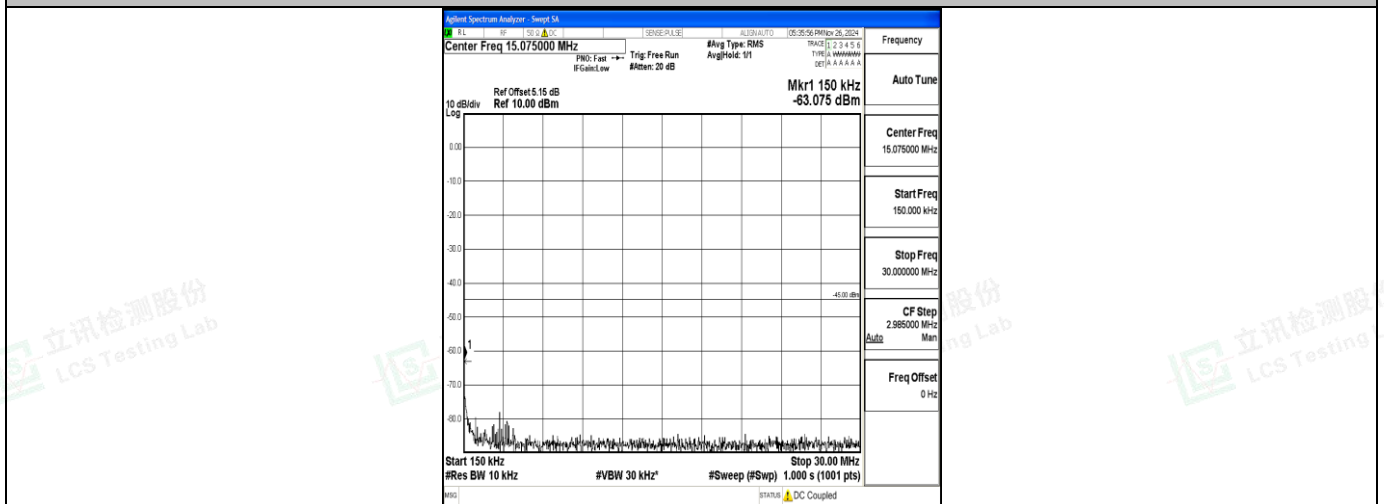


Band7_5MHz_16QAM_20775_1RB#0_0.15~30_0.15~30

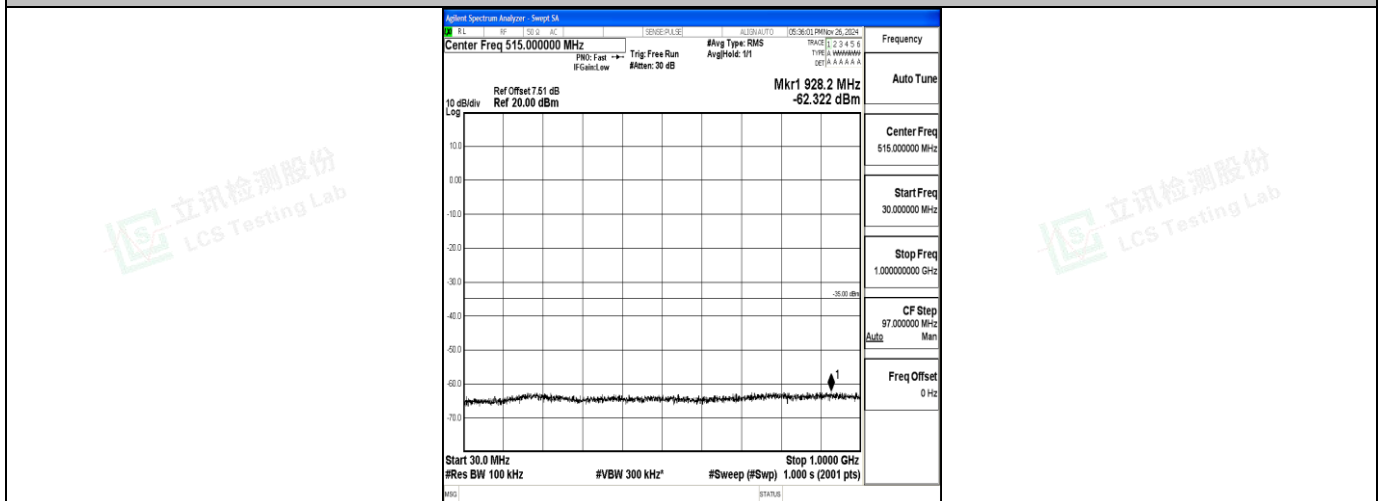


Band7_5MHz_16QAM_20775_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

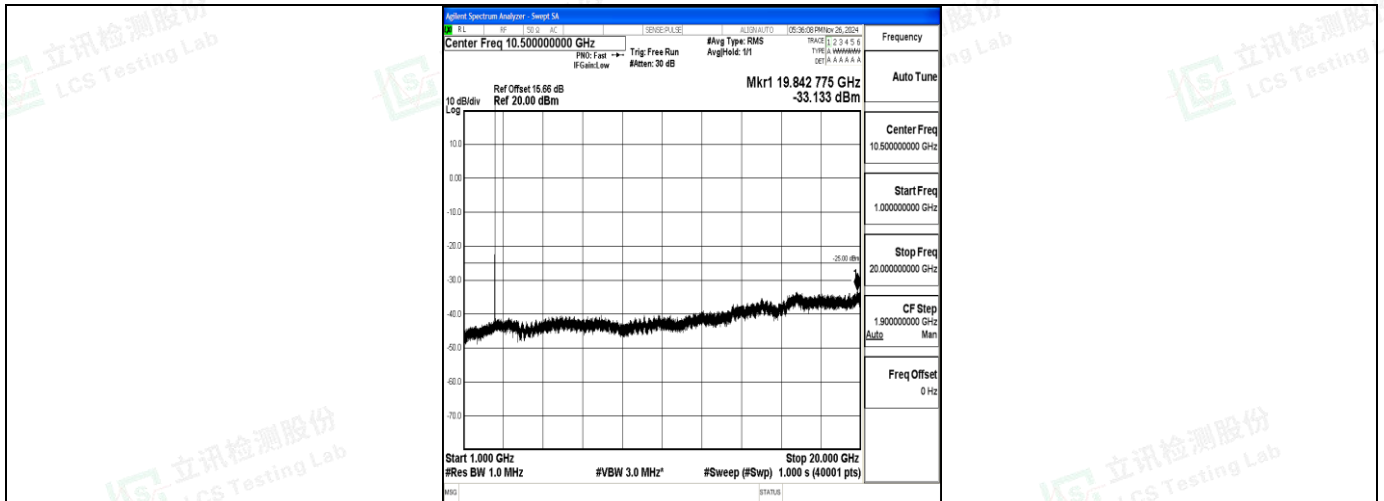

Band7_5MHz_16QAM_20775_1RB#0_1000~20000_1000~20000

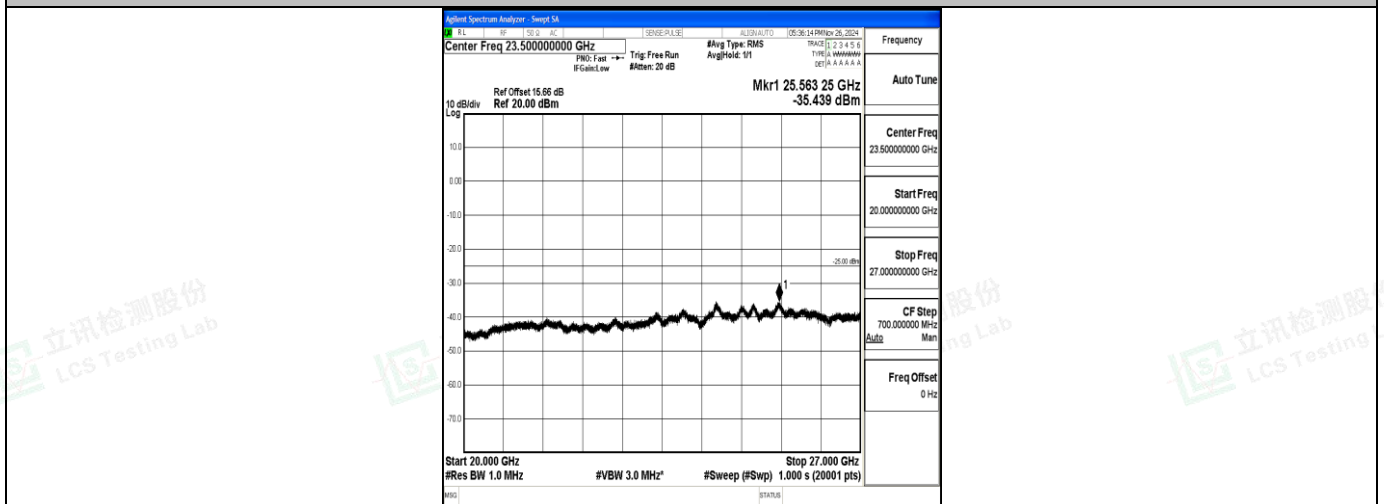


Band7_5MHz_16QAM_20775_1RB#0_20000~27000_20000~27000

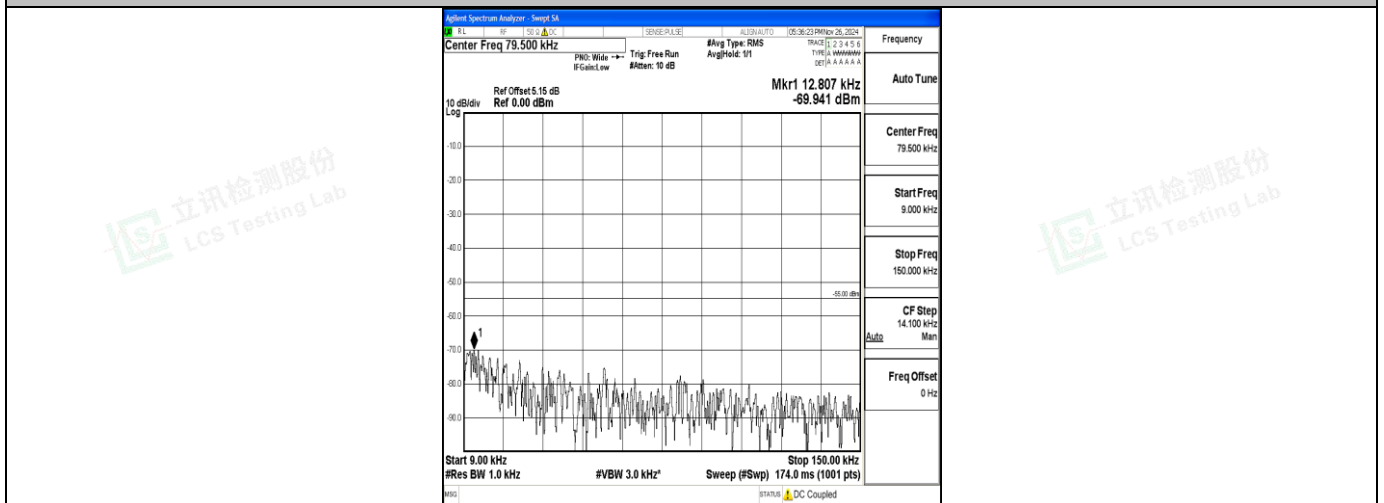


Band7_5MHz_QPSK_21100_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

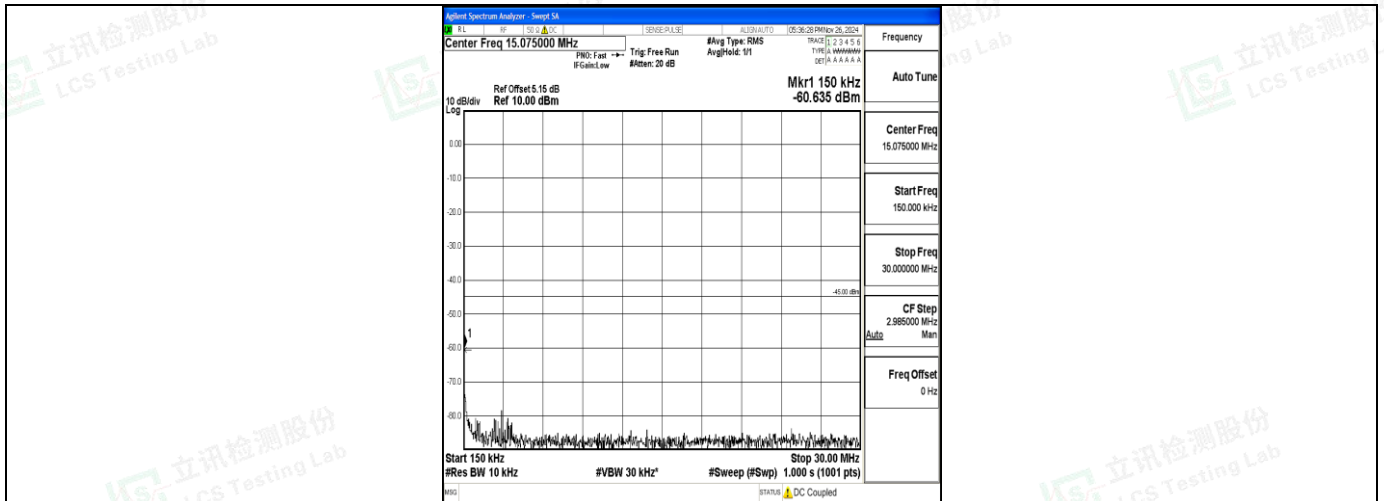

Band7_5MHz_QPSK_21100_1RB#0_0.15~30_0.15~30

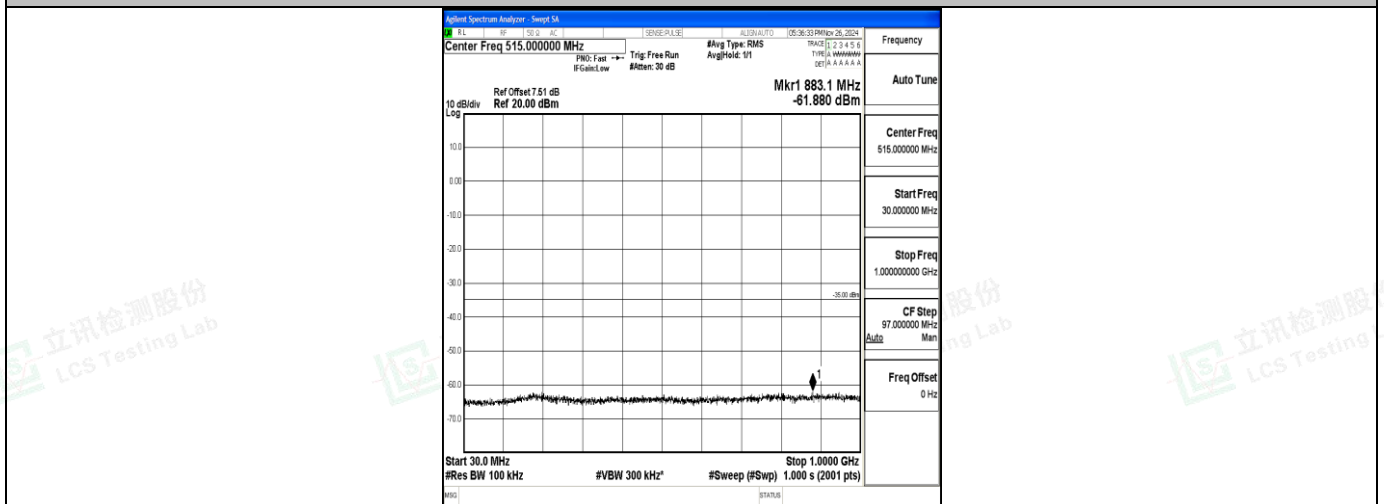


Band7_5MHz_QPSK_21100_1RB#0_30~1000_30~1000

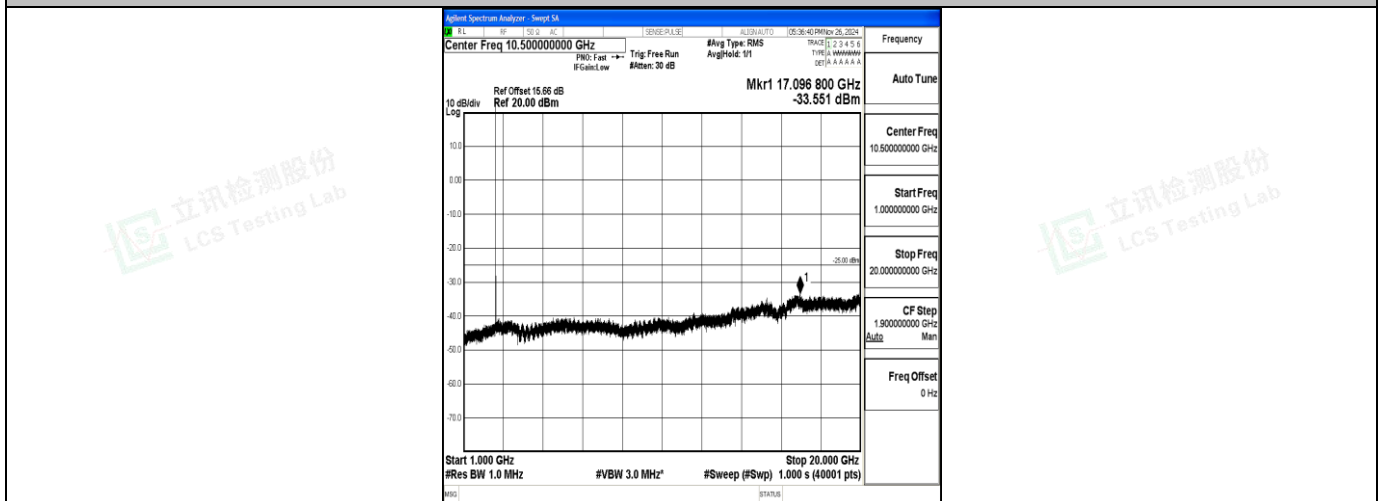


Band7_5MHz_QPSK_21100_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

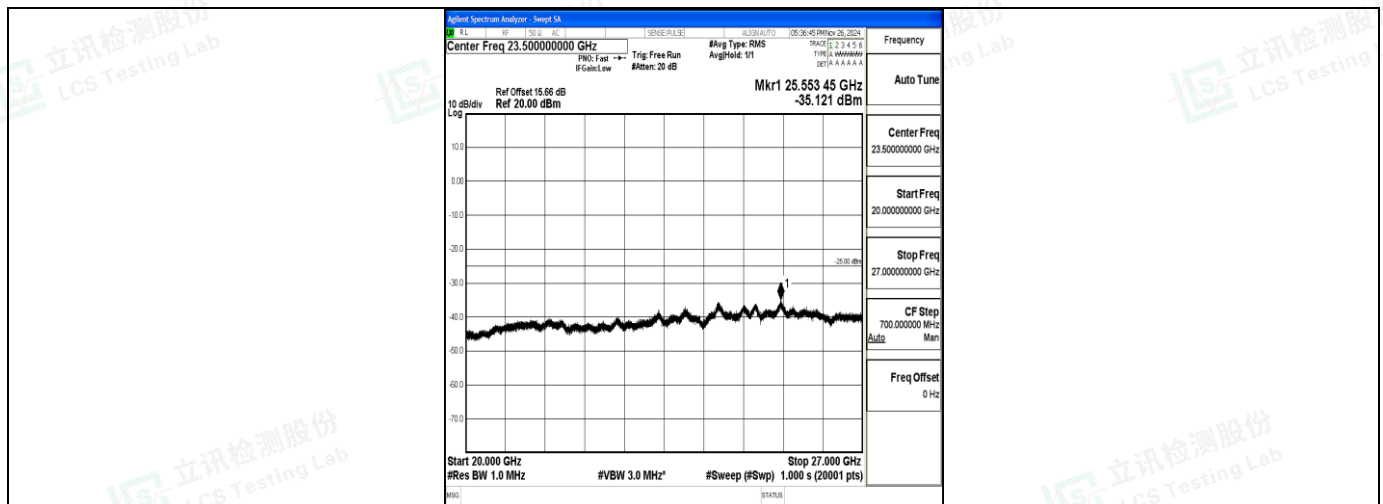

Band7_5MHz_QPSK_21100_1RB#0_20000~27000_20000~27000

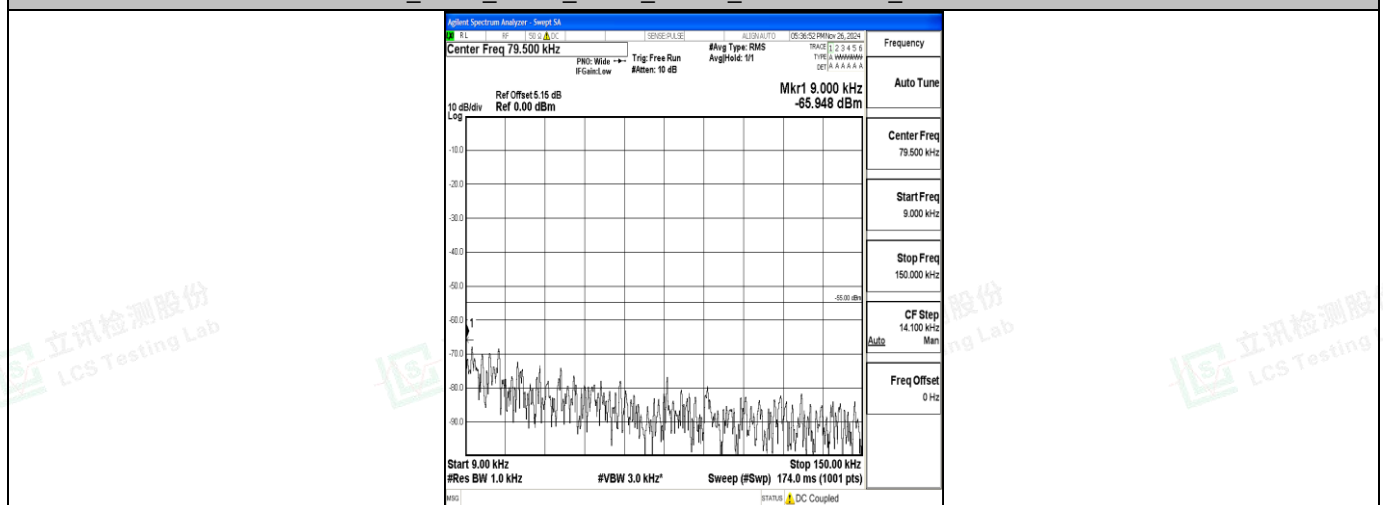


Band7_5MHz_16QAM_21100_1RB#0_0.009~0.15_0.009~0.15

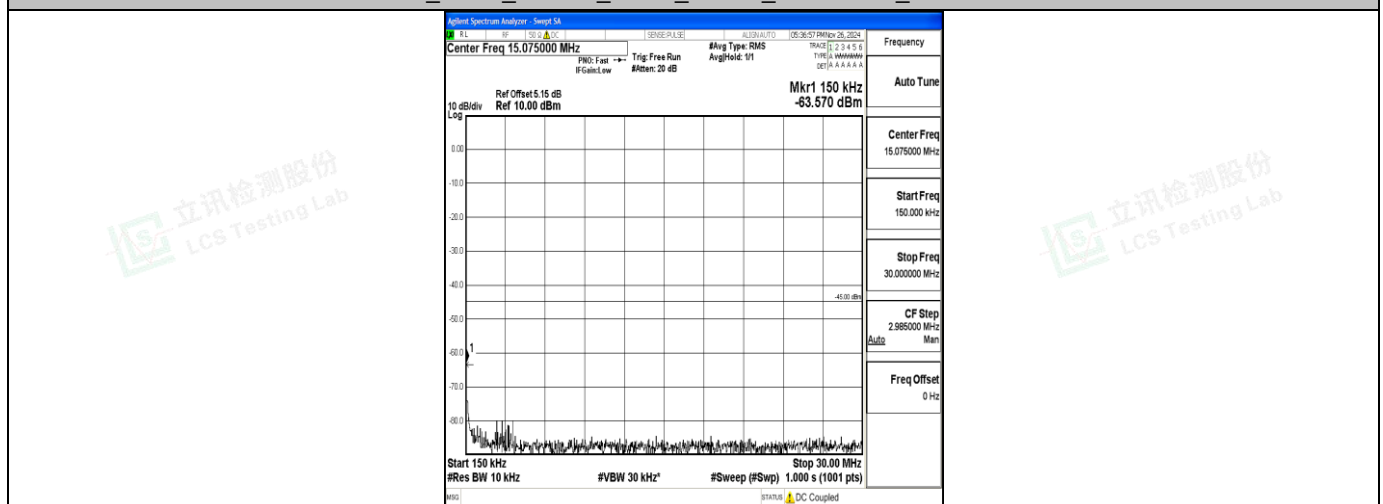


Band7_5MHz_16QAM_21100_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

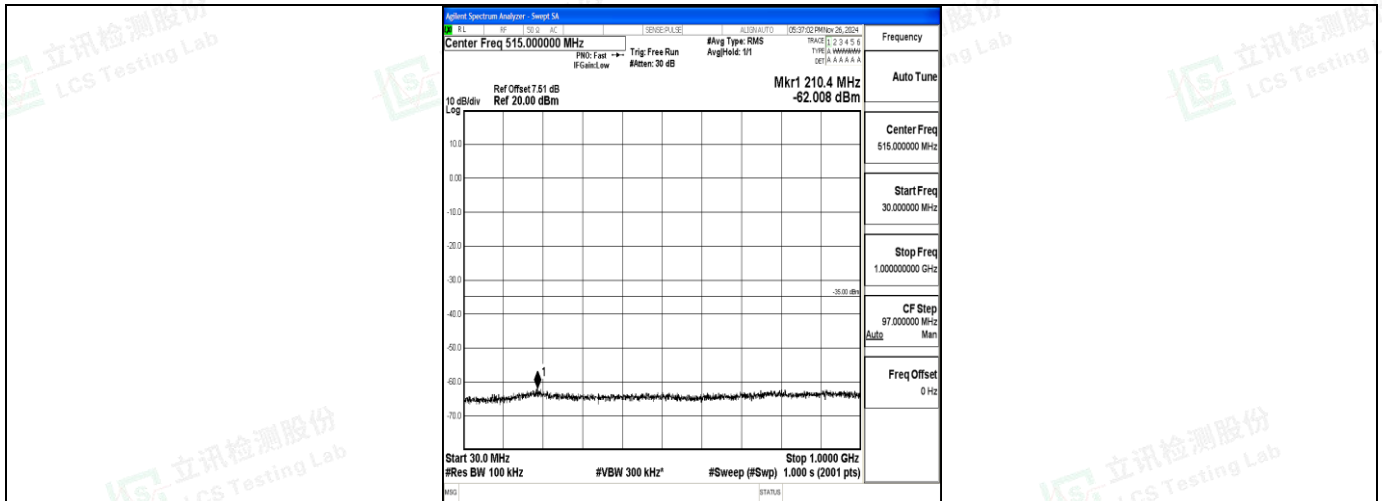

Band7_5MHz_16QAM_21100_1RB#0_30~1000_30~1000

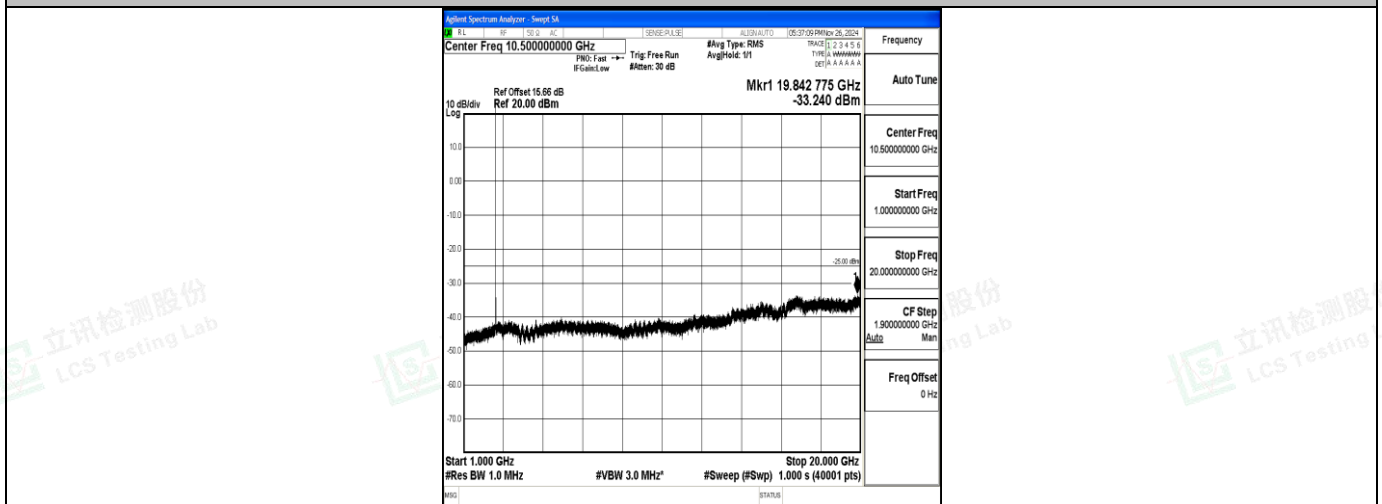


Band7_5MHz_16QAM_21100_1RB#0_1000~20000_1000~20000

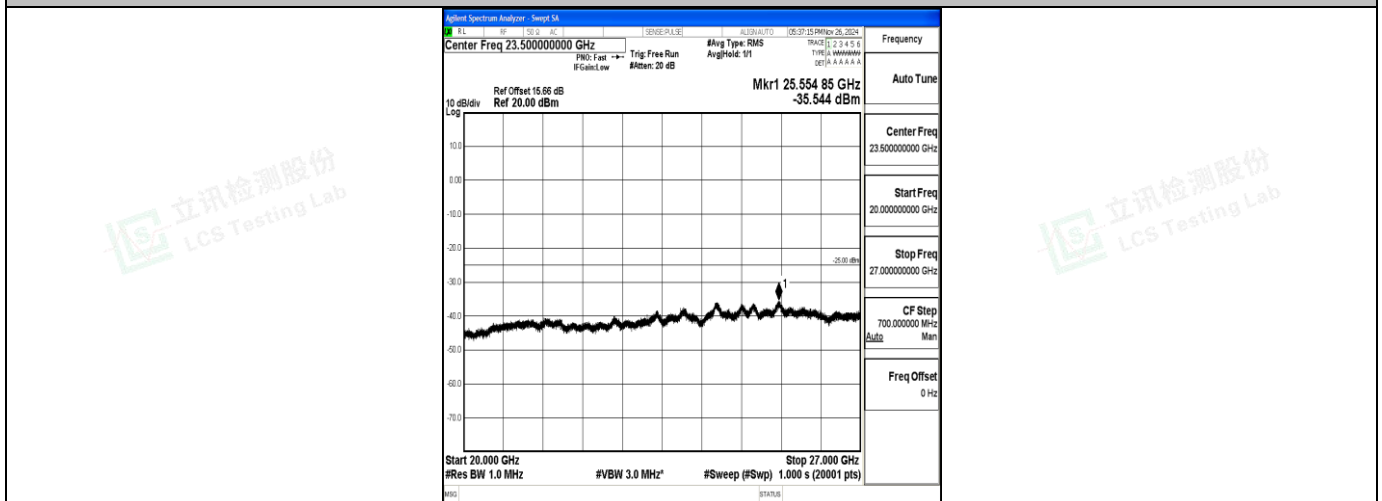


Band7_5MHz_16QAM_21100_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

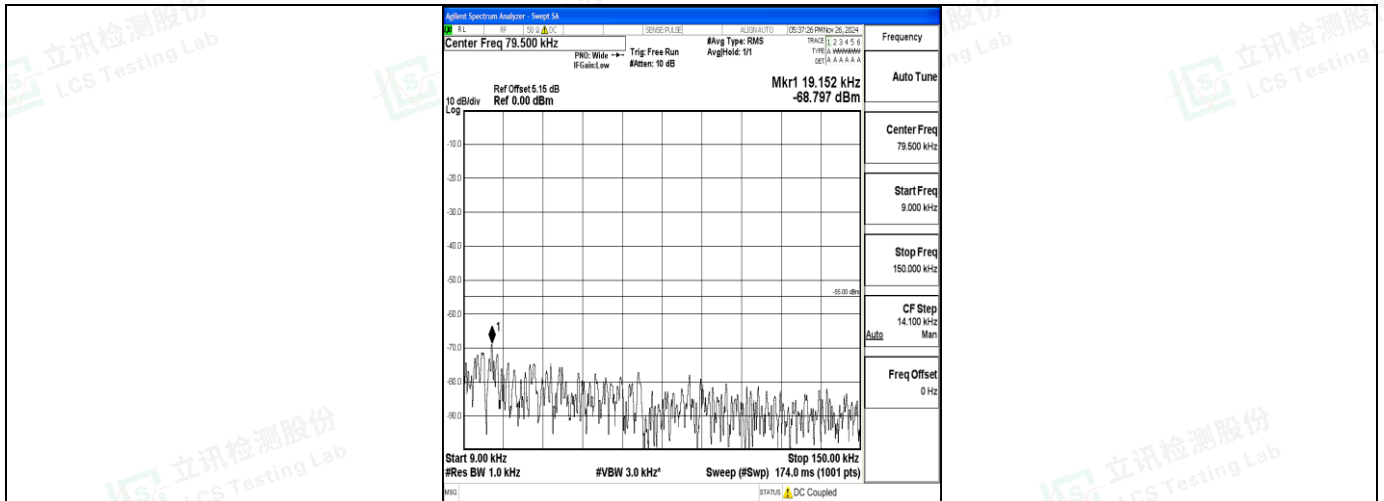

Band7_5MHz_QPSK_21425_1RB#0_0.009~0.15_0.009~0.15

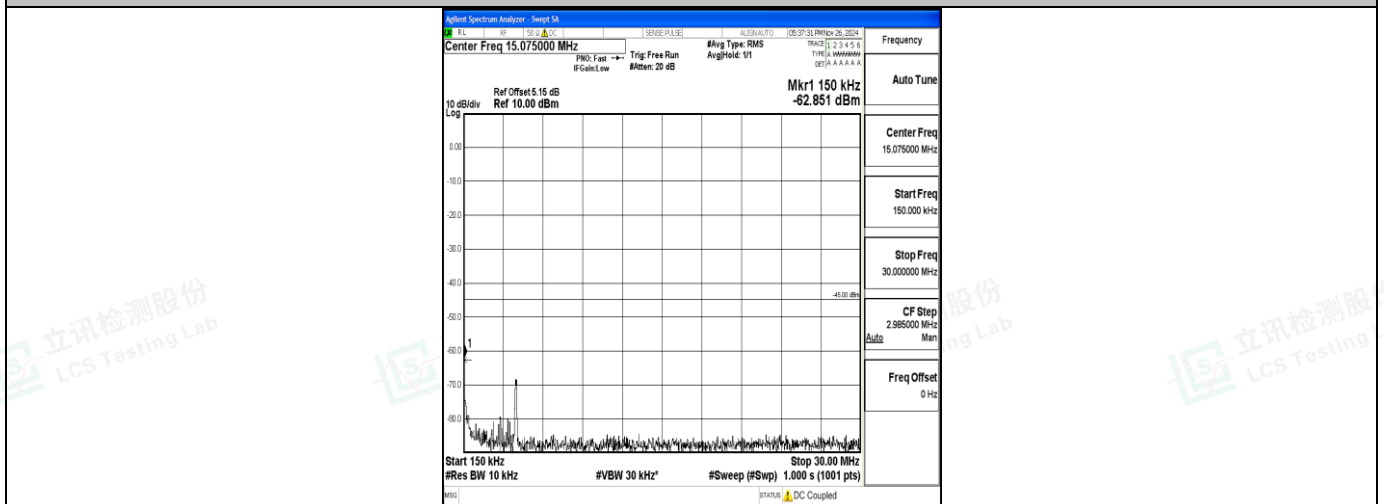


Band7_5MHz_QPSK_21425_1RB#0_0.15~30_0.15~30

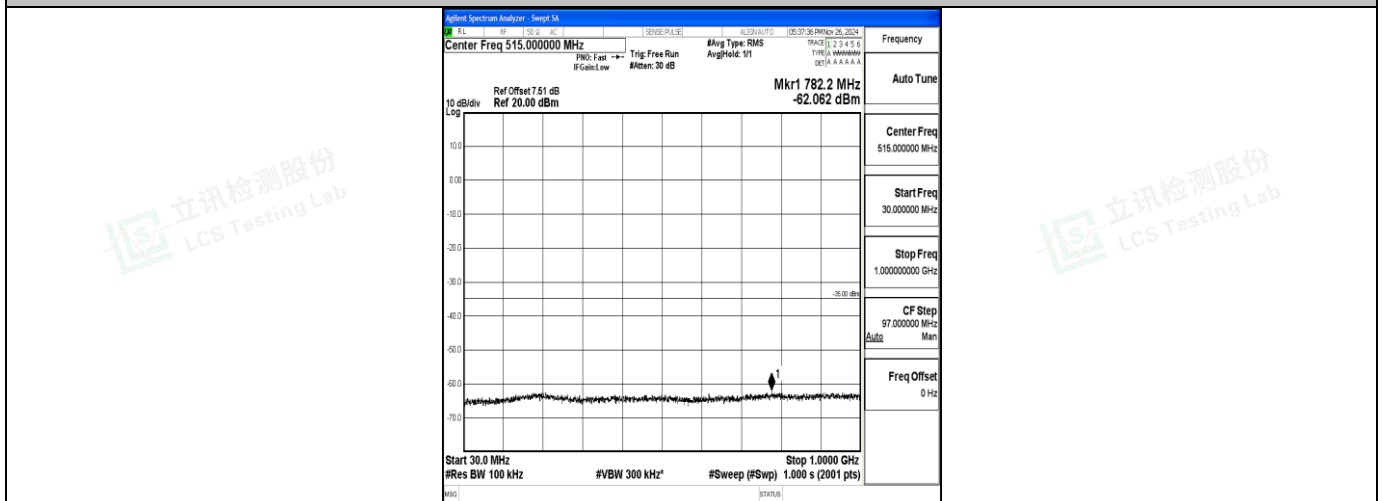


Band7_5MHz_QPSK_21425_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

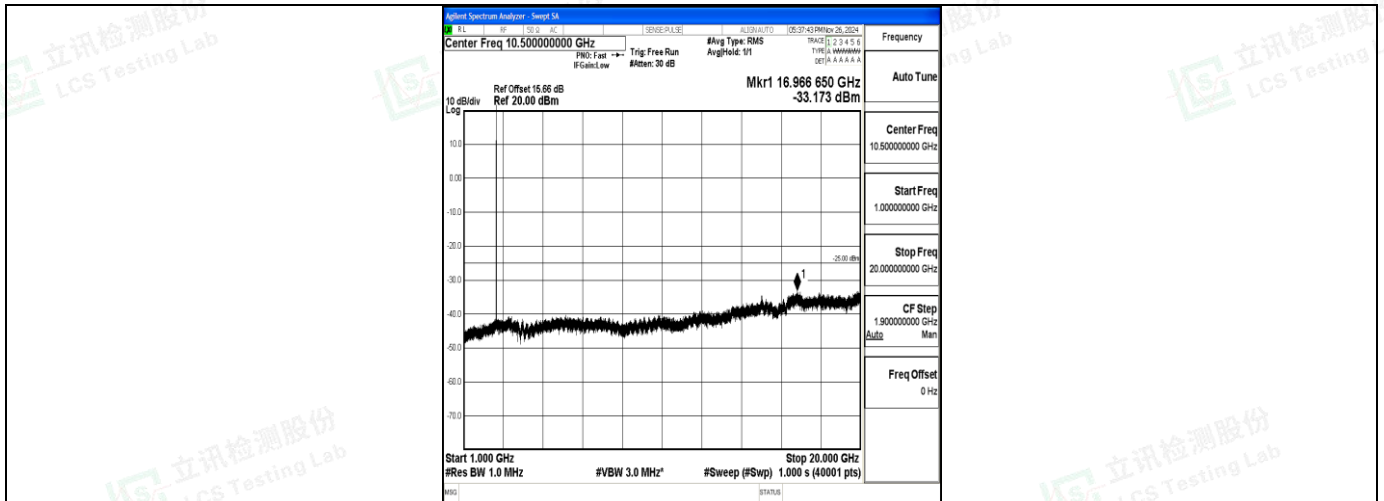

Band7_5MHz_QPSK_21425_1RB#0_1000~20000_1000~20000

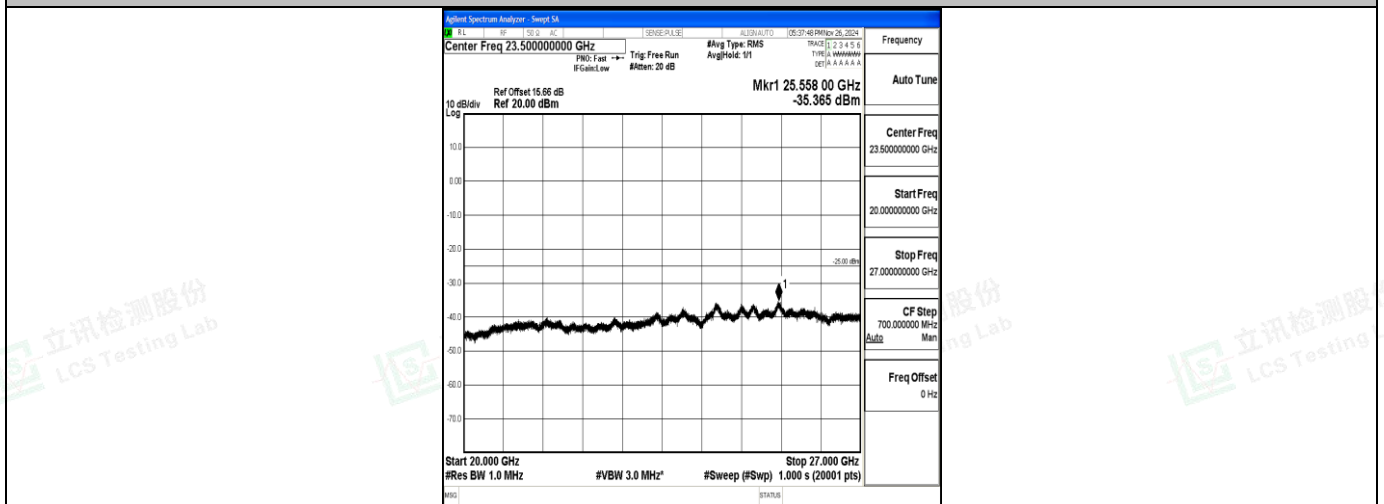


Band7_5MHz_QPSK_21425_1RB#0_20000~27000_20000~27000

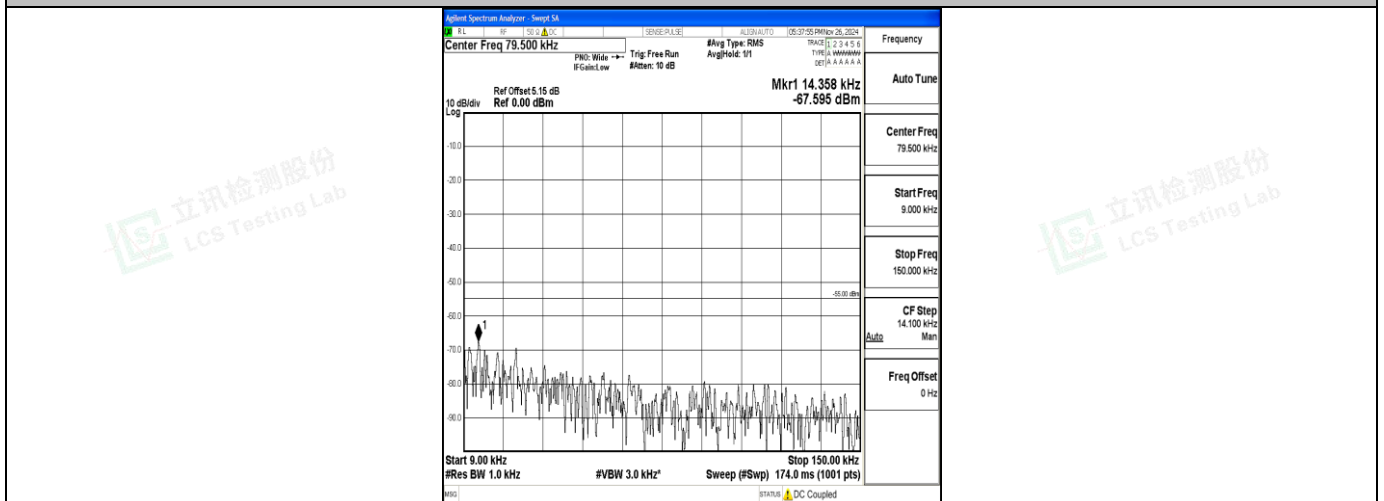


Band7_5MHz_16QAM_21425_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

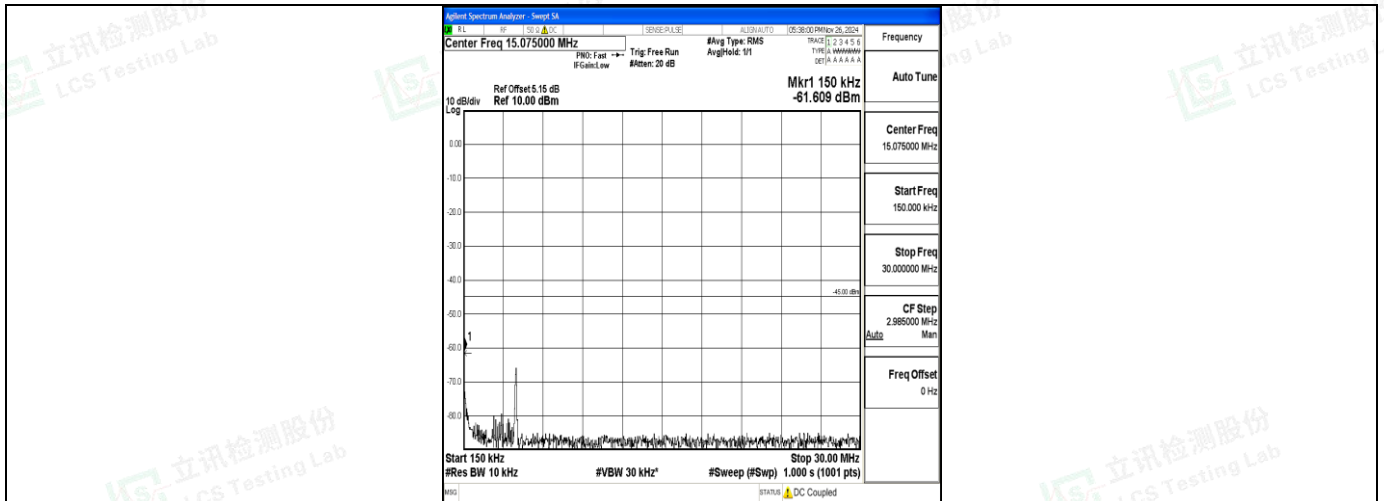

Band7_5MHz_16QAM_21425_1RB#0_0.15~30_0.15~30

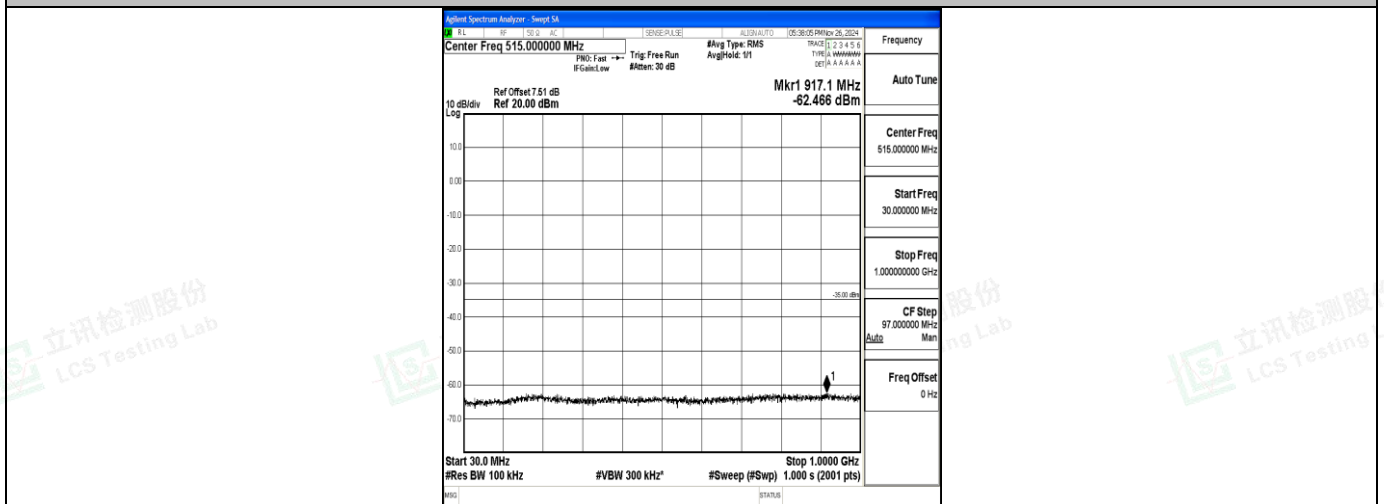


Band7_5MHz_16QAM_21425_1RB#0_30~1000_30~1000

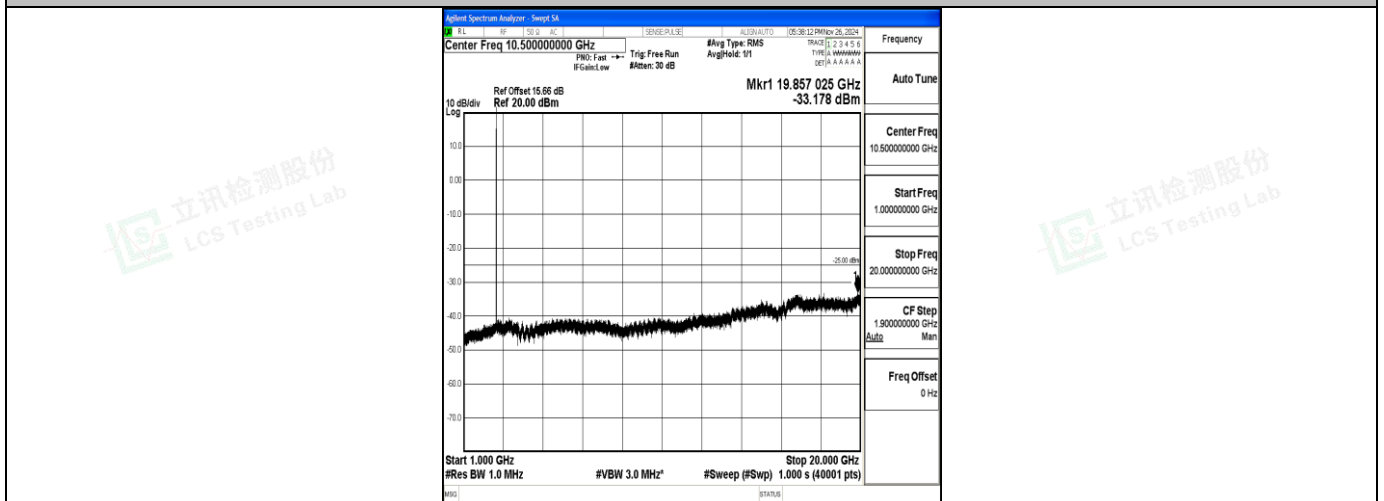


Band7_5MHz_16QAM_21425_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

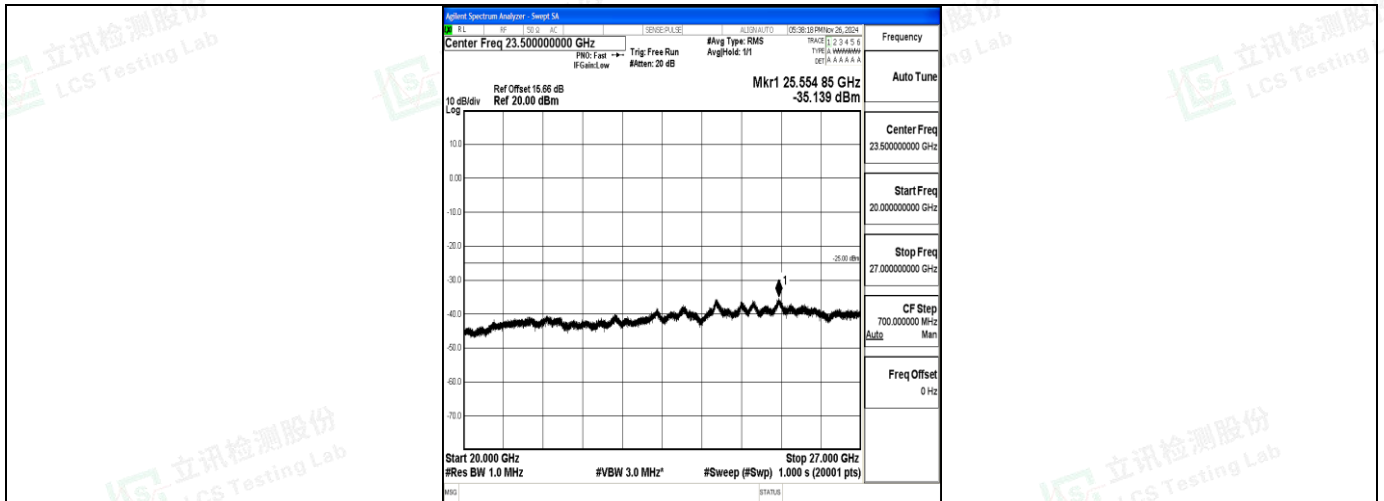

Band7_5MHz_16QAM_21425_1RB#0_20000~27000_20000~27000

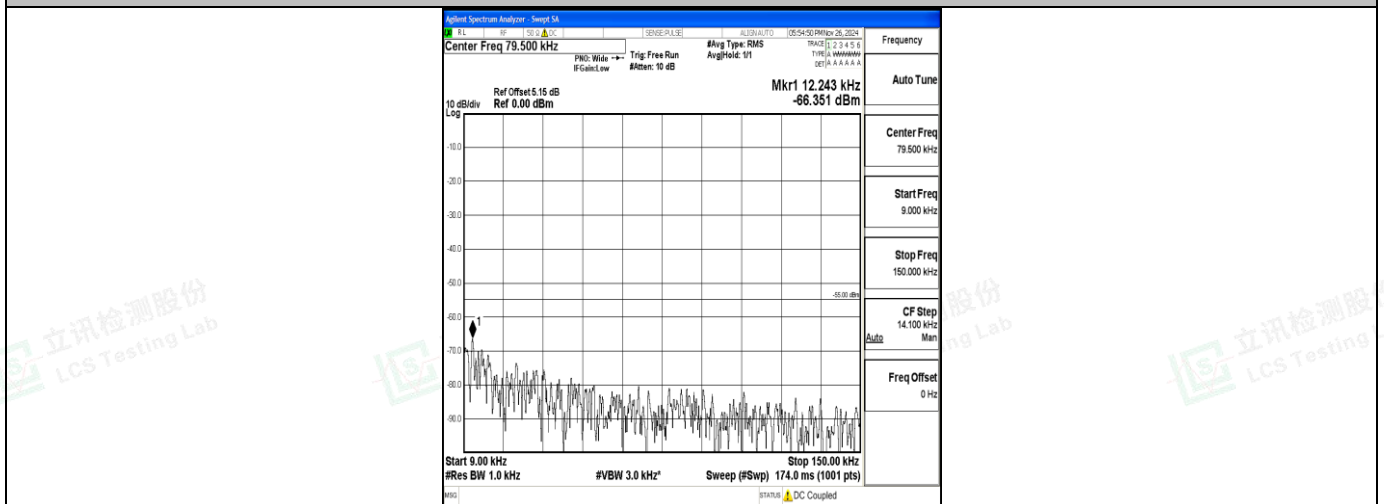


Band7_10MHz_QPSK_20800_1RB#0_0.009~0.15_0.009~0.15

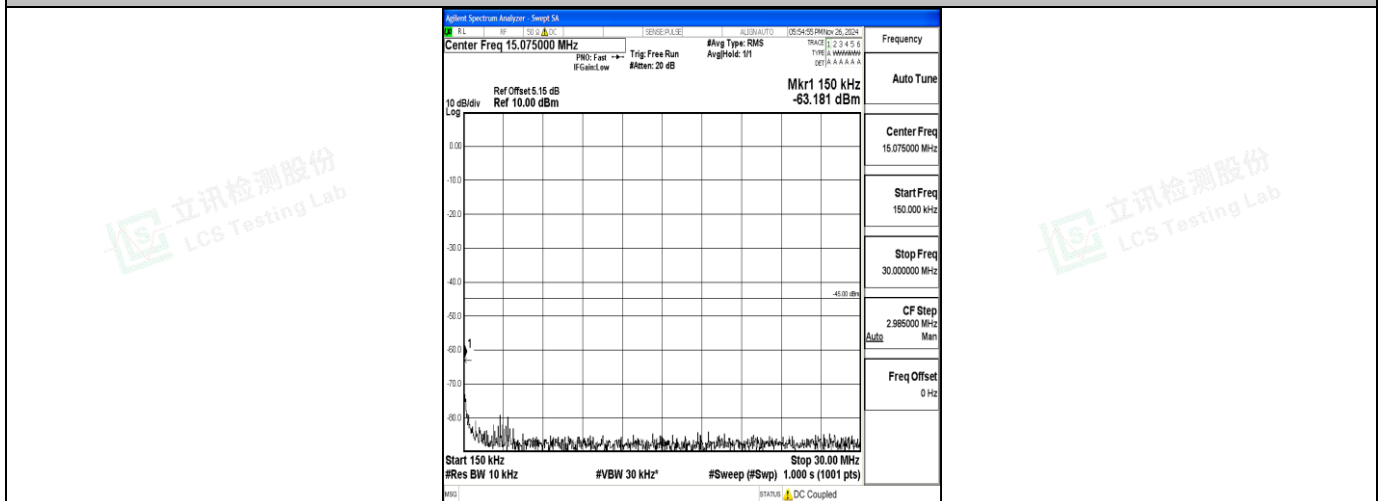


Band7_10MHz_QPSK_20800_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

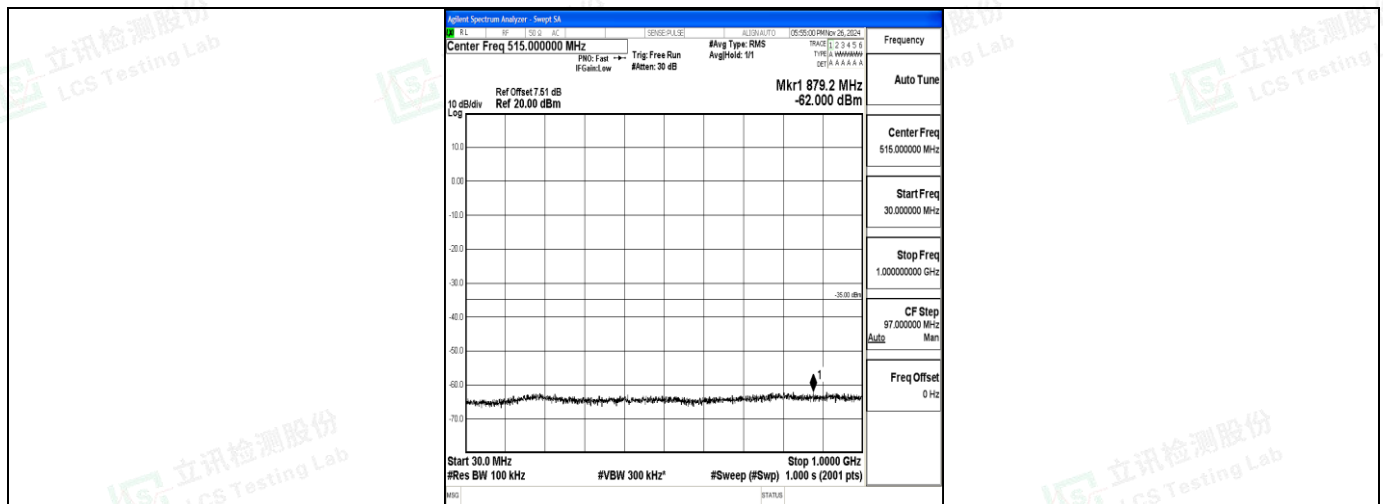

Band7_10MHz_QPSK_20800_1RB#0_30~1000_30~1000

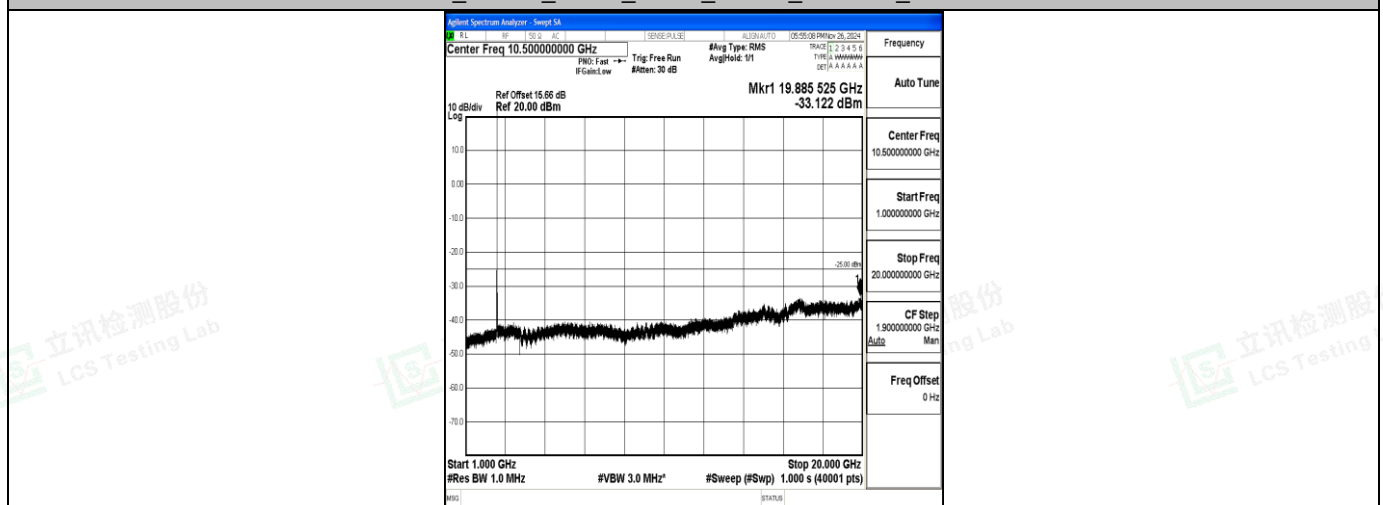


Band7_10MHz_QPSK_20800_1RB#0_1000~20000_1000~20000

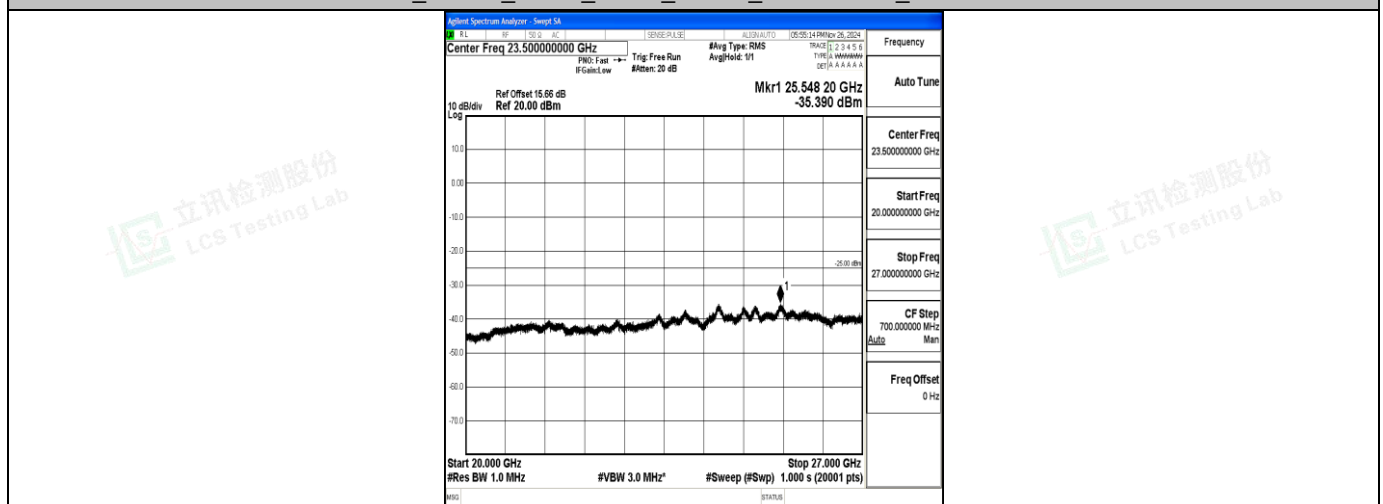


Band7_10MHz_QPSK_20800_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

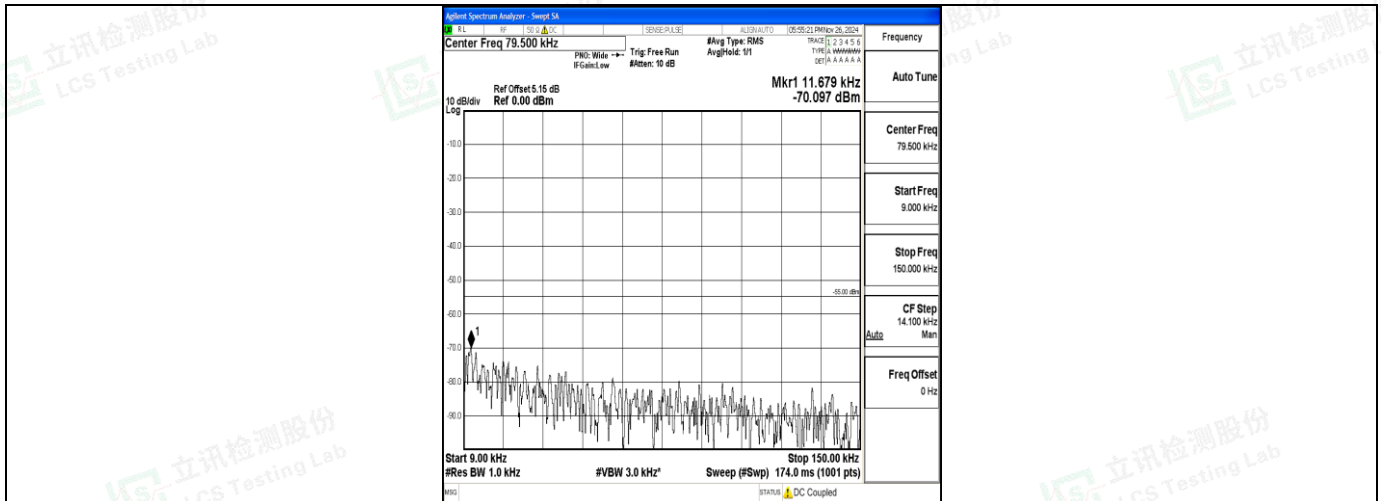

Band7_10MHz_16QAM_20800_1RB#0_0.009~0.15_0.009~0.15

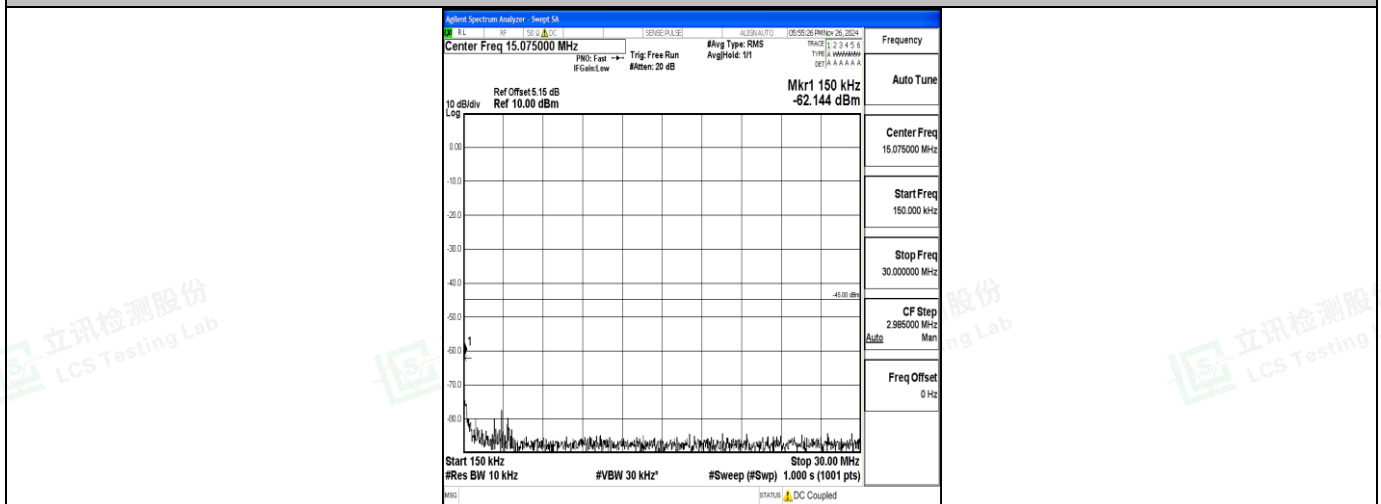


Band7_10MHz_16QAM_20800_1RB#0_0.15~30_0.15~30

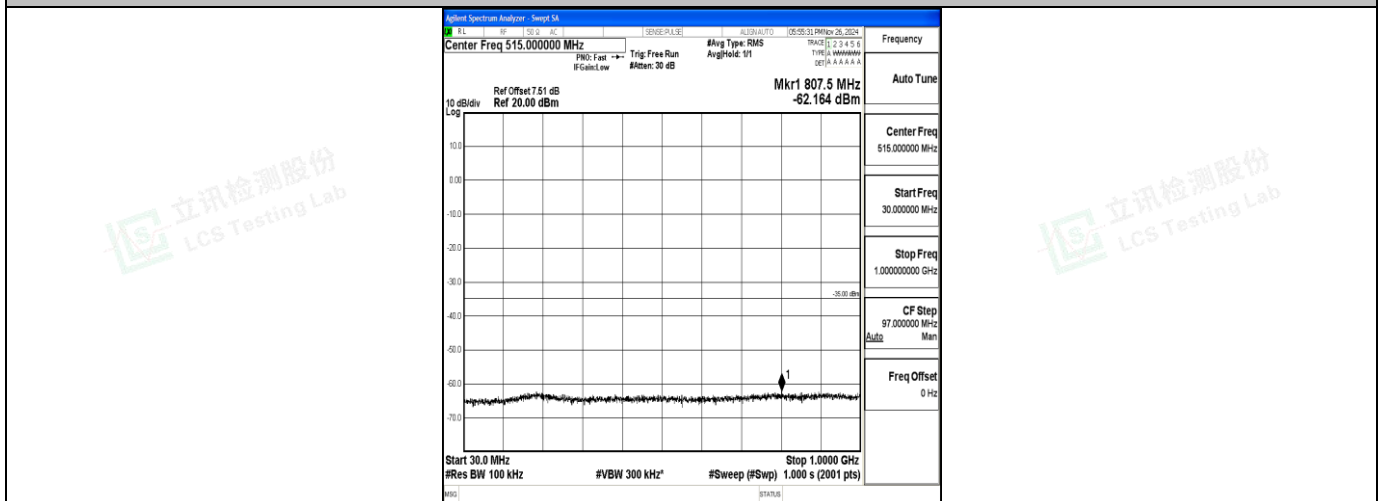


Band7_10MHz_16QAM_20800_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

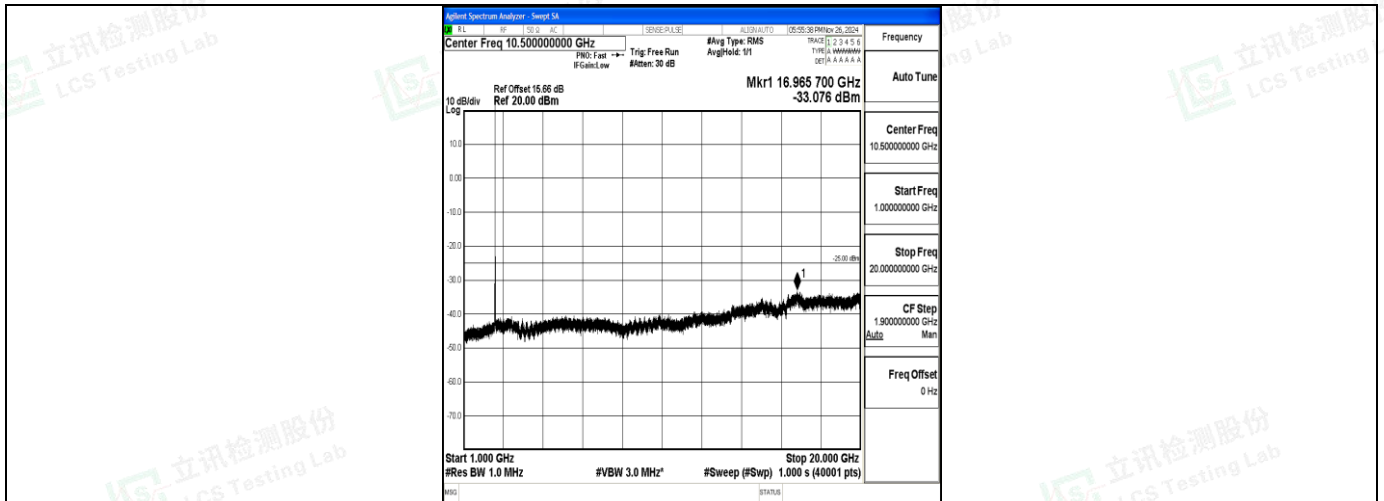

Band7_10MHz_16QAM_20800_1RB#0_1000~20000_1000~20000

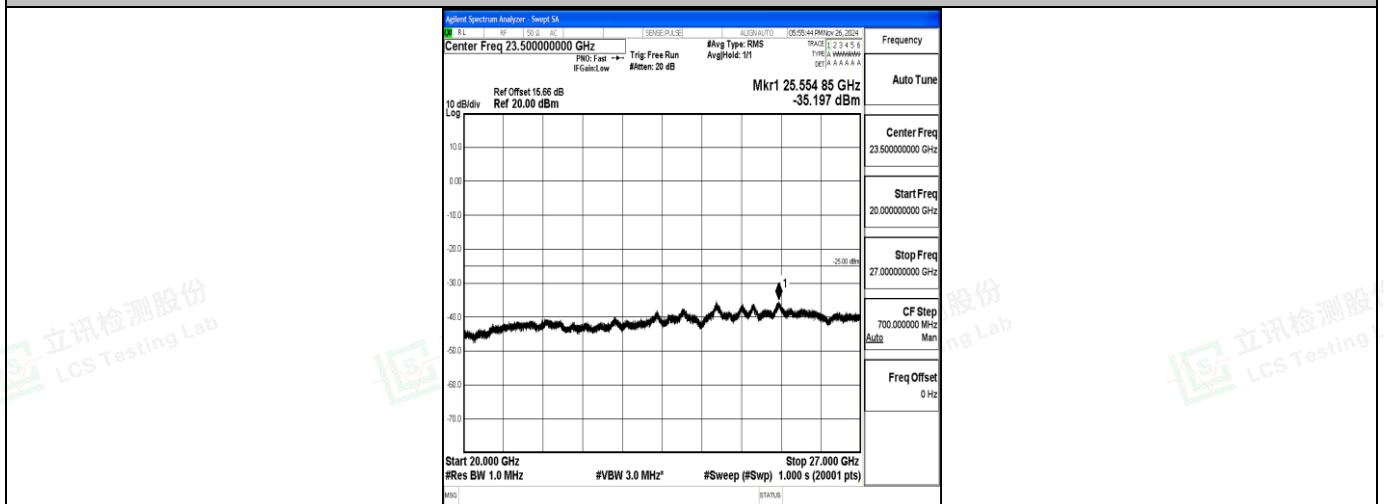


Band7_10MHz_16QAM_20800_1RB#0_20000~27000_20000~27000

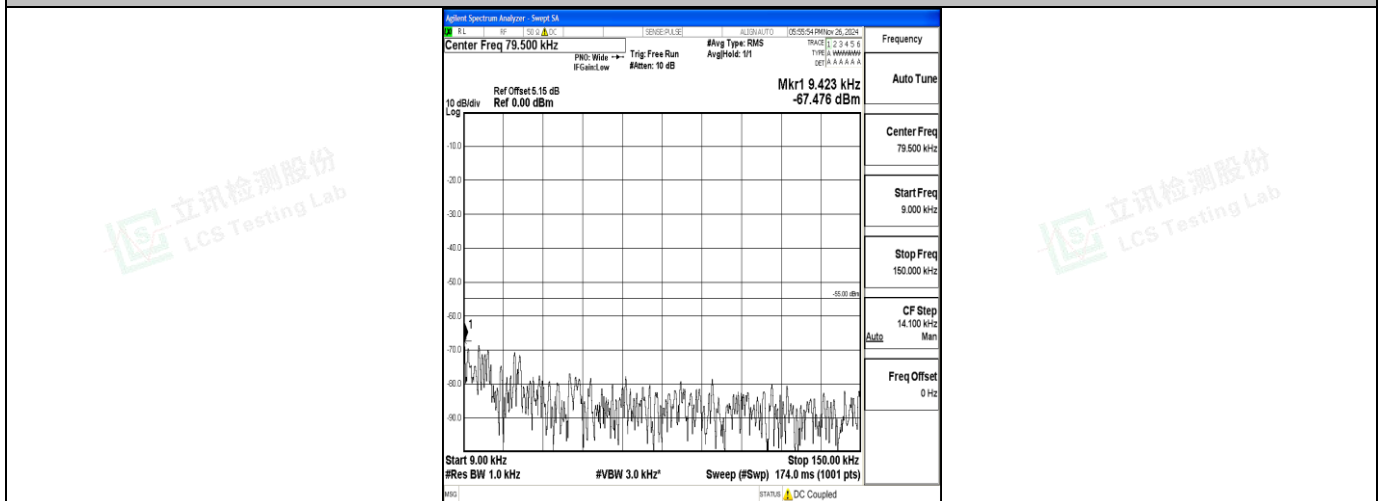


Band7_10MHz_QPSK_21100_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

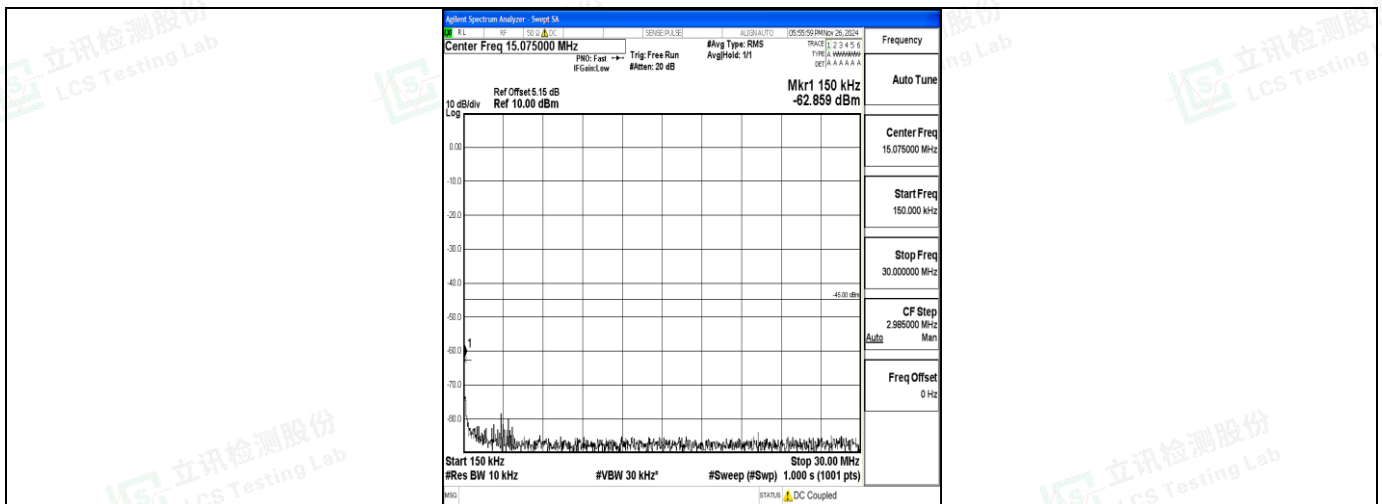

Band7_10MHz_QPSK_21100_1RB#0_0.15~30_0.15~30

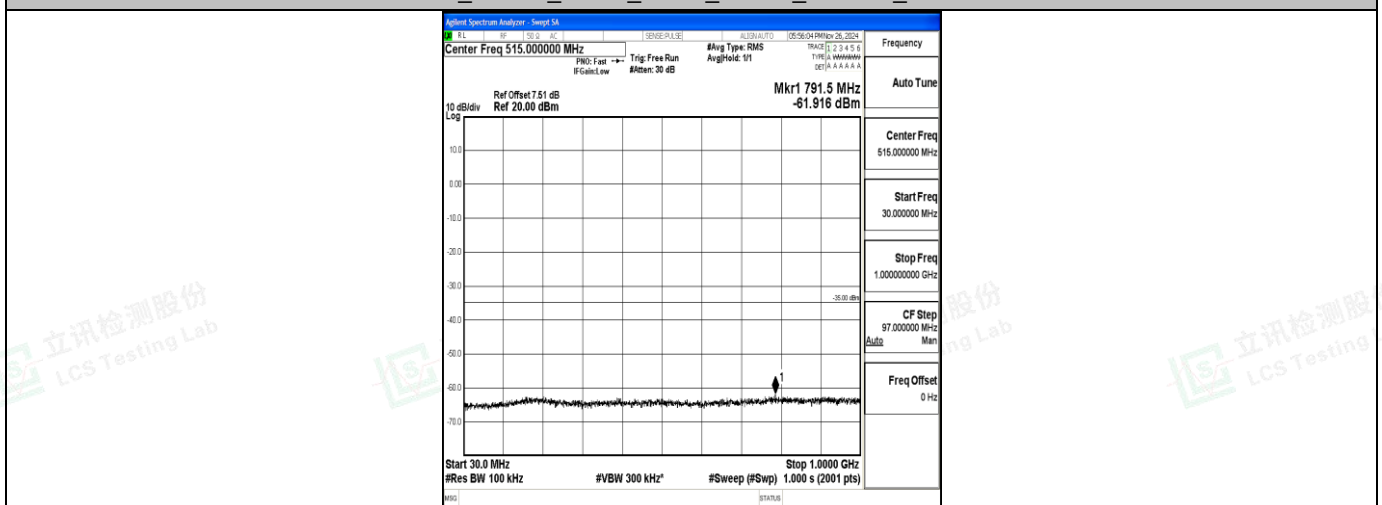


Band7_10MHz_QPSK_21100_1RB#0_30~1000_30~1000

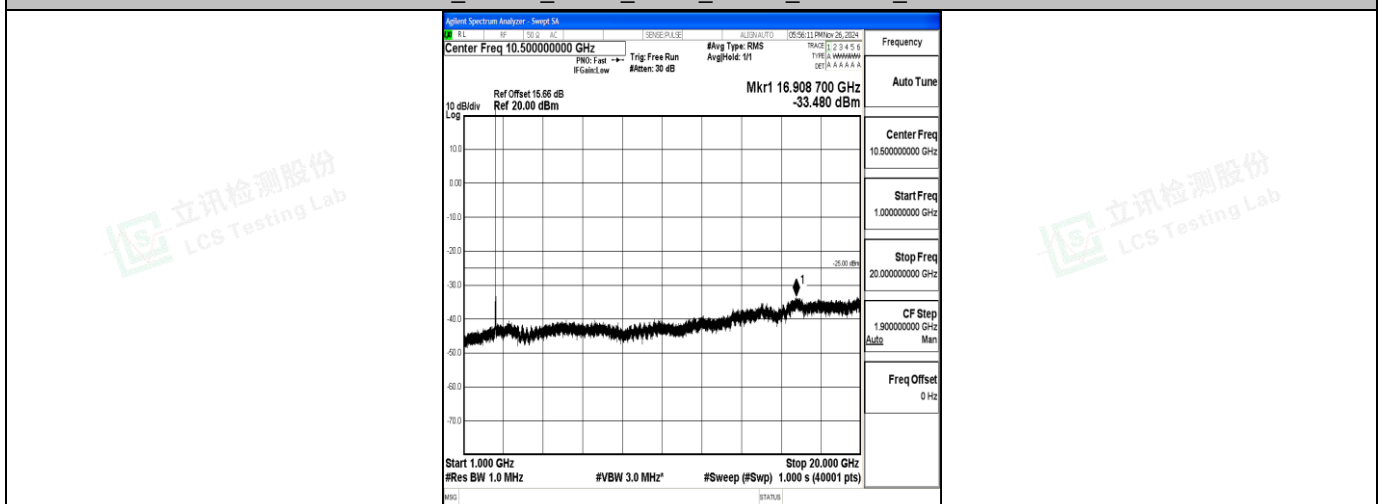


Band7_10MHz_QPSK_21100_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

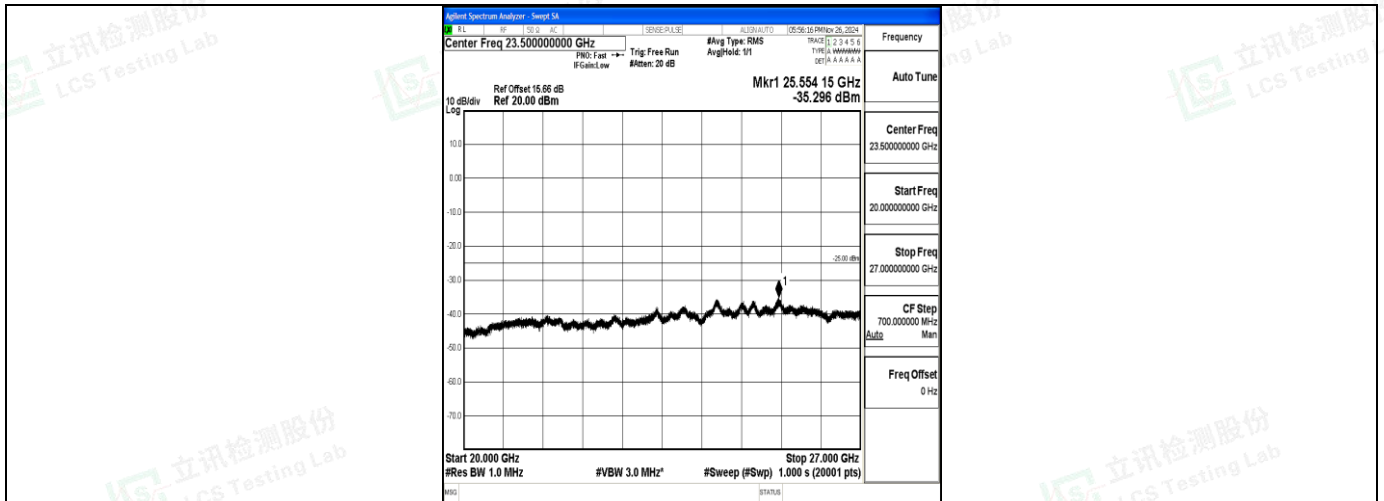

Band7_10MHz_QPSK_21100_1RB#0_20000~27000_20000~27000

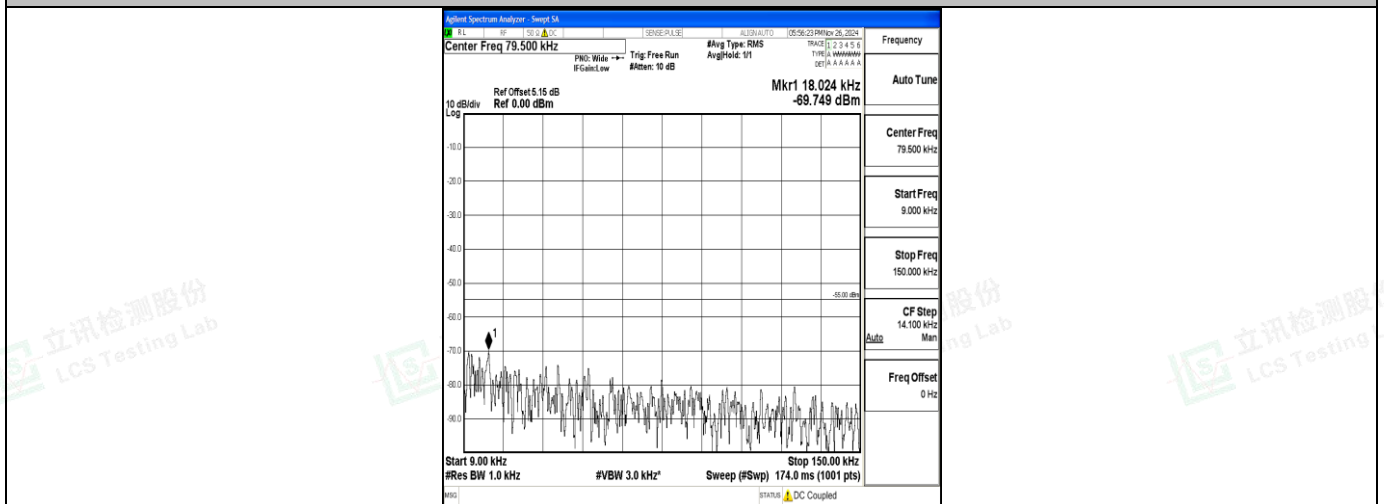


Band7_10MHz_16QAM_21100_1RB#0_0.009~0.15_0.009~0.15

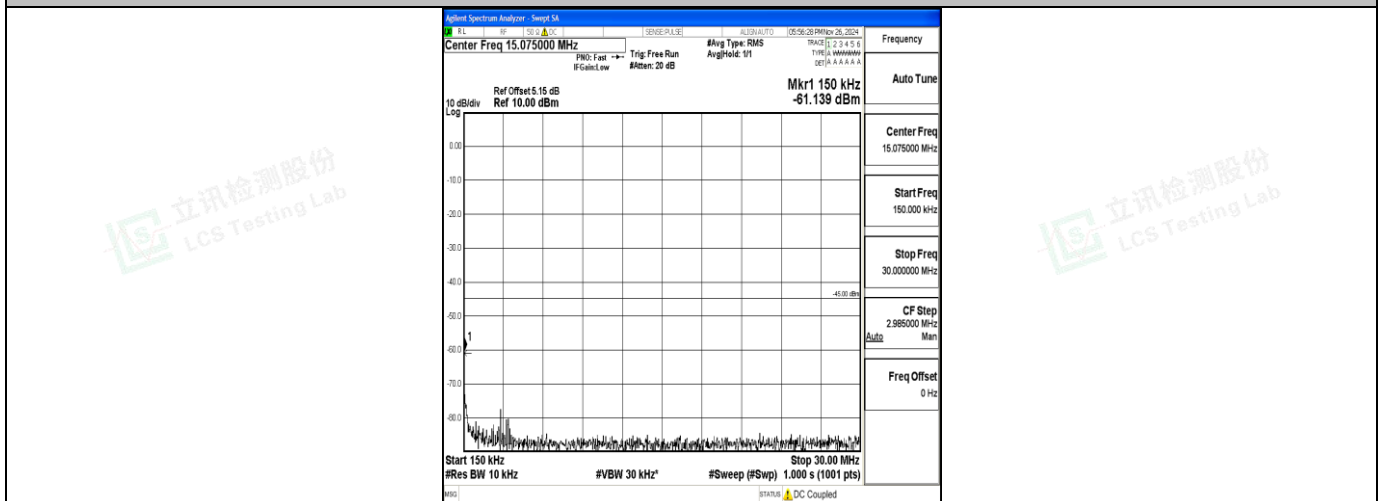


Band7_10MHz_16QAM_21100_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

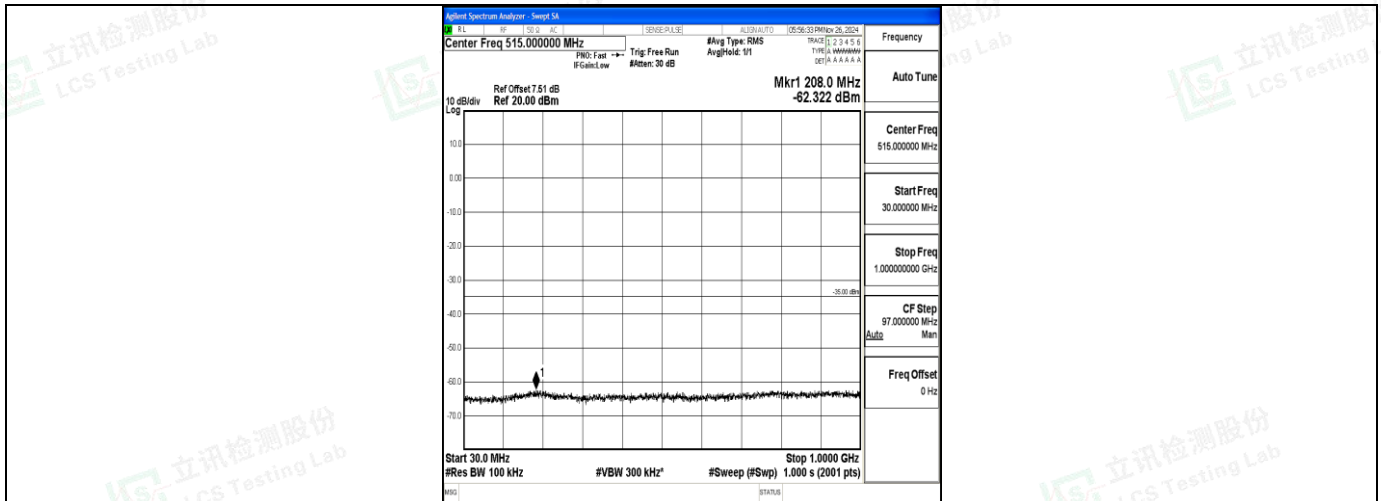

Band7_10MHz_16QAM_21100_1RB#0_30~1000_30~1000

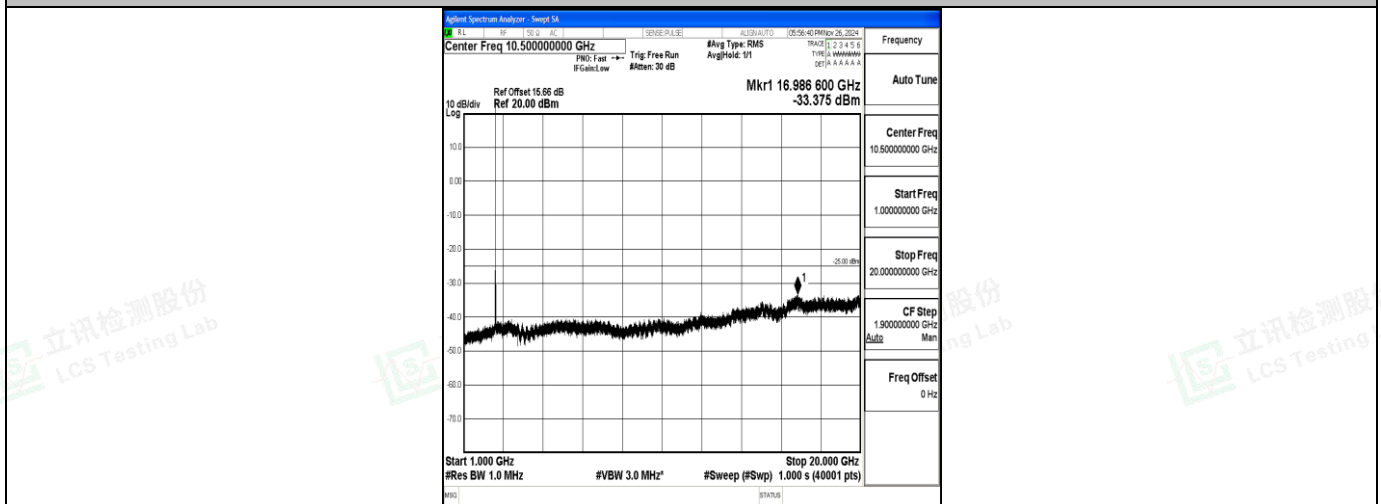


Band7_10MHz_16QAM_21100_1RB#0_1000~20000_1000~20000

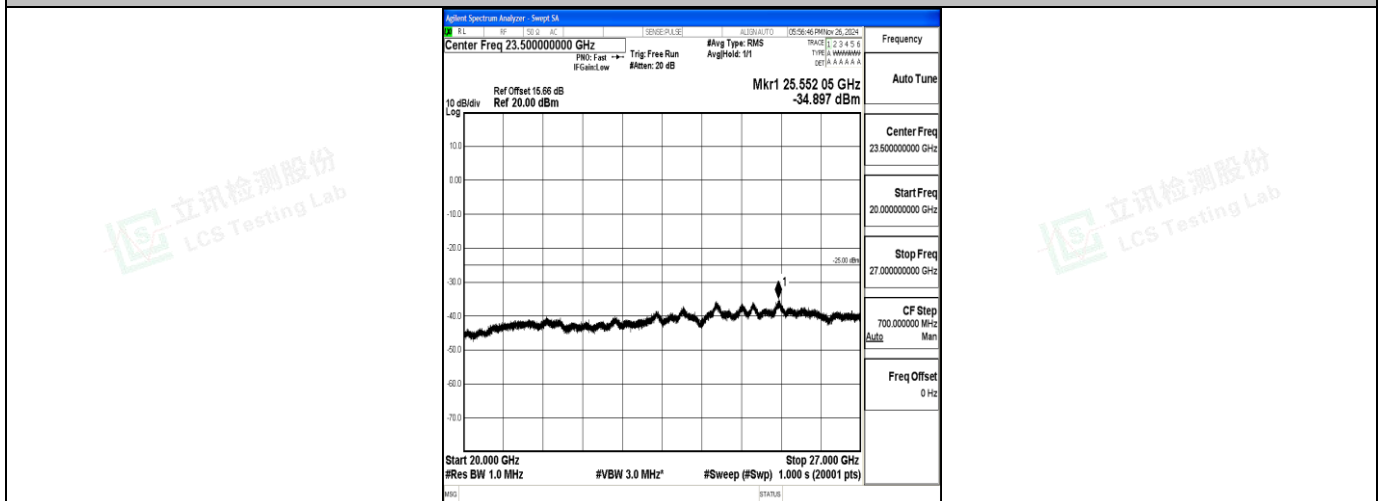


Band7_10MHz_16QAM_21100_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

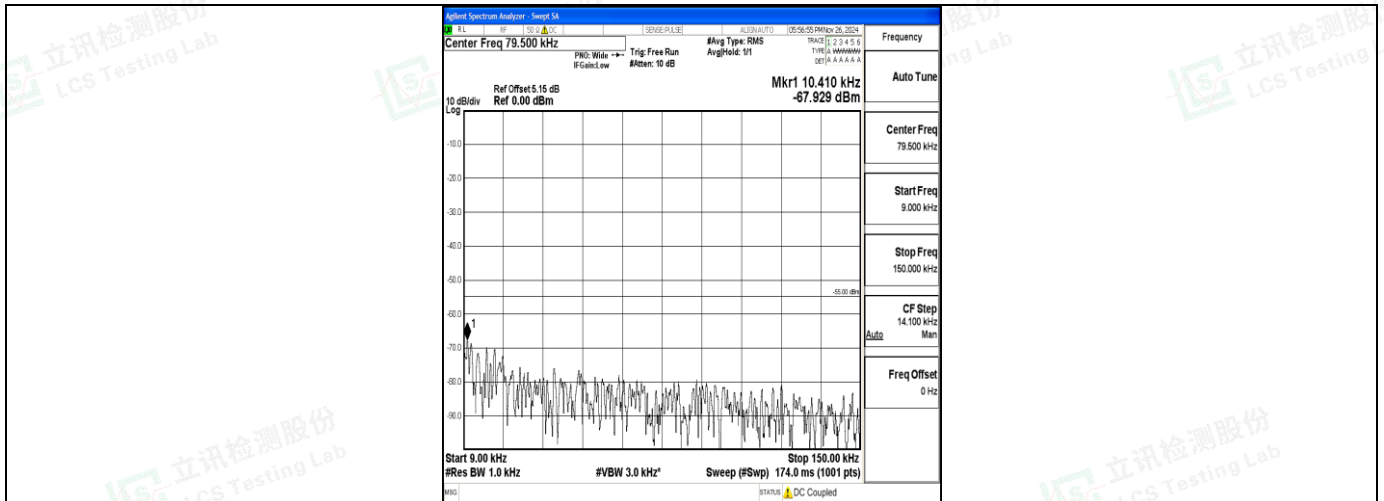

Band7_10MHz_QPSK_21400_1RB#0_0.009~0.15_0.009~0.15

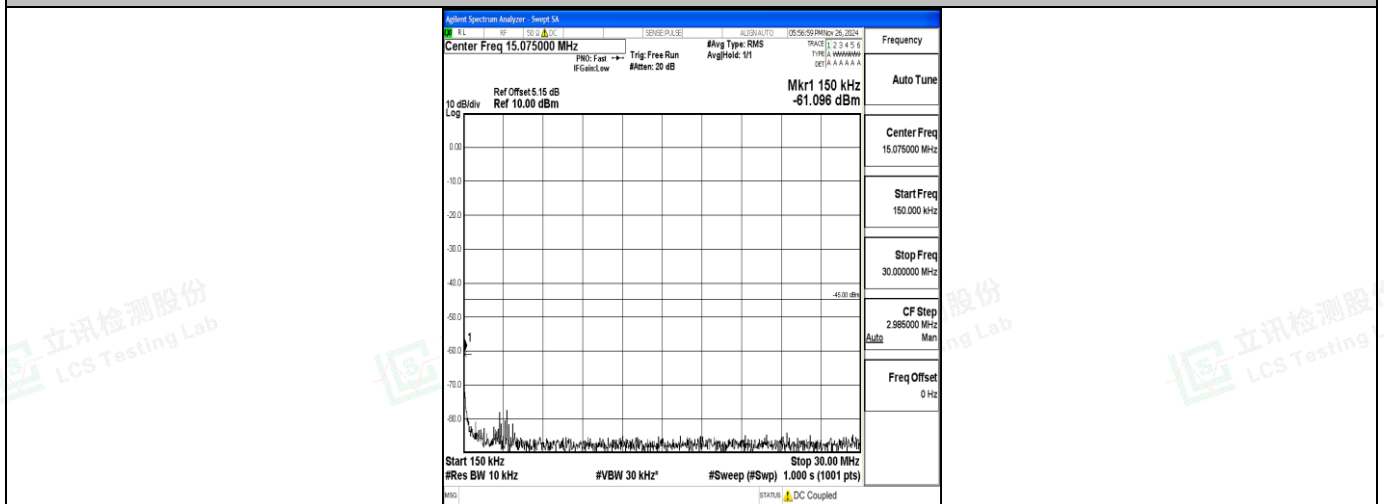


Band7_10MHz_QPSK_21400_1RB#0_0.15~30_0.15~30

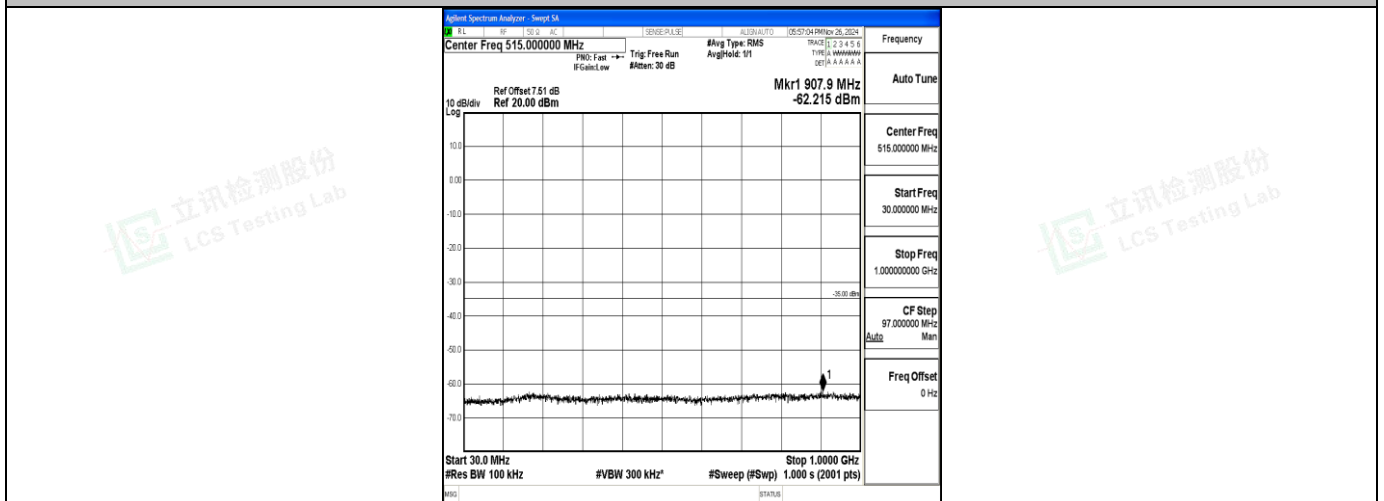


Band7_10MHz_QPSK_21400_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

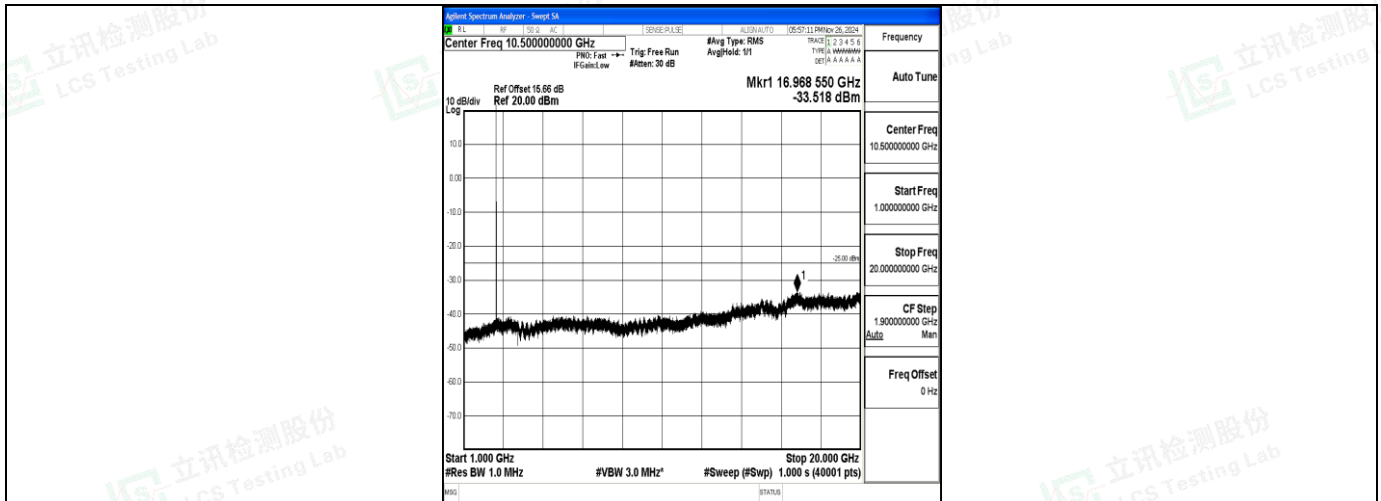

Band7_10MHz_QPSK_21400_1RB#0_1000~20000_1000~20000

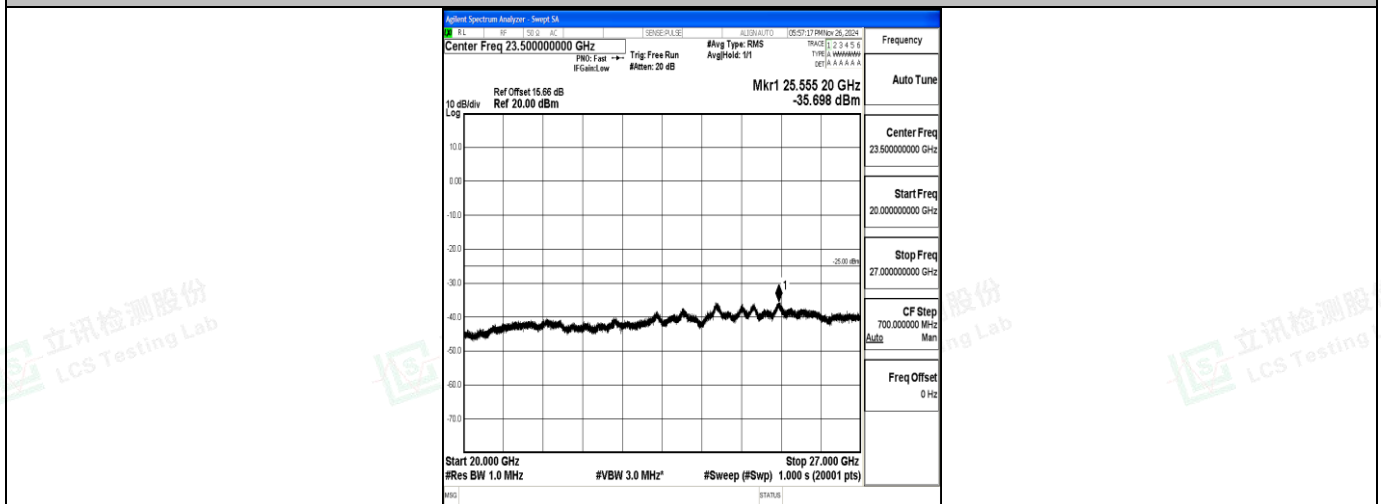


Band7_10MHz_QPSK_21400_1RB#0_20000~27000_20000~27000

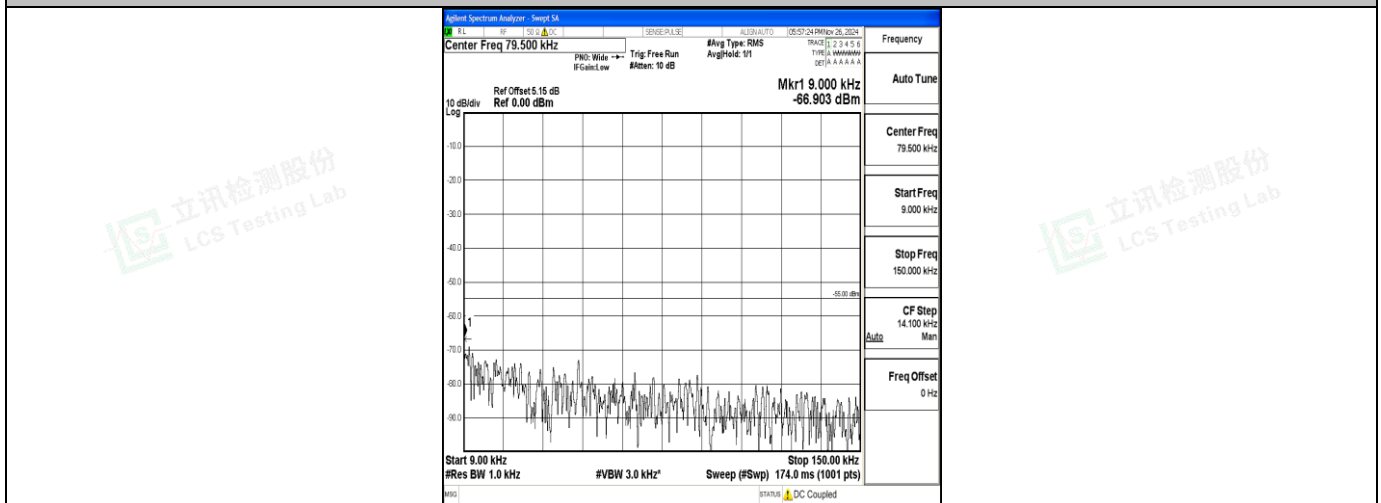


Band7_10MHz_16QAM_21400_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

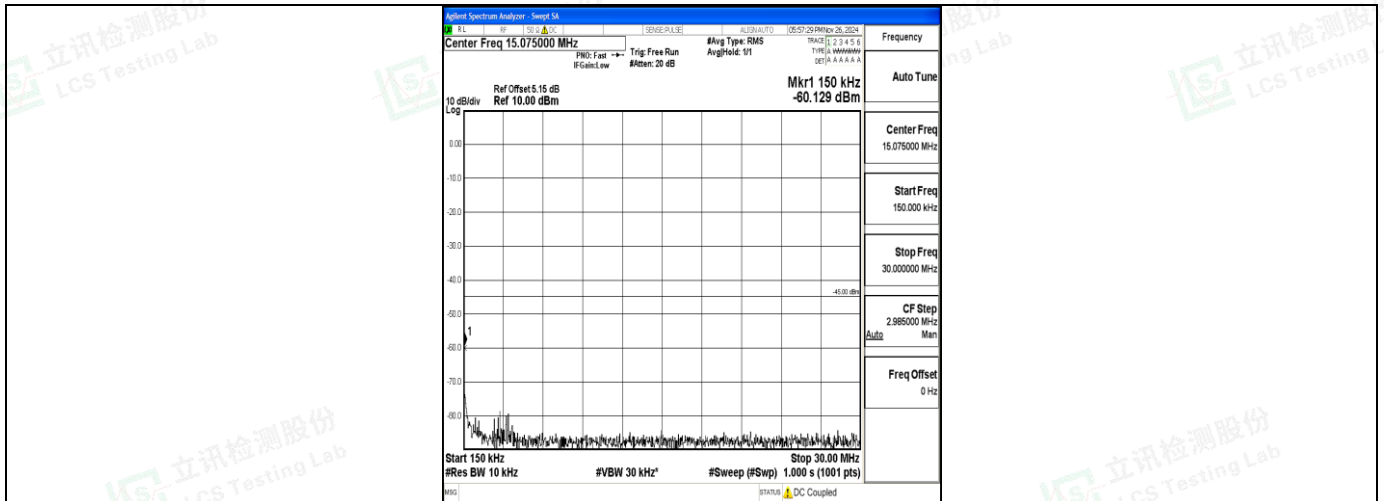

Band7_10MHz_16QAM_21400_1RB#0_0.15~30_0.15~30

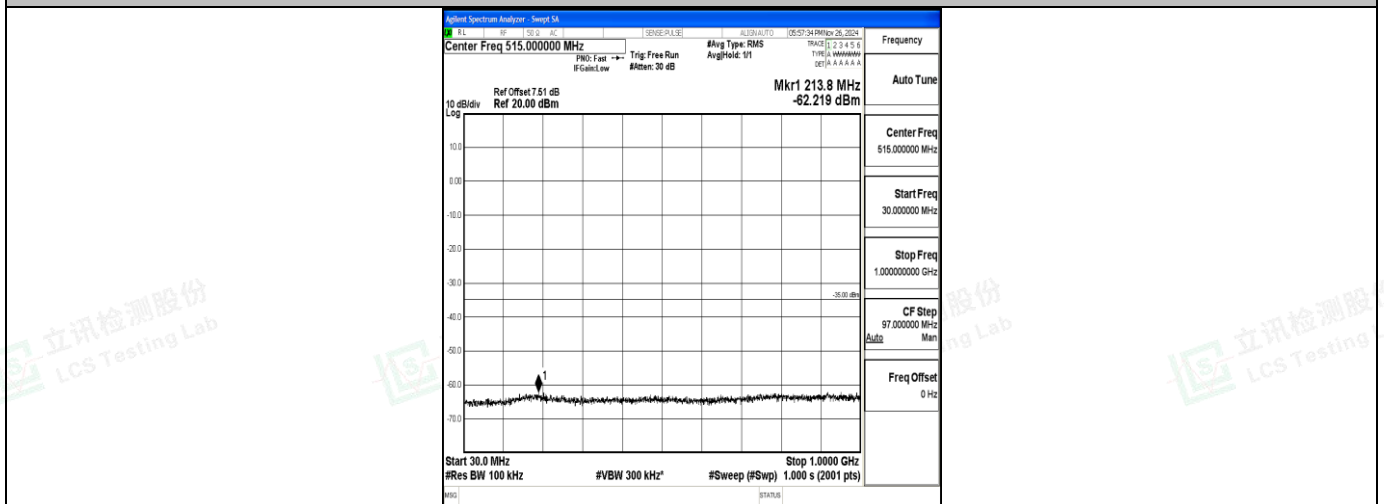


Band7_10MHz_16QAM_21400_1RB#0_30~1000_30~1000

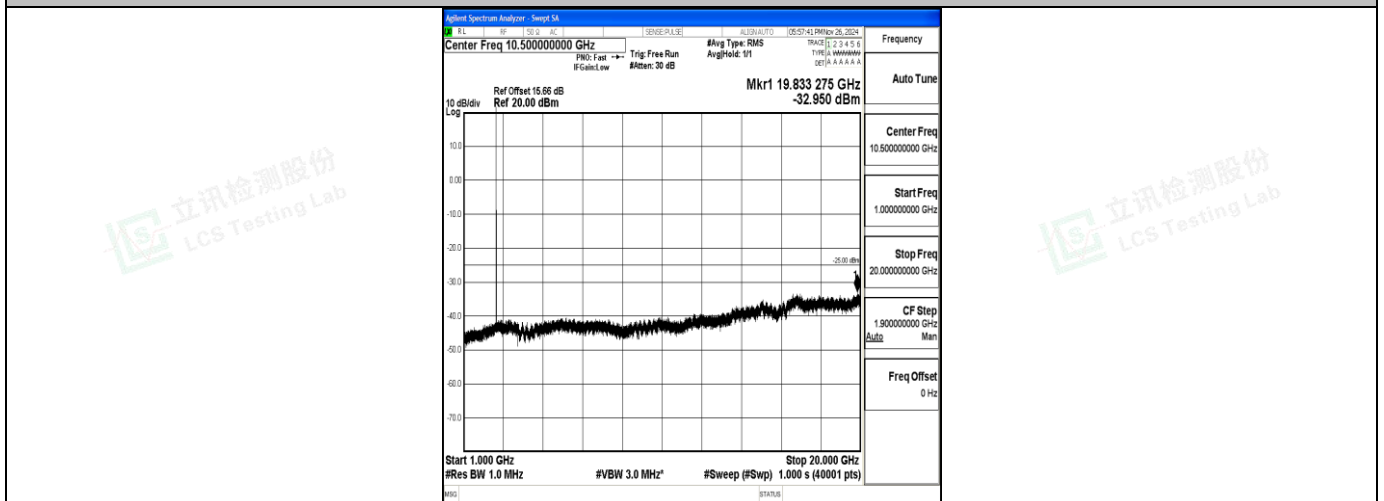


Band7_10MHz_16QAM_21400_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

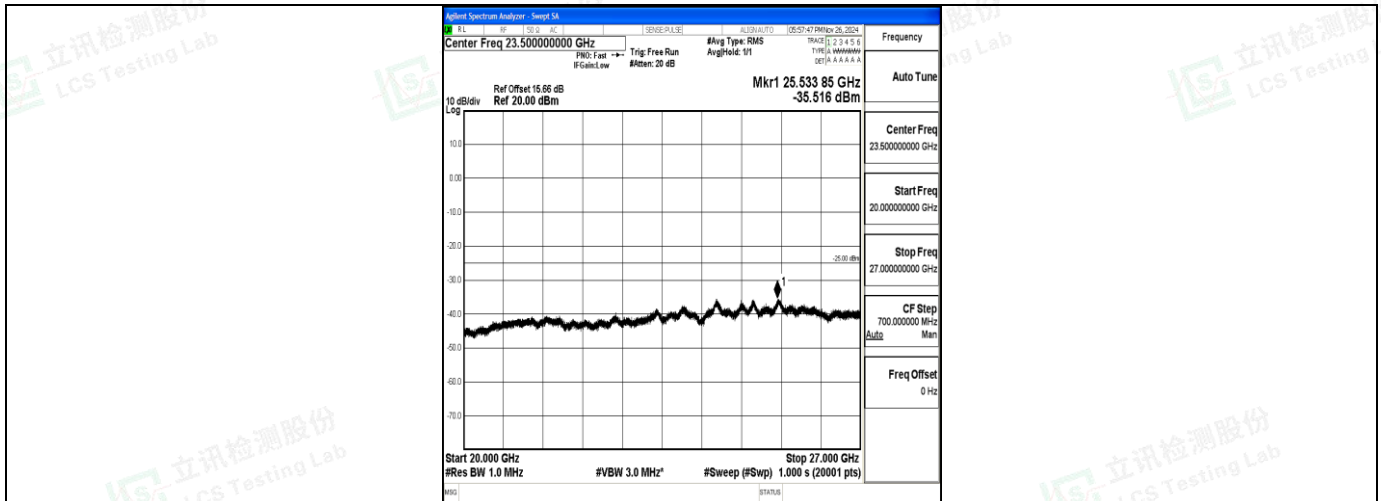

Band7_10MHz_16QAM_21400_1RB#0_20000~27000_20000~27000

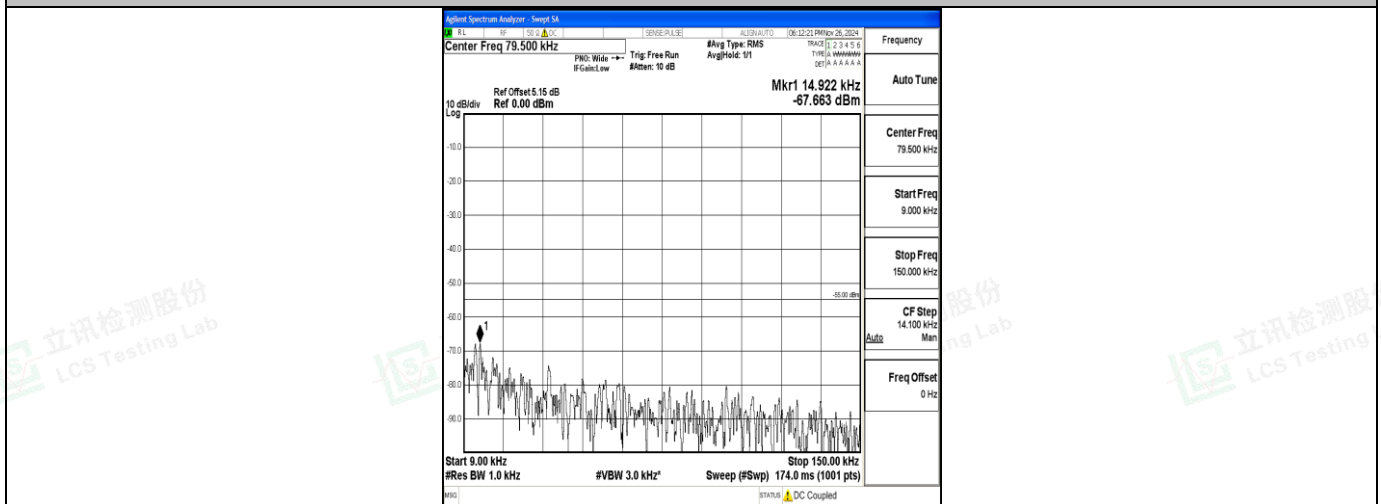


Band7_15MHz_QPSK_20825_1RB#0_0.009~0.15_0.009~0.15

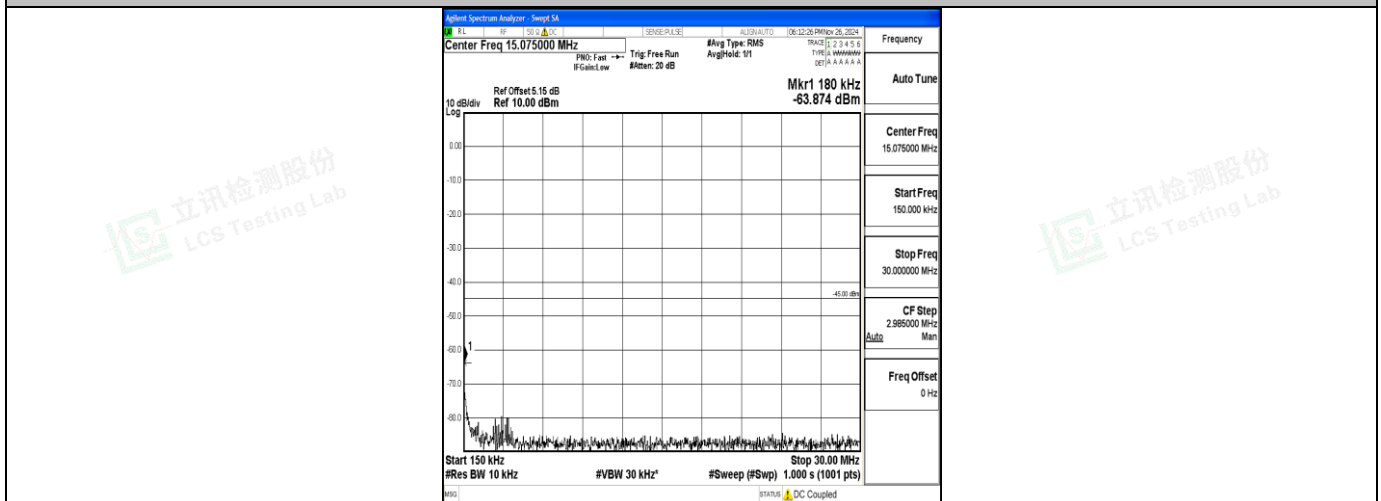


Band7_15MHz_QPSK_20825_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

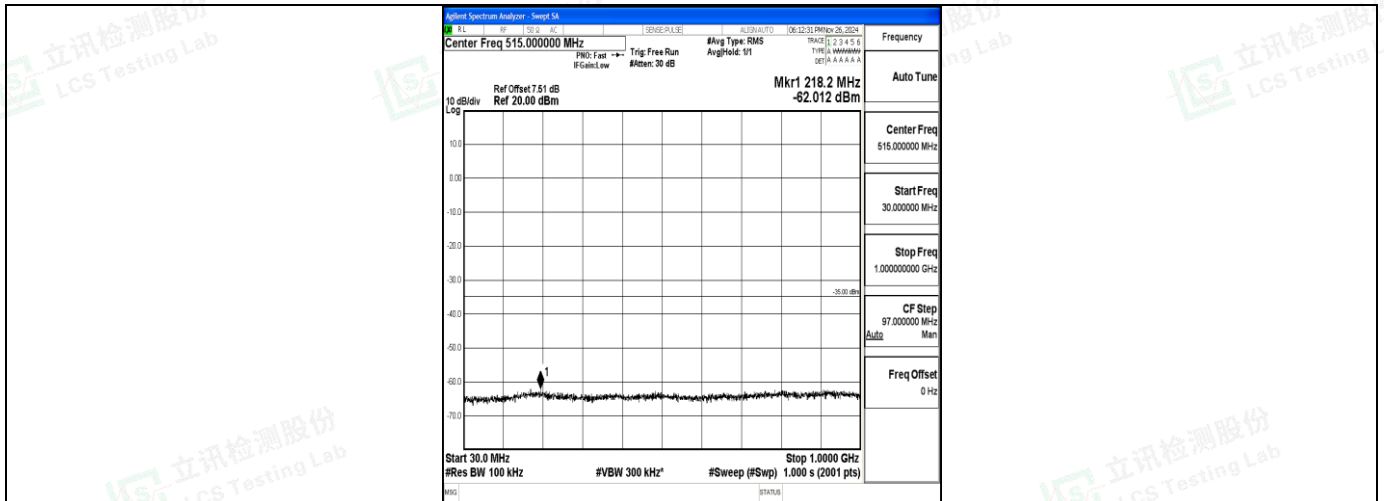

Band7_15MHz_QPSK_20825_1RB#0_30~1000_30~1000

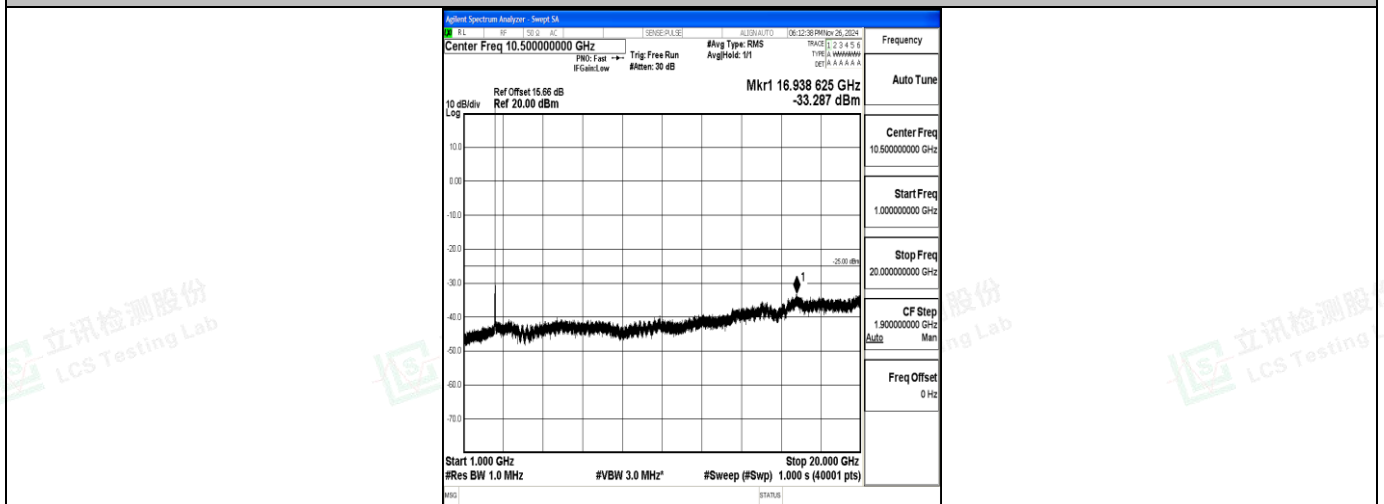


Band7_15MHz_QPSK_20825_1RB#0_1000~20000_1000~20000

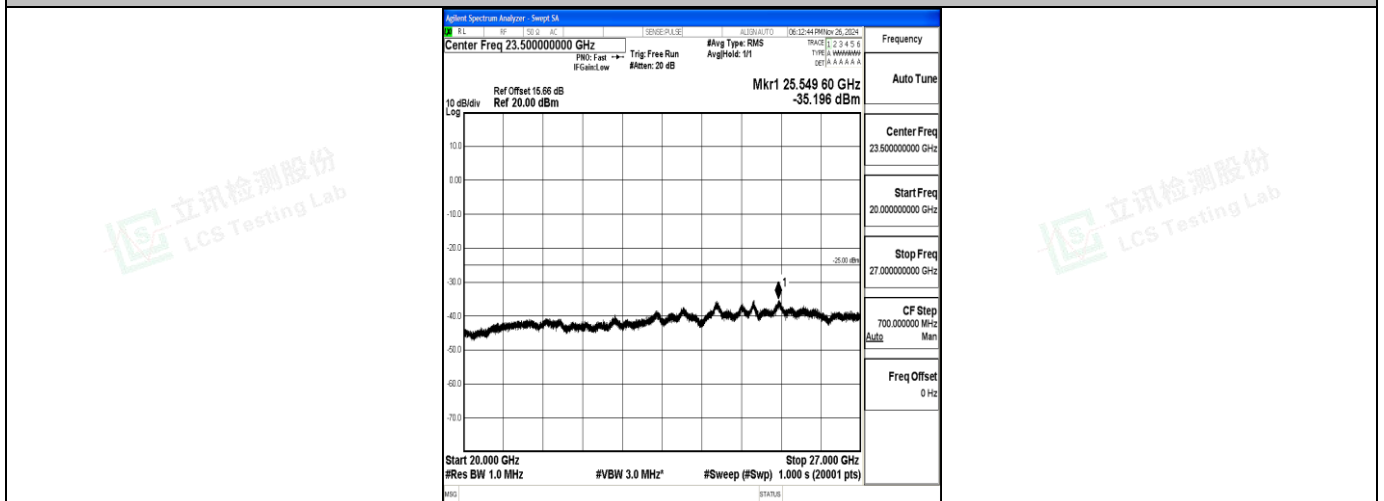


Band7_15MHz_QPSK_20825_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

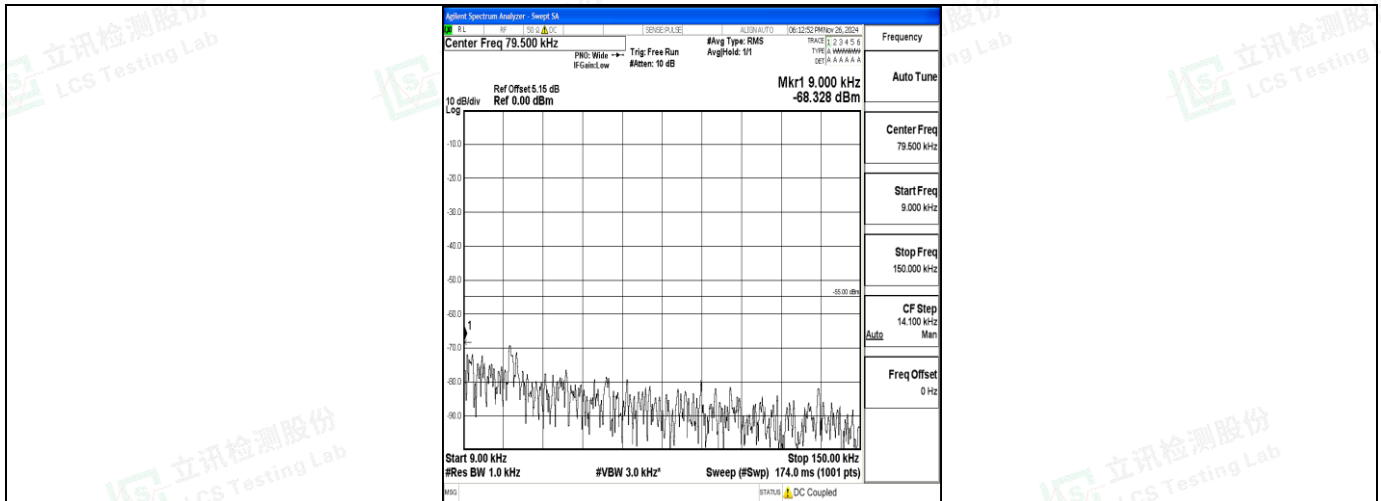

Band7_15MHz_16QAM_20825_1RB#0_0.009~0.15_0.009~0.15

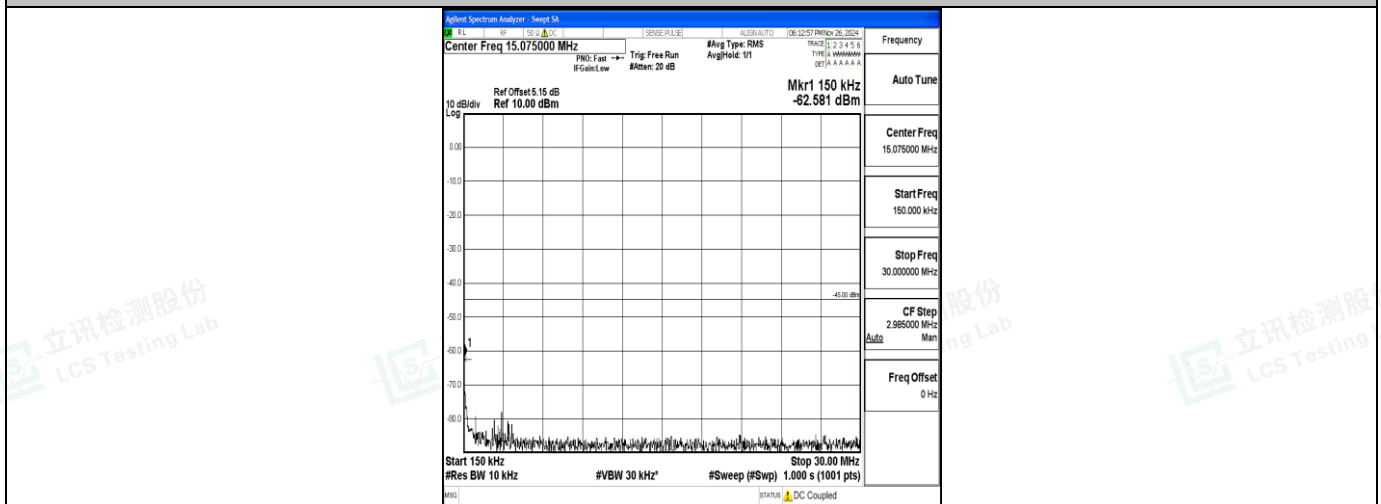


Band7_15MHz_16QAM_20825_1RB#0_0.15~30_0.15~30

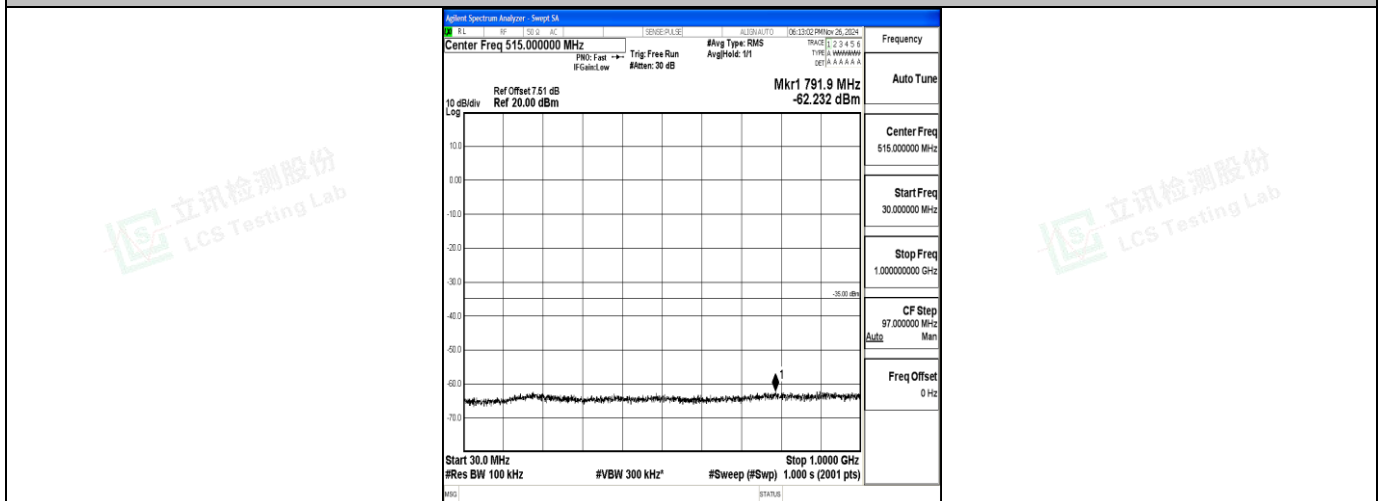


Band7_15MHz_16QAM_20825_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

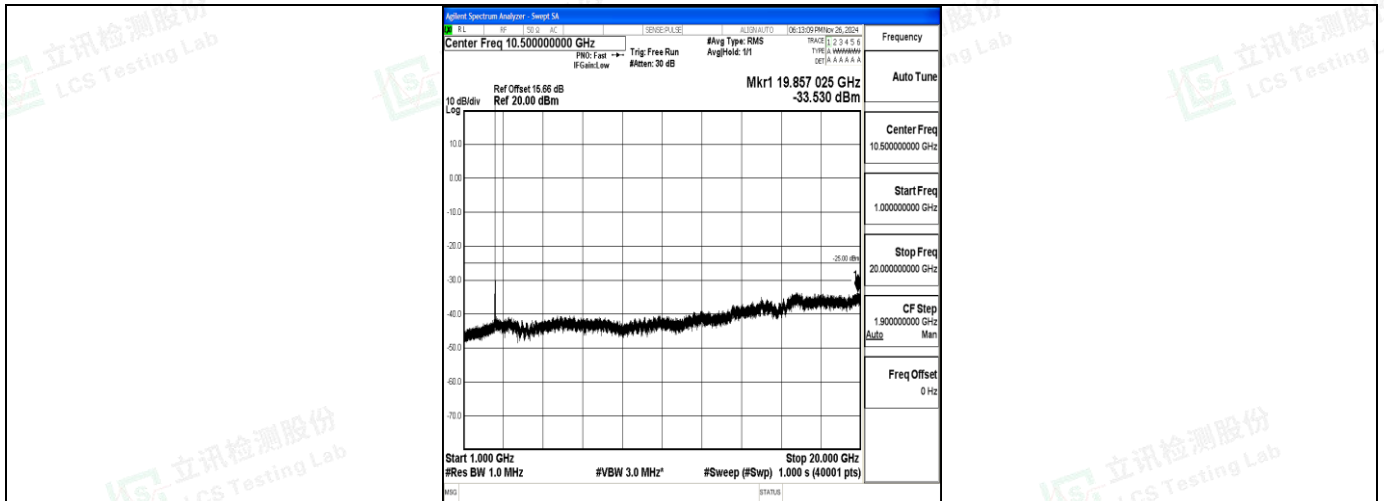

Band7_15MHz_16QAM_20825_1RB#0_1000~20000_1000~20000

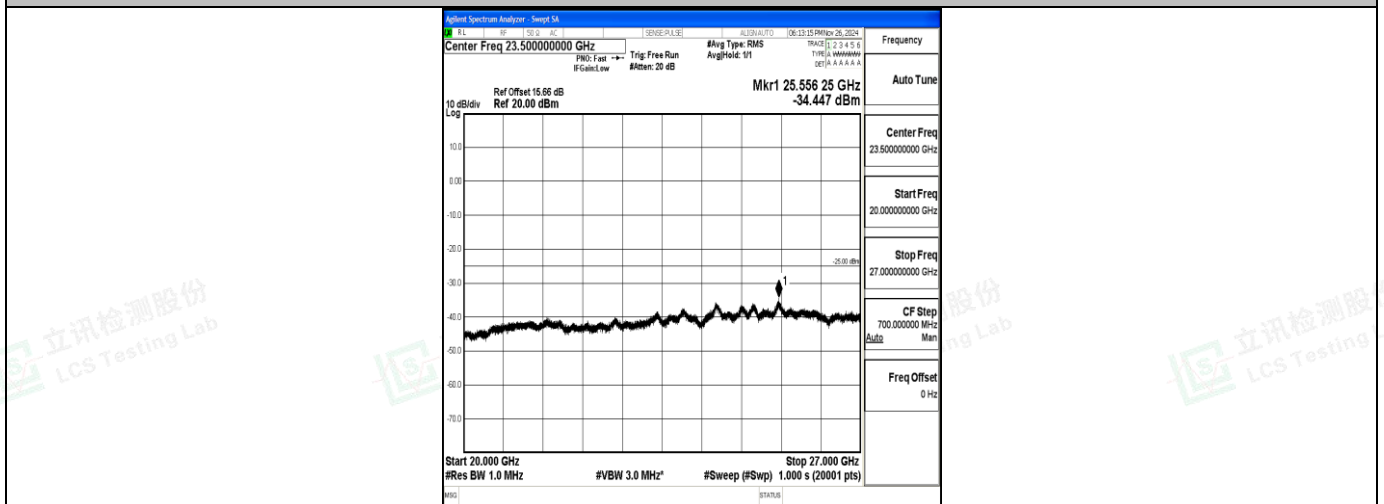


Band7_15MHz_16QAM_20825_1RB#0_20000~27000_20000~27000

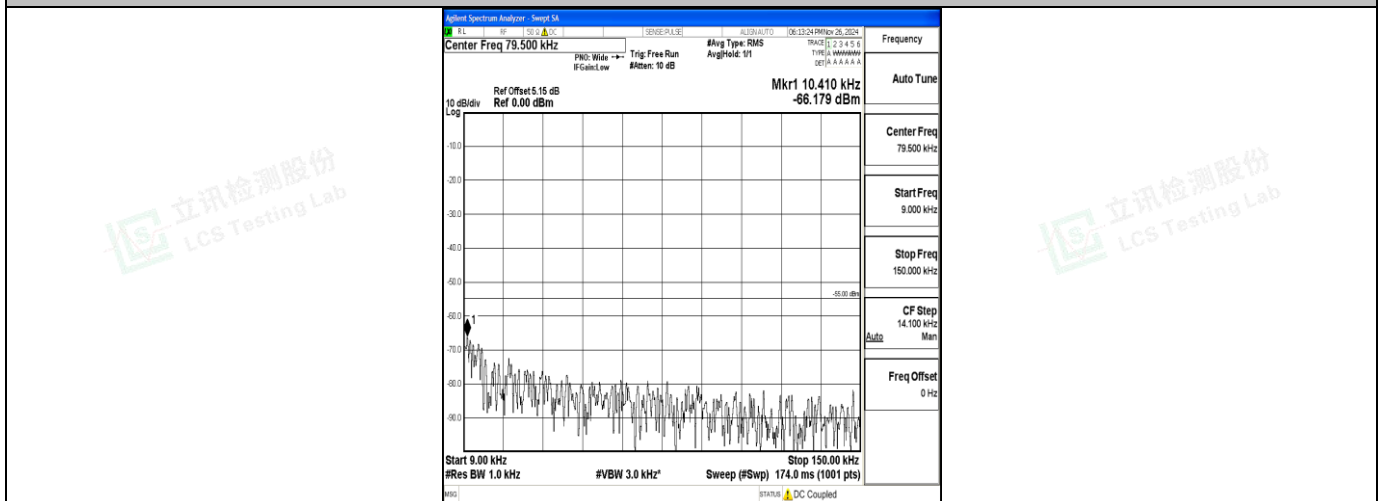


Band7_15MHz_QPSK_21100_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

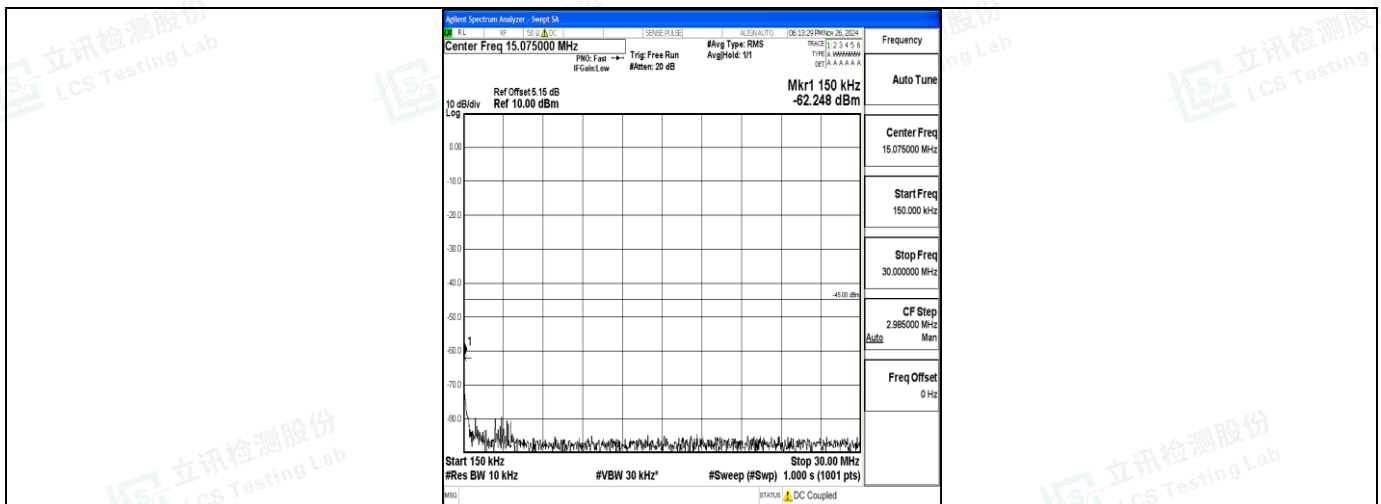

Band7_15MHz_QPSK_21100_1RB#0_0.15~30_0.15~30

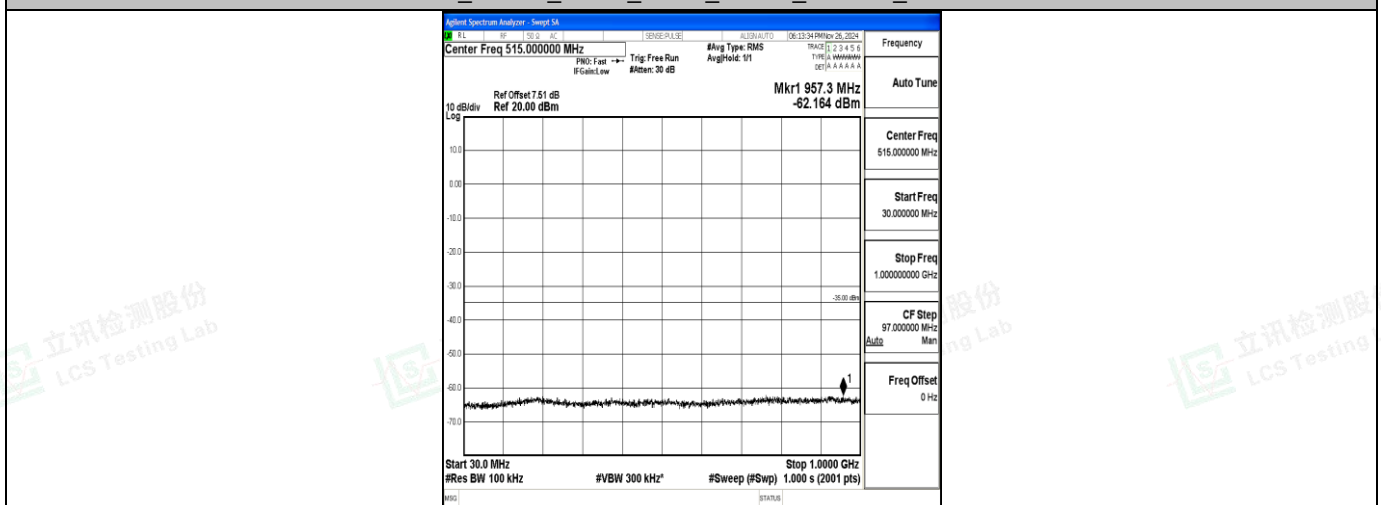


Band7_15MHz_QPSK_21100_1RB#0_30~1000_30~1000

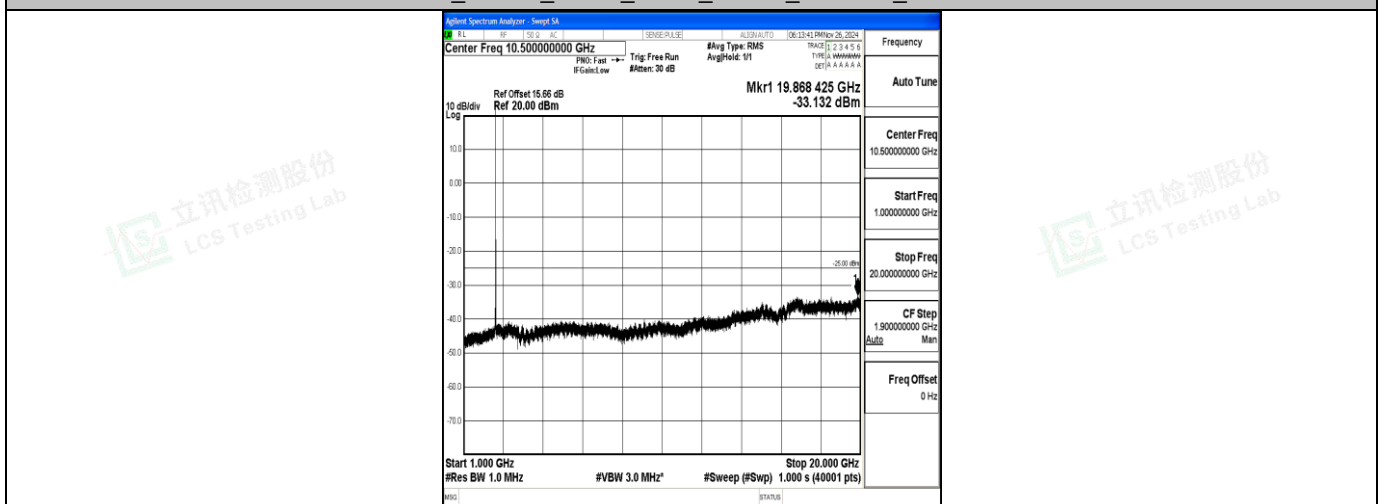


Band7_15MHz_QPSK_21100_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

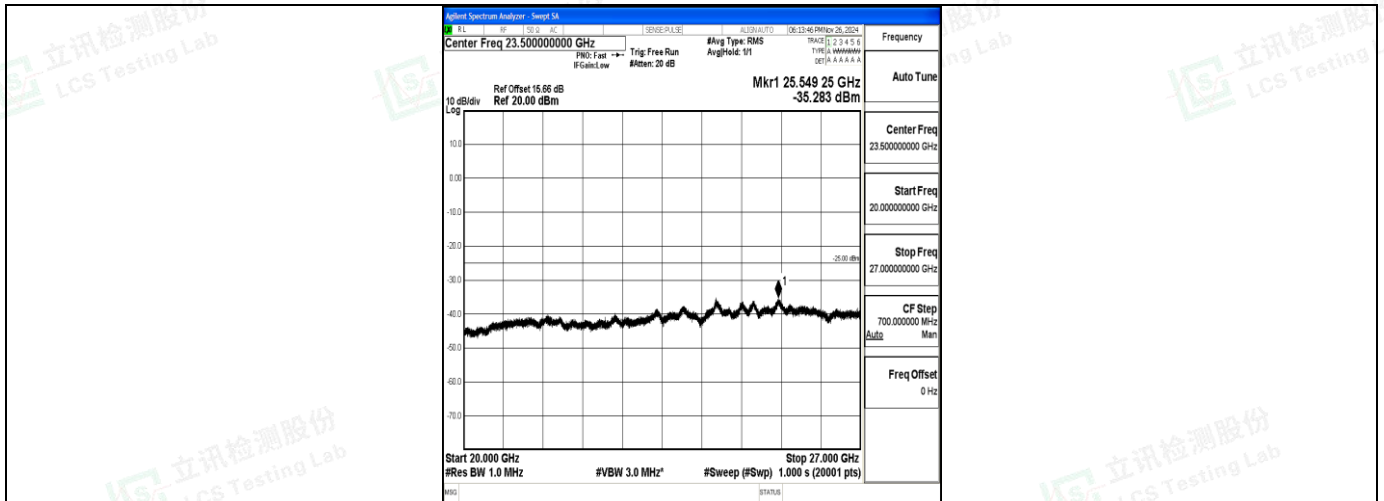

Band7_15MHz_QPSK_21100_1RB#0_20000~27000_20000~27000

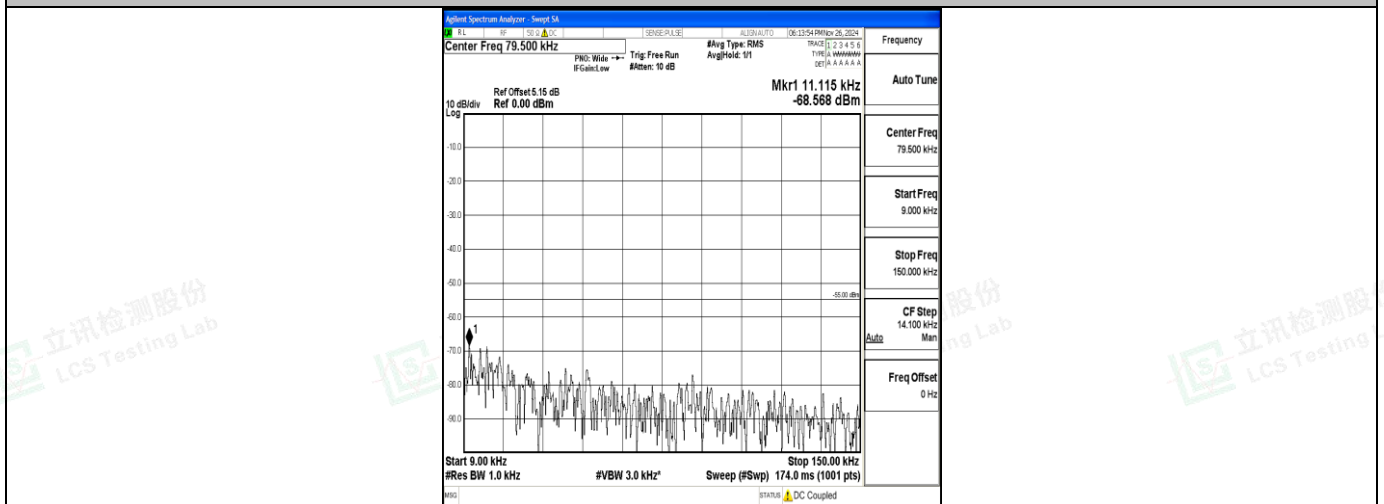


Band7_15MHz_16QAM_21100_1RB#0_0.009~0.15_0.009~0.15

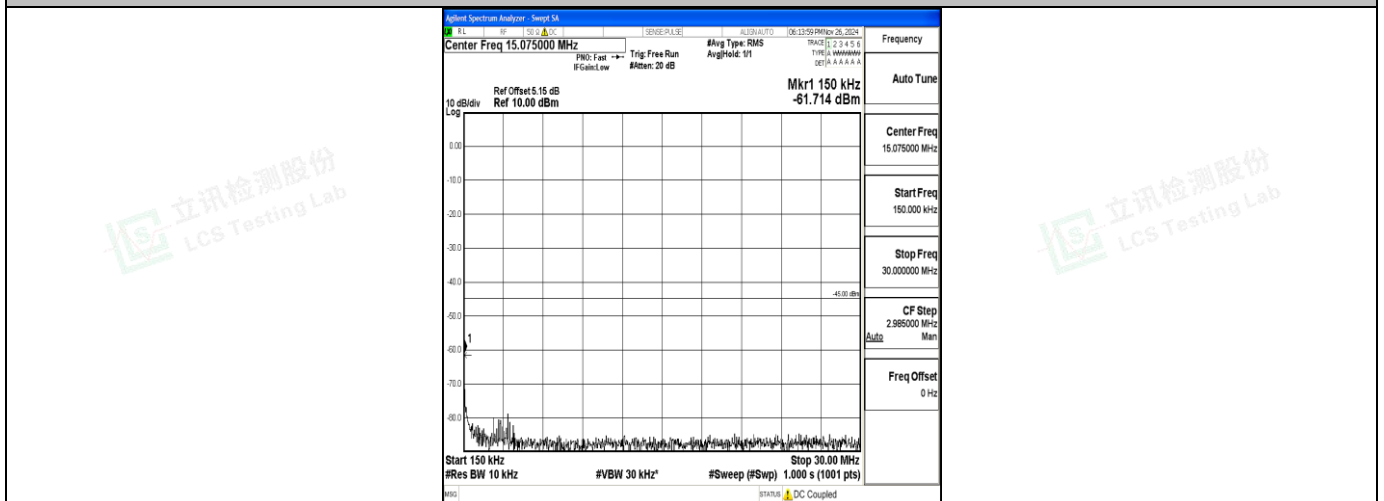


Band7_15MHz_16QAM_21100_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

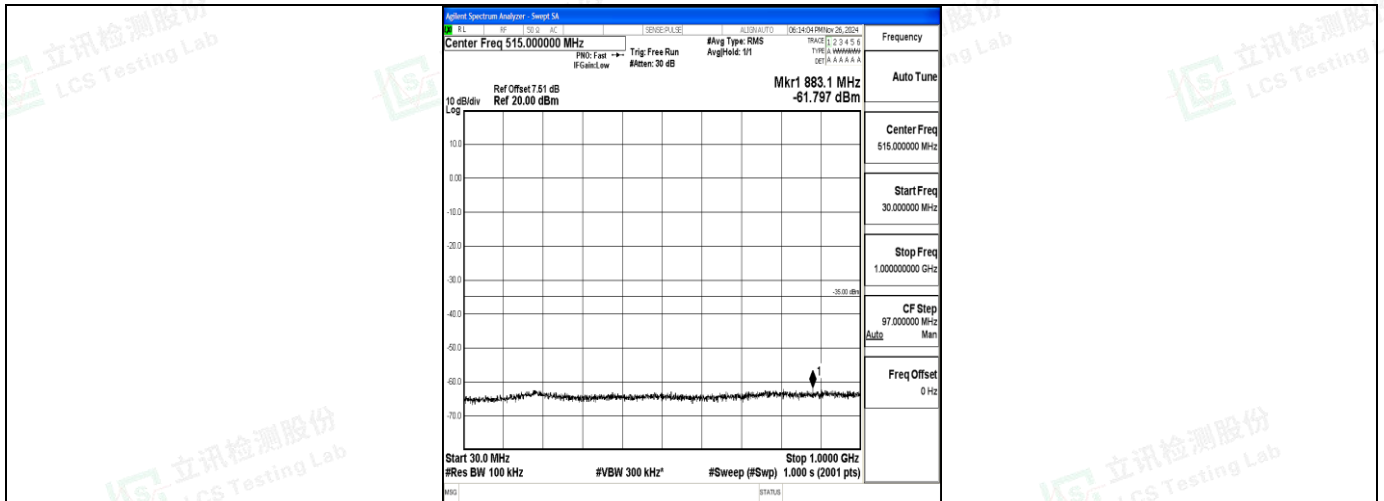

Band7_15MHz_16QAM_21100_1RB#0_30~1000_30~1000

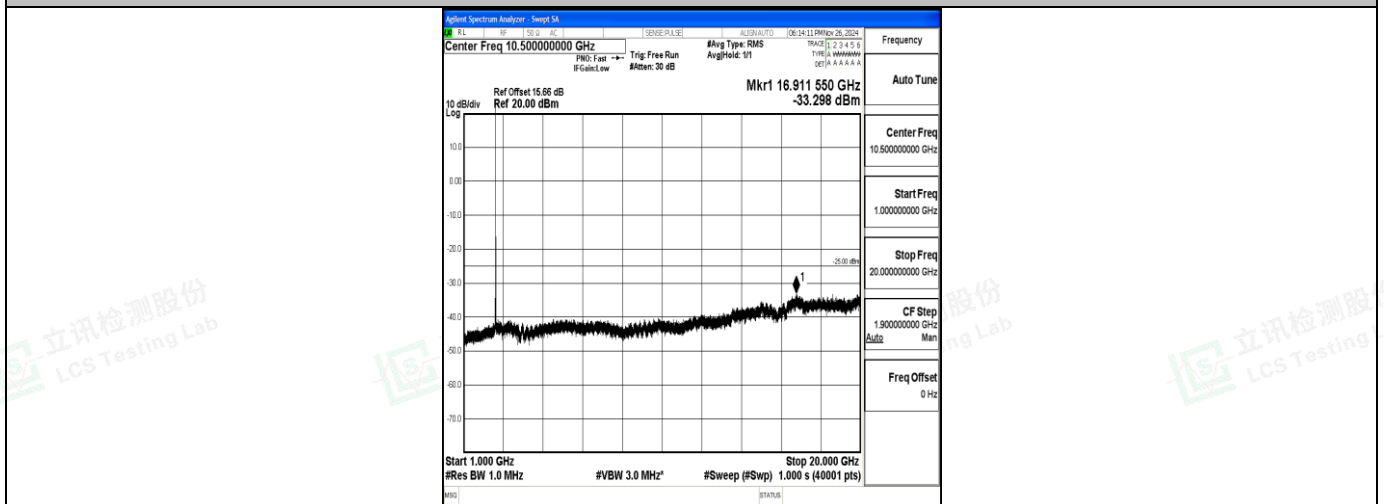


Band7_15MHz_16QAM_21100_1RB#0_1000~20000_1000~20000

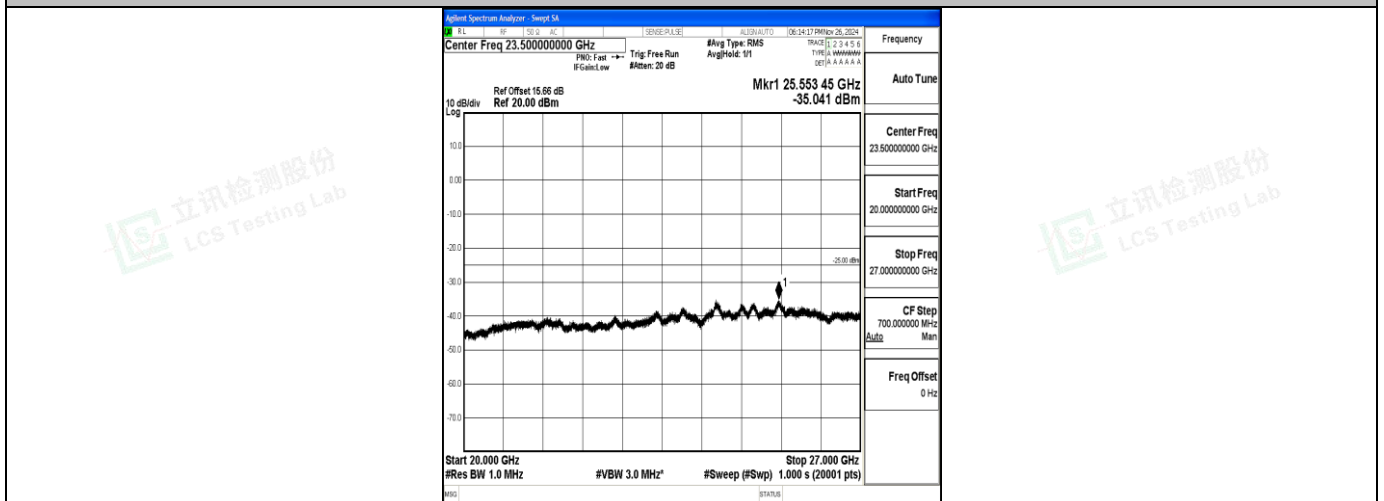


Band7_15MHz_16QAM_21100_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

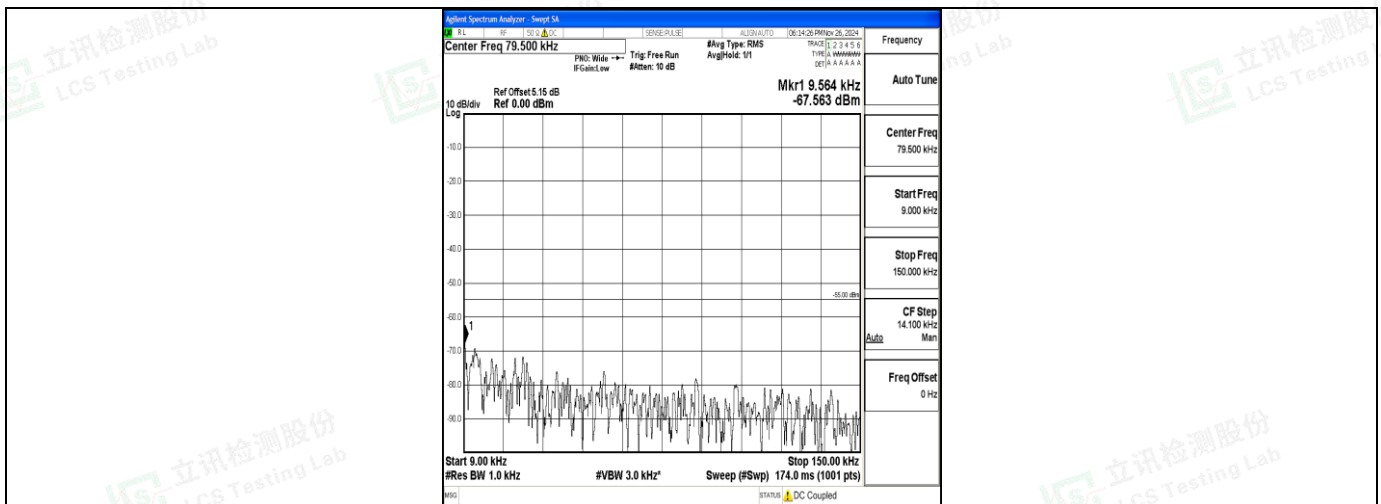

Band7_15MHz_QPSK_21375_1RB#0_0.009~0.15_0.009~0.15

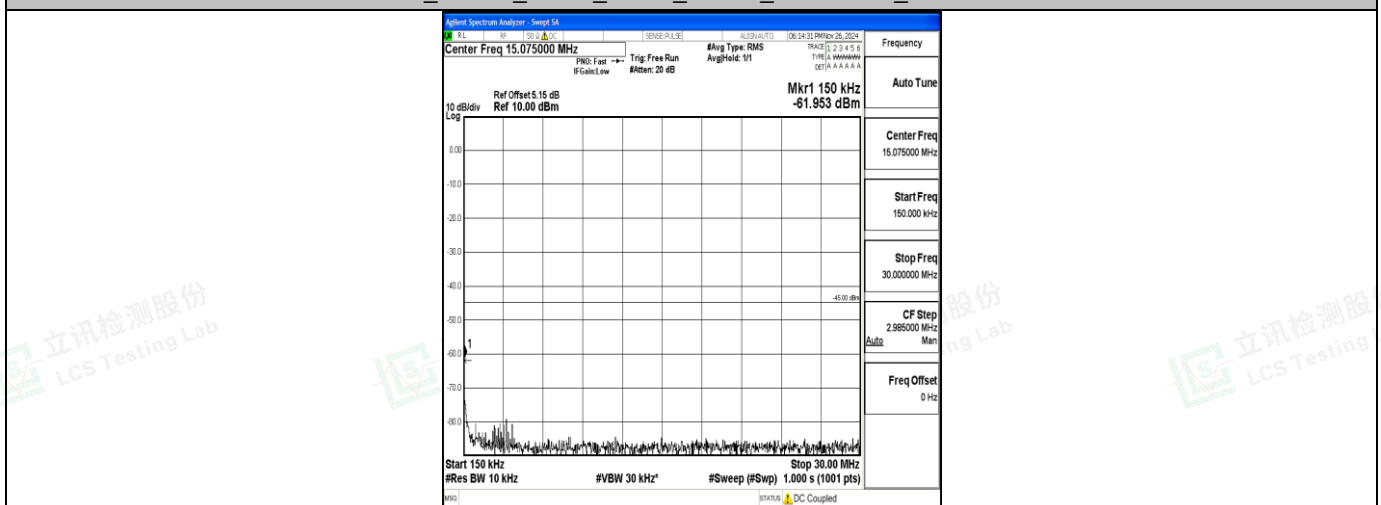

Band7_15MHz_QPSK_21375_1RB#0_0.15~30_0.15~30

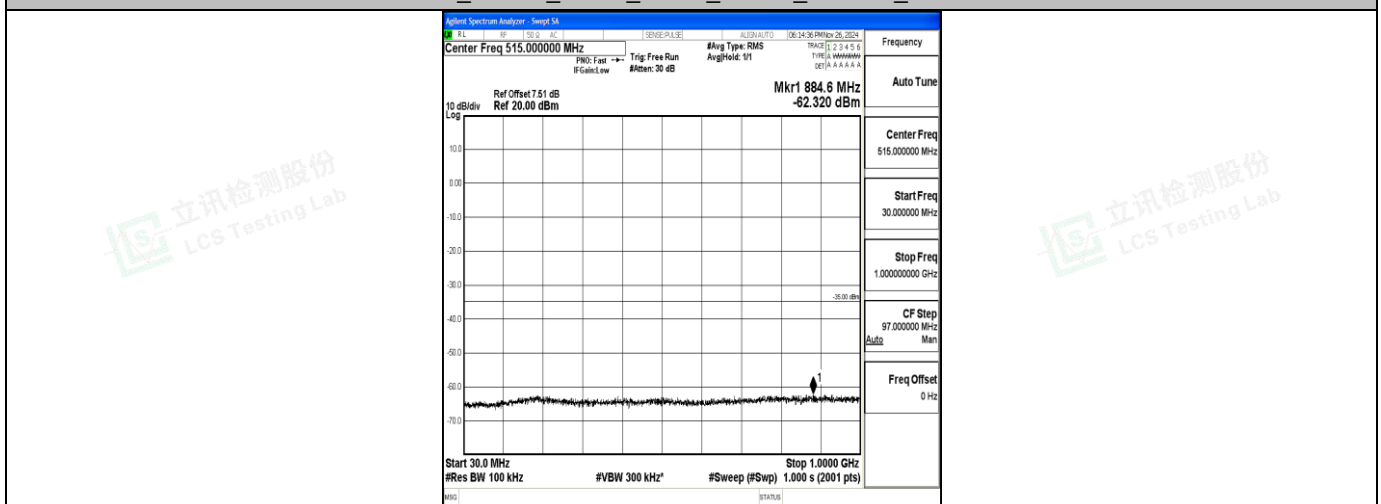

Band7	15MHz	QPSK	21375	1RB#0	30~1000	30~1000
-------	-------	------	-------	-------	---------	---------



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity