


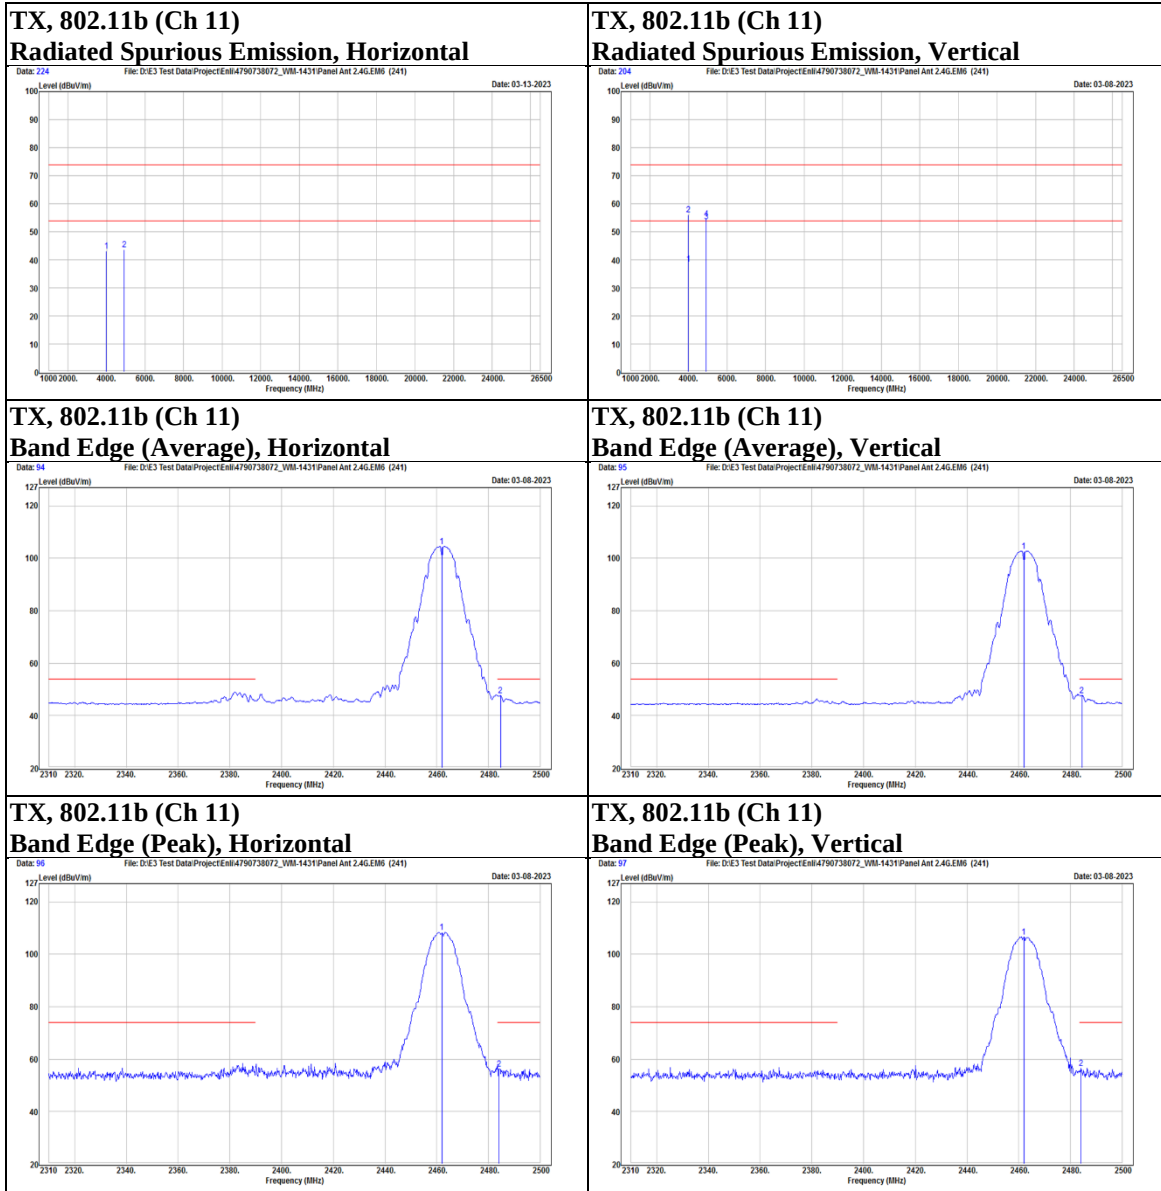

Mode	802.11g	Channel	1
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2388.66	46.21	18.87	65.08	74	-8.92	PK
		2389.99	34.83	18.86	53.69	54	-0.31	AVG
	@	2412	88.23	18.88	107.11	N/A	N/A	PK
	@	2412	80.53	18.88	99.41	N/A	N/A	AVG
	*	3992	43.77	0.05	43.82	74	-30.18	PK
	*	4824	36.92	2.16	39.08	74	-34.92	PK
Vertical		2388.66	45.89	15.87	61.76	74	-12.24	PK
		2389.99	33.58	15.86	49.44	54	-4.56	AVG
	@	2412	88.57	15.88	104.45	N/A	N/A	PK
	@	2412	80.06	15.88	95.94	N/A	N/A	AVG
		3992	56.99	0.05	57.04	74	-16.96	PK
		3992	39.41	0.05	39.46	54	-14.54	AVG
	*	4824	45.43	2.16	47.59	74	-26.41	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

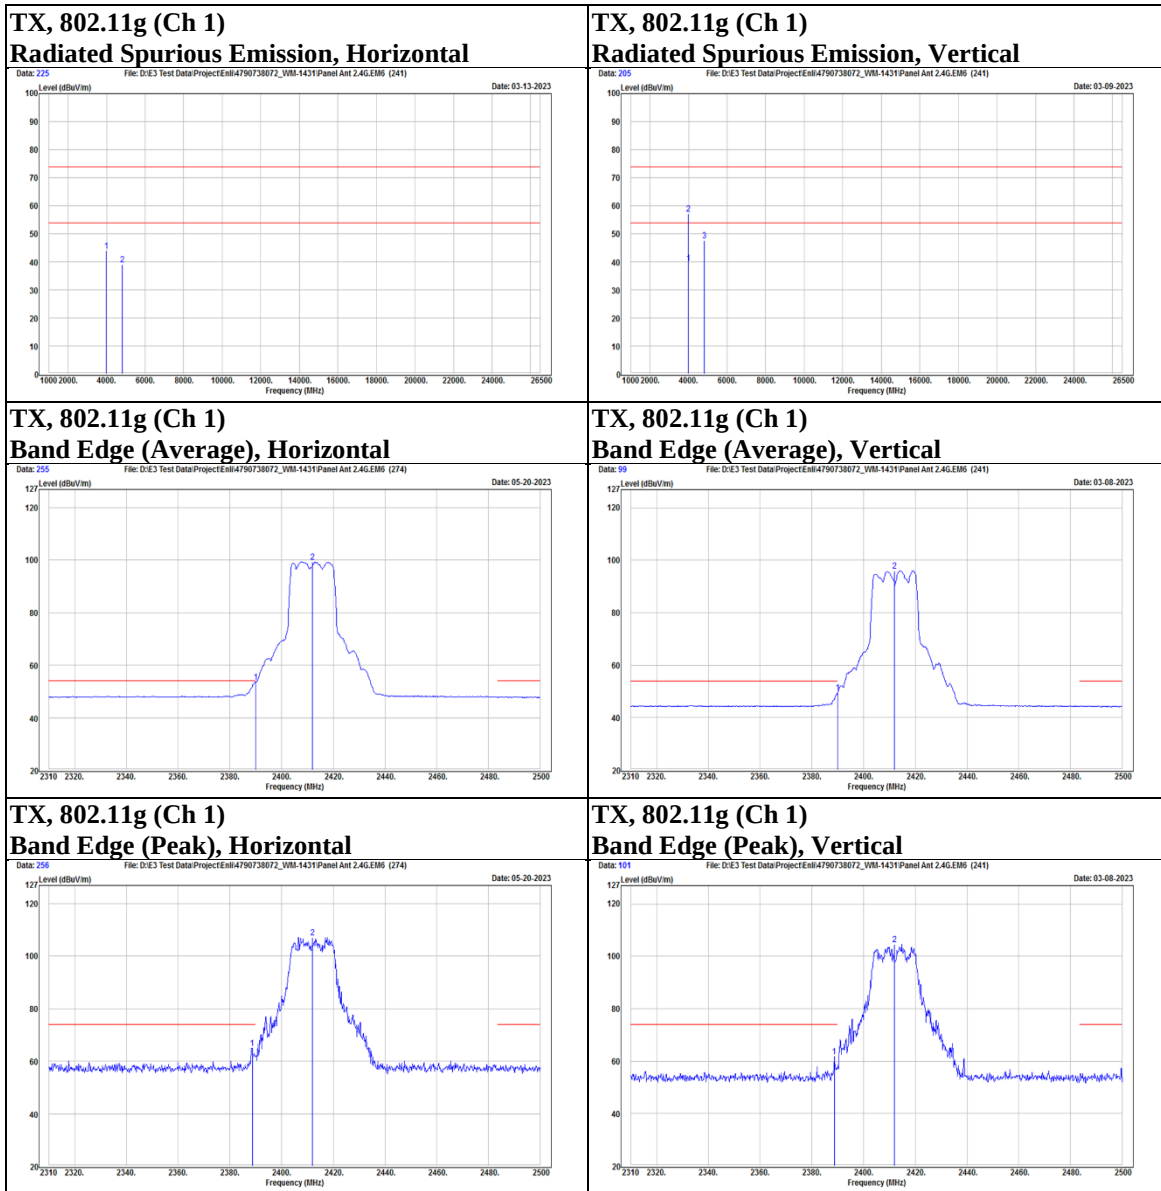

Mode	802.11g	Channel	2
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.04	37.48	15.86	53.34	54	-0.66	AVG
		2389.8	54.67	15.86	70.53	74	-3.47	PK
	@	2417	94.75	15.89	110.64	N/A	N/A	PK
	@	2417	86.74	15.89	102.63	N/A	N/A	AVG
		3992	42.05	0.05	42.1	74	-31.9	PK
	*	4834	38.22	2.17	40.39	74	-33.61	PK
Vertical		2389.42	47.38	15.86	63.24	74	-10.76	PK
		2389.8	33.53	15.86	49.39	54	-4.61	AVG
	@	2417	90.81	15.89	106.7	N/A	N/A	PK
	@	2417	82.35	15.89	98.24	N/A	N/A	AVG
		3992	56.19	0.05	56.24	74	-17.76	PK
		3992	38.8	0.05	38.85	54	-15.15	AVG
	*	4834	47.46	2.17	49.63	74	-24.37	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

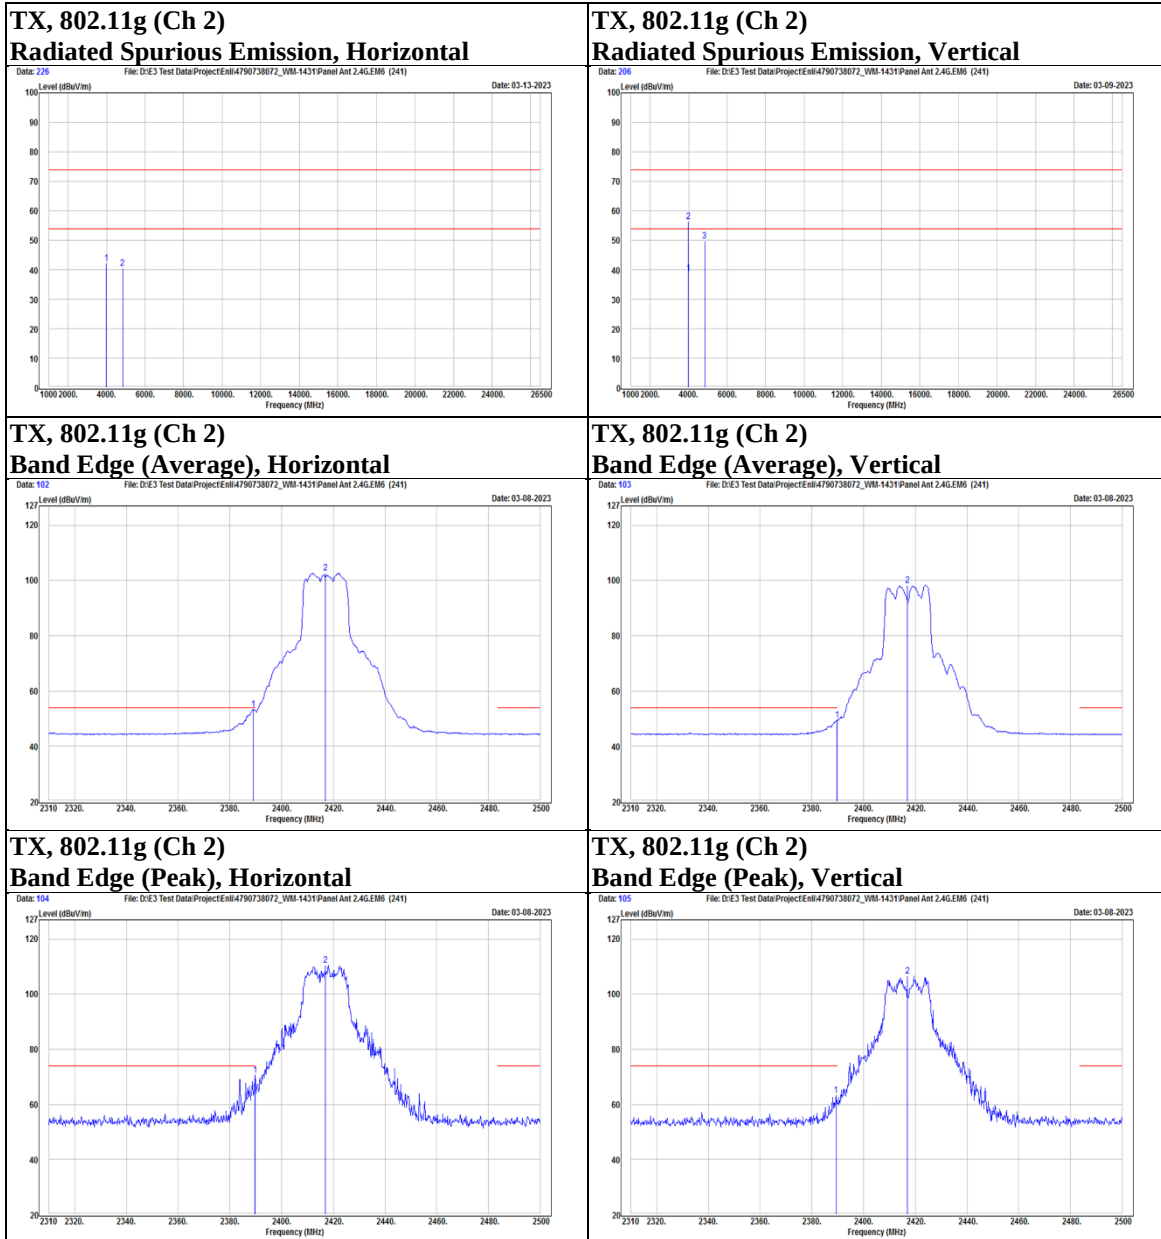

Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.8	49.97	15.86	65.83	74	-8.17	PK
		2389.99	37.57	15.86	53.43	54	-0.57	AVG
	@	2437	96.8	15.97	112.77	N/A	N/A	PK
	@	2437	88.95	15.97	104.92	N/A	N/A	AVG
		2483.66	47.83	15.81	63.64	74	-10.36	PK
		2483.85	32.95	15.81	48.76	54	-5.24	AVG
	*	3992	41.59	0.05	41.64	74	-32.36	PK
	*	4874	42.34	2.2	44.54	74	-29.46	PK
Vertical		2388.85	44.16	15.86	60.02	74	-13.98	PK
		2389.99	33	15.86	48.86	54	-5.14	AVG
	@	2437	94.68	15.97	110.65	N/A	N/A	PK
	@	2437	85.84	15.97	101.81	N/A	N/A	AVG
		2483.85	31.24	15.81	47.05	54	-6.95	AVG
		2484.61	42.76	15.8	58.56	74	-15.44	PK
		3992	58.03	0.05	58.08	74	-15.92	PK
		3992	40.68	0.05	40.73	54	-13.27	AVG
	*	4874	45.41	2.2	47.61	74	-26.39	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

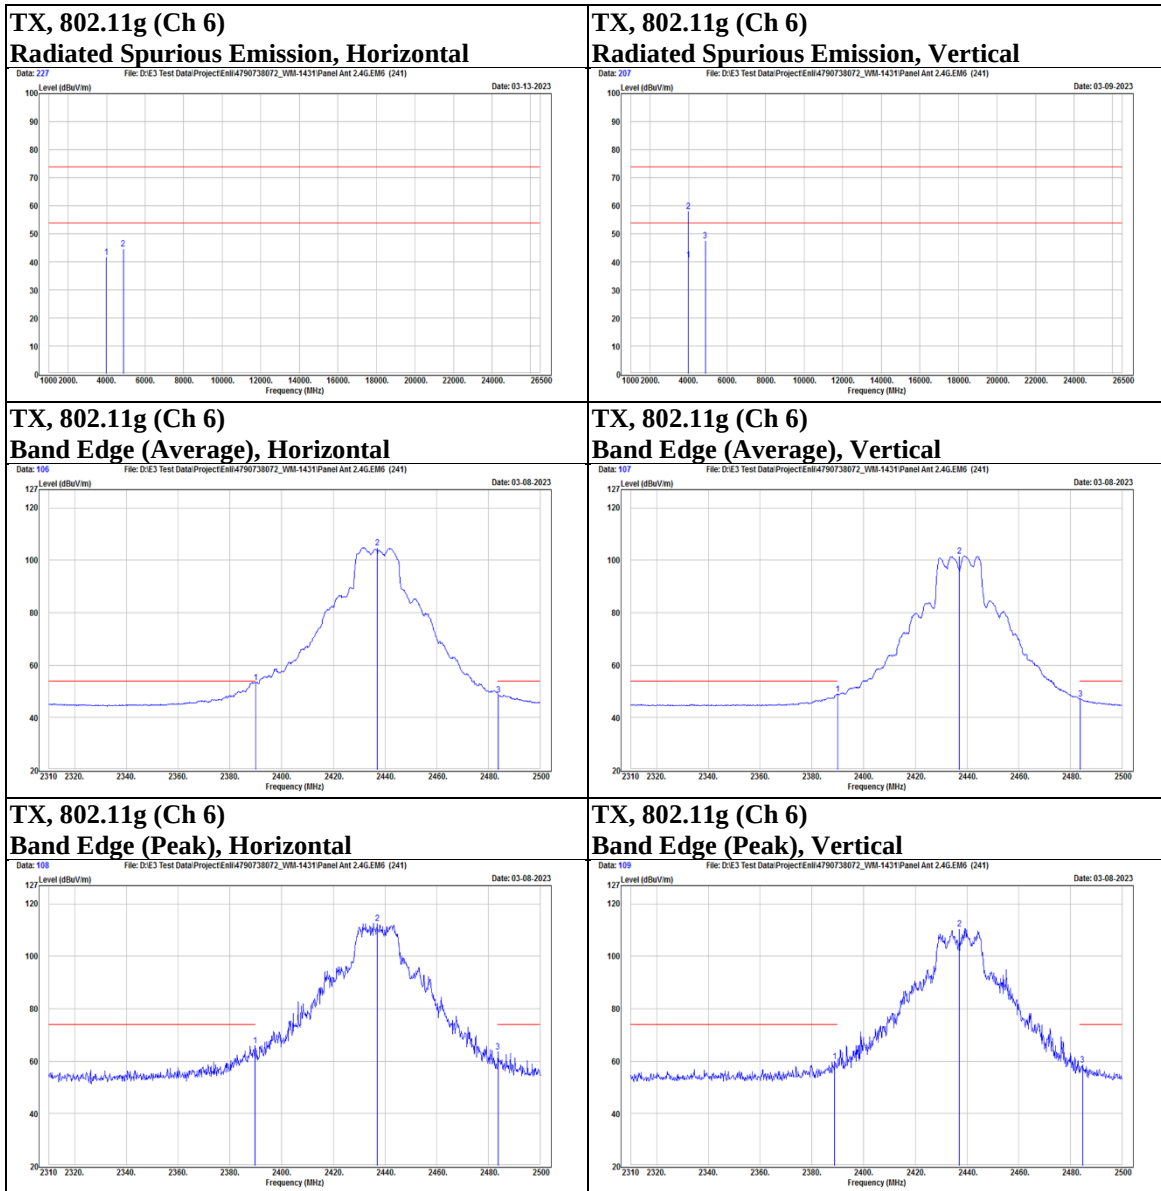

Mode	802.11g	Channel	11
------	---------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	88.35	18.95	107.3	N/A	N/A	PK
	@	2462	80.34	18.95	99.29	N/A	N/A	AVG
		2483.66	34.71	18.81	53.52	54	-0.48	AVG
		2483.85	51.25	18.81	70.06	74	-3.94	PK
	*	3992	42.86	0.05	42.91	74	-31.09	PK
	*	4924	35.79	2.25	38.04	74	-35.96	PK
Vertical	@	2462	89.9	15.95	105.85	N/A	N/A	PK
	@	2462	81.22	15.95	97.17	N/A	N/A	AVG
		2483.66	46.82	15.81	62.63	74	-11.37	PK
		2483.66	35.65	15.81	51.46	54	-2.54	AVG
		3992	57.22	0.05	57.27	74	-16.73	PK
		3992	39.98	0.05	40.03	54	-13.97	AVG
	*	4924	37.15	2.25	39.4	74	-34.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

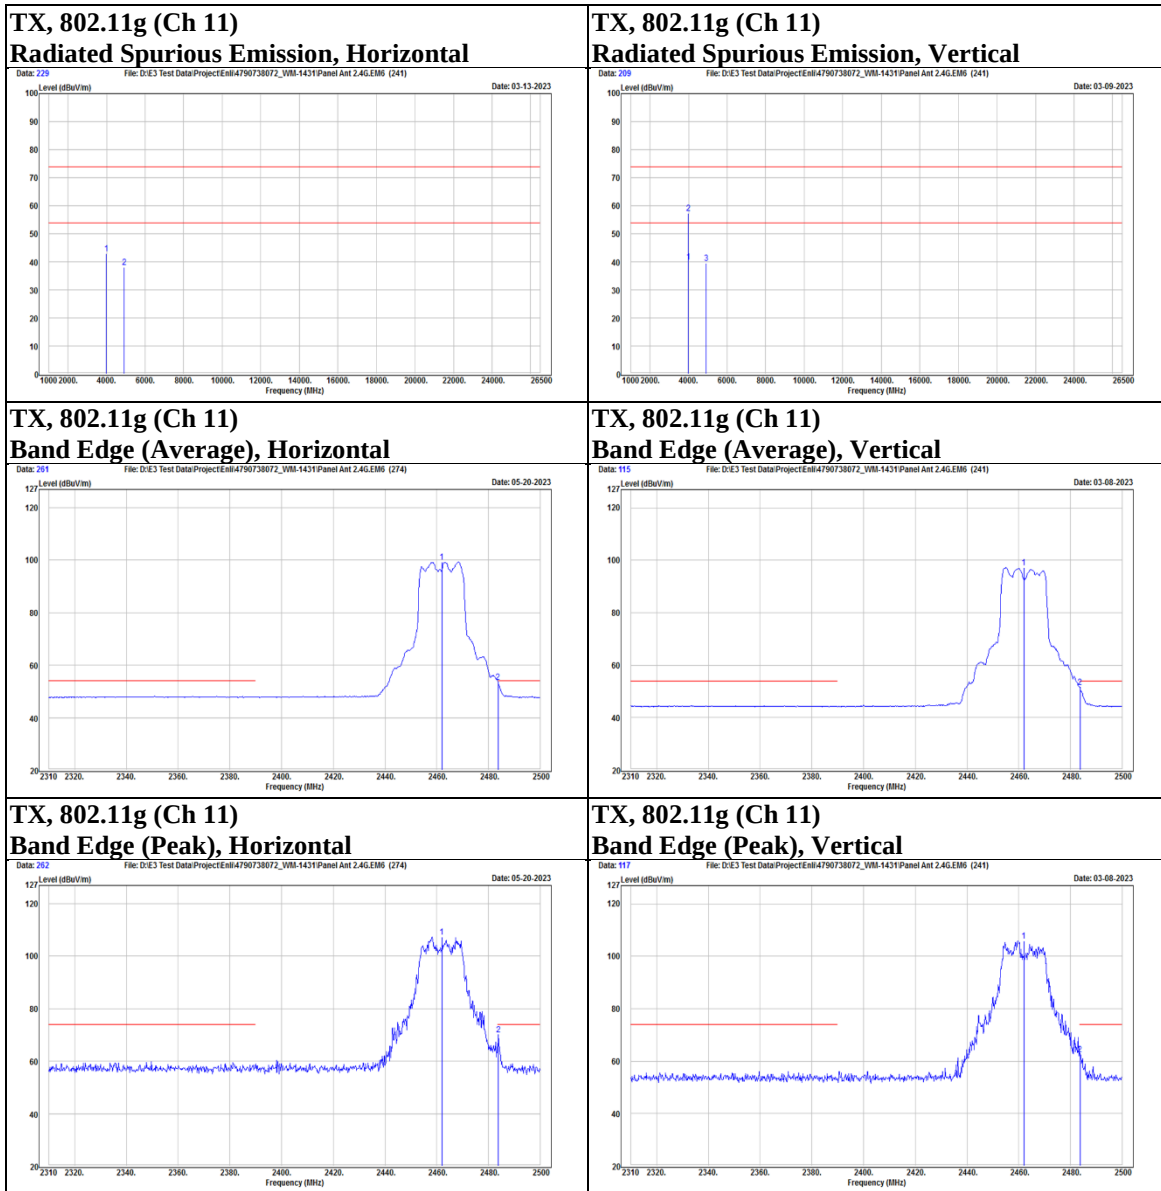

Mode	802.11ax(HE20)	Channel	1
------	----------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2388.28	45.23	18.87	64.1	74	-9.9	PK
		2389.42	34.46	18.86	53.32	54	-0.68	AVG
	@	2412	85.86	18.88	104.74	N/A	N/A	PK
	@	2412	77.46	18.88	96.34	N/A	N/A	AVG
	*	3992	42.67	0.05	42.72	74	-31.28	PK
	*	4824	35.99	2.16	38.15	74	-35.85	PK
Vertical		2389.61	48.73	15.86	64.59	74	-9.41	PK
		2389.8	33.41	15.86	49.27	54	-4.73	AVG
	@	2412	86.92	15.88	102.8	N/A	N/A	PK
	@	2412	78.16	15.88	94.04	N/A	N/A	AVG
		3992	56.82	0.05	56.87	74	-17.13	PK
		3992	39.75	0.05	39.8	54	-14.2	AVG
	*	4824	39.02	2.16	41.18	74	-32.82	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

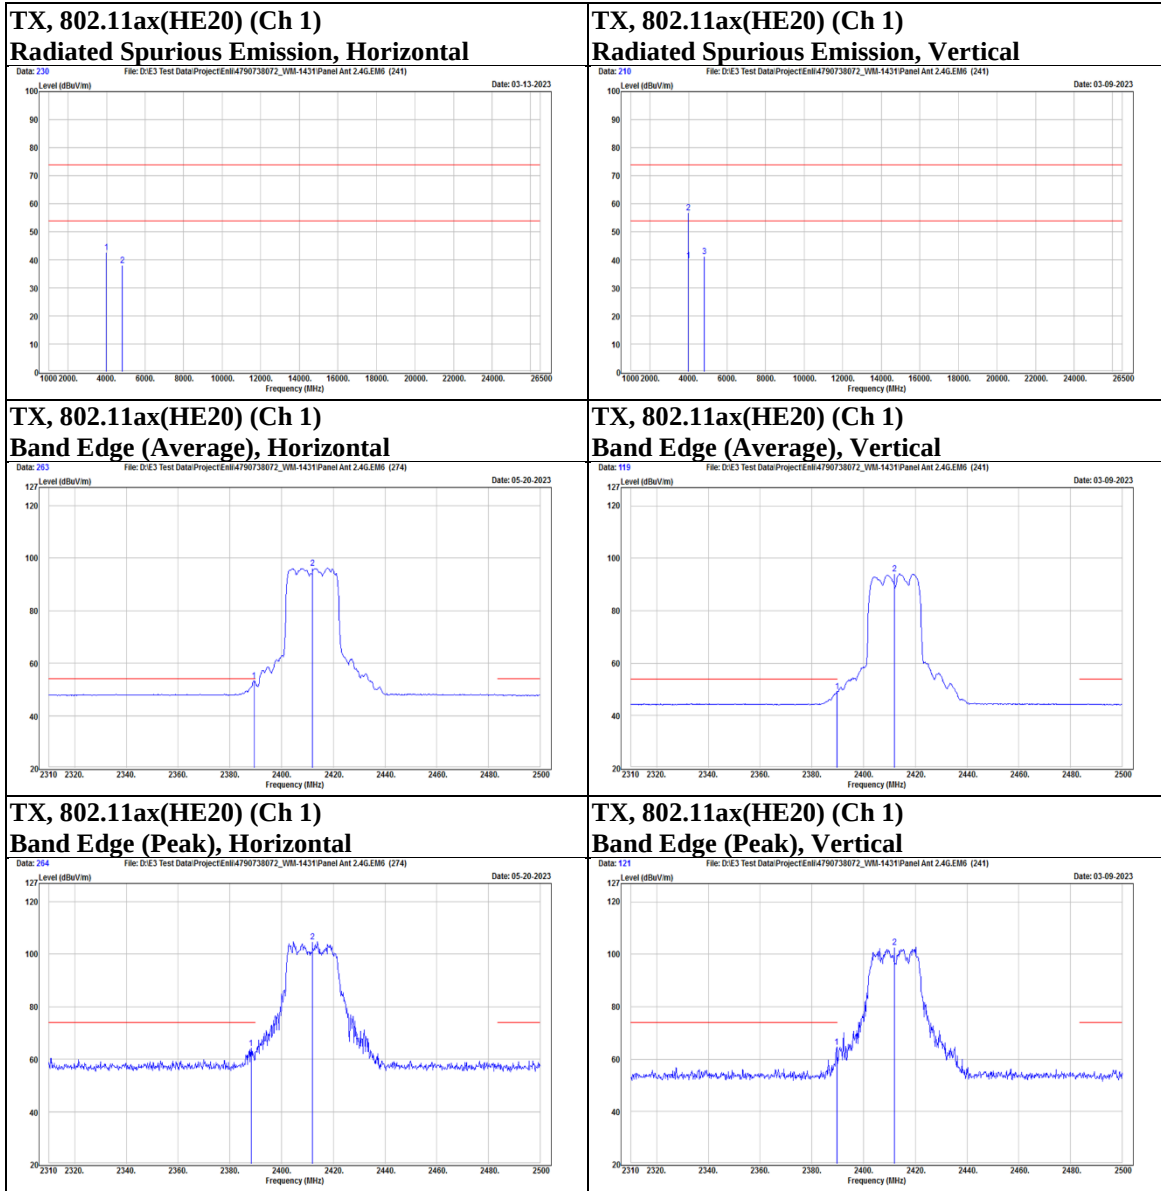

Mode	802.11ax(HE20)	Channel	2
------	----------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2389.99	43.41	18.86	62.27	74	-11.73	PK
		2389.99	34.63	18.86	53.49	54	-0.51	AVG
	@	2417	89.78	18.89	108.67	N/A	N/A	PK
	@	2417	81.31	18.89	100.2	N/A	N/A	AVG
	*	3992	42.27	0.05	42.32	74	-31.68	PK
	*	4834	38.26	2.17	40.43	74	-33.57	PK
Vertical		2389.42	45.61	15.86	61.47	74	-12.53	PK
		2389.99	34.19	15.86	50.05	54	-3.95	AVG
	@	2417	89.4	15.89	105.29	N/A	N/A	PK
	@	2417	81.01	15.89	96.9	N/A	N/A	AVG
		3992	57.26	0.05	57.31	74	-16.69	PK
		3992	39.9	0.05	39.95	54	-14.05	AVG
	*	4834	43.97	2.17	46.14	74	-27.86	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

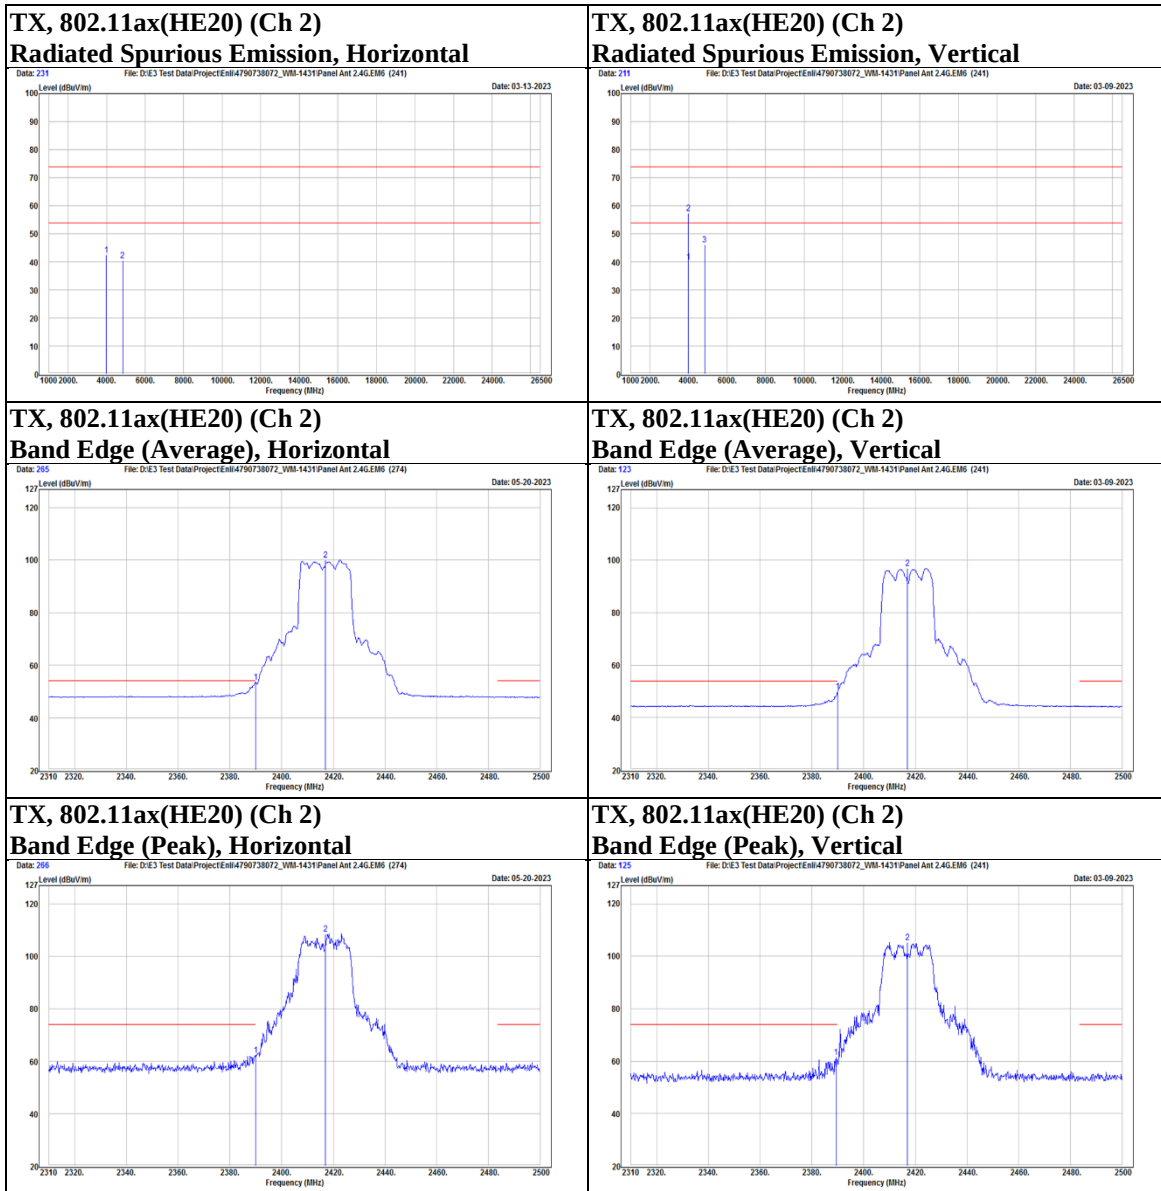

Mode	802.11ax(HE20)	Channel	6
------	----------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2388.47	48.8	15.87	64.67	74	-9.33	PK
		2389.42	37.61	15.86	53.47	54	-0.53	AVG
	@	2437	96.51	15.97	112.48	N/A	N/A	PK
	@	2437	88.1	15.97	104.07	N/A	N/A	AVG
		2486.32	33.79	15.79	49.58	54	-4.42	AVG
		2487.08	45.54	15.79	61.33	74	-12.67	PK
	*	3992	42.78	0.05	42.83	74	-31.17	PK
	*	4874	41.6	2.2	43.8	74	-30.2	PK
Vertical		2388.47	44.52	15.87	60.39	74	-13.61	PK
		2389.99	33.76	15.86	49.62	54	-4.38	AVG
	@	2437	94.24	15.97	110.21	N/A	N/A	PK
	@	2437	84.75	15.97	100.72	N/A	N/A	AVG
		2483.66	43.75	15.81	59.56	74	-14.44	PK
		2483.66	32.06	15.81	47.87	54	-6.13	AVG
		3992	56.81	0.05	56.86	74	-17.14	PK
		3992	39.61	0.05	39.66	54	-14.34	AVG
	*	4874	45.03	2.2	47.23	74	-26.77	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

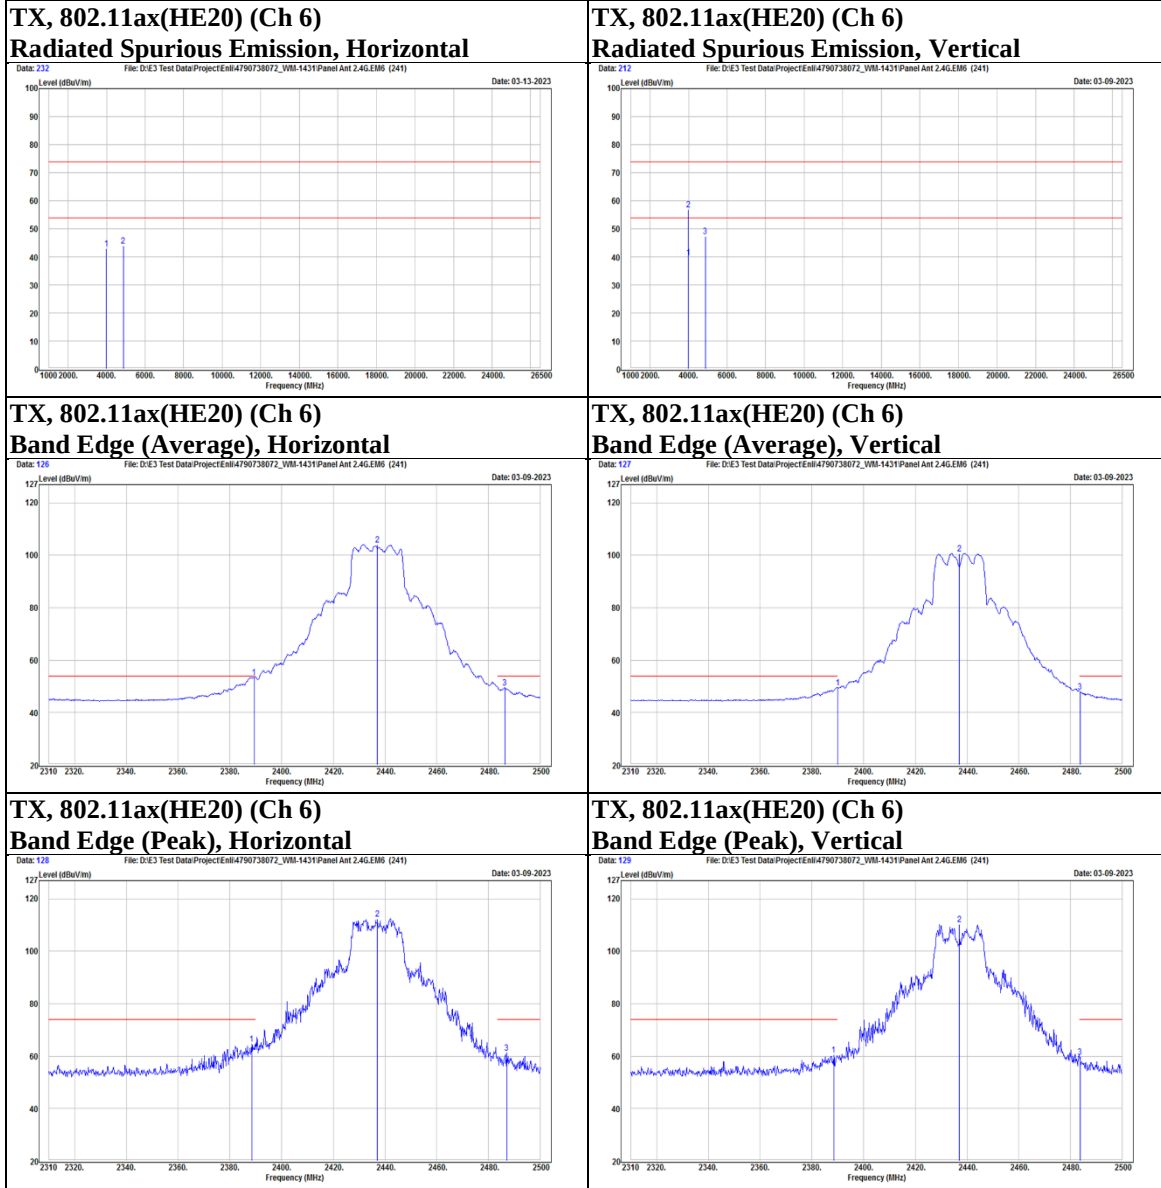

Mode	802.11ax(HE20)	Channel	11
------	----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2462	86.64	18.95	105.59	N/A	N/A	PK
	@	2462	78.26	18.95	97.21	N/A	N/A	AVG
		2483.66	34.48	18.81	53.29	54	-0.71	AVG
		2484.8	47.38	18.8	66.18	74	-7.82	PK
	*	3992	44.2	0.05	44.25	74	-29.75	PK
	*	4924	36.22	2.25	38.47	74	-35.53	PK
Vertical	@	2462	89.55	15.95	105.5	N/A	N/A	PK
	@	2462	79.33	15.95	95.28	N/A	N/A	AVG
		2483.66	36.06	15.81	51.87	54	-2.13	AVG
		2485.18	46.35	15.8	62.15	74	-11.85	PK
		3992	56	0.05	56.05	74	-17.95	PK
		3992	38.7	0.05	38.75	54	-15.25	AVG
	*	4924	36.65	2.25	38.9	74	-35.1	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

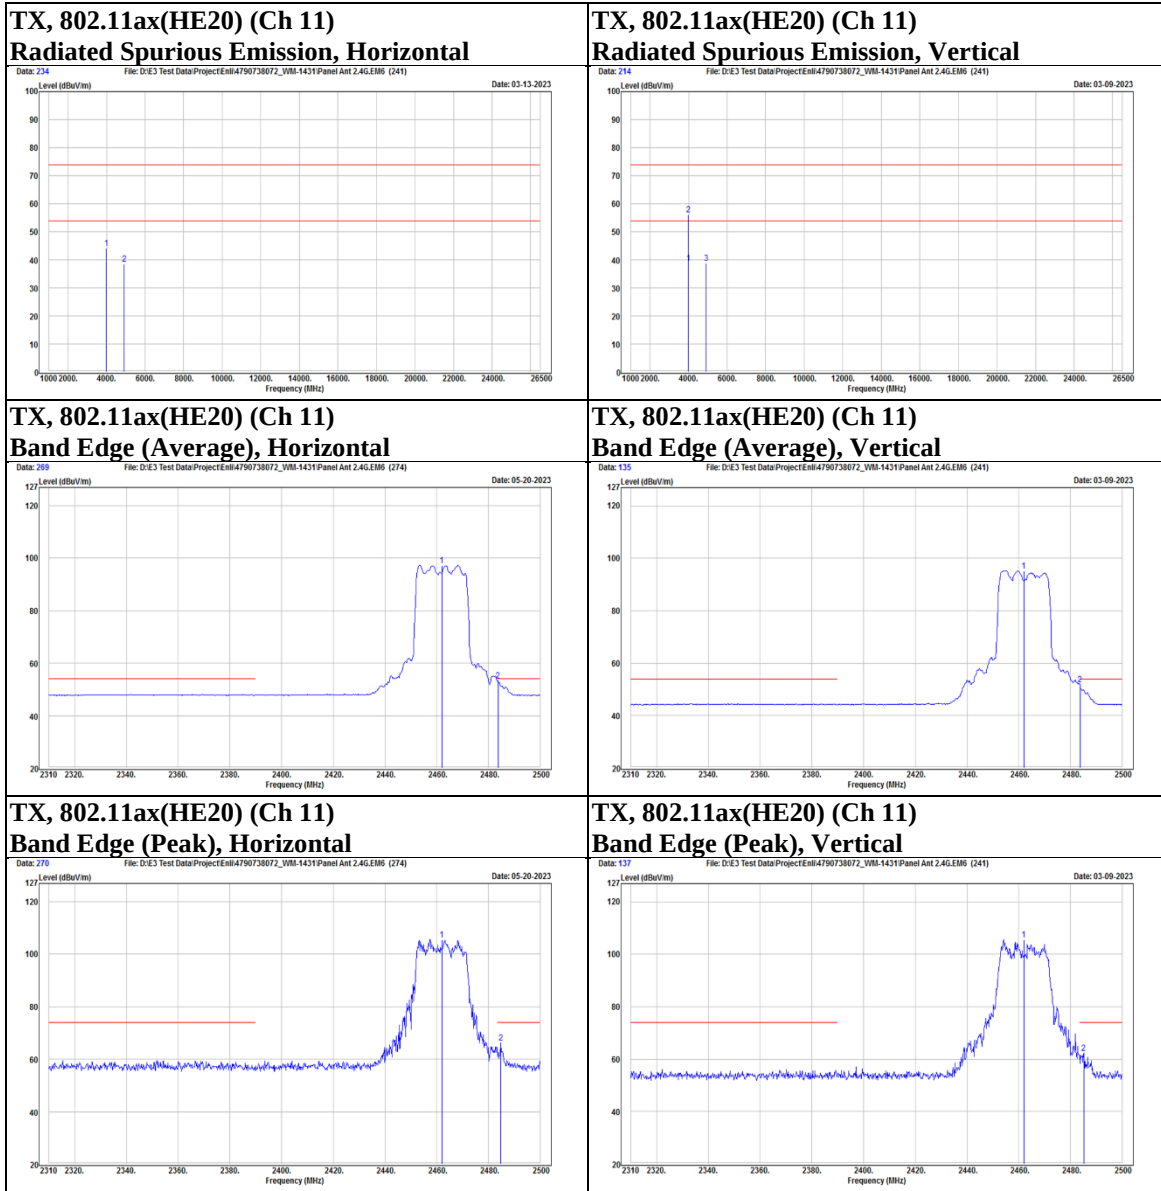

Mode	802.11ax(HE40)	Channel	3
------	----------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2381.63	45.03	18.88	63.91	74	-10.09	PK
		2388.28	34.55	18.87	53.42	54	-0.58	AVG
	@	2422	83.79	18.91	102.7	N/A	N/A	PK
	@	2422	74.85	18.91	93.76	N/A	N/A	AVG
	*	3992	42.48	0.05	42.53	74	-31.47	PK
	*	4844	35.23	2.18	37.41	74	-36.59	PK
Vertical		2386.95	46.87	15.87	62.74	74	-11.26	PK
		2389.99	33.34	15.86	49.2	54	-4.8	AVG
	@	2422	84.46	15.91	100.37	N/A	N/A	PK
	@	2422	75.41	15.91	91.32	N/A	N/A	AVG
		3992	56.81	0.05	56.86	74	-17.14	PK
		3992	39.51	0.05	39.56	54	-14.44	AVG
	*	4844	36.01	2.18	38.19	74	-35.81	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

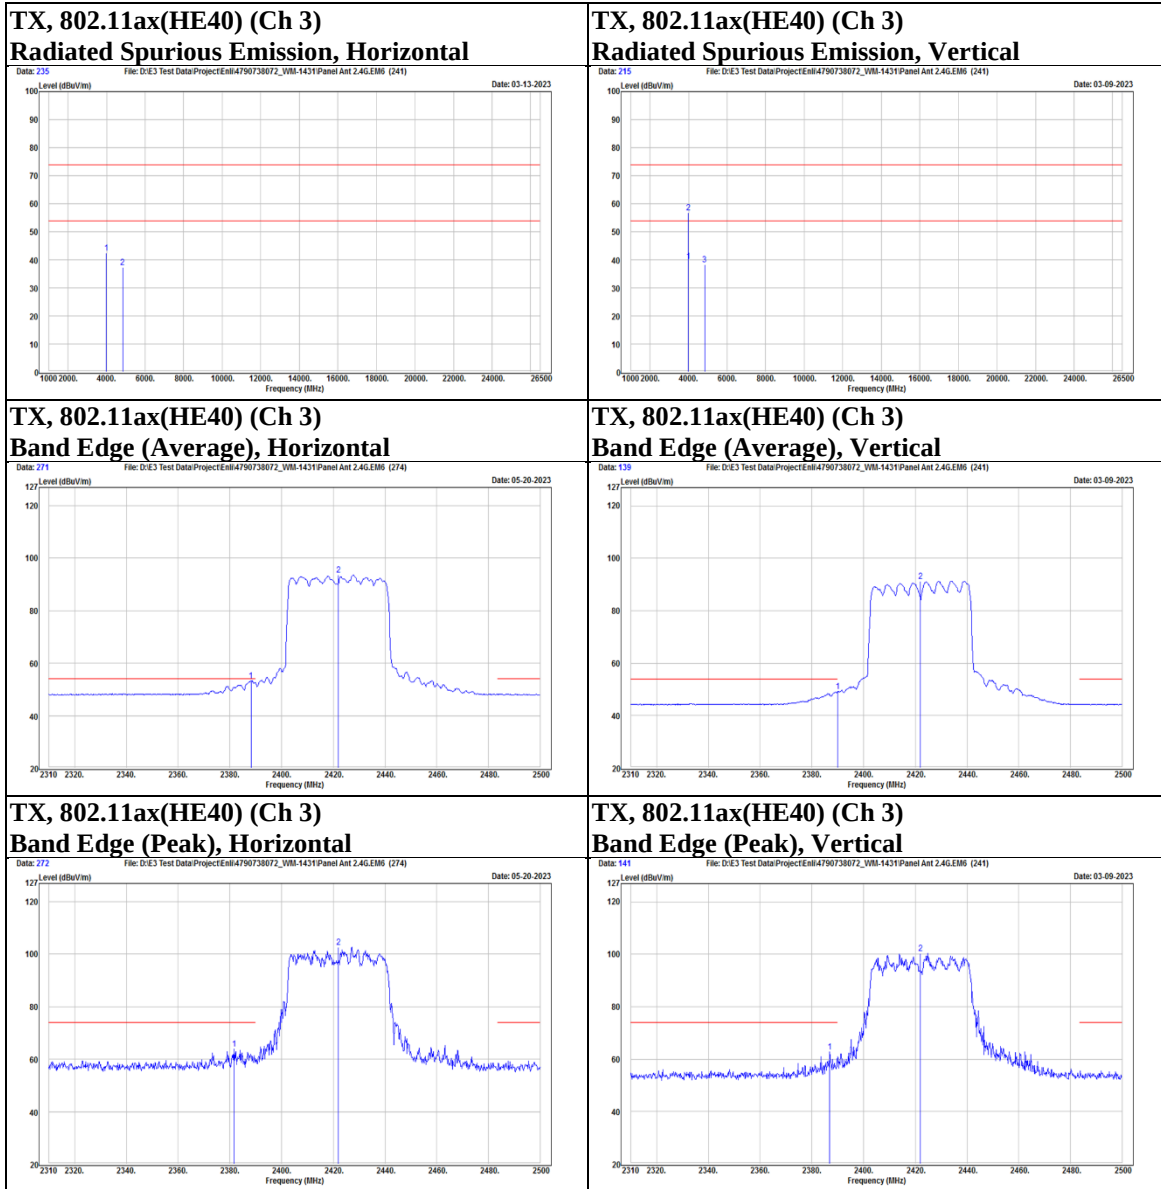

Mode	802.11ax(HE40)	Channel	6
------	----------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		2387.9	52.33	15.87	68.2	74	-5.8	PK
		2389.61	37.71	15.86	53.57	54	-0.43	AVG
	@	2437	90.86	15.97	106.83	N/A	N/A	PK
	@	2437	81.2	15.97	97.17	N/A	N/A	AVG
		2485.75	46.88	15.79	62.67	74	-11.33	PK
		2486.13	34.89	15.79	50.68	54	-3.32	AVG
	*	3992	43.59	0.05	43.64	74	-30.36	PK
	*	4874	35.65	2.2	37.85	74	-36.15	PK
Vertical		2389.61	46.24	15.86	62.1	74	-11.9	PK
		2389.99	33.16	15.86	49.02	54	-4.98	AVG
	@	2437	87.98	15.97	103.95	N/A	N/A	PK
	@	2437	77.64	15.97	93.61	N/A	N/A	AVG
		2483.66	47.78	15.81	63.59	74	-10.41	PK
		2483.66	33.65	15.81	49.46	54	-4.54	AVG
		3992	56.77	0.05	56.82	74	-17.18	PK
		3992	39.44	0.05	39.49	54	-14.51	AVG
	*	4874	37.17	2.2	39.37	74	-34.63	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

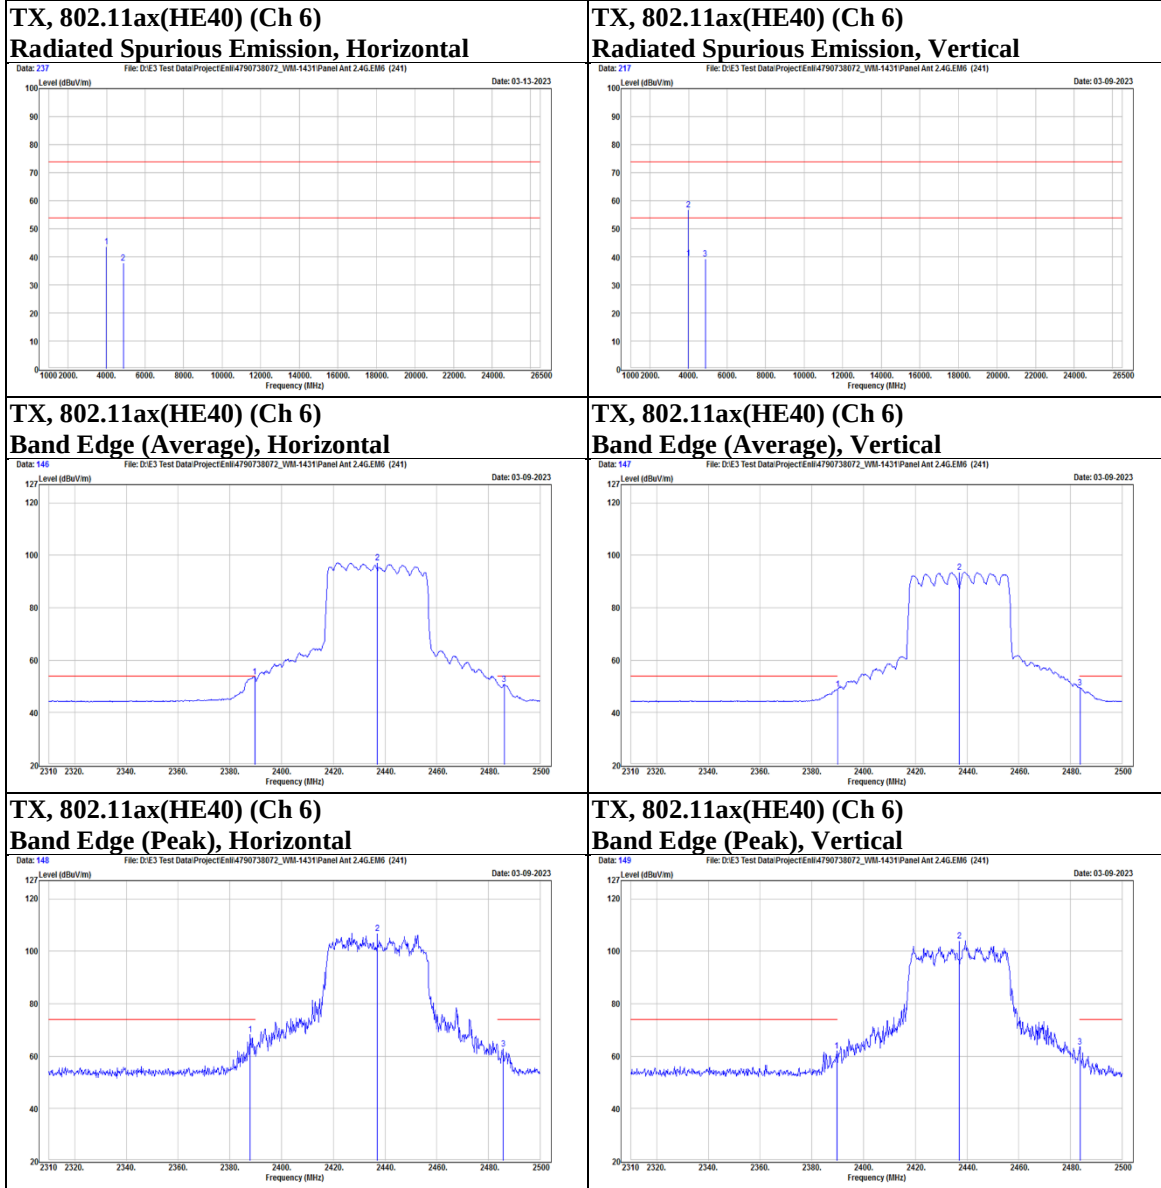

Mode	802.11ax(HE40)	Channel	9
------	----------------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	2452	83.36	19.01	102.37	N/A	N/A	PK
	@	2452	75.15	19.01	94.16	N/A	N/A	AVG
		2483.66	34.64	18.81	53.45	54	-0.55	AVG
		2484.04	43.04	18.81	61.85	74	-12.15	PK
	*	3992	42.3	0.05	42.35	74	-31.65	PK
	*	4904	36.24	2.23	38.47	74	-35.53	PK
Vertical	@	2452	86.34	16.01	102.35	N/A	N/A	PK
	@	2452	75.83	16.01	91.84	N/A	N/A	AVG
		2483.85	34.18	15.81	49.99	54	-4.01	AVG
		2489.17	47.48	15.78	63.26	74	-10.74	PK
		3992	57.86	0.05	57.91	74	-16.09	PK
		3992	40.54	0.05	40.59	54	-13.41	AVG
	*	4904	35.38	2.23	37.61	74	-36.39	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

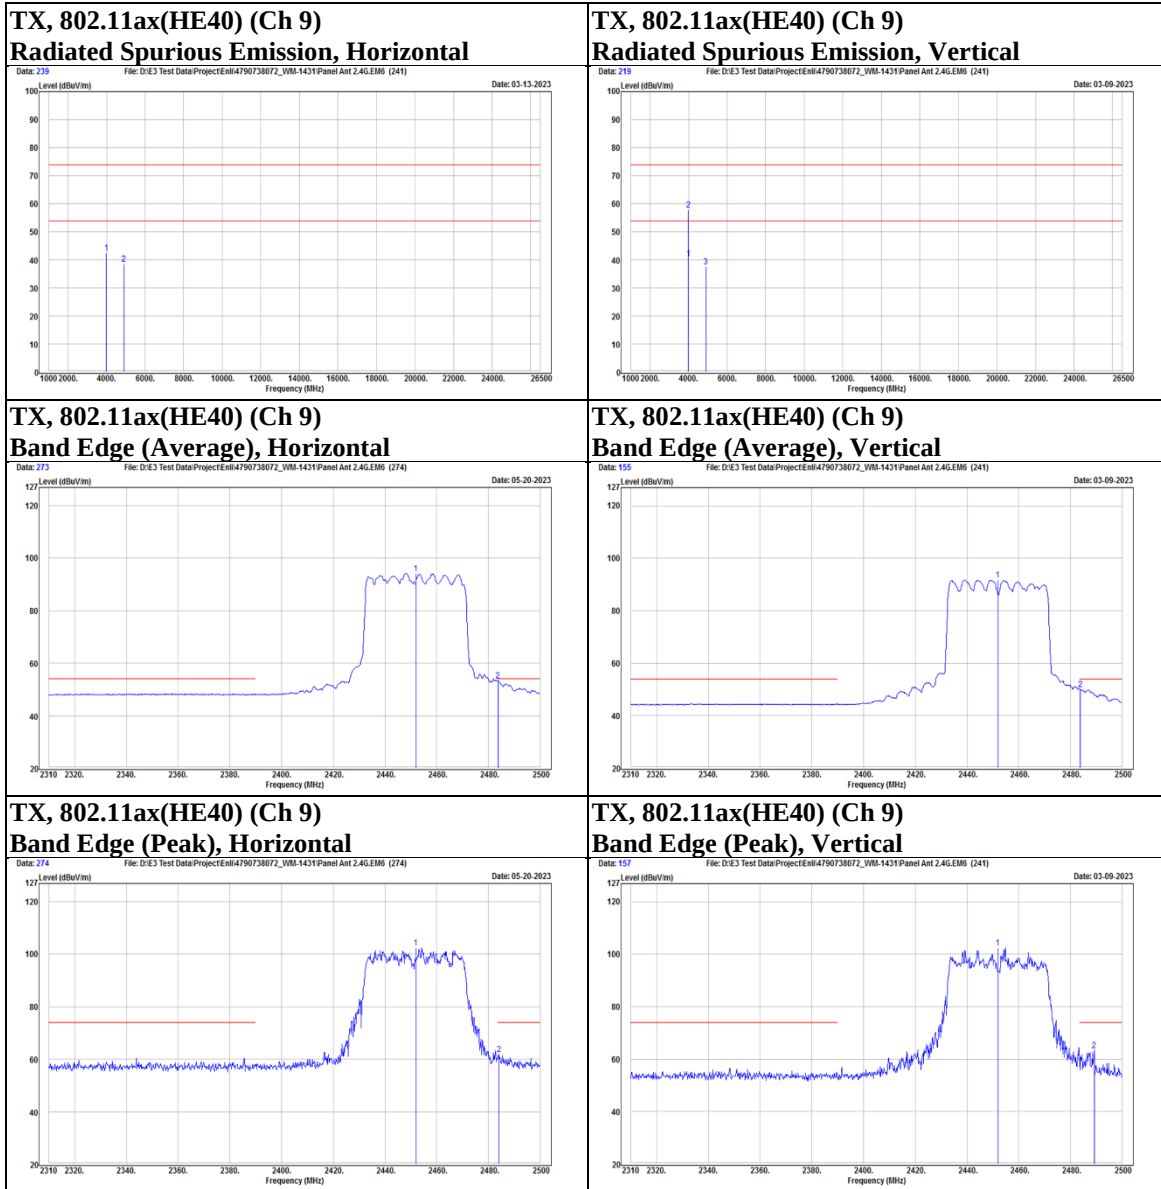


Below 1 GHz

Mode	802.11g	Channel	6
------	---------	---------	---

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		99.84	50.48	-16.35	34.13	43.5	-9.37	PK
		148.34	42.37	-11.95	30.42	43.5	-13.08	PK
		199.75	41.39	-14.2	27.19	43.5	-16.31	PK
		255.04	42.71	-12.29	30.42	46	-15.58	PK
		299.66	55.27	-10.7	44.57	46	-1.43	PK
		469.41	41.99	-5.78	36.21	46	-9.79	PK
Vertical		68.8	46.76	-13.92	32.84	40	-7.16	PK
		99.84	56.18	-16.35	39.83	43.5	-3.67	PK
		148.34	43.49	-11.95	31.54	43.5	-11.96	PK
		299.66	49.2	-10.7	38.5	46	-7.5	PK
		375.32	38.44	-8.64	29.8	46	-16.2	PK
		446.13	43.23	-6.31	36.92	46	-9.08	PK


TX, 802.11g (Ch 6)

Radiated Spurious Emission, Horizontal

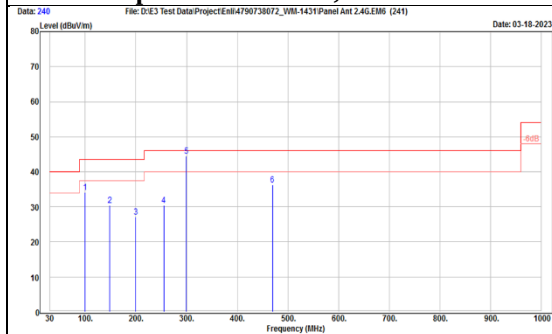

TX, 802.11g (Ch 6)

Radiated Spurious Emission, Vertical

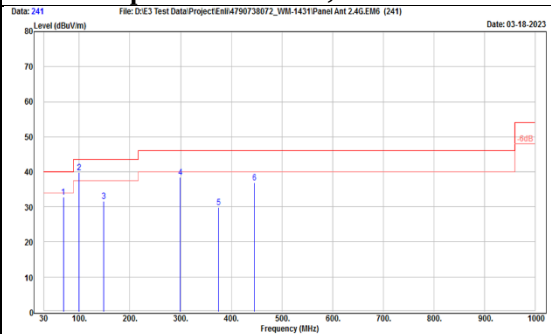

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

9 kHz ~ 30 MHz Data:

For 9 kHz to 30 MHz radiated emission have performed all modes of operation were investigated. The amplitude of spurious emissions attenuated more than 20 dB below the permissible value is not required to be report.

No non-compliance noted:

KDB 414788 D01 OATS and Chamber Correlation Justification

- Base on FCC 15.31 (f) (2): measurements may be performed at a distance closer than that specified in the regulations; however, an attempt should be made to avoid making measurements in the near field.

- OATs and chamber correlation testing had been performed and chamber measured test results is the worst case test result.

Although these tests were performed other than open area test site, adequate comparison measurements were confirmed against 30m open area test site. Therefore sufficient tests were made to demonstrate that the alternative site produces results that correlate with the ones of tests made in an open field based on KDB 414788.

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

9.6. AC Power Line Conducted Emission

Requirements

Frequency (MHz)	Conducted limit (dBμV)	
	Quasi-peak	Average
0.15 - 0.5	66 - 56	56 - 46
0.50 - 5.0	56	46
5.0 - 30	60	50

Note:

1. The lower limit shall apply at the transition frequencies.
2. The limit decreases in line with the logarithm of the frequency in the range of 0.15 to 0.50MHz.

Test Procedures

- a. The EUT was placed 0.4 meters from the conducting wall of the shielded room with EUT being connected to the power mains through a line impedance stabilization network (LISN). Other support units were connected to the power mains through another LISN. The two LISNs provide 50 ohm/ 50uH of coupling impedance for the measuring instrument.
- b. Both lines of the power mains connected to the EUT were checked for maximum conducted interference.
- c. The frequency range from 150kHz to 30MHz was searched. Emission levels under (Limit - 20dB) was not recorded.

NOTE:

1. The resolution bandwidth and video bandwidth of test receiver is 9kHz for quasi-peak detection (QP) and average detection (AV) at frequency 0.15MHz-30MHz.
2. All modes of operation were investigated (includes all external accessories) and the worst-case emissions are reported, the other emission levels were low against the limit.
3. Test data of Result value (dBuV) = Reading value (dBuV) + Correction Factor (dB).
4. Test data of Margin(dB) = Result value (dBuV) - Limit value (dBuV).
5. Test data of Correction Factor (dB) = Insertion loss(dB) + Cable loss(dB).

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

Test Setup

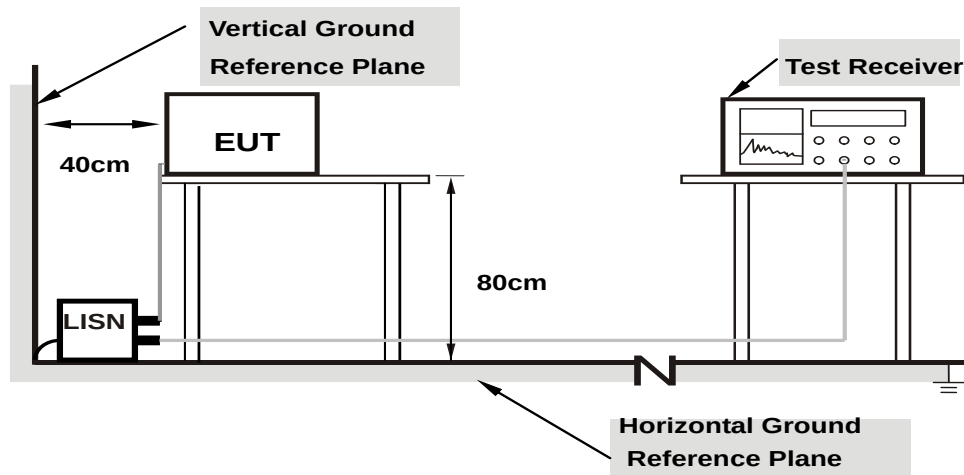


Note: 1.Support units were connected to second LISN.

For the actual test configuration, please refer to the Setup Configurations.

Test Data

Mode	11g_TX2437	Channel	6
------	------------	---------	---

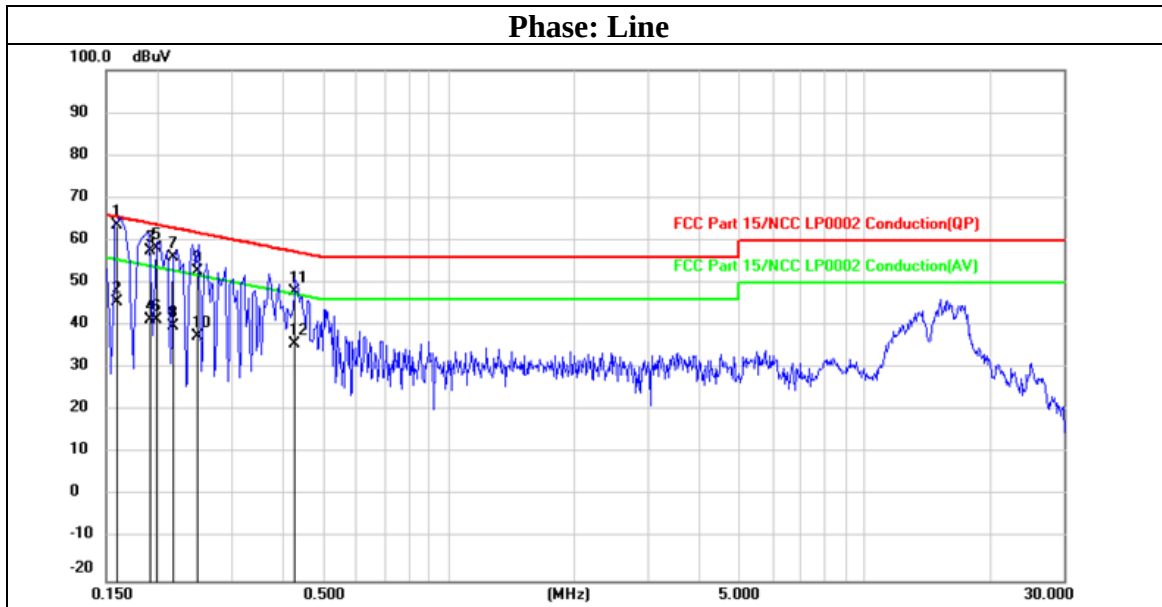

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1583	53.66	9.97	63.63	65.55	-1.92	QP
2	0.1583	35.44	9.97	45.41	55.55	-10.14	AVG
3	0.1923	47.65	9.96	57.61	63.94	-6.33	QP
4	0.1923	31.36	9.96	41.32	53.94	-12.62	AVG
5	0.1981	48.12	9.96	58.08	63.69	-5.61	QP
6	0.1981	31.48	9.96	41.44	53.69	-12.25	AVG
7	0.2180	46.07	9.96	56.03	62.89	-6.86	QP
8	0.2180	29.92	9.96	39.88	52.89	-13.01	AVG
9	0.2477	42.85	9.96	52.81	61.83	-9.02	QP
10	0.2477	27.48	9.96	37.44	51.83	-14.39	AVG
11	0.4256	38.07	9.97	48.04	57.34	-9.30	QP
12	0.4256	25.74	9.97	35.71	47.34	-11.63	AVG

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1

Mode	11g_TX2437	Channel	6
------	------------	---------	---

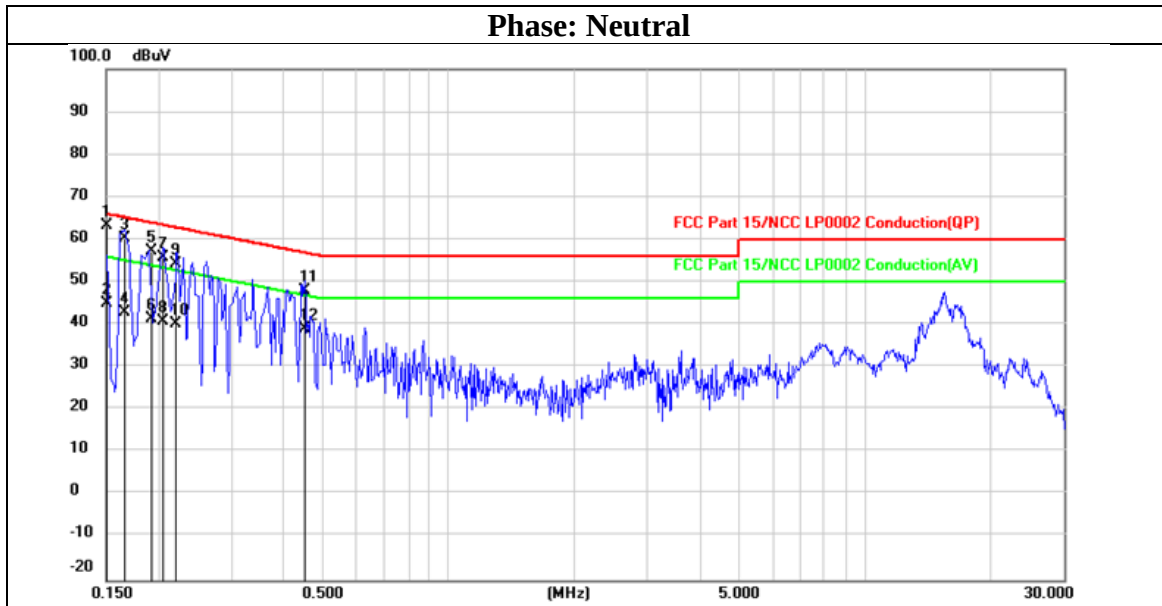

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1508	53.40	9.99	63.39	65.96	-2.57	QP
2	0.1508	34.97	9.99	44.96	55.96	-11.00	AVG
3	0.1658	50.13	9.99	60.12	65.17	-5.05	QP
4	0.1658	32.96	9.99	42.95	55.17	-12.22	AVG
5	0.1935	47.16	9.99	57.15	63.88	-6.73	QP
6	0.1935	31.42	9.99	41.41	53.88	-12.47	AVG
7	0.2057	45.65	9.99	55.64	63.38	-7.74	QP
8	0.2057	30.72	9.99	40.71	53.38	-12.67	AVG
9	0.2205	44.25	9.99	54.24	62.80	-8.56	QP
10	0.2205	30.31	9.99	40.30	52.80	-12.50	AVG
11	0.4485	37.88	9.99	47.87	56.90	-9.03	QP
12	0.4485	28.99	9.99	38.98	46.90	-7.92	AVG

END OF REPORT

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: Form-ULID-004737 (DCS:17-EM-F0876) / 6.1