


Band66	20MHz	QPSK	132072	1	0	Low	0.15	30	-74.49	PASS
Band66	20MHz	QPSK	132072	1	0	Low	30	1000	-51.1	PASS
Band66	20MHz	QPSK	132072	1	0	Low	1000	20000	-39.99	PASS
Band66	20MHz	16QAM	132072	1	0	Low	0.009	0.15	-71.93	PASS
Band66	20MHz	16QAM	132072	1	0	Low	0.15	30	-74.48	PASS
Band66	20MHz	16QAM	132072	1	0	Low	30	1000	-51.11	PASS
Band66	20MHz	16QAM	132072	1	0	Low	1000	20000	-40.37	PASS
Band66	20MHz	QPSK	132322	1	0	Low	0.009	0.15	-74.07	PASS
Band66	20MHz	QPSK	132322	1	0	Low	0.15	30	-73.36	PASS
Band66	20MHz	QPSK	132322	1	0	Low	30	1000	-51.05	PASS
Band66	20MHz	QPSK	132322	1	0	Low	1000	20000	-40.86	PASS
Band66	20MHz	16QAM	132322	1	0	Low	0.009	0.15	-72.74	PASS
Band66	20MHz	16QAM	132322	1	0	Low	0.15	30	-72.1	PASS
Band66	20MHz	16QAM	132322	1	0	Low	30	1000	-51.09	PASS
Band66	20MHz	16QAM	132322	1	0	Low	1000	20000	-41.38	PASS
Band66	20MHz	QPSK	132572	1	5	High	0.009	0.15	-73.53	PASS
Band66	20MHz	QPSK	132572	1	5	High	0.15	30	-74.38	PASS
Band66	20MHz	QPSK	132572	1	5	High	30	1000	-50.99	PASS
Band66	20MHz	QPSK	132572	1	5	High	1000	20000	-41.41	PASS
Band66	20MHz	16QAM	132572	1	5	High	0.009	0.15	-71.59	PASS
Band66	20MHz	16QAM	132572	1	5	High	0.15	30	-73.8	PASS
Band66	20MHz	16QAM	132572	1	5	High	30	1000	-51.06	PASS
Band66	20MHz	16QAM	132572	1	5	High	1000	20000	-41.5	PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

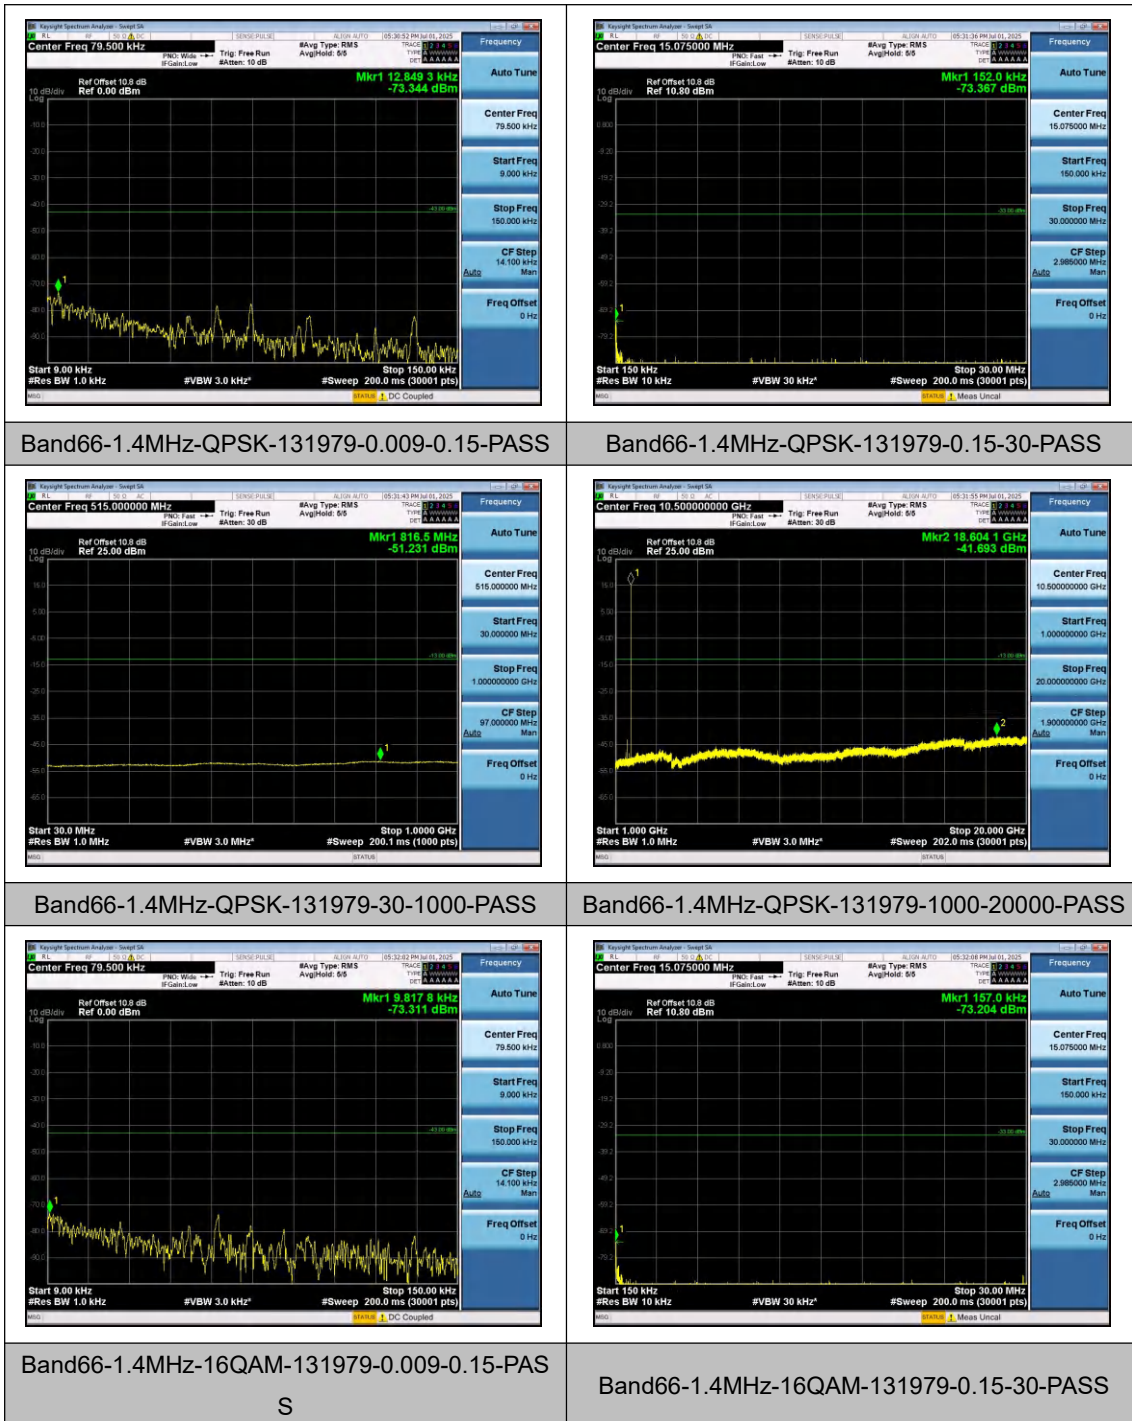


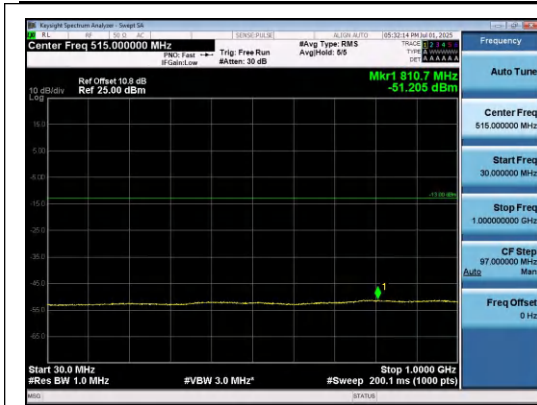

Band66-1.4MHz-16QAM-131979-30-1000-PASS




Band66-1.4MHz-16QAM-131979-1000-20000-PASS
S

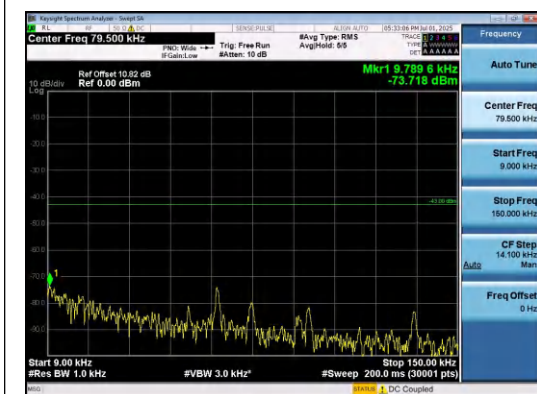


Band66-1.4MHz-QPSK-132322-0.009-0.15-PASS




Band66-1.4MHz-QPSK-132322-0.15-30-PASS

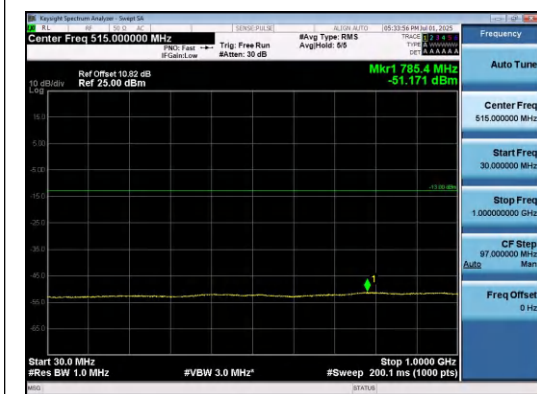

Band66-1.4MHz-QPSK-132322-30-1000-PASS

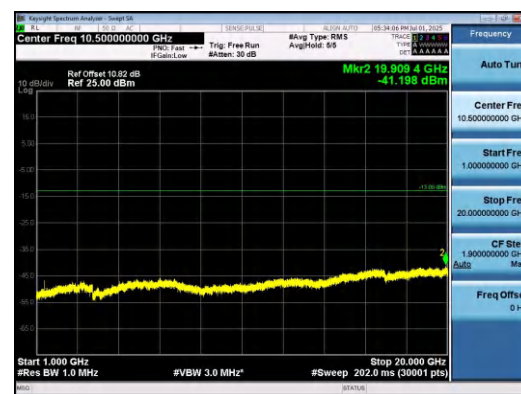


Band66-1.4MHz-QPSK-132322-1000-20000-PASS

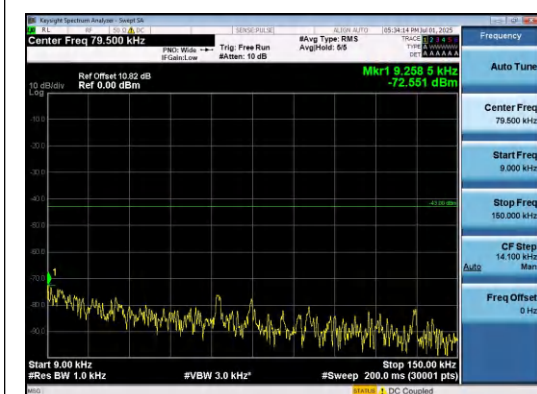


Band66-1.4MHz-16QAM-132322-0.009-0.15-PAS


S

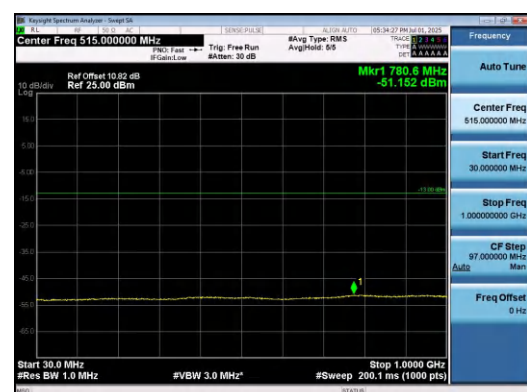

Band66-1.4MHz-16QAM-132322-0.15-30-PASS

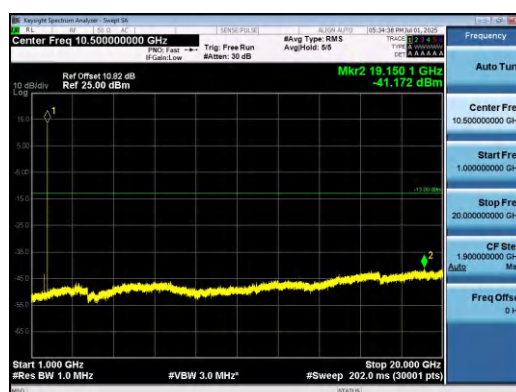

Band66-1.4MHz-16QAM-132322-30-1000-PASS

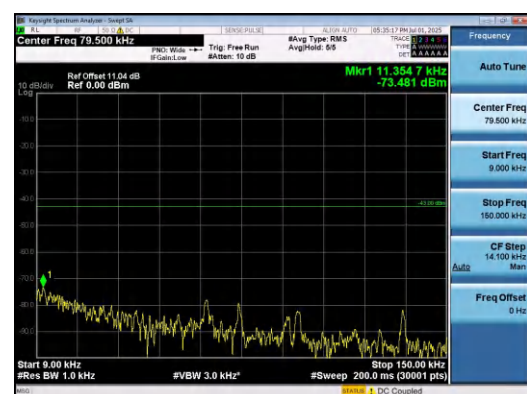


Band66-1.4MHz-16QAM-132322-1000-20000-PAS


S



Band66-1.4MHz-QPSK-132665-0.009-0.15-PASS

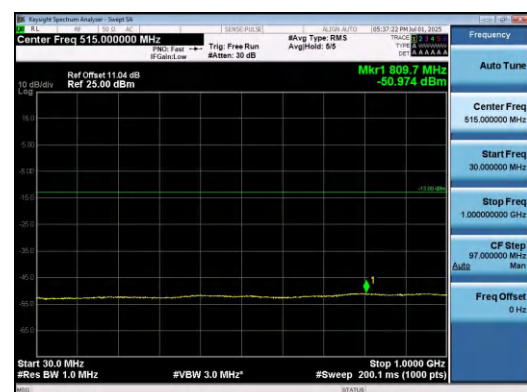


Band66-1.4MHz-QPSK-132665-0.15-30-PASS

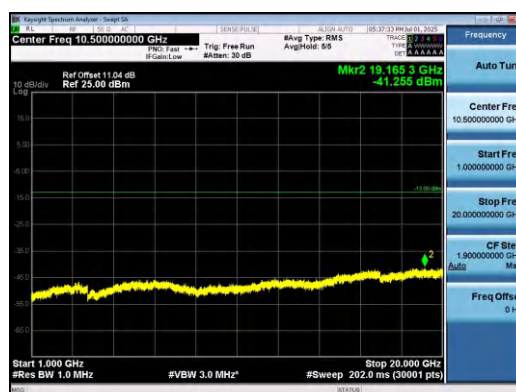

Band66-1.4MHz-QPSK-132665-30-1000-PASS

Band66-1.4MHz-QPSK-132665-1000-20000-PASS

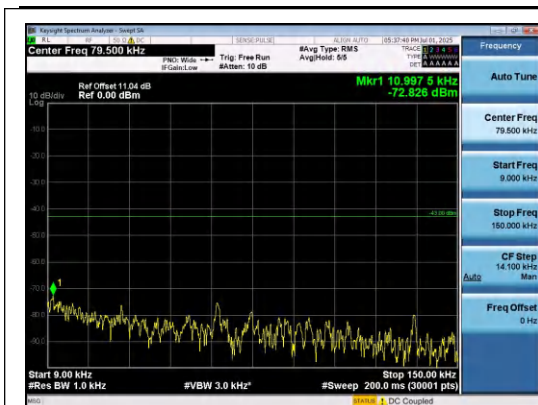


Band66-1.4MHz-16QAM-132665-0.009-0.15-PAS


S



Band66-1.4MHz-16QAM-132665-0.15-30-PASS

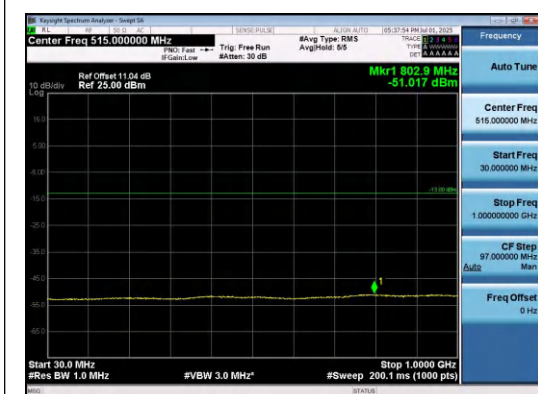


Band66-1.4MHz-16QAM-132665-30-1000-PASS

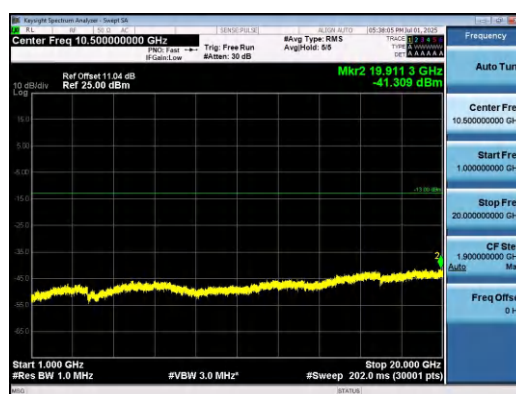

Band66-1.4MHz-16QAM-132665-1000-20000-PAS


S

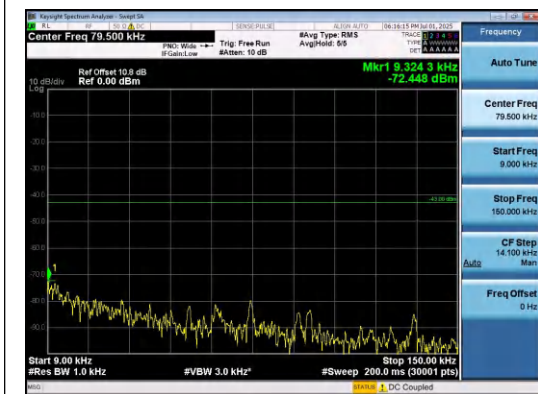



Band66-3MHz-QPSK-131987-0.009-0.15-PASS





Band66-3MHz-QPSK-131987-0.15-30-PASS

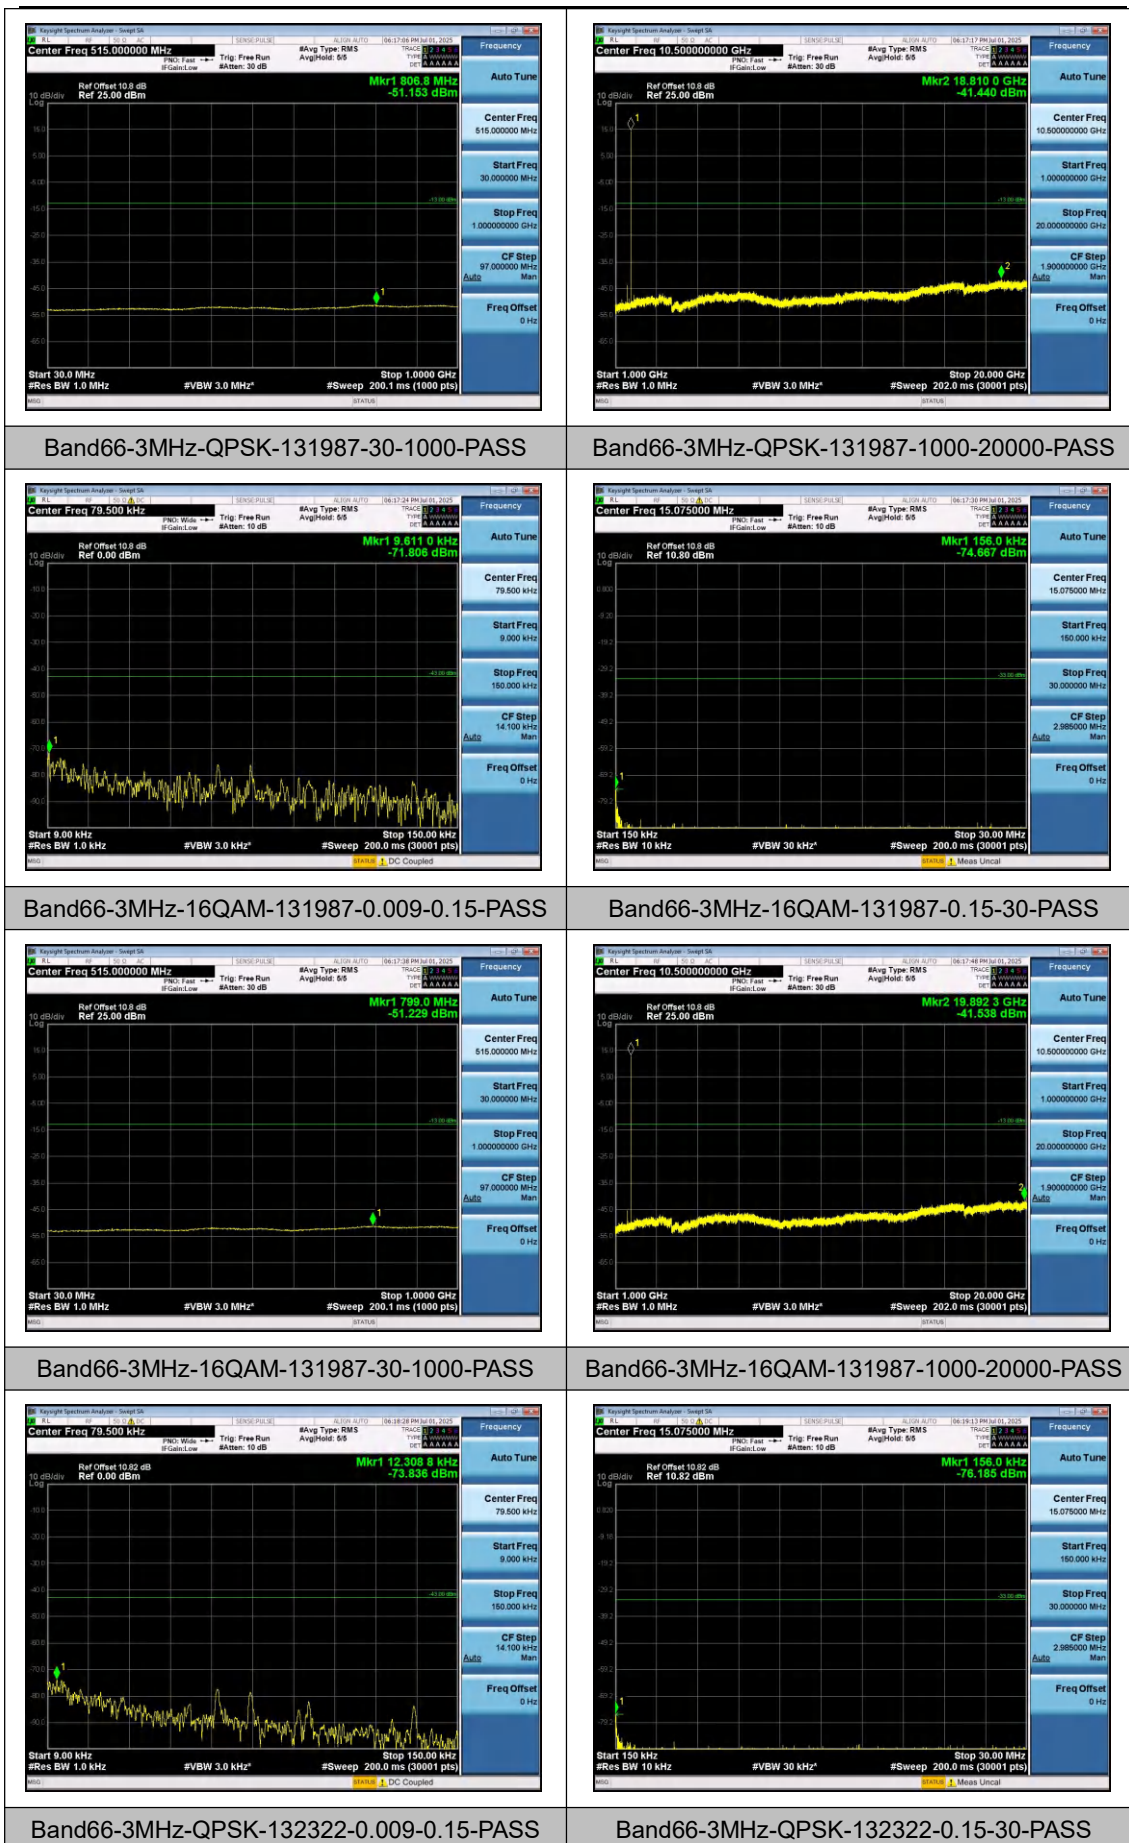


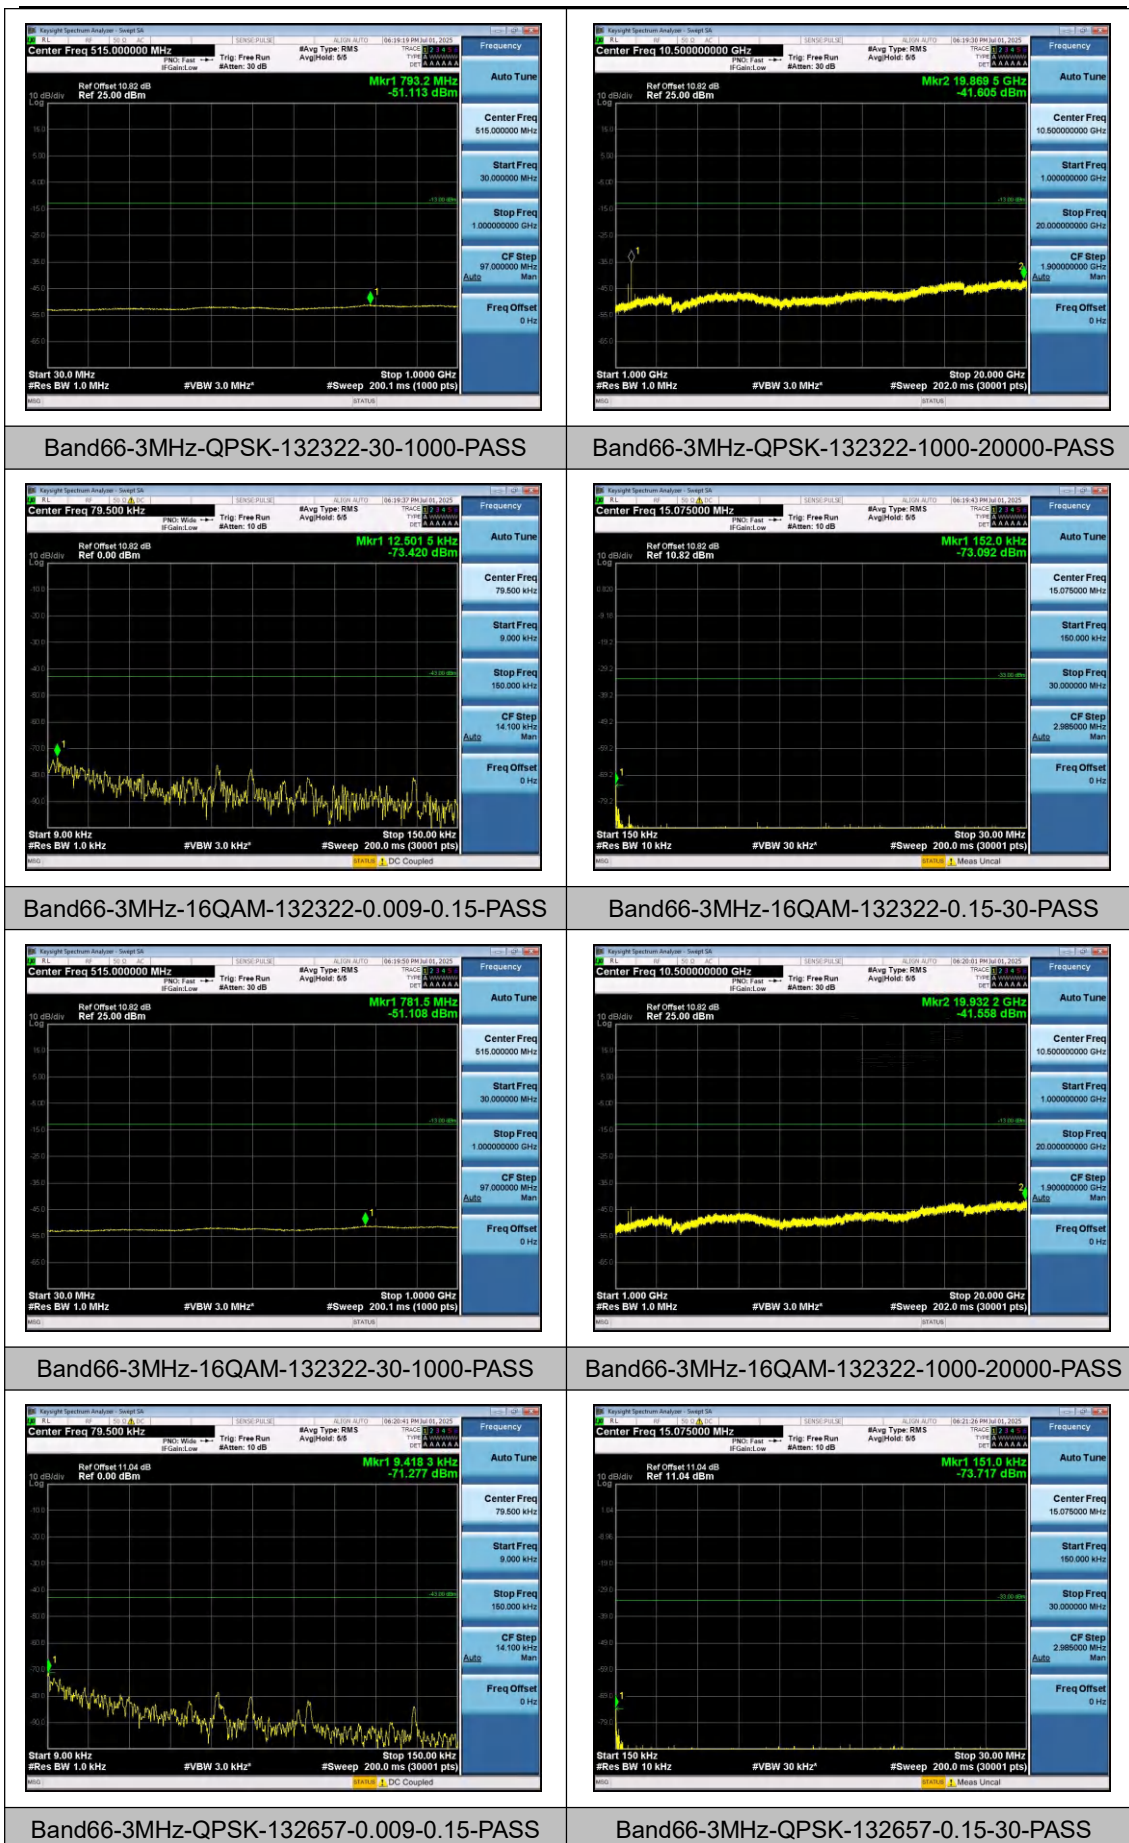


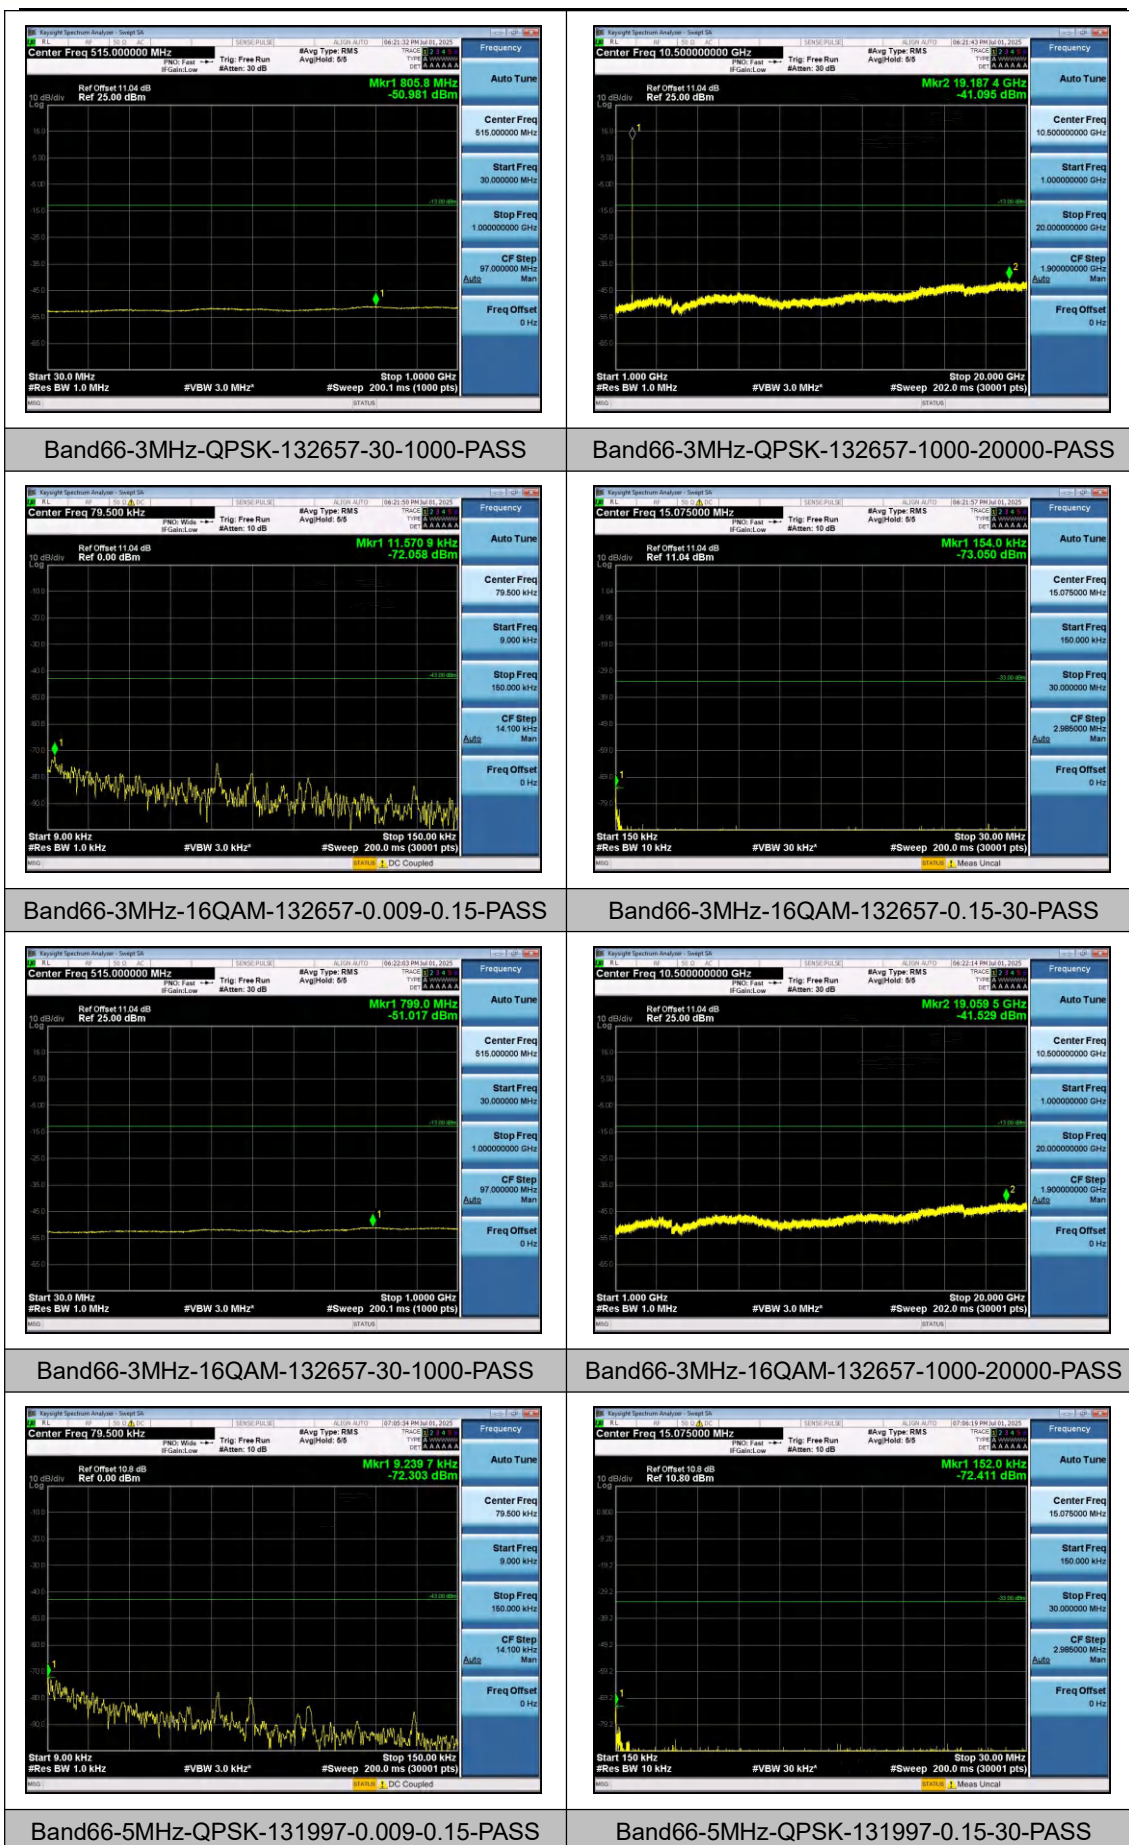


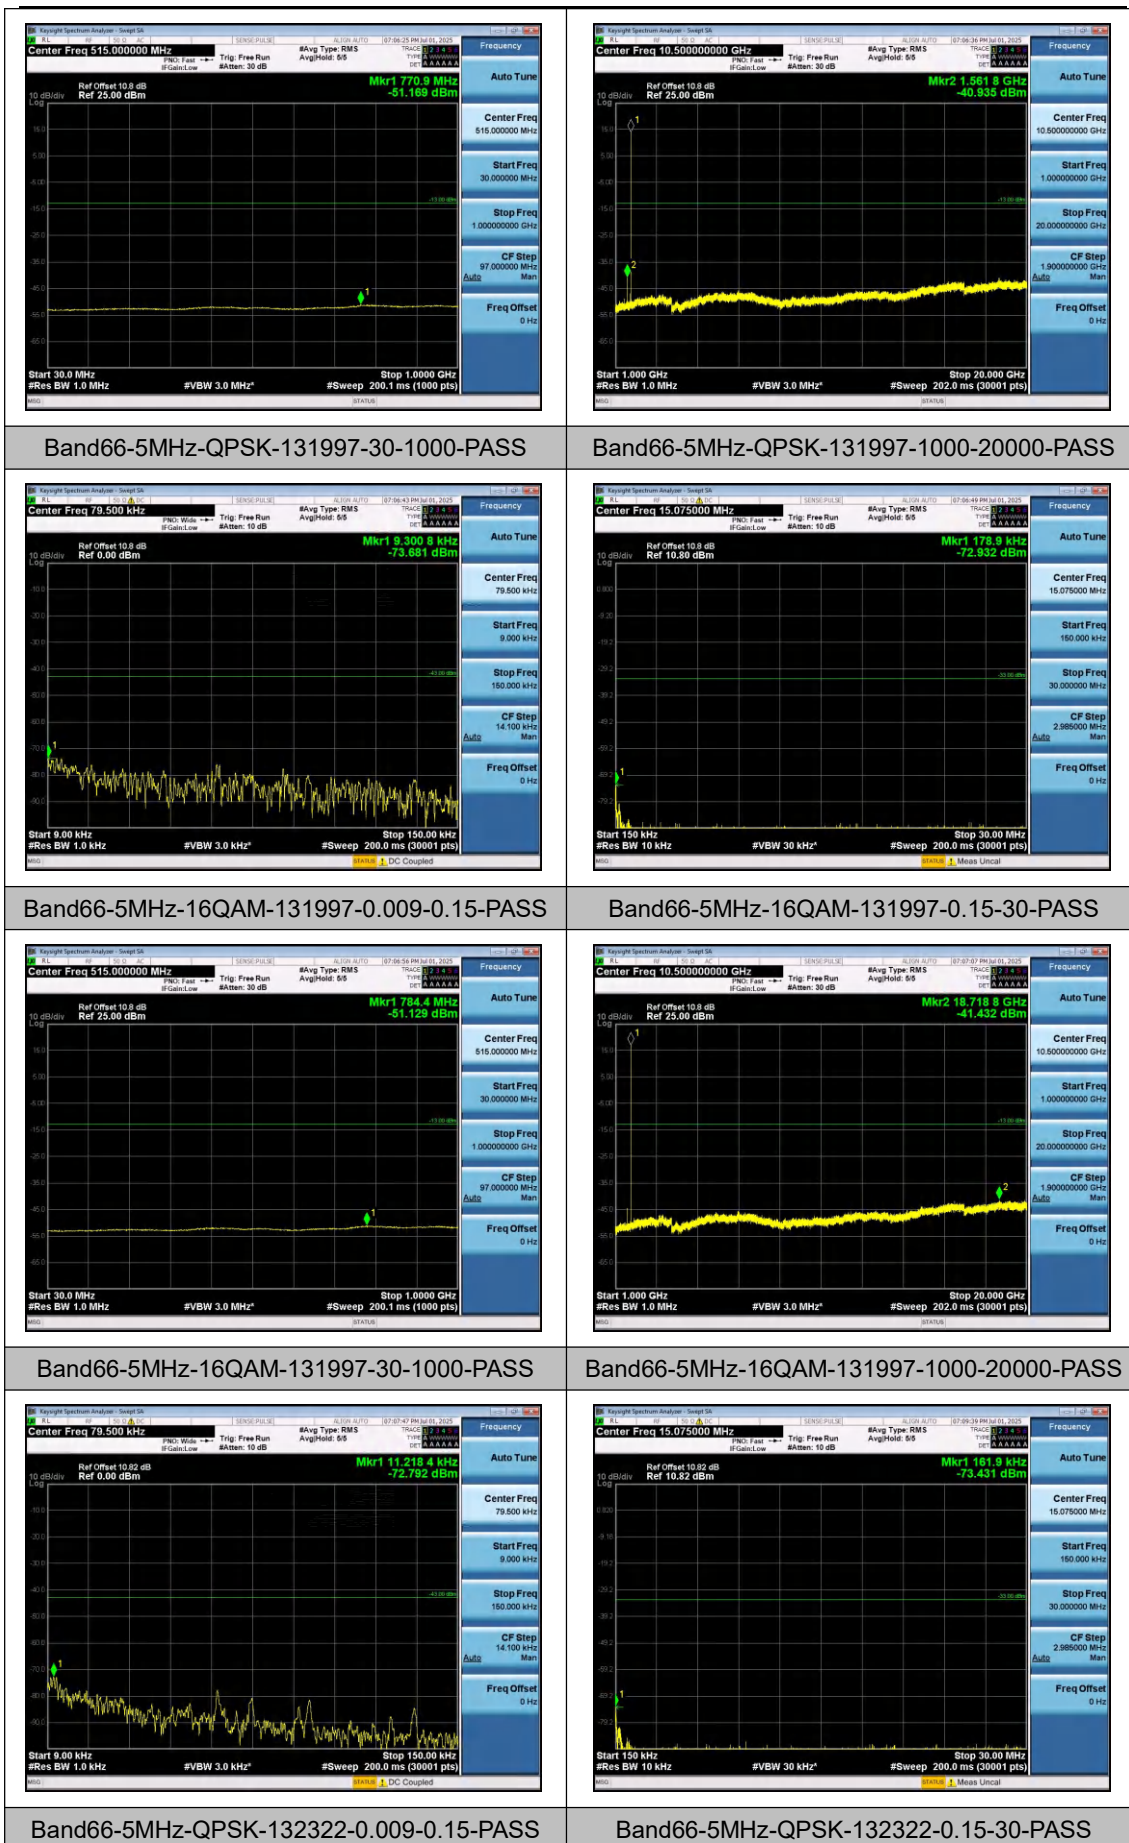

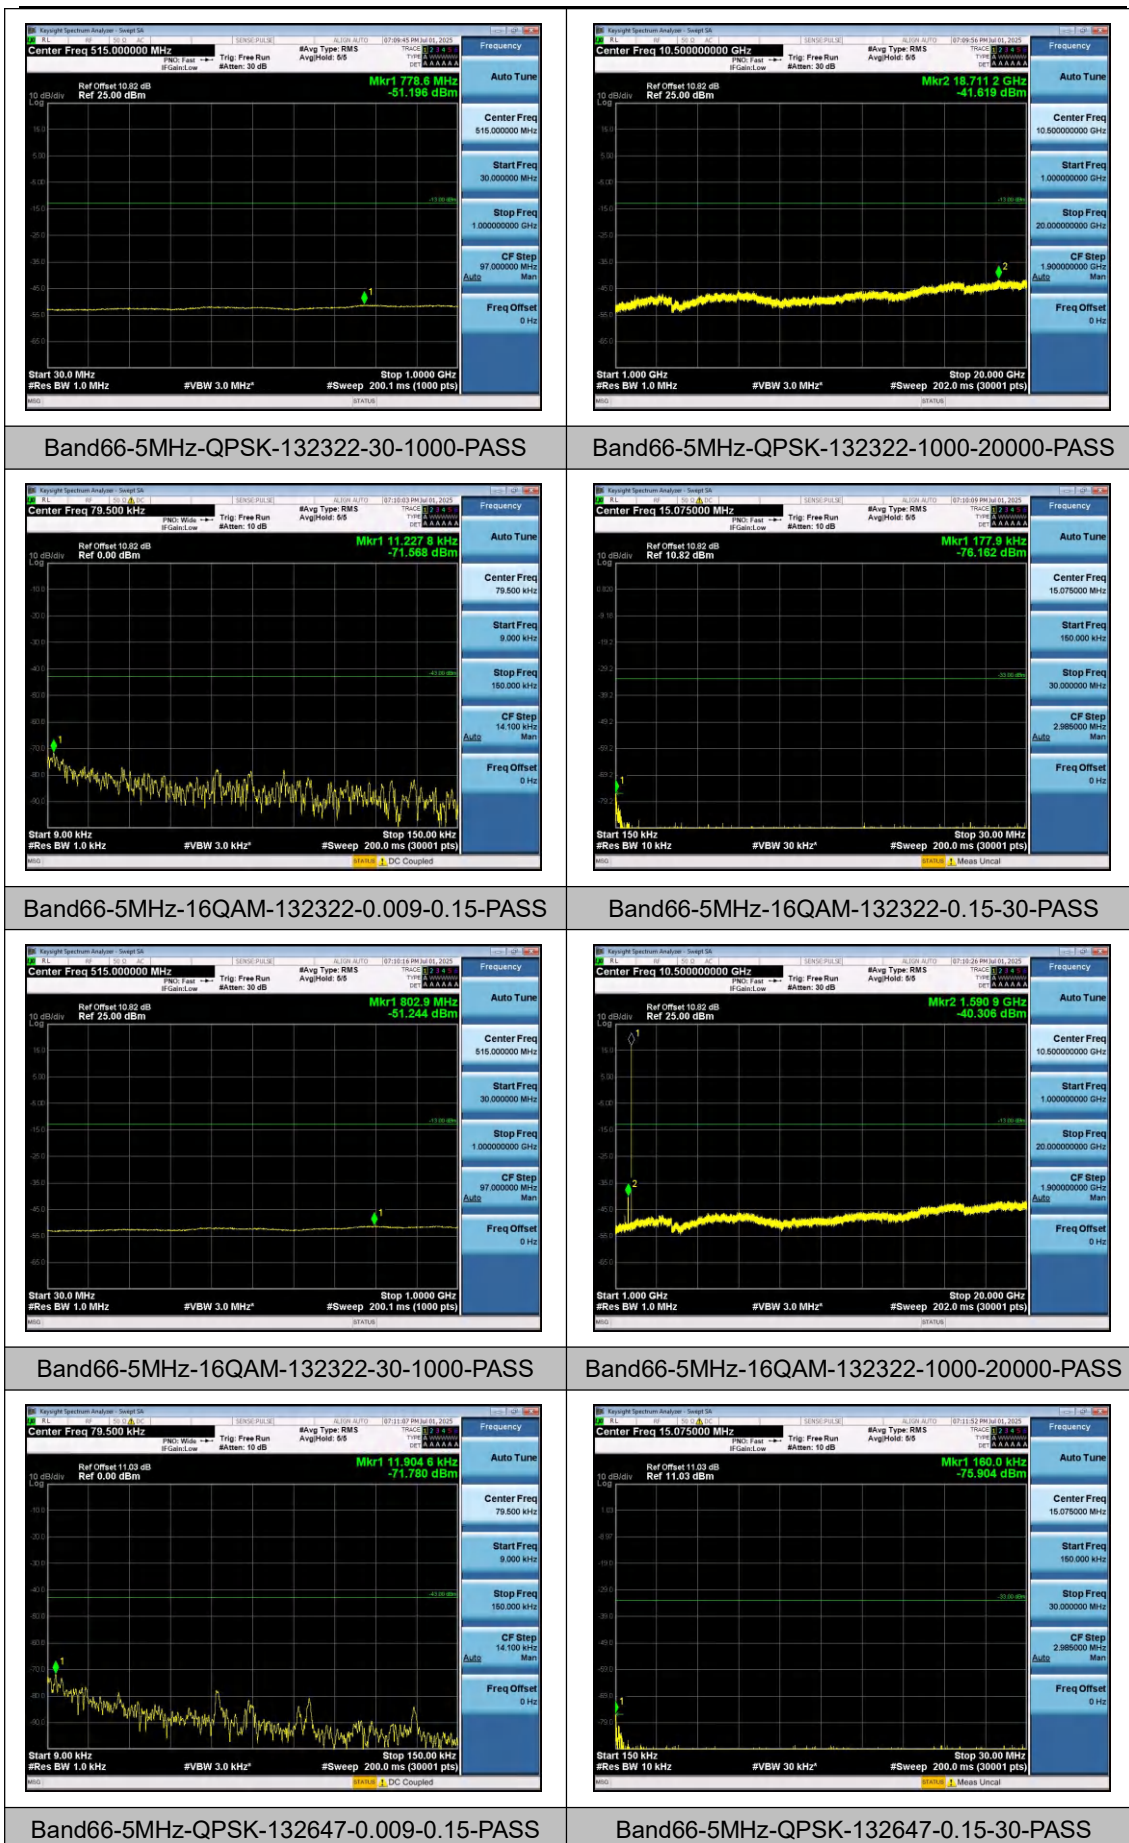

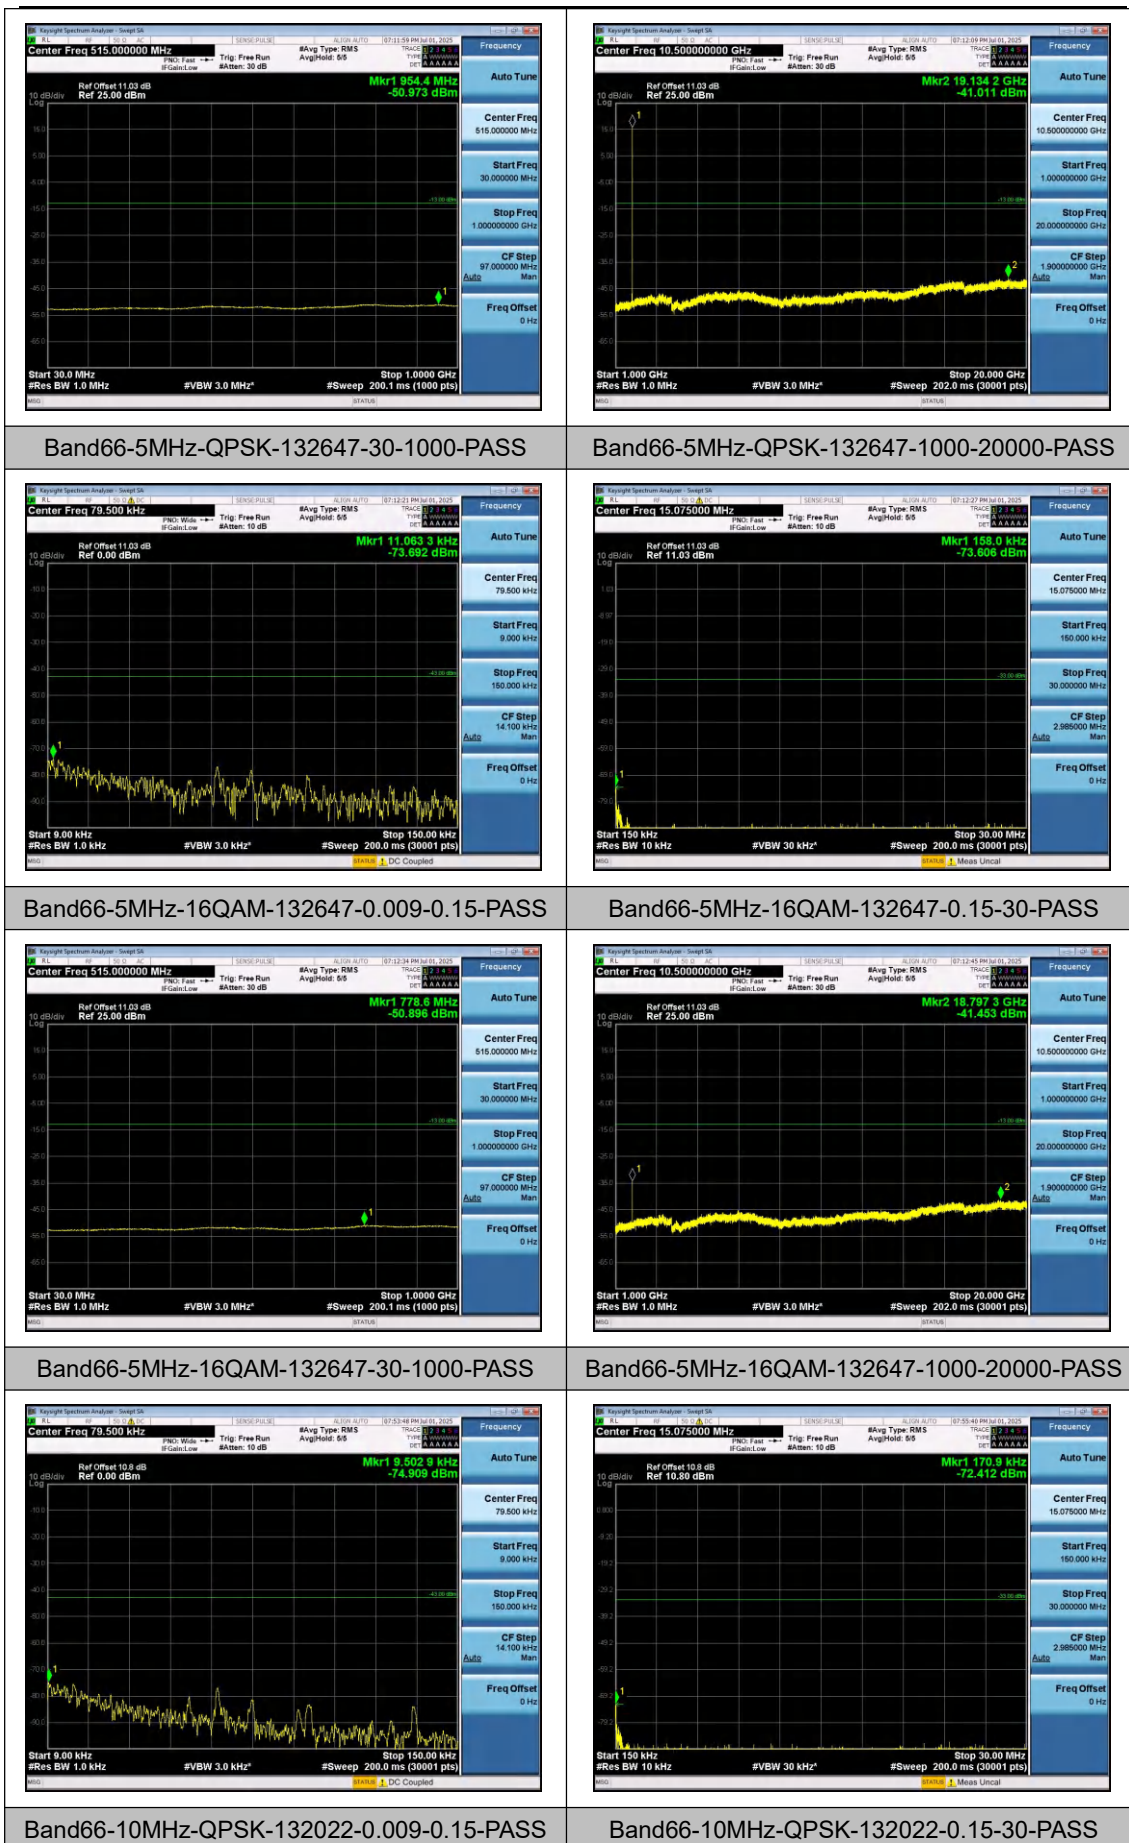

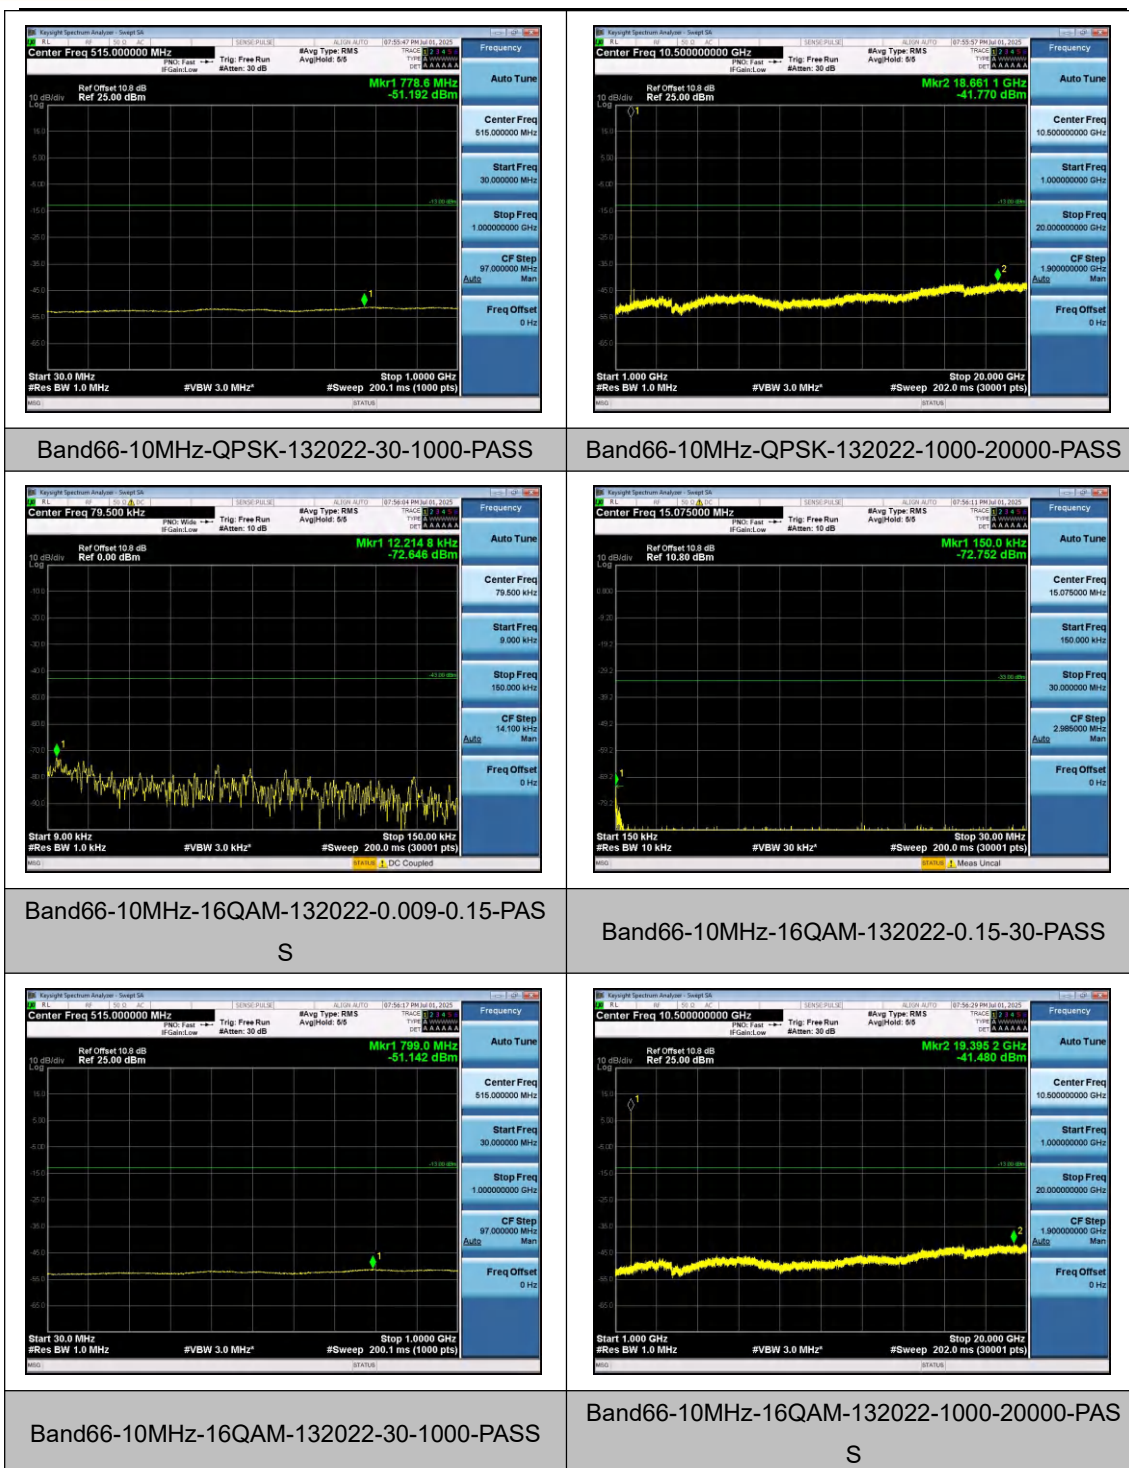

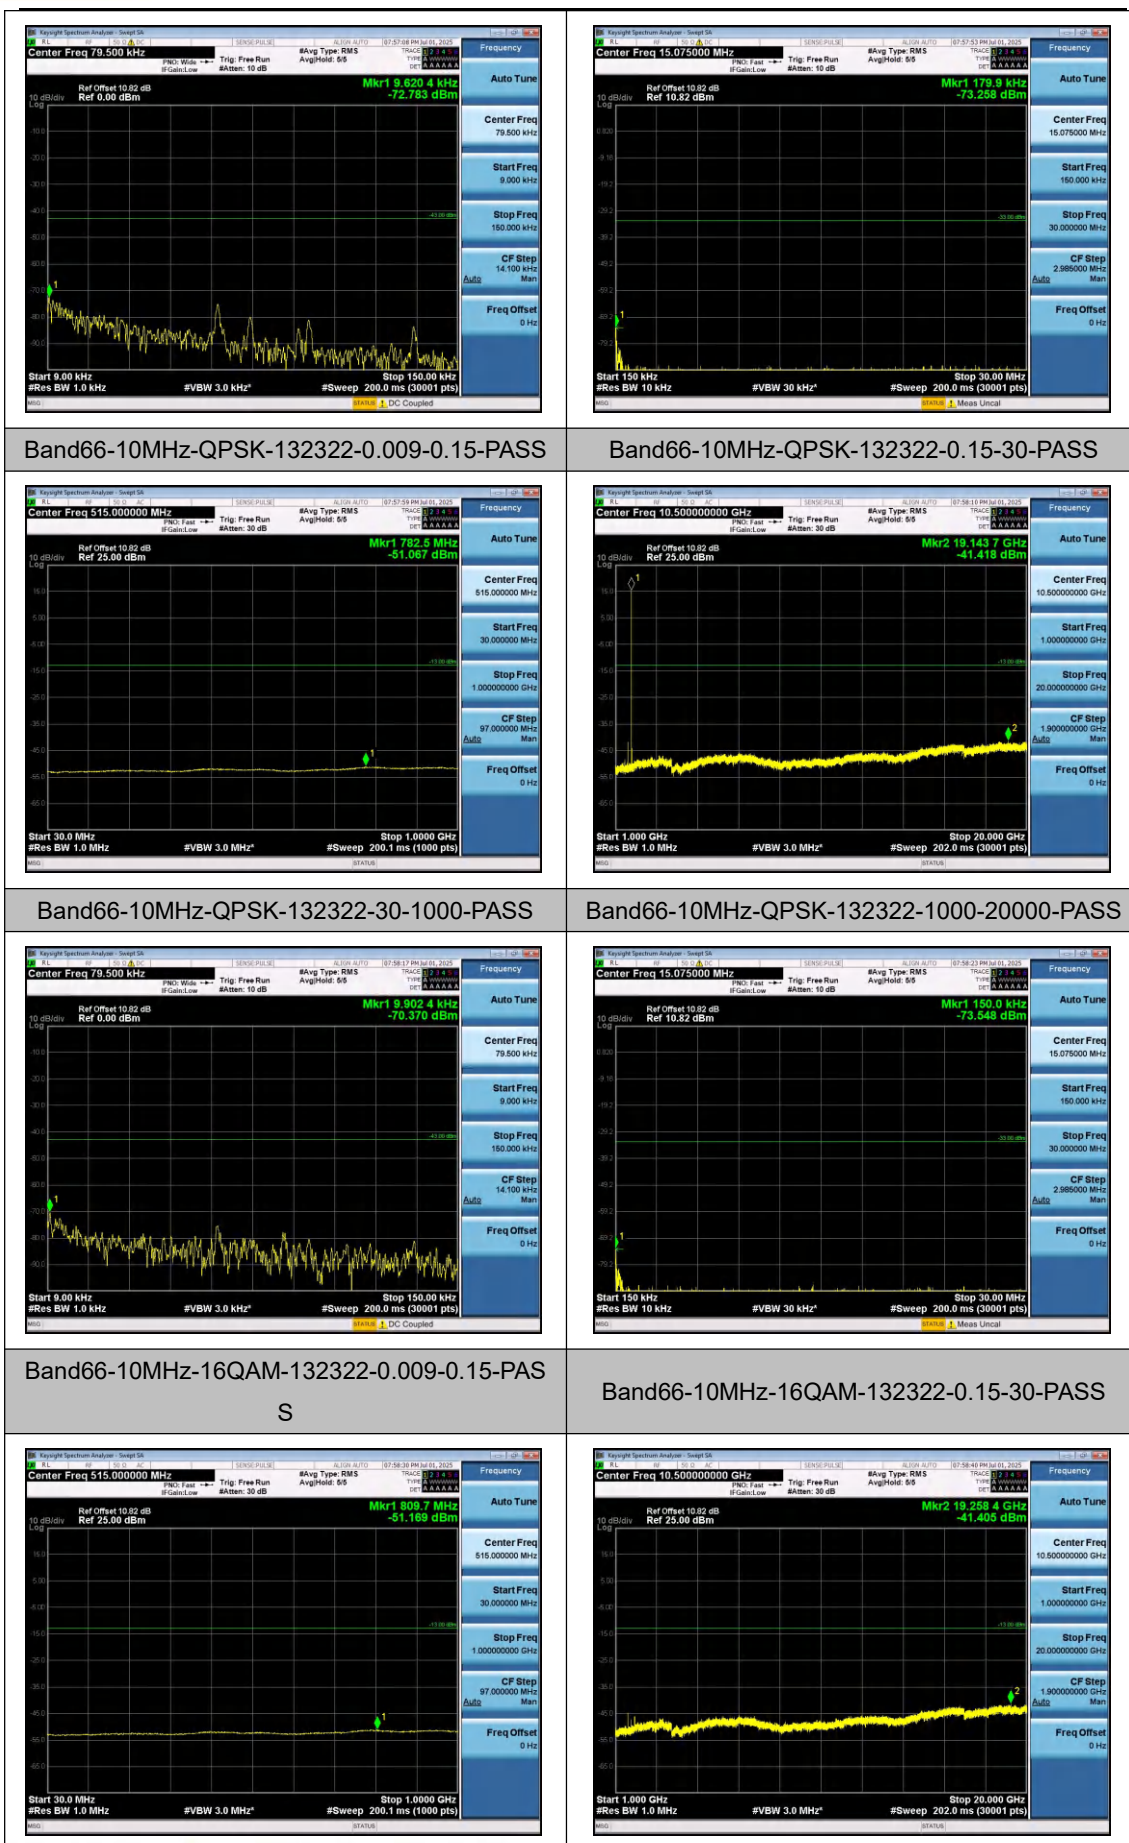

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66-10MHz-16QAM-132322-30-1000-PASS




Band66-10MHz-16QAM-132322-1000-20000-PASS
S




Band66-10MHz-QPSK-132622-0.009-0.15-PASS



Band66-10MHz-QPSK-132622-0.15-30-PASS

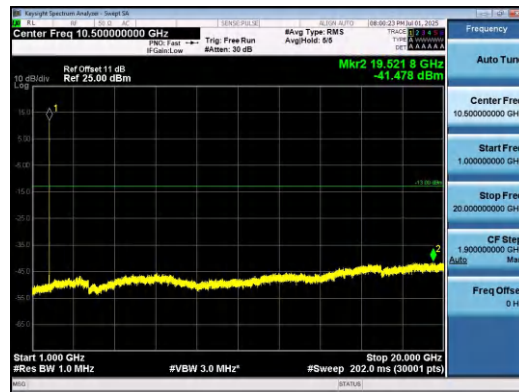

Band66-10MHz-QPSK-132622-30-1000-PASS

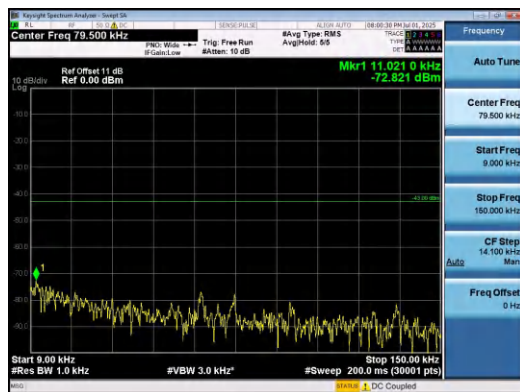


Band66-10MHz-QPSK-132622-1000-20000-PASS




Band66-10MHz-16QAM-132622-0.009-0.15-PASS
S


Band66-10MHz-16QAM-132622-0.15-30-PASS

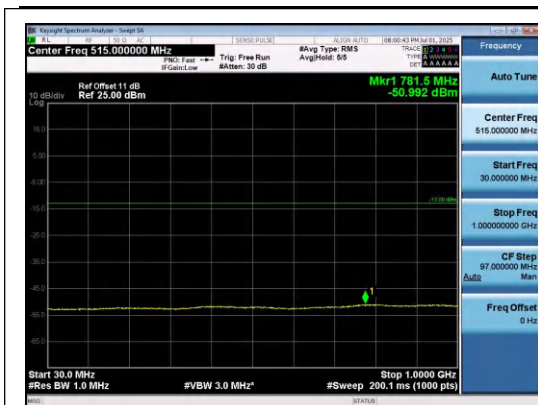

Band66-10MHz-16QAM-132622-30-1000-PASS

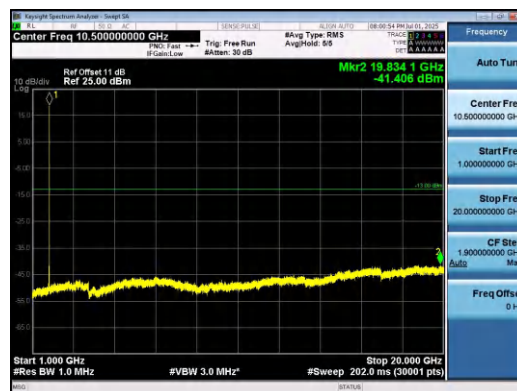


Band66-10MHz-16QAM-132622-1000-20000-PASS

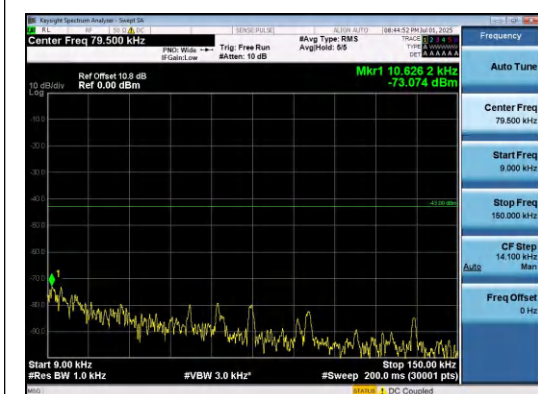


Band66-15MHz-QPSK-132047-0.009-0.15-PASS




Band66-15MHz-QPSK-132047-0.15-30-PASS

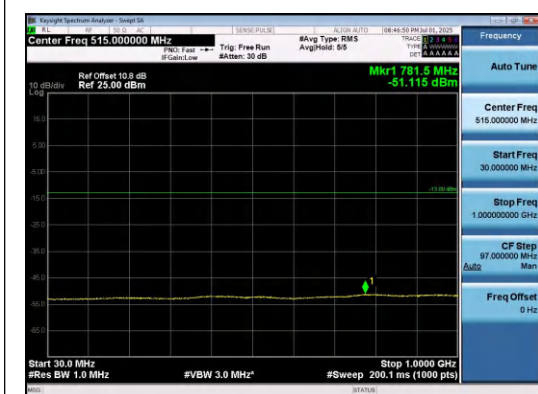

Band66-15MHz-QPSK-132047-30-1000-PASS

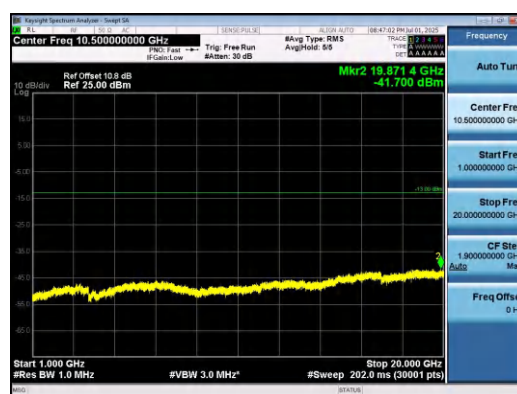


Band66-15MHz-QPSK-132047-1000-20000-PASS

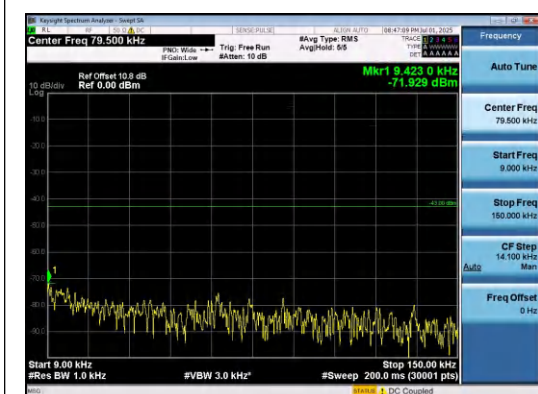


Band66-15MHz-16QAM-132047-0.009-0.15-PAS
S



Band66-15MHz-16QAM-132047-0.15-30-PASS

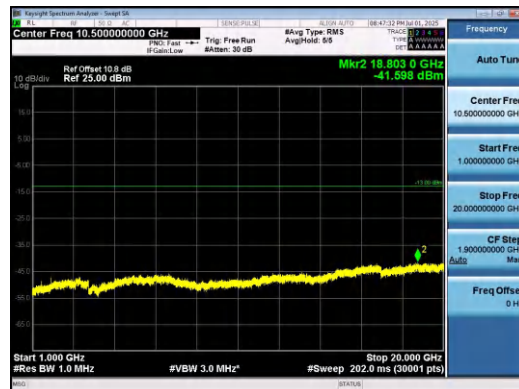


Band66-15MHz-16QAM-132047-30-1000-PASS

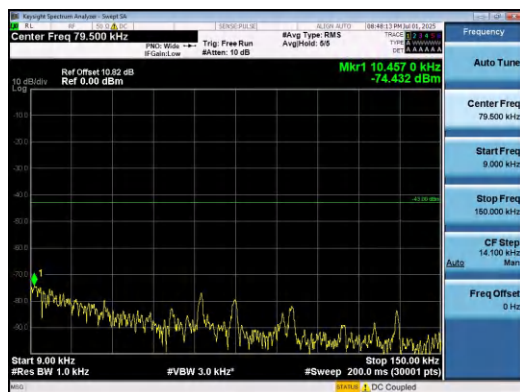


Band66-15MHz-16QAM-132047-1000-20000-PAS
S



Band66-15MHz-QPSK-132322-0.009-0.15-PASS

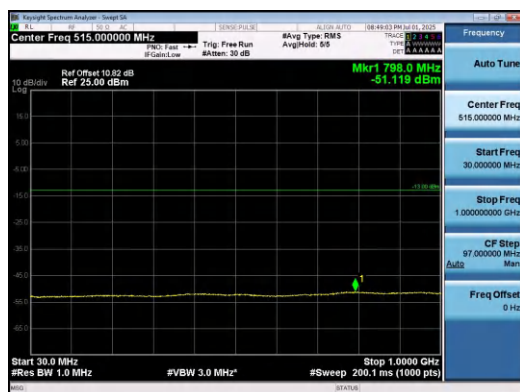


Band66-15MHz-QPSK-132322-0.15-30-PASS

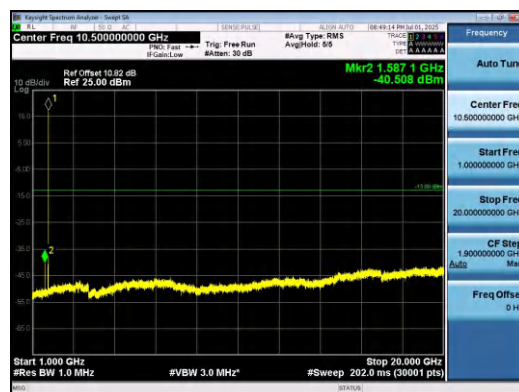

Band66-15MHz-QPSK-132322-30-1000-PASS

Band66-15MHz-QPSK-132322-1000-20000-PASS

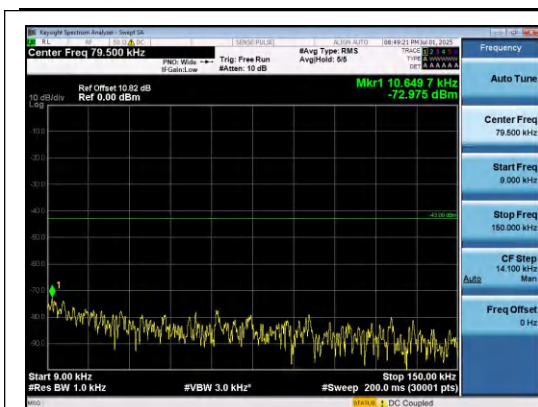


Band66-15MHz-16QAM-132322-0.009-0.15-PAS


S



Band66-15MHz-16QAM-132322-0.15-30-PASS

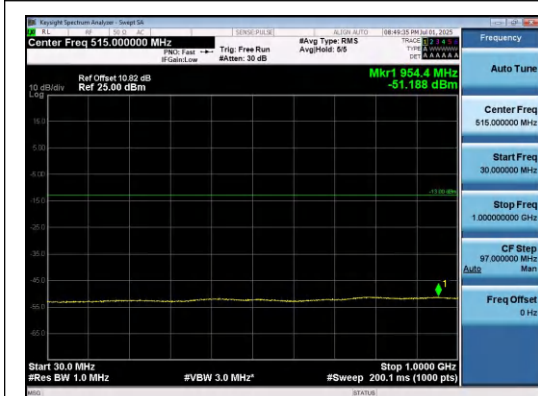


Band66-15MHz-16QAM-132322-30-1000-PASS

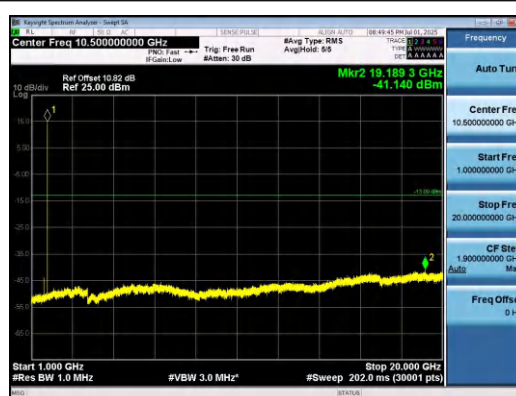

Band66-15MHz-16QAM-132322-1000-20000-PAS


S

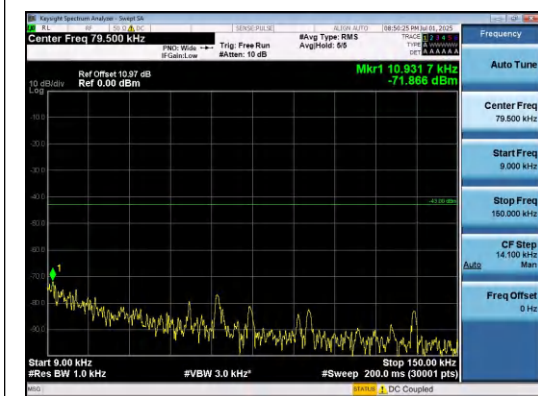


Band66-15MHz-QPSK-132597-0.009-0.15-PASS



Band66-15MHz-QPSK-132597-0.15-30-PASS

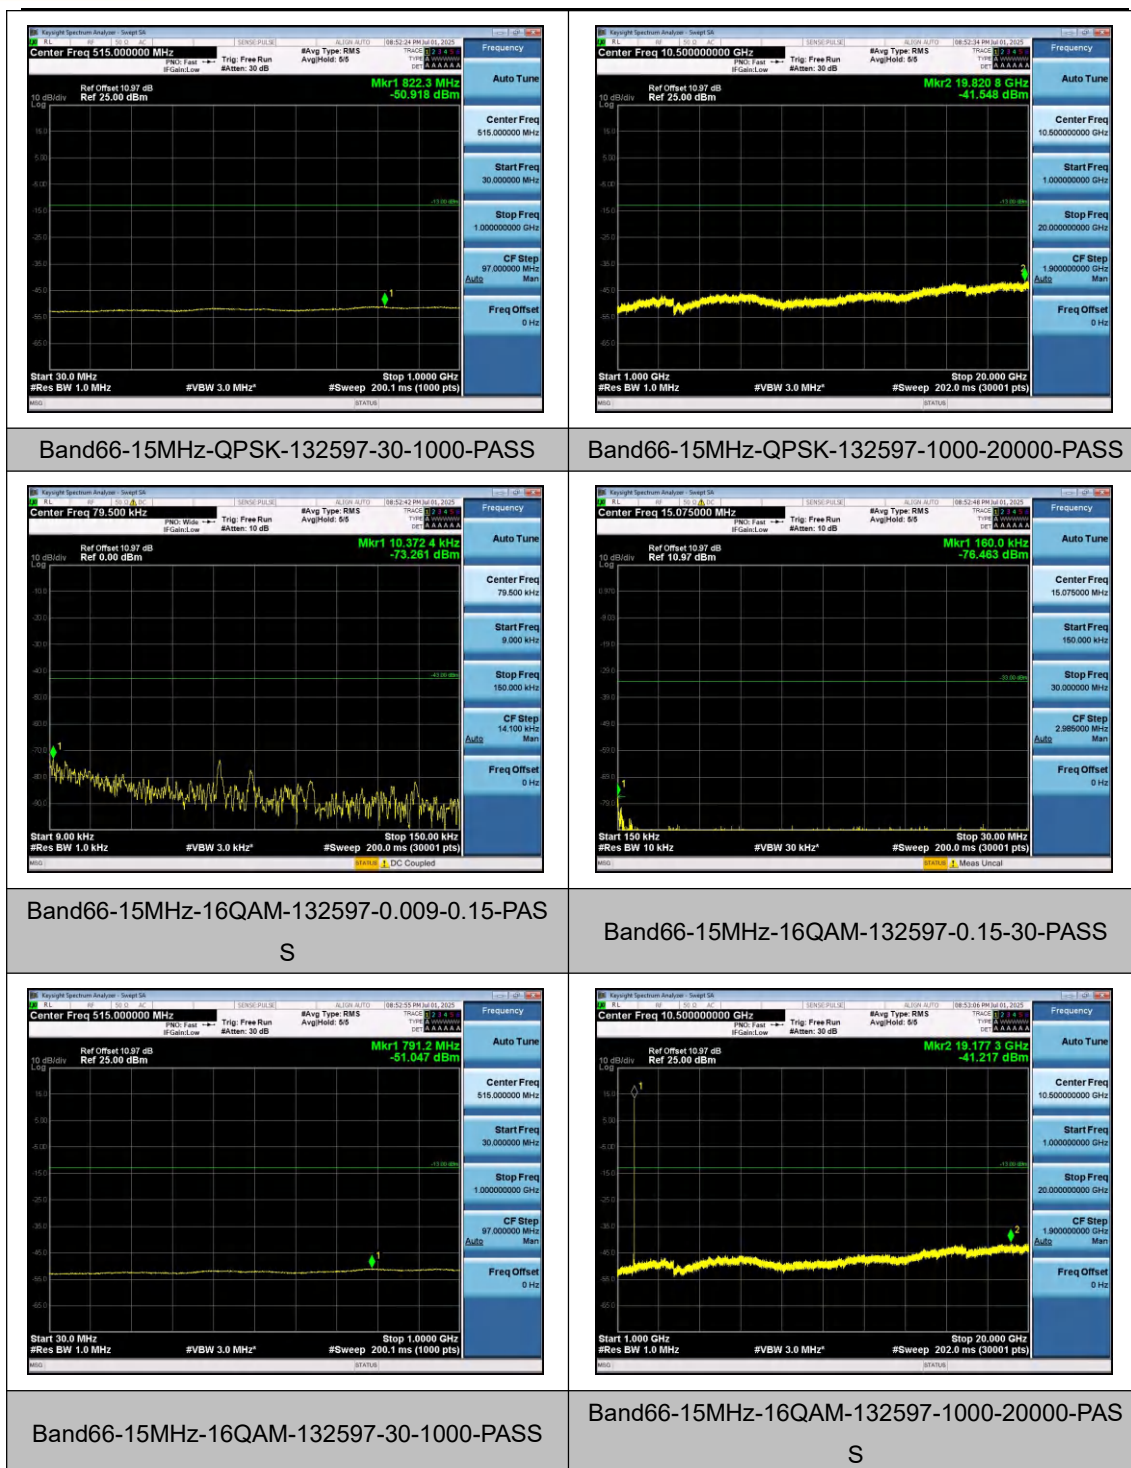

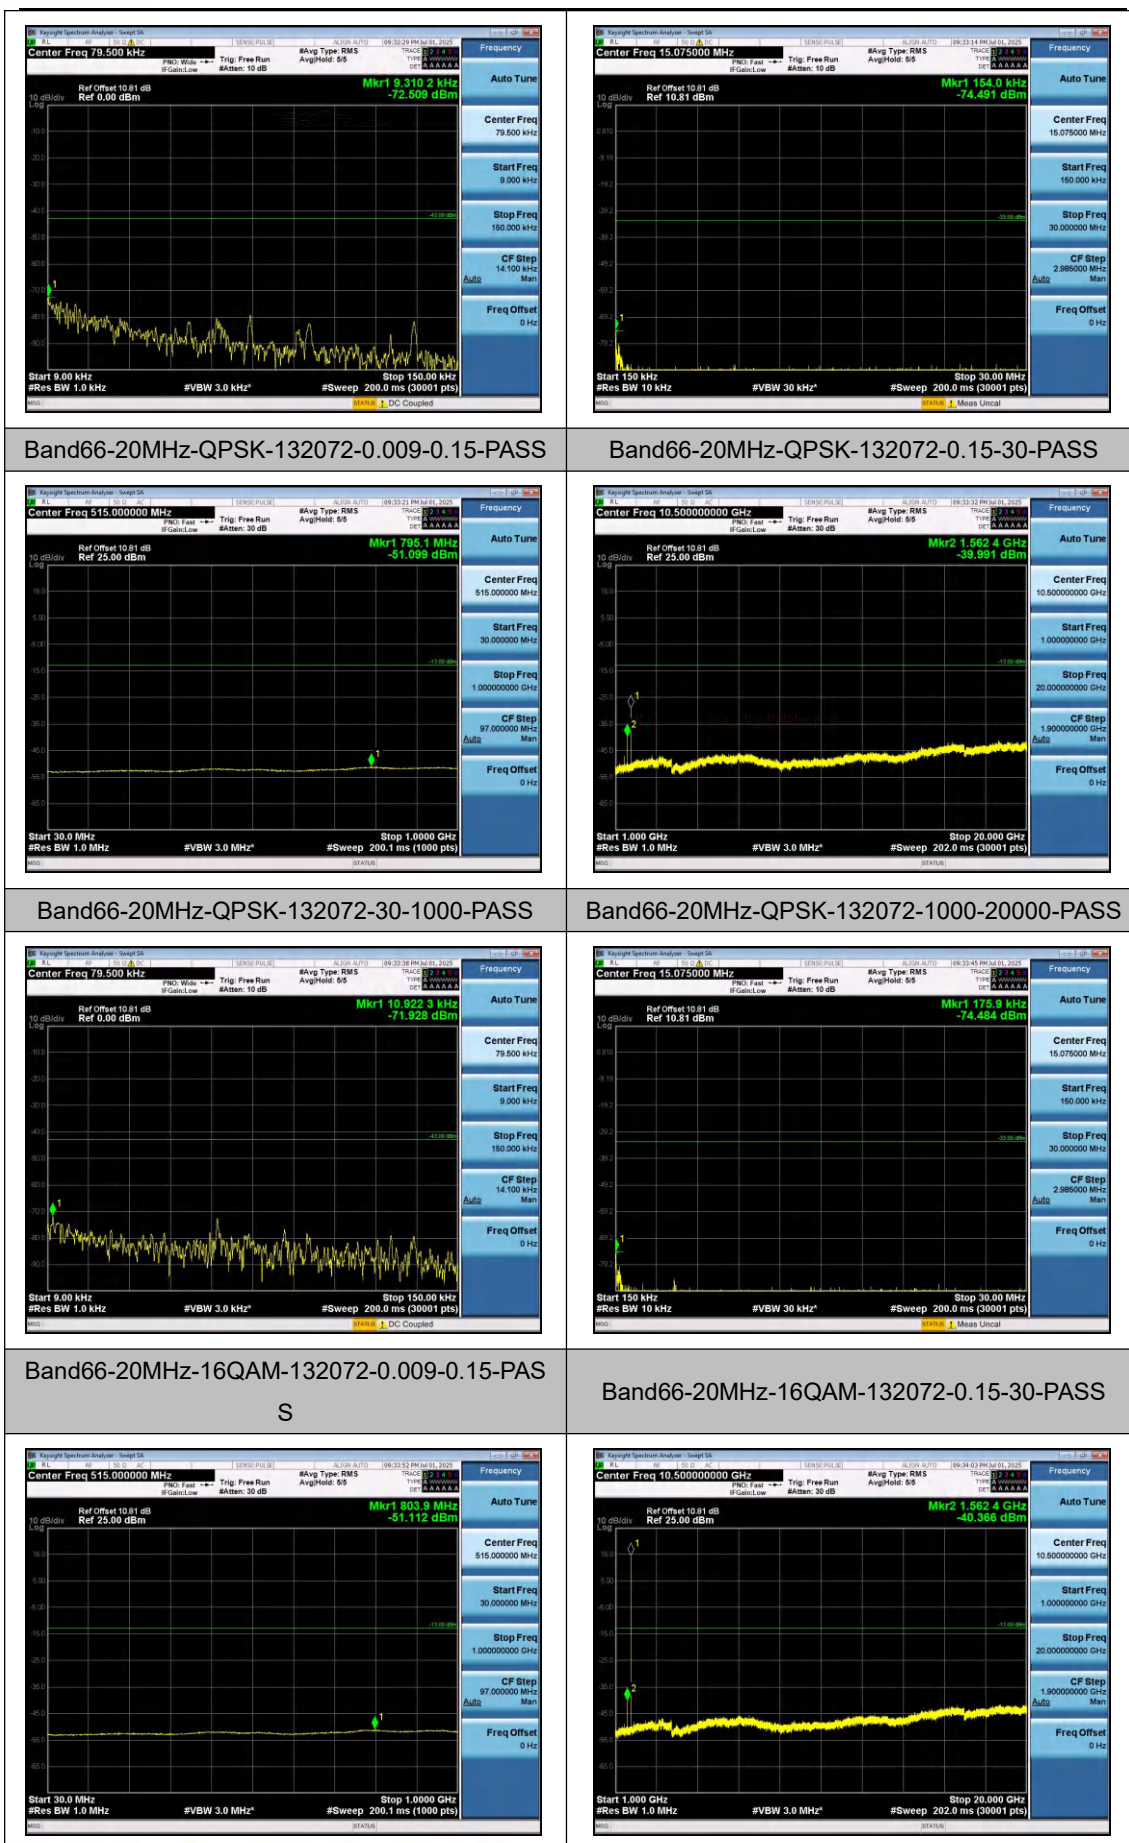

Band66-20MHz-QPSK-132072-0.009-0.15-PASS

Band66-20MHz-QPSK-132072-0.15-30-PASS

Band66-20MHz-QPSK-132072-30-1000-PASS


Band66-20MHz-QPSK-132072-1000-20000-PASS

Band66-20MHz-16QAM-132072-0.009-0.15-PAS

Band66-20MHz-16QAM-132072-0.15-30-PASS

S


Band66-20MHz-16QAM-132072-30-1000-PASS

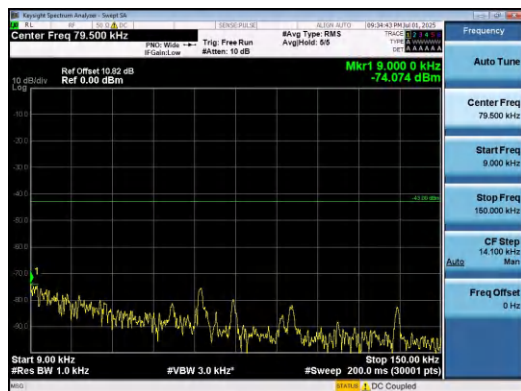


Band66-20MHz-16QAM-132072-1000-20000-PASS
S




Band66-20MHz-QPSK-132322-0.009-0.15-PASS

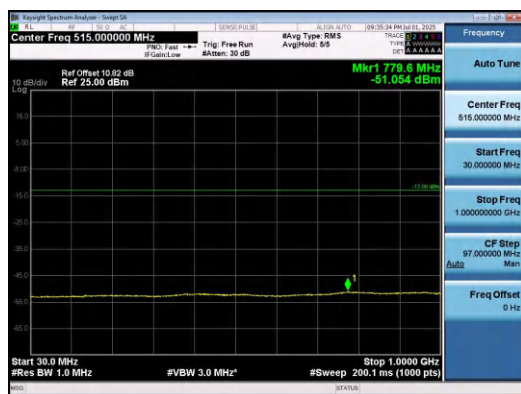

Band66-20MHz-QPSK-132322-0.15-30-PASS

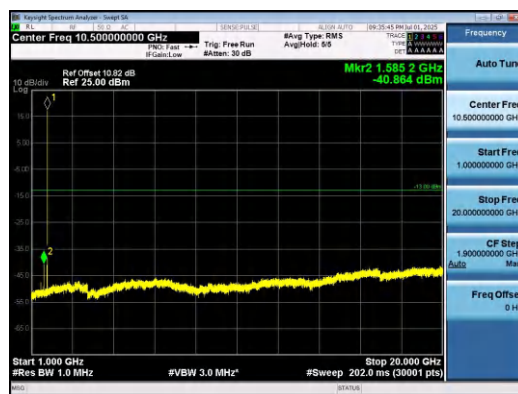

Band66-20MHz-QPSK-132322-30-1000-PASS

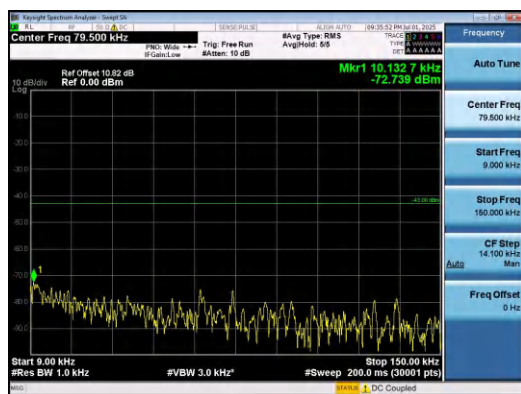


Band66-20MHz-QPSK-132322-1000-20000-PASS




Band66-20MHz-16QAM-132322-0.009-0.15-PASS

S


Band66-20MHz-16QAM-132322-0.15-30-PASS

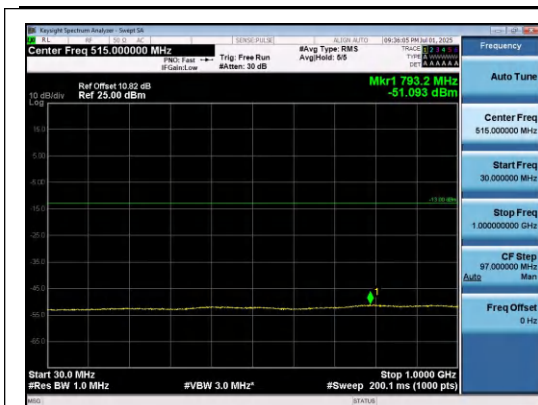

Band66-20MHz-16QAM-132322-30-1000-PASS

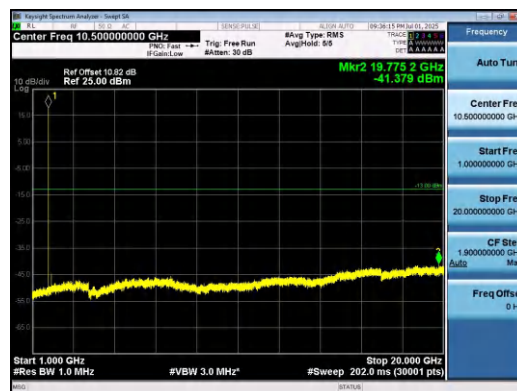


Band66-20MHz-16QAM-132322-1000-20000-PAS
S

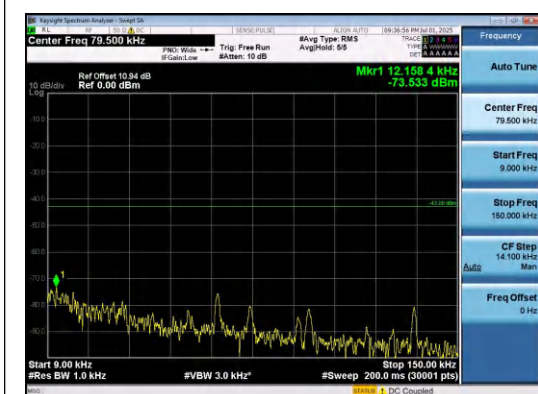


Band66-20MHz-QPSK-132572-0.009-0.15-PASS




Band66-20MHz-QPSK-132572-0.15-30-PASS

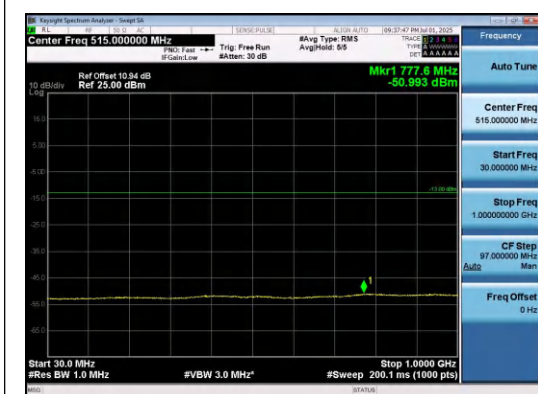


Band66-20MHz-QPSK-132572-30-1000-PASS

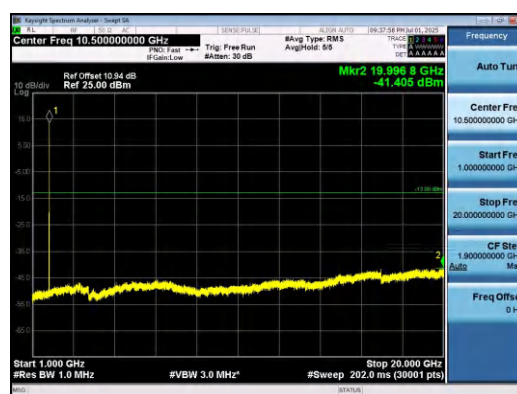

Band66-20MHz-QPSK-132572-1000-20000-PASS

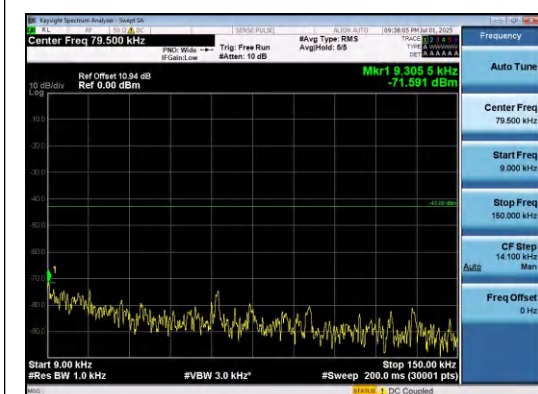

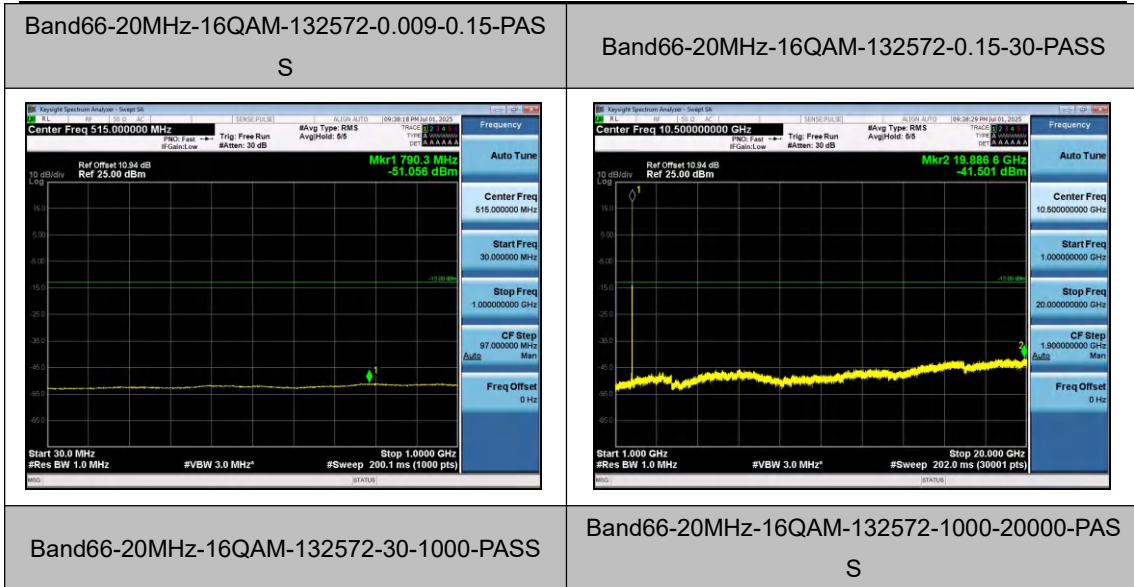

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Frequency Stability for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Voltage		Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
							Voltag	e [Vdc]					
Band66	1.4MHz	QPSK	131979	6	0	Low	VN		NT	-47.46	-0.027743	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	VL		NT	-48.71	-0.028474	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	VH		NT	-50.15	-0.029315	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	VN		NT	-14.92	-0.008722	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	VL		NT	-53.06	-0.031017	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	VH		NT	-20.16	-0.011785	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	VN		NT	-13.76	-0.007885	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	VL		NT	-9.03	-0.005175	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	VH		NT	-8.54	-0.004894	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	VN		NT	-5.24	-0.003003	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	VL		NT	-7.94	-0.004550	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	VH		NT	-8.87	-0.005083	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	VN		NT	13.65	0.007672	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	VL		NT	14.43	0.008110	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	VH		NT	12.66	0.007115	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	VN		NT	11.26	0.006328	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	VL		NT	10.70	0.006014	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	VH		NT	10.43	0.005862	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	VN		NT	8.21	0.004797	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	VL		NT	9.46	0.005527	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	VH		NT	-9.66	-0.005644	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	VN		NT	9.03	0.005276	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	VL		NT	6.58	0.003845	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	VH		NT	-12.25	-0.007157	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	VN		NT	-7.08	-0.004057	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	VL		NT	4.75	0.002722	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	VH		NT	-11.63	-0.006665	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	VN		NT	-7.58	-0.004344	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	VL		NT	-9.60	-0.005501	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	VH		NT	-6.90	-0.003954	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	VN		NT	-14.15	-0.007956	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	VL		NT	-17.12	-0.009626	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	VH		NT	-16.94	-0.009525	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	VN		NT	-17.58	-0.009885	±2.5	PASS

Band66	3MHz	16QAM	132657	6	0	High	VL	NT	-16.89	-0.009497	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	VH	NT	-17.77	-0.009992	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	VN	NT	-11.74	-0.006855	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	VL	NT	-11.62	-0.006785	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	VH	NT	-12.99	-0.007585	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	VN	NT	-10.69	-0.006242	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	VL	NT	-12.02	-0.007019	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	VH	NT	-12.77	-0.007457	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	VN	NT	3.92	0.002246	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	VL	NT	7.70	0.004413	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	VH	NT	9.00	0.005158	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	VN	NT	-6.90	-0.003954	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	VL	NT	6.87	0.003937	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	VH	NT	-4.55	-0.002607	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	VN	NT	12.19	0.006858	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	VL	NT	11.12	0.006256	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	VH	NT	8.17	0.004596	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	VN	NT	9.26	0.005210	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	VL	NT	10.34	0.005817	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	VH	NT	9.38	0.005277	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	VN	NT	13.82	0.008058	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	VL	NT	14.75	0.008601	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	VH	NT	12.27	0.007155	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	VN	NT	16.26	0.009481	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	VL	NT	14.45	0.008426	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	VH	NT	-24.49	-0.014280	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	VN	NT	14.82	0.008493	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	VL	NT	14.45	0.008281	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	VH	NT	13.92	0.007977	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	VN	NT	13.10	0.007507	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	VL	NT	13.42	0.007691	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	VH	NT	18.32	0.010499	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	VN	NT	14.75	0.008310	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	VL	NT	15.91	0.008963	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	VH	NT	12.16	0.006851	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	VN	NT	17.18	0.009679	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	VL	NT	15.86	0.008935	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	VH	NT	14.66	0.008259	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	VN	NT	15.19	0.008844	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	VL	NT	9.91	0.005770	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	VH	NT	9.47	0.005514	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	16QAM	132047	6	0	Low	VN	NT	13.29	0.007738	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	VL	NT	8.75	0.005095	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	VH	NT	10.23	0.005956	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	VN	NT	-8.13	-0.004659	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	VL	NT	-9.84	-0.005639	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	VH	NT	7.81	0.004476	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	VN	NT	-7.41	-0.004246	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	VL	NT	-9.24	-0.005295	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	VH	NT	-8.55	-0.004900	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	VN	NT	-8.85	-0.004993	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	VL	NT	-14.06	-0.007932	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	VH	NT	-12.57	-0.007092	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	VN	NT	-10.39	-0.005862	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	VL	NT	-12.19	-0.006877	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	VH	NT	-13.93	-0.007859	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	VN	NT	-11.43	-0.006645	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	VL	NT	-12.13	-0.007052	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	VH	NT	-12.42	-0.007221	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	VN	NT	-12.07	-0.007017	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	VL	NT	-10.33	-0.006006	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	VH	NT	-11.89	-0.006913	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	VN	NT	-9.14	-0.005238	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	VL	NT	-8.83	-0.005060	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	VH	NT	-8.08	-0.004630	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	VN	NT	-8.37	-0.004797	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	VL	NT	-7.95	-0.004556	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	VH	NT	-6.88	-0.003943	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	VN	NT	11.60	0.006554	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	VL	NT	11.54	0.006520	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	VH	NT	8.43	0.004763	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	VN	NT	9.64	0.005446	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	VL	NT	9.97	0.005633	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	VH	NT	10.67	0.006028	±2.5	PASS

Temperature												
Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	-30	-21.21	-0.012398	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	-20	-51.60	-0.030163	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	-10	-51.57	-0.030146	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	0	-50.28	-0.029391	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	1.4MHz	QPSK	131979	6	0	Low	NV	10	-17.67	-0.010329	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	20	-18.10	-0.010580	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	30	-24.06	-0.014064	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	40	-52.27	-0.030555	±2.5	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	NV	50	-20.03	-0.011709	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	-30	-51.84	-0.030303	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	-20	-18.85	-0.011019	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	-10	-51.38	-0.030034	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	0	-21.90	-0.012802	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	10	-16.95	-0.009908	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	20	-23.66	-0.013831	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	30	-54.66	-0.031952	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	40	-52.53	-0.030707	±2.5	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	NV	50	-20.20	-0.011808	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	-30	-14.19	-0.008132	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	-20	-8.65	-0.004957	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	-10	-7.12	-0.004080	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	0	-11.10	-0.006361	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	10	-8.75	-0.005014	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	20	-14.78	-0.008470	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	30	-9.04	-0.005181	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	40	-6.34	-0.003633	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	NV	50	-8.15	-0.004670	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	-30	-16.98	-0.009731	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	-20	-12.52	-0.007175	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	-10	-15.15	-0.008682	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	0	-9.34	-0.005352	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	10	-13.46	-0.007713	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	20	-8.04	-0.004607	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	30	-16.91	-0.009691	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	40	-14.45	-0.008281	±2.5	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	NV	50	-16.49	-0.009450	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	-30	11.27	0.006334	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	-20	10.09	0.005671	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	-10	10.43	0.005862	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	0	11.56	0.006497	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	10	9.08	0.005103	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	20	10.51	0.005907	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	30	10.09	0.005671	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	40	11.19	0.006289	±2.5	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	NV	50	12.95	0.007278	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	1.4MHz	16QAM	132665	6	0	High	NV	-30	9.93	0.005581	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	-20	10.91	0.006132	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	-10	10.70	0.006014	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	0	12.77	0.007177	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	10	11.12	0.006250	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	20	11.77	0.006615	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	30	12.55	0.007053	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	40	9.94	0.005586	±2.5	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	NV	50	12.02	0.006755	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	-30	-9.46	-0.005527	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	-20	8.24	0.004814	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	-10	8.55	0.004996	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	0	10.66	0.006228	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	10	-10.10	-0.005901	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	20	10.53	0.006152	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	30	-9.40	-0.005492	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	40	6.79	0.003967	±2.5	PASS
Band66	3MHz	QPSK	131987	6	0	Low	NV	50	-11.93	-0.006970	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	-30	8.25	0.004820	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	-20	-11.14	-0.006509	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	-10	-8.98	-0.005247	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	0	6.08	0.003552	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	10	9.57	0.005592	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	20	-10.51	-0.006141	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	30	12.63	0.007379	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	40	-13.56	-0.007923	±2.5	PASS
Band66	3MHz	16QAM	131987	6	0	Low	NV	50	8.58	0.005013	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	-30	-5.55	-0.003181	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	-20	-7.58	-0.004344	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	-10	-10.17	-0.005828	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	0	-7.28	-0.004172	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	10	-7.00	-0.004011	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	20	-5.39	-0.003089	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	30	4.85	0.002779	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	40	-7.25	-0.004155	±2.5	PASS
Band66	3MHz	QPSK	132322	6	0	Low	NV	50	5.46	0.003129	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	-30	-7.60	-0.004355	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	-20	-6.29	-0.003605	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	-10	-7.20	-0.004126	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	0	-8.41	-0.004819	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	10	-9.31	-0.005335	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	16QAM	132322	6	0	Low	NV	20	-7.42	-0.004252	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	30	-6.74	-0.003862	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	40	-8.61	-0.004934	±2.5	PASS
Band66	3MHz	16QAM	132322	6	0	Low	NV	50	-10.40	-0.005960	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	-30	-17.47	-0.009823	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	-20	-16.34	-0.009188	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	-10	-18.38	-0.010335	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	0	-16.92	-0.009514	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	10	-19.30	-0.010852	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	20	-16.78	-0.009435	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	30	-17.02	-0.009570	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	40	-19.48	-0.010953	±2.5	PASS
Band66	3MHz	QPSK	132657	6	0	High	NV	50	-15.49	-0.008710	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	-30	-19.18	-0.010784	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	-20	-19.20	-0.010796	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	-10	-17.37	-0.009767	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	0	-18.55	-0.010430	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	10	-17.82	-0.010020	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	20	-19.27	-0.010835	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	30	-21.07	-0.011847	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	40	-19.24	-0.010818	±2.5	PASS
Band66	3MHz	16QAM	132657	6	0	High	NV	50	-15.84	-0.008906	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	-30	-14.39	-0.008403	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	-20	-13.88	-0.008105	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	-10	-12.15	-0.007095	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	0	-10.59	-0.006184	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	10	-13.18	-0.007696	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	20	-12.99	-0.007585	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	30	-10.51	-0.006137	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	40	-12.72	-0.007428	±2.5	PASS
Band66	5MHz	QPSK	131997	6	0	Low	NV	50	-10.94	-0.006388	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	-30	-13.45	-0.007854	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	-20	-8.98	-0.005244	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	-10	-11.01	-0.006429	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	0	-10.59	-0.006184	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	10	-9.60	-0.005606	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	20	-12.46	-0.007276	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	30	-11.66	-0.006809	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	40	-9.54	-0.005571	±2.5	PASS
Band66	5MHz	16QAM	131997	6	0	Low	NV	50	-11.26	-0.006575	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	-30	6.95	0.003983	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	QPSK	132322	6	0	Low	NV	-20	6.67	0.003822	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	-10	6.14	0.003519	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	0	8.27	0.004739	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	10	6.71	0.003845	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	20	7.05	0.004040	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	30	7.84	0.004493	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	40	6.35	0.003639	±2.5	PASS
Band66	5MHz	QPSK	132322	6	0	Low	NV	50	8.04	0.004607	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	-30	5.09	0.002917	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	-20	7.60	0.004355	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	-10	7.93	0.004544	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	0	7.78	0.004458	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	10	7.67	0.004395	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	20	9.77	0.005599	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	30	5.46	0.003129	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	40	7.90	0.004527	±2.5	PASS
Band66	5MHz	16QAM	132322	6	0	Low	NV	50	7.42	0.004252	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	-30	9.61	0.005406	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	-20	12.45	0.007004	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	-10	10.53	0.005924	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	0	9.67	0.005440	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	10	9.33	0.005249	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	20	9.11	0.005125	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	30	10.21	0.005744	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	40	8.84	0.004973	±2.5	PASS
Band66	5MHz	QPSK	132647	6	0	High	NV	50	11.39	0.006408	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	-30	7.15	0.004023	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	-20	11.59	0.006520	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	-10	8.70	0.004895	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	0	7.17	0.004034	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	10	8.98	0.005052	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	20	10.27	0.005778	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	30	11.19	0.006295	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	40	12.60	0.007089	±2.5	PASS
Band66	5MHz	16QAM	132647	6	0	High	NV	50	9.30	0.005232	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	-30	12.62	0.007359	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	-20	18.95	0.011050	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	-10	13.53	0.007889	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	0	14.46	0.008431	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	10	13.69	0.007983	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	20	-23.23	-0.013545	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	QPSK	132022	6	0	Low	NV	30	14.71	0.008577	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	40	13.46	0.007848	±2.5	PASS
Band66	10MHz	QPSK	132022	6	0	Low	NV	50	14.63	0.008531	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	-30	13.02	0.007592	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	-20	14.38	0.008385	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	-10	15.62	0.009108	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	0	14.23	0.008297	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	10	14.73	0.008589	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	20	26.99	0.015738	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	30	15.94	0.009294	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	40	13.83	0.008064	±2.5	PASS
Band66	10MHz	16QAM	132022	6	0	Low	NV	50	14.23	0.008297	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	-30	13.86	0.007943	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	-20	13.95	0.007994	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	-10	14.13	0.008097	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	0	15.49	0.008877	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	10	14.68	0.008413	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	20	14.23	0.008155	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	30	14.59	0.008361	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	40	15.91	0.009117	±2.5	PASS
Band66	10MHz	QPSK	132322	6	0	Low	NV	50	15.66	0.008974	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	-30	17.62	0.010097	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	-20	16.51	0.009461	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	-10	14.02	0.008034	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	0	14.89	0.008533	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	10	14.45	0.008281	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	20	14.39	0.008246	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	30	15.42	0.008837	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	40	15.81	0.009060	±2.5	PASS
Band66	10MHz	16QAM	132322	6	0	Low	NV	50	15.62	0.008951	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	-30	12.04	0.006783	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	-20	12.40	0.006986	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	-10	14.41	0.008118	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	0	11.87	0.006687	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	10	14.18	0.007989	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	20	14.12	0.007955	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	30	14.61	0.008231	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	40	13.07	0.007363	±2.5	PASS
Band66	10MHz	QPSK	132622	6	0	High	NV	50	13.00	0.007324	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	-30	18.18	0.010242	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	-20	14.38	0.008101	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	16QAM	132622	6	0	High	NV	-10	15.56	0.008766	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	0	12.37	0.006969	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	10	13.15	0.007408	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	20	12.92	0.007279	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	30	11.90	0.006704	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	40	15.26	0.008597	±2.5	PASS
Band66	10MHz	16QAM	132622	6	0	High	NV	50	15.26	0.008597	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	-30	10.57	0.006154	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	-20	18.44	0.010737	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	-10	9.88	0.005753	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	0	11.30	0.006579	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	10	9.48	0.005520	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	20	10.19	0.005933	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	30	11.46	0.006672	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	40	10.83	0.006306	±2.5	PASS
Band66	15MHz	QPSK	132047	6	0	Low	NV	50	13.55	0.007889	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	-30	12.06	0.007022	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	-20	12.96	0.007546	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	-10	9.23	0.005374	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	0	8.81	0.005130	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	10	10.97	0.006387	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	20	10.34	0.006020	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	30	9.77	0.005689	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	40	12.13	0.007063	±2.5	PASS
Band66	15MHz	16QAM	132047	6	0	Low	NV	50	11.39	0.006632	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	-30	-7.65	-0.004384	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	-20	6.29	0.003605	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	-10	-8.57	-0.004911	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	0	-6.15	-0.003524	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	10	-7.14	-0.004092	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	20	7.25	0.004155	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	30	-8.24	-0.004722	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	40	-7.77	-0.004453	±2.5	PASS
Band66	15MHz	QPSK	132322	6	0	Low	NV	50	-9.88	-0.005662	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	-30	-8.73	-0.005003	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	-20	-9.34	-0.005352	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	-10	-8.20	-0.004699	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	0	8.75	0.005014	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	10	8.70	0.004986	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	20	-5.85	-0.003352	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	30	7.25	0.004155	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	16QAM	132322	6	0	Low	NV	40	-9.84	-0.005639	±2.5	PASS
Band66	15MHz	16QAM	132322	6	0	Low	NV	50	7.52	0.004309	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	-30	-12.16	-0.006860	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	-20	-12.27	-0.006922	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	-10	-11.66	-0.006578	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	0	-12.53	-0.007069	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	10	-13.38	-0.007549	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	20	-13.05	-0.007362	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	30	-10.93	-0.006166	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	40	-13.66	-0.007707	±2.5	PASS
Band66	15MHz	QPSK	132597	6	0	High	NV	50	-13.09	-0.007385	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	-30	-12.03	-0.006787	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	-20	-13.00	-0.007334	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	-10	-9.66	-0.005450	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	0	-11.93	-0.006731	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	10	-12.52	-0.007063	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	20	-12.03	-0.006787	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	30	-13.76	-0.007763	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	40	-11.22	-0.006330	±2.5	PASS
Band66	15MHz	16QAM	132597	6	0	High	NV	50	-13.98	-0.007887	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	-30	-9.74	-0.005663	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	-20	-11.67	-0.006785	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	-10	-13.68	-0.007953	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	0	-12.99	-0.007552	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	10	-12.57	-0.007308	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	20	-11.87	-0.006901	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	30	-14.45	-0.008401	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	40	-12.50	-0.007267	±2.5	PASS
Band66	20MHz	QPSK	132072	6	0	Low	NV	50	-11.74	-0.006826	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	-30	-13.06	-0.007593	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	-20	-11.74	-0.006826	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	-10	-12.65	-0.007355	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	0	-11.90	-0.006919	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	10	-10.36	-0.006023	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	20	-11.57	-0.006727	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	30	-10.56	-0.006140	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	40	-11.33	-0.006587	±2.5	PASS
Band66	20MHz	16QAM	132072	6	0	Low	NV	50	-12.55	-0.007297	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	-30	-8.43	-0.004831	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	-20	-7.05	-0.004040	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	-10	7.57	0.004338	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	20MHz	QPSK	132322	6	0	Low	NV	0	-8.65	-0.004957	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	10	-7.51	-0.004304	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	20	-6.78	-0.003885	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	30	-8.17	-0.004682	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	40	-7.38	-0.004229	±2.5	PASS
Band66	20MHz	QPSK	132322	6	0	Low	NV	50	-8.01	-0.004590	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	-30	6.97	0.003994	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	-20	-6.82	-0.003908	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	-10	-7.05	-0.004040	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	0	8.30	0.004756	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	10	-8.81	-0.005049	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	20	-7.51	-0.004304	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	30	-7.41	-0.004246	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	40	8.35	0.004785	±2.5	PASS
Band66	20MHz	16QAM	132322	6	0	Low	NV	50	5.78	0.003312	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	-30	11.03	0.006232	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	-20	9.51	0.005373	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	-10	10.10	0.005706	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	0	9.18	0.005186	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	10	10.31	0.005825	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	20	10.44	0.005898	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	30	12.17	0.006876	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	40	8.85	0.005000	±2.5	PASS
Band66	20MHz	QPSK	132572	6	0	High	NV	50	10.94	0.006181	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	-30	9.77	0.005520	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	-20	9.64	0.005446	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	-10	9.87	0.005576	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	0	9.63	0.005441	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	10	10.07	0.005689	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	20	8.73	0.004932	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	30	7.62	0.004305	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	40	10.24	0.005785	±2.5	PASS
Band66	20MHz	16QAM	132572	6	0	High	NV	50	9.47	0.005350	±2.5	PASS

---END---