

Appendix Test Data

Report No.:	1812C50023312504	Test Sample No.:	1-2-2
Start Test Date:	2025-1-16	Finish Test Date:	2025-5-16
Test Engineer:	Hu Sen Guan	Auditor:	Justin Feng
Temperature:	23.0°C	Relative Humidity:	46%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	19.32	5170.24	5189.56	---	---
11A	Ant2	5180	18.52	5170.68	5189.20	---	---
11A	Ant1	5200	19.04	5190.36	5209.40	---	---
11A	Ant2	5200	19.04	5190.40	5209.44	---	---
11A	Ant1	5240	18.96	5230.52	5249.48	---	---
11A	Ant2	5240	18.60	5230.72	5249.32	---	---
11A	Ant1	5260	18.92	5250.44	5269.36	---	---
11A	Ant2	5260	19.08	5250.36	5269.44	---	---
11A	Ant1	5280	19.04	5270.44	5289.48	---	---
11A	Ant2	5280	18.60	5270.56	5289.16	---	---
11A	Ant1	5320	18.80	5310.40	5329.20	---	---
11A	Ant2	5320	18.80	5310.60	5329.40	---	---
11A	Ant1	5500	19.20	5490.40	5509.60	---	---
11A	Ant2	5500	19.00	5490.52	5509.52	---	---
11A	Ant1	5580	19.00	5570.44	5589.44	---	---
11A	Ant2	5580	19.16	5570.32	5589.48	---	---
11A	Ant1	5700	19.00	5690.64	5709.64	---	---
11A	Ant2	5700	18.68	5690.40	5709.08	---	---
11A	Ant1	5745	18.64	5735.68	5754.32	---	---
11A	Ant2	5745	19.12	5735.36	5754.48	---	---
11A	Ant1	5785	19.08	5775.40	5794.48	---	---
11A	Ant2	5785	18.56	5775.48	5794.04	---	---
11A	Ant1	5825	18.88	5815.56	5834.44	---	---
11A	Ant2	5825	18.64	5815.76	5834.40	---	---

11N20MIMO	Ant1	5180	19.92	5169.92	5189.84	---	---
11N20MIMO	Ant2	5180	19.52	5170.08	5189.60	---	---
11N20MIMO	Ant1	5200	19.88	5189.96	5209.84	---	---
11N20MIMO	Ant2	5200	19.56	5190.00	5209.56	---	---
11N20MIMO	Ant1	5240	20.12	5229.92	5250.04	---	---
11N20MIMO	Ant2	5240	19.40	5230.16	5249.56	---	---
11N20MIMO	Ant1	5260	19.64	5250.28	5269.92	---	---
11N20MIMO	Ant2	5260	19.36	5250.24	5269.60	---	---
11N20MIMO	Ant1	5280	19.44	5270.20	5289.64	---	---
11N20MIMO	Ant2	5280	19.28	5270.44	5289.72	---	---
11N20MIMO	Ant1	5320	19.28	5310.36	5329.64	---	---
11N20MIMO	Ant2	5320	19.40	5310.28	5329.68	---	---
11N20MIMO	Ant1	5500	19.80	5490.08	5509.88	---	---
11N20MIMO	Ant2	5500	19.60	5490.24	5509.84	---	---
11N20MIMO	Ant1	5580	19.64	5570.20	5589.84	---	---
11N20MIMO	Ant2	5580	19.12	5570.36	5589.48	---	---
11N20MIMO	Ant1	5700	20.04	5689.92	5709.96	---	---
11N20MIMO	Ant2	5700	19.36	5690.24	5709.60	---	---
11N20MIMO	Ant1	5745	19.40	5735.36	5754.76	---	---
11N20MIMO	Ant2	5745	19.08	5735.32	5754.40	---	---
11N20MIMO	Ant1	5785	19.12	5775.44	5794.56	---	---
11N20MIMO	Ant2	5785	19.80	5774.92	5794.72	---	---
11N20MIMO	Ant1	5825	19.20	5815.28	5834.48	---	---
11N20MIMO	Ant2	5825	19.60	5815.20	5834.80	---	---
11N40MIMO	Ant1	5190	39.36	5170.24	5209.60	---	---
11N40MIMO	Ant2	5190	39.20	5170.24	5209.44	---	---
11N40MIMO	Ant1	5230	39.60	5210.24	5249.84	---	---
11N40MIMO	Ant2	5230	38.80	5210.48	5249.28	---	---
11N40MIMO	Ant1	5270	38.64	5250.72	5289.36	---	---
11N40MIMO	Ant2	5270	38.80	5250.88	5289.68	---	---
11N40MIMO	Ant1	5310	38.64	5290.80	5329.44	---	---
11N40MIMO	Ant2	5310	39.36	5290.80	5330.16	---	---
11N40MIMO	Ant1	5510	39.28	5490.32	5529.60	---	---
11N40MIMO	Ant2	5510	39.04	5490.48	5529.52	---	---
11N40MIMO	Ant1	5550	39.28	5530.48	5569.76	---	---
11N40MIMO	Ant2	5550	38.64	5530.32	5568.96	---	---
11N40MIMO	Ant1	5670	38.96	5650.48	5689.44	---	---
11N40MIMO	Ant2	5670	38.48	5651.04	5689.52	---	---
11N40MIMO	Ant1	5755	38.64	5735.64	5774.28	---	---
11N40MIMO	Ant2	5755	38.48	5735.88	5774.36	---	---
11N40MIMO	Ant1	5795	38.64	5775.72	5814.36	---	---
11N40MIMO	Ant2	5795	40.56	5775.32	5815.88	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20MIMO	Ant1	5180	19.64	5170.16	5189.80	---	---
11AC20MIMO	Ant2	5180	19.36	5170.32	5189.68	---	---
11AC20MIMO	Ant1	5200	19.36	5190.24	5209.60	---	---
11AC20MIMO	Ant2	5200	19.88	5189.88	5209.76	---	---
11AC20MIMO	Ant1	5240	19.48	5230.20	5249.68	---	---
11AC20MIMO	Ant2	5240	19.80	5229.88	5249.68	---	---
11AC20MIMO	Ant1	5260	19.52	5250.24	5269.76	---	---
11AC20MIMO	Ant2	5260	19.16	5250.40	5269.56	---	---
11AC20MIMO	Ant1	5280	19.36	5270.32	5289.68	---	---
11AC20MIMO	Ant2	5280	19.72	5270.24	5289.96	---	---
11AC20MIMO	Ant1	5320	19.40	5310.20	5329.60	---	---
11AC20MIMO	Ant2	5320	19.36	5310.40	5329.76	---	---
11AC20MIMO	Ant1	5500	19.12	5490.28	5509.40	---	---
11AC20MIMO	Ant2	5500	19.44	5490.32	5509.76	---	---
11AC20MIMO	Ant1	5580	19.16	5570.44	5589.60	---	---
11AC20MIMO	Ant2	5580	19.32	5570.28	5589.60	---	---
11AC20MIMO	Ant1	5700	19.64	5690.12	5709.76	---	---
11AC20MIMO	Ant2	5700	19.24	5690.28	5709.52	---	---
11AC20MIMO	Ant1	5745	19.04	5735.40	5754.44	---	---
11AC20MIMO	Ant2	5745	19.36	5735.12	5754.48	---	---
11AC20MIMO	Ant1	5785	19.52	5775.24	5794.76	---	---
11AC20MIMO	Ant2	5785	19.60	5775.20	5794.80	---	---
11AC20MIMO	Ant1	5825	19.44	5815.20	5834.64	---	---
11AC20MIMO	Ant2	5825	19.60	5815.12	5834.72	---	---
11AC40MIMO	Ant1	5190	38.64	5170.80	5209.44	---	---
11AC40MIMO	Ant2	5190	38.48	5170.48	5208.96	---	---
11AC40MIMO	Ant1	5230	38.64	5210.56	5249.20	---	---
11AC40MIMO	Ant2	5230	38.64	5210.48	5249.12	---	---
11AC40MIMO	Ant1	5270	38.56	5250.64	5289.20	---	---
11AC40MIMO	Ant2	5270	38.88	5250.56	5289.44	---	---
11AC40MIMO	Ant1	5310	38.56	5290.64	5329.20	---	---
11AC40MIMO	Ant2	5310	38.16	5291.04	5329.20	---	---
11AC40MIMO	Ant1	5510	39.12	5490.48	5529.60	---	---
11AC40MIMO	Ant2	5510	38.16	5490.96	5529.12	---	---
11AC40MIMO	Ant1	5550	38.96	5530.56	5569.52	---	---
11AC40MIMO	Ant2	5550	38.64	5530.32	5568.96	---	---
11AC40MIMO	Ant1	5670	38.64	5650.64	5689.28	---	---
11AC40MIMO	Ant2	5670	38.48	5651.20	5689.68	---	---
11AC40MIMO	Ant1	5755	38.80	5735.56	5774.36	---	---
11AC40MIMO	Ant2	5755	38.88	5735.48	5774.36	---	---
11AC40MIMO	Ant1	5795	37.92	5775.88	5813.80	---	---
11AC40MIMO	Ant2	5795	38.96	5775.24	5814.20	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC80MIMO	Ant1	5210	79.52	5170.00	5249.52	---	---
11AC80MIMO	Ant2	5210	79.52	5170.16	5249.68	---	---
11AC80MIMO	Ant1	5290	80.16	5249.84	5330.00	---	---
11AC80MIMO	Ant2	5290	80.64	5250.00	5330.64	---	---
11AC80MIMO	Ant1	5530	79.52	5490.32	5569.84	---	---
11AC80MIMO	Ant2	5530	79.52	5490.16	5569.68	---	---
11AC80MIMO	Ant1	5610	79.52	5570.16	5649.68	---	---
11AC80MIMO	Ant2	5610	79.52	5570.16	5649.68	---	---
11AC80MIMO	Ant1	5775	79.84	5735.00	5814.84	---	---
11AC80MIMO	Ant2	5775	79.04	5735.32	5814.36	---	---
11AX20MIMO	Ant1	5180	20.00	5169.96	5189.96	---	---
11AX20MIMO	Ant2	5180	20.96	5170.00	5190.96	---	---
11AX20MIMO	Ant1	5200	19.80	5190.00	5209.80	---	---
11AX20MIMO	Ant2	5200	19.96	5189.92	5209.88	---	---
11AX20MIMO	Ant1	5240	20.04	5229.84	5249.88	---	---
11AX20MIMO	Ant2	5240	20.12	5229.84	5249.96	---	---
11AX20MIMO	Ant1	5260	19.76	5250.00	5269.76	---	---
11AX20MIMO	Ant2	5260	20.00	5249.92	5269.92	---	---
11AX20MIMO	Ant1	5280	20.04	5269.80	5289.84	---	---
11AX20MIMO	Ant2	5280	19.88	5269.92	5289.80	---	---
11AX20MIMO	Ant1	5320	19.80	5310.04	5329.84	---	---
11AX20MIMO	Ant2	5320	19.88	5309.92	5329.80	---	---
11AX20MIMO	Ant1	5500	19.88	5489.92	5509.80	---	---
11AX20MIMO	Ant2	5500	19.88	5489.96	5509.84	---	---
11AX20MIMO	Ant1	5580	19.84	5569.92	5589.76	---	---
11AX20MIMO	Ant2	5580	20.52	5569.88	5590.40	---	---
11AX20MIMO	Ant1	5700	19.84	5689.92	5709.76	---	---
11AX20MIMO	Ant2	5700	19.88	5689.88	5709.76	---	---
11AX20MIMO	Ant1	5745	19.84	5734.88	5754.72	---	---
11AX20MIMO	Ant2	5745	19.88	5735.04	5754.92	---	---
11AX20MIMO	Ant1	5785	20.00	5774.88	5794.88	---	---
11AX20MIMO	Ant2	5785	19.88	5774.84	5794.72	---	---
11AX20MIMO	Ant1	5825	19.88	5814.96	5834.84	---	---
11AX20MIMO	Ant2	5825	20.84	5814.24	5835.08	---	---
11AX40MIMO	Ant1	5190	39.28	5170.16	5209.44	---	---
11AX40MIMO	Ant2	5190	39.20	5170.32	5209.52	---	---
11AX40MIMO	Ant1	5230	39.28	5210.24	5249.52	---	---
11AX40MIMO	Ant2	5230	39.28	5210.24	5249.52	---	---
11AX40MIMO	Ant1	5270	39.44	5250.32	5289.76	---	---
11AX40MIMO	Ant2	5270	39.28	5250.24	5289.52	---	---
11AX40MIMO	Ant1	5310	39.36	5290.24	5329.60	---	---
11AX40MIMO	Ant2	5310	39.12	5290.16	5329.28	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX40MIMO	Ant1	5510	39.12	5490.32	5529.44	---	---
11AX40MIMO	Ant2	5510	39.36	5490.08	5529.44	---	---
11AX40MIMO	Ant1	5550	39.28	5530.24	5569.52	---	---
11AX40MIMO	Ant2	5550	39.68	5530.24	5569.92	---	---
11AX40MIMO	Ant1	5670	39.36	5650.16	5689.52	---	---
11AX40MIMO	Ant2	5670	39.52	5650.08	5689.60	---	---
11AX40MIMO	Ant1	5755	39.44	5735.08	5774.52	---	---
11AX40MIMO	Ant2	5755	39.28	5735.40	5774.68	---	---
11AX40MIMO	Ant1	5795	39.36	5775.16	5814.52	---	---
11AX40MIMO	Ant2	5795	39.28	5775.24	5814.52	---	---
11AX80MIMO	Ant1	5210	80.80	5169.84	5250.64	---	---
11AX80MIMO	Ant2	5210	80.48	5169.68	5250.16	---	---
11AX80MIMO	Ant2	5290	80.80	5249.36	5330.16	---	---
11AX80MIMO	Ant1	5290	80.16	5249.84	5330.00	---	---
11AX80MIMO	Ant1	5530	80.96	5488.88	5569.84	---	---
11AX80MIMO	Ant2	5530	80.00	5489.84	5569.84	---	---
11AX80MIMO	Ant1	5610	80.48	5570.00	5650.48	---	---
11AX80MIMO	Ant2	5610	80.96	5569.52	5650.48	---	---
11AX80MIMO	Ant1	5775	80.96	5734.36	5815.32	---	---
11AX80MIMO	Ant2	5775	80.80	5734.36	5815.16	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

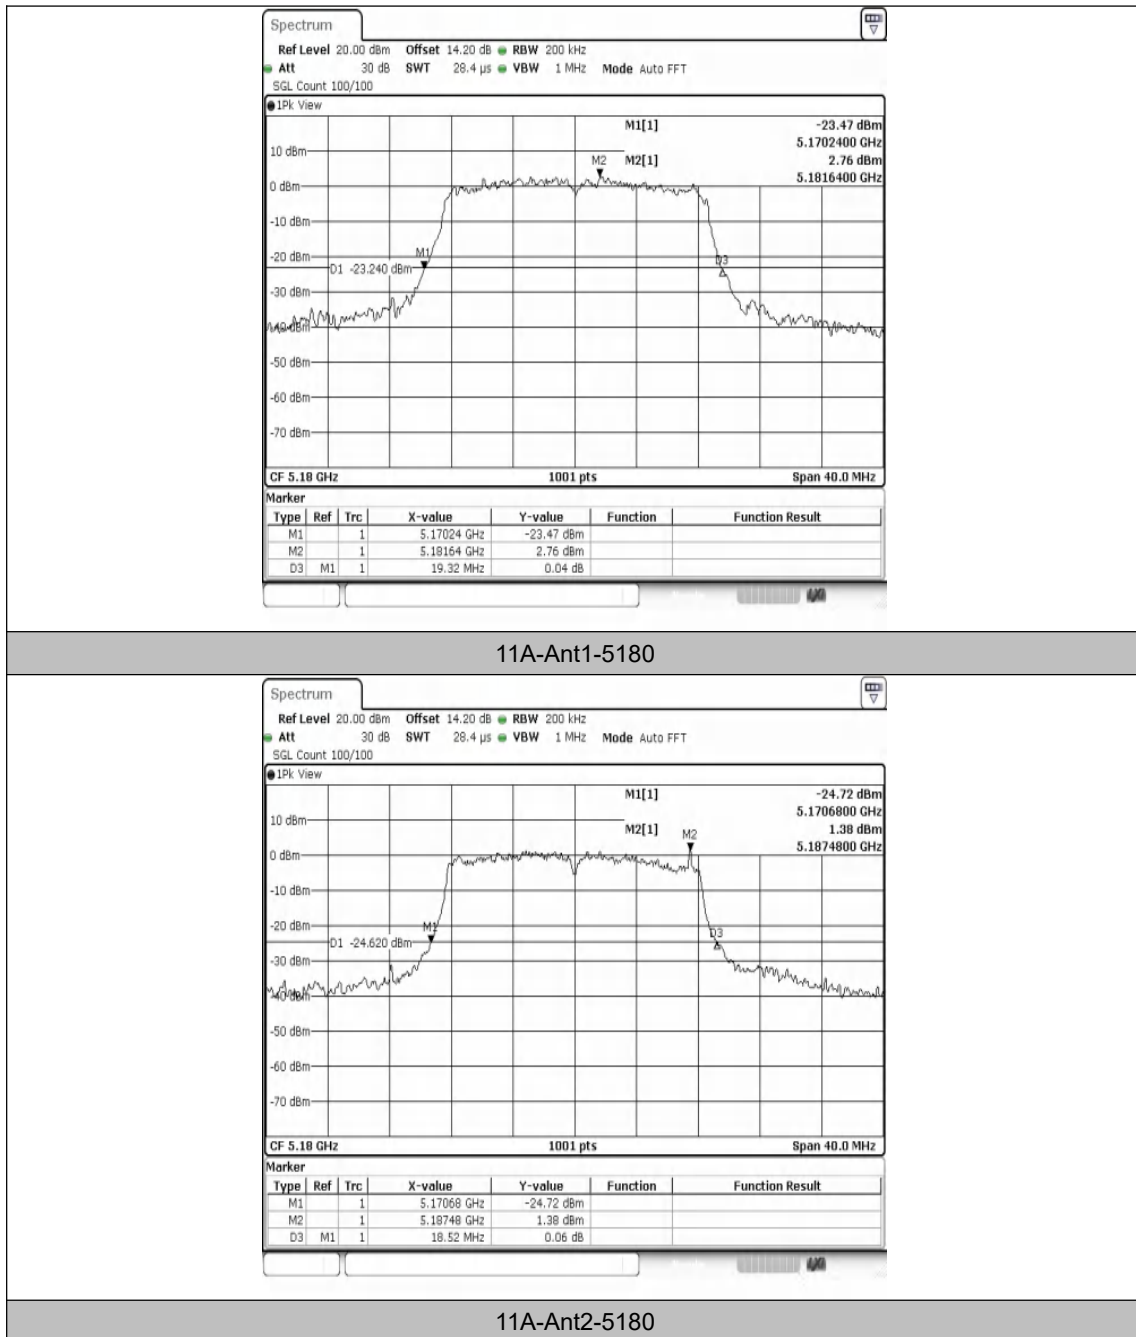


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

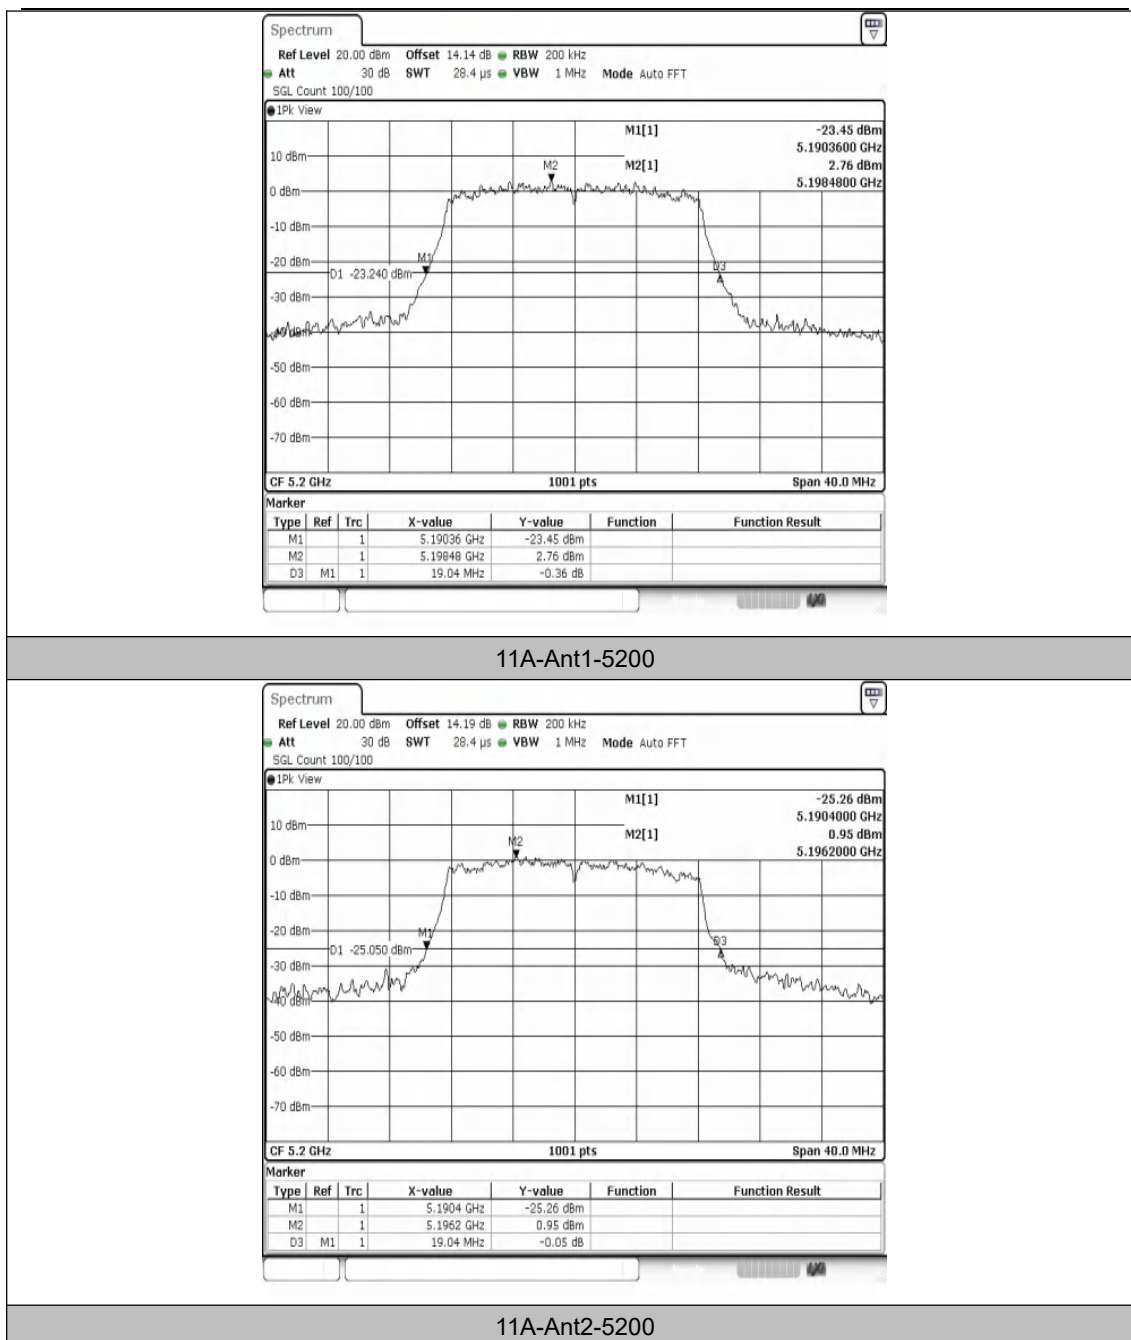

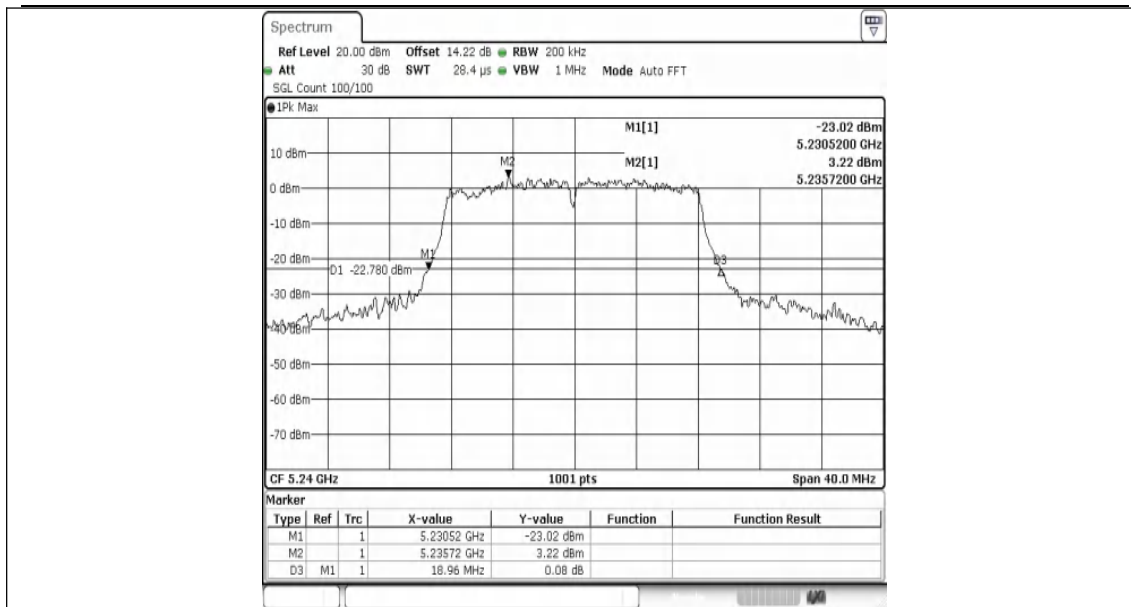

11A-Ant1-5240

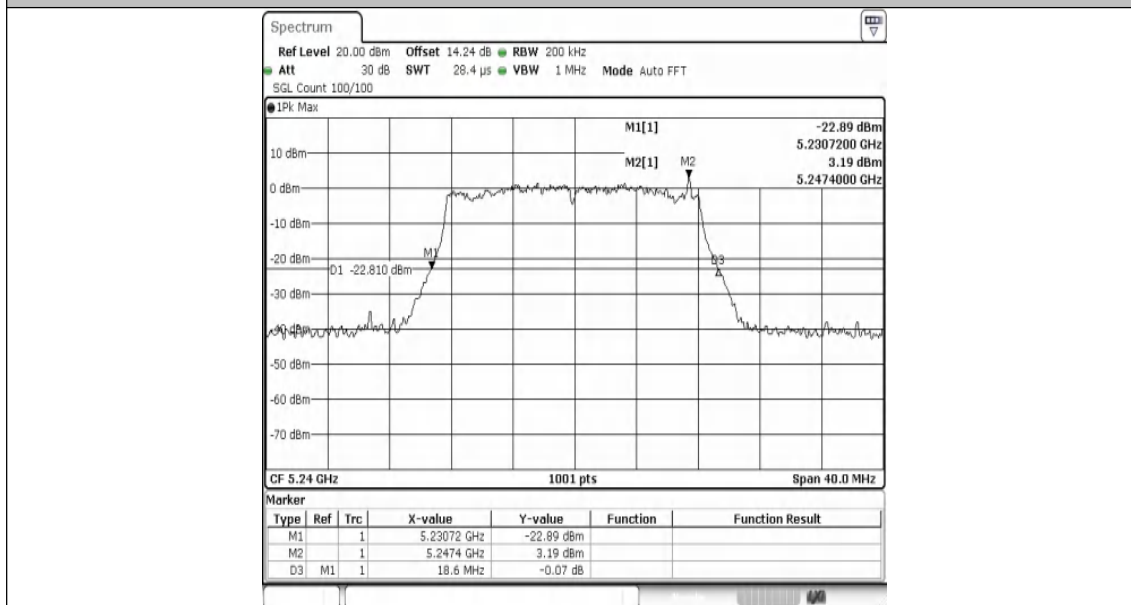


11A-Ant2-5240


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

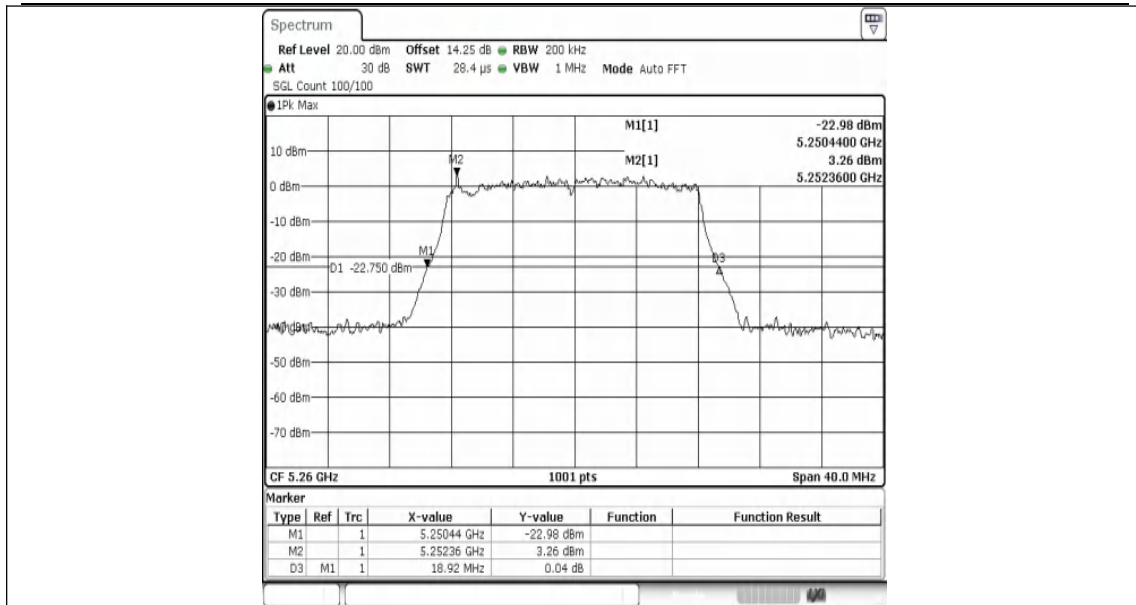


11A-Ant1-5260

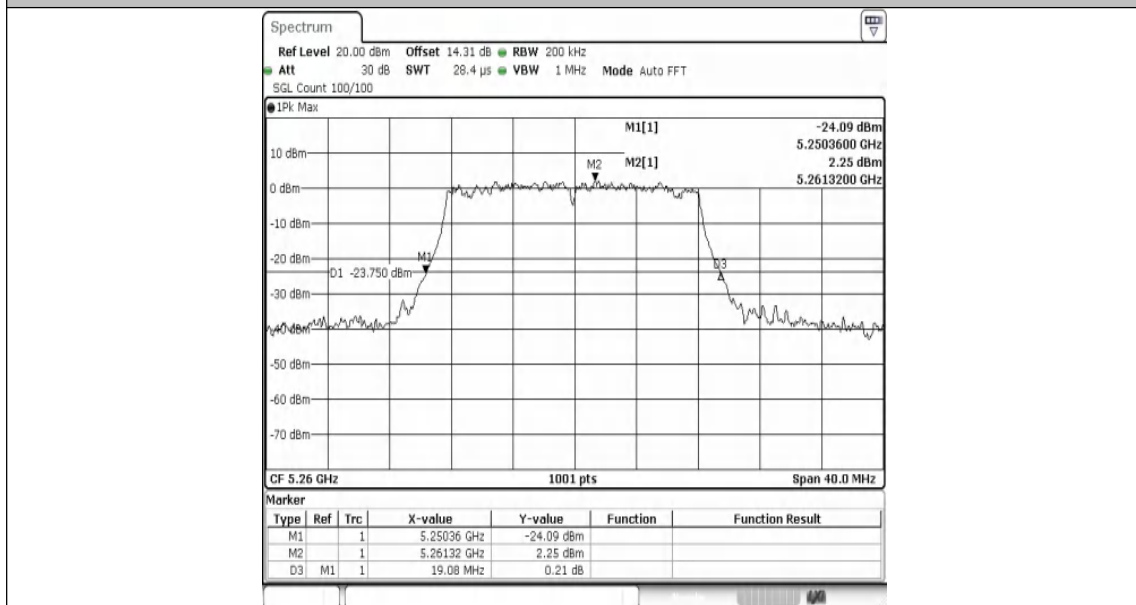


11A-Ant2-5260

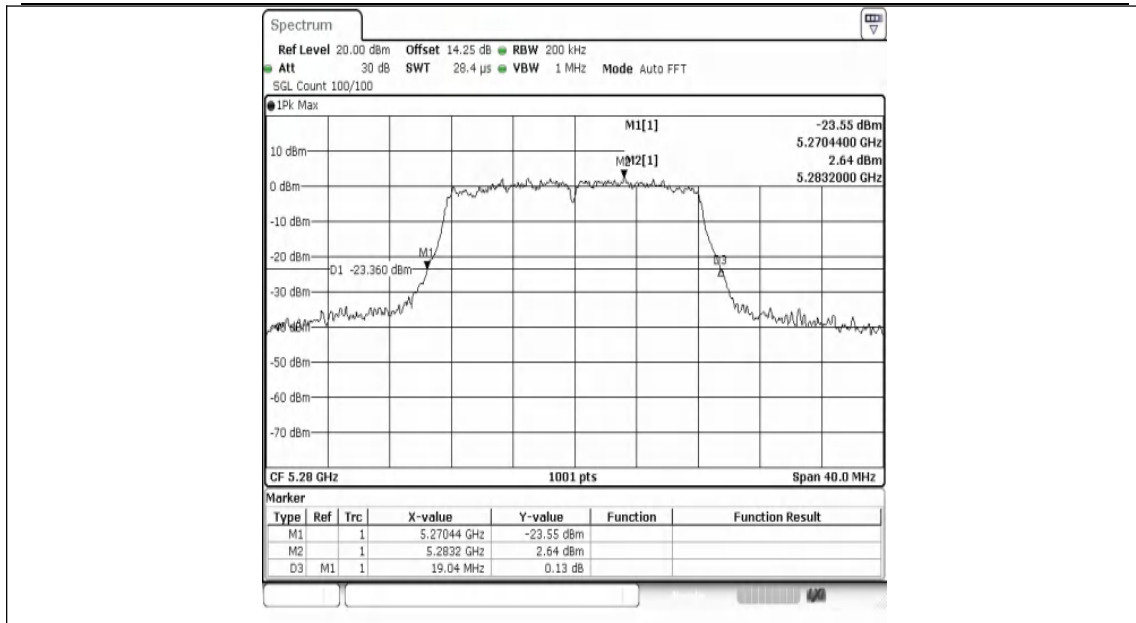


11A-Ant1-5280

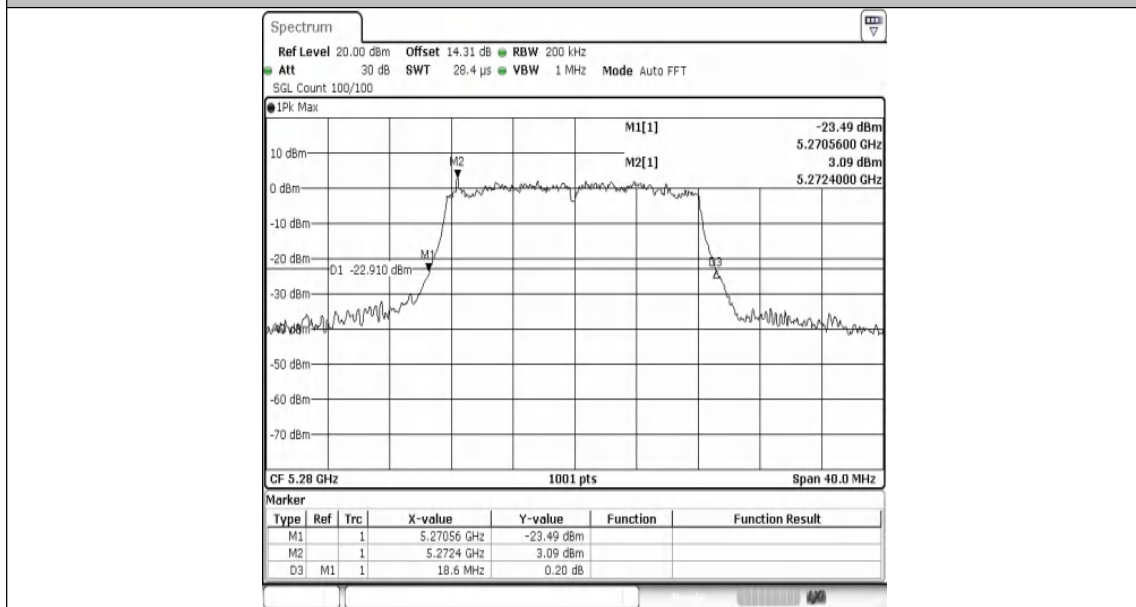


11A-Ant2-5280

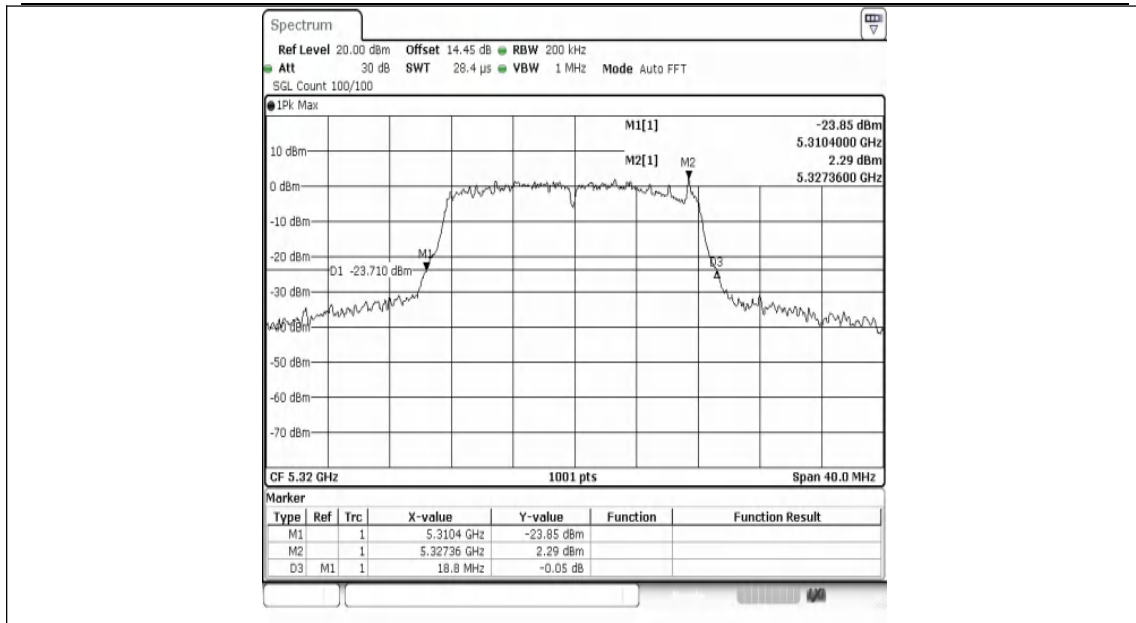


11A-Ant1-5320

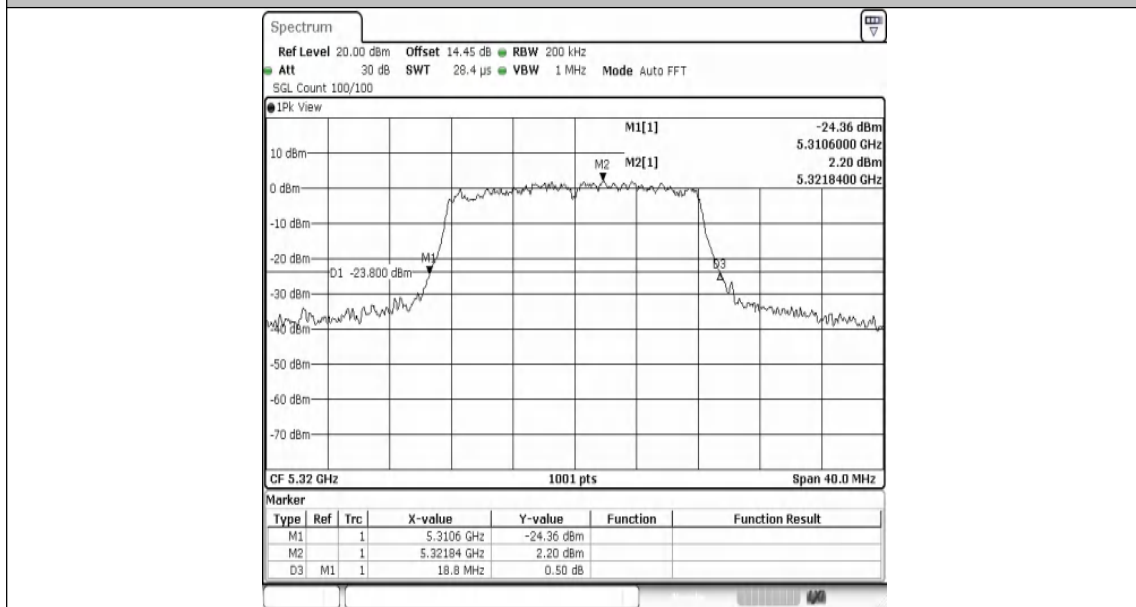


11A-Ant2-5320

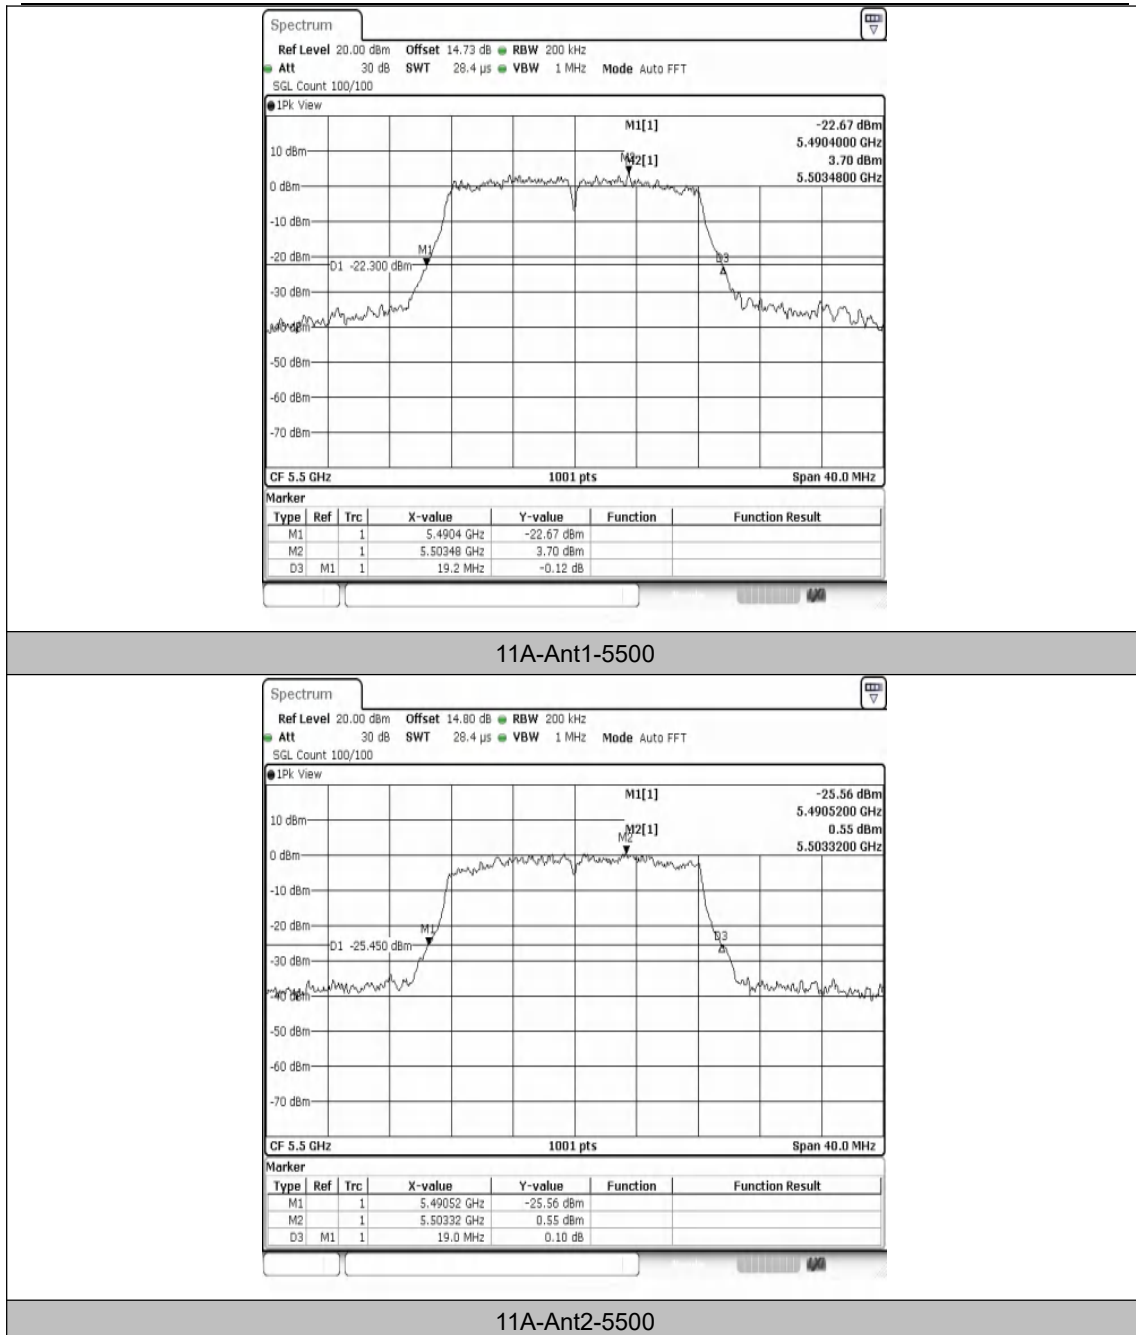


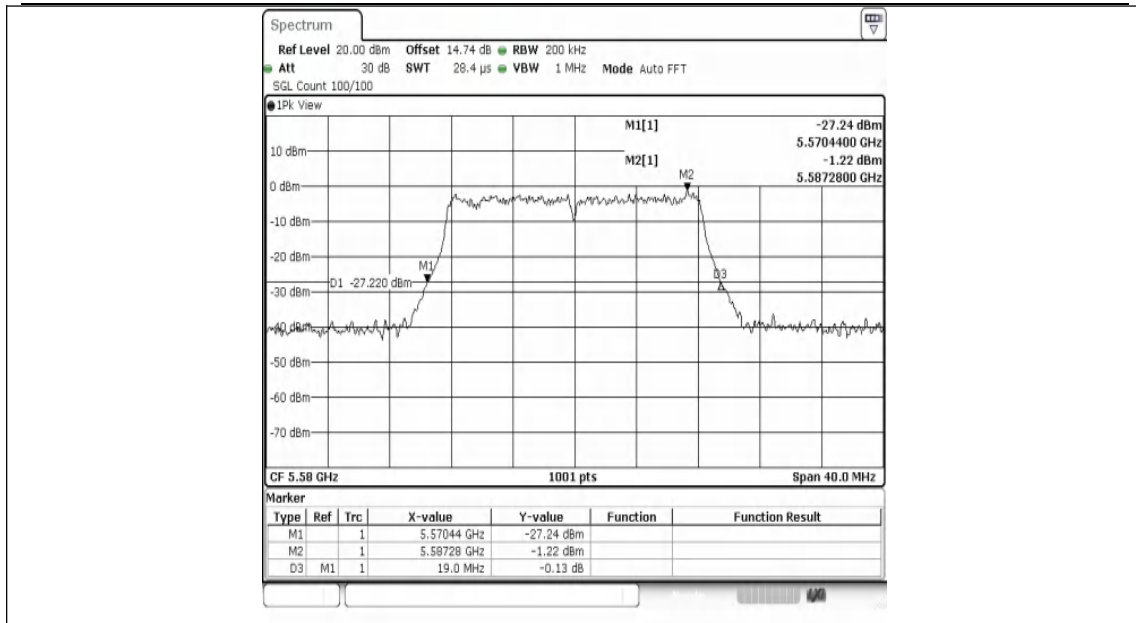

11A-Ant1-5580

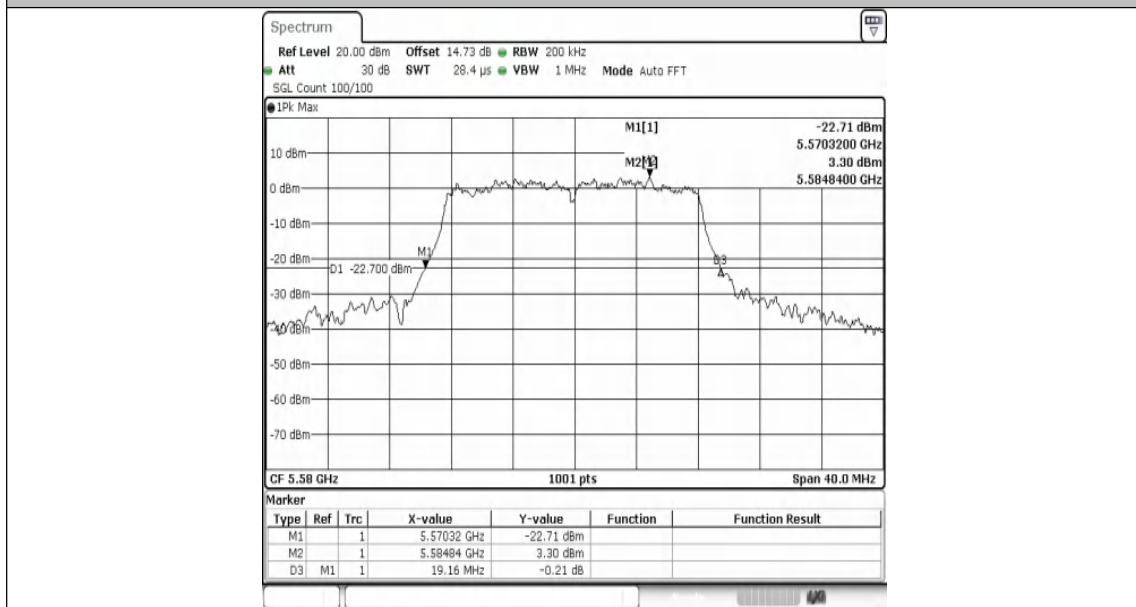


11A-Ant2-5580

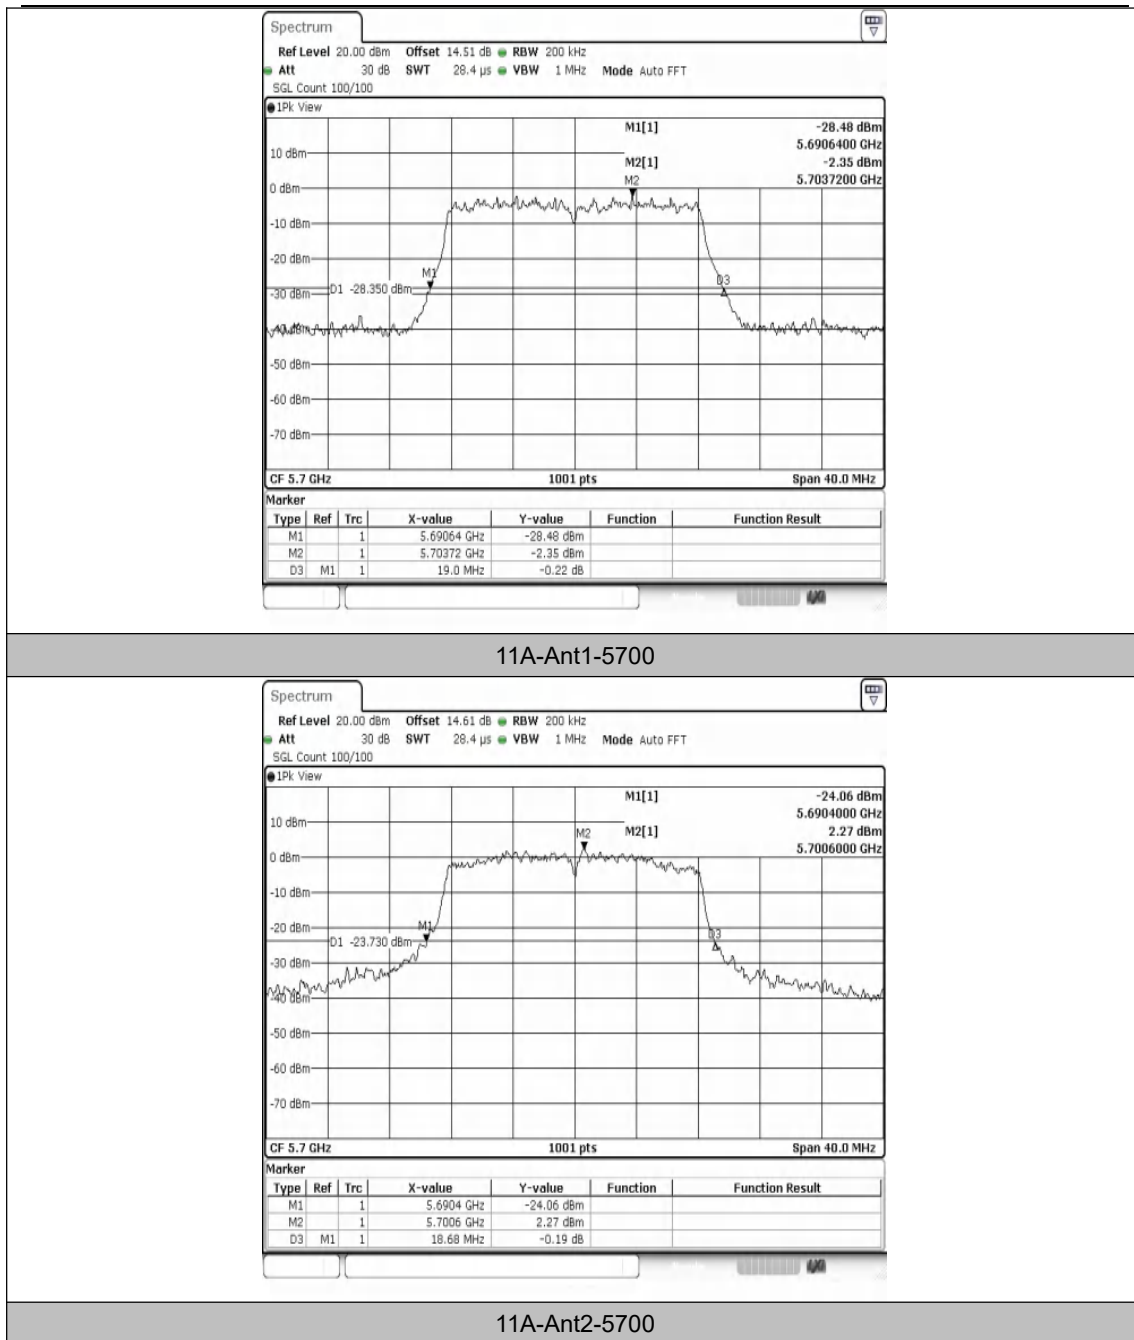


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

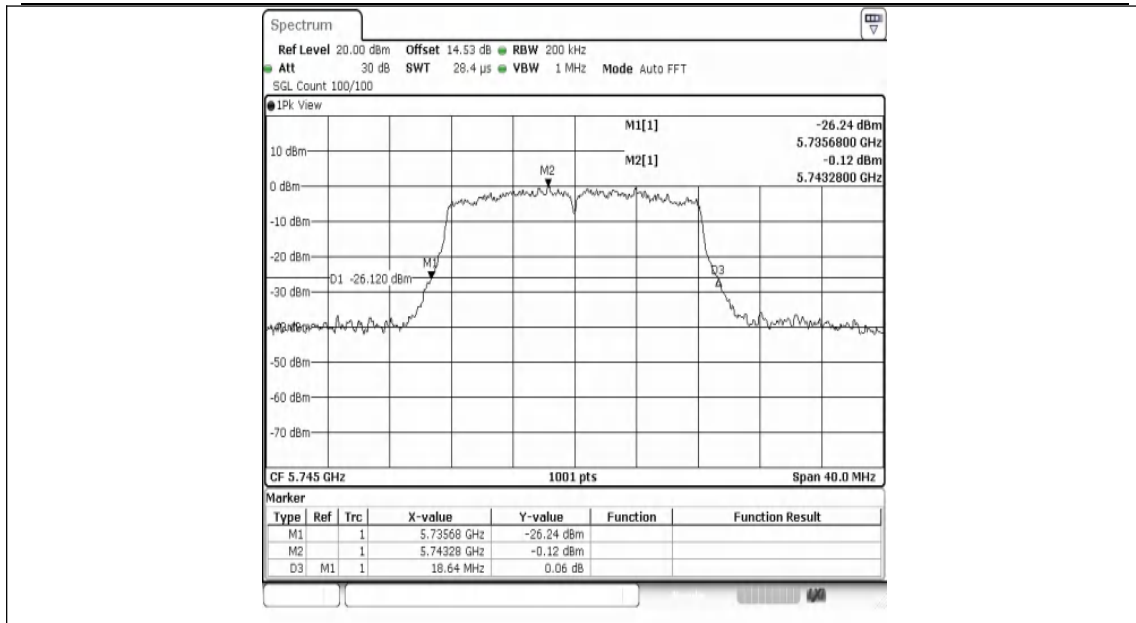


11A-Ant1-5745

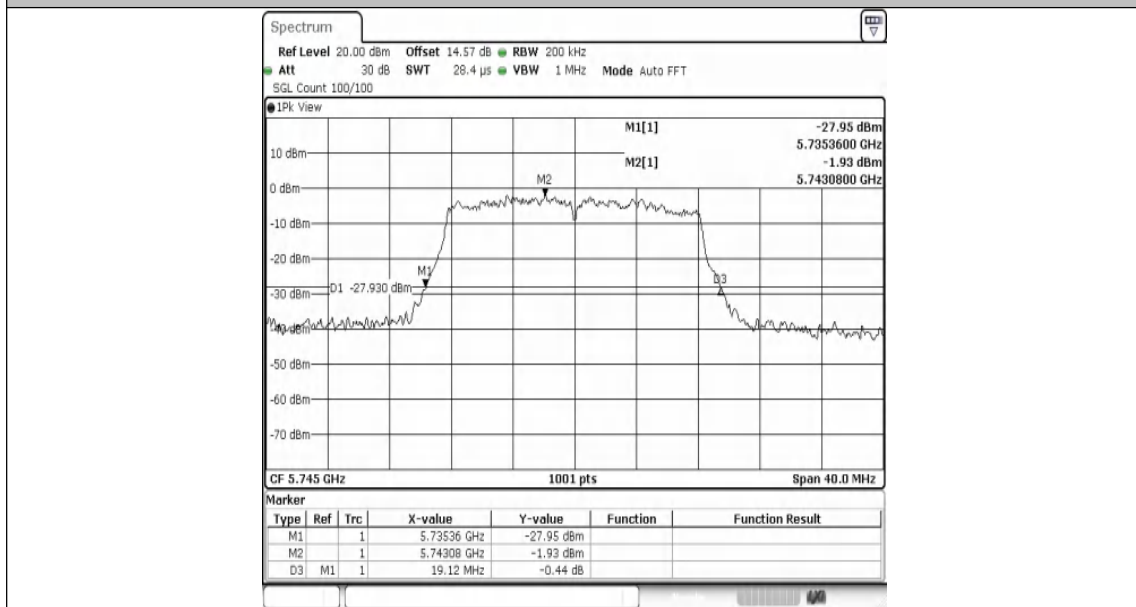


11A-Ant2-5745

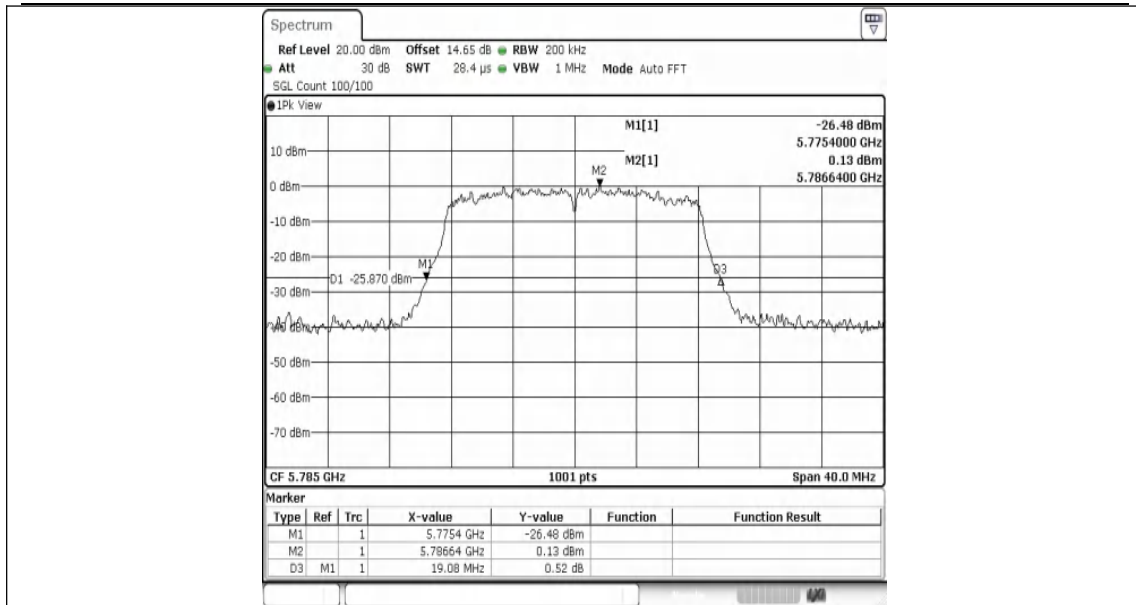


11A-Ant1-5785

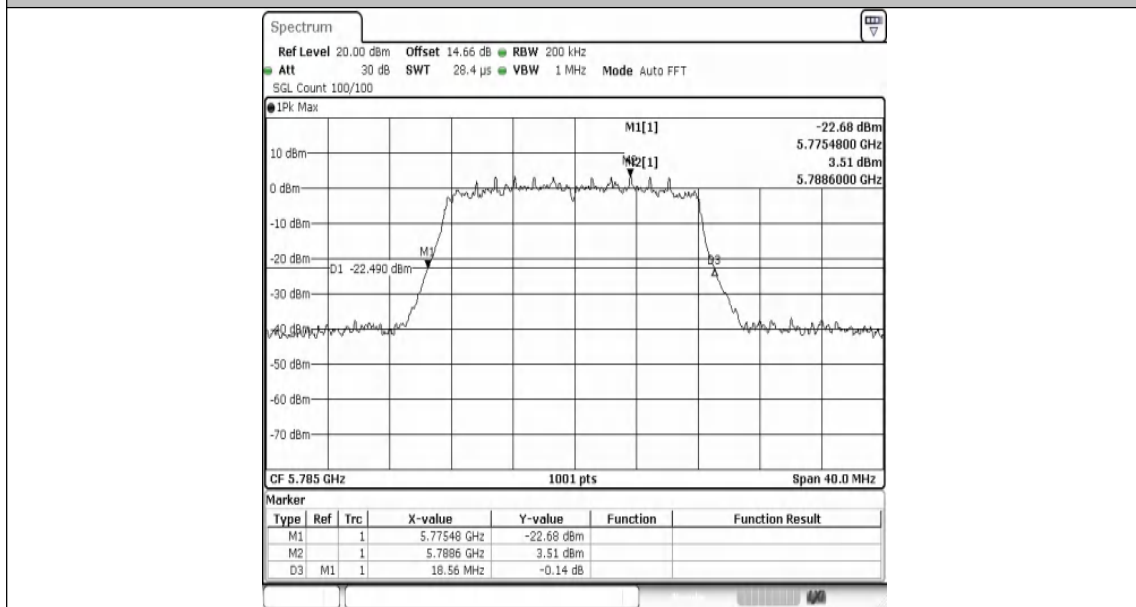


11A-Ant2-5785

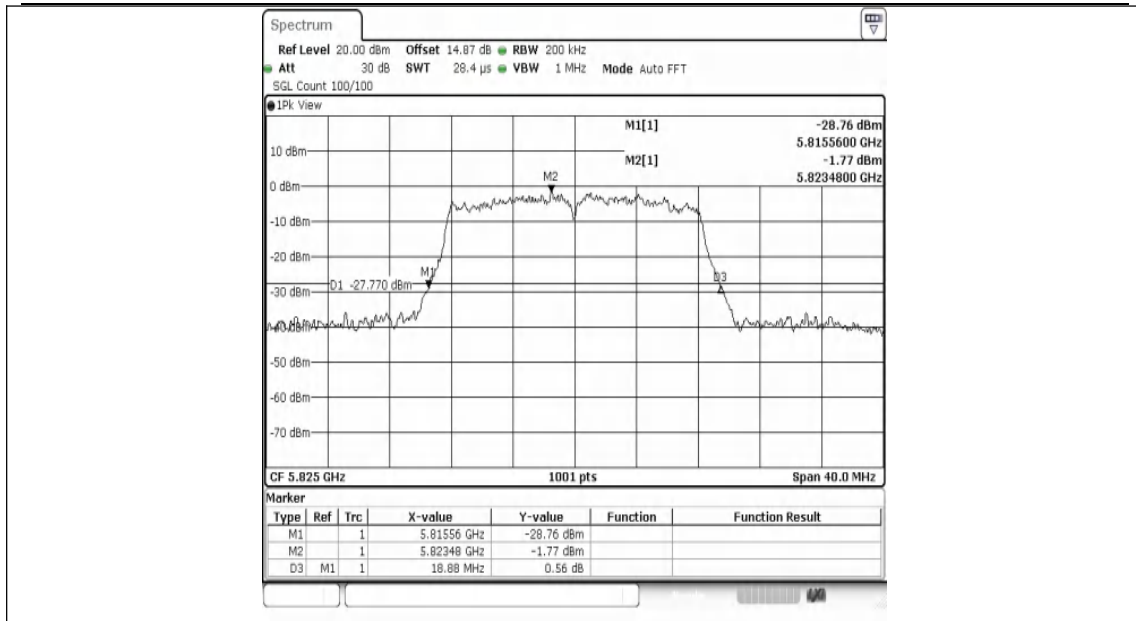


11A-Ant1-5825

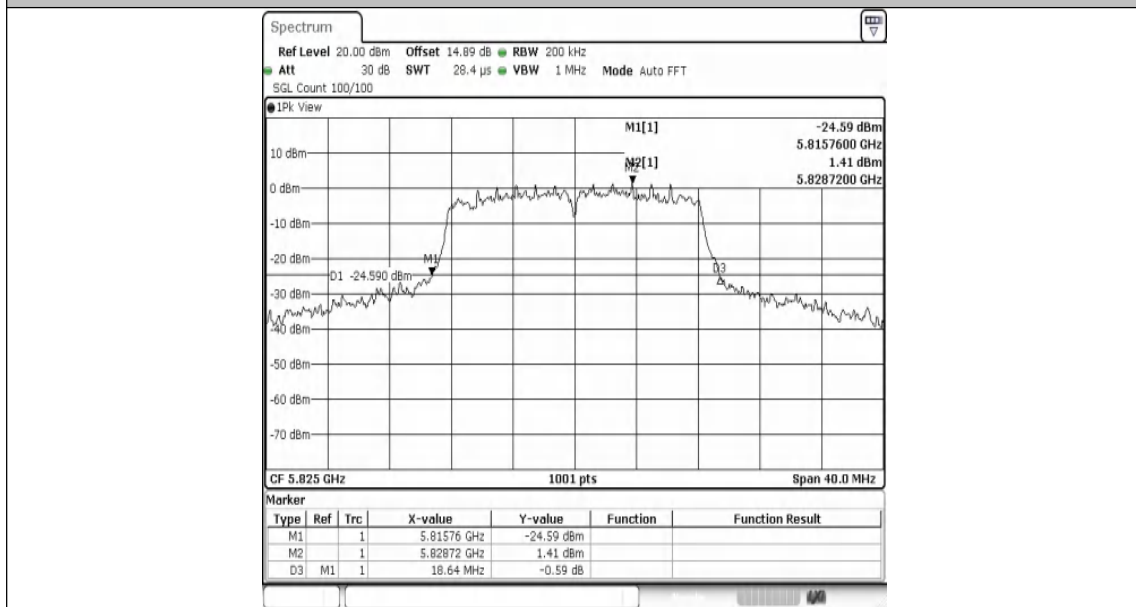


11A-Ant2-5825

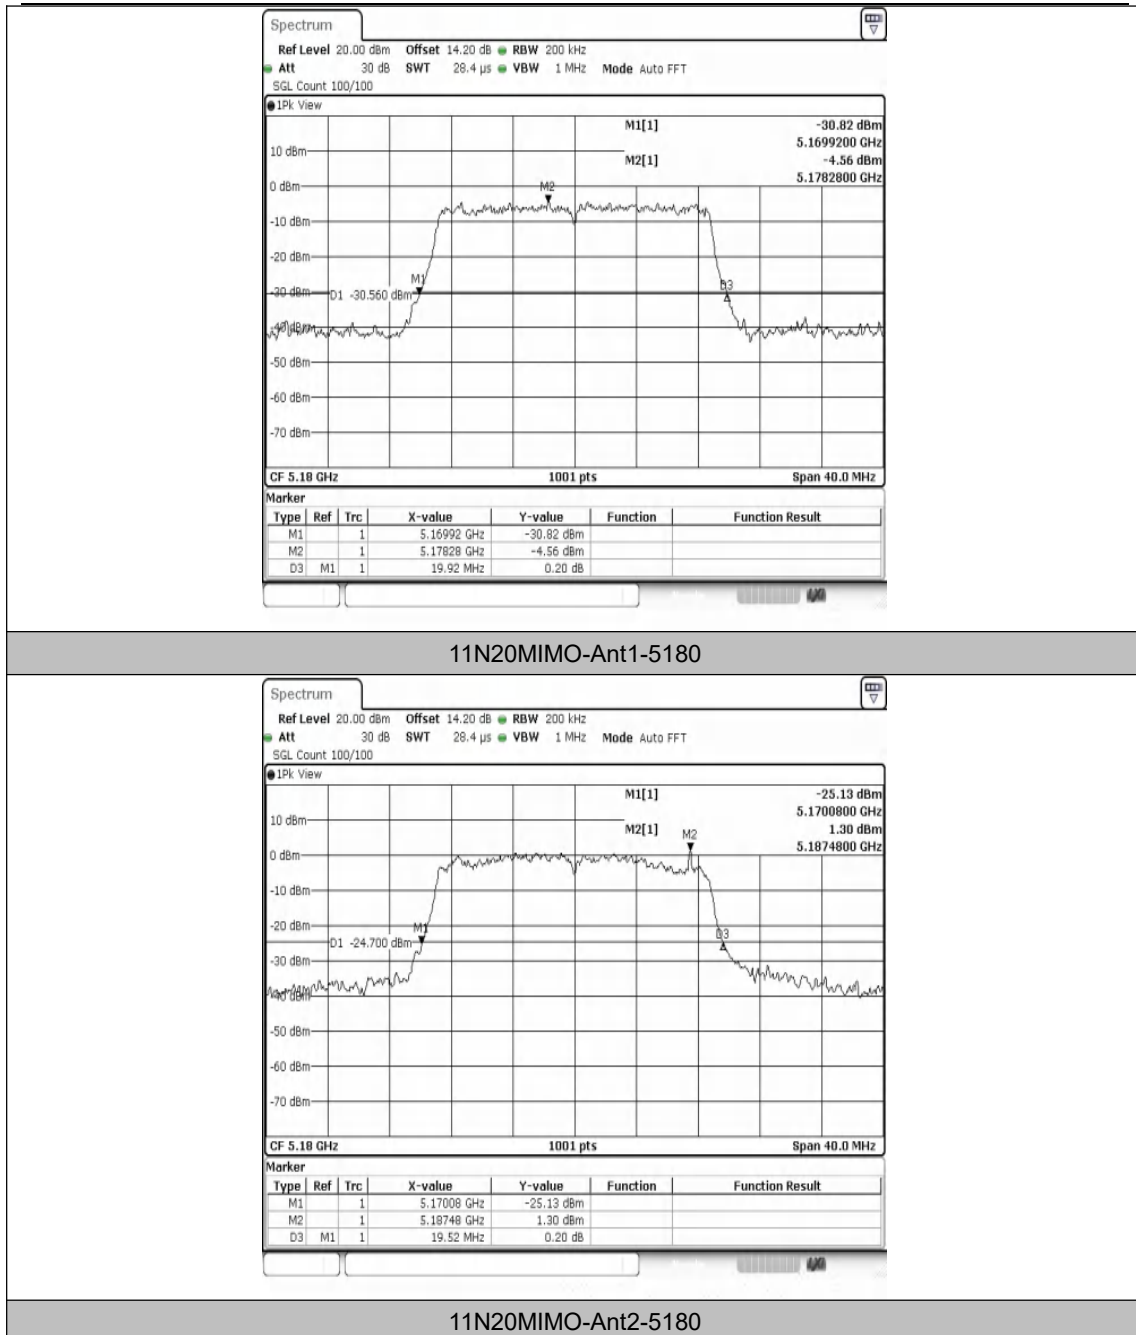


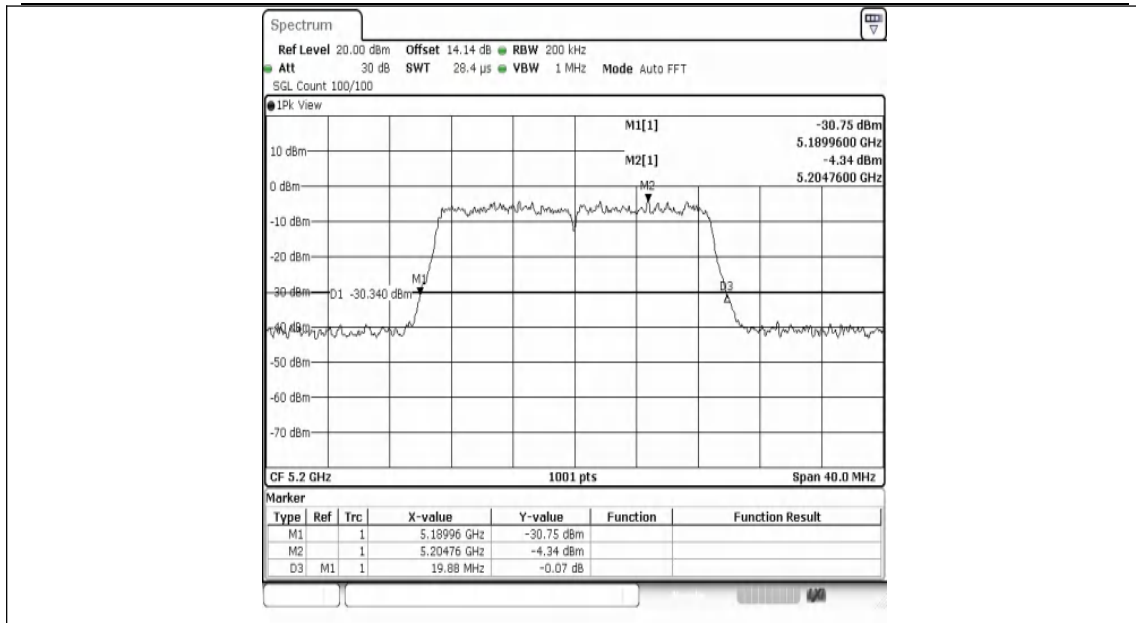



11N20MIMO-Ant1-5200

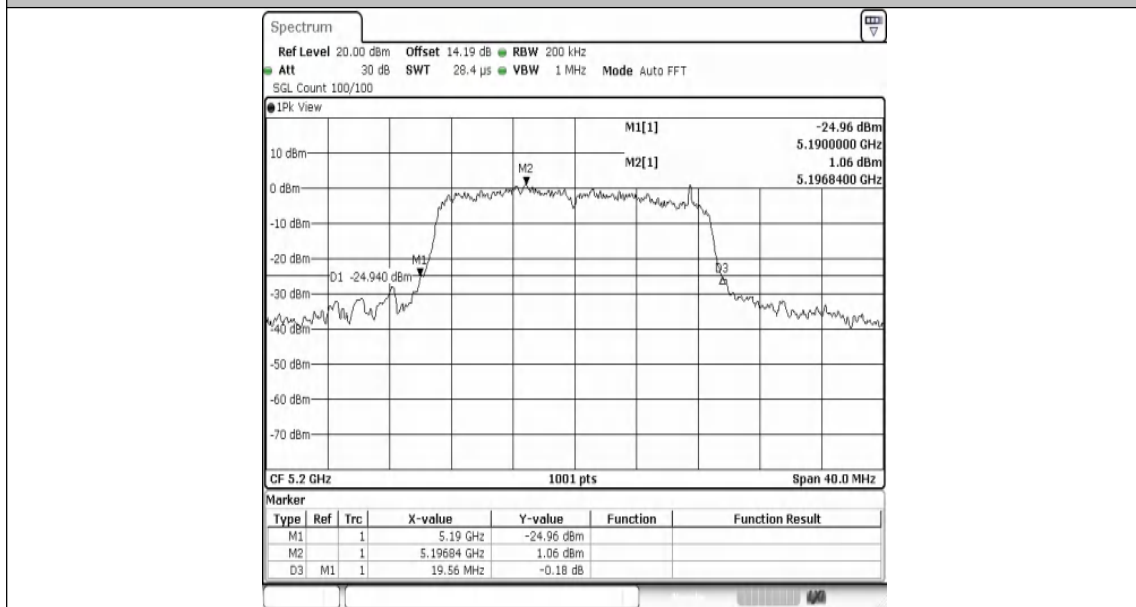


11N20MIMO-Ant2-5200

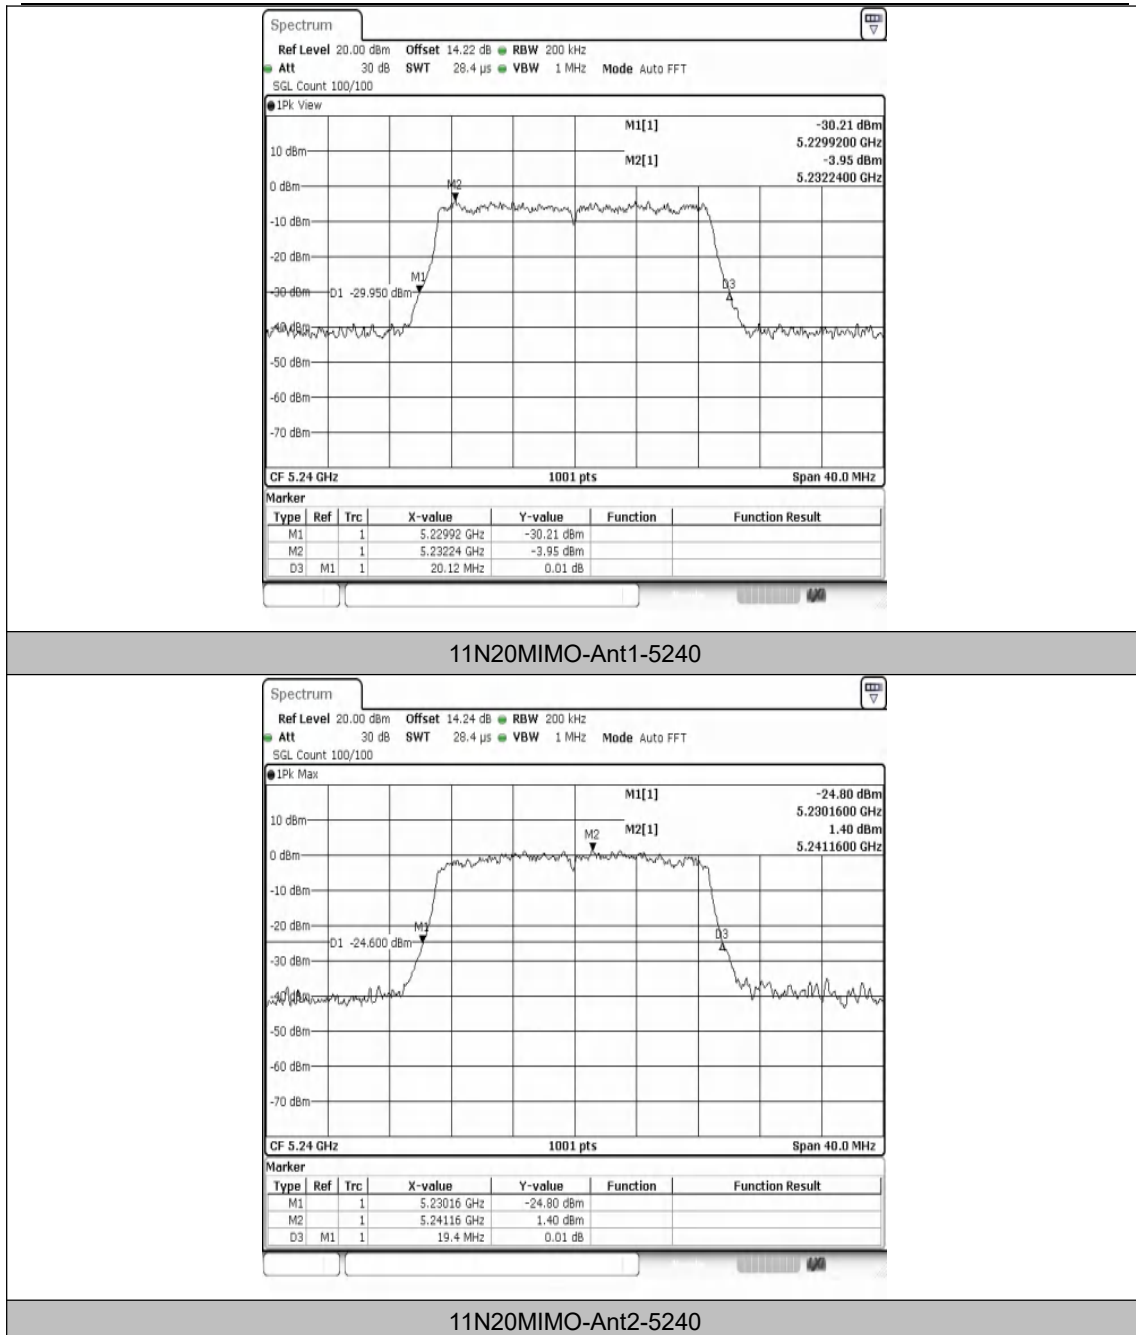


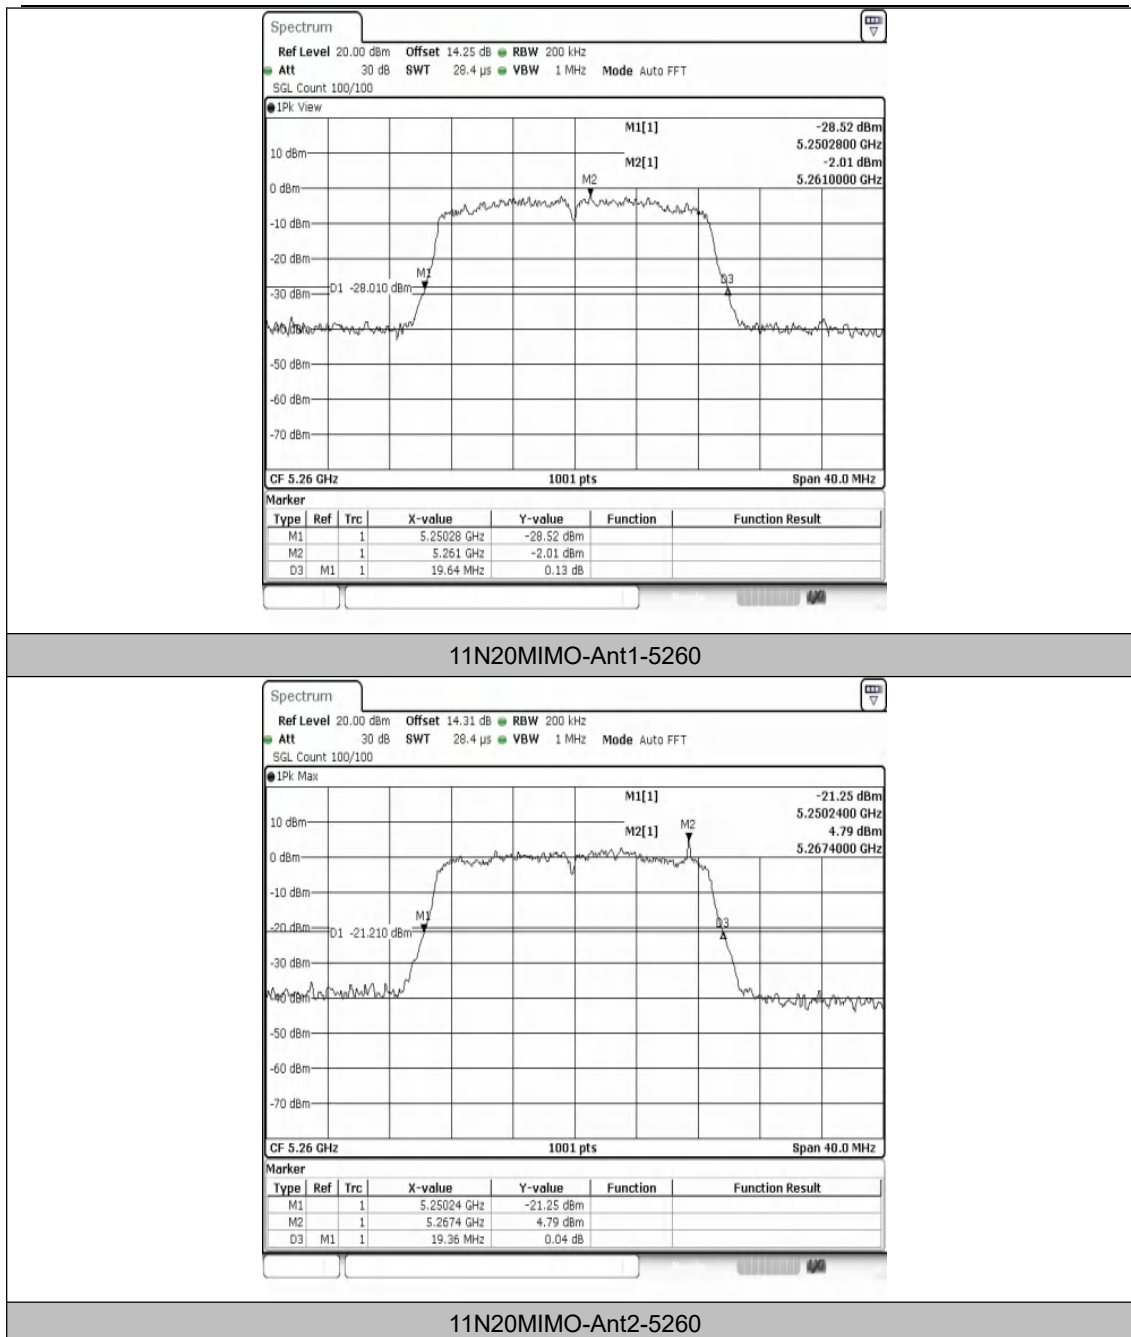

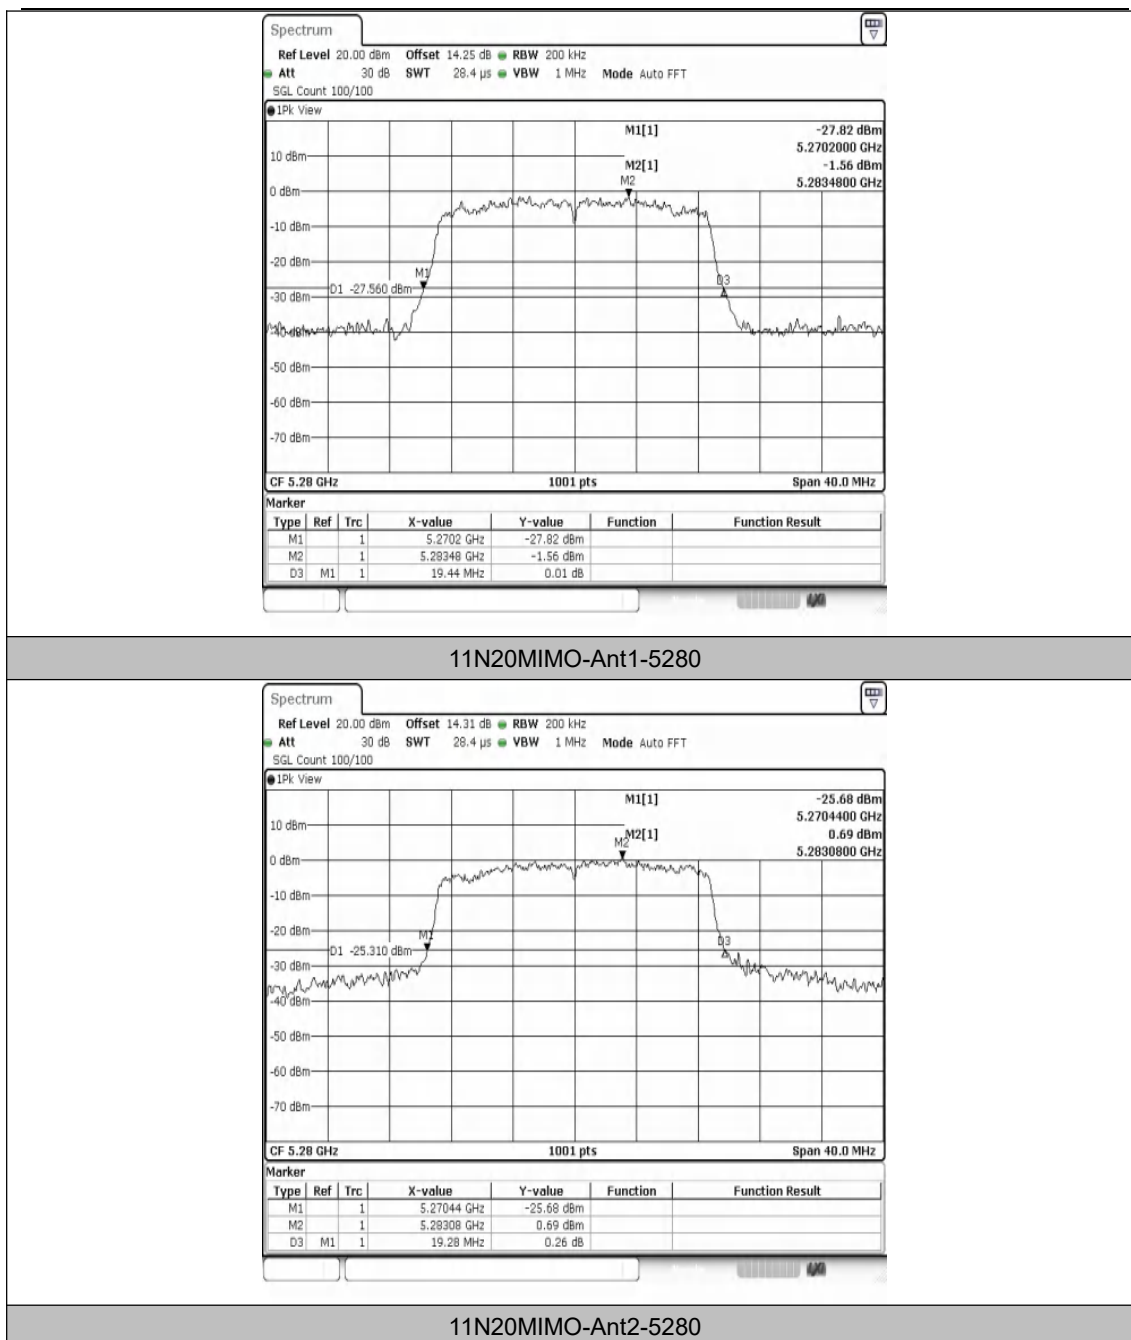


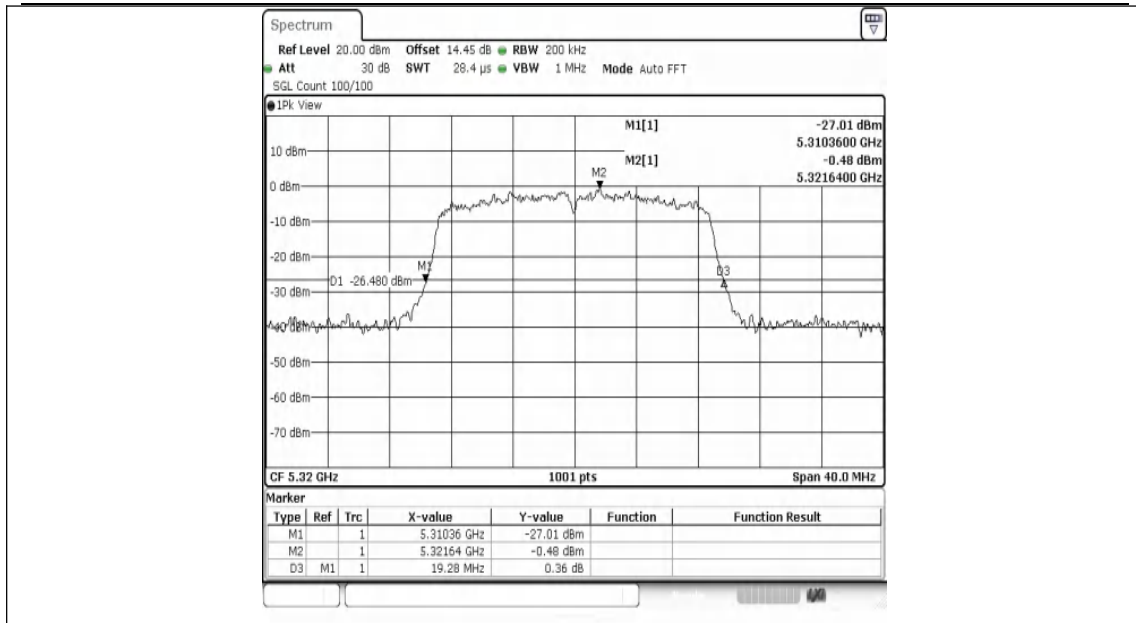


11N20MIMO-Ant1-5320

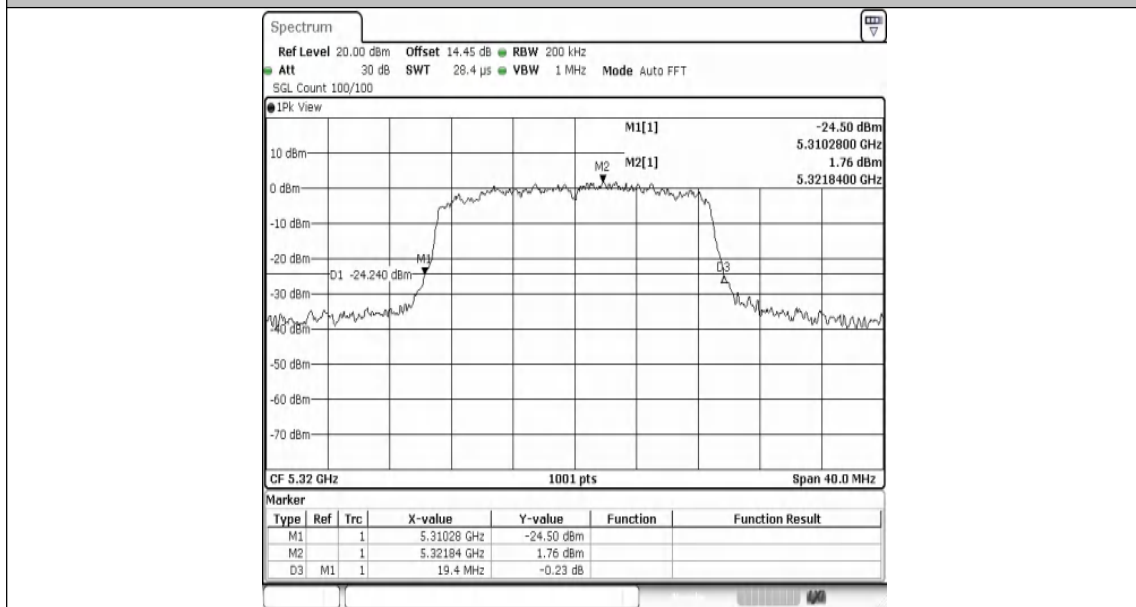


11N20MIMO-Ant2-5320

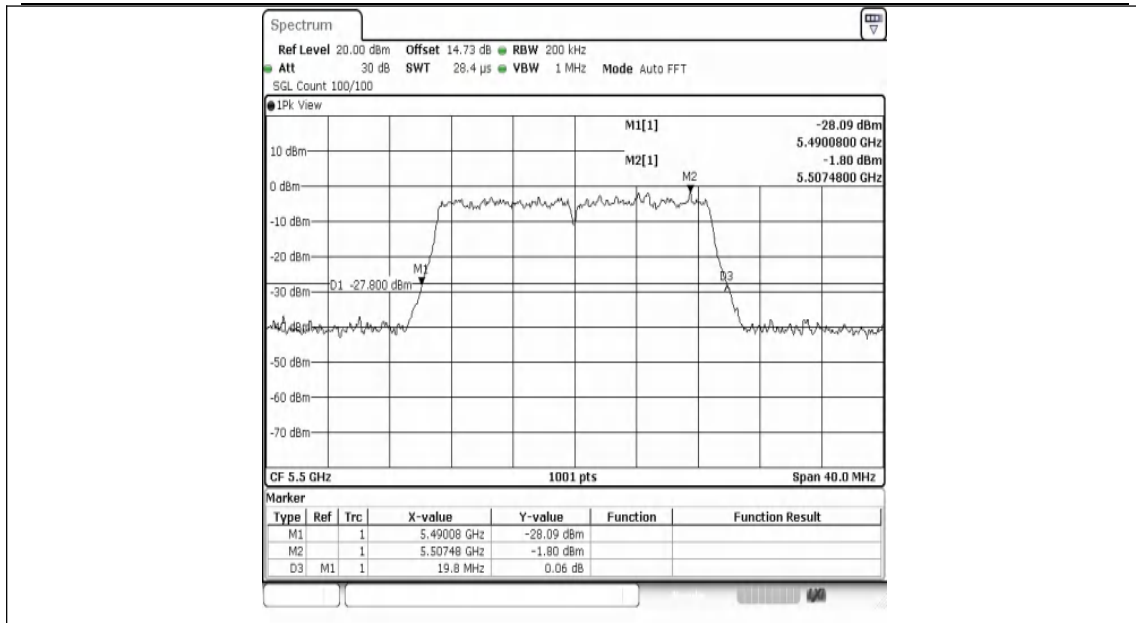


11N20MIMO-Ant1-5500

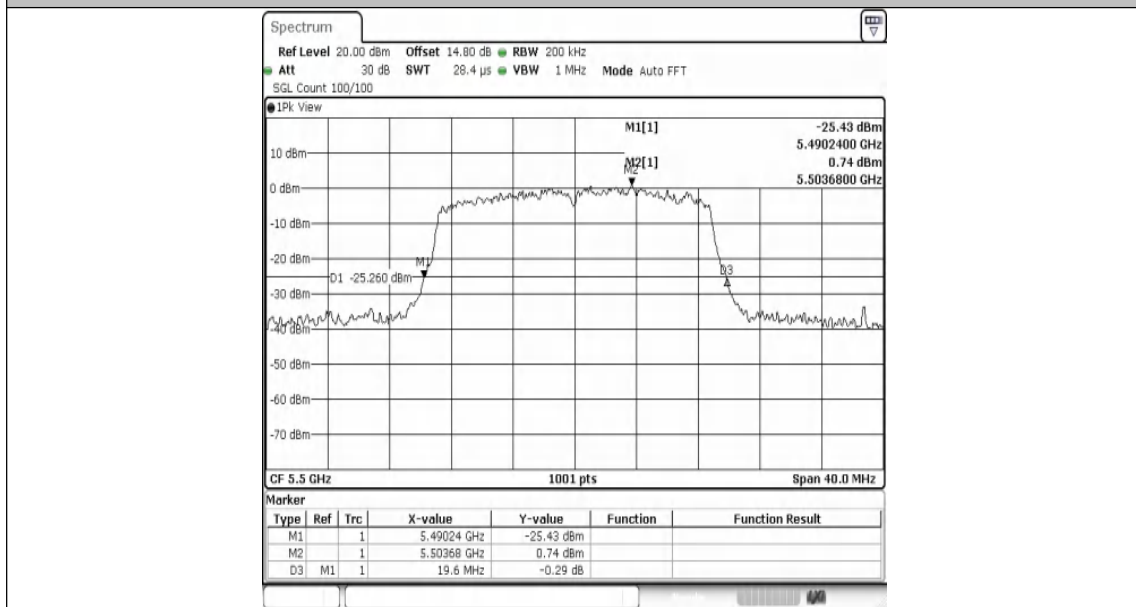


11N20MIMO-Ant2-5500

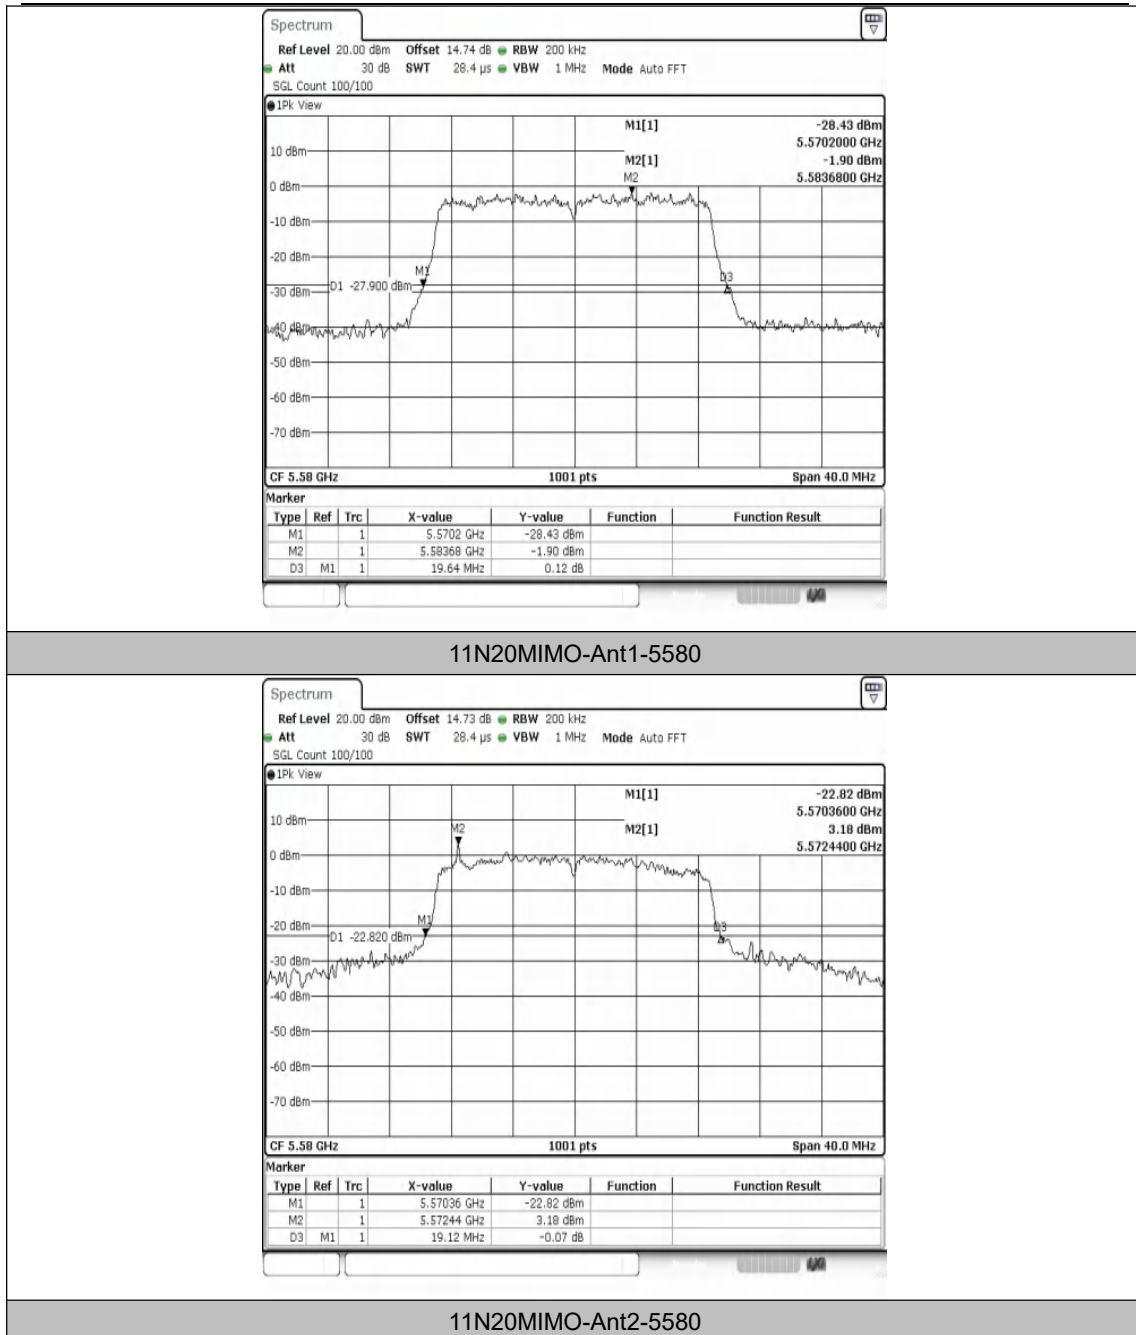


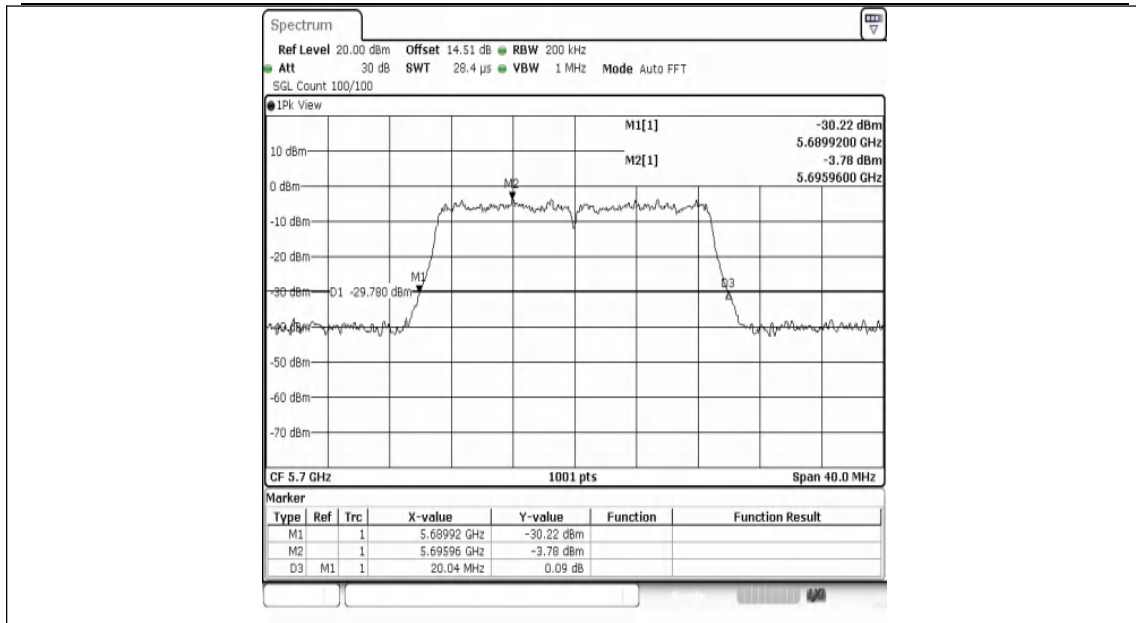



11N20MIMO-Ant1-5700

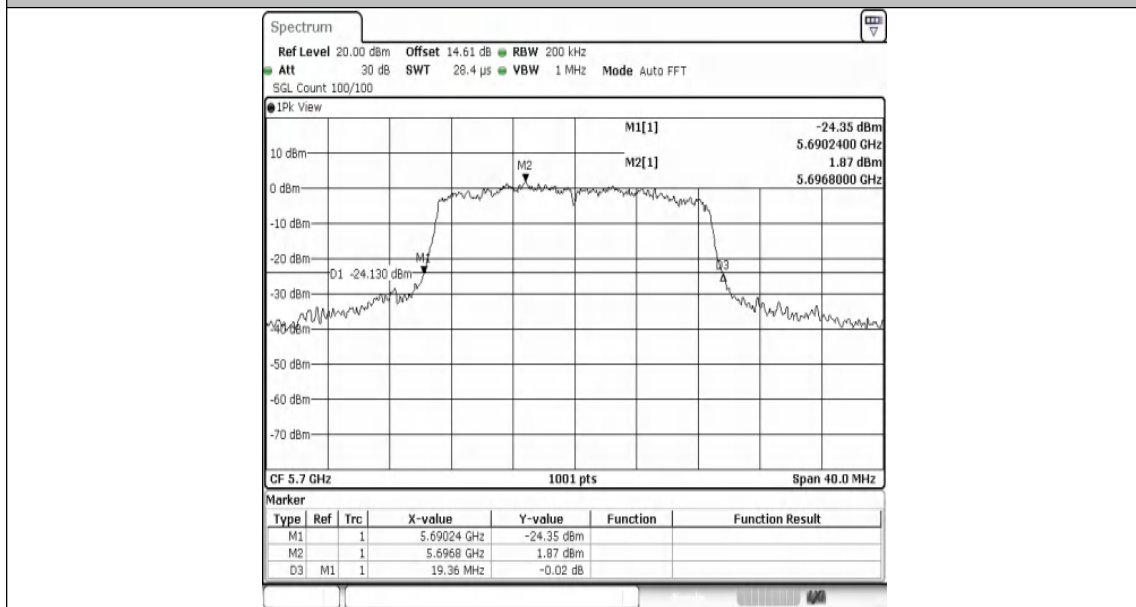



11N20MIMO-Ant2-5700

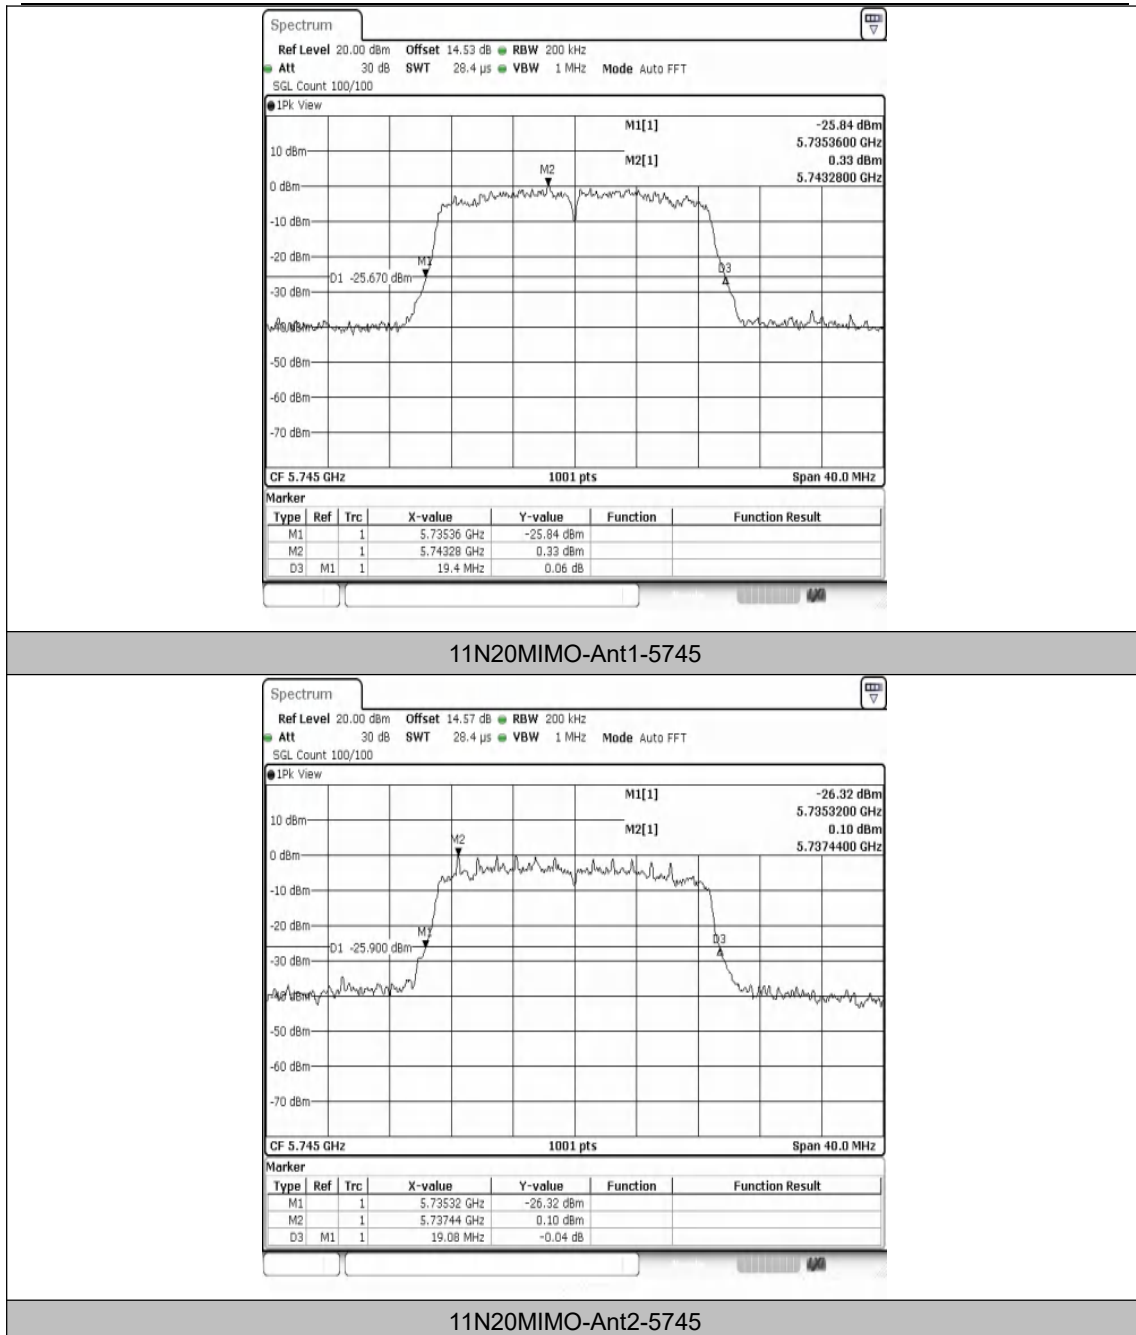


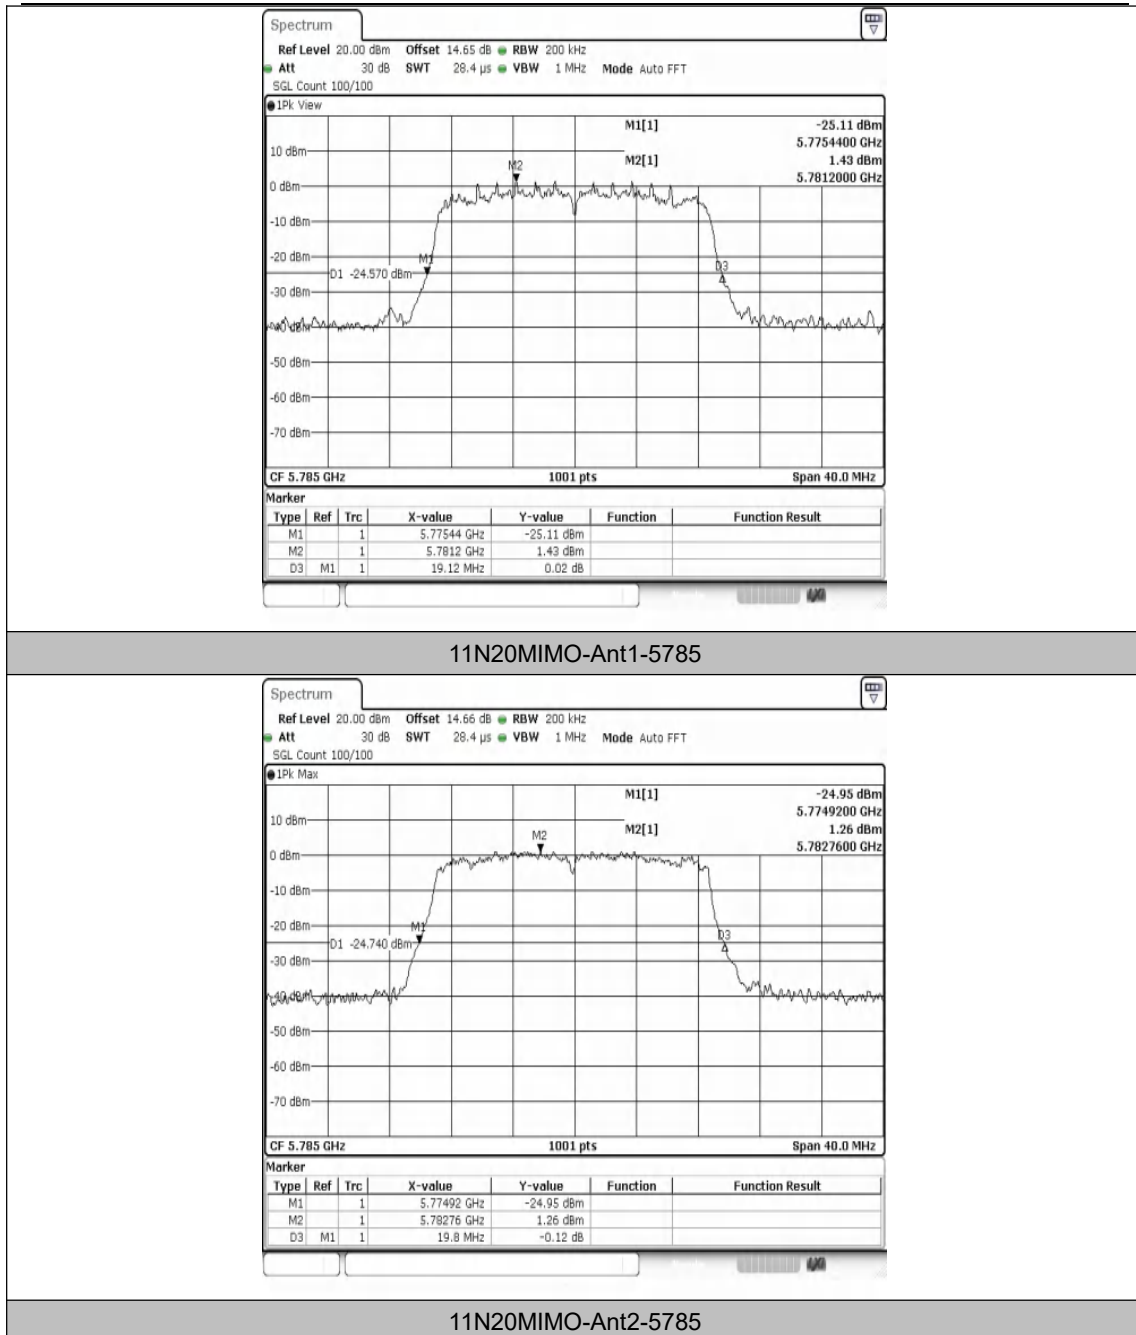


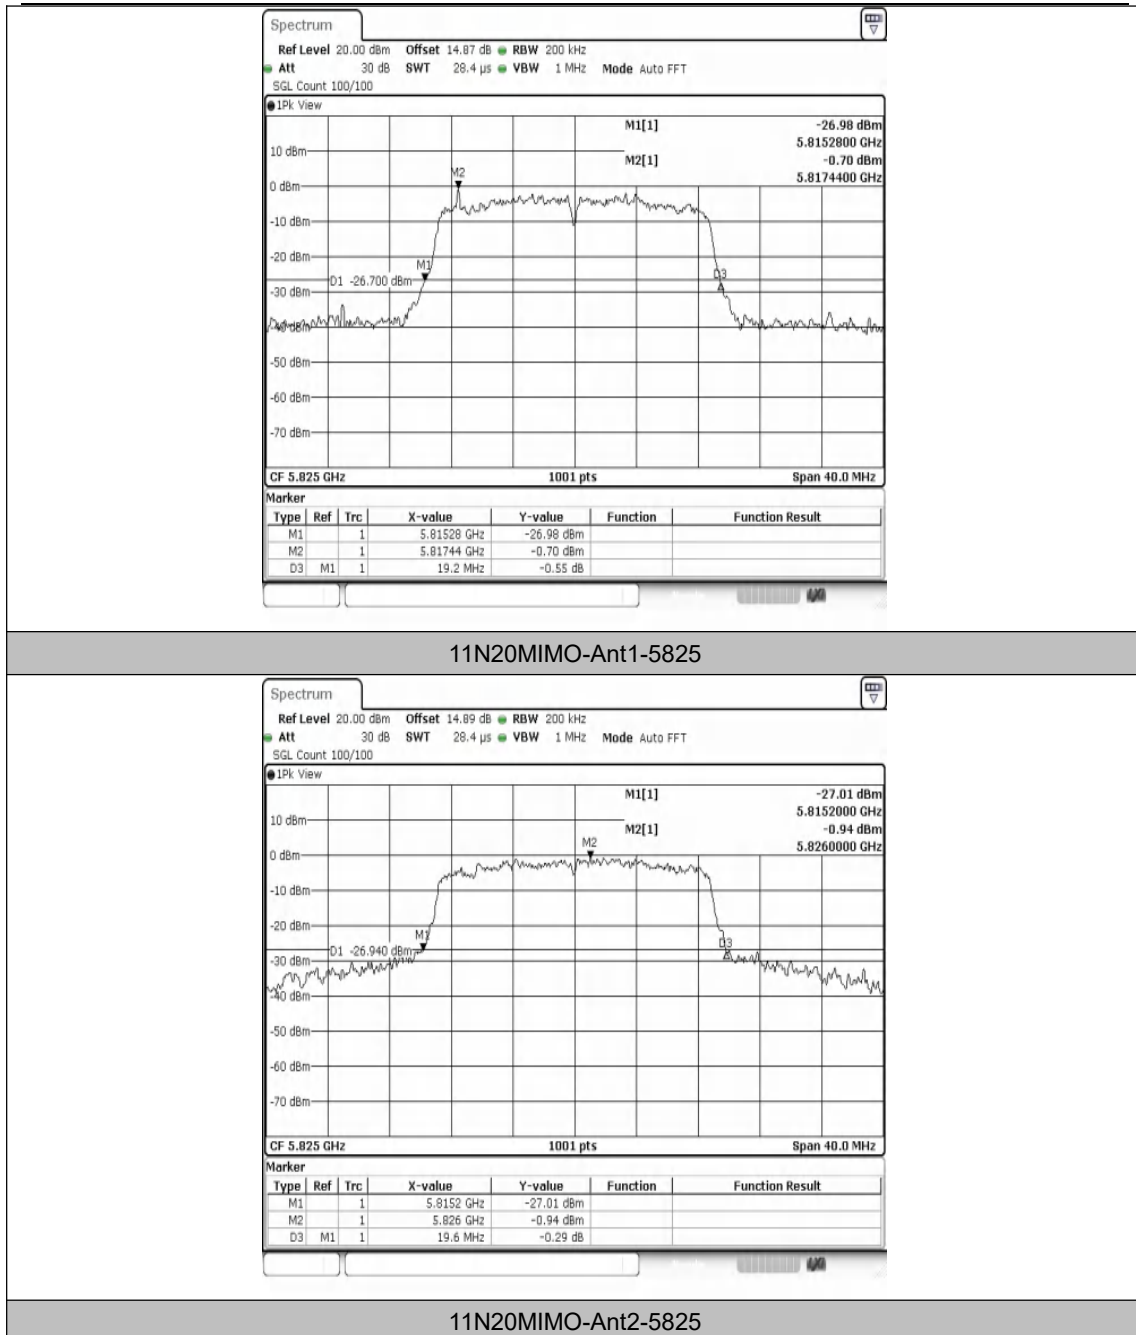


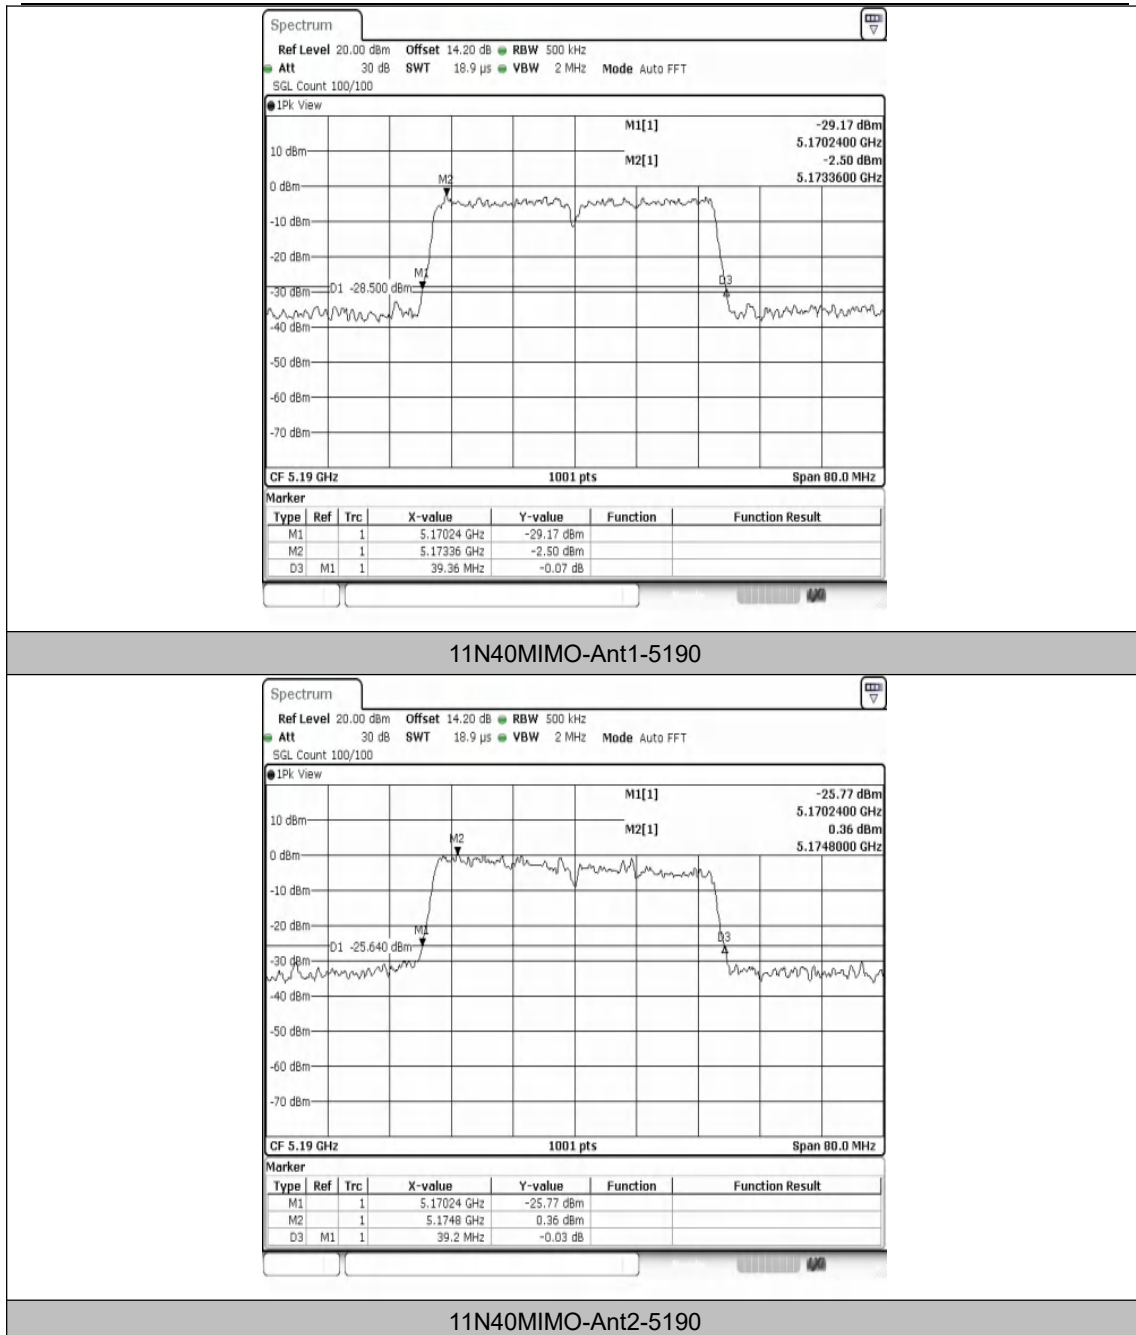


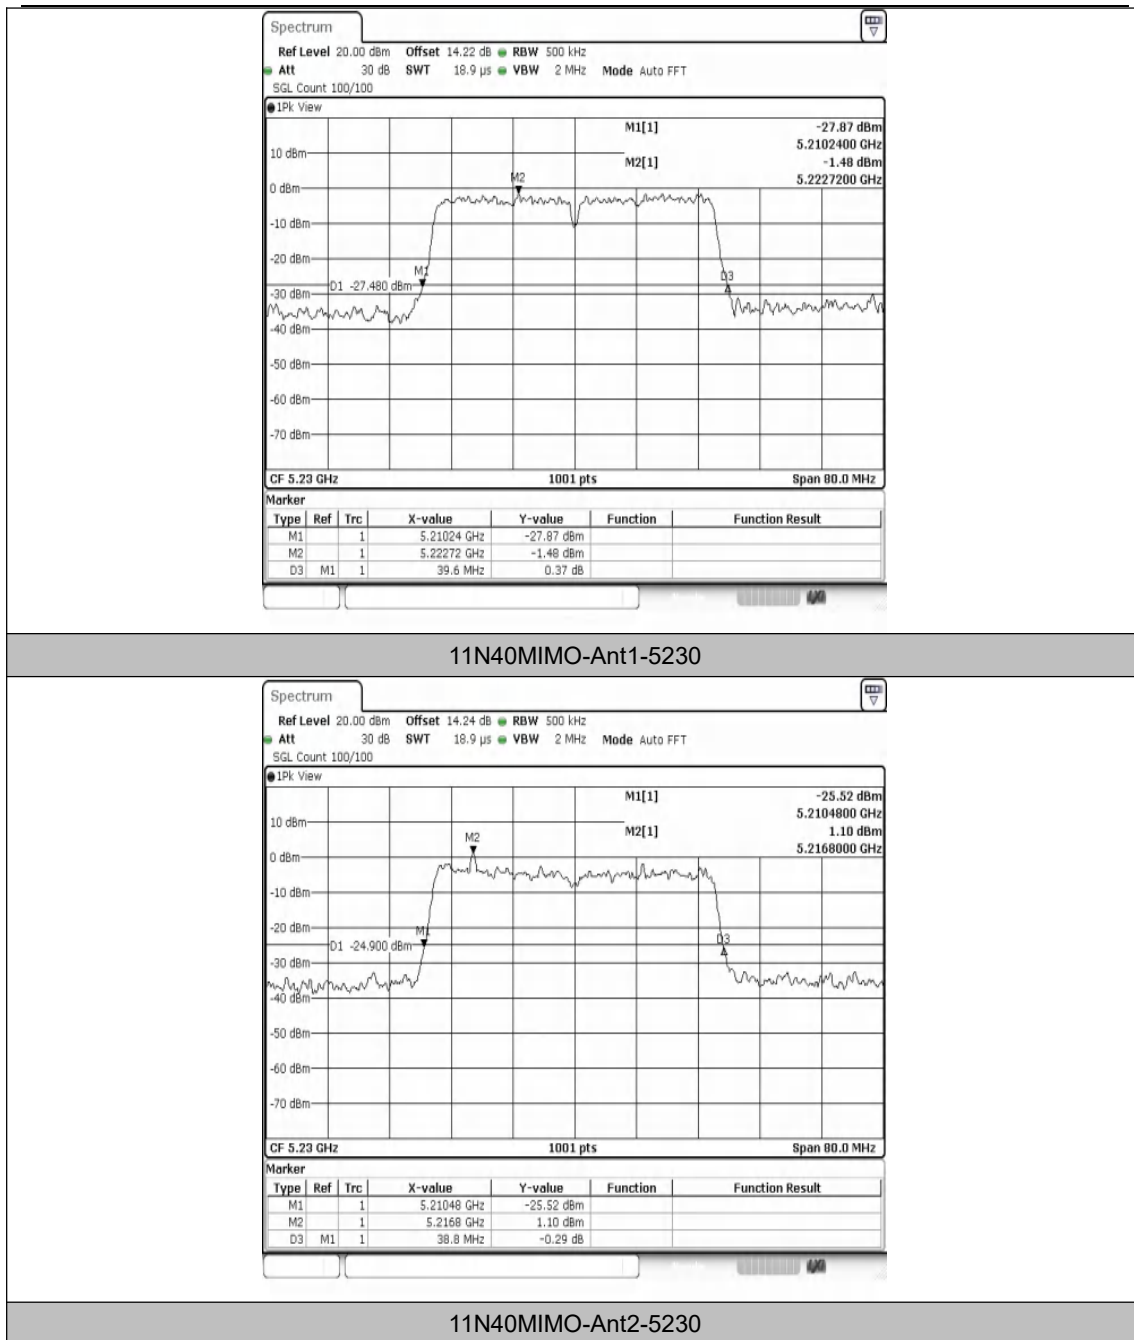

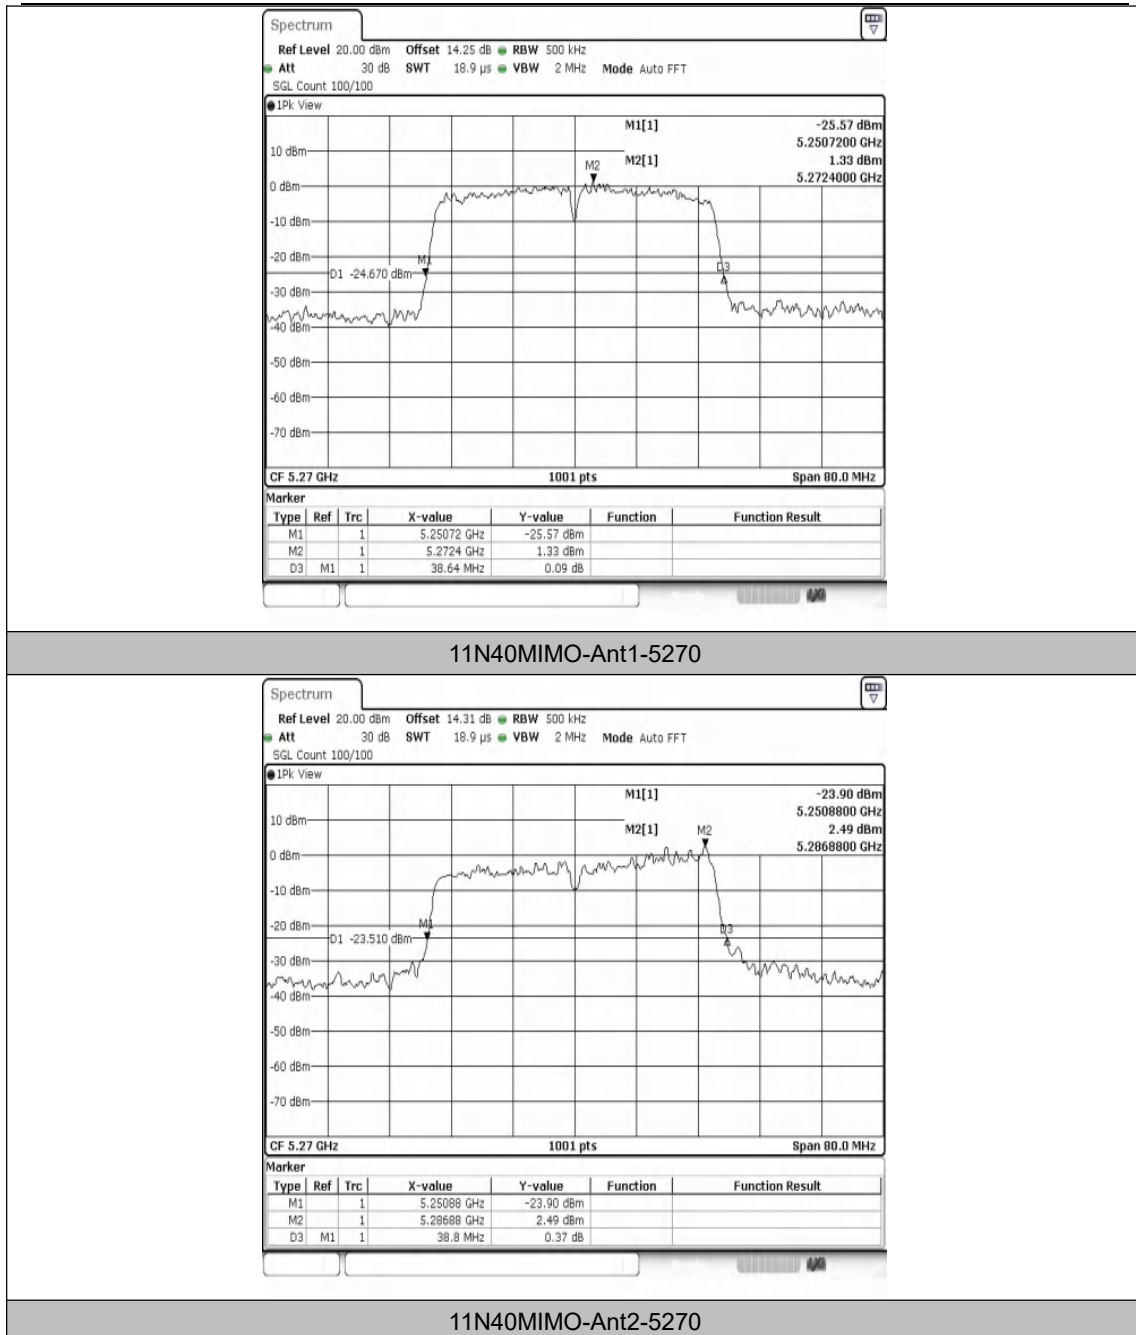

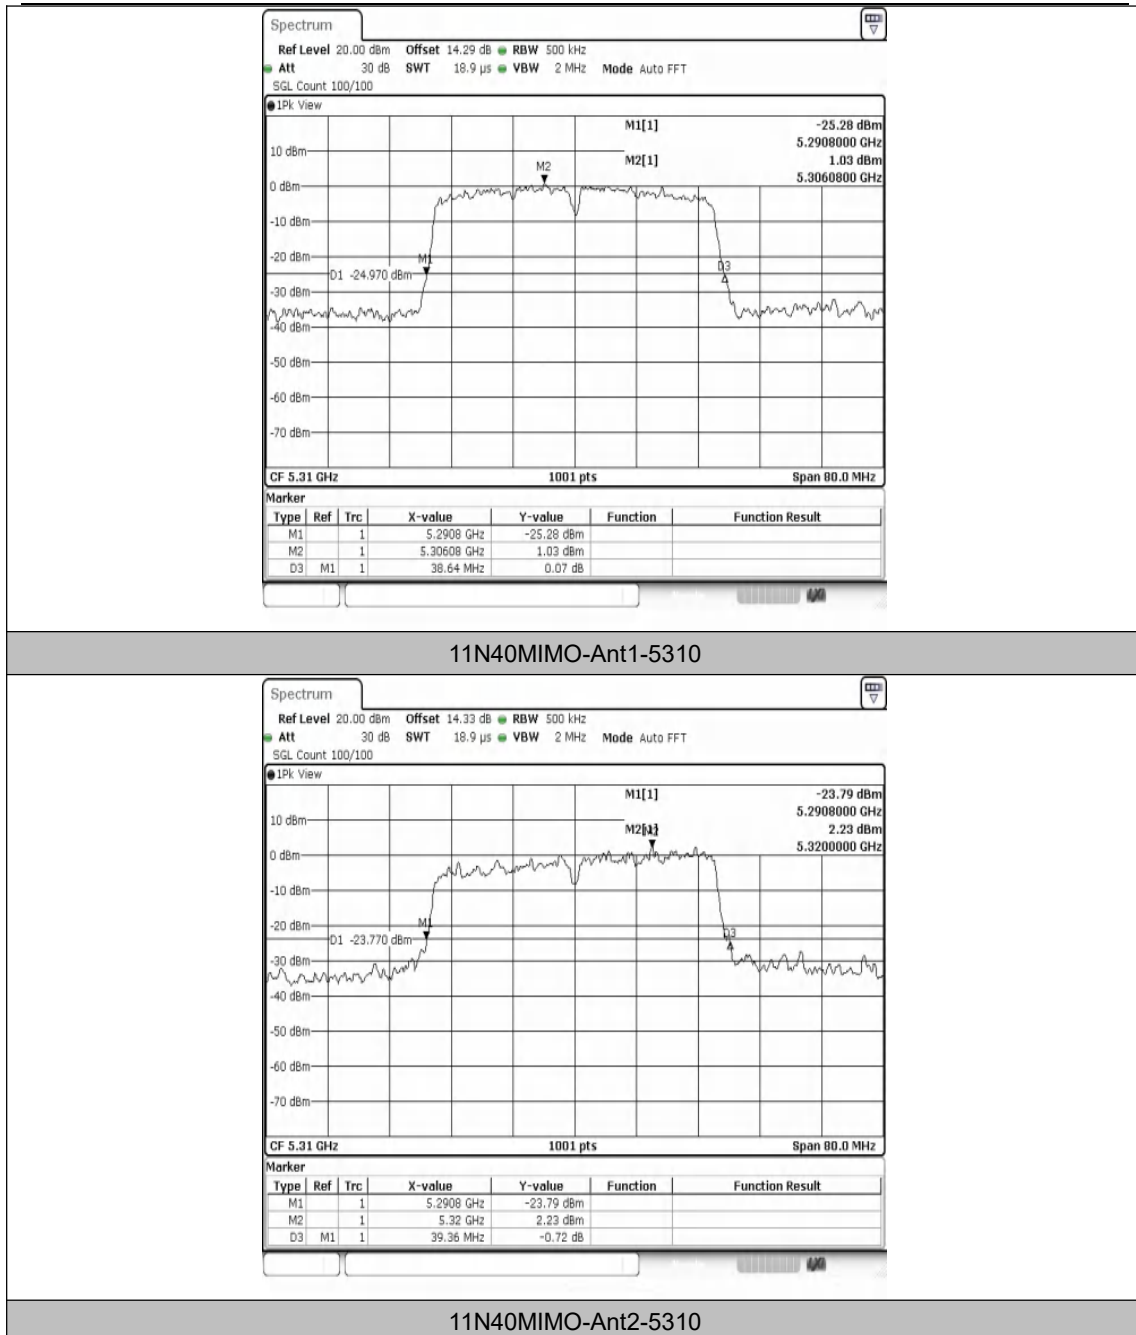

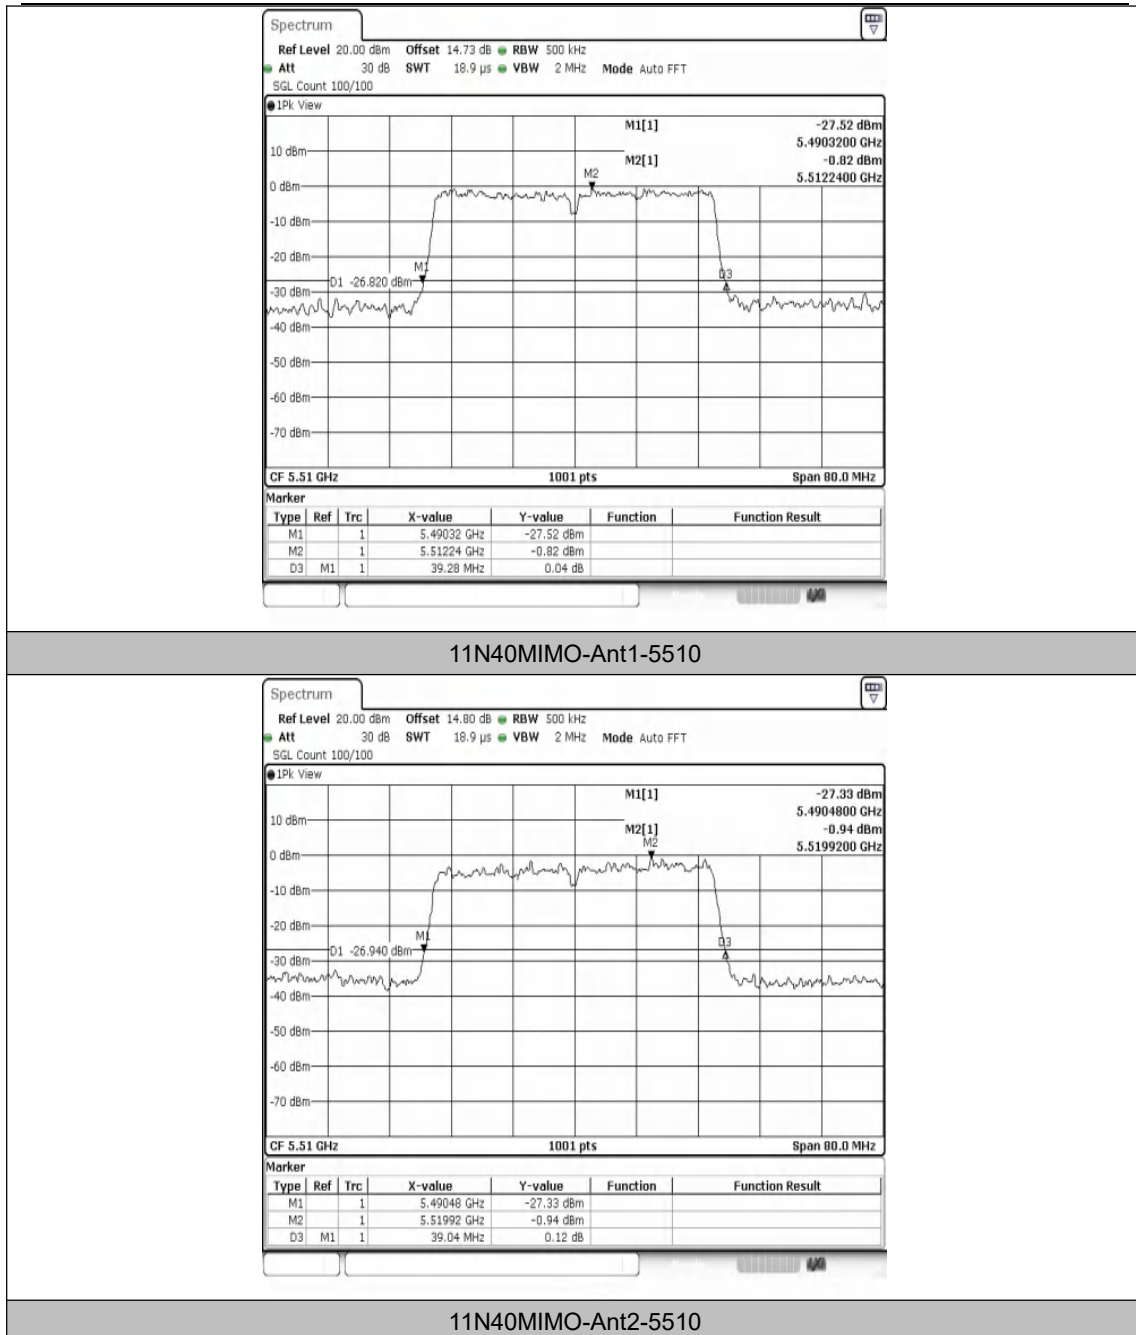


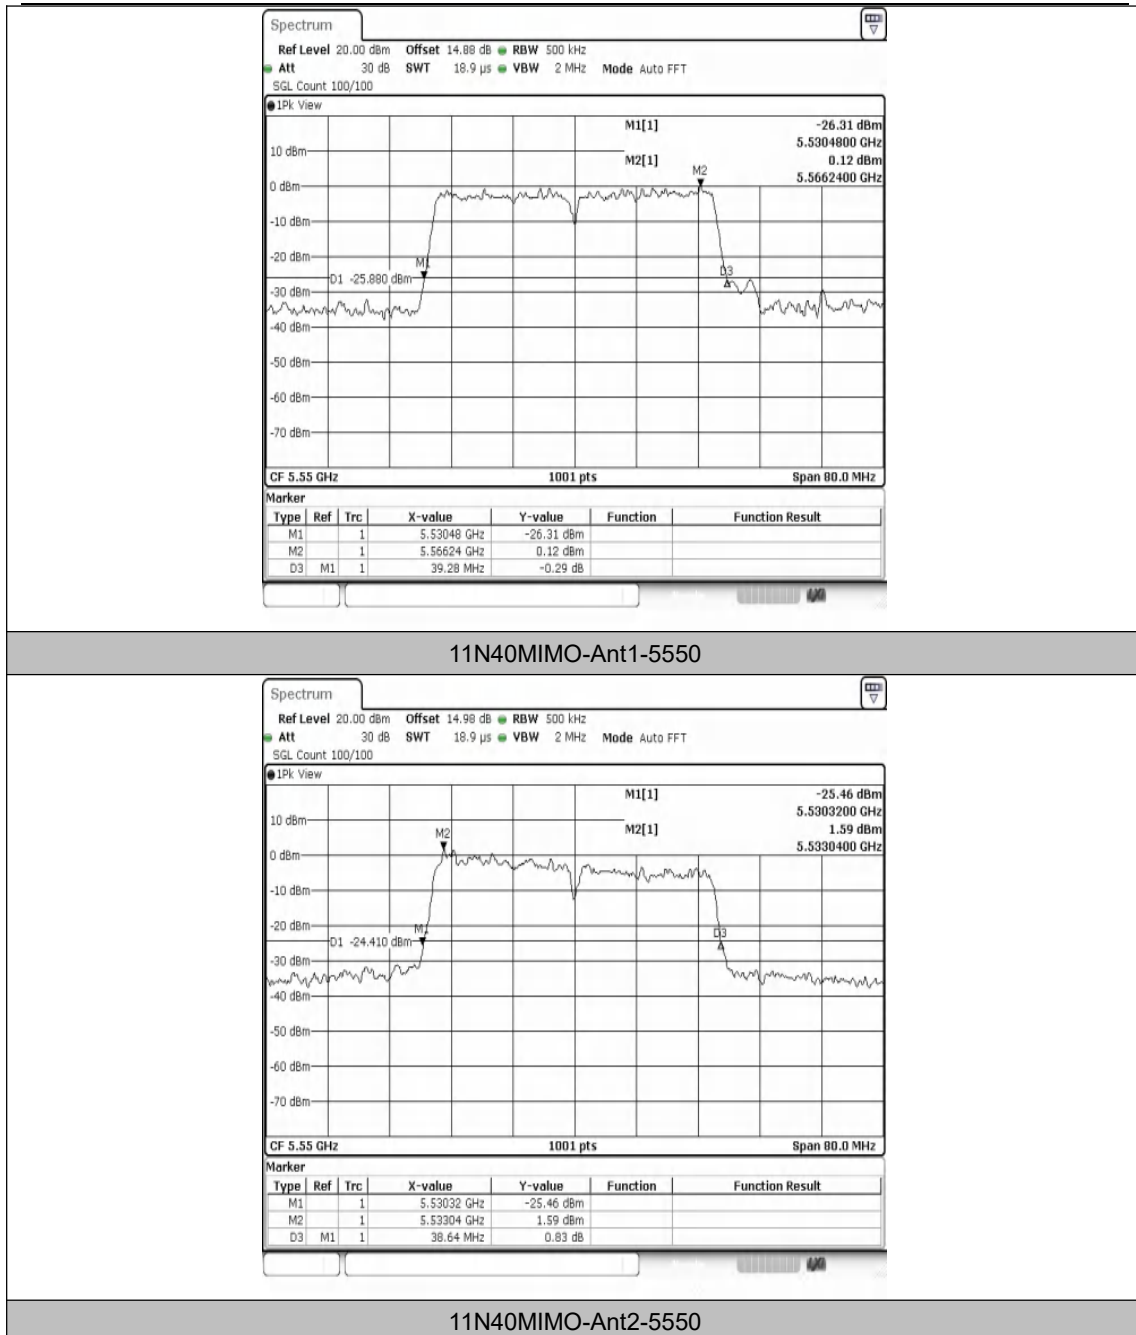


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

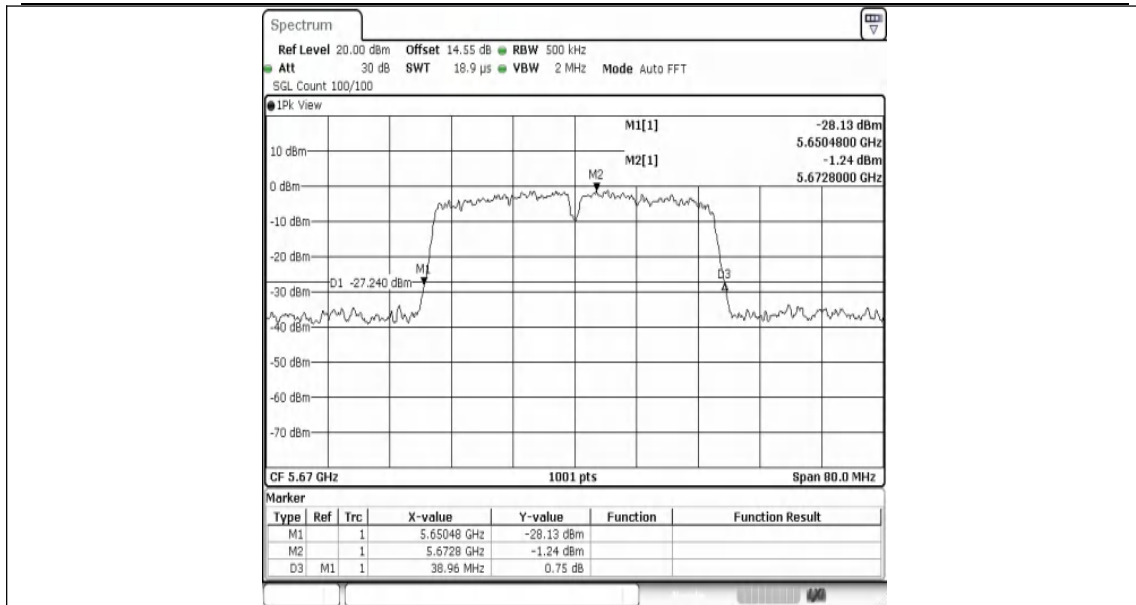


11N40MIMO-Ant1-5670

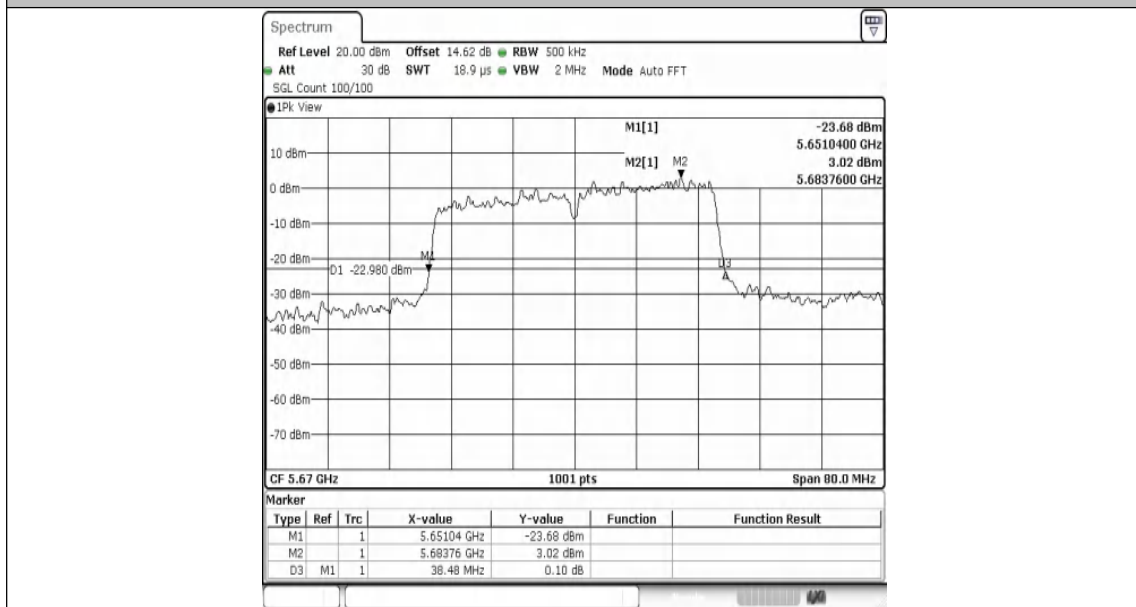


11N40MIMO-Ant2-5670

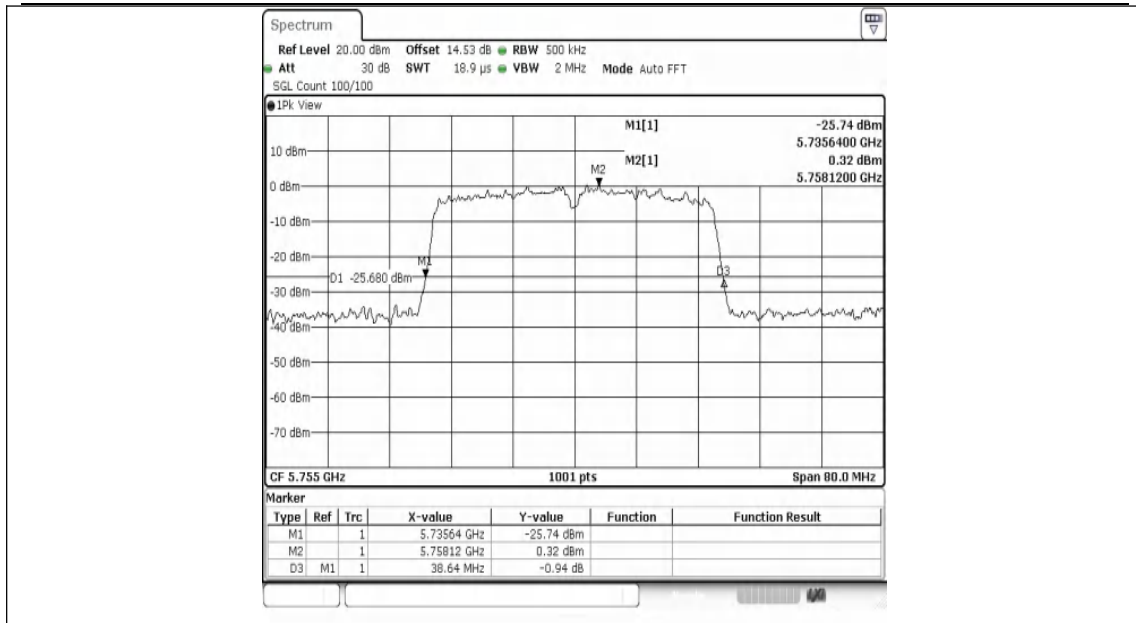



11N40MIMO-Ant1-5755

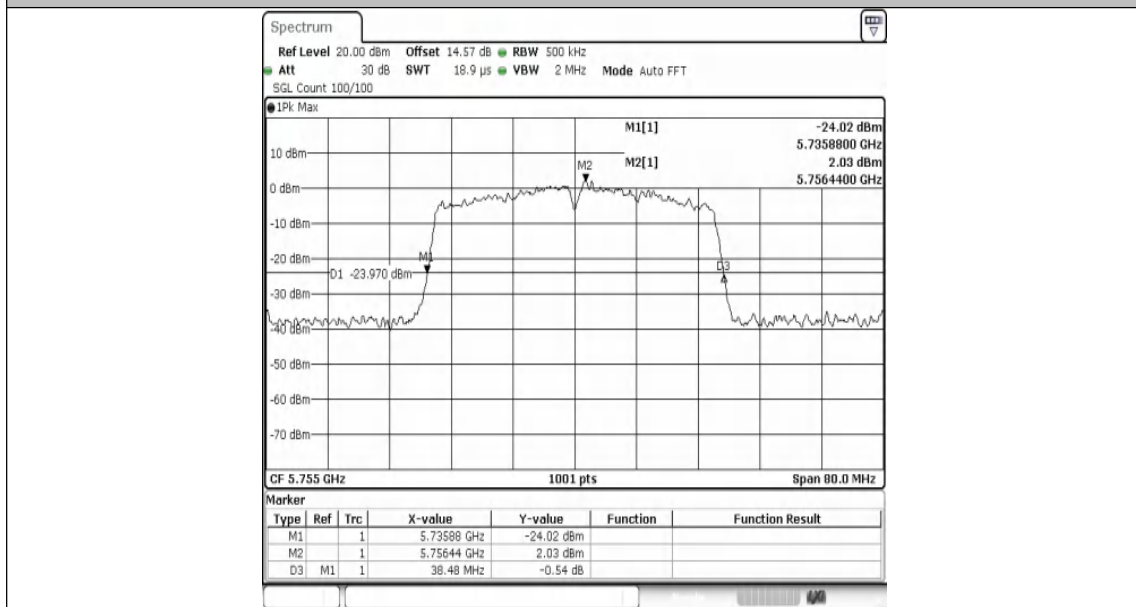


11N40MIMO-Ant2-5755

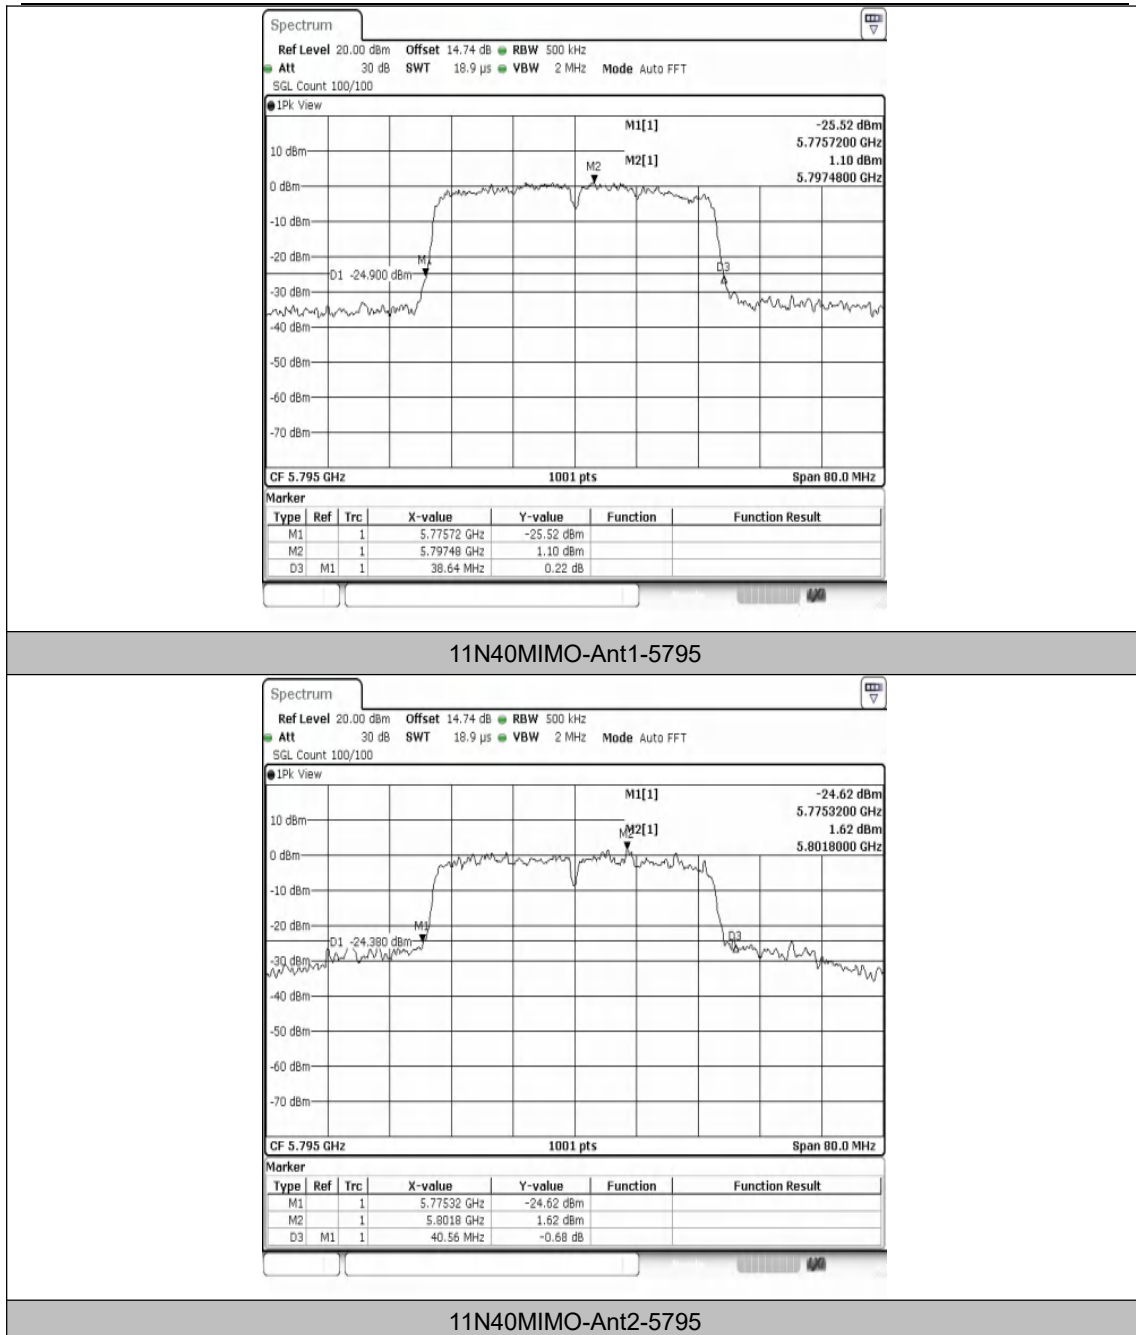

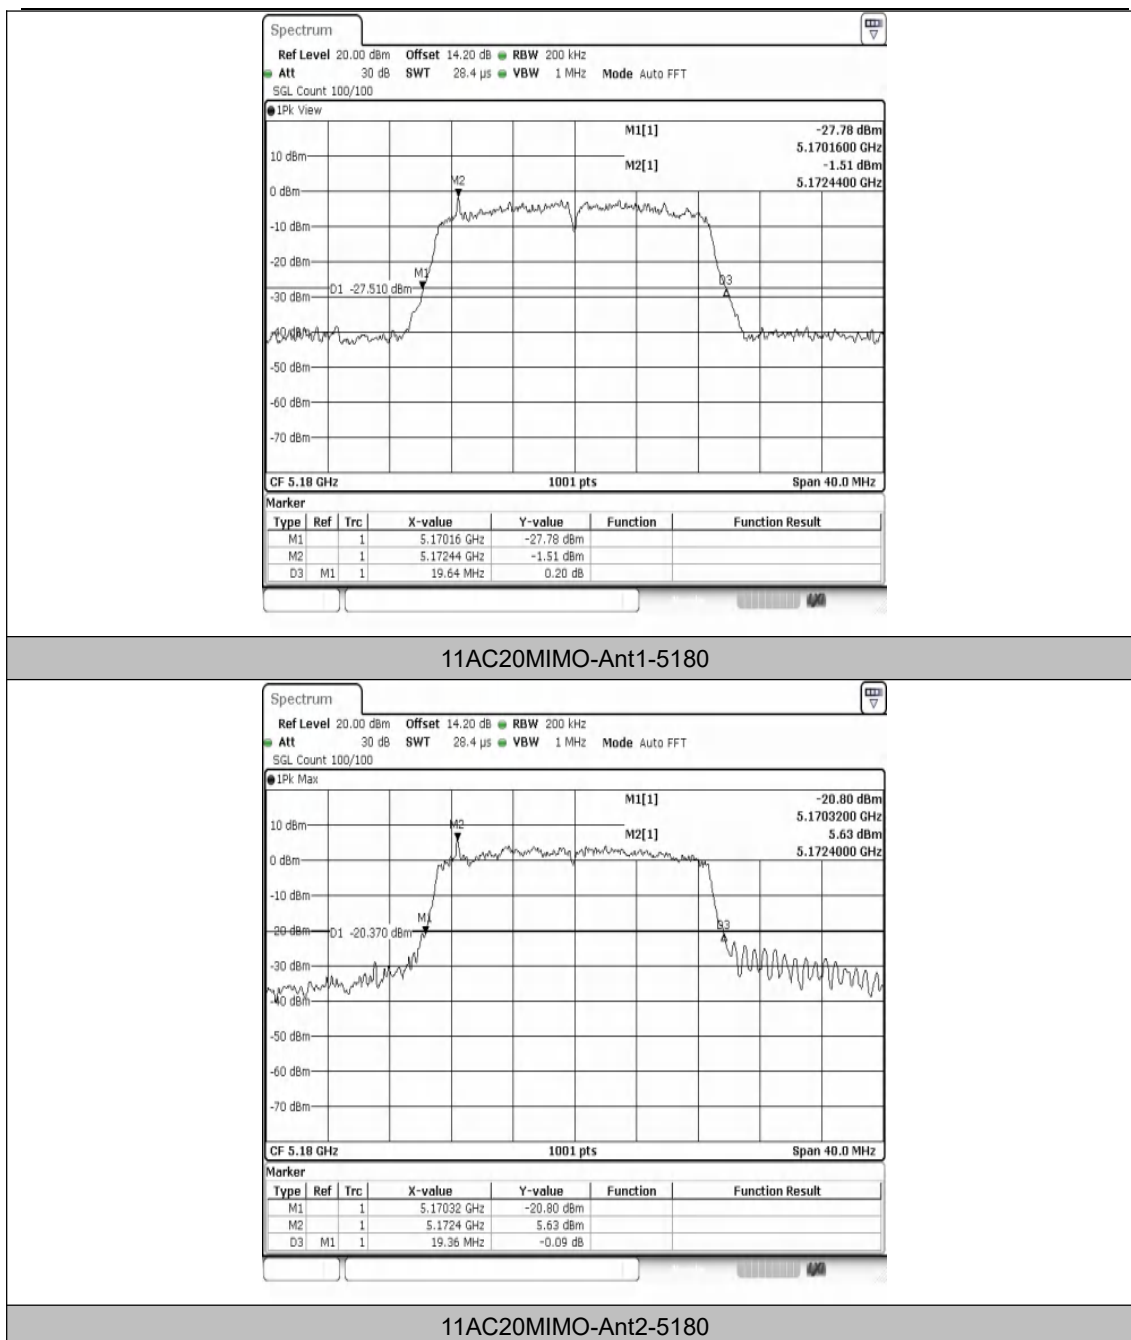

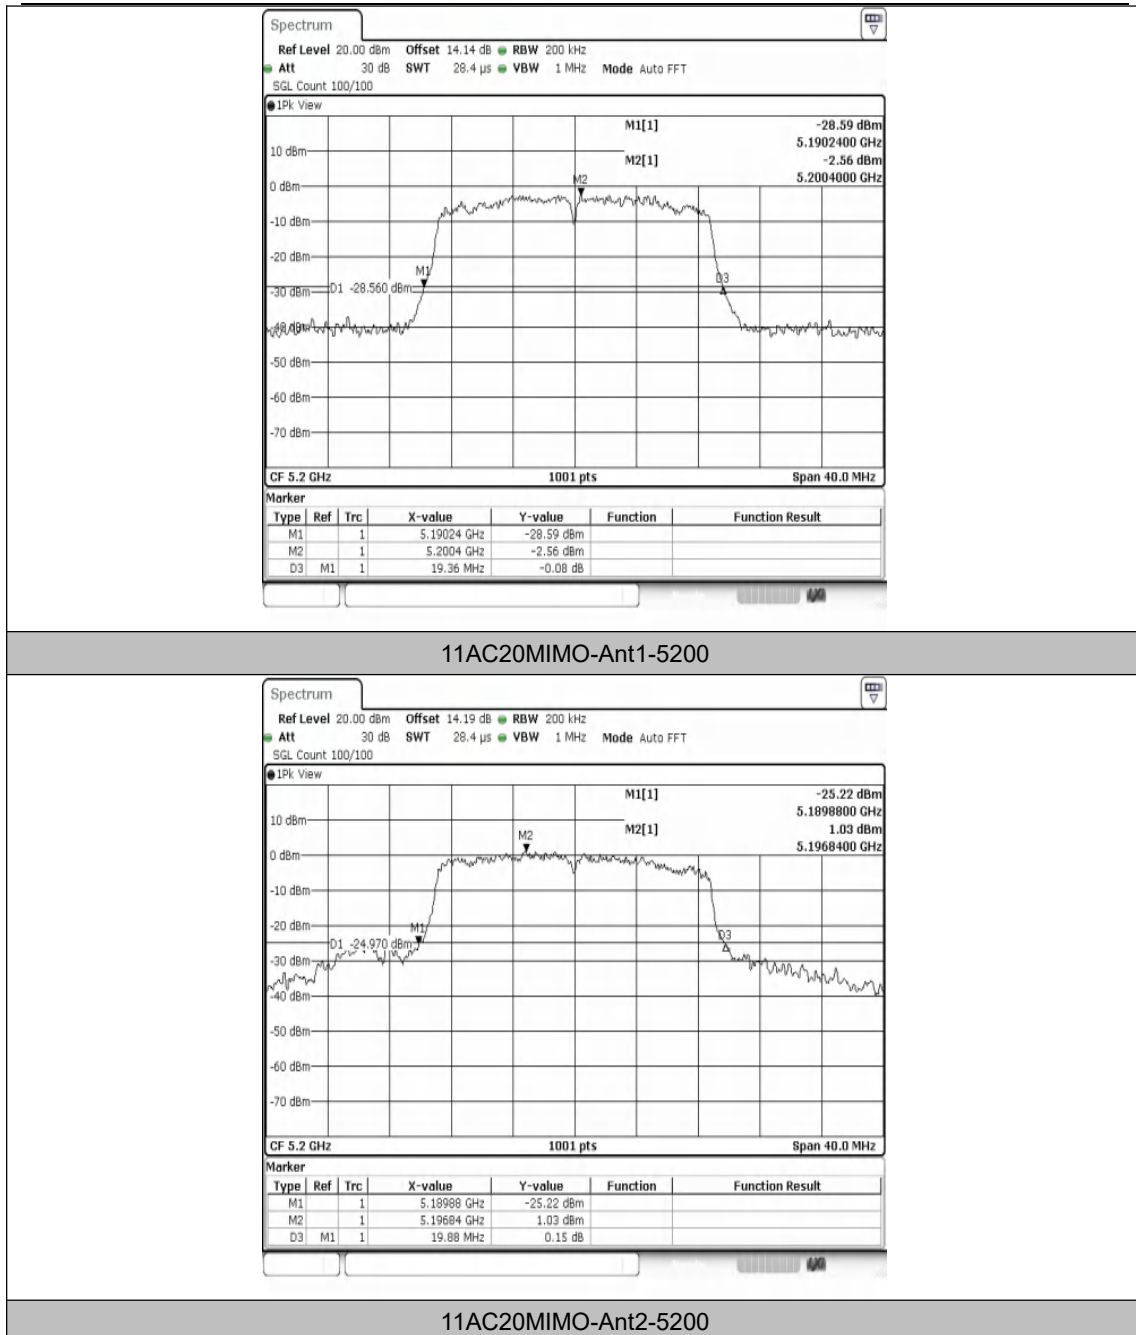


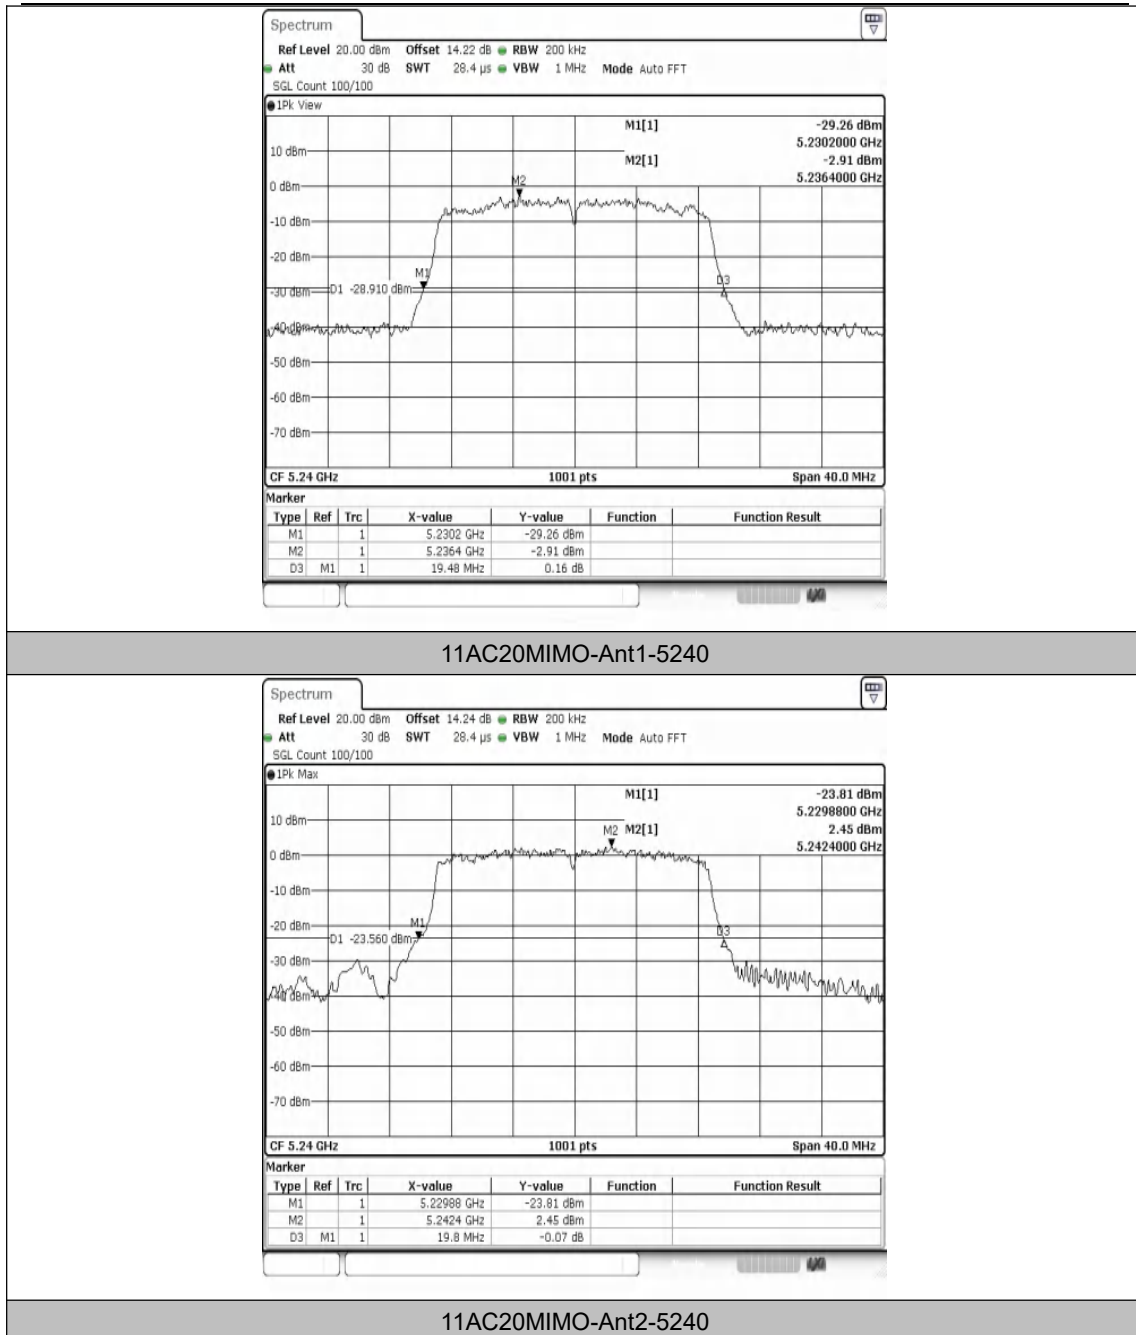


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

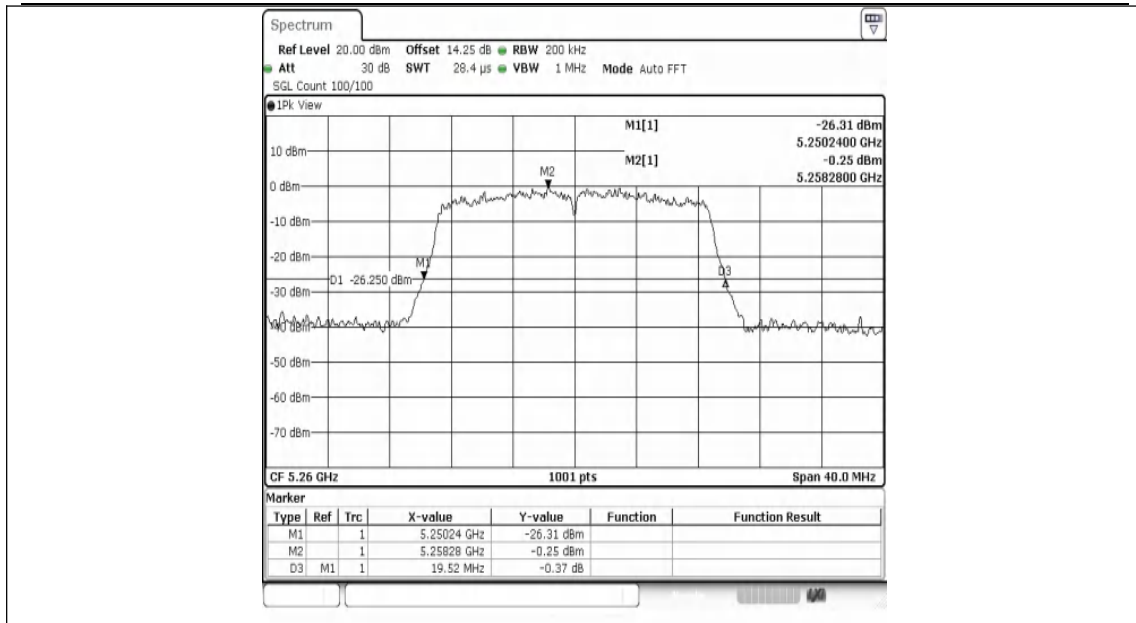


11AC20MIMO-Ant1-5260

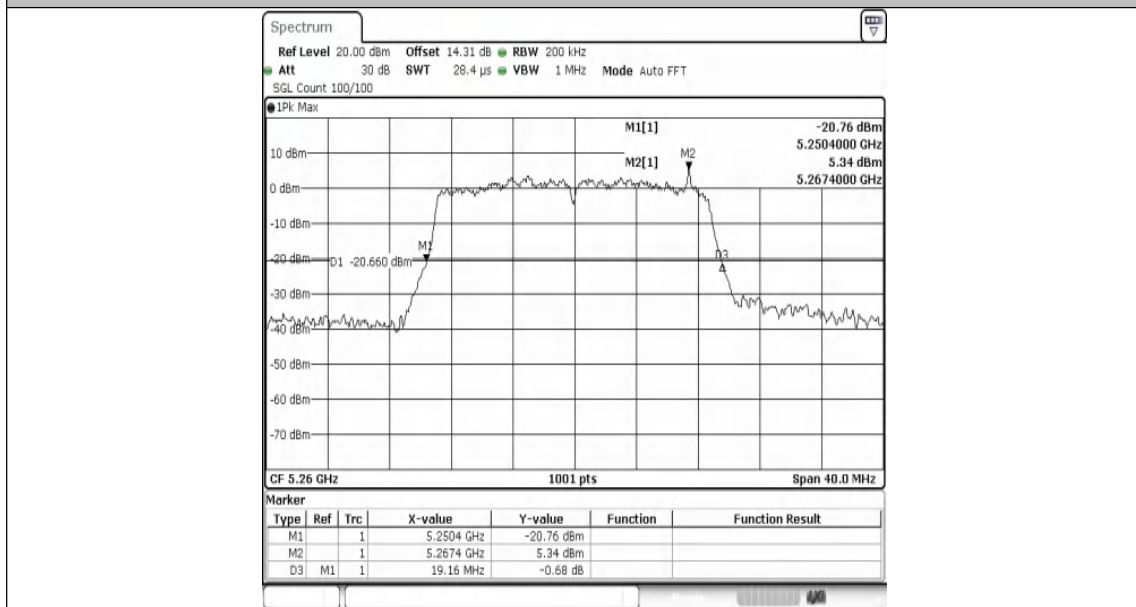


11AC20MIMO-Ant2-5260

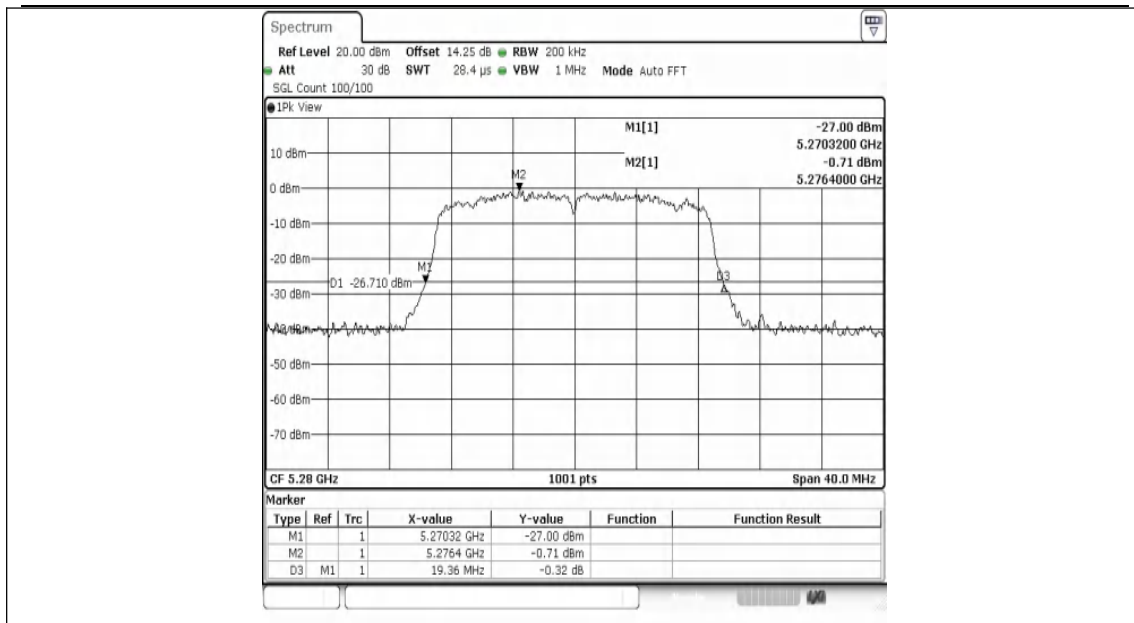


11AC20MIMO-Ant1-5280

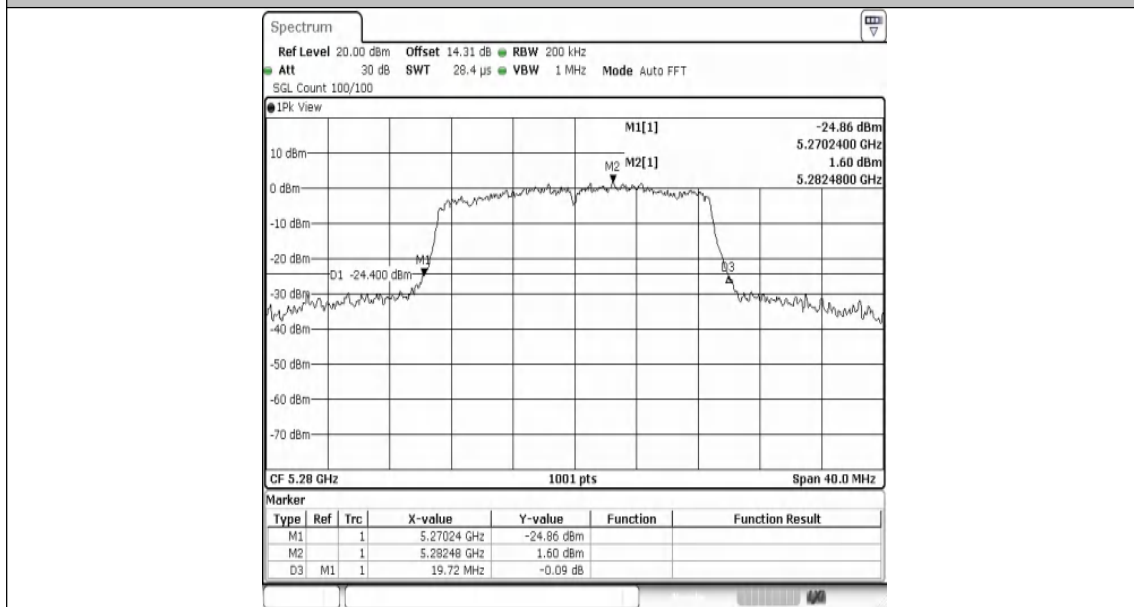


11AC20MIMO-Ant2-5280

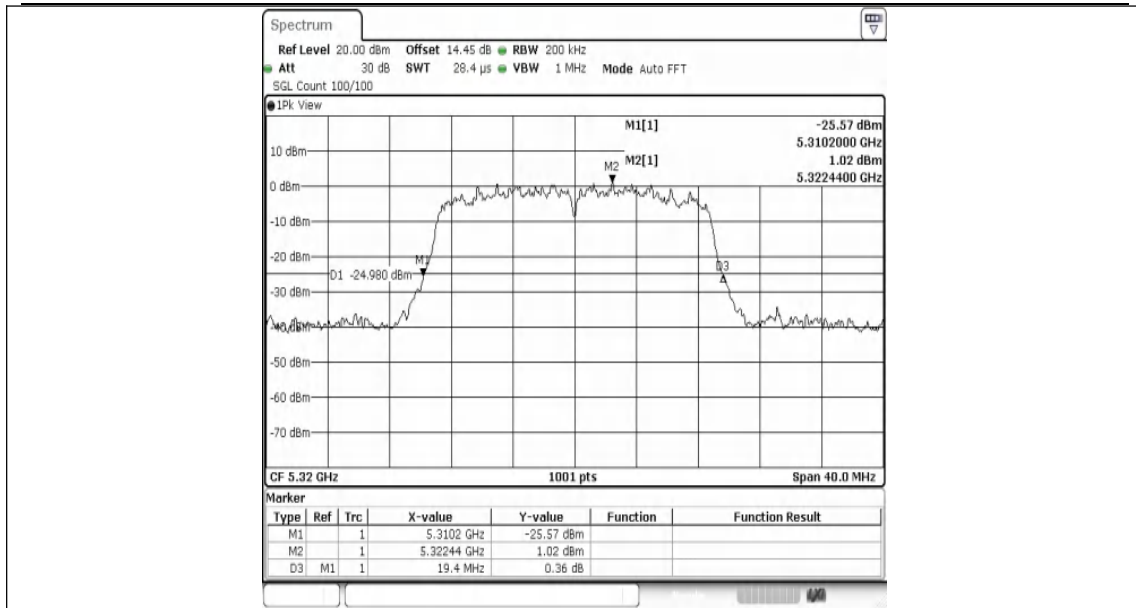


11AC20MIMO-Ant1-5320

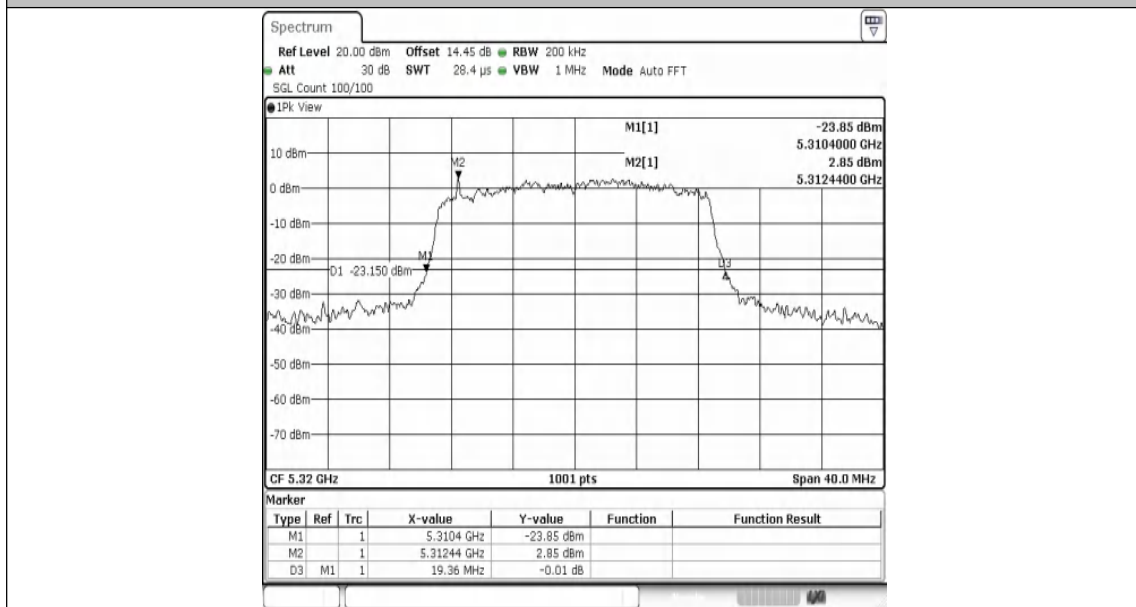

11AC20MIMO-Ant2-5320

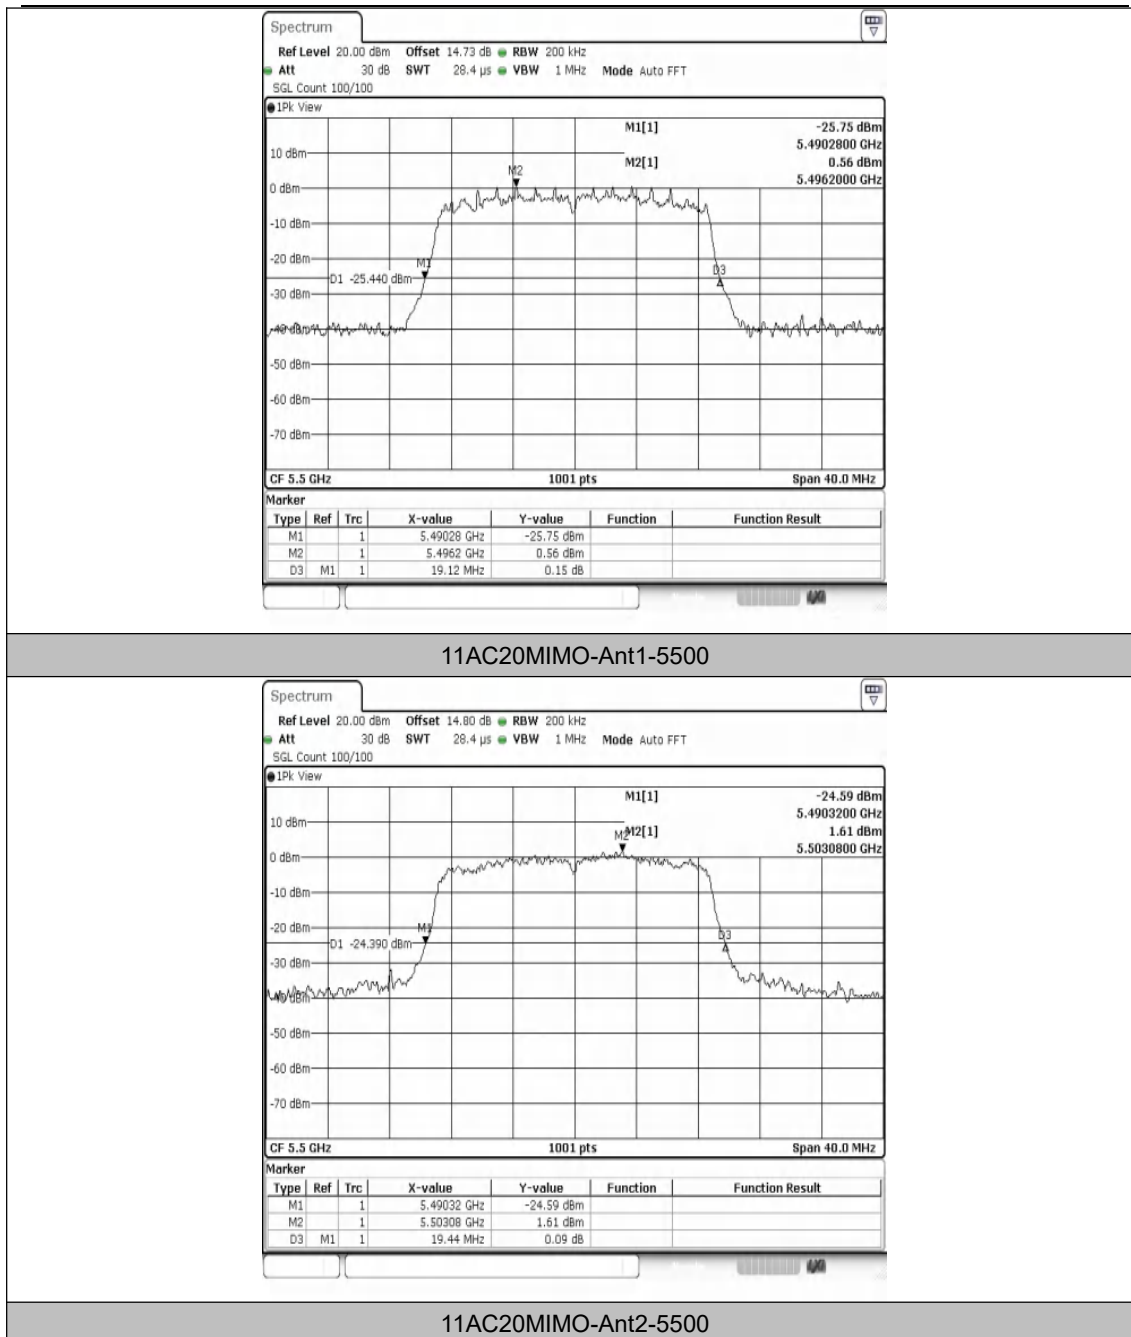


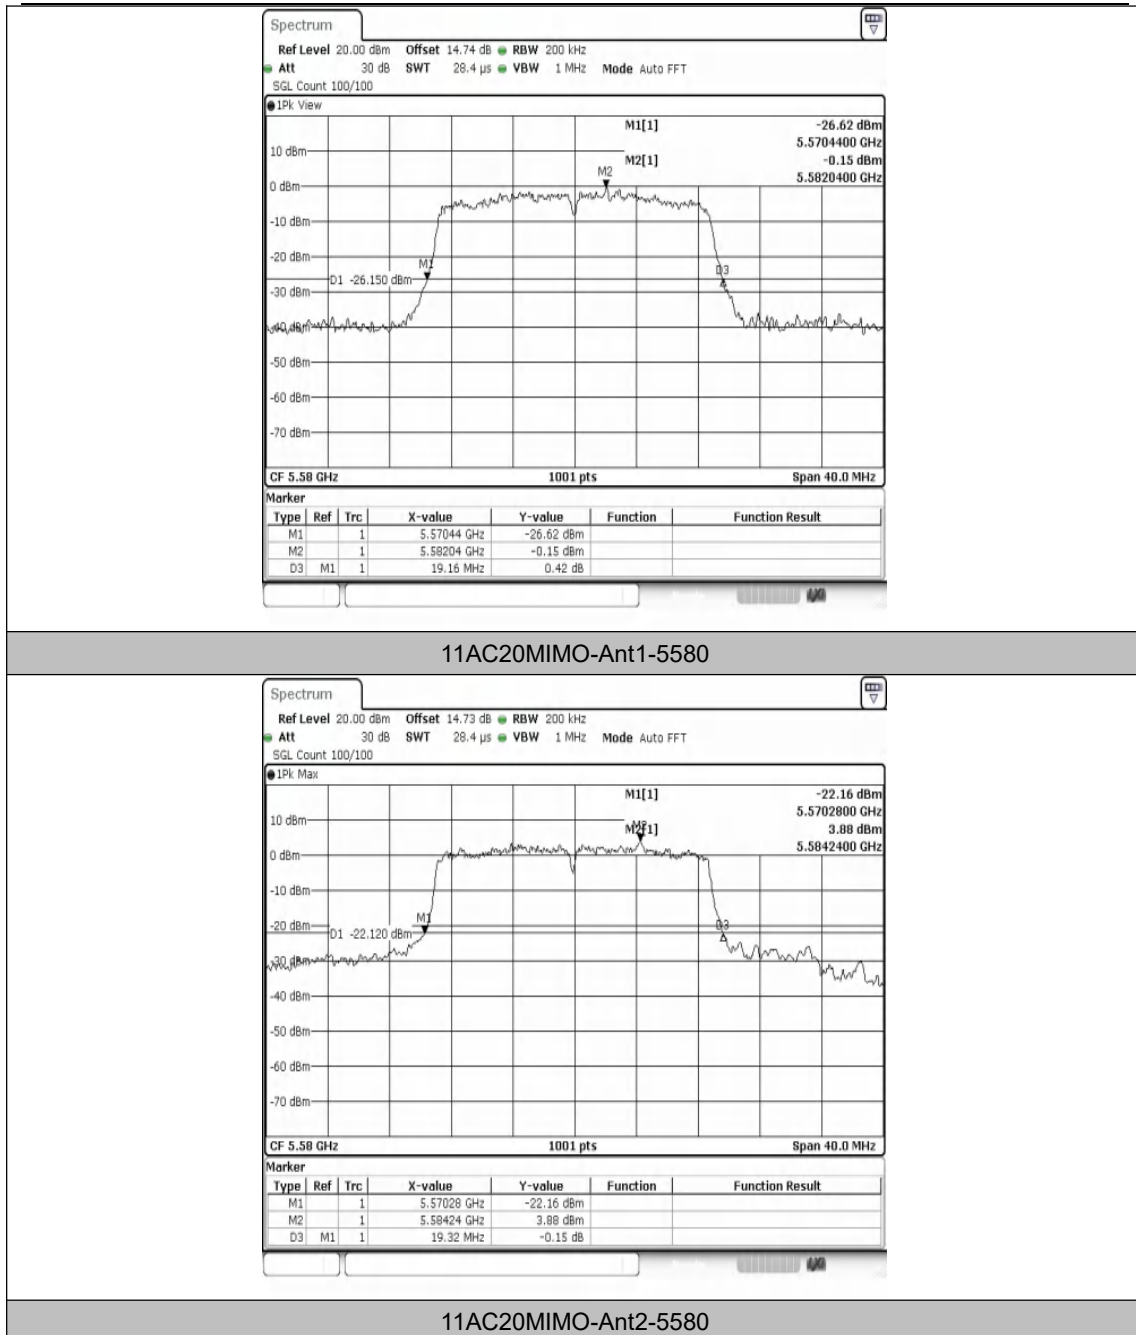



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

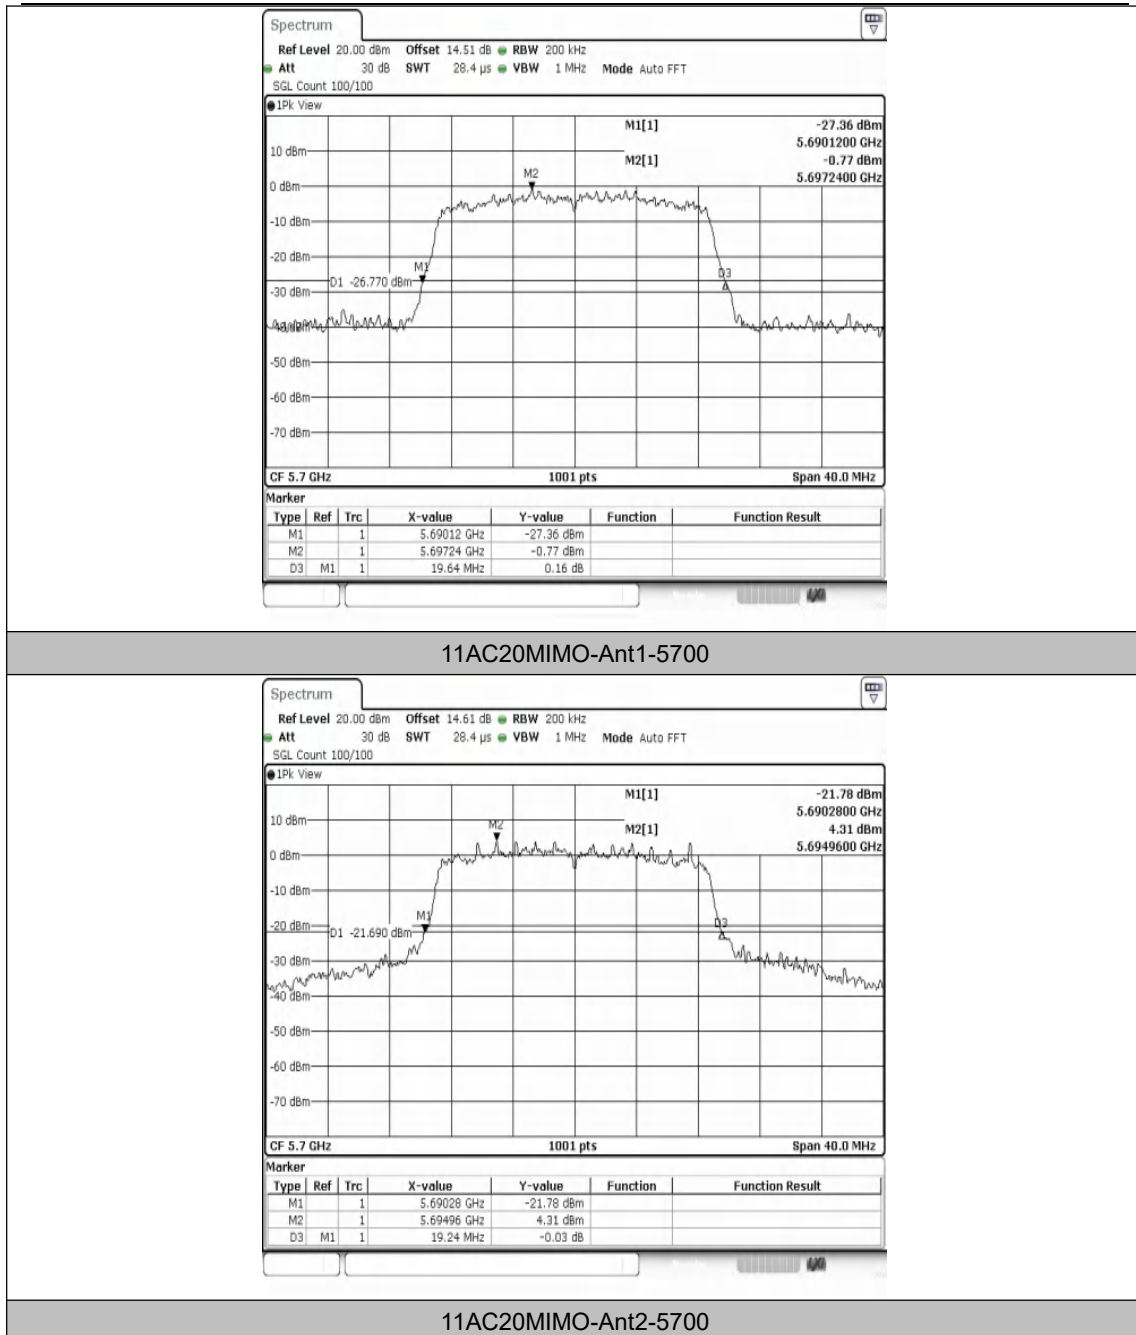

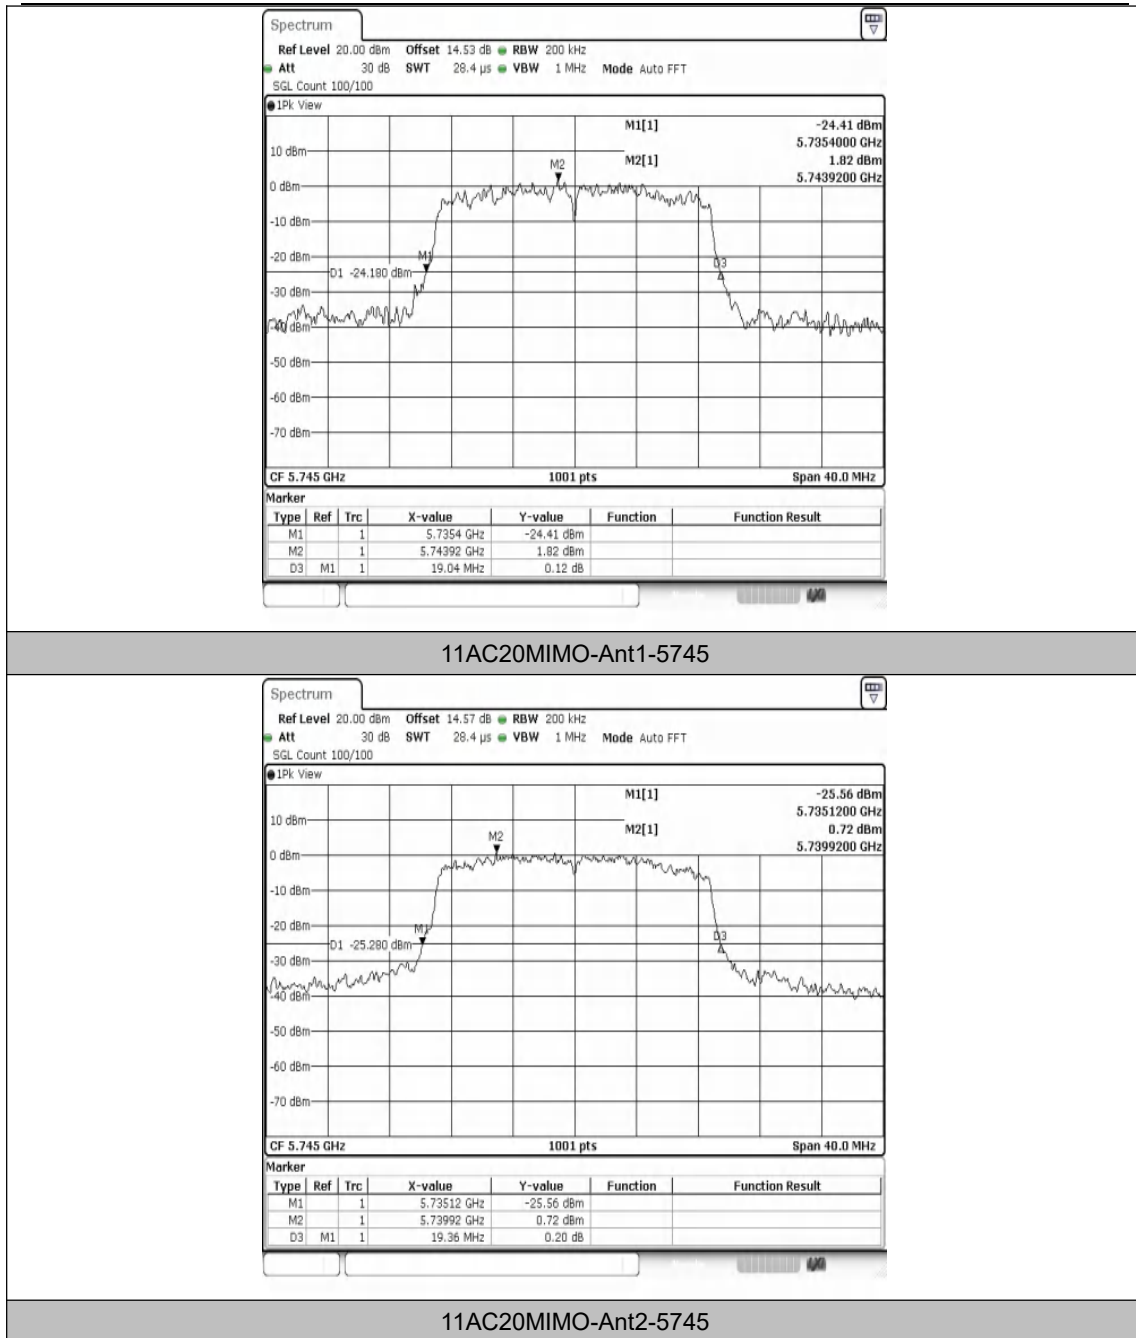


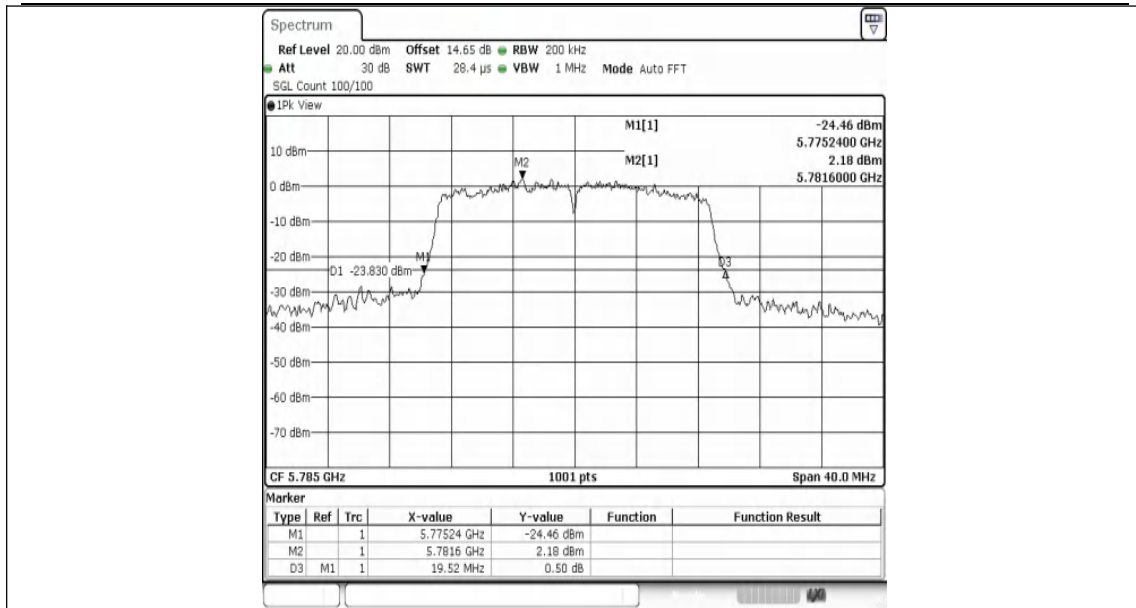



11AC20MIMO-Ant1-5785

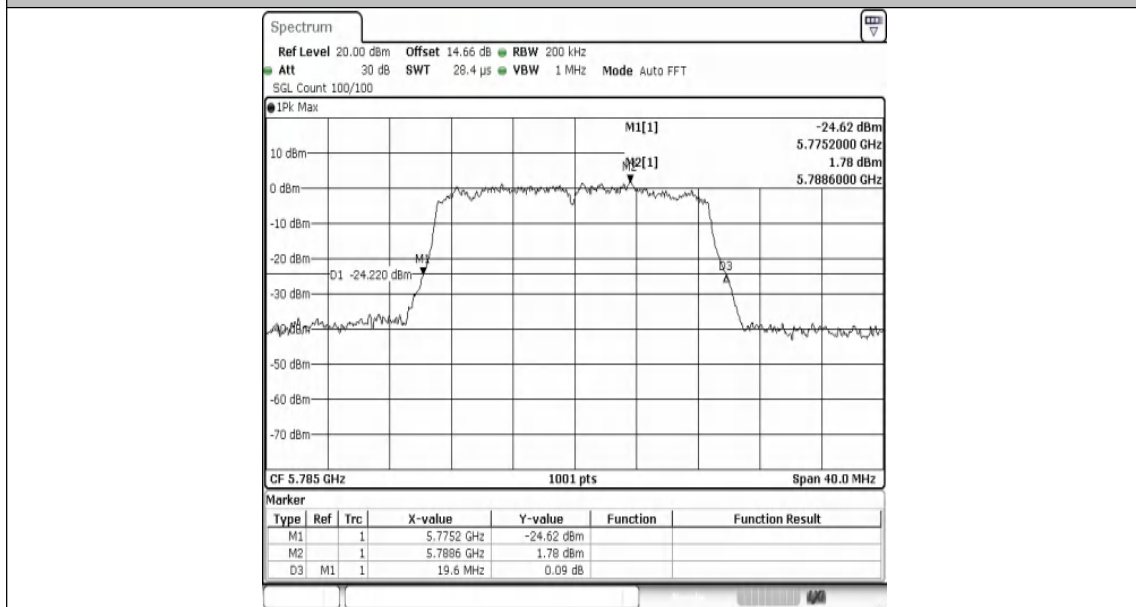


11AC20MIMO-Ant2-5785

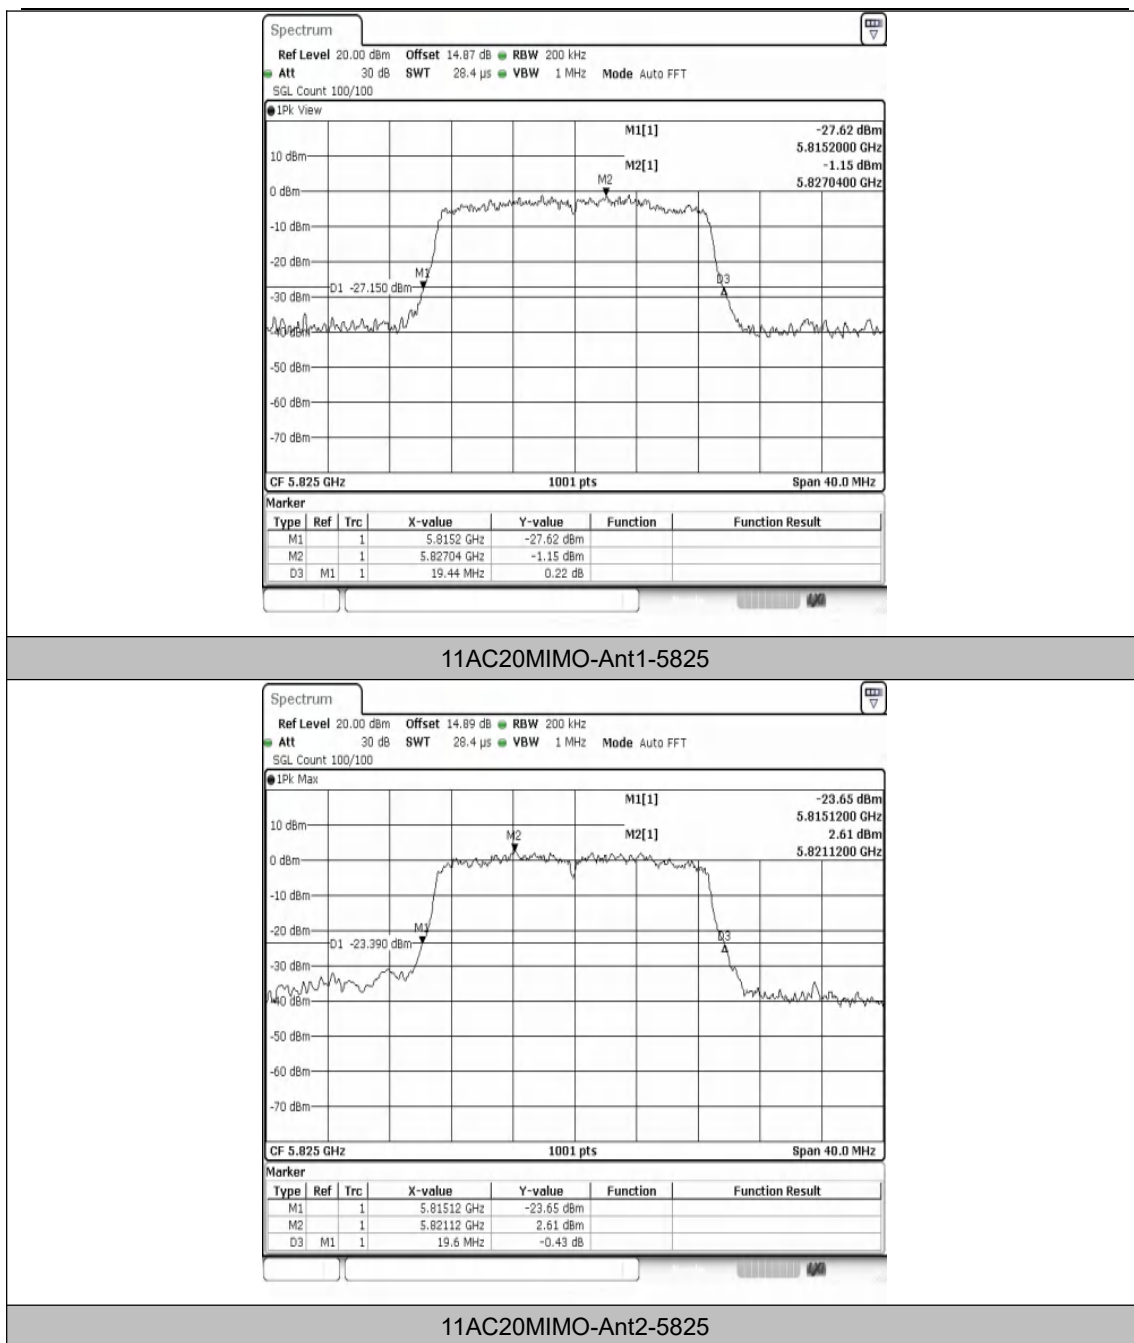

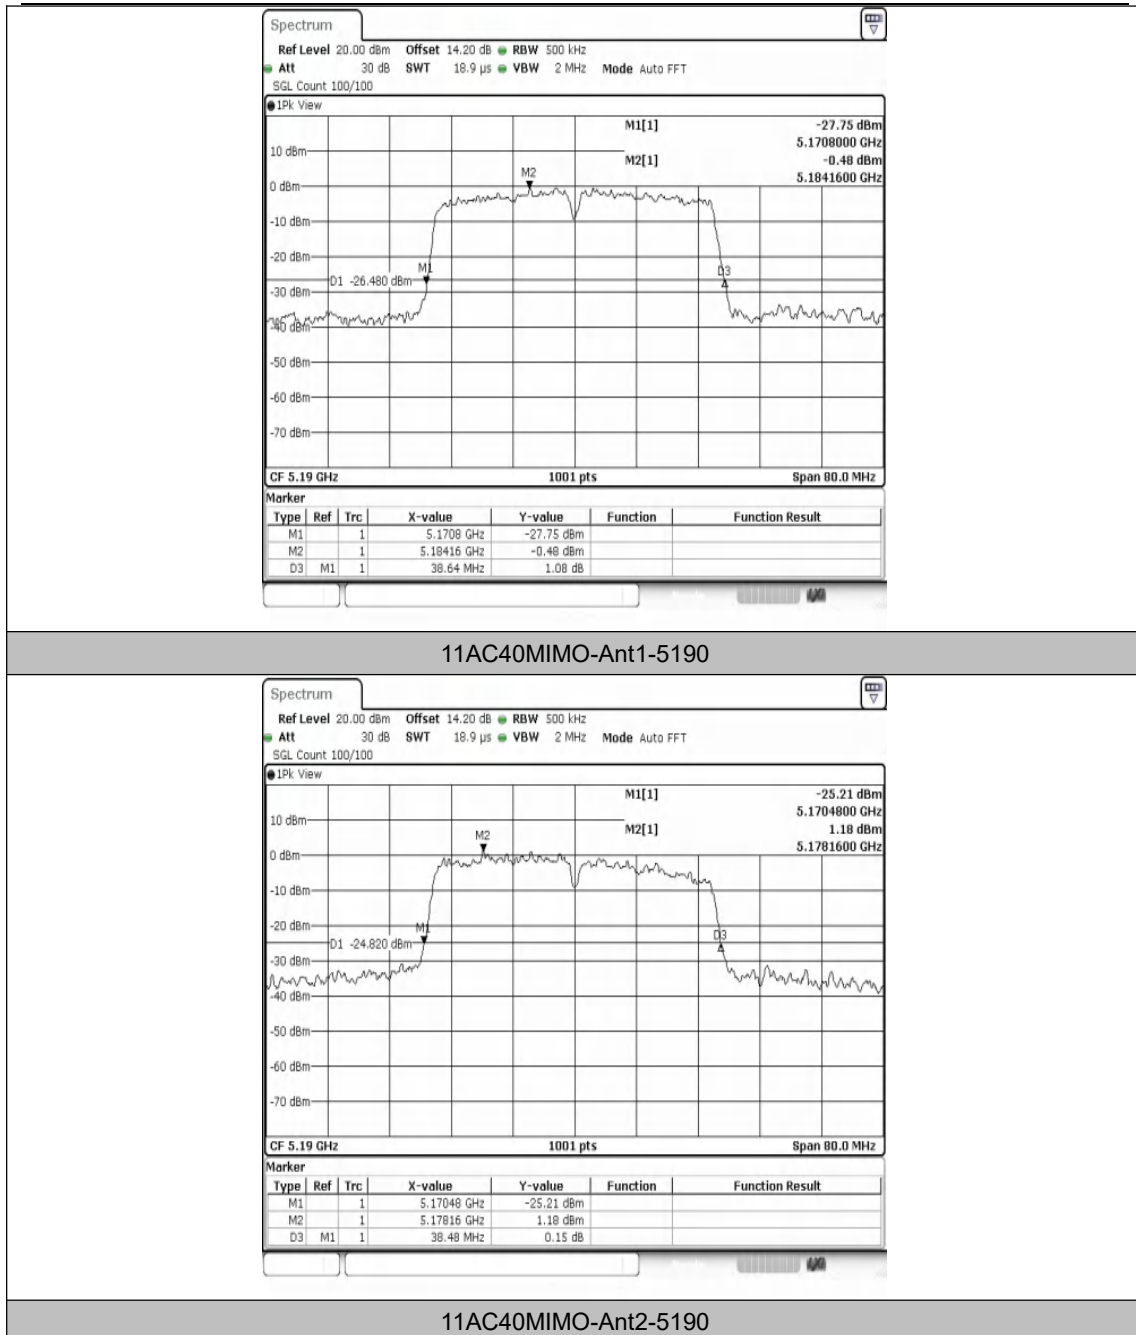


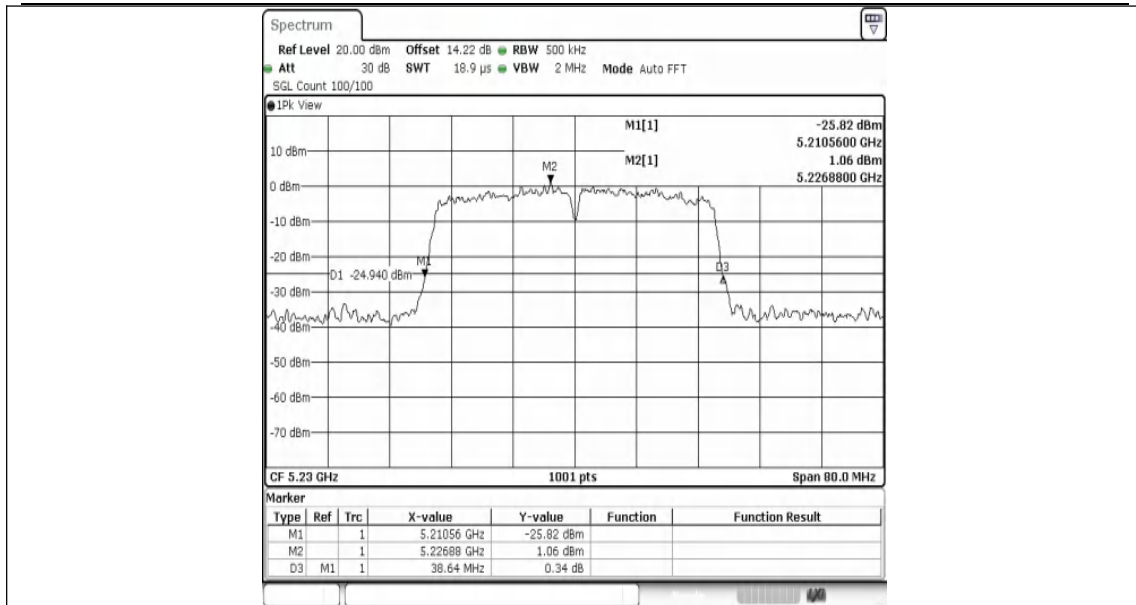


11AC40MIMO-Ant1-5230

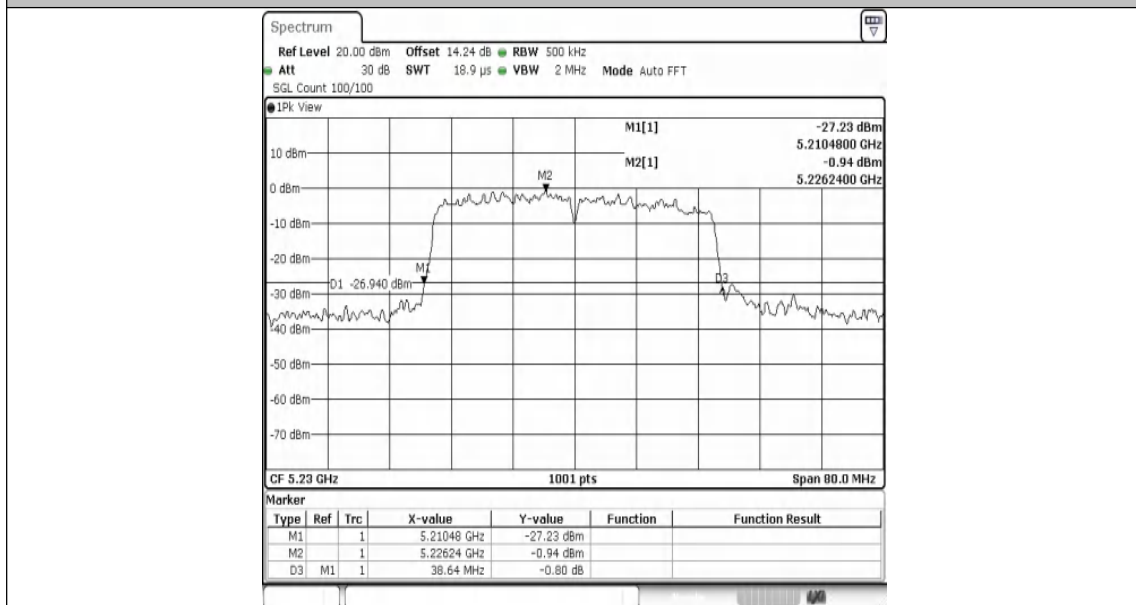


11AC40MIMO-Ant2-5230

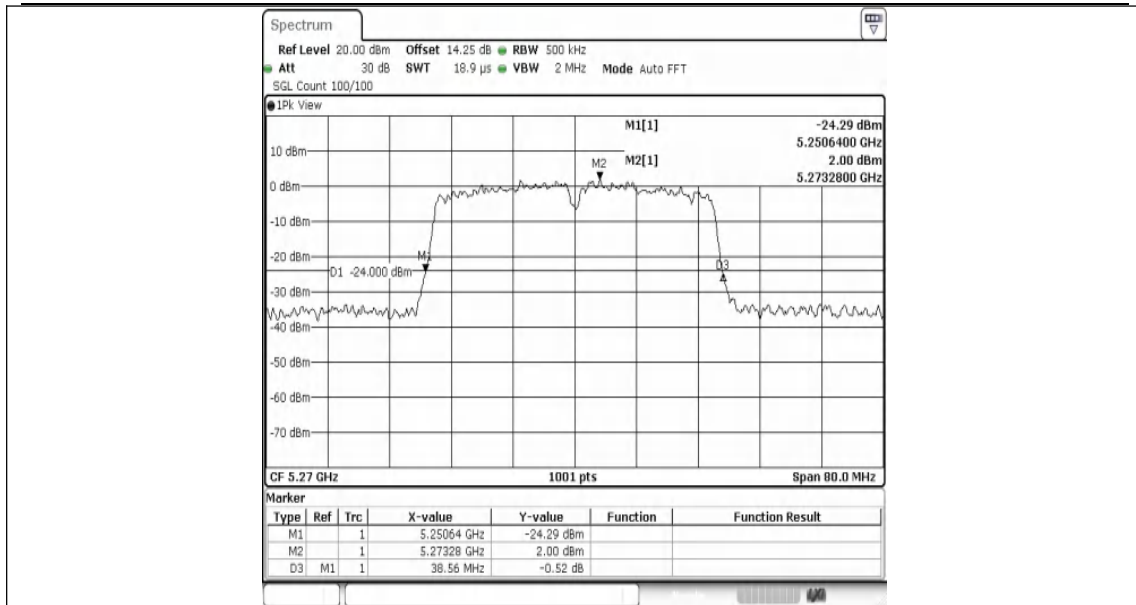



11AC40MIMO-Ant1-5270

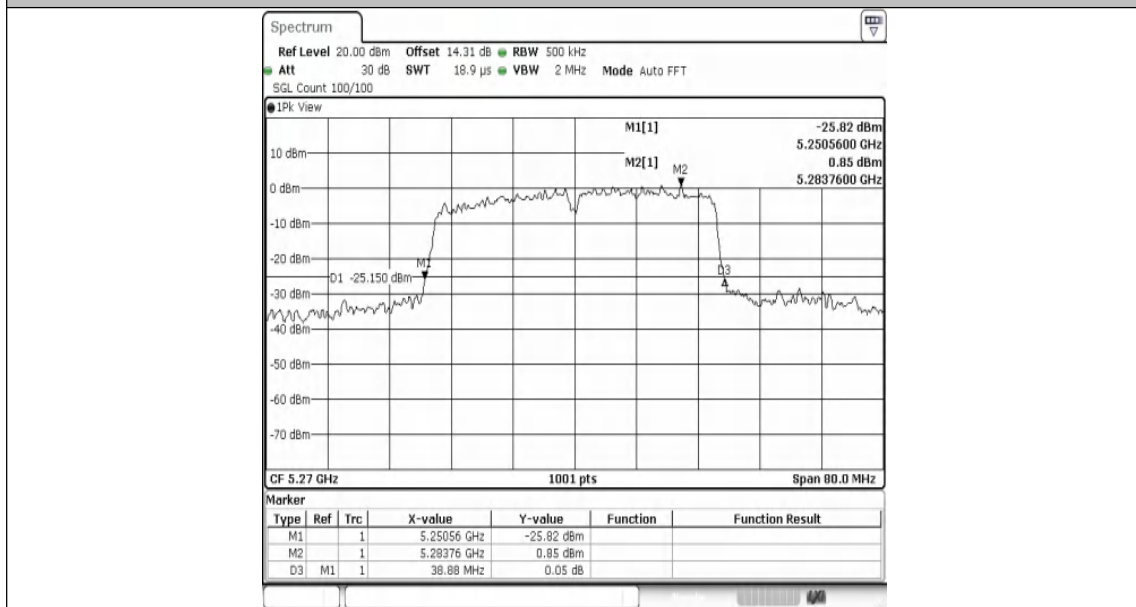


11AC40MIMO-Ant2-5270

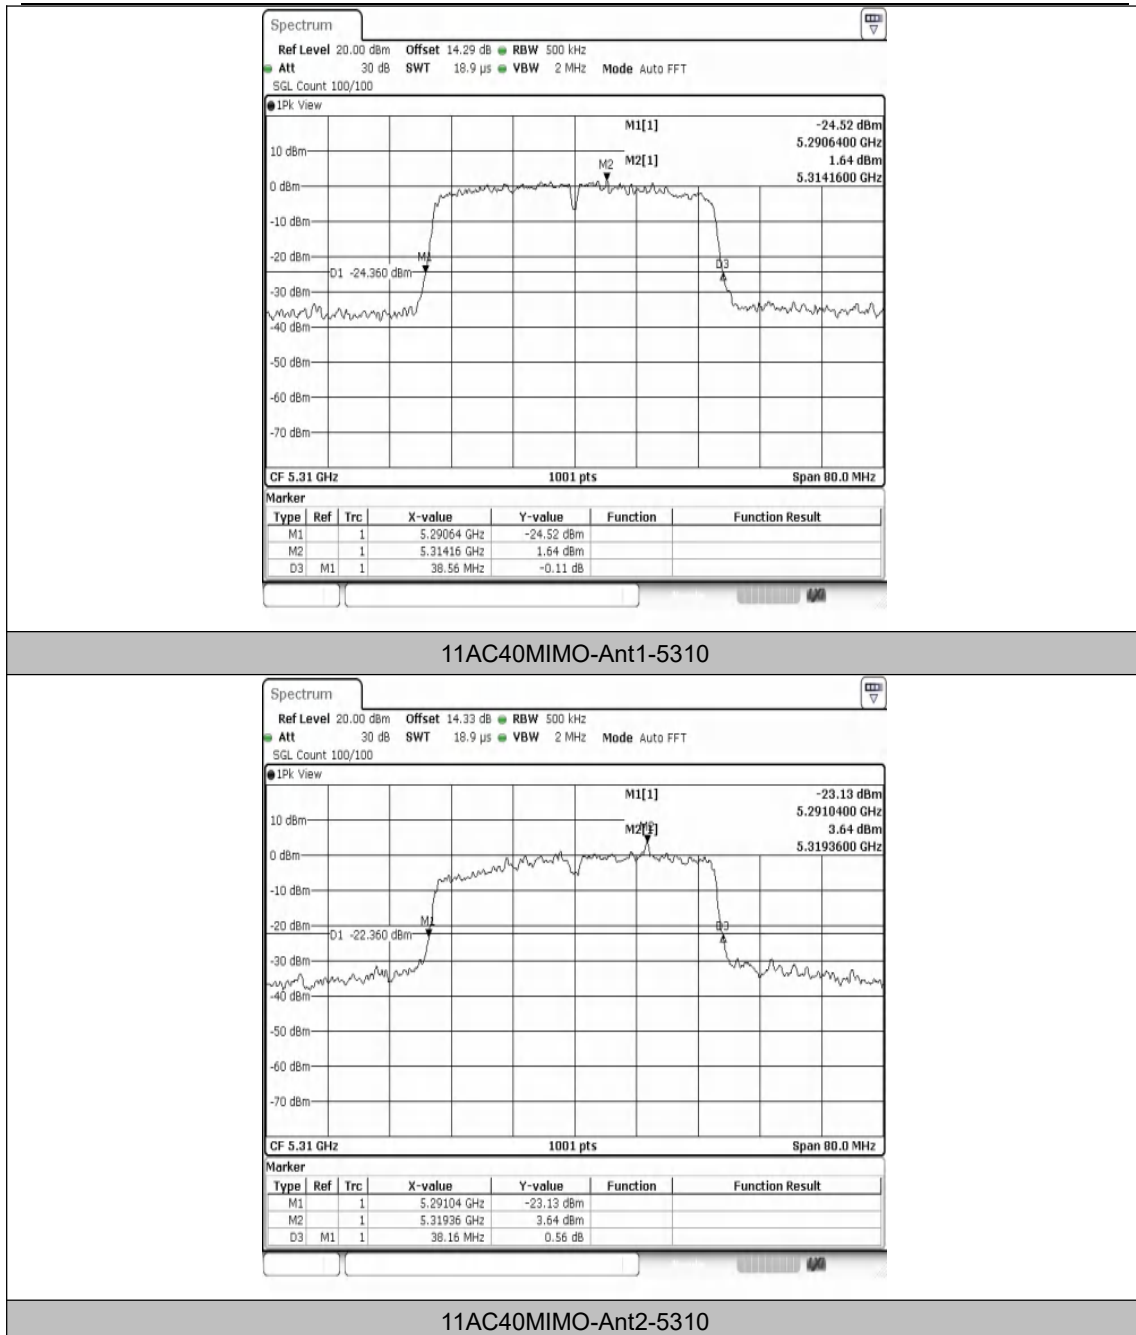

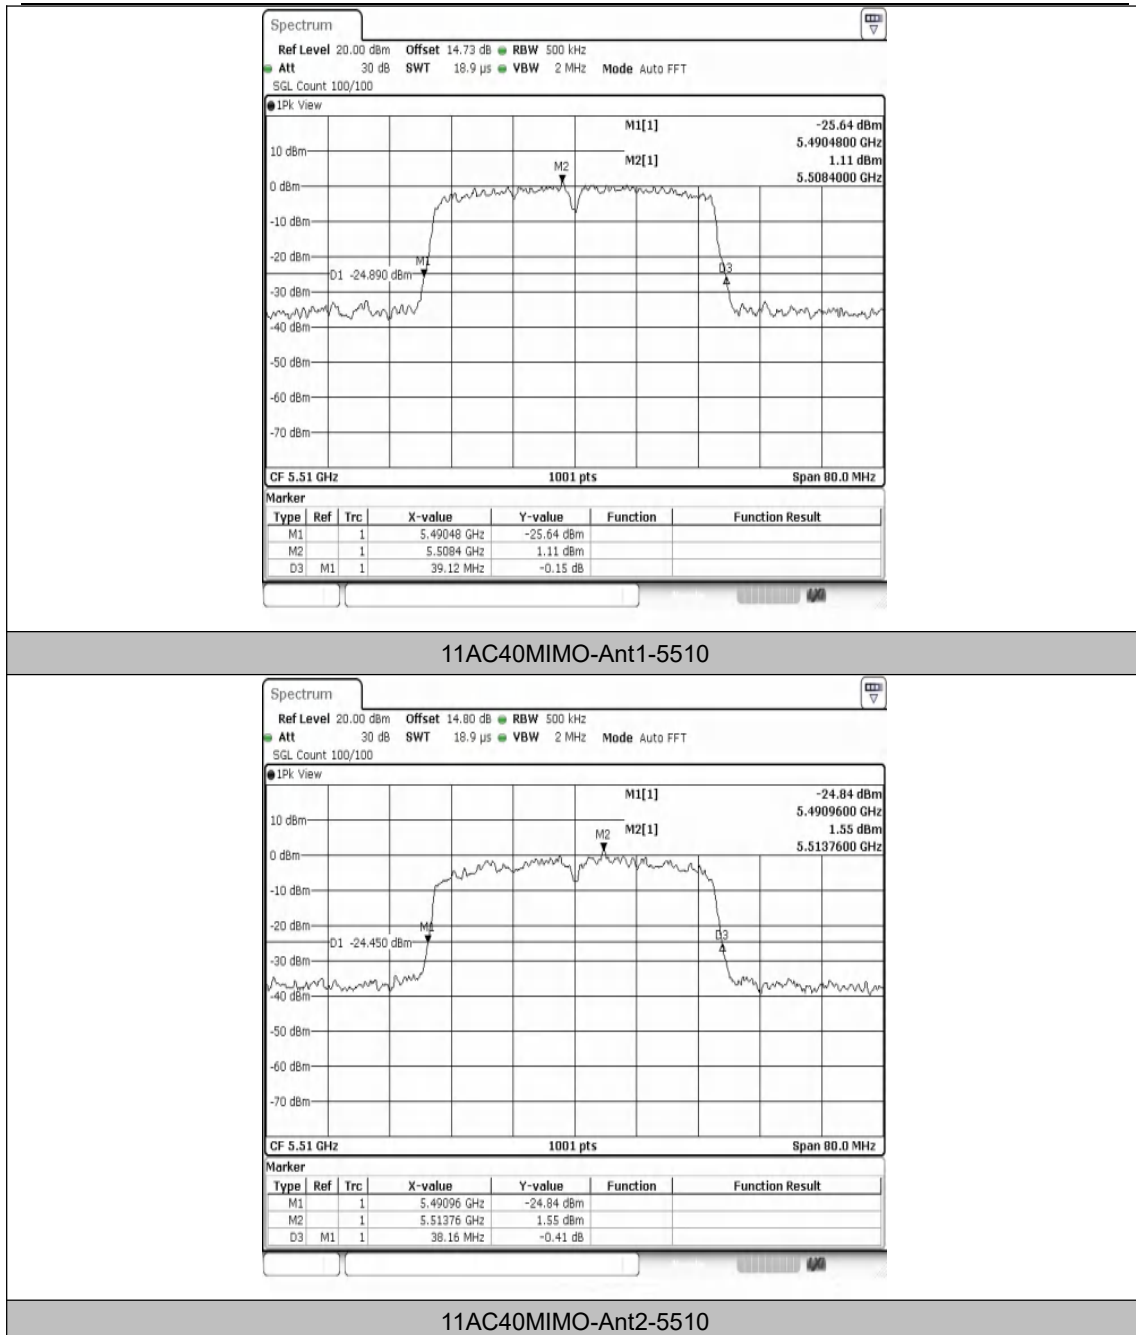


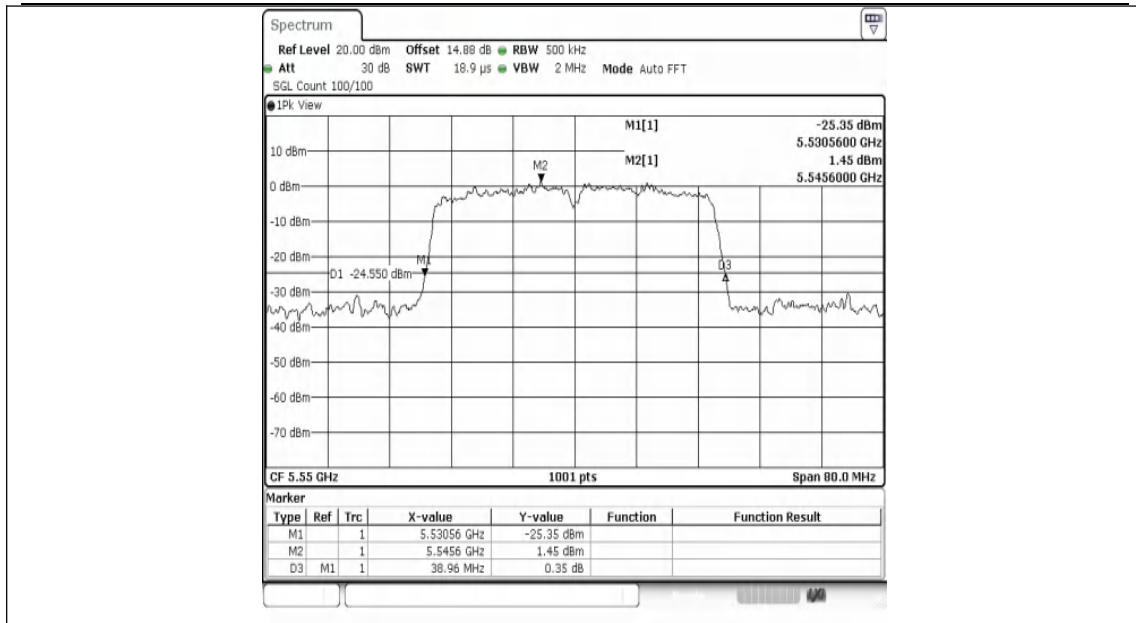


11AC40MIMO-Ant1-5550

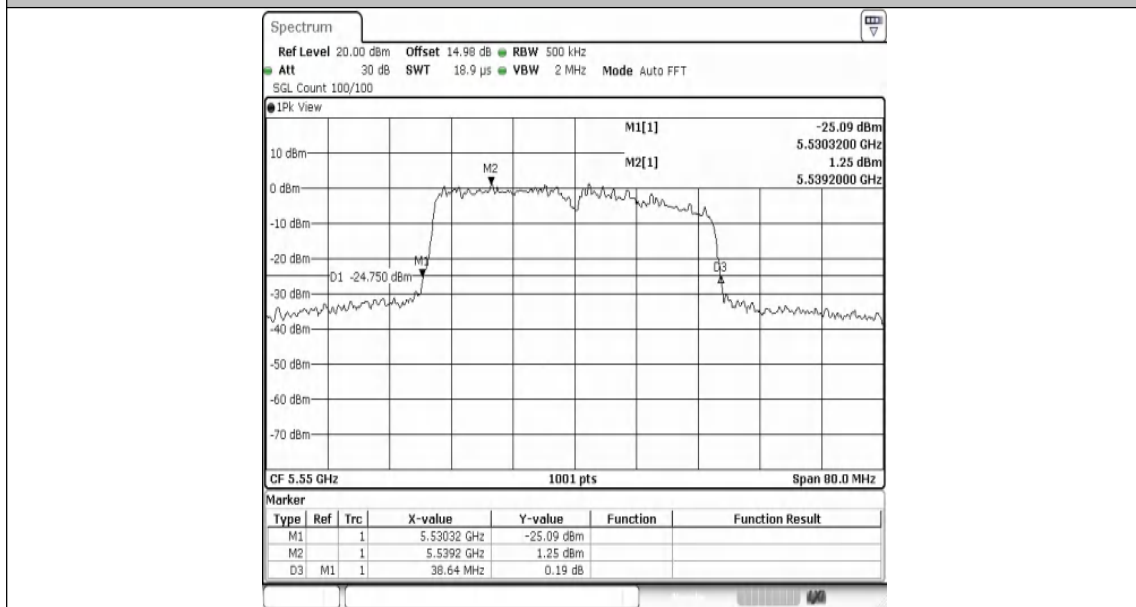


11AC40MIMO-Ant2-5550

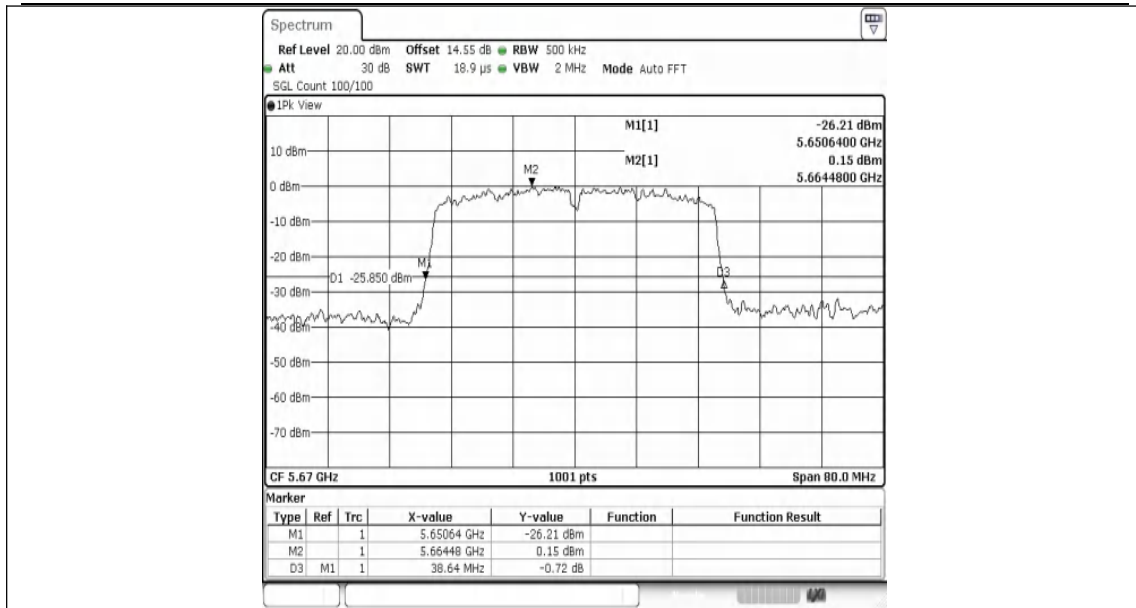


11AC40MIMO-Ant1-5670

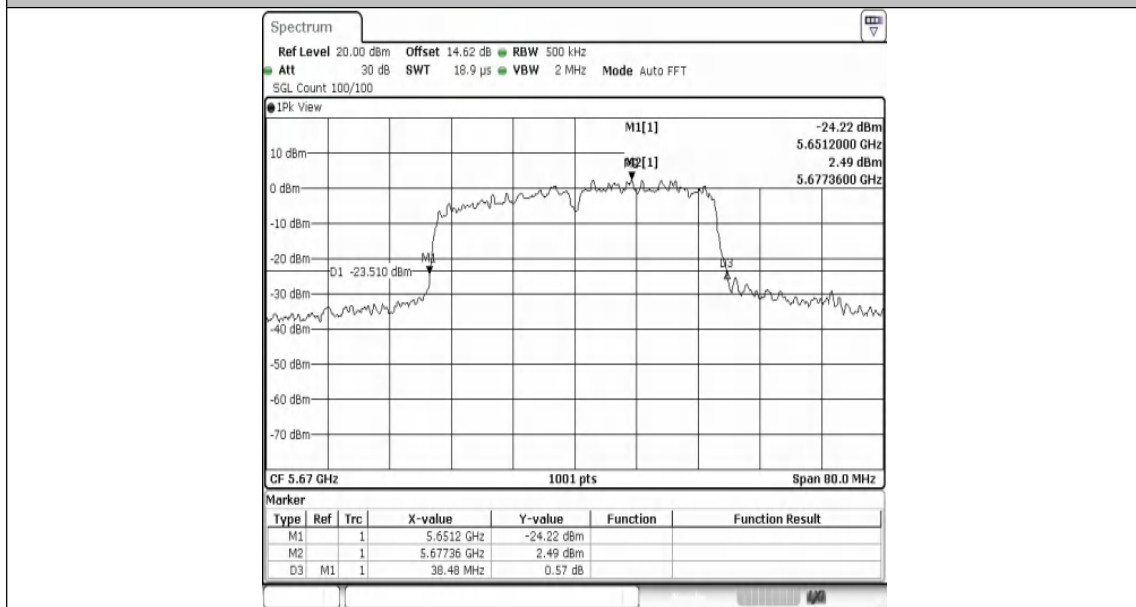


11AC40MIMO-Ant2-5670

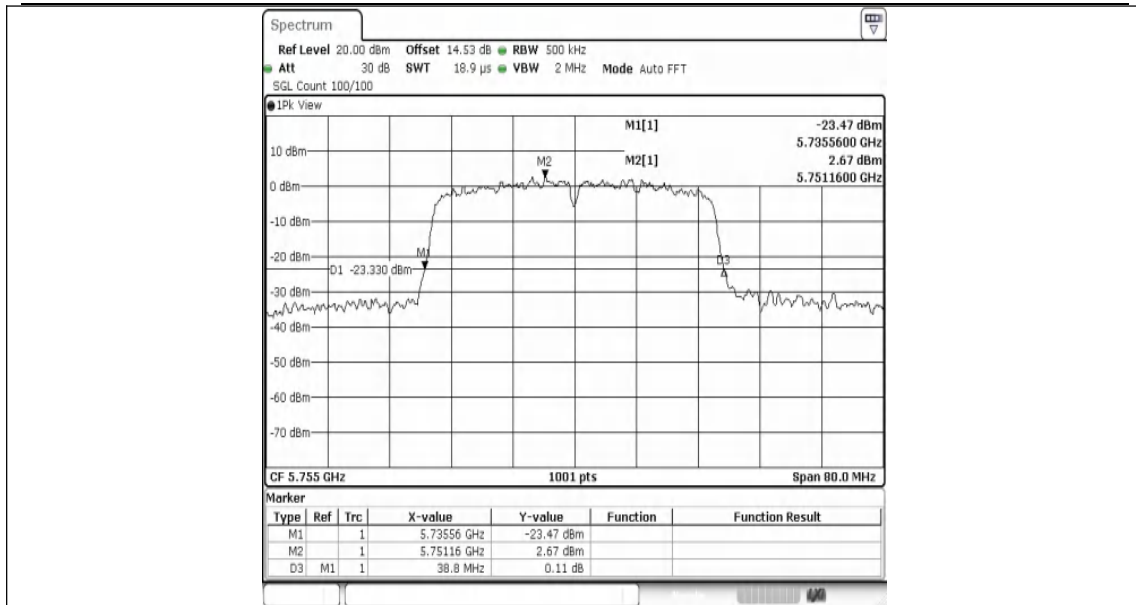


11AC40MIMO-Ant1-5755

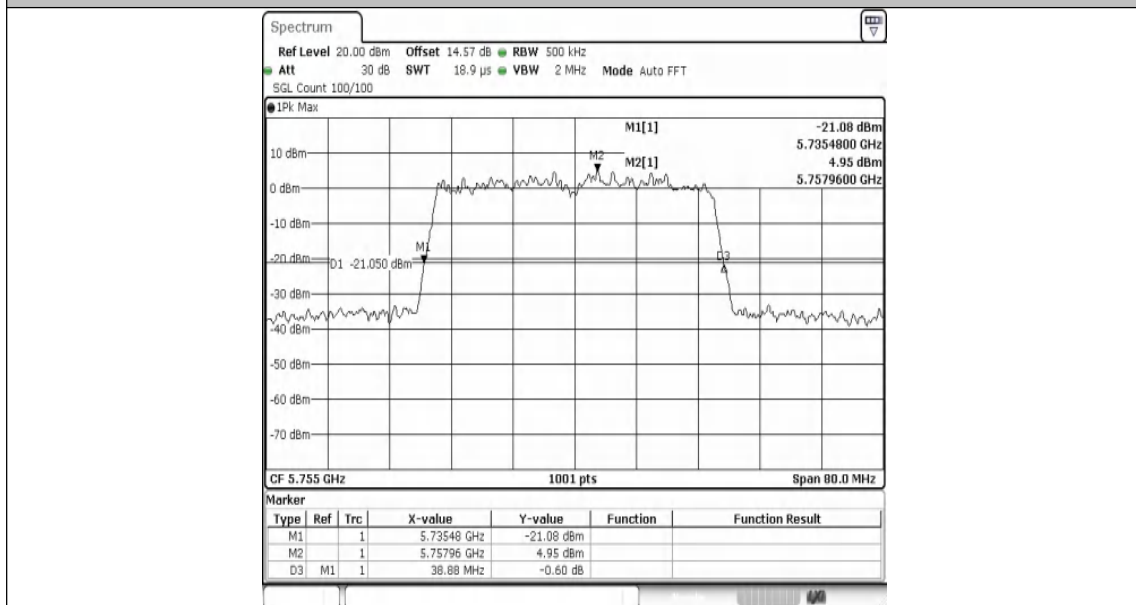


11AC40MIMO-Ant2-5755

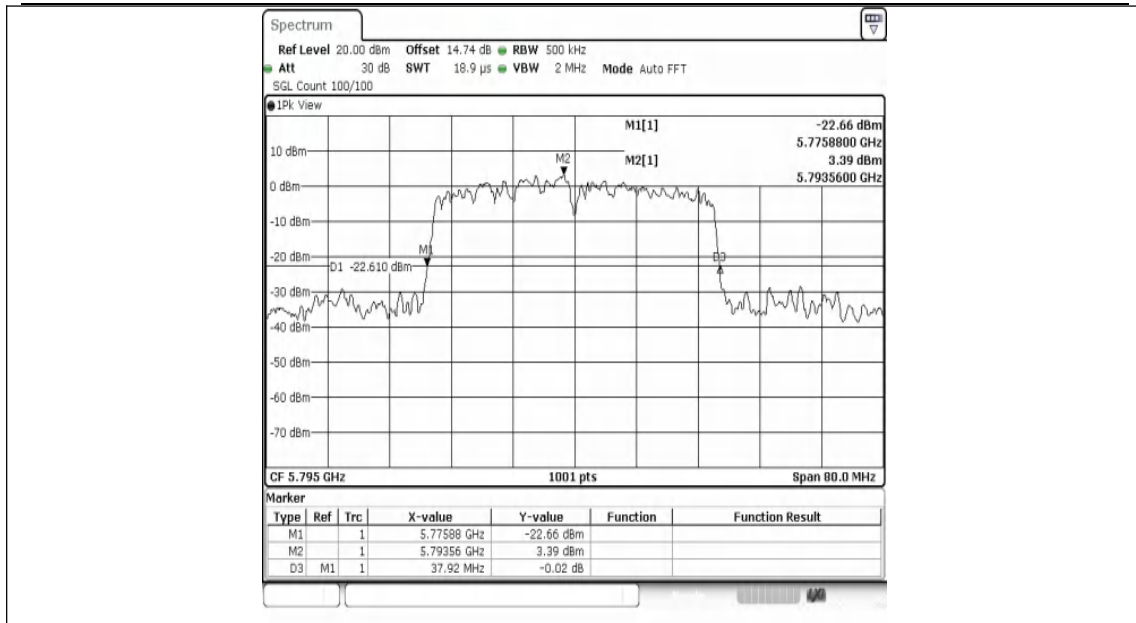



11AC40MIMO-Ant1-5795

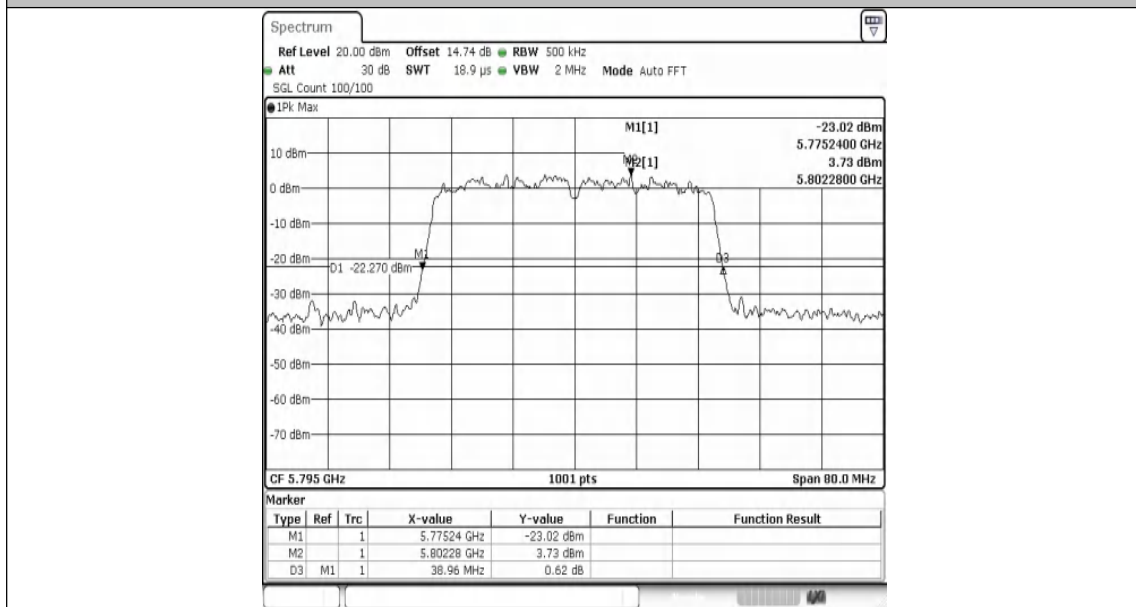



11AC40MIMO-Ant2-5795

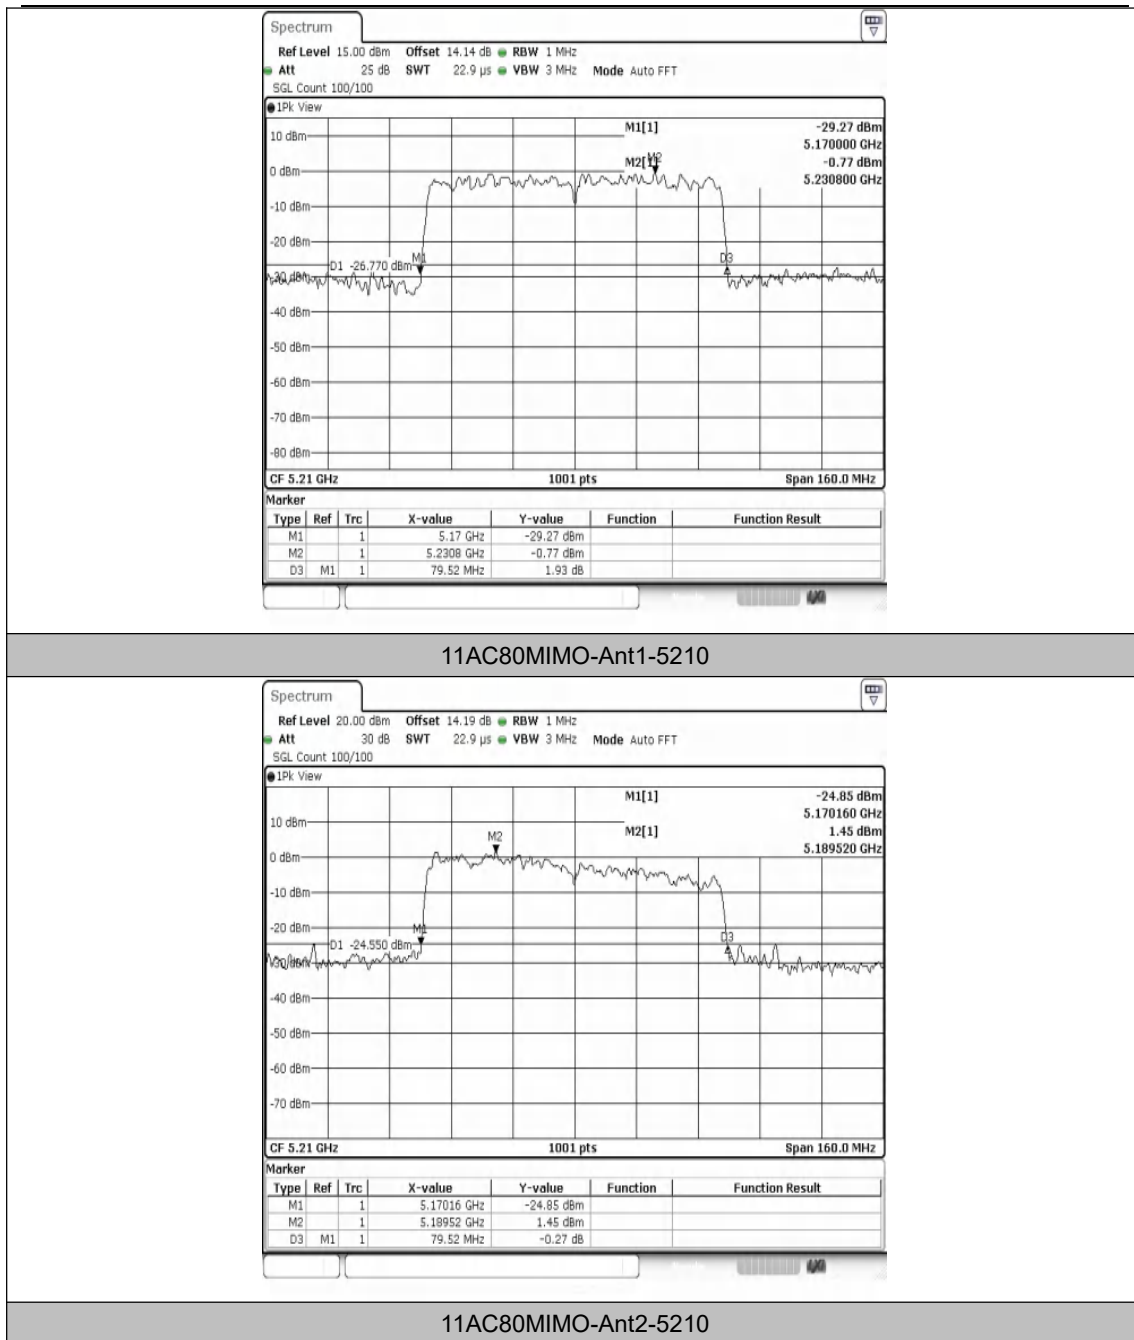


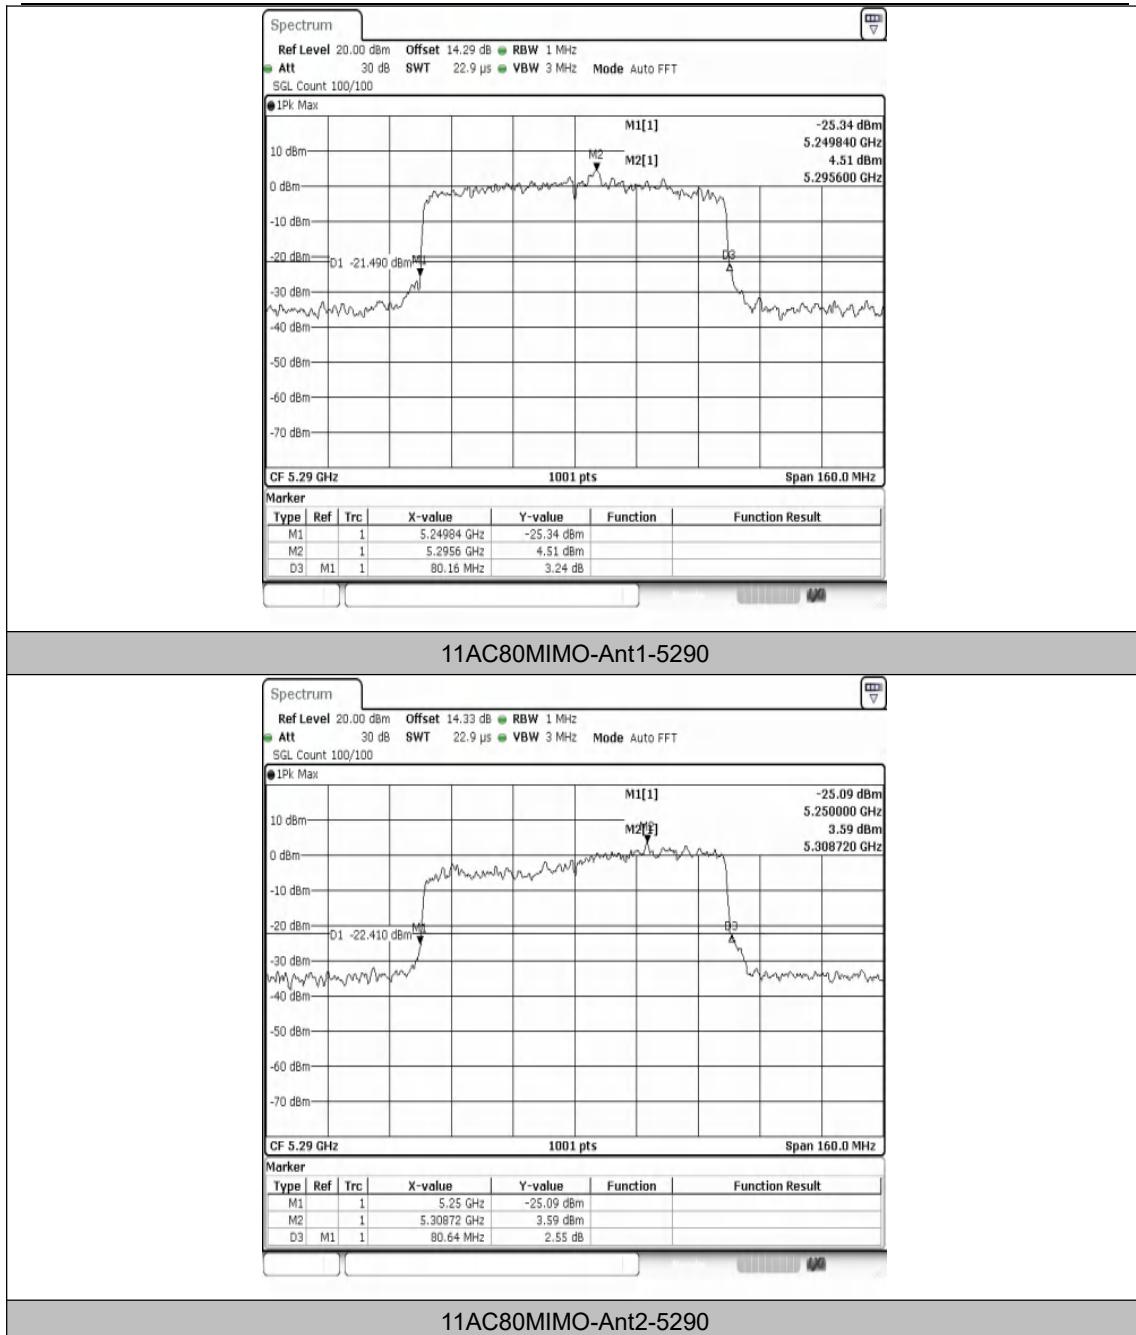

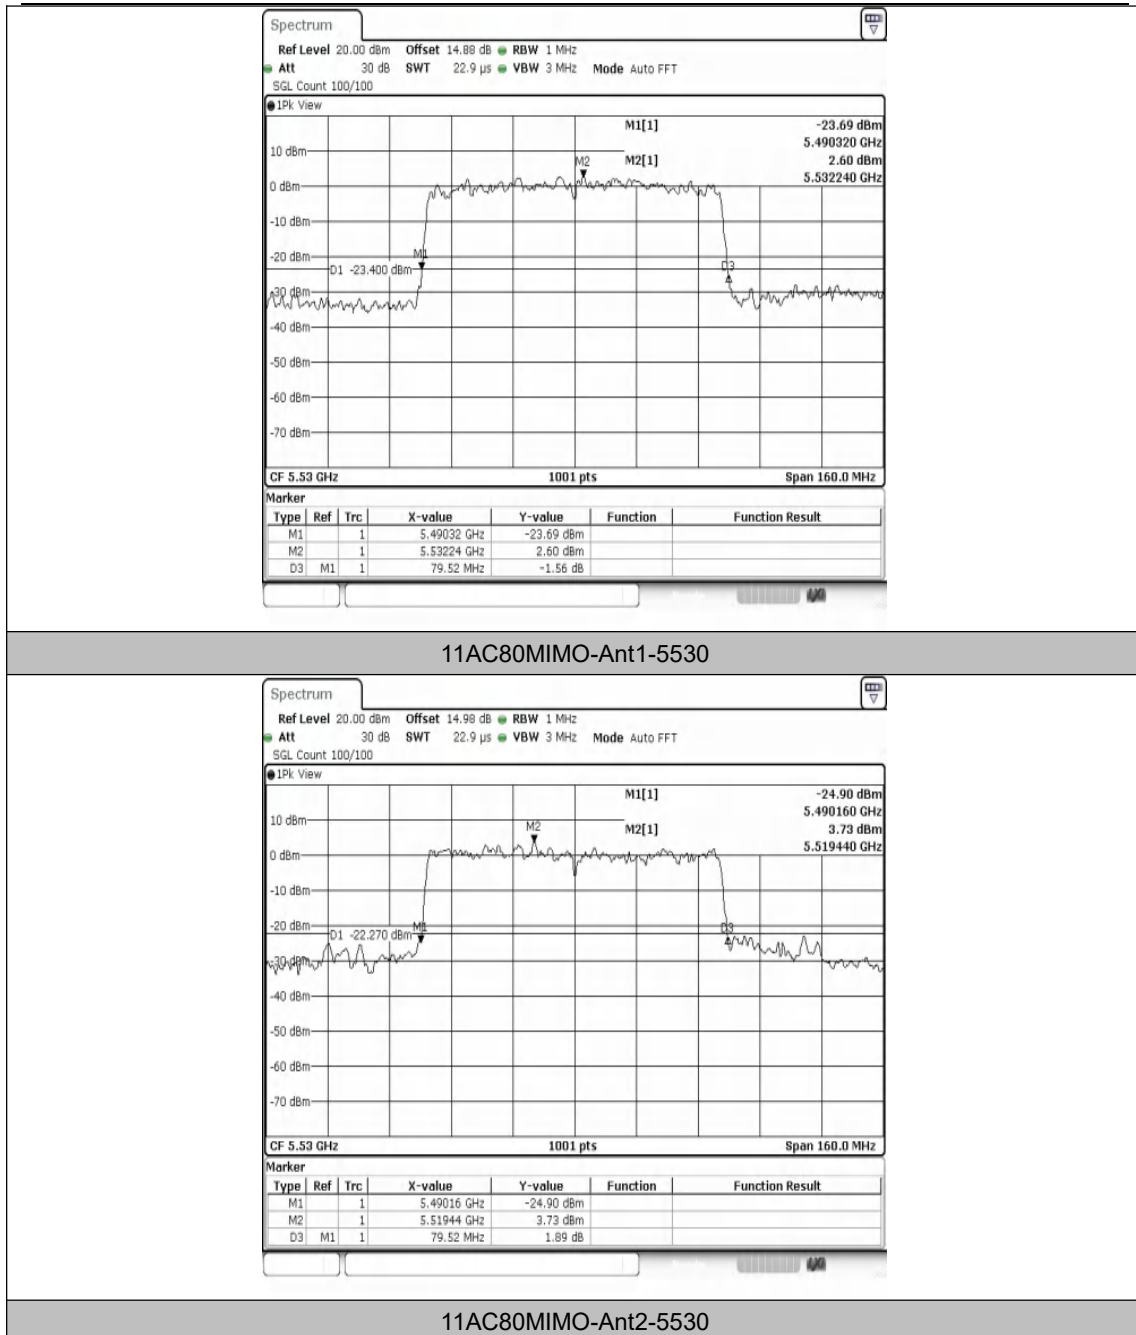


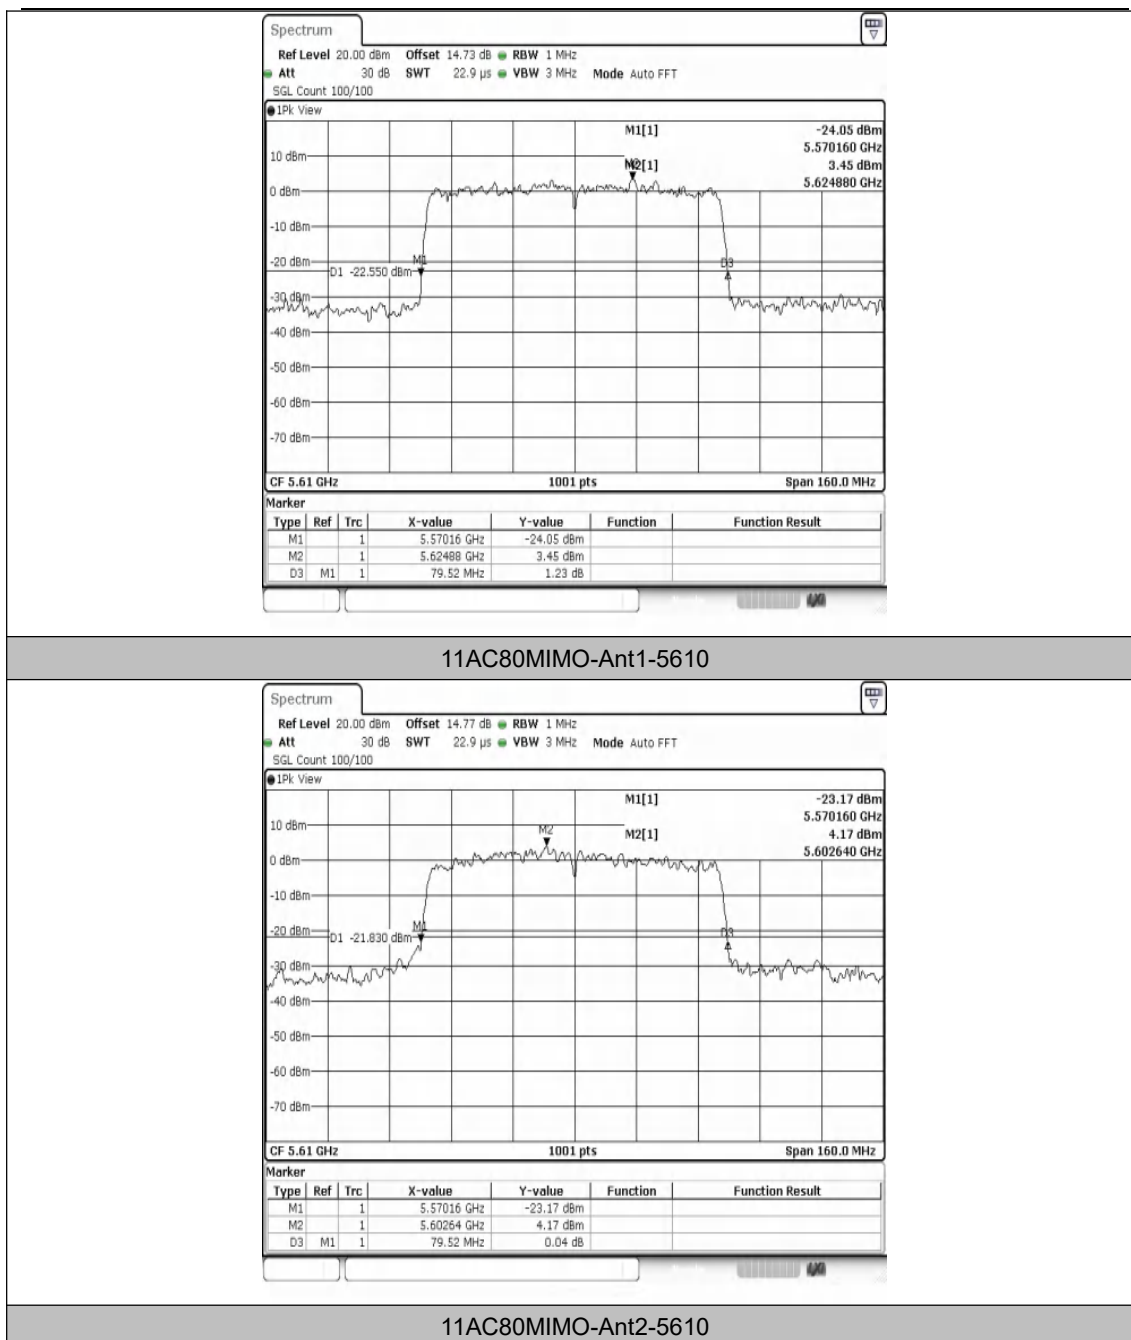

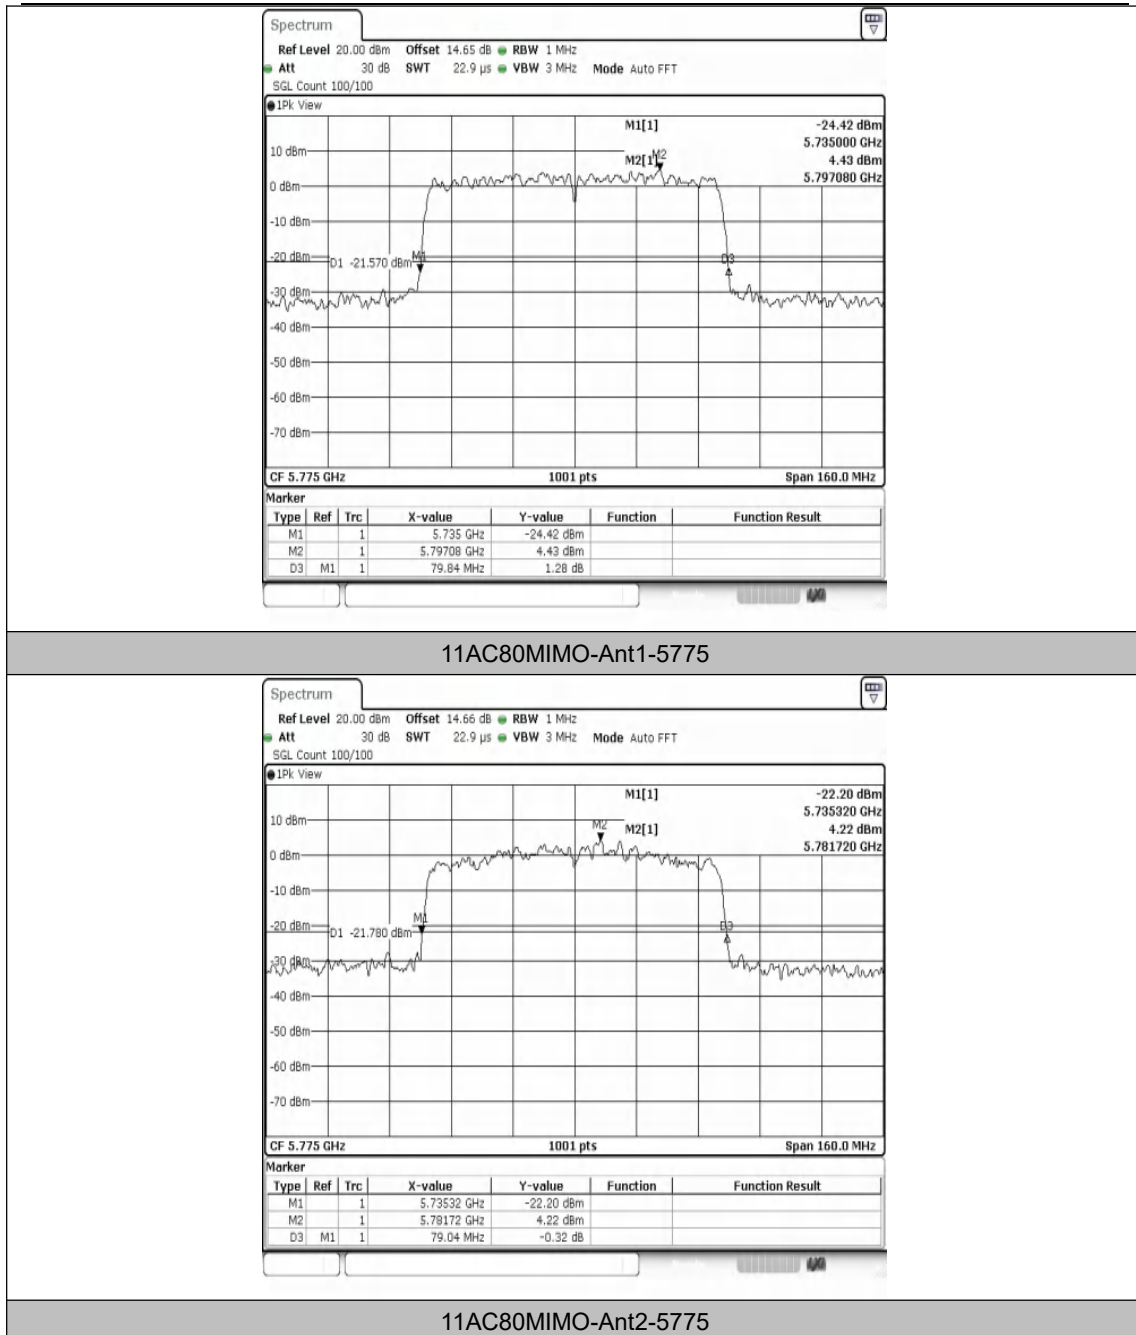


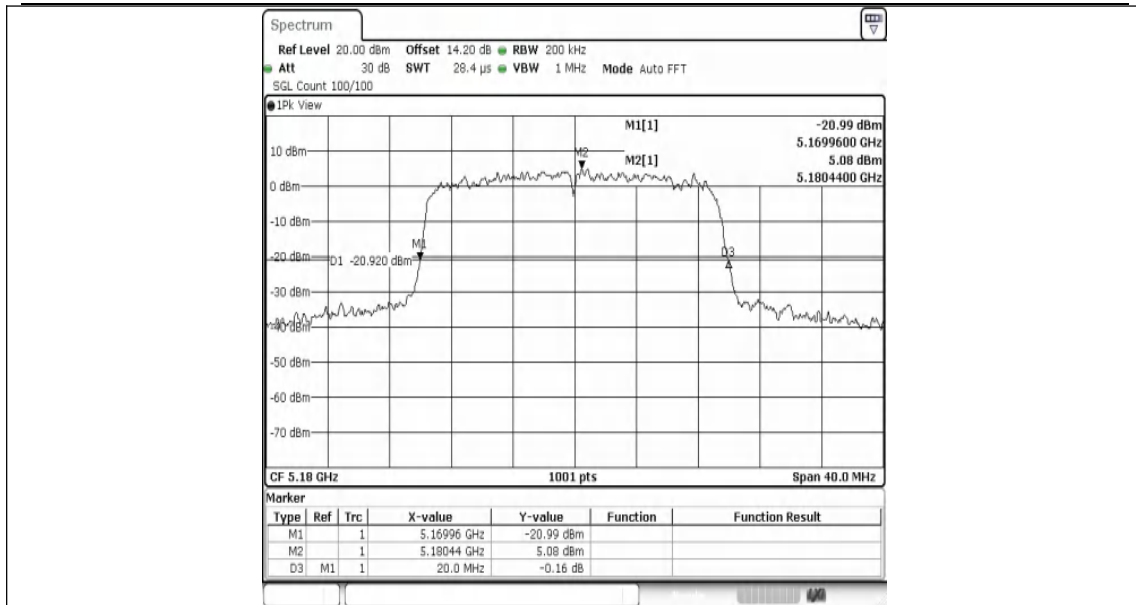


11AX20MIMO-Ant1-5180

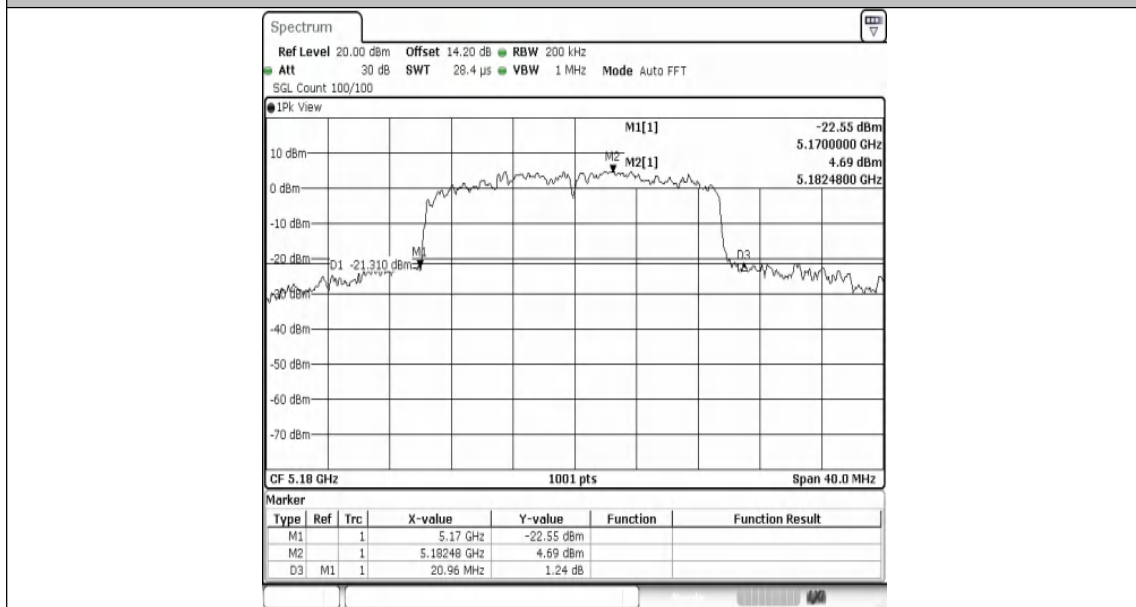


11AX20MIMO-Ant2-5180

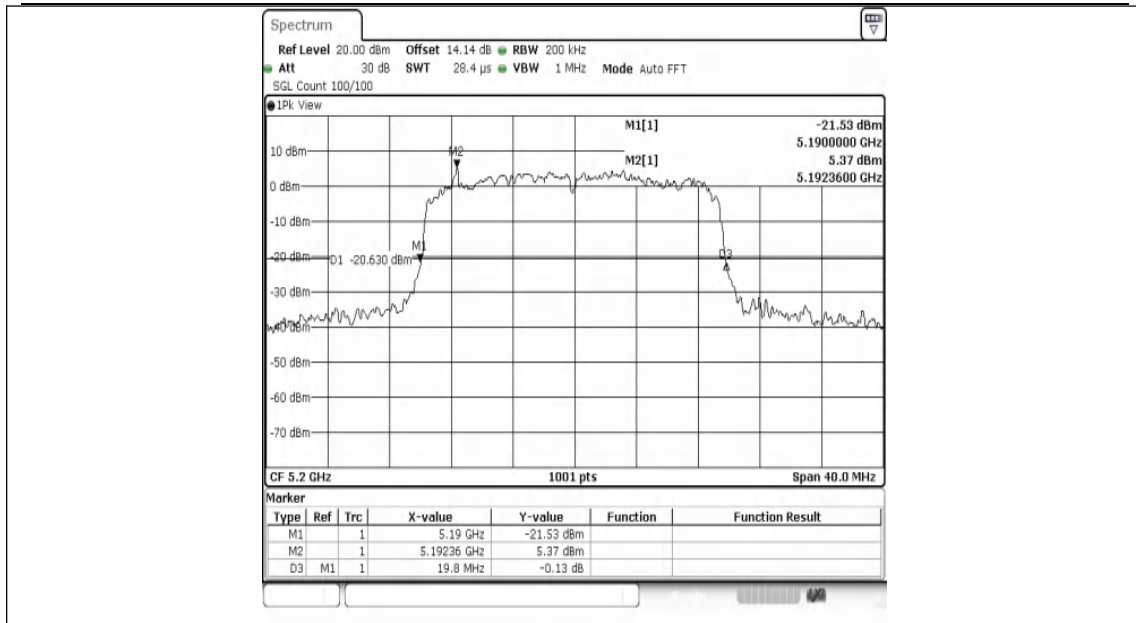



11AX20MIMO-Ant1-5200

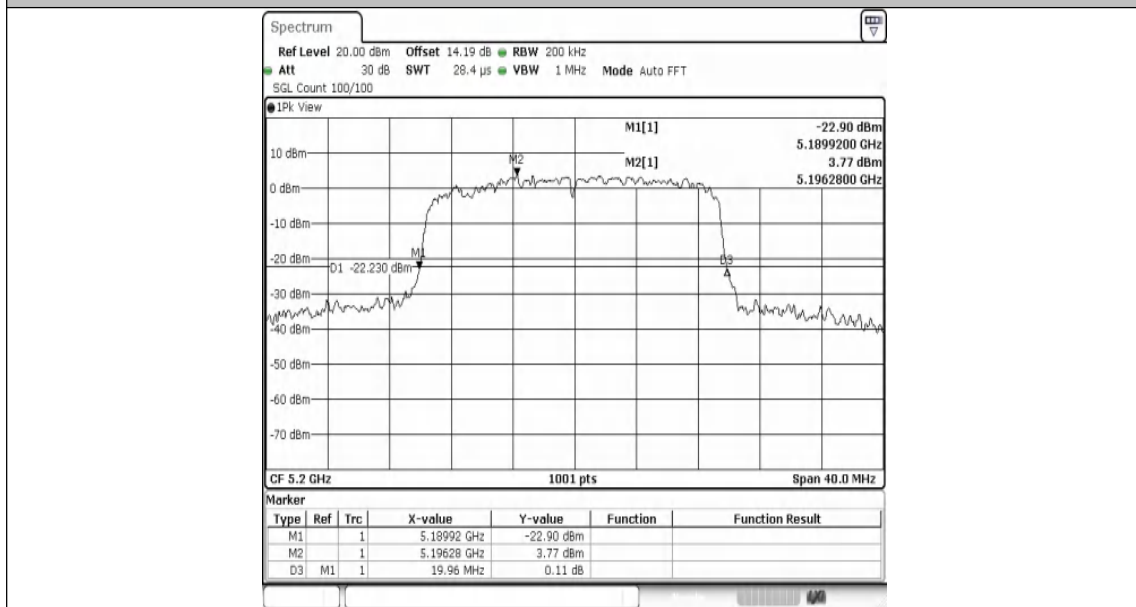


11AX20MIMO-Ant2-5200

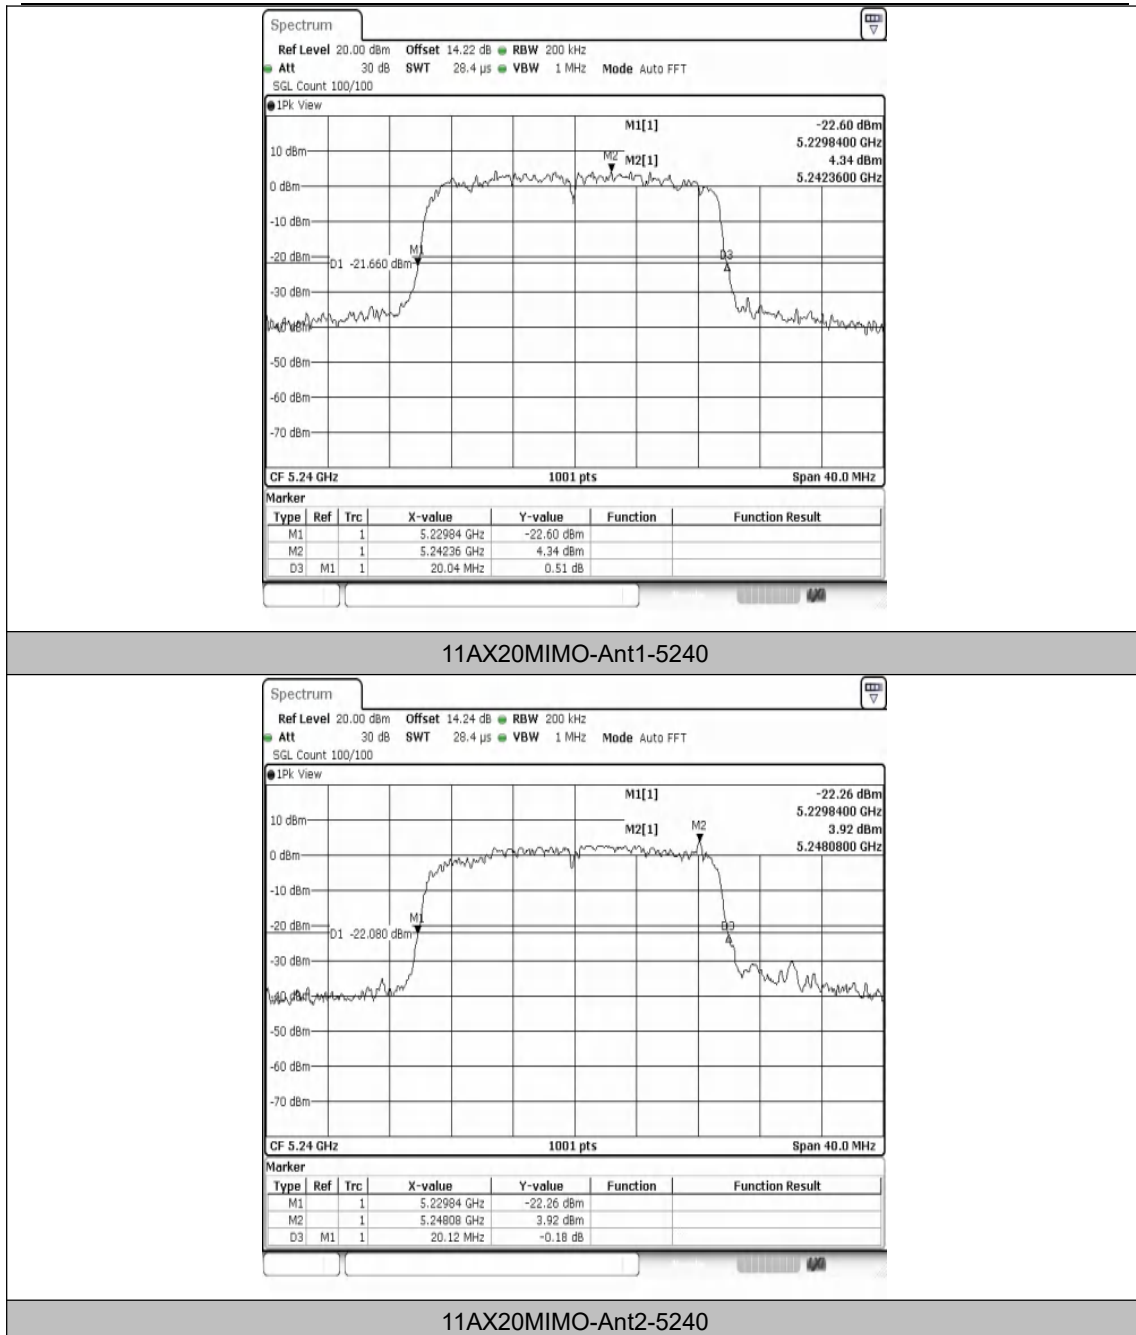


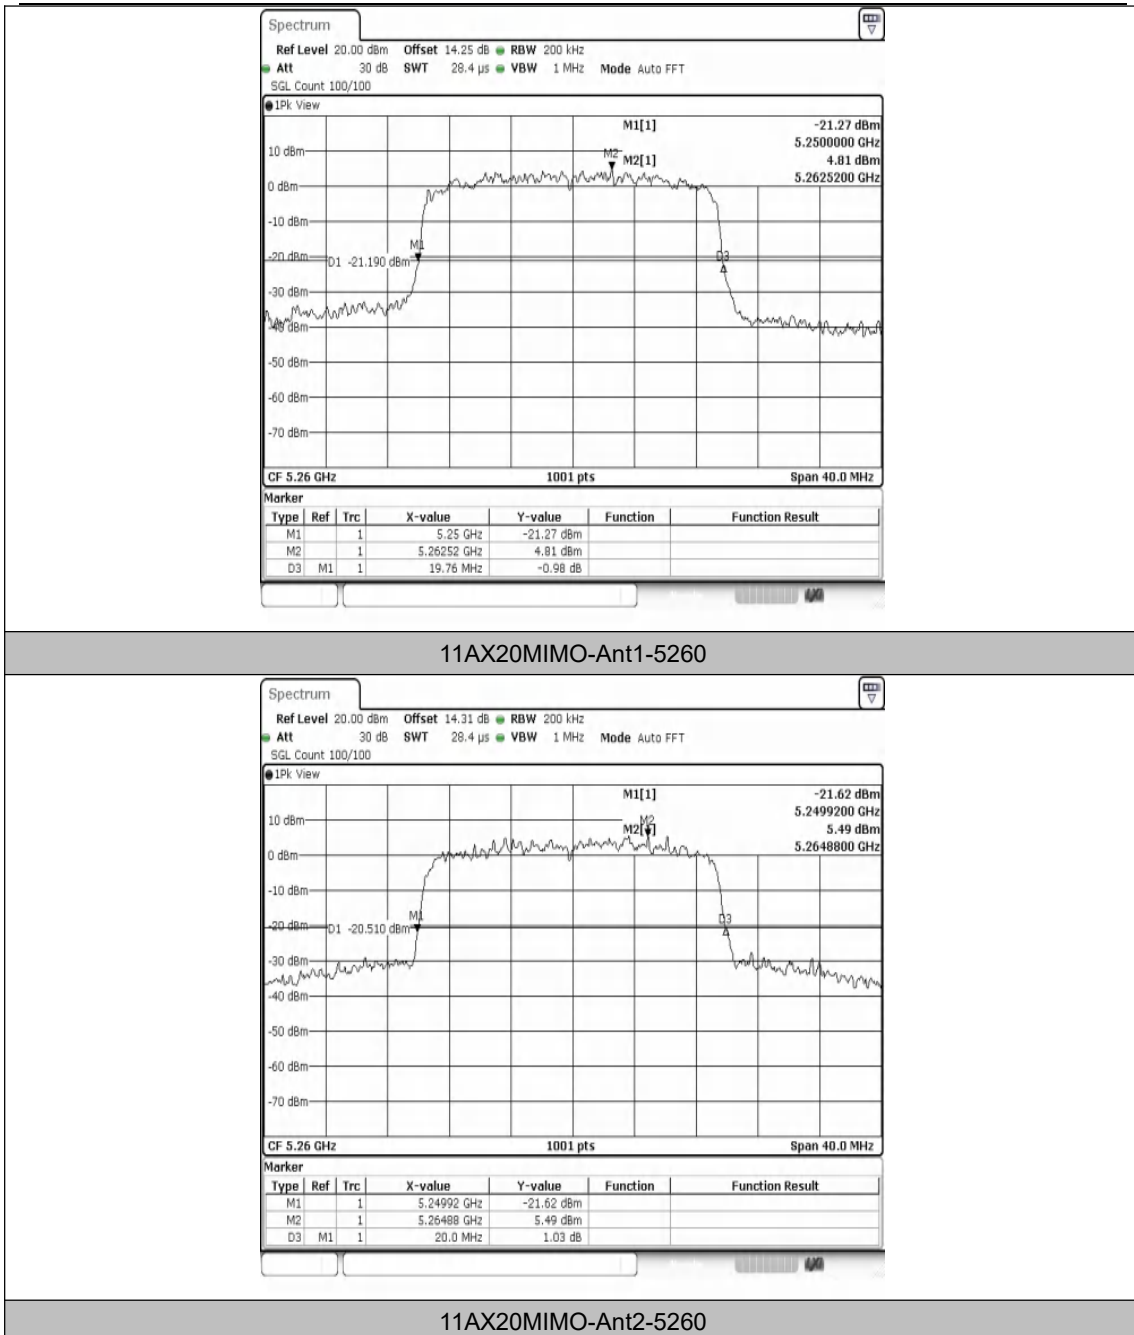

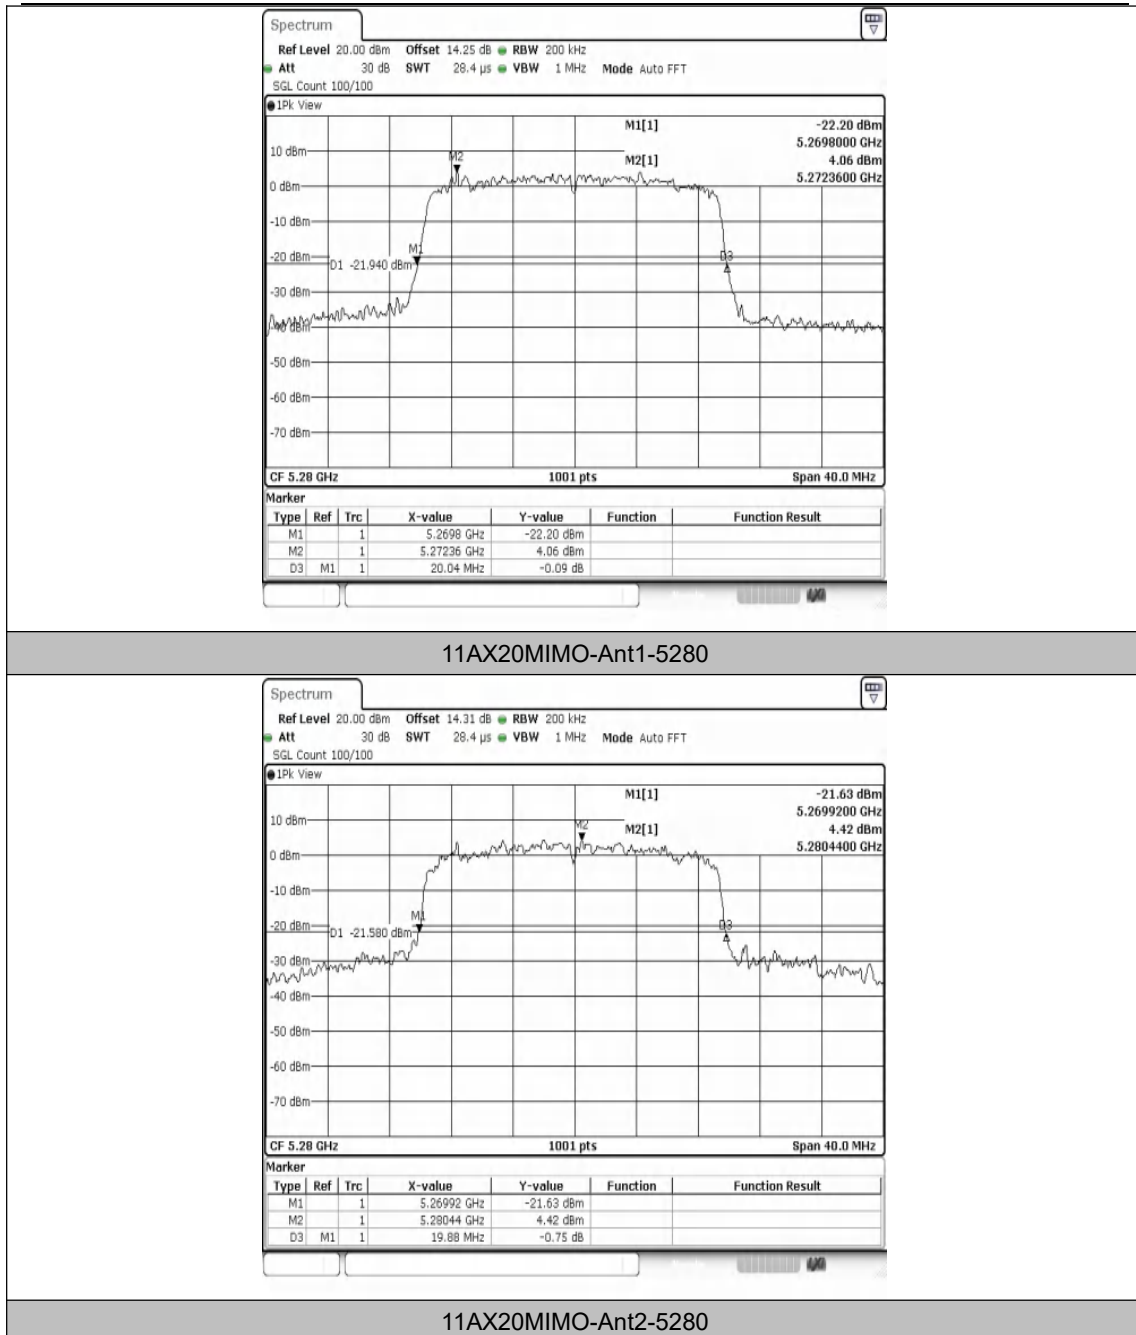


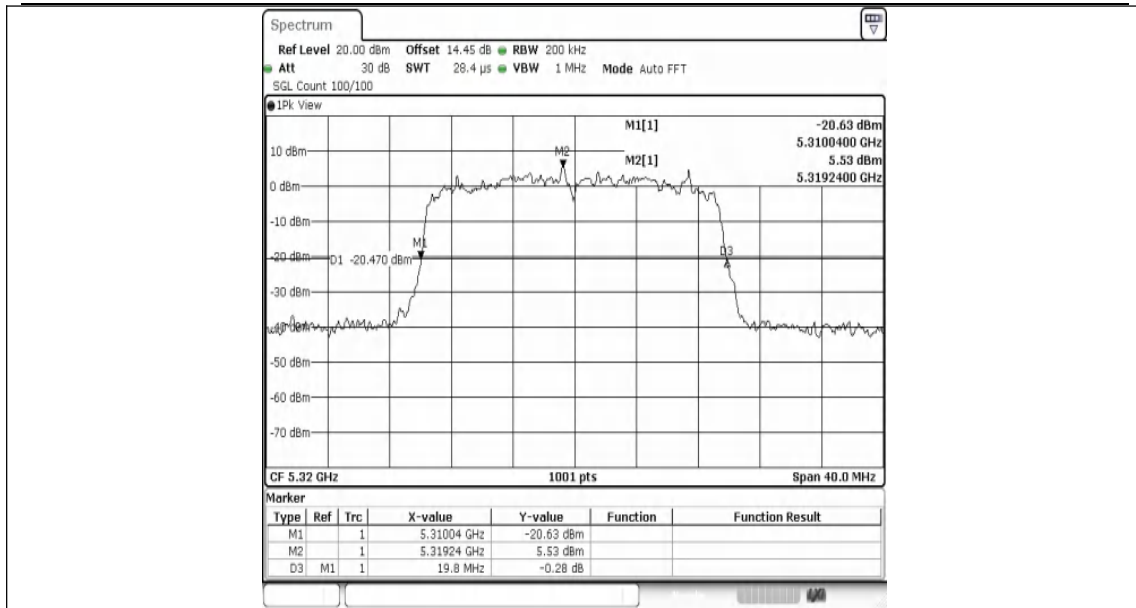


11AX20MIMO-Ant1-5320

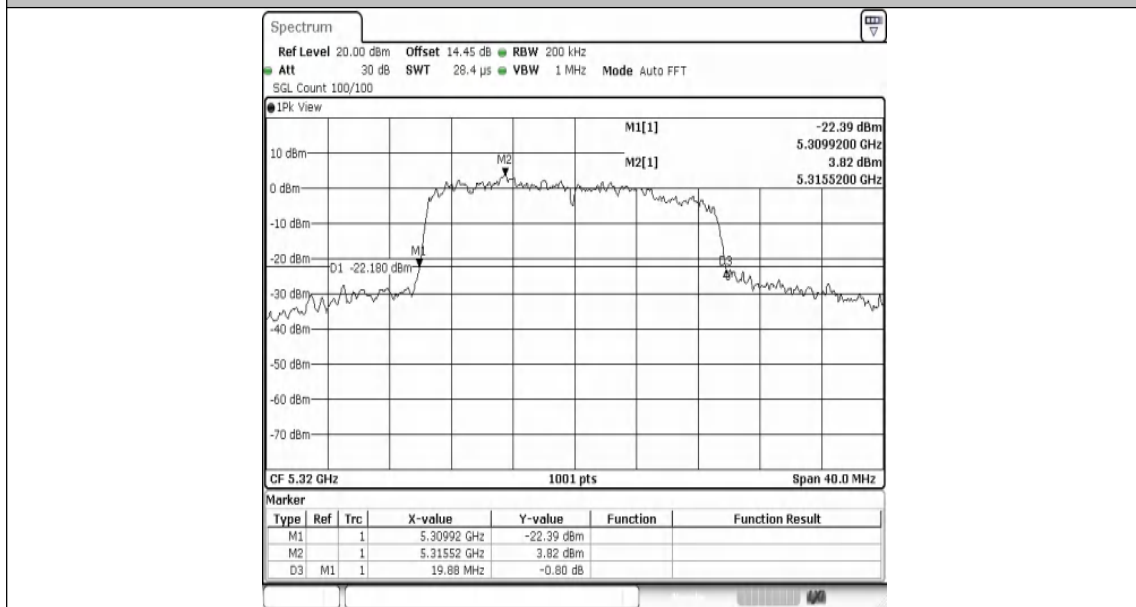


11AX20MIMO-Ant2-5320

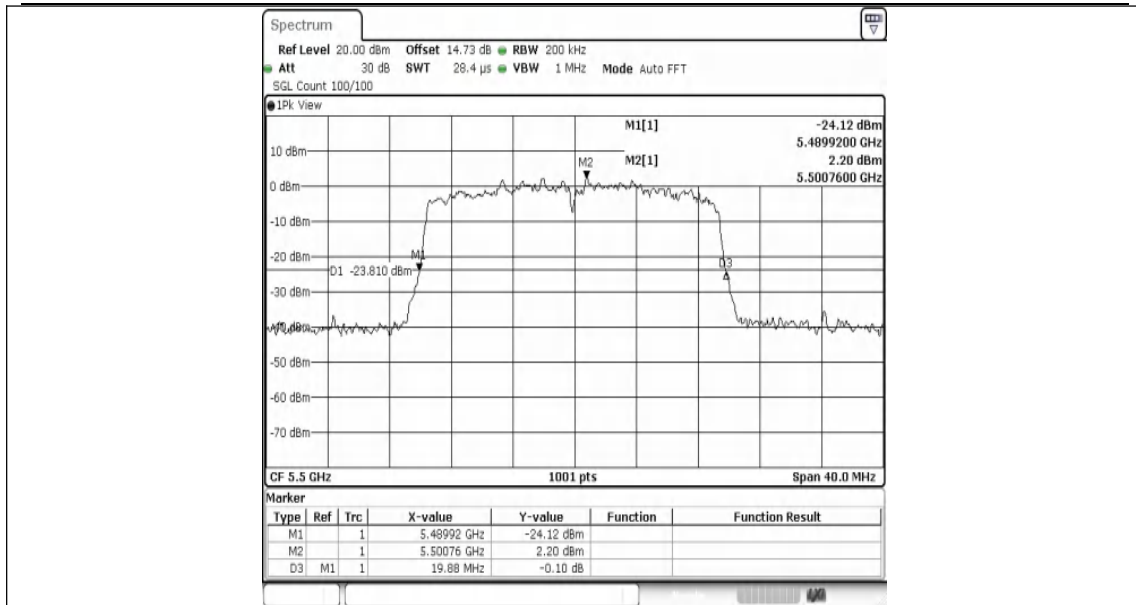



11AX20MIMO-Ant1-5500

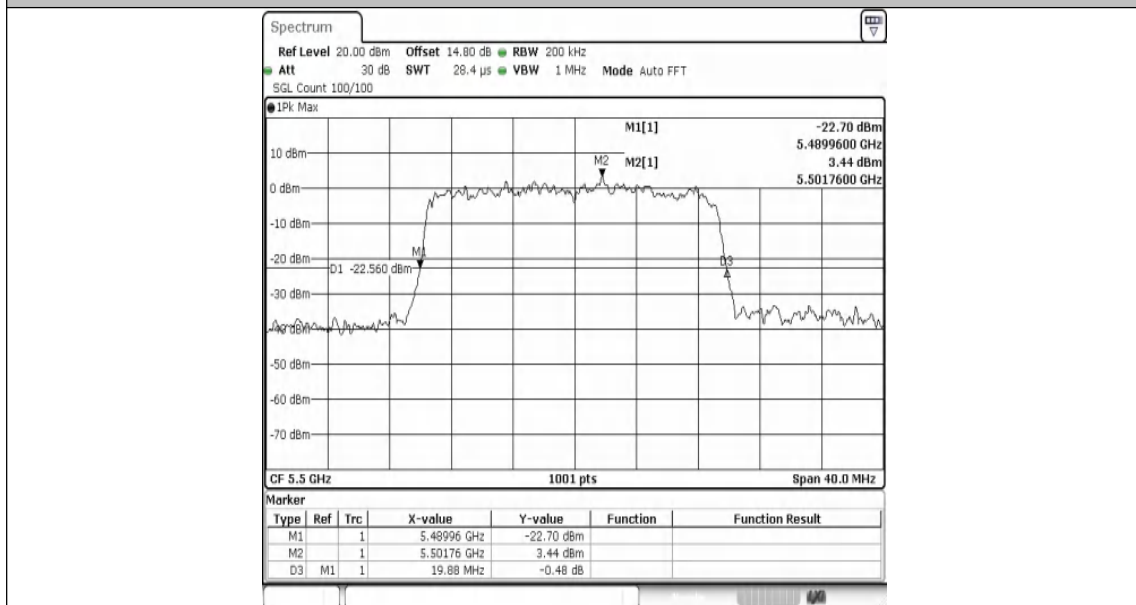


11AX20MIMO-Ant2-5500

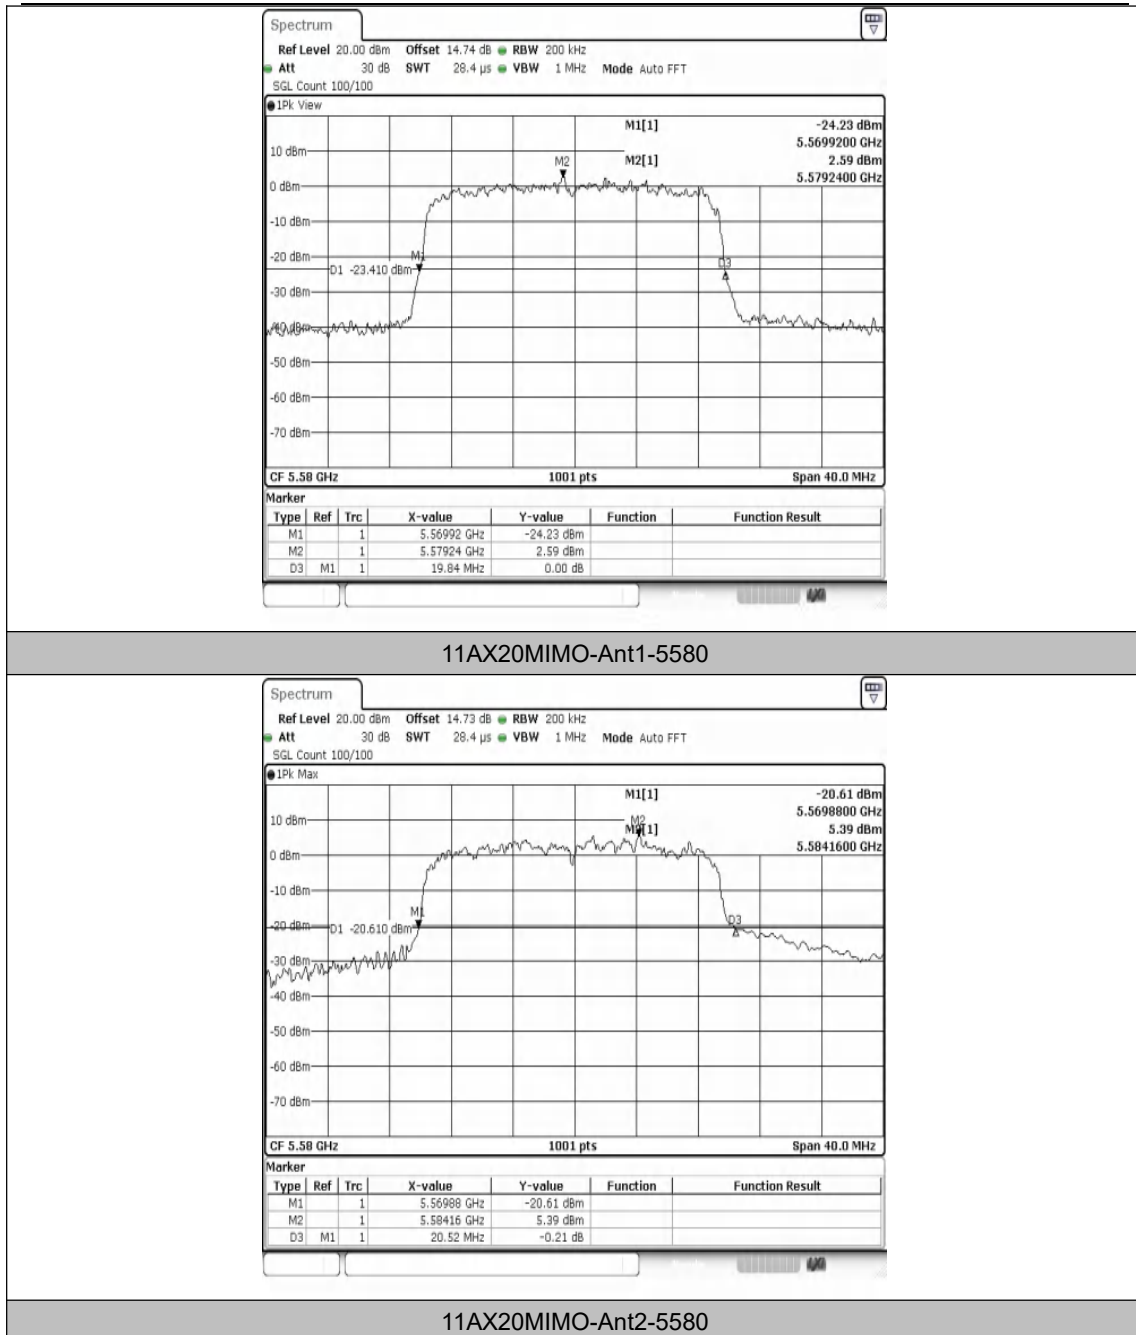

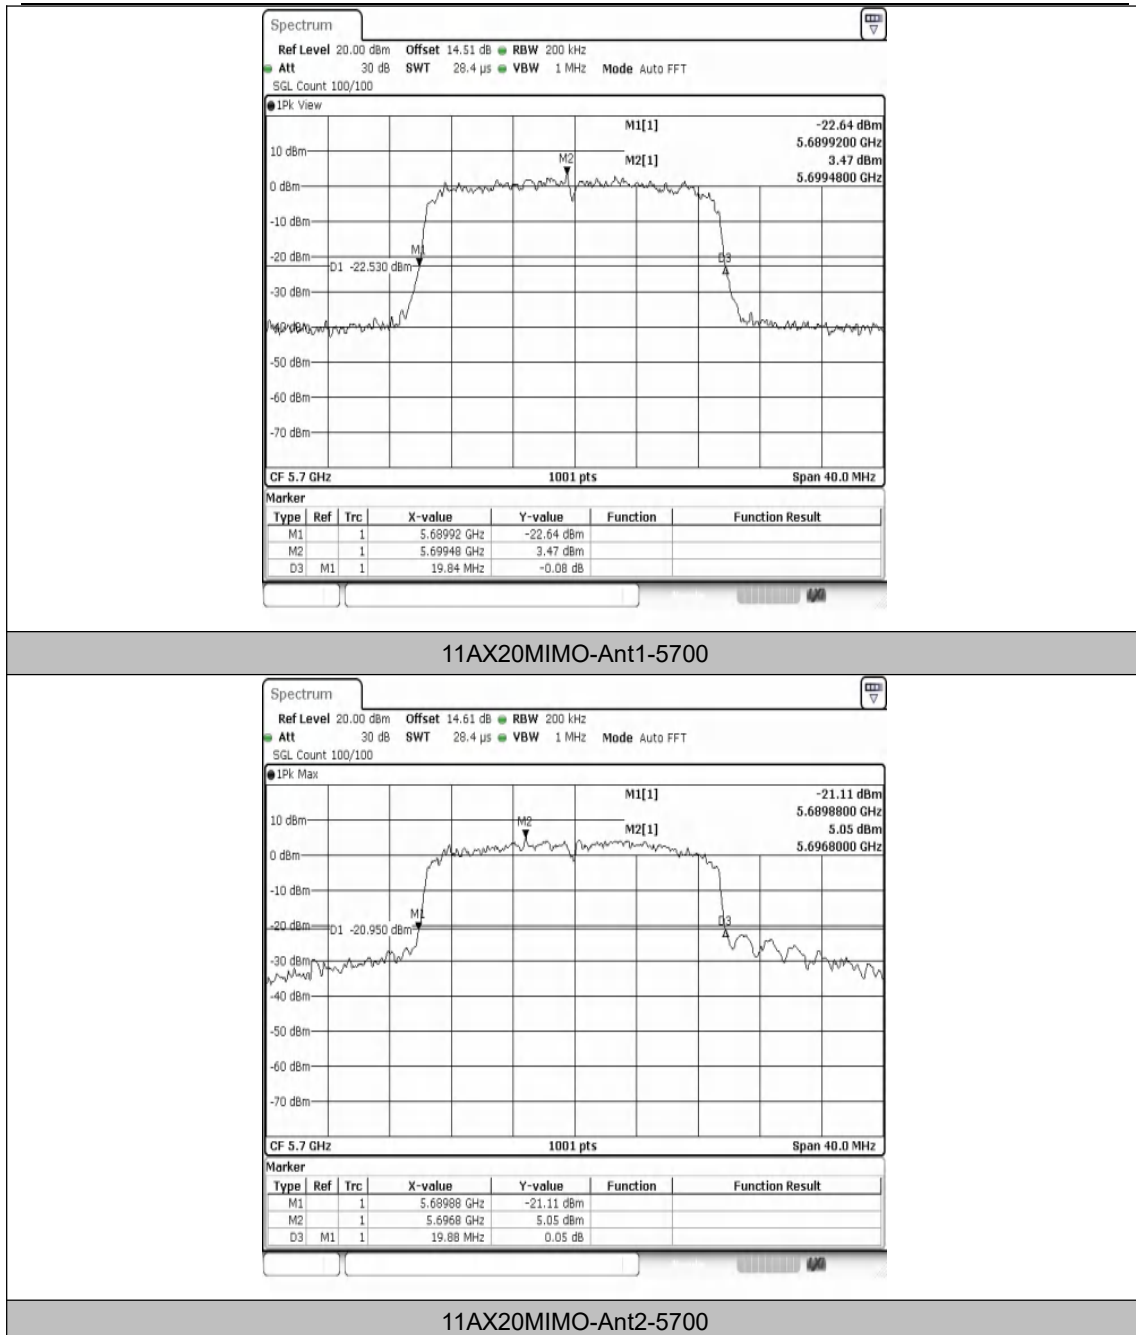


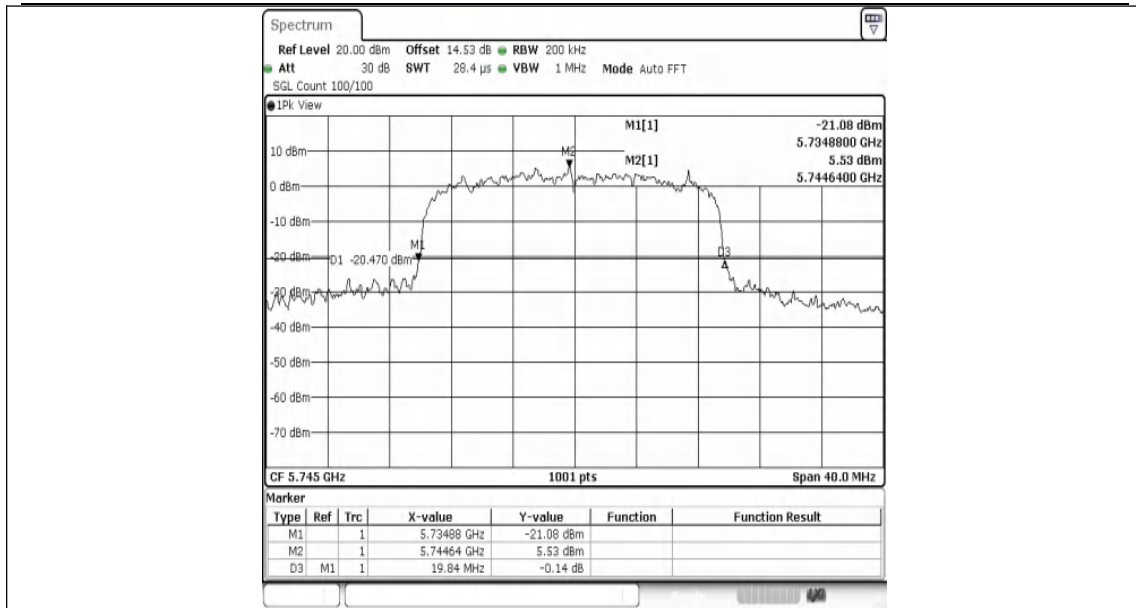



11AX20MIMO-Ant1-5745

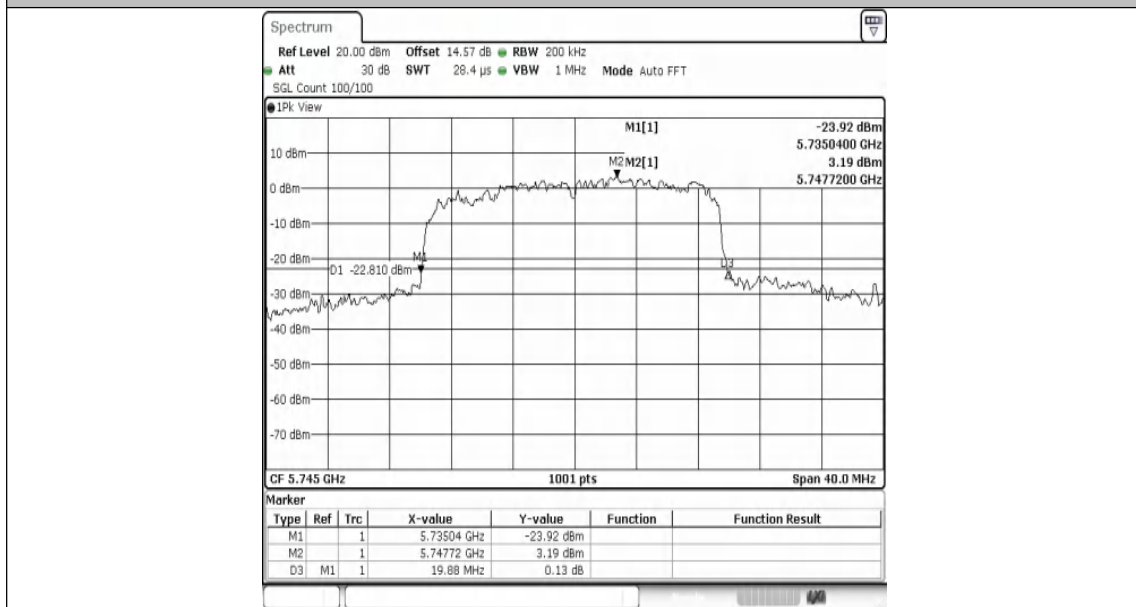


11AX20MIMO-Ant2-5745

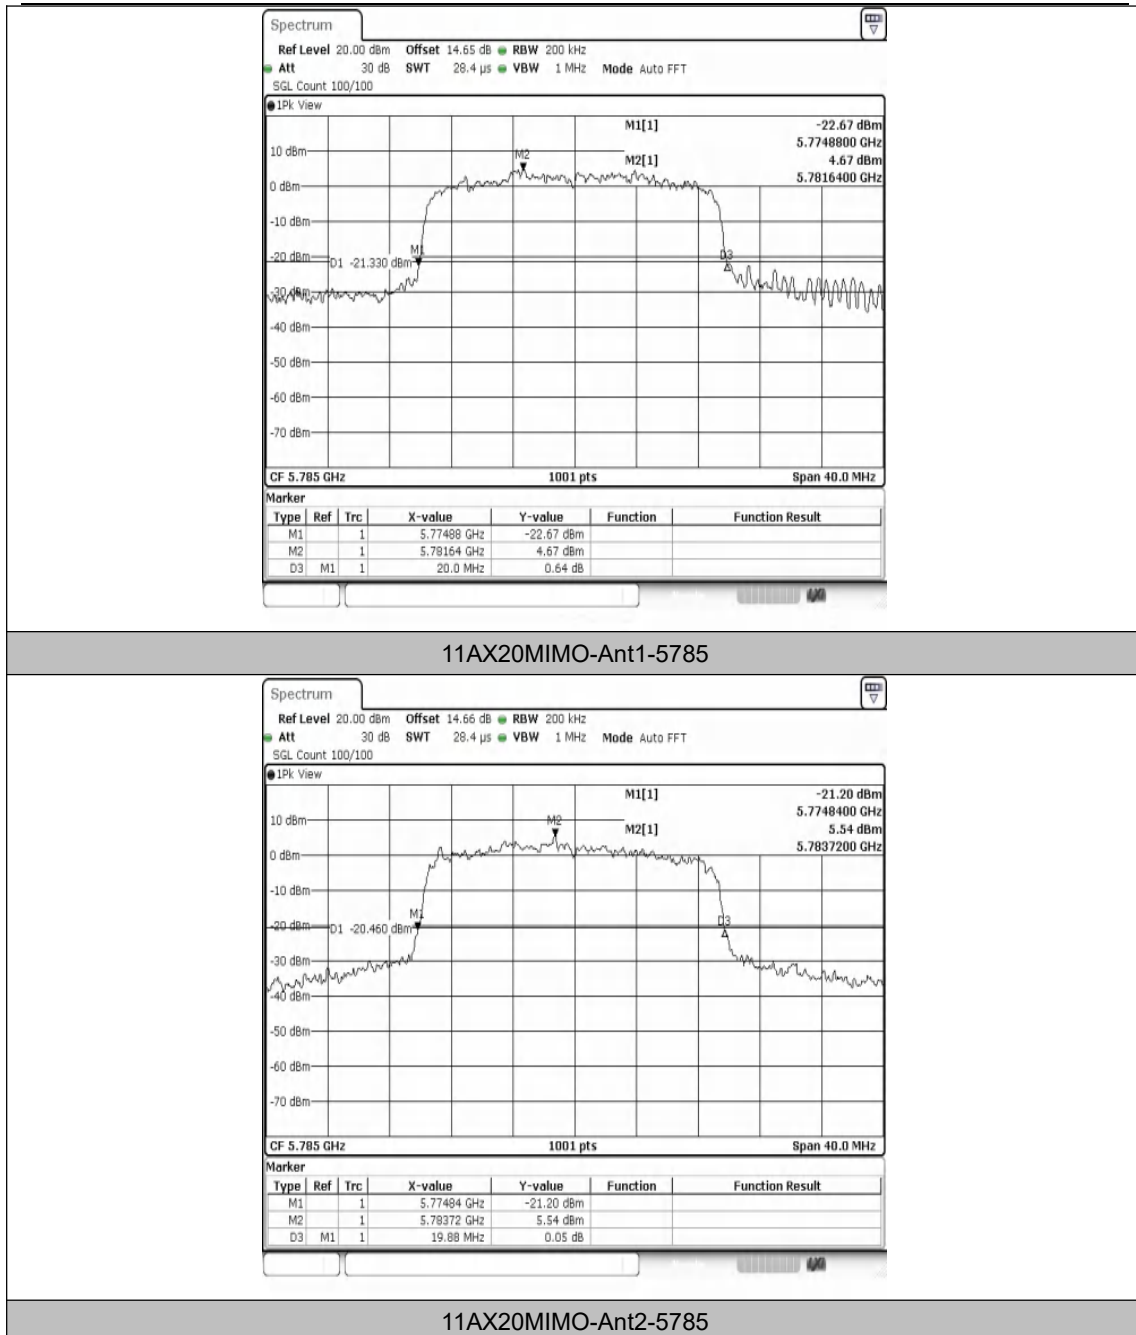


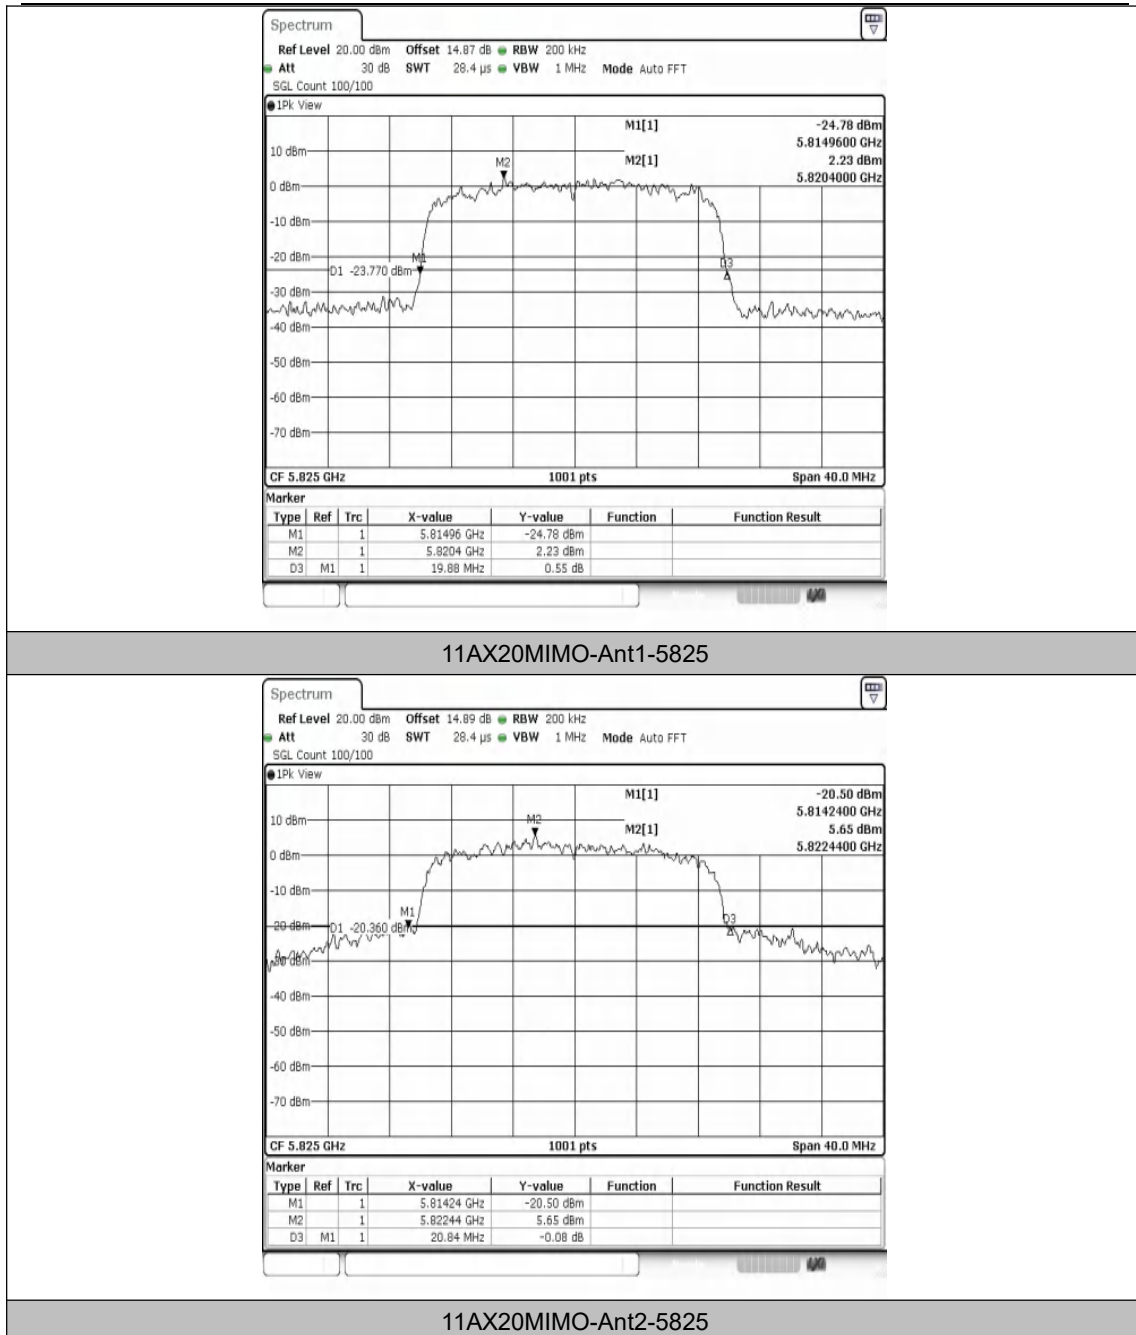

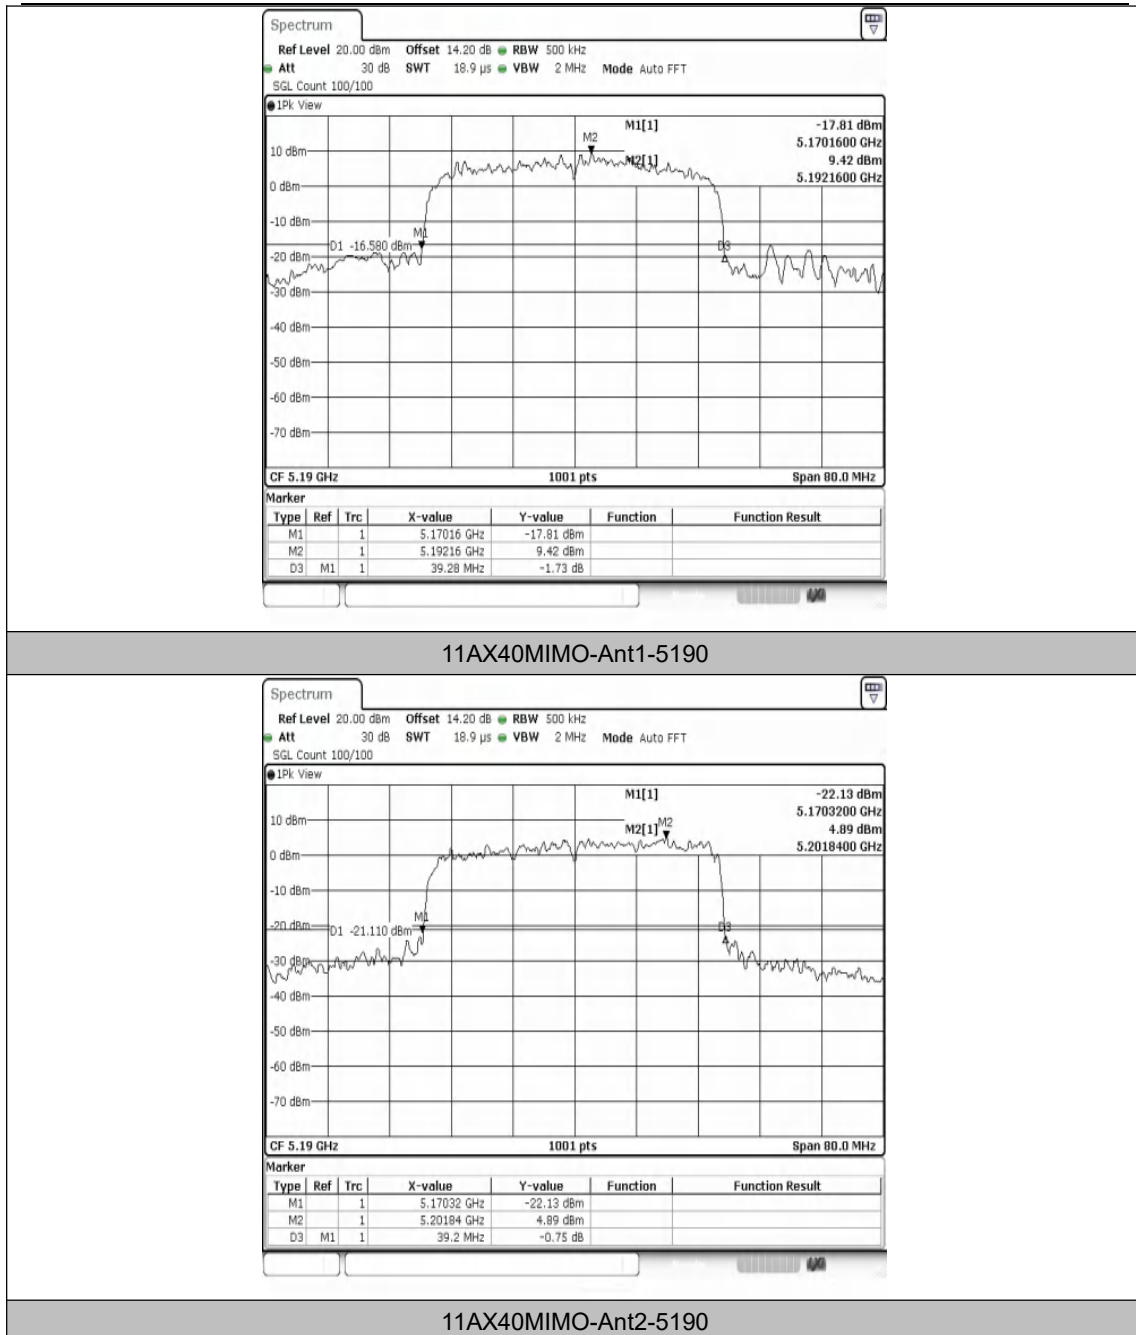


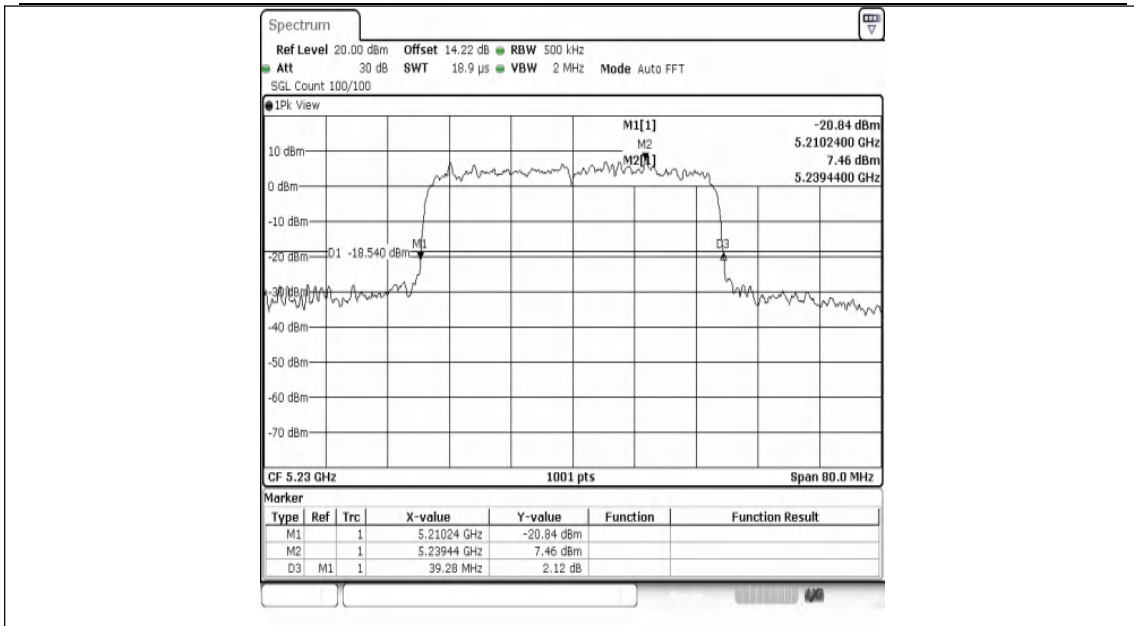


11AX40MIMO-Ant1-5230

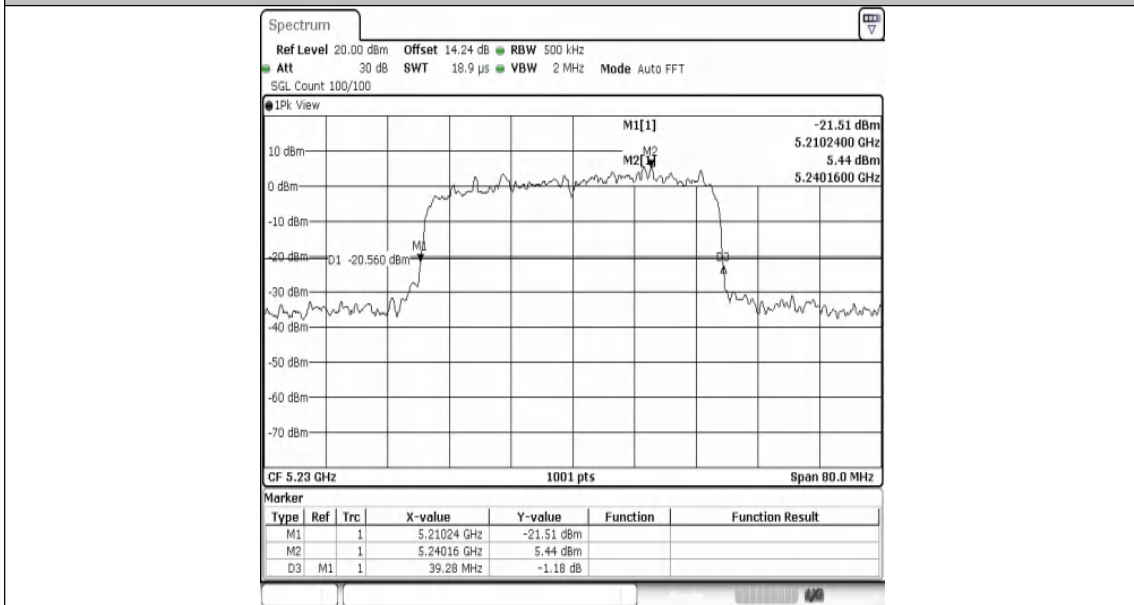


11AX40MIMO-Ant2-5230

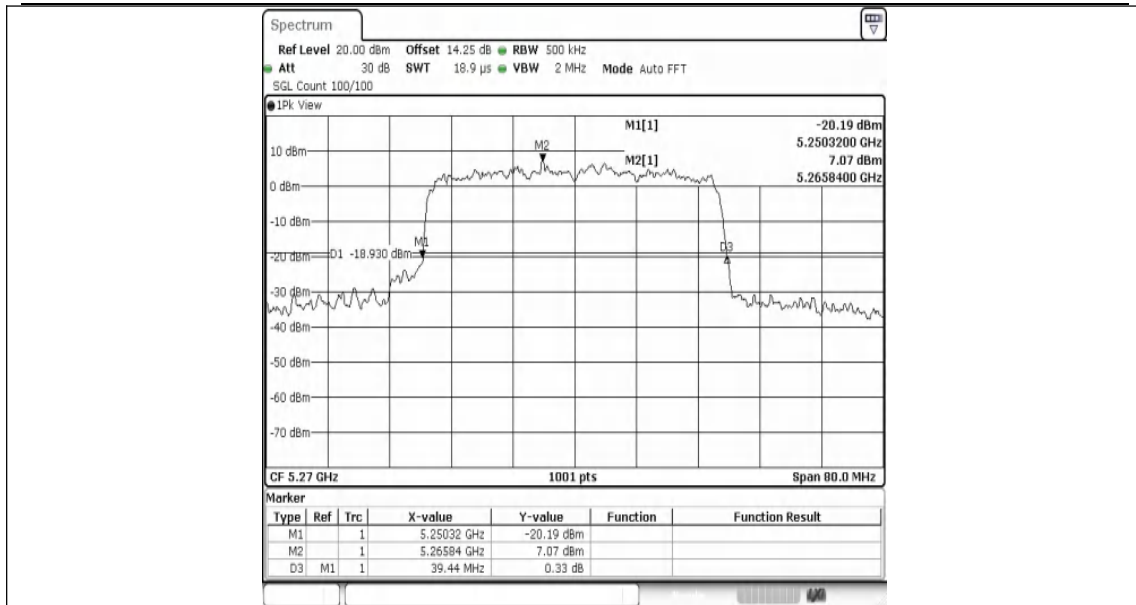


11AX40MIMO-Ant1-5270

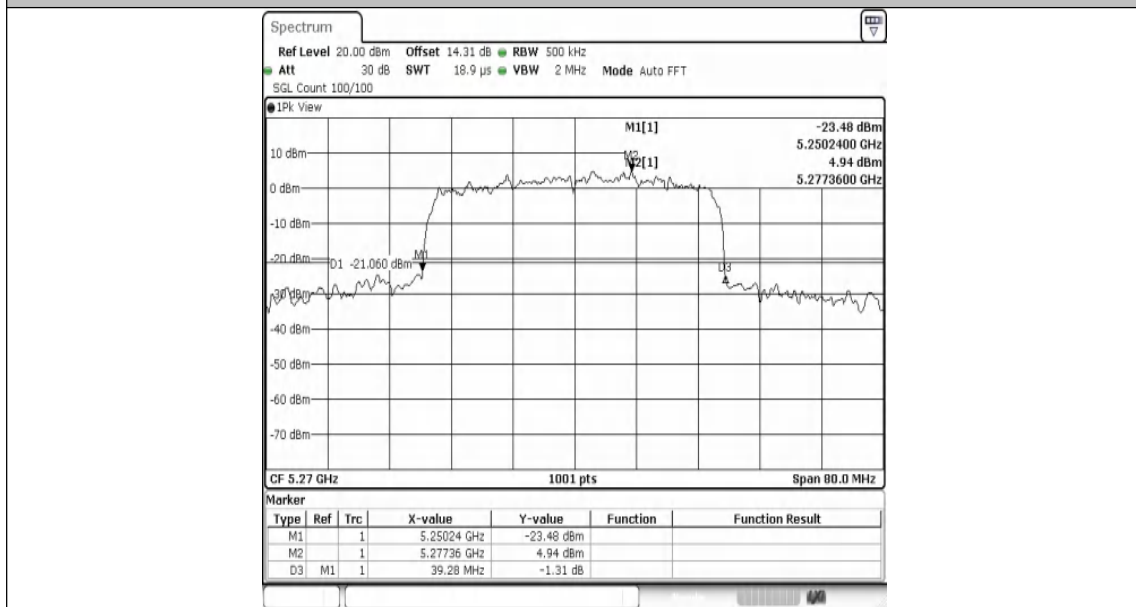


11AX40MIMO-Ant2-5270

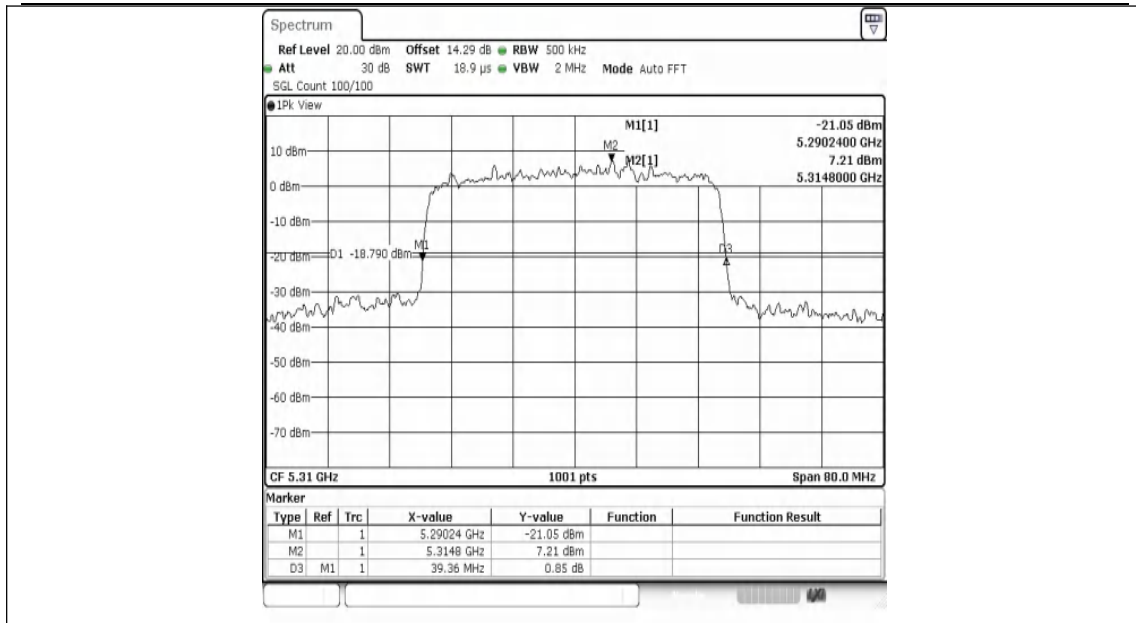


11AX40MIMO-Ant1-5310

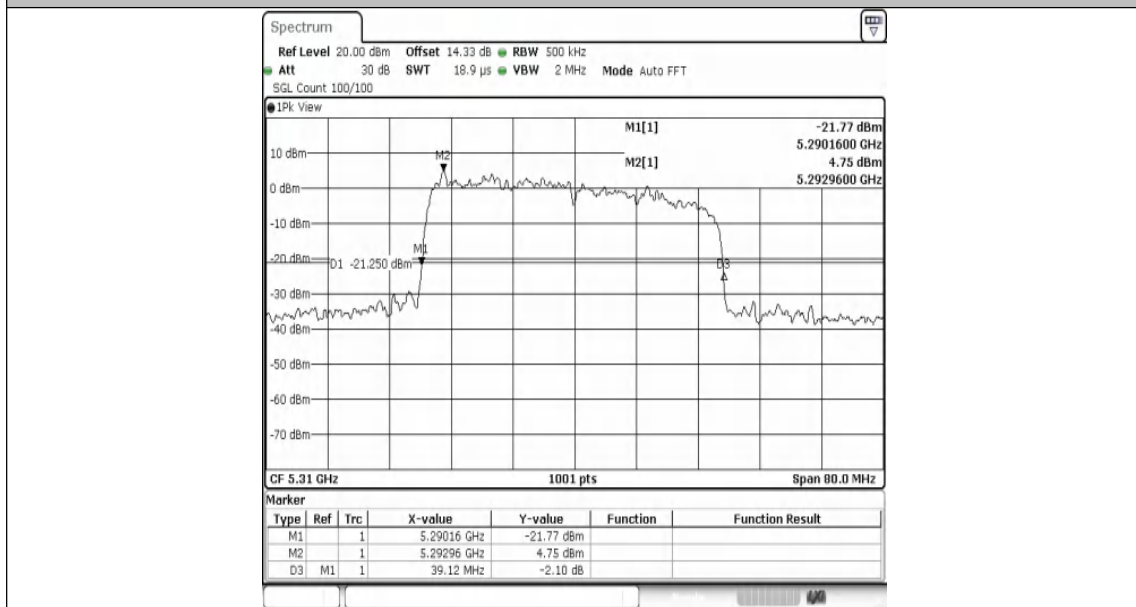


11AX40MIMO-Ant2-5310

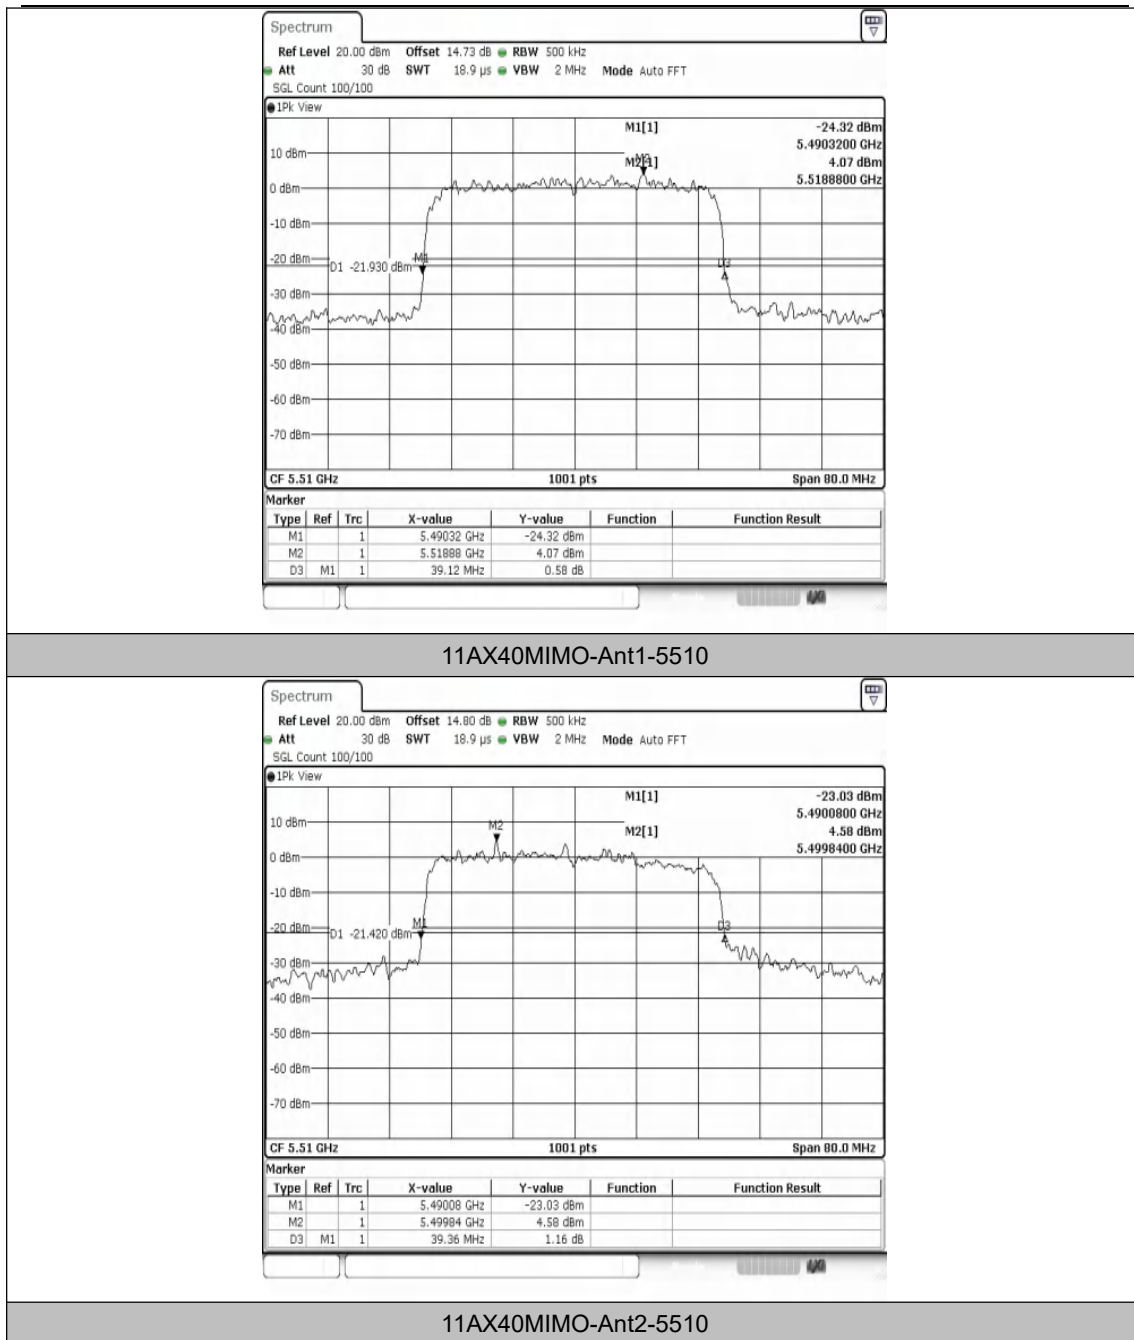


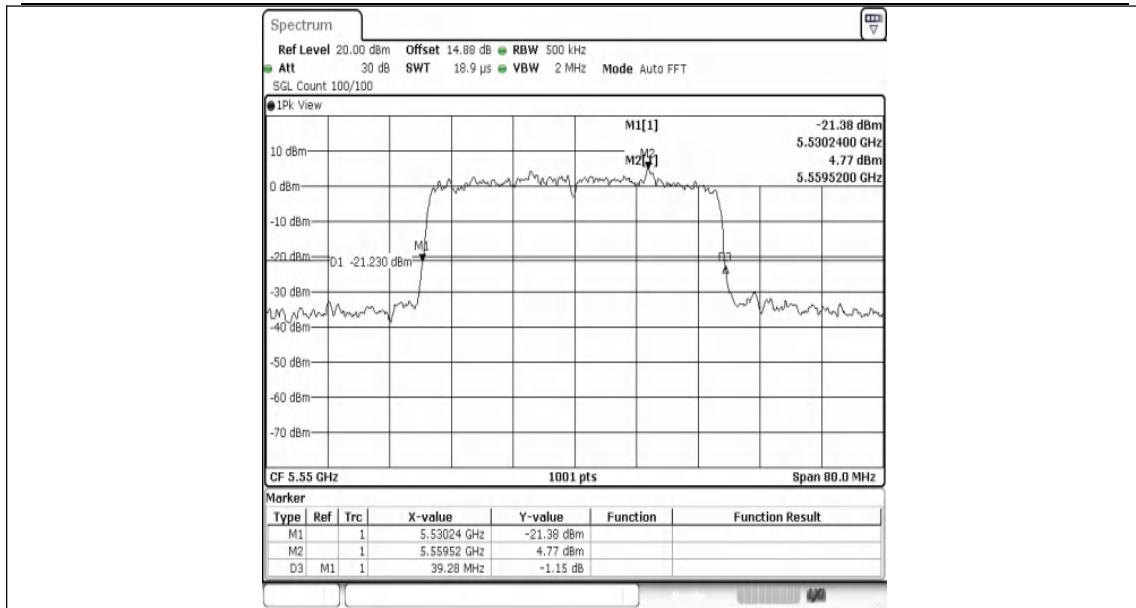


11AX40MIMO-Ant1-5550

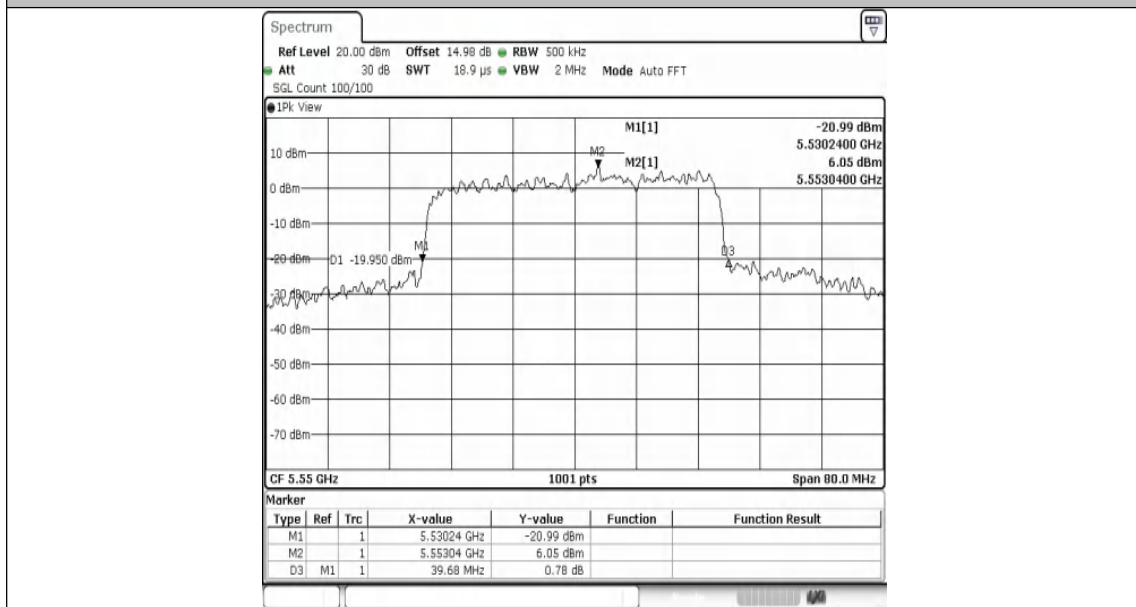


11AX40MIMO-Ant2-5550

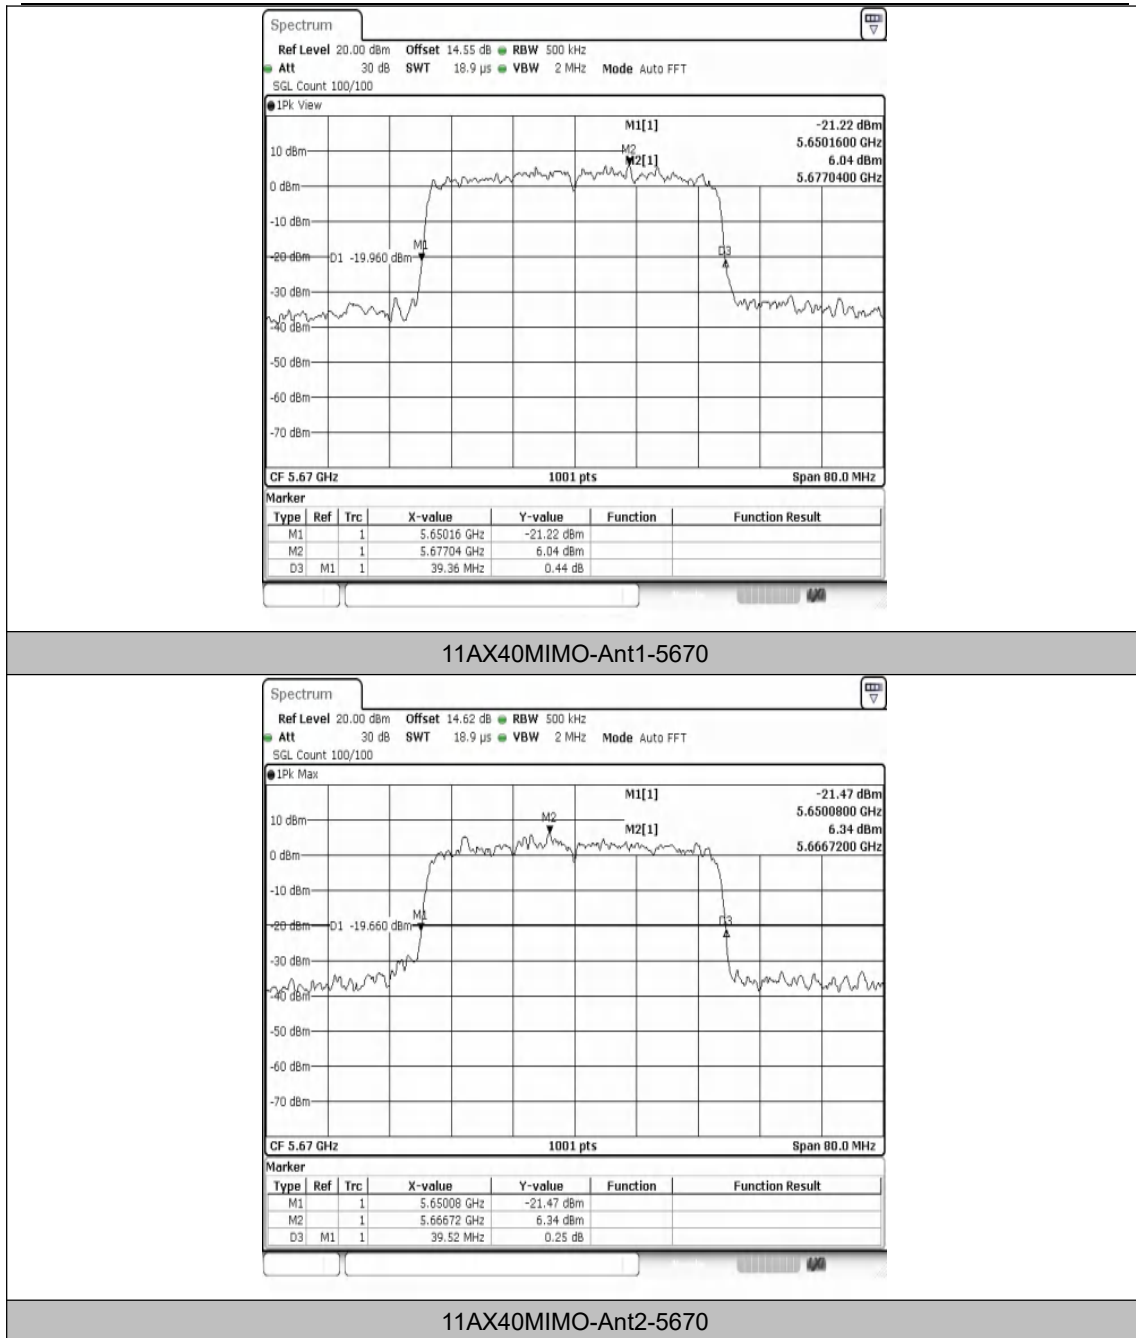


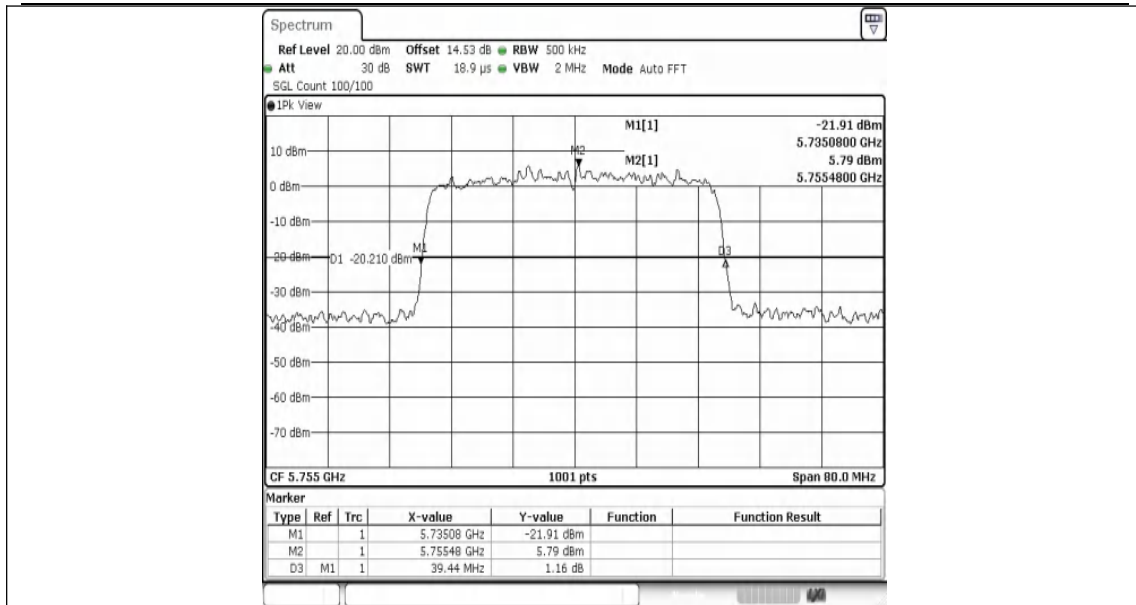


11AX40MIMO-Ant1-5755

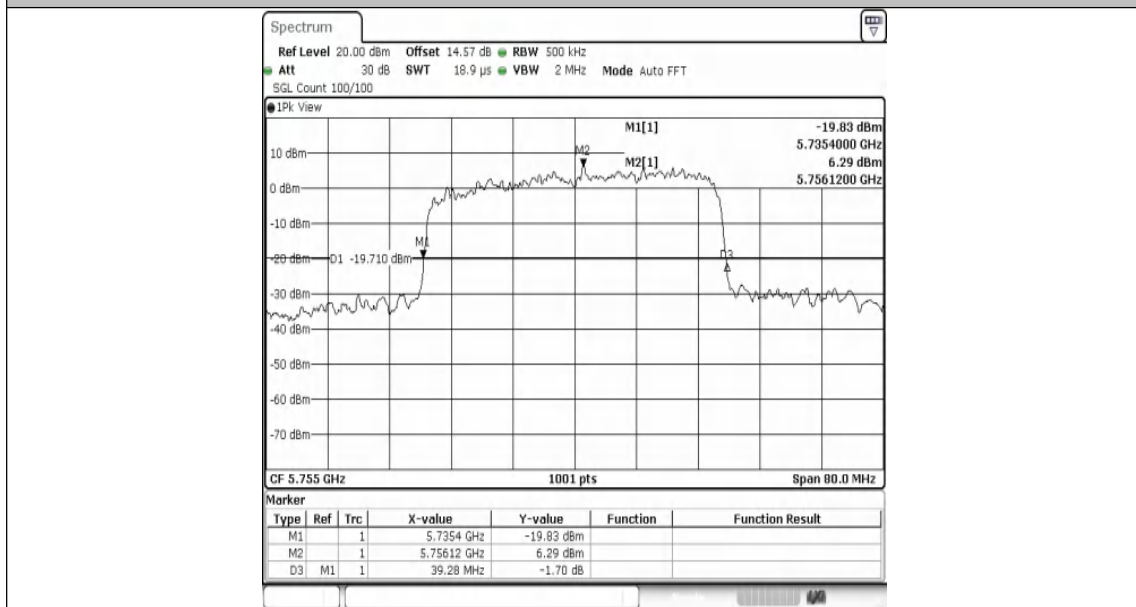


11AX40MIMO-Ant2-5755

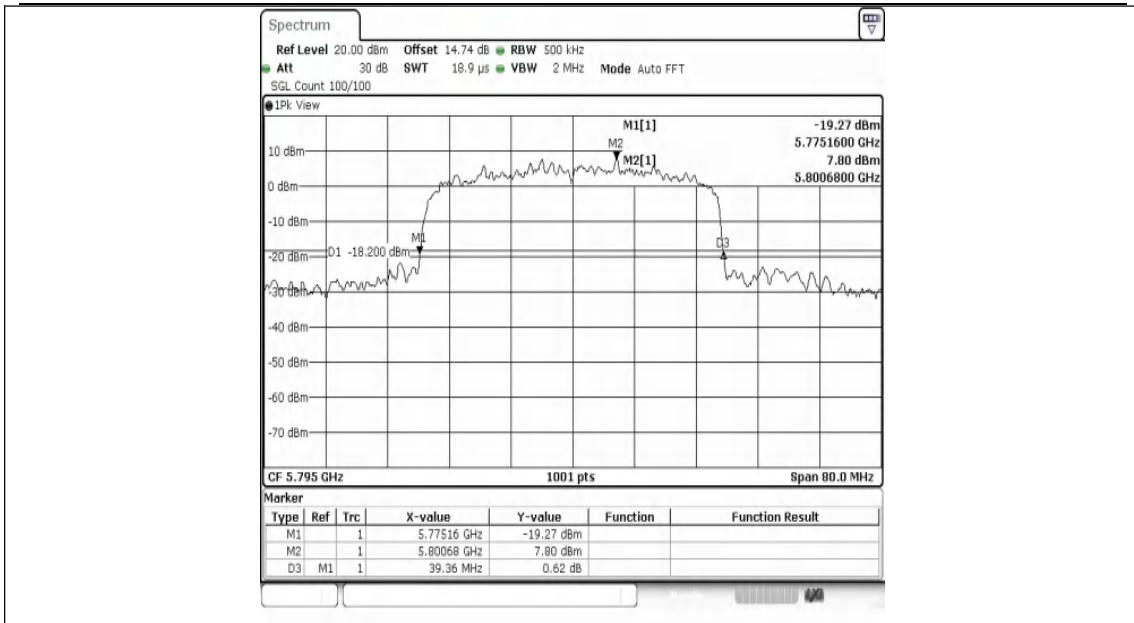

11AX40MIMO-Ant1-5795

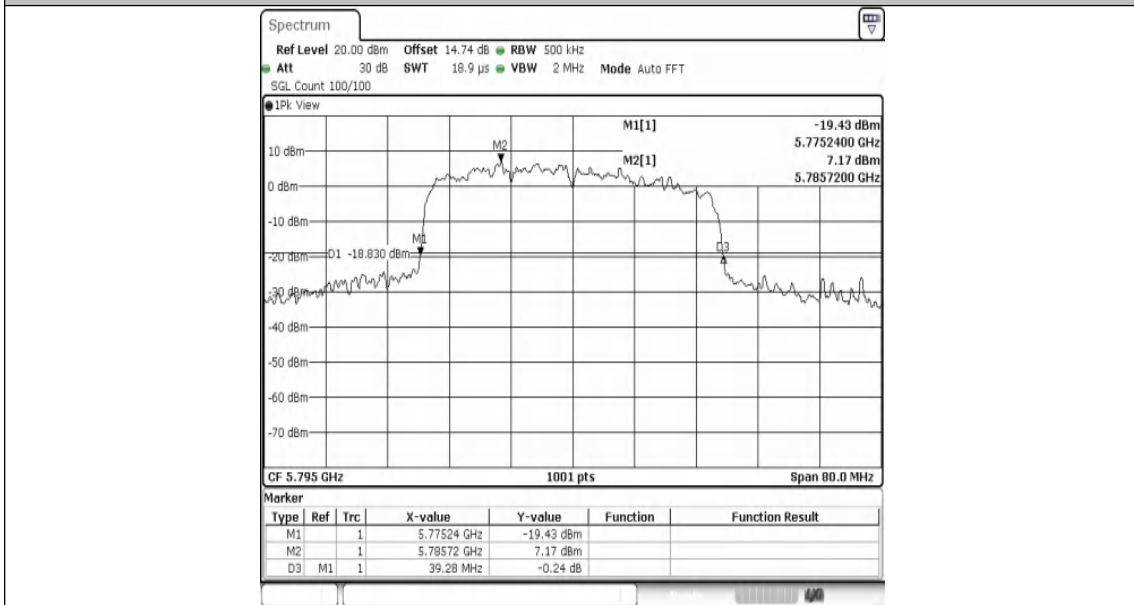


11AX40MIMO-Ant2-5795

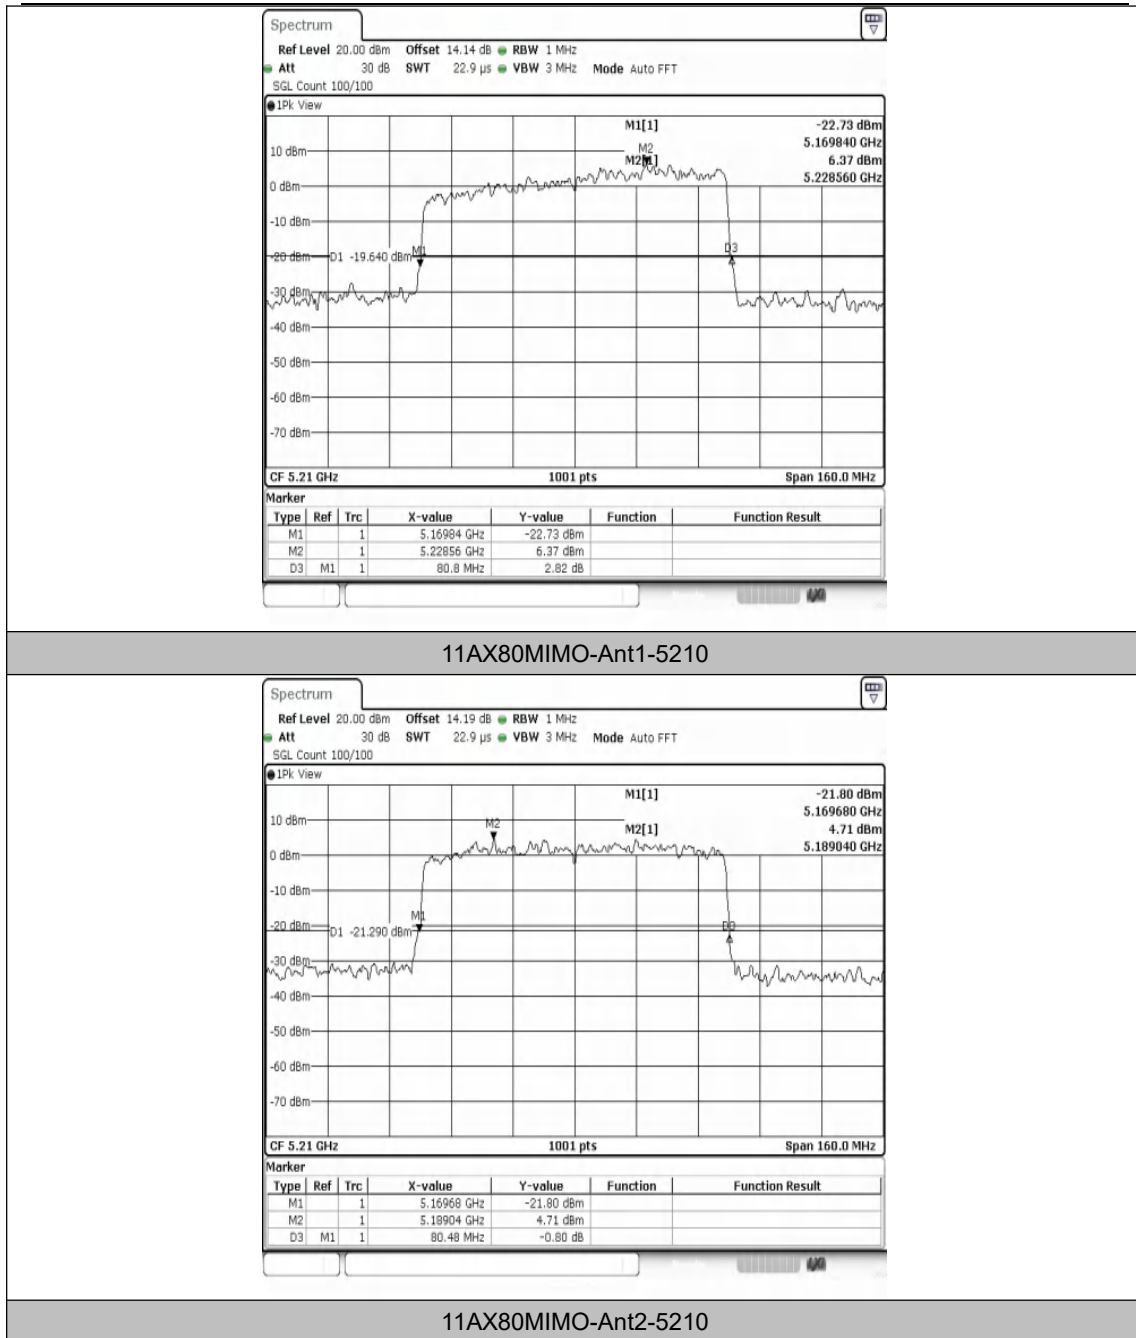



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

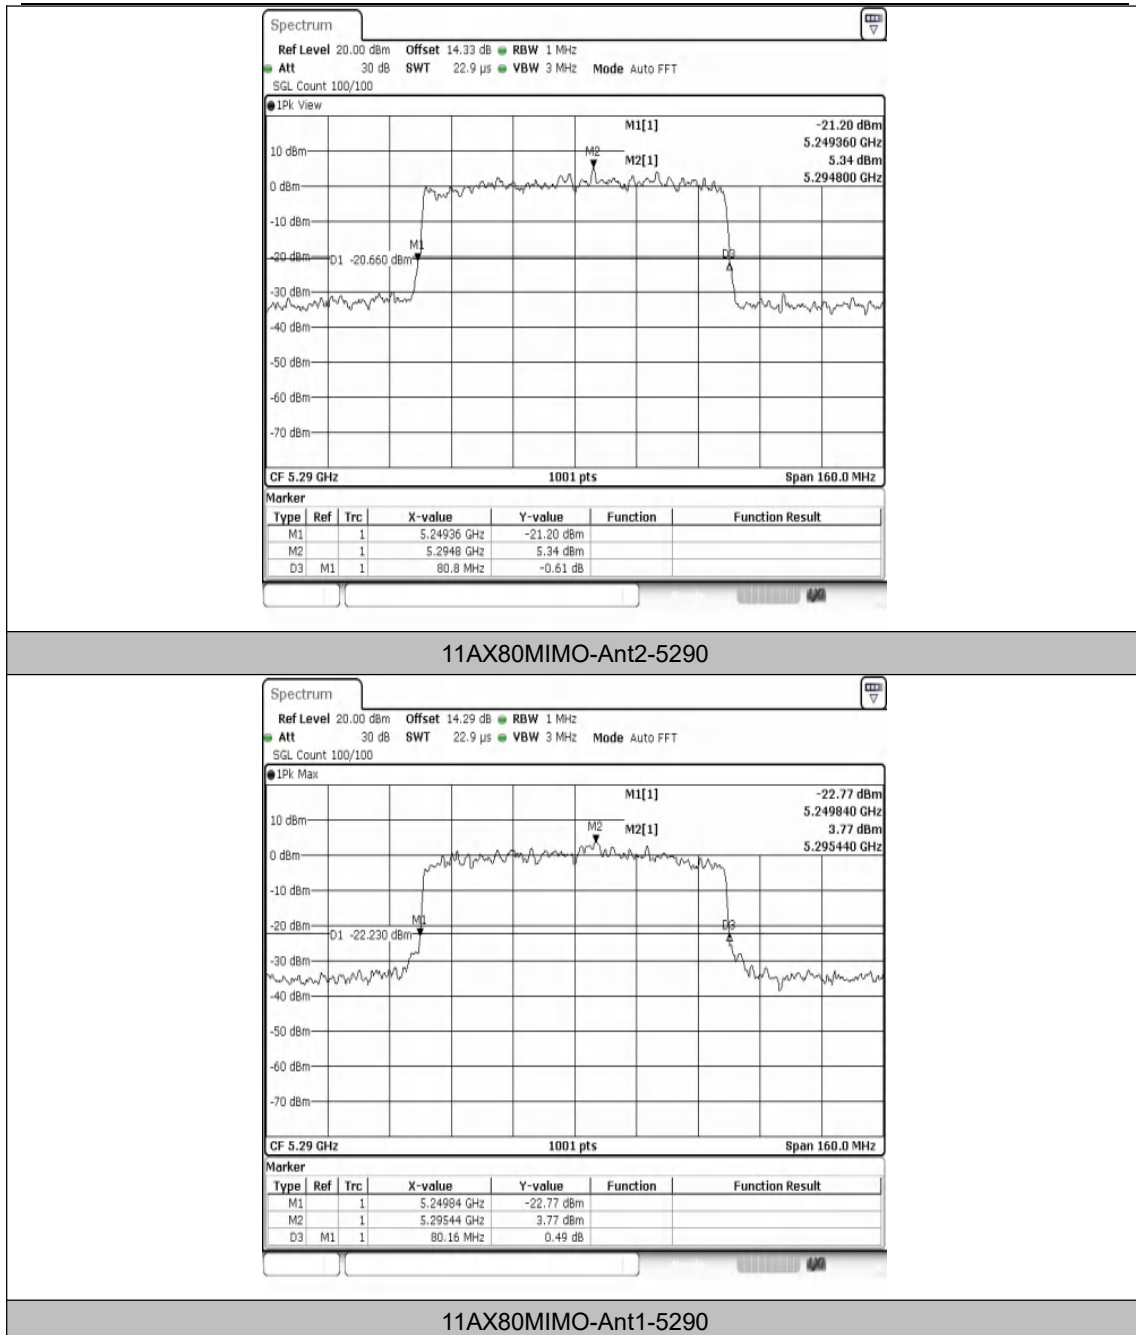

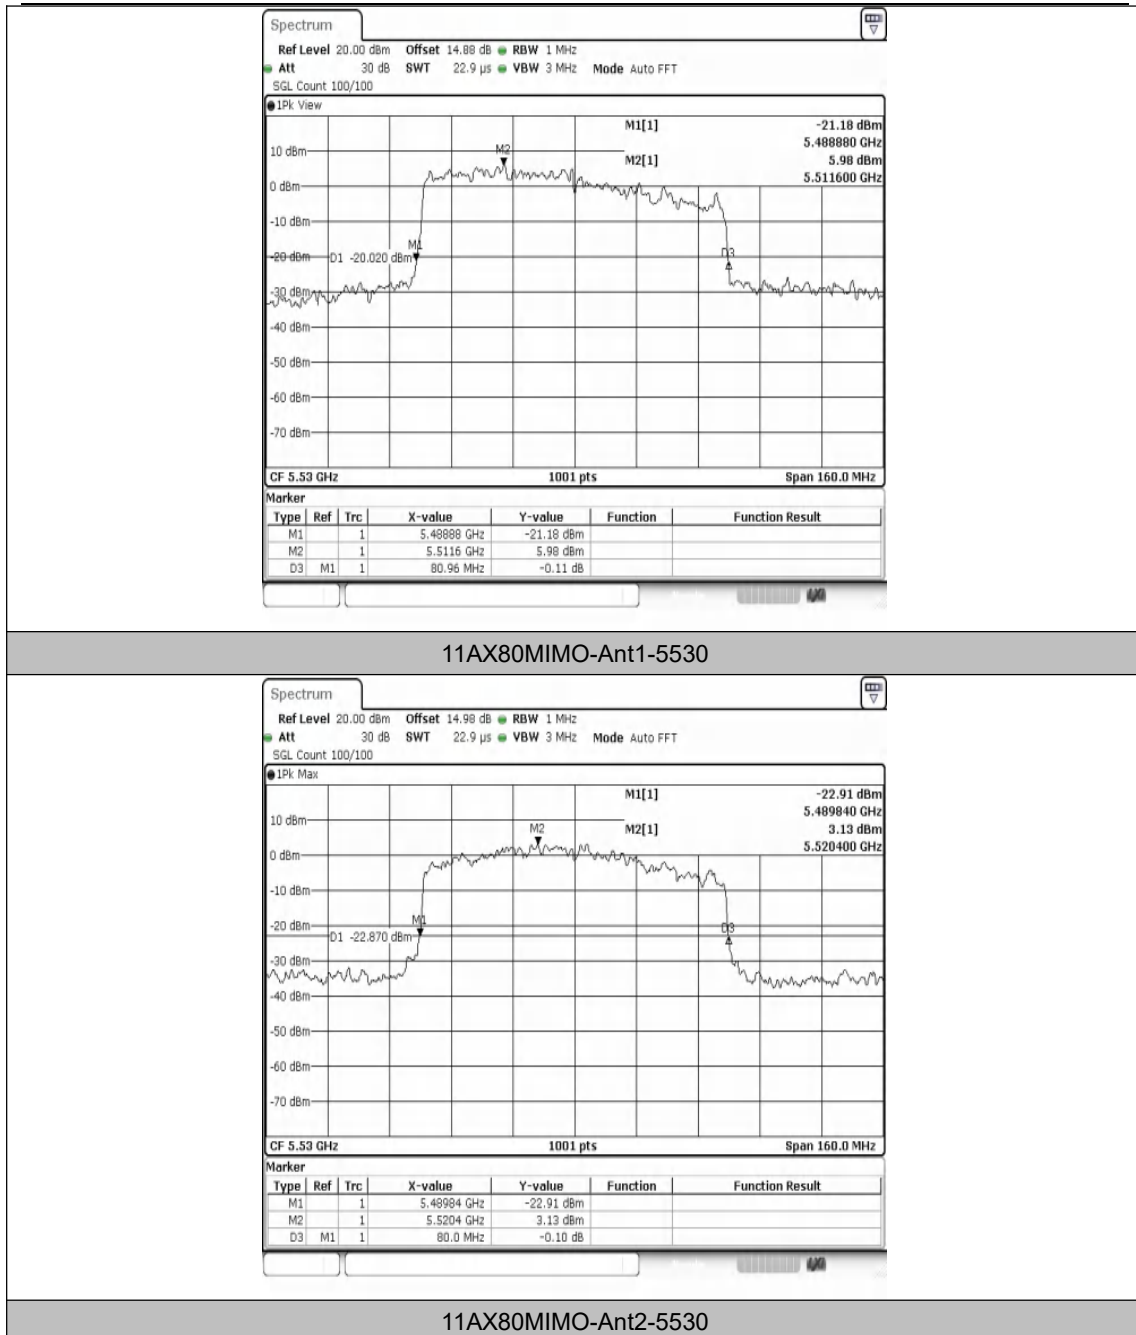

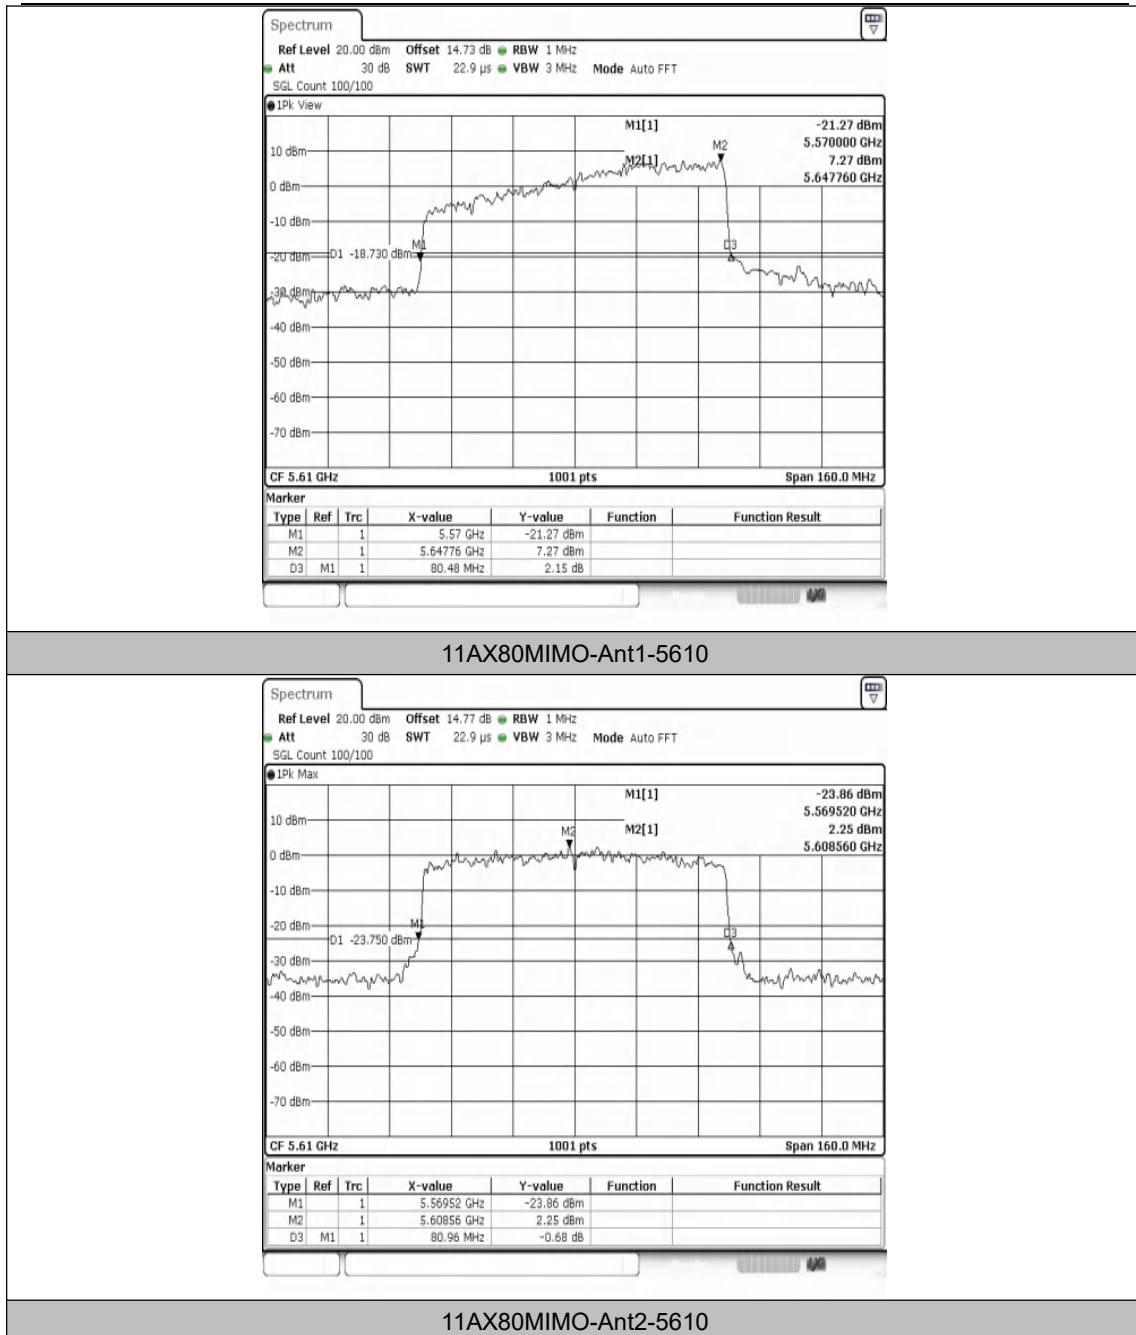

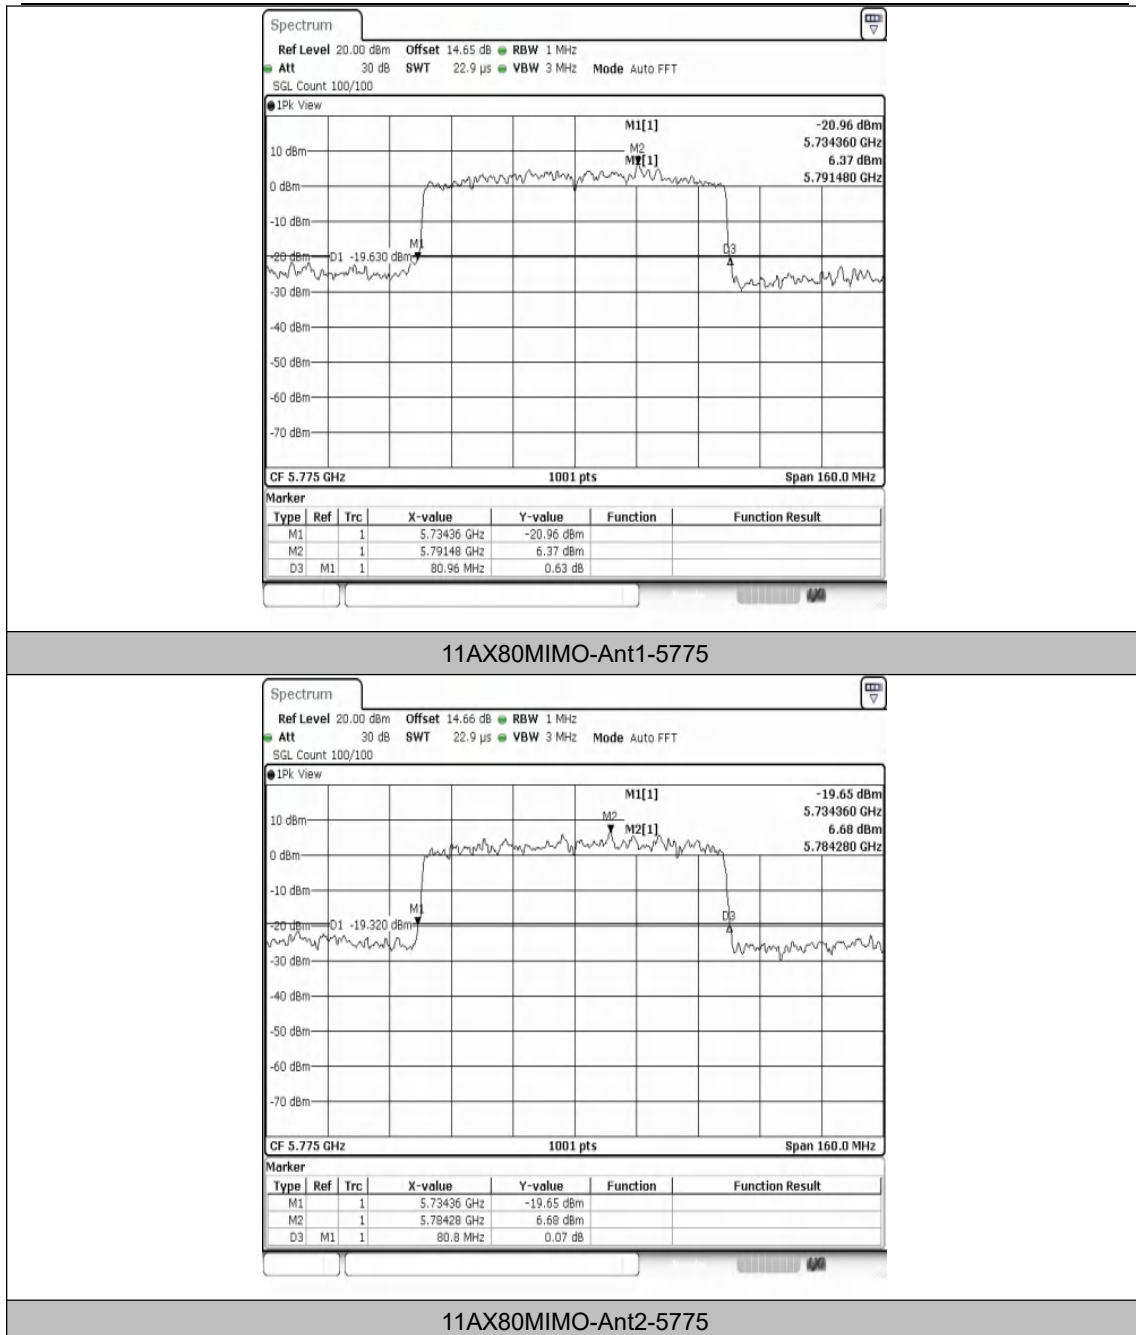

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.542	5171.2088	5188.7512	---	---
11A	Ant2	5180	16.543	5171.6484	5188.1918	---	---
11A	Ant1	5200	16.663	5191.5684	5208.2318	---	---
11A	Ant2	5200	16.503	5191.5684	5208.0719	---	---
11A	Ant1	5240	19.421	5231.1688	5250.5894	---	---
11A	Ant2	5240	16.863	5231.5285	5248.3916	---	---
11A	Ant1	5260	17.742	5250.4096	5268.1518	---	---
11A	Ant2	5260	16.623	5251.7283	5268.3516	---	---
11A	Ant1	5280	19.061	5269.9700	5289.0310	---	---
11A	Ant2	5280	16.583	5271.7682	5288.3516	---	---
11A	Ant1	5320	16.703	5311.4086	5328.1119	---	---
11A	Ant2	5320	16.503	5311.7682	5328.2717	---	---
11A	Ant1	5500	16.743	5491.5684	5508.3117	---	---
11A	Ant2	5500	16.543	5491.7682	5508.3117	---	---
11A	Ant1	5580	17.183	5571.3686	5588.5514	---	---
11A	Ant2	5580	16.543	5571.6484	5588.1918	---	---
11A	Ant1	5700	16.983	5691.4086	5708.3916	---	---
11A	Ant2	5700	16.503	5691.6883	5708.1918	---	---
11A	Ant1	5745	16.903	5736.4885	5753.3916	---	---
11A	Ant2	5745	16.543	5736.6084	5753.1518	---	---
11A	Ant1	5785	16.743	5776.6084	5793.3516	---	---
11A	Ant2	5785	16.863	5776.4885	5793.3516	---	---
11A	Ant1	5825	16.663	5816.6883	5833.3516	---	---
11A	Ant2	5825	16.583	5816.6883	5833.2717	---	---
11N20MIMO	Ant1	5180	17.982	5170.9291	5188.9111	---	---
11N20MIMO	Ant2	5180	17.502	5171.1289	5188.6314	---	---
11N20MIMO	Ant1	5200	18.022	5190.9291	5208.9510	---	---
11N20MIMO	Ant2	5200	17.542	5191.0889	5208.6314	---	---
11N20MIMO	Ant1	5240	17.782	5231.0490	5248.8312	---	---
11N20MIMO	Ant2	5240	17.782	5231.0889	5248.8711	---	---
11N20MIMO	Ant1	5260	17.542	5251.2088	5268.7512	---	---
11N20MIMO	Ant2	5260	17.742	5251.1289	5268.8711	---	---
11N20MIMO	Ant1	5280	17.542	5271.1688	5288.7113	---	---
11N20MIMO	Ant2	5280	17.542	5271.2488	5288.7912	---	---
11N20MIMO	Ant1	5320	17.582	5311.1688	5328.7512	---	---
11N20MIMO	Ant2	5320	17.502	5311.2887	5328.7912	---	---
11N20MIMO	Ant1	5500	17.942	5490.9690	5508.9111	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N20MIMO	Ant2	5500	17.542	5491.2088	5508.7512	---	---
11N20MIMO	Ant1	5580	17.862	5571.0490	5588.9111	---	---
11N20MIMO	Ant2	5580	17.582	5571.1289	5588.7113	---	---
11N20MIMO	Ant1	5700	17.942	5691.0490	5708.9910	---	---
11N20MIMO	Ant2	5700	17.502	5691.1289	5708.6314	---	---
11N20MIMO	Ant1	5745	17.662	5736.1289	5753.7912	---	---
11N20MIMO	Ant2	5745	17.542	5736.1289	5753.6713	---	---
11N20MIMO	Ant1	5785	17.542	5776.1688	5793.7113	---	---
11N20MIMO	Ant2	5785	17.822	5775.9690	5793.7912	---	---
11N20MIMO	Ant1	5825	17.542	5816.1688	5833.7113	---	---
11N20MIMO	Ant2	5825	17.622	5816.1688	5833.7912	---	---
11N40MIMO	Ant1	5190	36.364	5171.8581	5208.2218	---	---
11N40MIMO	Ant2	5190	36.284	5171.5385	5207.8222	---	---
11N40MIMO	Ant1	5230	36.523	5211.7782	5248.3017	---	---
11N40MIMO	Ant2	5230	36.364	5211.7782	5248.1419	---	---
11N40MIMO	Ant1	5270	35.724	5252.0979	5287.8222	---	---
11N40MIMO	Ant2	5270	36.364	5252.0180	5288.3816	---	---
11N40MIMO	Ant1	5310	35.804	5292.0180	5327.8222	---	---
11N40MIMO	Ant2	5310	36.124	5292.2577	5328.3816	---	---
11N40MIMO	Ant1	5510	36.284	5491.8581	5528.1419	---	---
11N40MIMO	Ant2	5510	36.204	5491.8581	5528.0619	---	---
11N40MIMO	Ant1	5550	36.364	5531.7782	5568.1419	---	---
11N40MIMO	Ant2	5550	36.044	5531.6184	5567.6623	---	---
11N40MIMO	Ant1	5670	35.724	5652.0180	5687.7423	---	---
11N40MIMO	Ant2	5670	36.364	5652.0979	5688.4615	---	---
11N40MIMO	Ant1	5755	35.485	5737.2577	5772.7423	---	---
11N40MIMO	Ant2	5755	35.724	5736.9381	5772.6623	---	---
11N40MIMO	Ant1	5795	35.884	5777.0180	5812.9021	---	---
11N40MIMO	Ant2	5795	36.124	5776.9381	5813.0619	---	---
11AC20MIMO	Ant1	5180	17.542	5171.2088	5188.7512	---	---
11AC20MIMO	Ant2	5180	17.622	5171.0889	5188.7113	---	---
11AC20MIMO	Ant1	5200	17.542	5191.1688	5208.7113	---	---
11AC20MIMO	Ant2	5200	17.622	5191.0889	5208.7113	---	---
11AC20MIMO	Ant1	5240	17.662	5231.1688	5248.8312	---	---
11AC20MIMO	Ant2	5240	17.902	5231.0090	5248.9111	---	---
11AC20MIMO	Ant1	5260	17.582	5251.1289	5268.7113	---	---
11AC20MIMO	Ant2	5260	17.662	5251.1688	5268.8312	---	---
11AC20MIMO	Ant1	5280	17.502	5271.2088	5288.7113	---	---
11AC20MIMO	Ant2	5280	17.502	5271.2887	5288.7912	---	---
11AC20MIMO	Ant1	5320	17.502	5311.1688	5328.6713	---	---
11AC20MIMO	Ant2	5320	17.542	5311.2488	5328.7912	---	---
11AC20MIMO	Ant1	5500	17.622	5491.0889	5508.7113	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20MIMO	Ant2	5500	17.502	5491.2088	5508.7113	---	---
11AC20MIMO	Ant1	5580	17.542	5571.1688	5588.7113	---	---
11AC20MIMO	Ant2	5580	17.702	5571.0490	5588.7512	---	---
11AC20MIMO	Ant1	5700	17.502	5691.2088	5708.7113	---	---
11AC20MIMO	Ant2	5700	17.502	5691.1688	5708.6713	---	---
11AC20MIMO	Ant1	5745	17.542	5736.0889	5753.6314	---	---
11AC20MIMO	Ant2	5745	17.622	5736.0889	5753.7113	---	---
11AC20MIMO	Ant1	5785	17.622	5776.1289	5793.7512	---	---
11AC20MIMO	Ant2	5785	17.662	5776.0889	5793.7512	---	---
11AC20MIMO	Ant1	5825	17.582	5816.1688	5833.7512	---	---
11AC20MIMO	Ant2	5825	17.542	5816.2488	5833.7912	---	---
11AC40MIMO	Ant1	5190	35.644	5172.1778	5207.8222	---	---
11AC40MIMO	Ant2	5190	35.564	5171.8581	5207.4226	---	---
11AC40MIMO	Ant1	5230	35.804	5212.0180	5247.8222	---	---
11AC40MIMO	Ant2	5230	36.044	5211.7782	5247.8222	---	---
11AC40MIMO	Ant1	5270	35.724	5252.0979	5287.8222	---	---
11AC40MIMO	Ant2	5270	35.724	5252.4176	5288.1419	---	---
11AC40MIMO	Ant1	5310	35.804	5292.0979	5327.9021	---	---
11AC40MIMO	Ant2	5310	35.564	5292.5774	5328.1419	---	---
11AC40MIMO	Ant1	5510	35.644	5492.1778	5527.8222	---	---
11AC40MIMO	Ant2	5510	35.485	5492.2577	5527.7423	---	---
11AC40MIMO	Ant1	5550	35.804	5532.0979	5567.9021	---	---
11AC40MIMO	Ant2	5550	35.405	5531.8581	5567.2627	---	---
11AC40MIMO	Ant1	5670	35.564	5652.1778	5687.7423	---	---
11AC40MIMO	Ant2	5670	35.485	5652.6573	5688.1419	---	---
11AC40MIMO	Ant1	5755	35.644	5737.1778	5772.8222	---	---
11AC40MIMO	Ant2	5755	35.804	5736.7782	5772.5824	---	---
11AC40MIMO	Ant1	5795	35.884	5776.9381	5812.8222	---	---
11AC40MIMO	Ant2	5795	36.204	5776.9381	5813.1419	---	---
11AC80MIMO	Ant1	5210	76.084	5171.9580	5248.0420	---	---
11AC80MIMO	Ant2	5210	75.764	5171.4785	5247.2428	---	---
11AC80MIMO	Ant1	5290	75.604	5252.1179	5327.7223	---	---
11AC80MIMO	Ant2	5290	74.645	5253.7163	5328.3616	---	---
11AC80MIMO	Ant1	5530	75.604	5491.9580	5567.5624	---	---
11AC80MIMO	Ant2	5530	76.244	5491.6384	5567.8821	---	---
11AC80MIMO	Ant1	5610	75.285	5572.1179	5647.4026	---	---
11AC80MIMO	Ant2	5610	74.805	5572.5974	5647.4026	---	---
11AC80MIMO	Ant1	5775	75.924	5736.9580	5812.8821	---	---
11AC80MIMO	Ant2	5775	74.486	5738.0769	5812.5624	---	---
11AX20MIMO	Ant1	5180	18.501	5170.6893	5189.1908	---	---
11AX20MIMO	Ant2	5180	18.621	5170.6494	5189.2707	---	---
11AX20MIMO	Ant1	5200	18.501	5190.6094	5209.1109	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20MIMO	Ant2	5200	18.422	5190.7692	5209.1908	---	---
11AX20MIMO	Ant1	5240	18.462	5230.6494	5249.1109	---	---
11AX20MIMO	Ant2	5240	18.581	5230.6494	5249.2308	---	---
11AX20MIMO	Ant1	5260	18.422	5250.6893	5269.1109	---	---
11AX20MIMO	Ant2	5260	18.661	5250.5295	5269.1908	---	---
11AX20MIMO	Ant1	5280	18.501	5270.6094	5289.1109	---	---
11AX20MIMO	Ant2	5280	18.462	5270.5694	5289.0310	---	---
11AX20MIMO	Ant1	5320	18.382	5310.7293	5329.1109	---	---
11AX20MIMO	Ant2	5320	18.541	5310.4496	5328.9910	---	---
11AX20MIMO	Ant1	5500	18.462	5490.6494	5509.1109	---	---
11AX20MIMO	Ant2	5500	18.781	5490.4496	5509.2308	---	---
11AX20MIMO	Ant1	5580	18.581	5570.6094	5589.1908	---	---
11AX20MIMO	Ant2	5580	18.462	5570.8492	5589.3107	---	---
11AX20MIMO	Ant1	5700	18.462	5690.6094	5709.0709	---	---
11AX20MIMO	Ant2	5700	18.861	5690.4496	5709.3107	---	---
11AX20MIMO	Ant1	5745	18.462	5735.6094	5754.0709	---	---
11AX20MIMO	Ant2	5745	18.262	5735.9690	5754.2308	---	---
11AX20MIMO	Ant1	5785	18.581	5775.5694	5794.1508	---	---
11AX20MIMO	Ant2	5785	18.382	5775.6893	5794.0709	---	---
11AX20MIMO	Ant1	5825	18.462	5815.6094	5834.0709	---	---
11AX20MIMO	Ant2	5825	18.741	5815.2897	5834.0310	---	---
11AX40MIMO	Ant1	5190	36.843	5171.6184	5208.4615	---	---
11AX40MIMO	Ant2	5190	36.843	5171.6983	5208.5415	---	---
11AX40MIMO	Ant1	5230	36.763	5211.4585	5248.2218	---	---
11AX40MIMO	Ant2	5230	36.763	5211.8581	5248.6214	---	---
11AX40MIMO	Ant1	5270	36.843	5251.3786	5288.2218	---	---
11AX40MIMO	Ant2	5270	37.163	5251.3786	5288.5415	---	---
11AX40MIMO	Ant1	5310	36.923	5291.3786	5328.3017	---	---
11AX40MIMO	Ant2	5310	36.603	5291.0589	5327.6623	---	---
11AX40MIMO	Ant1	5510	36.843	5491.4585	5528.3017	---	---
11AX40MIMO	Ant2	5510	37.003	5491.2188	5528.2218	---	---
11AX40MIMO	Ant1	5550	36.843	5531.5385	5568.3816	---	---
11AX40MIMO	Ant2	5550	37.243	5531.4585	5568.7013	---	---
11AX40MIMO	Ant1	5670	36.843	5651.3786	5688.2218	---	---
11AX40MIMO	Ant2	5670	37.642	5650.9790	5688.6214	---	---
11AX40MIMO	Ant1	5755	37.003	5736.2987	5773.3017	---	---
11AX40MIMO	Ant2	5755	36.843	5736.8581	5773.7013	---	---
11AX40MIMO	Ant1	5795	36.603	5776.5385	5813.1419	---	---
11AX40MIMO	Ant2	5795	36.523	5776.1389	5812.6623	---	---
11AX80MIMO	Ant1	5210	76.883	5172.1179	5249.0010	---	---
11AX80MIMO	Ant2	5210	77.522	5170.9990	5248.5215	---	---
11AX80MIMO	Ant1	5290	77.363	5251.7982	5329.1608	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX80MIMO	Ant2	5290	77.203	5251.4785	5328.6813	---	---
11AX80MIMO	Ant1	5530	76.563	5490.8392	5567.4026	---	---
11AX80MIMO	Ant2	5530	77.363	5491.1588	5568.5215	---	---
11AX80MIMO	Ant1	5610	74.166	5575.1548	5649.3207	---	---
11AX80MIMO	Ant2	5610	77.682	5571.3187	5649.0010	---	---
11AX80MIMO	Ant1	5775	77.522	5736.1588	5813.6813	---	---
11AX80MIMO	Ant2	5775	77.522	5736.1588	5813.6813	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

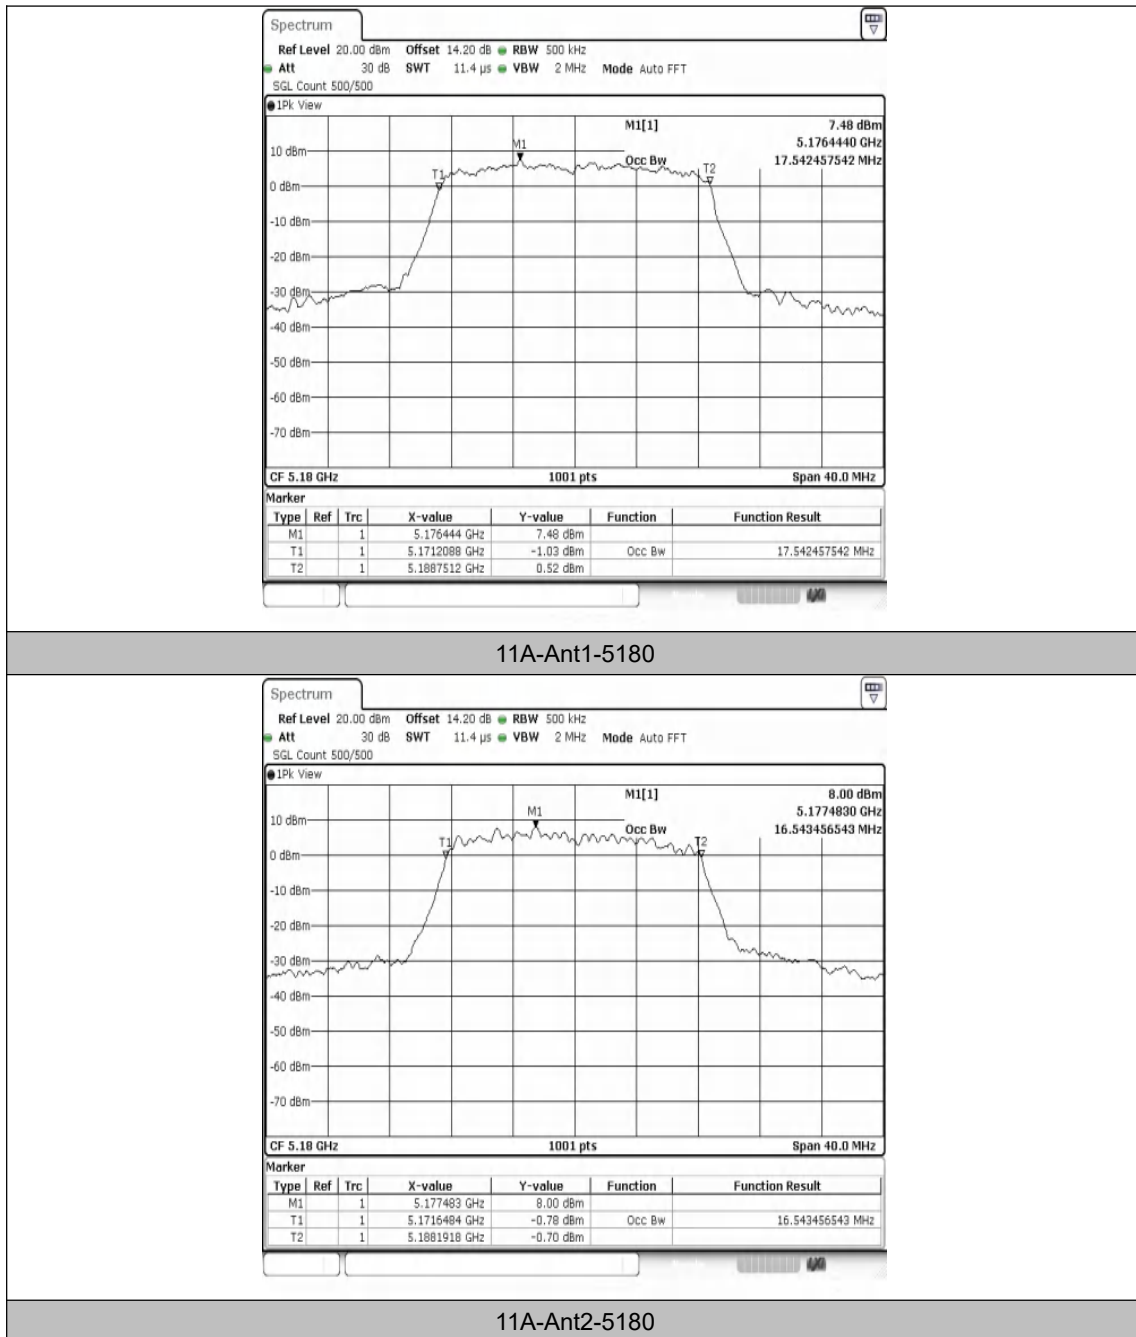


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

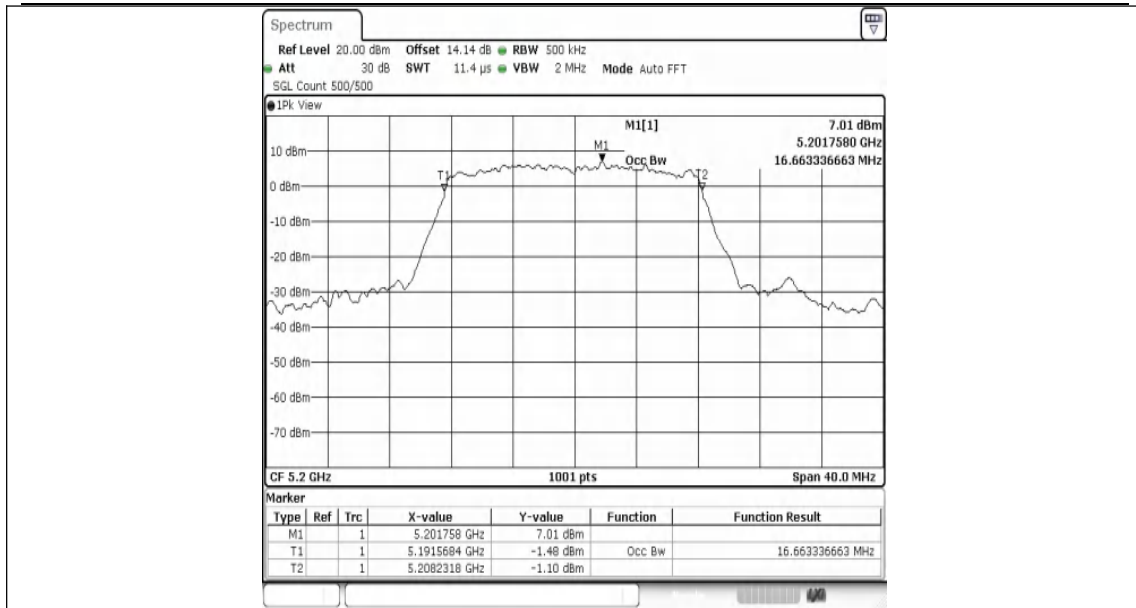

11A-Ant1-5200

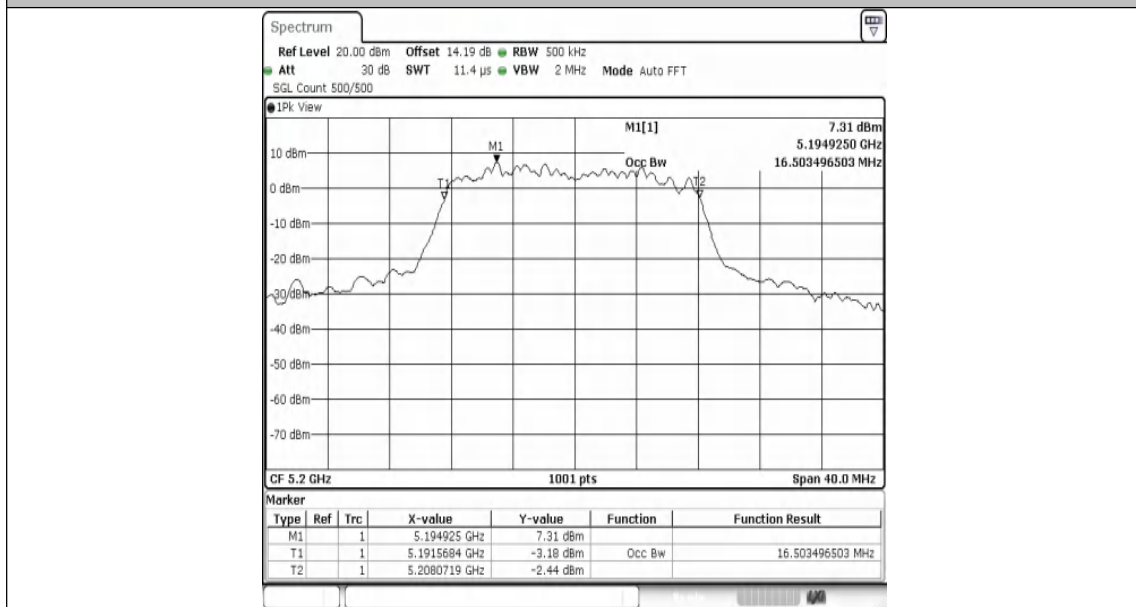


11A-Ant2-5200

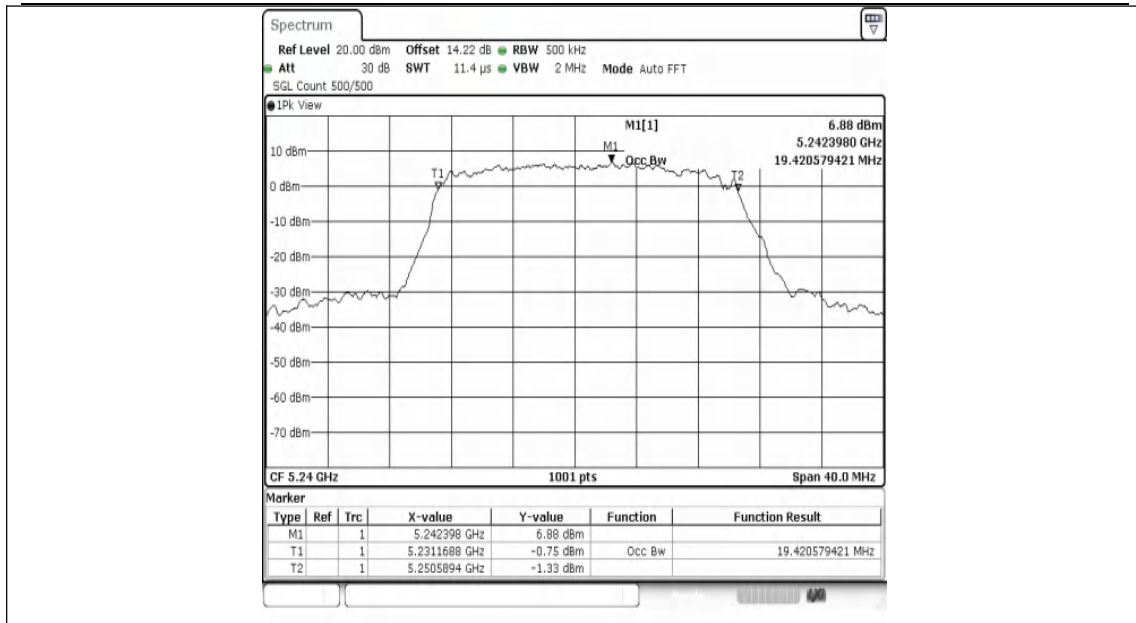

11A-Ant1-5240




11A-Ant2-5240

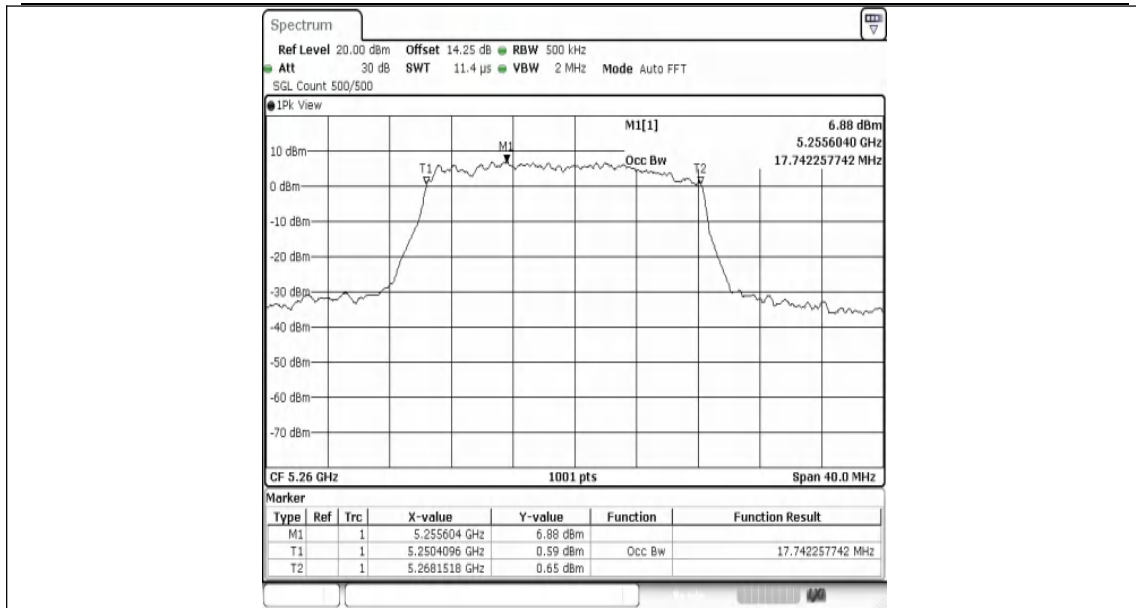



11A-Ant1-5260




11A-Ant2-5260

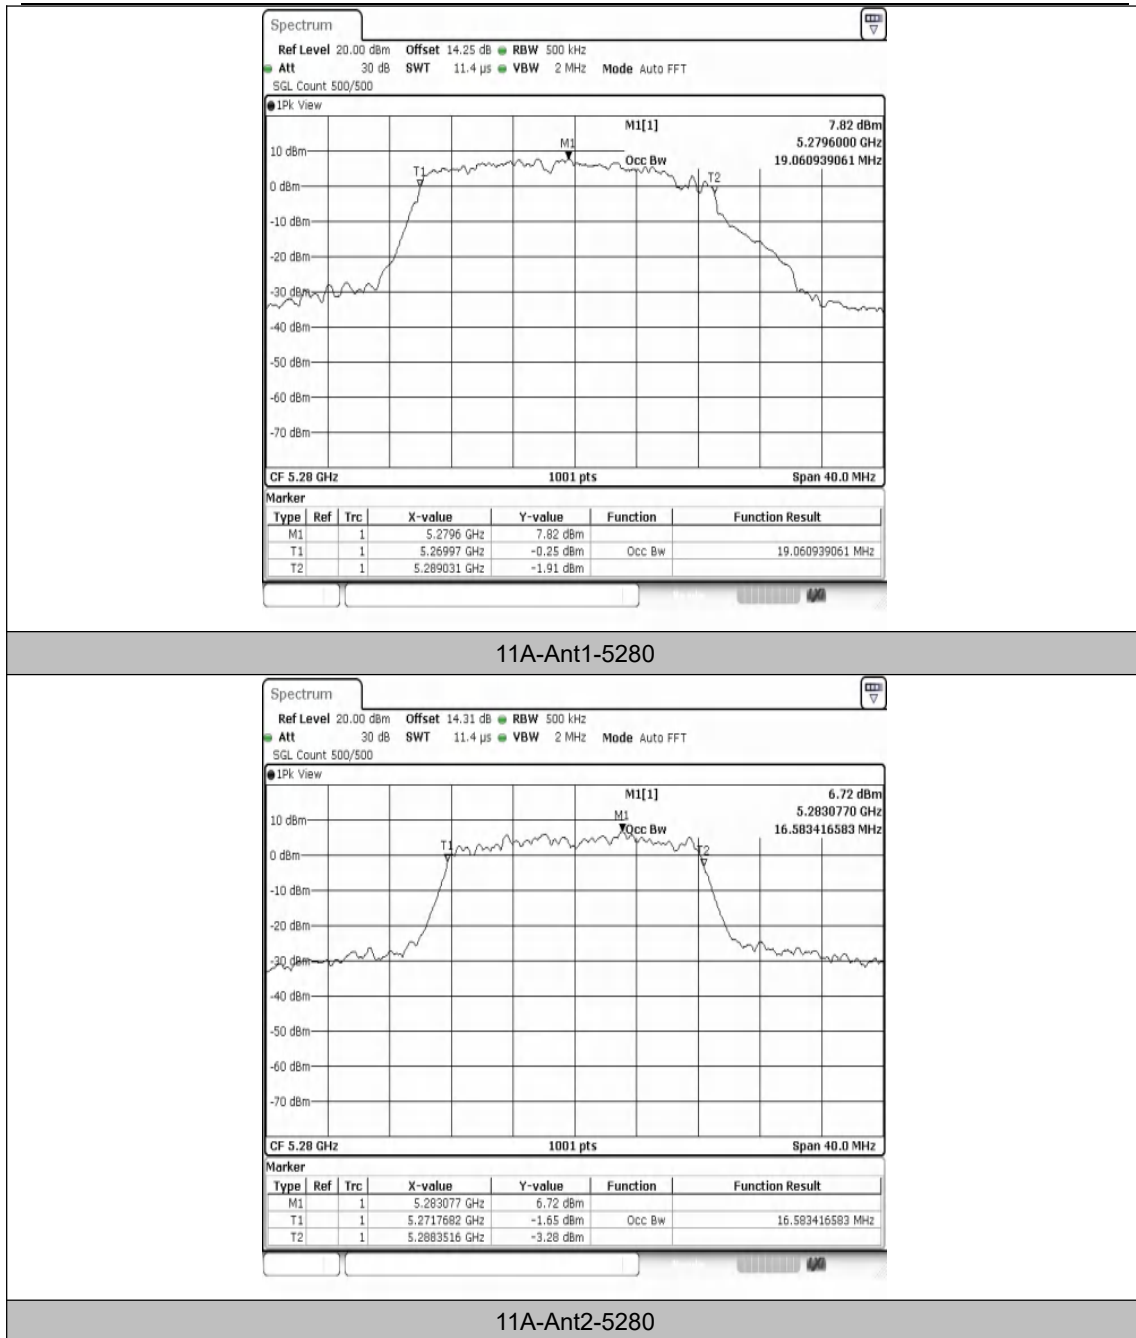

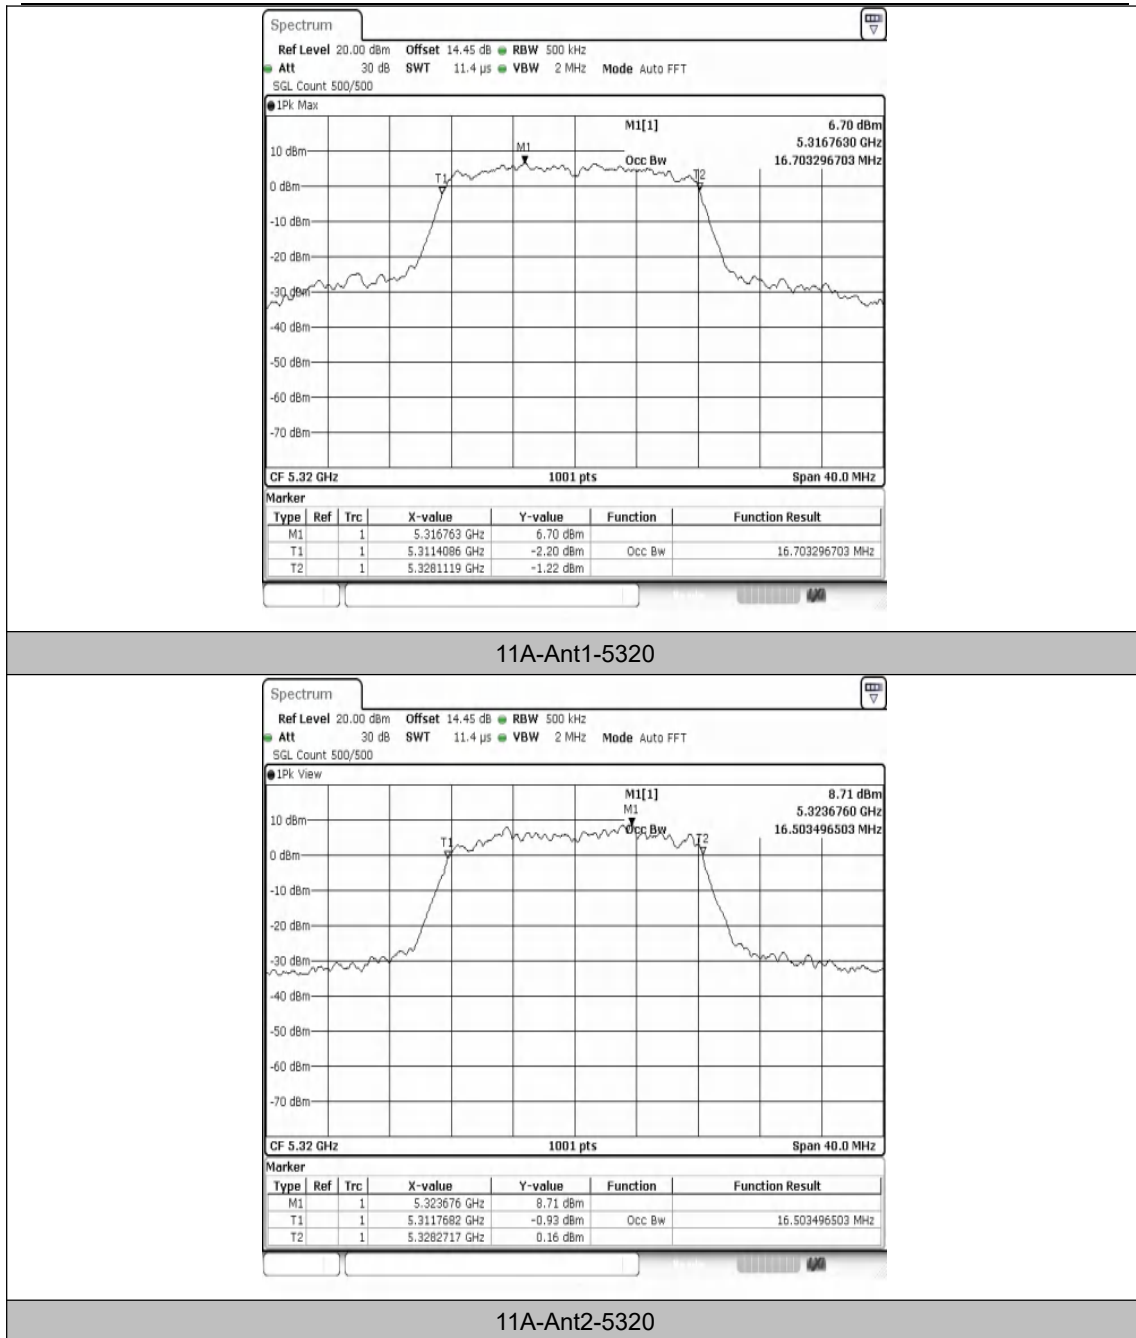


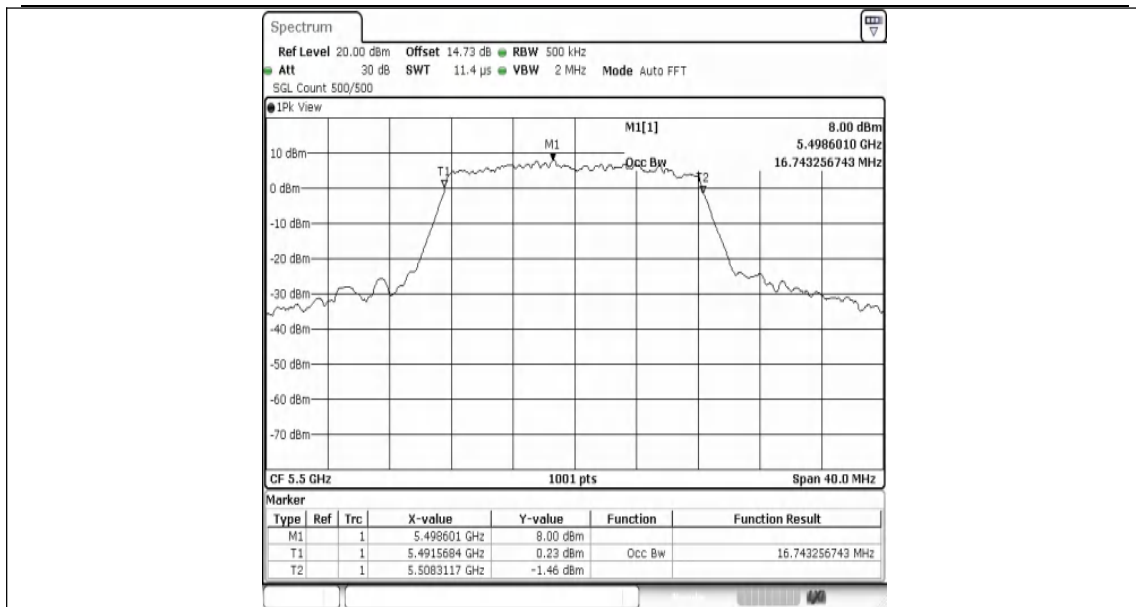


11A-Ant1-5500

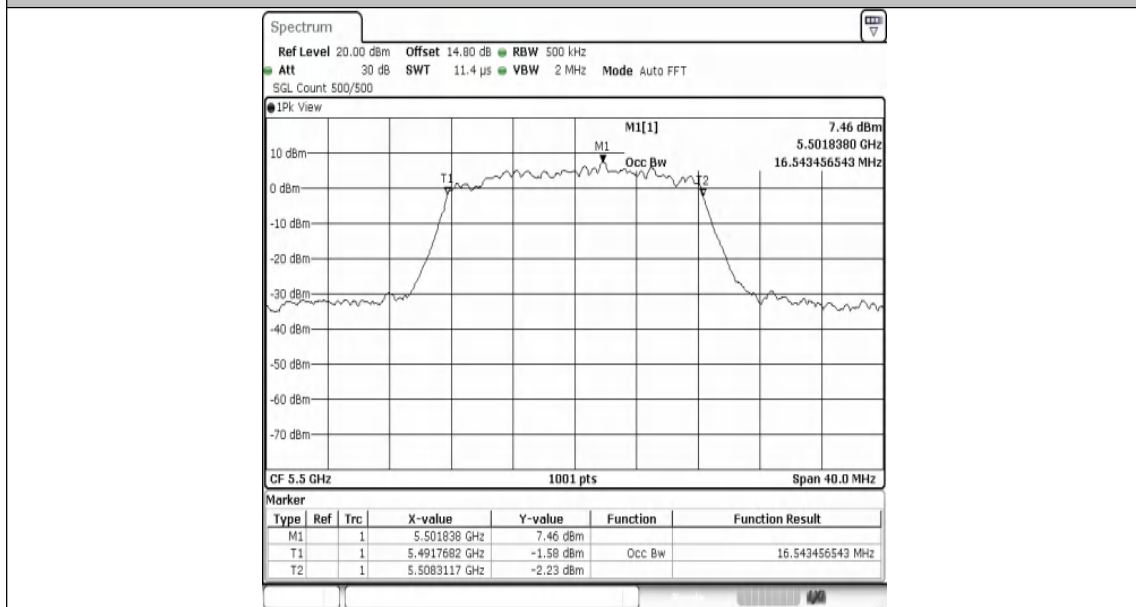


11A-Ant2-5500

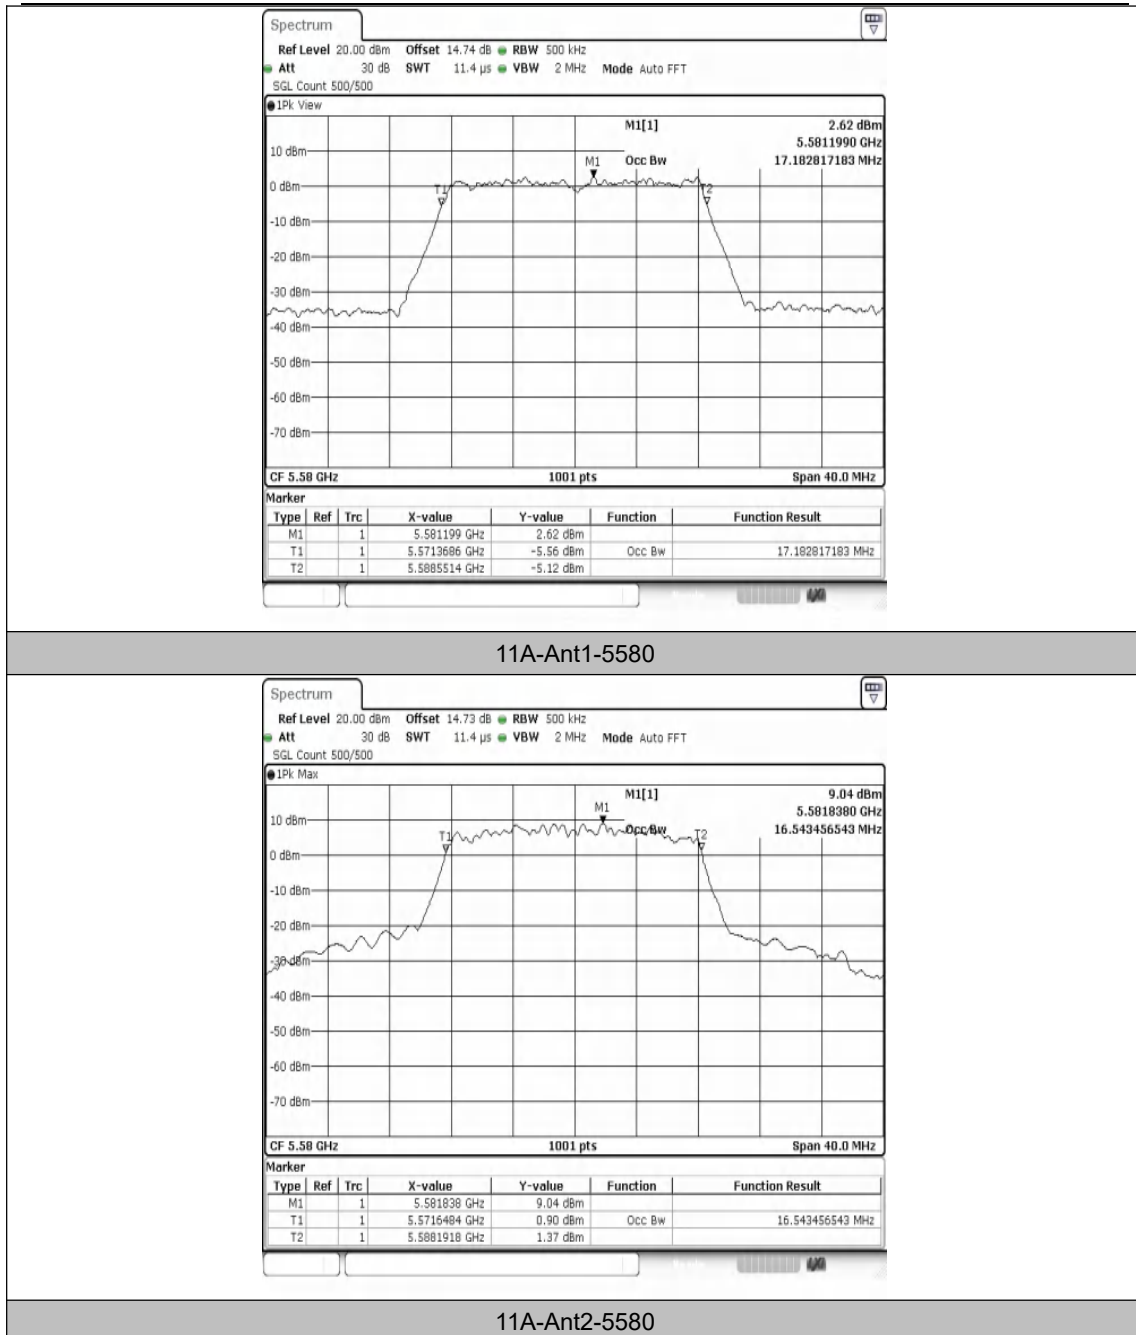


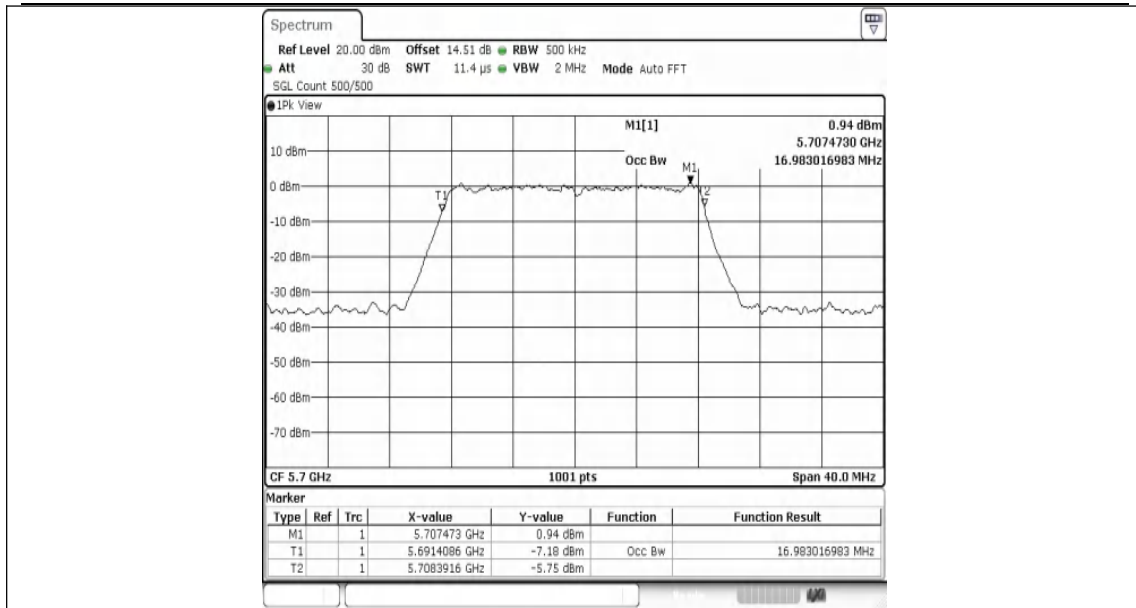


11A-Ant1-5700

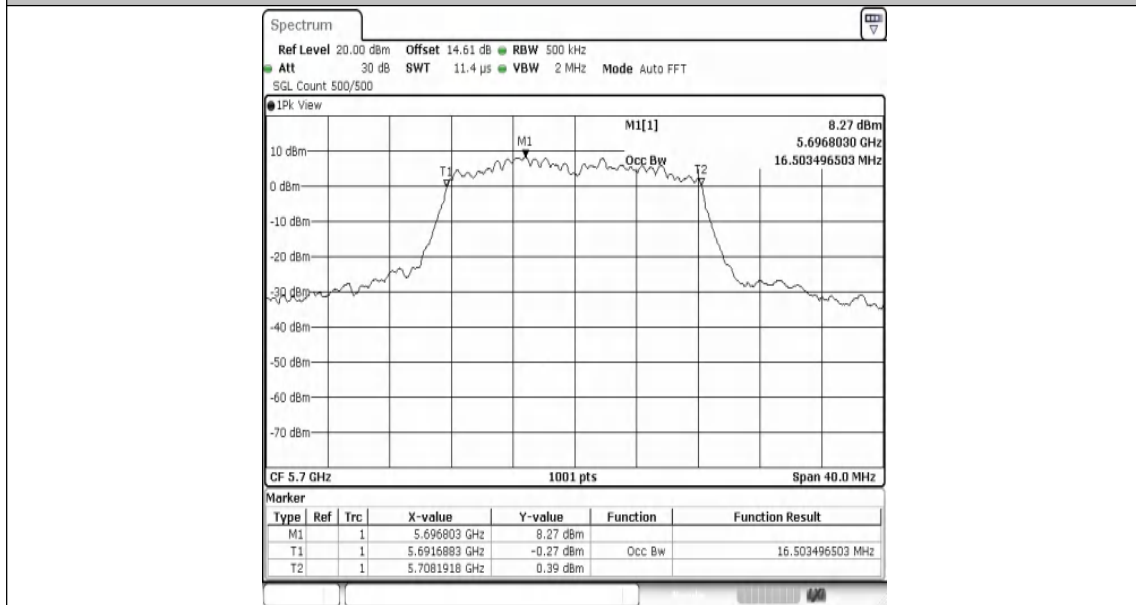


11A-Ant2-5700

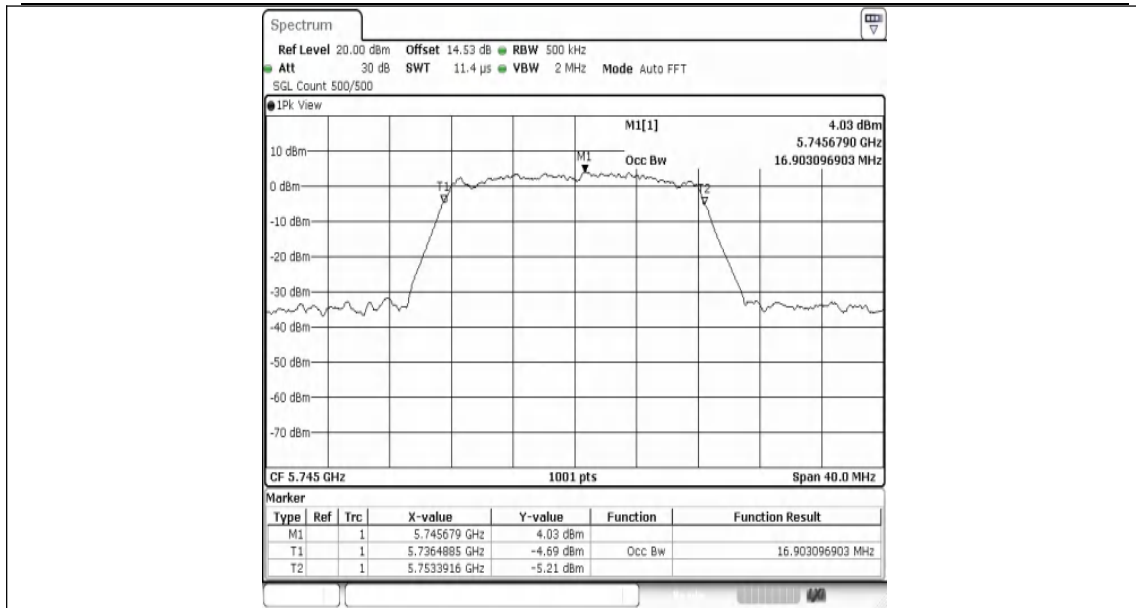

11A-Ant1-5745

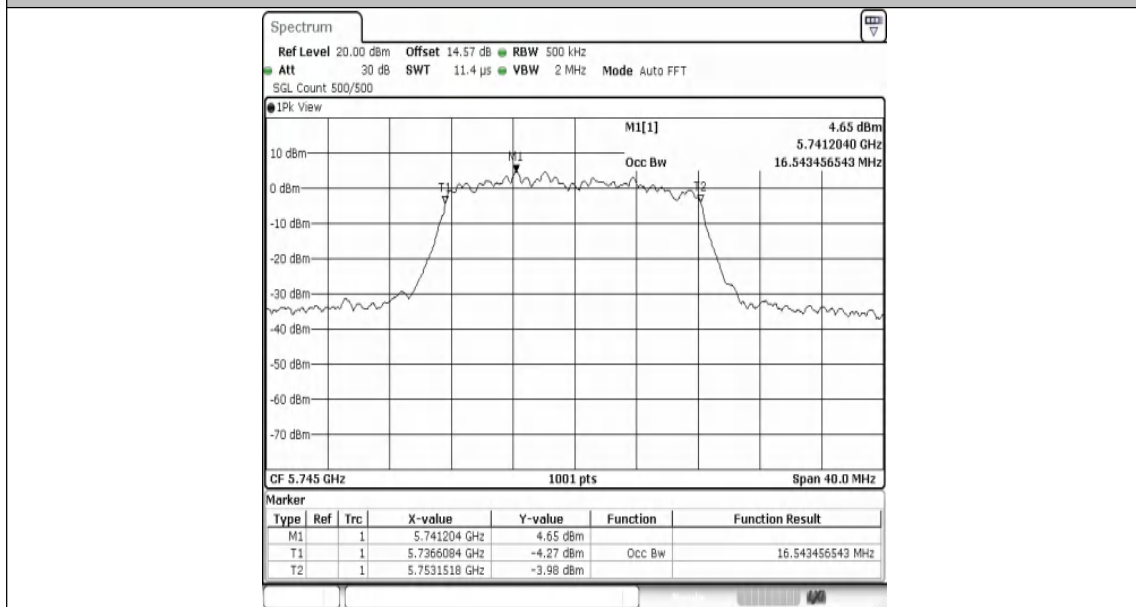


11A-Ant2-5745

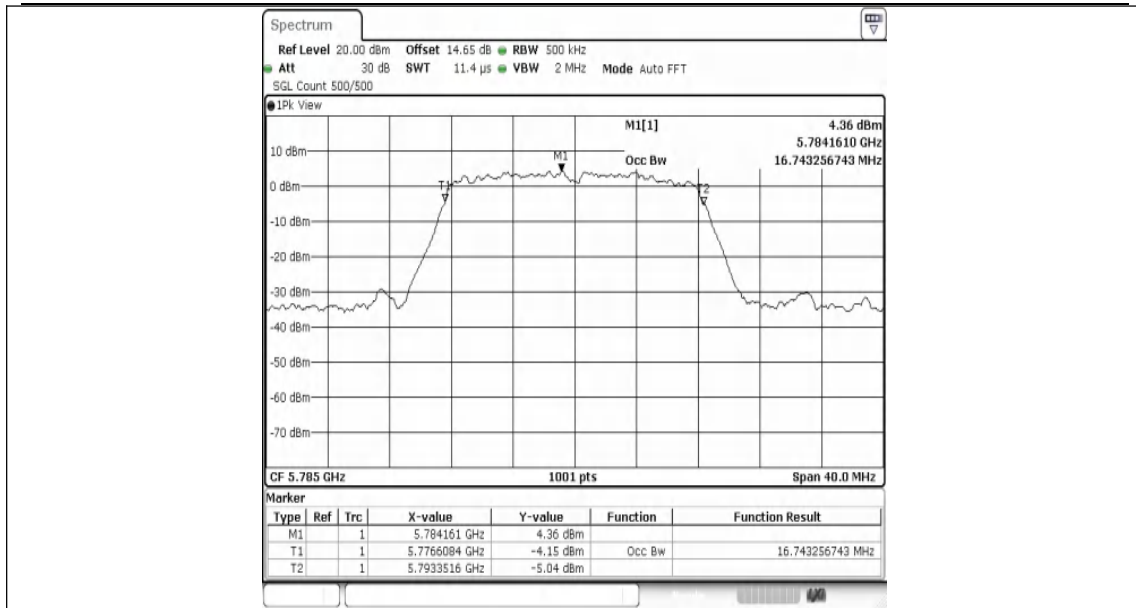


11A-Ant1-5785




11A-Ant2-5785

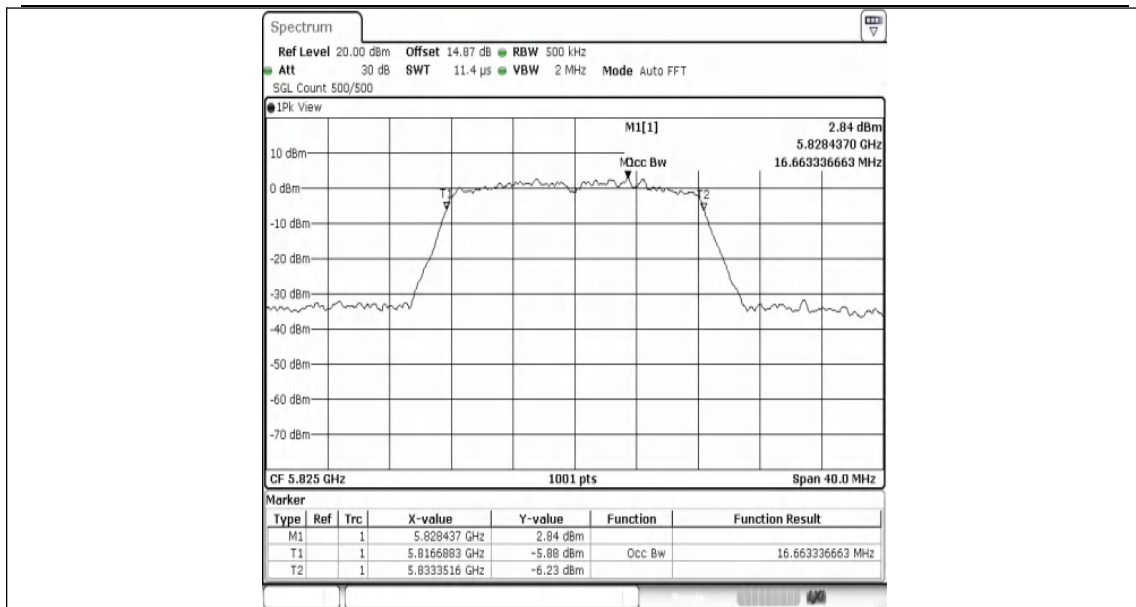


11A-Ant1-5825

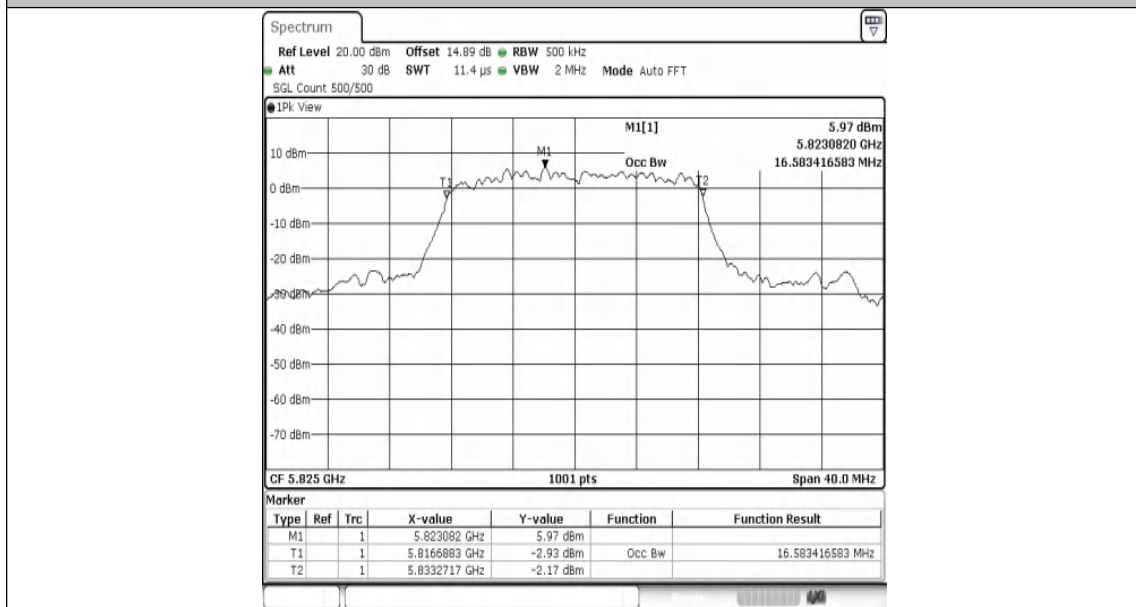


11A-Ant2-5825

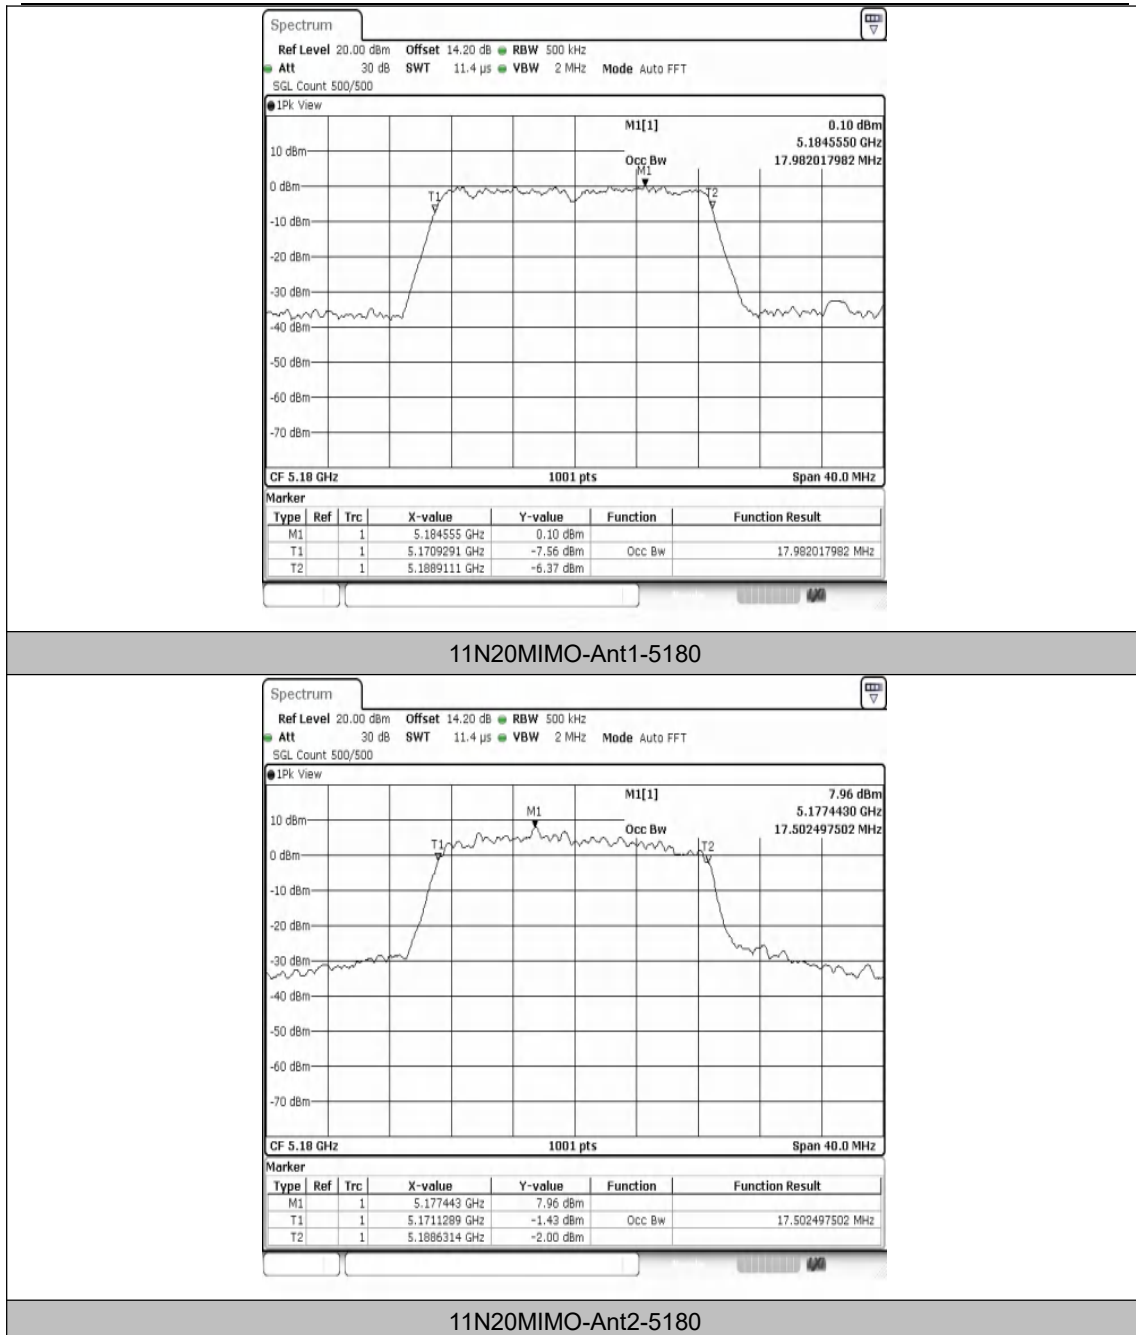


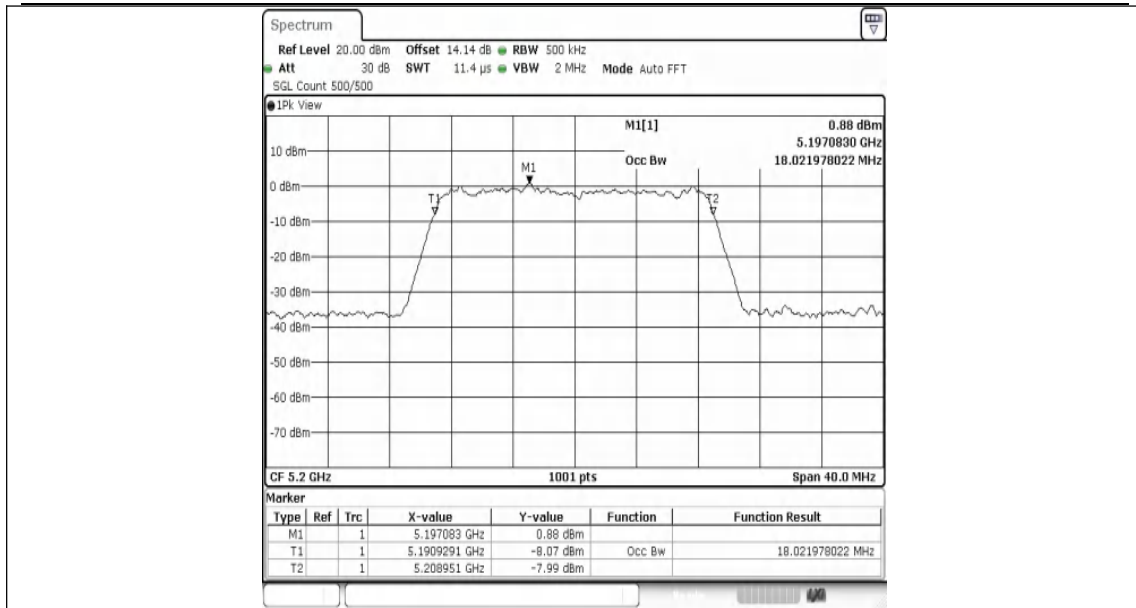

11N20MIMO-Ant1-5200

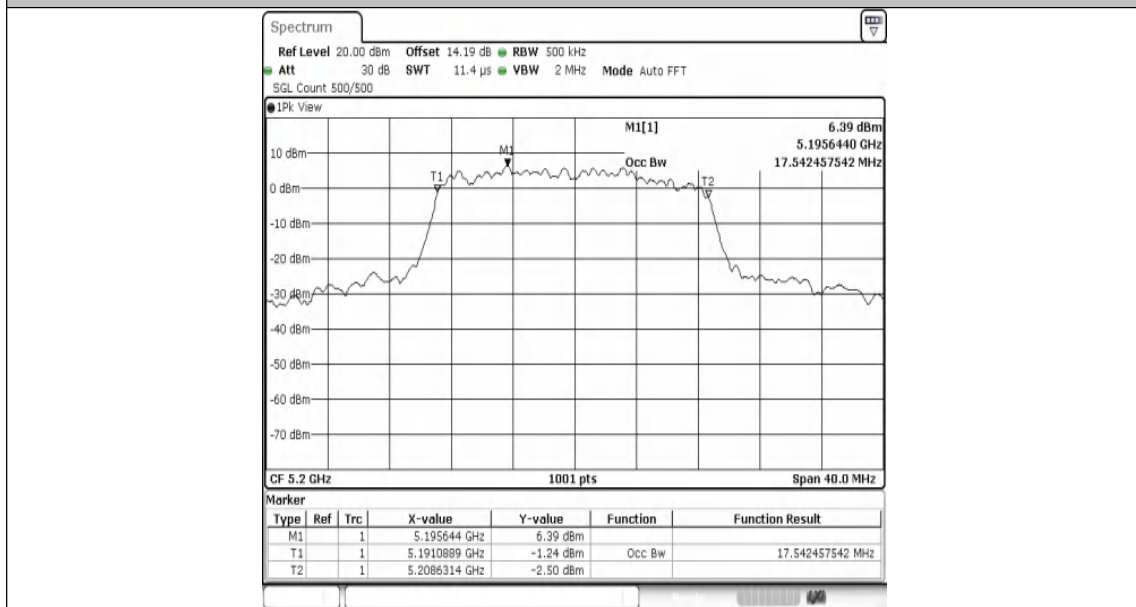

11N20MIMO-Ant2-5200

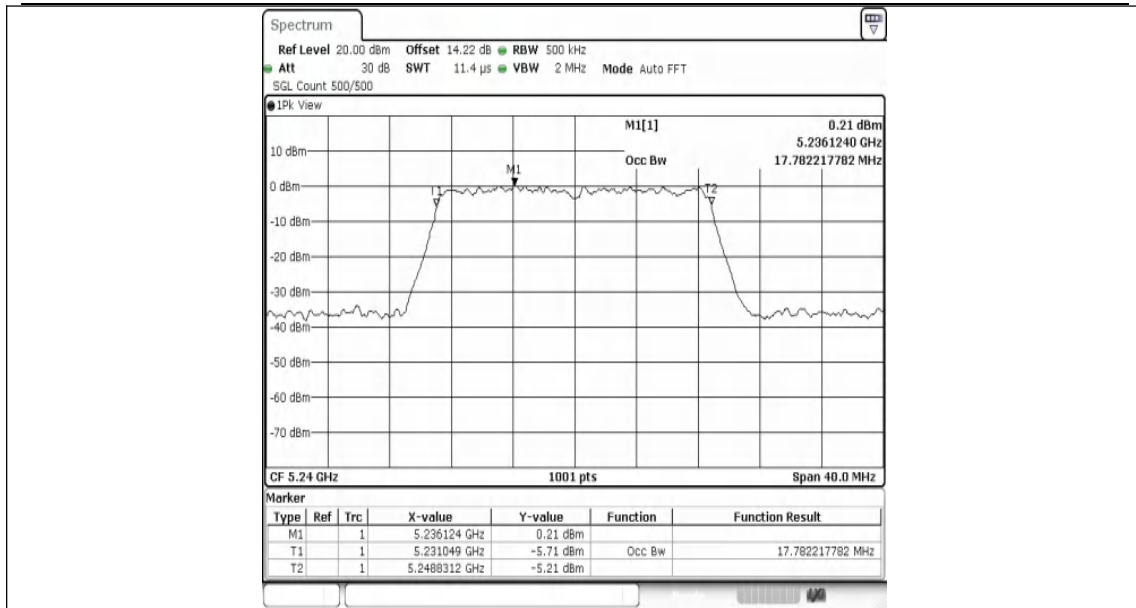

11N20MIMO-Ant1-5240



11N20MIMO-Ant2-5240

