





Test Graphs


DH5_Ant1_Hop

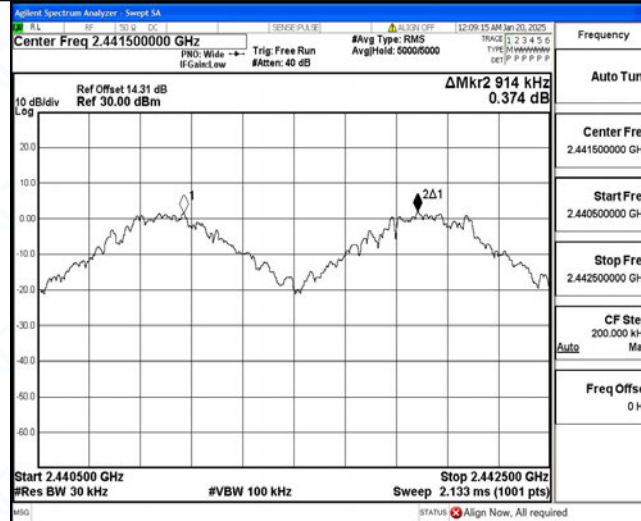

2DH5_Ant1_Hop

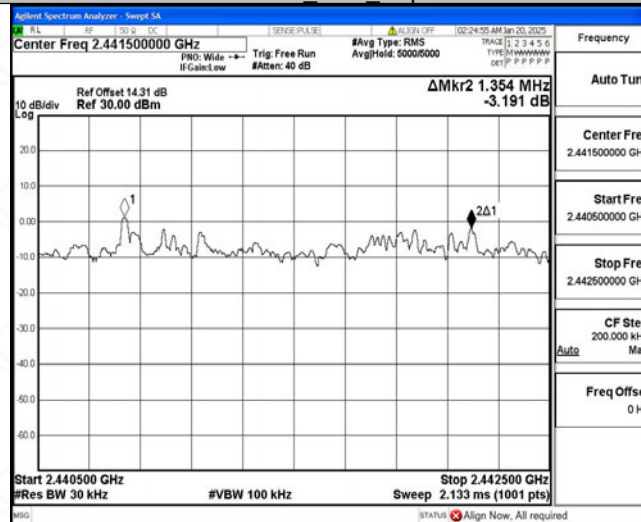

3DH5_Ant1_Hop

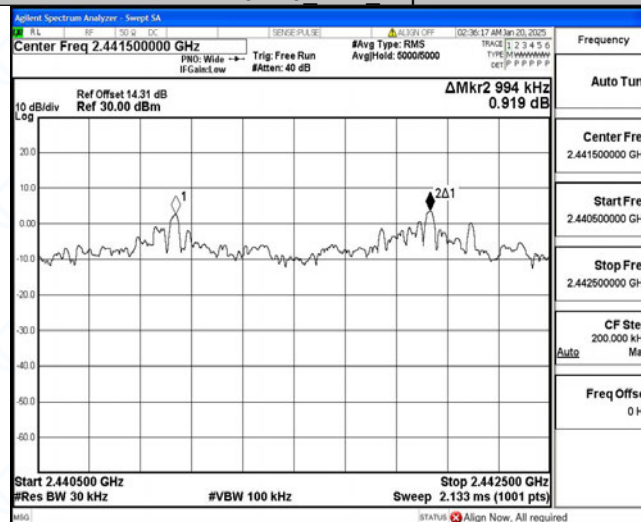



Appendix E: Number of hopping channels

Test Result


TestMode	Antenna	Freq(MHz)	Result[Num]	Limit[Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS

Note:The right earphone is the worst, only the worse case was reported.




Test Graphs


DH5_Ant1_Hop

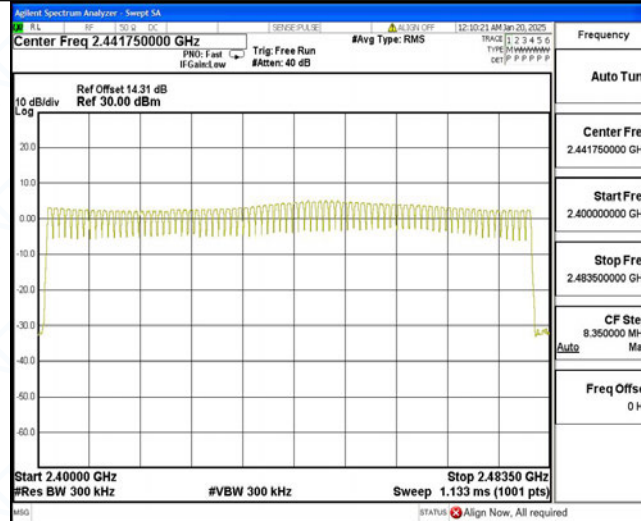

2DH5_Ant1_Hop

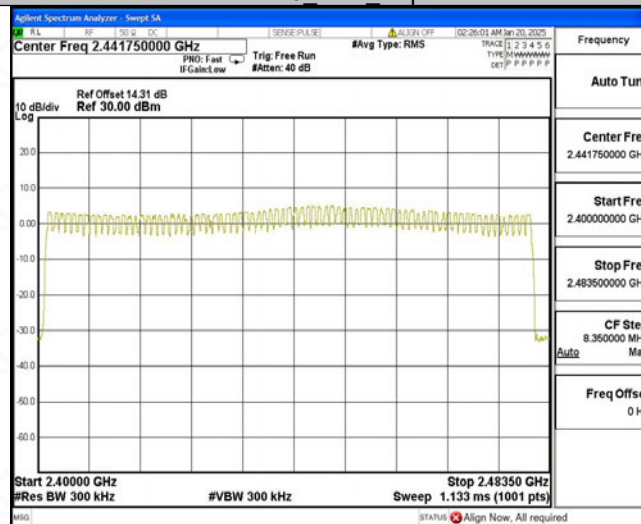

3DH5_Ant1_Hop

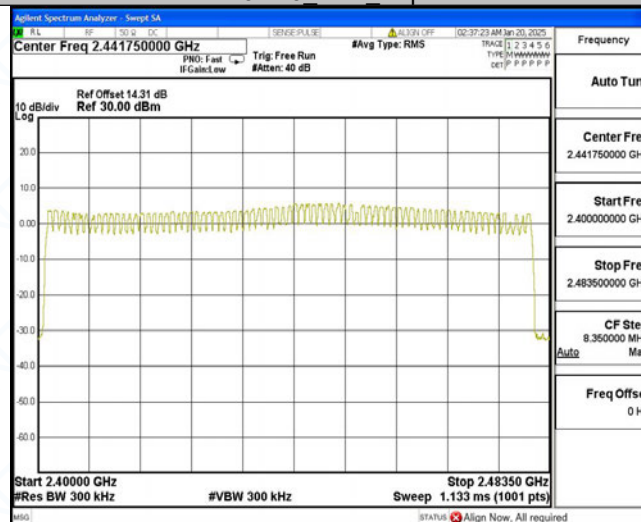



Appendix F: Band edge measurements

Test Result


TestMode	Antenna	ChName	Freq(MHz)	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	-0.53	-49.84	≤ -20.53	PASS
		High	2480	-2.20	-49.92	≤ -22.2	PASS
		Low	Hop_2402	-0.11	-50.32	≤ -20.11	PASS
		High	Hop_2480	-0.94	-49.71	≤ -20.94	PASS
2DH5	Ant1	Low	2402	-0.36	-49.9	≤ -20.36	PASS
		High	2480	-7.19	-48.51	≤ -27.19	PASS
		Low	Hop_2402	-0.05	-49.99	≤ -20.05	PASS
		High	Hop_2480	-1.73	-49.76	≤ -21.73	PASS
3DH5	Ant1	Low	2402	-0.14	-49.95	≤ -20.14	PASS
		High	2480	-0.88	-49.99	≤ -20.88	PASS
		Low	Hop_2402	-5.05	-49.99	≤ -25.05	PASS
		High	Hop_2480	-0.99	-49.37	≤ -20.99	PASS

Note: The right earphone is the worst, only the worse case was reported.




Test Graphs


DH5_Ant1_Low_2402

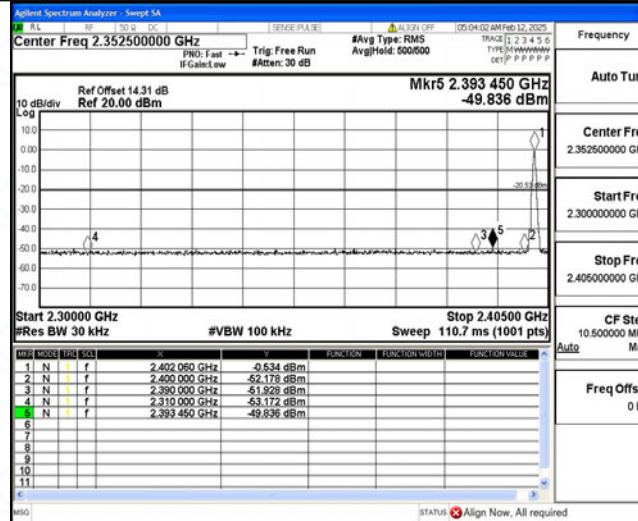


DH5_Ant1_High_2480

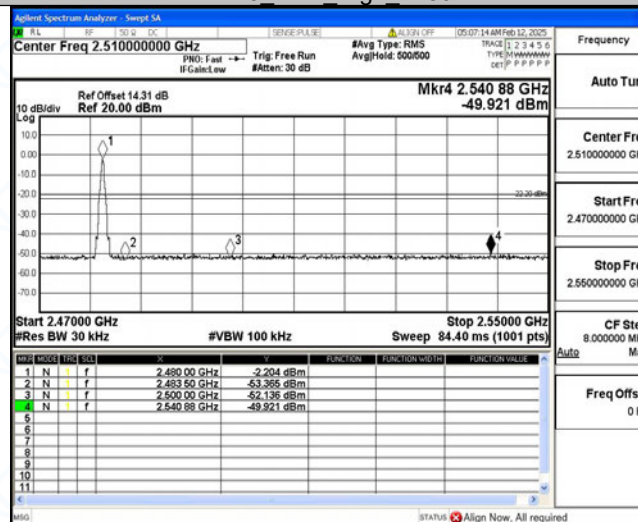


DH5_Ant1_Low_Hop_2402

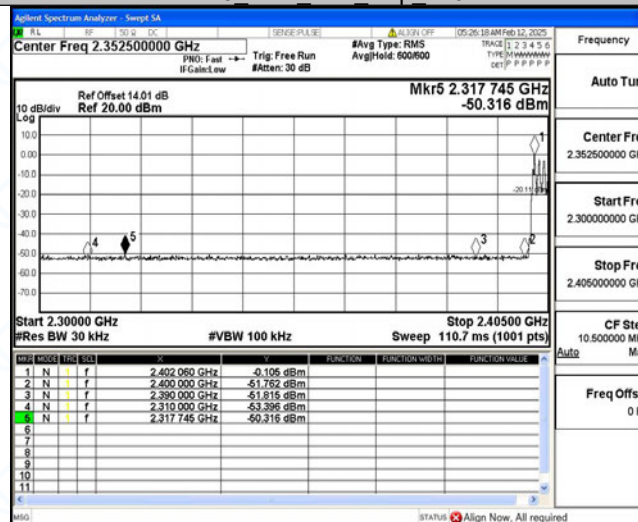


DH5_Ant1_High_Hop_2480

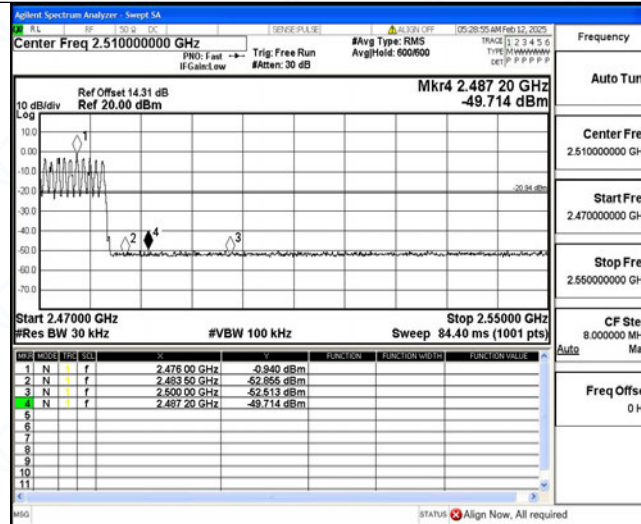


2DH5_Ant1_Low_2402

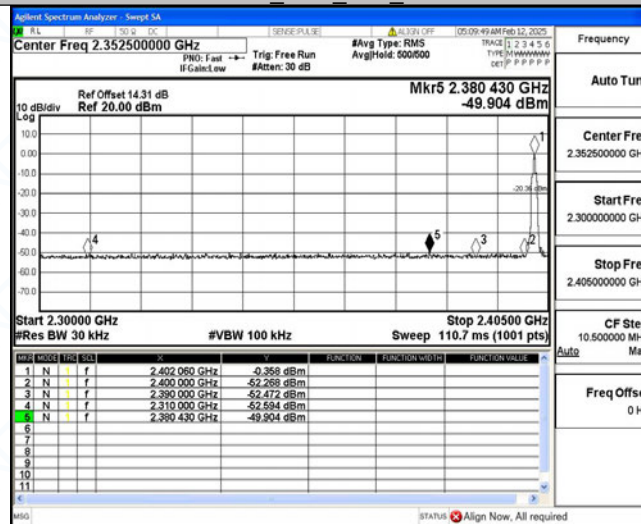


2DH5_Ant1_High_2480

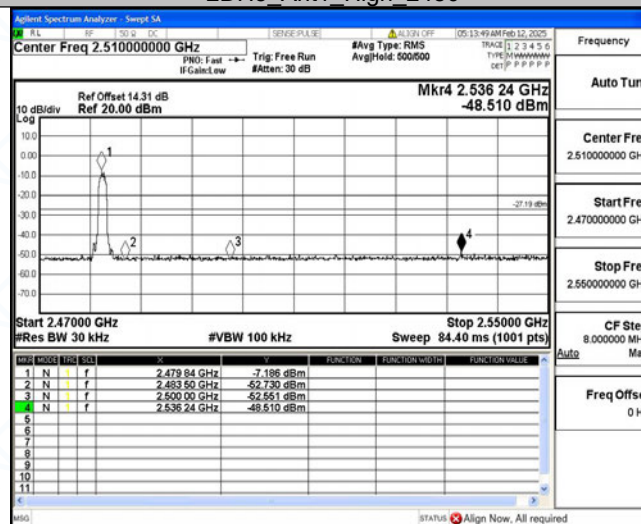


2DH5_Ant1_Low_Hop_2402

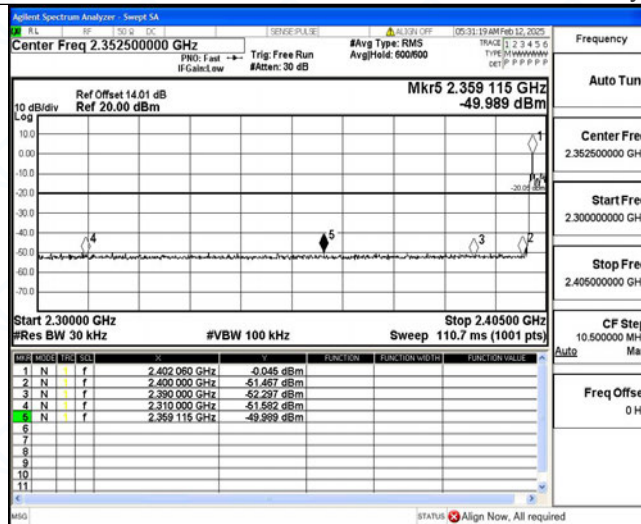


2DH5_Ant1_High_Hop_2480

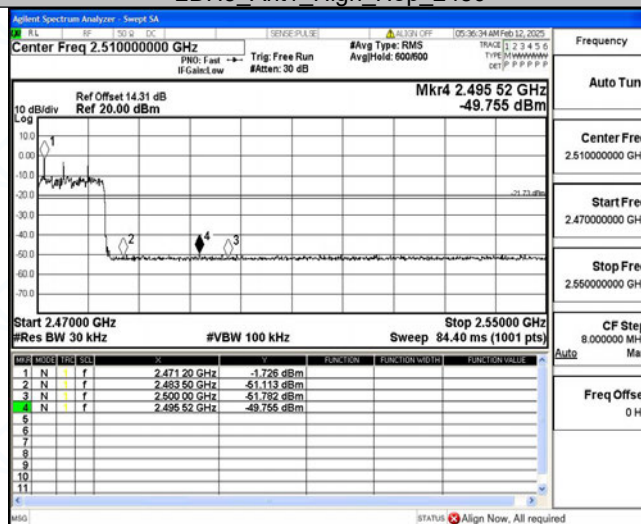


3DH5_Ant1_Low_2402

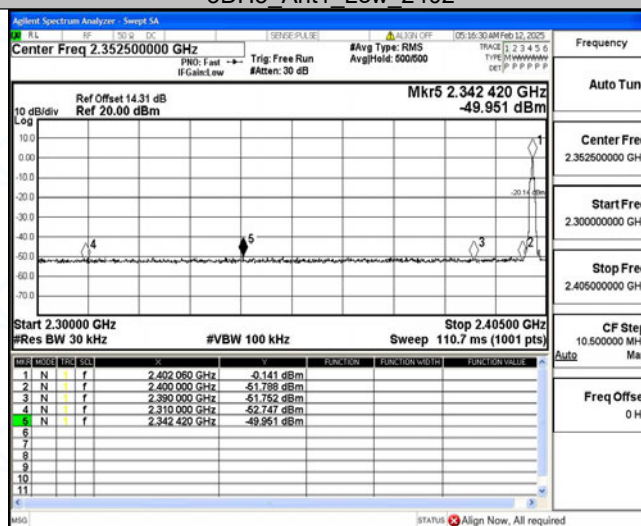


3DH5_Ant1_High_2480

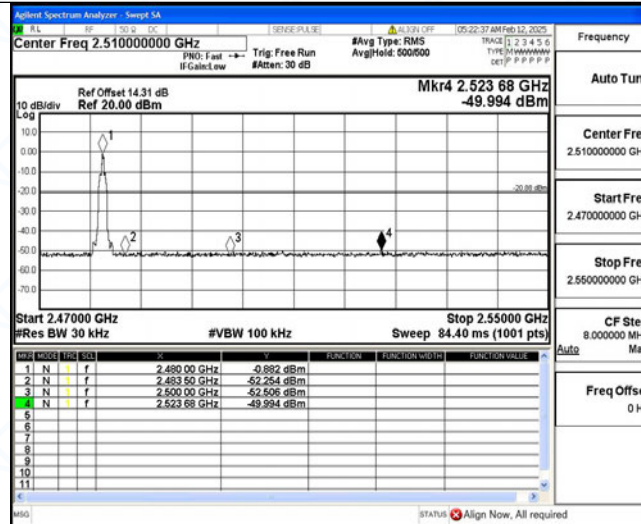

3DH5_Ant1_Low_Hop_2402

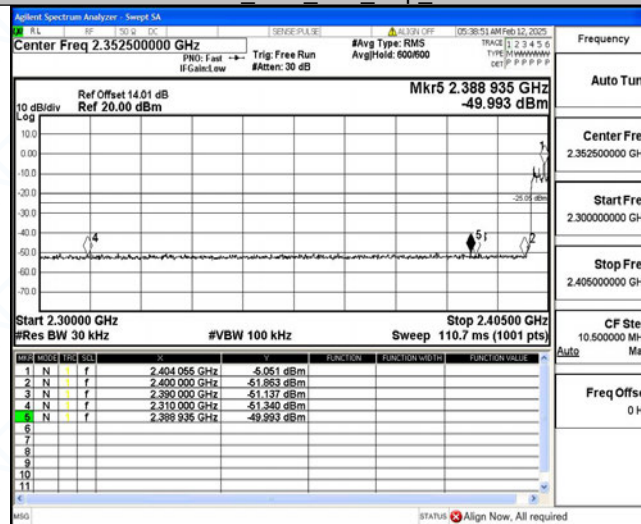

3DH5_Ant1_High_Hop_2480

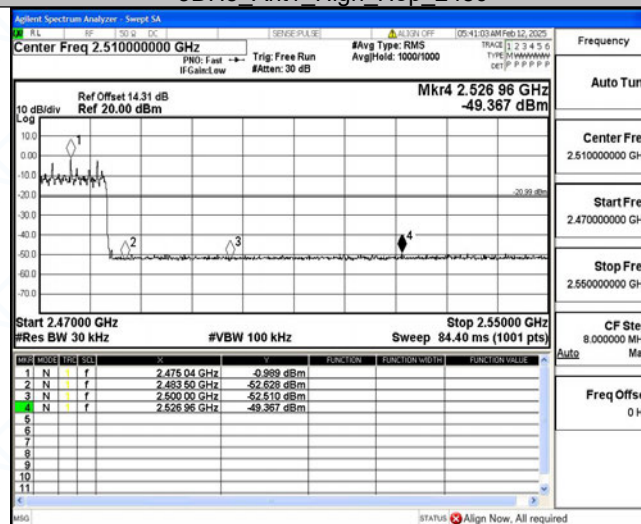



Appendix D: Dwell Time

Test Result


TestMode	Antenna	Freq(MHz)	BurstWidth [ms]	TotalHops [Num]	Result[s]	Limit[s]	Verdict
DH1	Ant1	Hop	0.405	320	0.13	≤0.4	PASS
DH3	Ant1	Hop	1.663	160	0.266	≤0.4	PASS
DH5	Ant1	Hop	2.911	106.67	0.311	≤0.4	PASS
2DH1	Ant1	Hop	0.417	320	0.133	≤0.4	PASS
2DH3	Ant1	Hop	1.668	160	0.267	≤0.4	PASS
2DH5	Ant1	Hop	2.916	106.67	0.311	≤0.4	PASS
3DH1	Ant1	Hop	0.415	320	0.133	≤0.4	PASS
3DH3	Ant1	Hop	1.667	160	0.267	≤0.4	PASS
3DH5	Ant1	Hop	2.917	106.67	0.311	≤0.4	PASS

Note:The right earphone is the worst, only the worse case was reported.




Test Graphs


DH1_Ant1_Hop

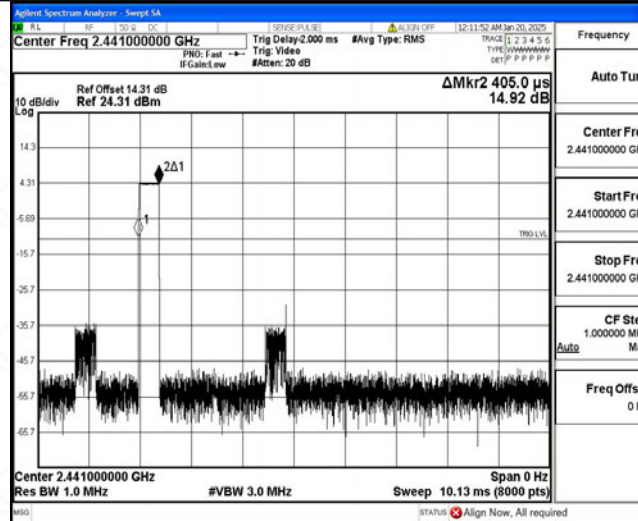


DH3_Ant1_Hop

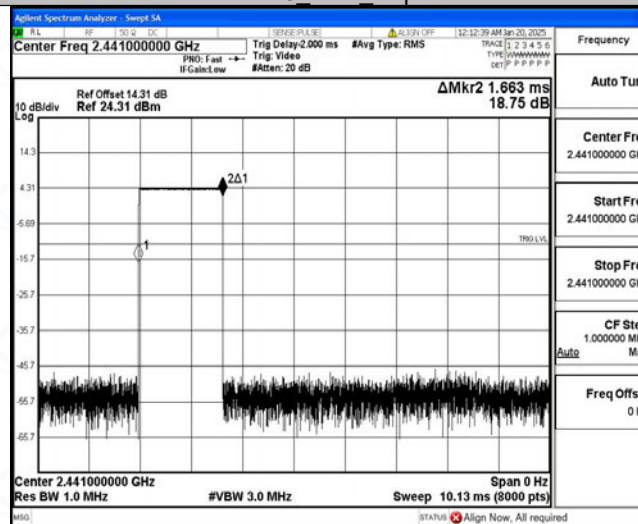


DH5_Ant1_Hop

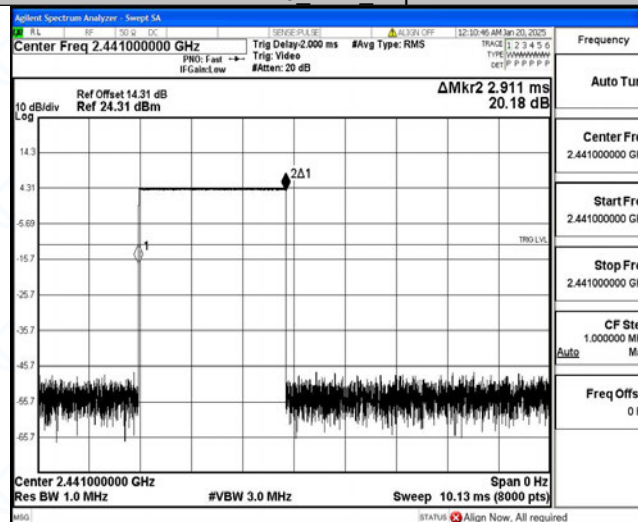


2DH1_Ant1_Hop

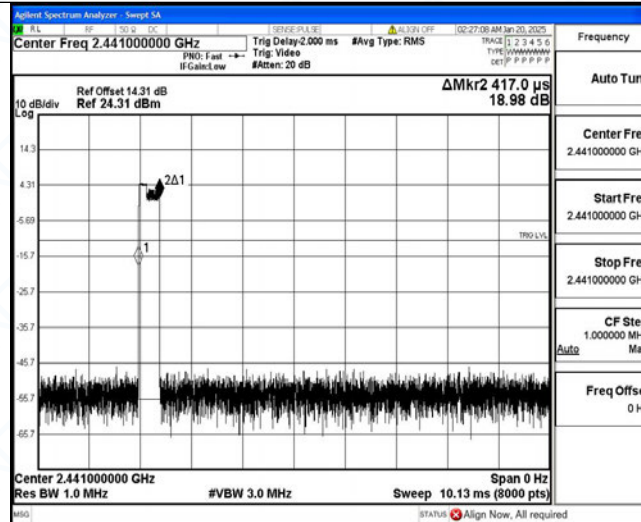


2DH3_Ant1_Hop

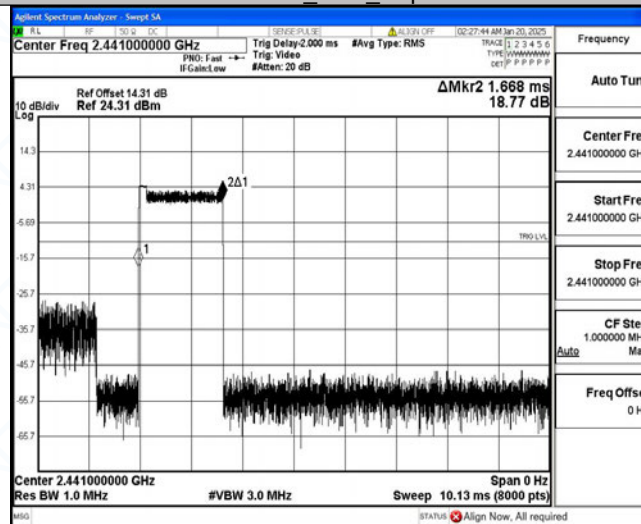


2DH5_Ant1_Hop

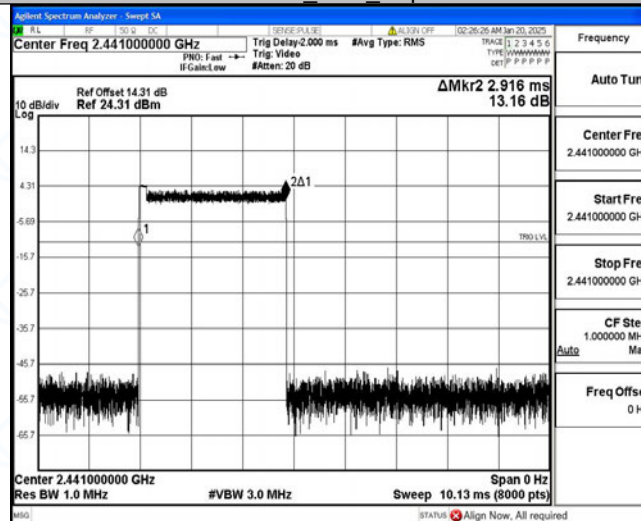


3DH1_Ant1_Hop

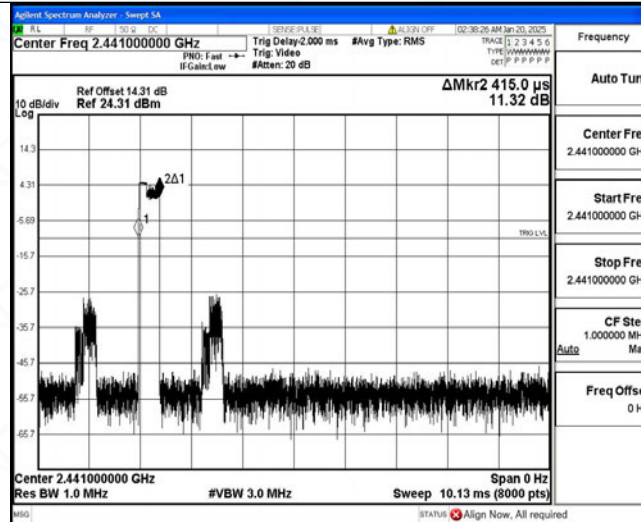

3DH3_Ant1_Hop

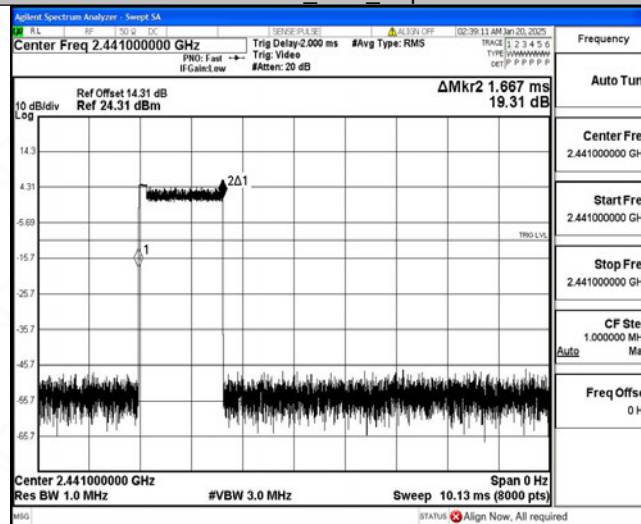

3DH5_Ant1_Hop

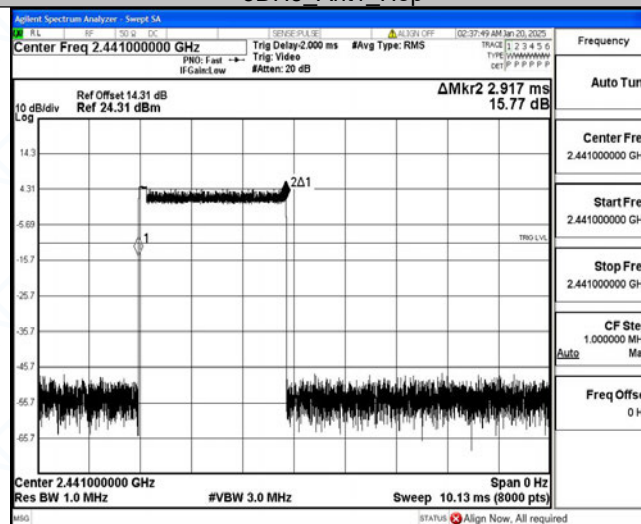

**Appendix G: Conducted Spurious Emission****Test Result**


TestMode	Antenna	Freq(MHz)	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	Reference	-0.05	-0.05	---	PASS
			30~1000	-0.05	-57.49	≤-20.05	PASS
			1000~26500	-0.05	-22.75	≤-20.05	PASS
		2441	Reference	0.96	0.96	---	PASS
			30~1000	0.96	-56.47	≤-19.04	PASS
			1000~26500	0.96	-24.46	≤-19.04	PASS
		2480	Reference	-1.24	-1.24	---	PASS
			30~1000	-1.24	-57.74	≤-21.24	PASS
			1000~26500	-1.24	-22.31	≤-21.24	PASS
2DH5	Ant1	2402	Reference	0.29	0.29	---	PASS
			30~1000	0.29	-56.69	≤-19.71	PASS
			1000~26500	0.29	-22.97	≤-19.71	PASS
		2441	Reference	1.41	1.41	---	PASS
			30~1000	1.41	-57.34	≤-18.59	PASS
			1000~26500	1.41	-31.85	≤-18.59	PASS
		2480	Reference	-1.43	-1.43	---	PASS
			30~1000	-1.43	-57.77	≤-21.43	PASS
			1000~26500	-1.43	-29.82	≤-21.43	PASS
3DH5	Ant1	2402	Reference	-0.56	-0.56	---	PASS
			30~1000	-0.56	-57.12	≤-20.56	PASS
			1000~26500	-0.56	-30.56	≤-20.56	PASS
		2441	Reference	1.01	1.01	---	PASS
			30~1000	1.01	-56.3	≤-18.99	PASS
			1000~26500	1.01	-29.78	≤-18.99	PASS
		2480	Reference	-0.79	-0.79	---	PASS
			30~1000	-0.79	-56.86	≤-20.79	PASS
			1000~26500	-0.79	-31.41	≤-20.79	PASS

Note:The right earphone is the worst, only the worse case was reported.




Test Graphs


DH5_Ant1_2402_0~Reference

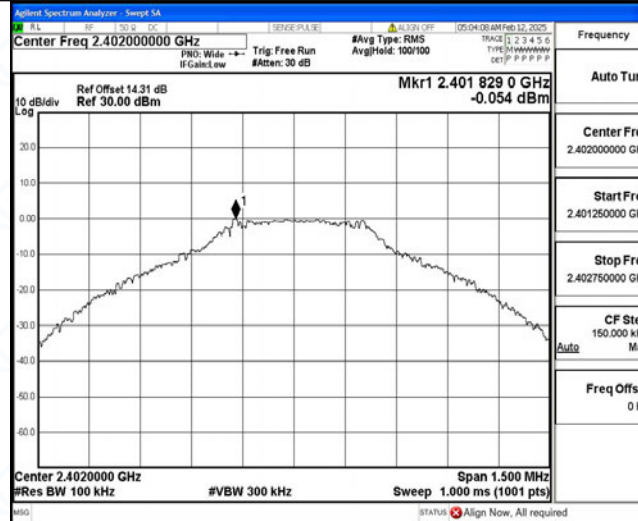


DH5_Ant1_2402_30~1000

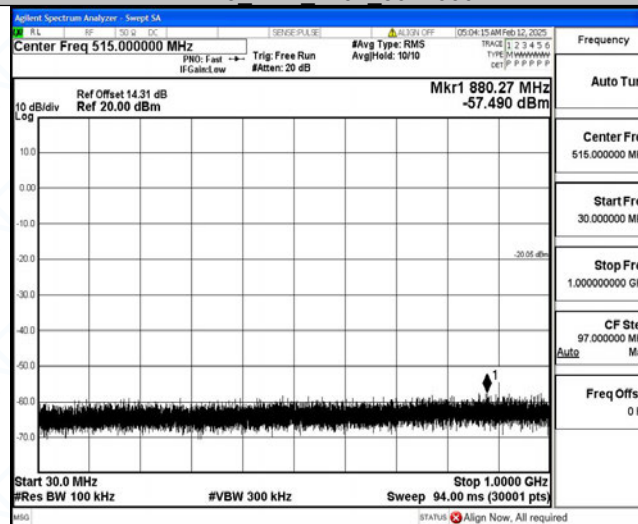


DH5_Ant1_2402_1000~26500

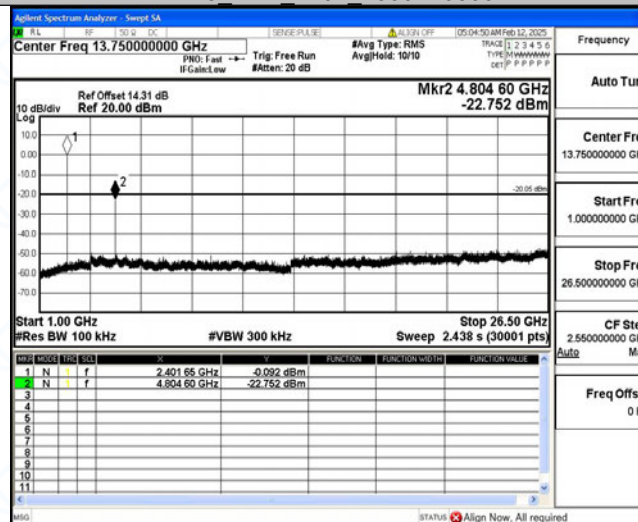


DH5_Ant1_2441_0~Reference

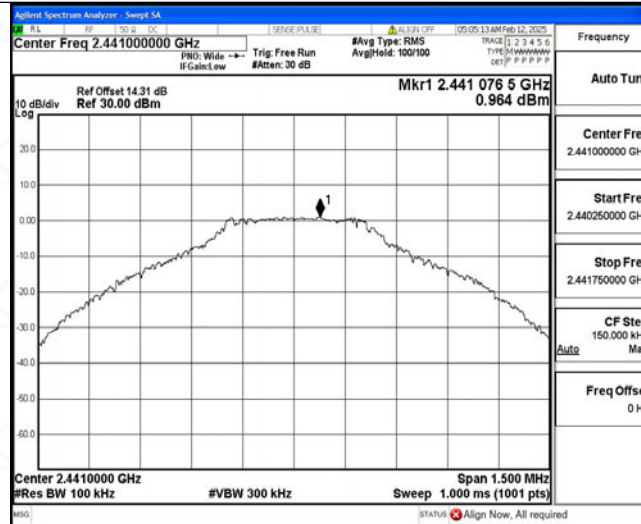


DH5_Ant1_2441_30~1000

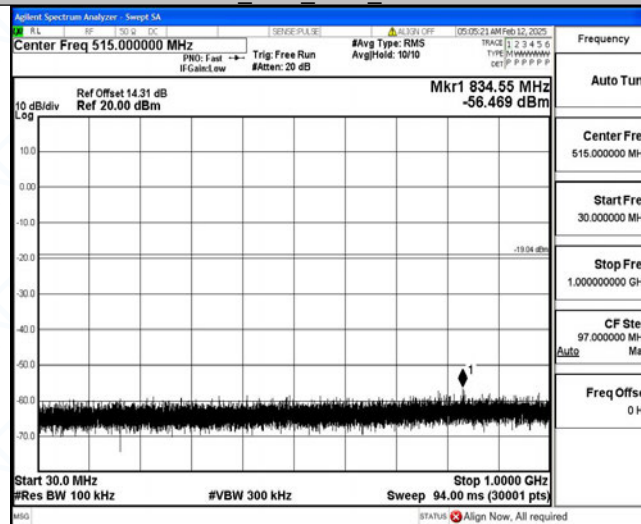


DH5_Ant1_2441_1000~26500

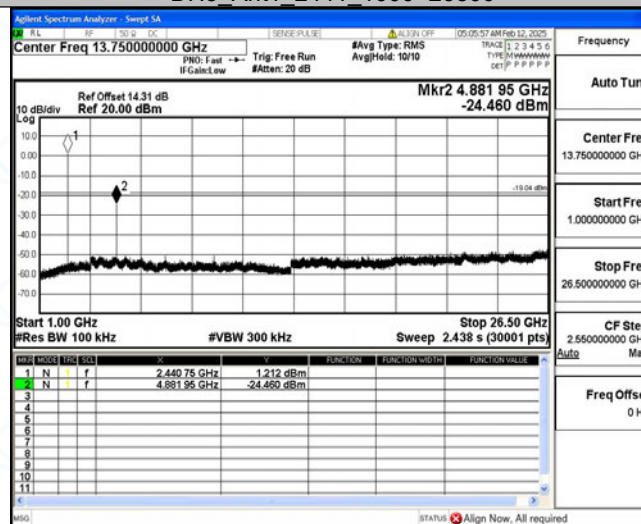


DH5_Ant1_2480_0~Reference

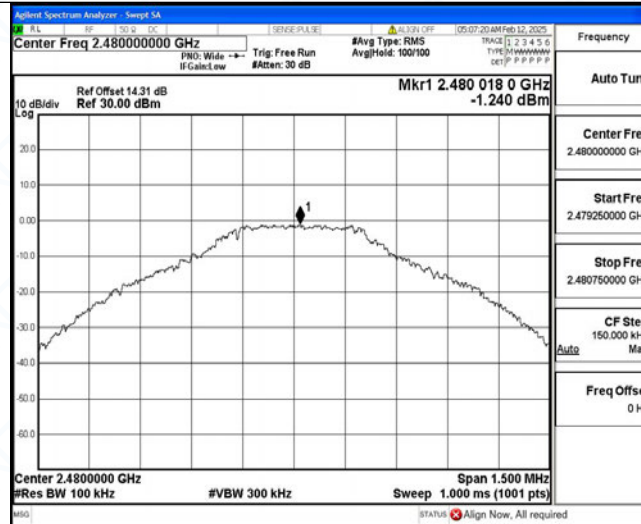


DH5_Ant1_2480_30~1000

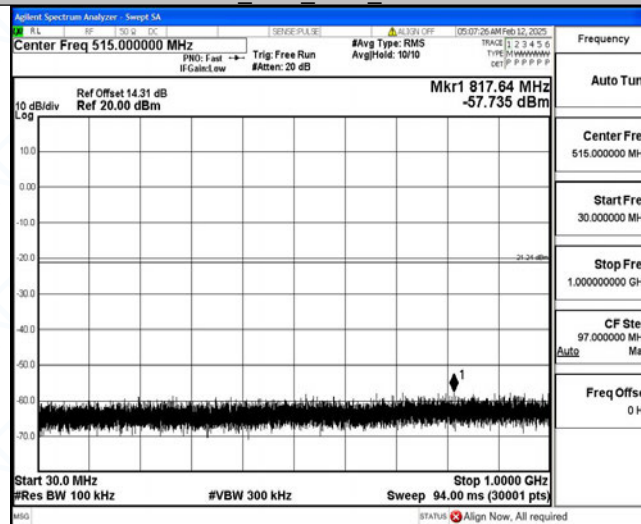


DH5_Ant1_2480_1000~26500

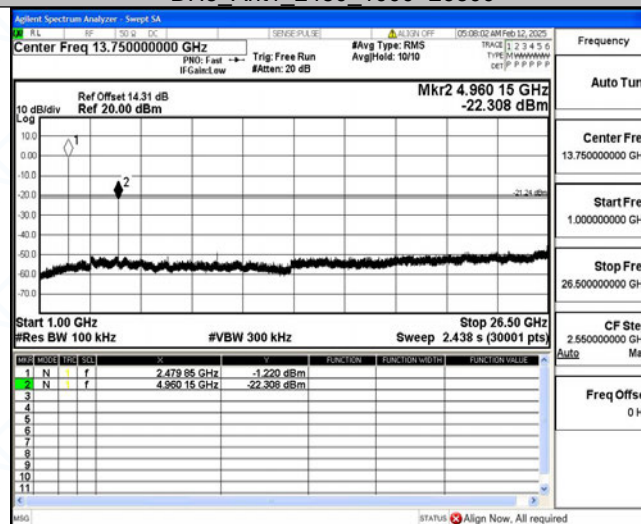


2DH5_Ant1_2402_0~Reference

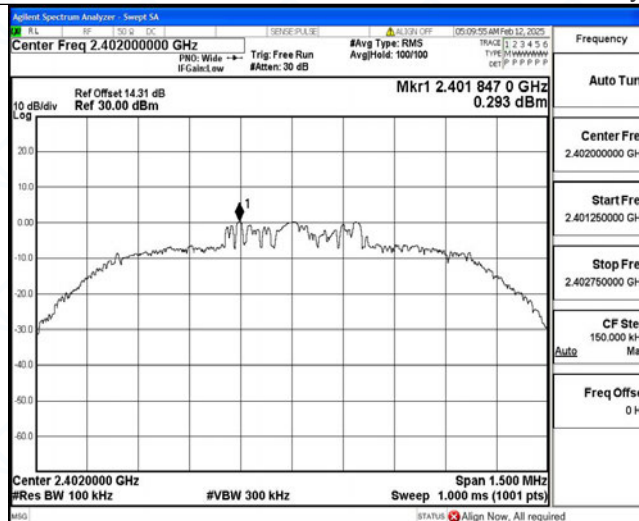


2DH5_Ant1_2402_30~1000

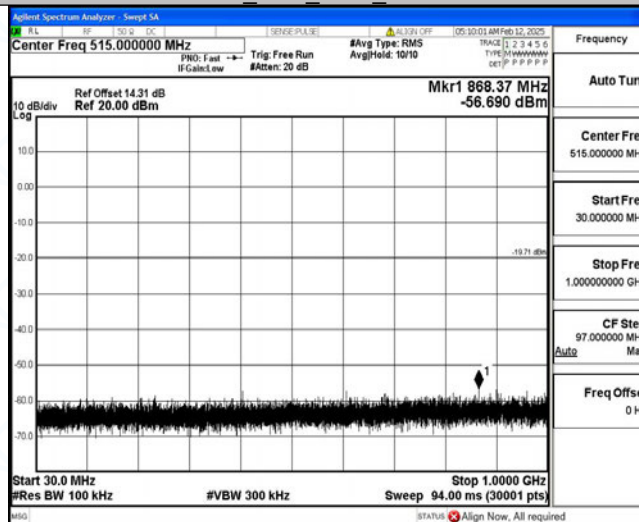


2DH5_Ant1_2402_1000~26500

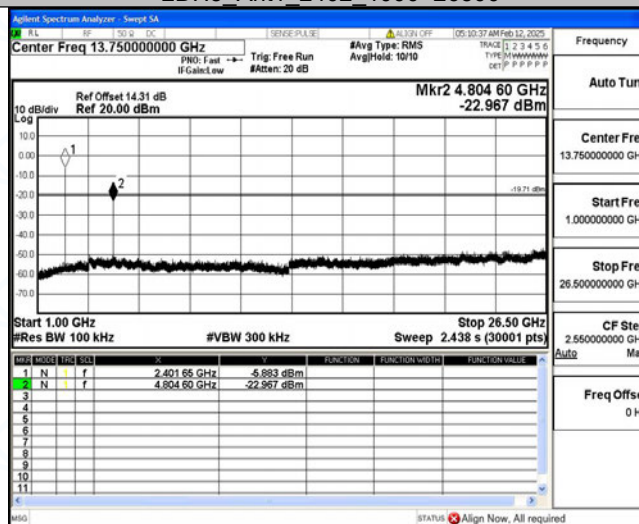


2DH5_Ant1_2441_0~Reference

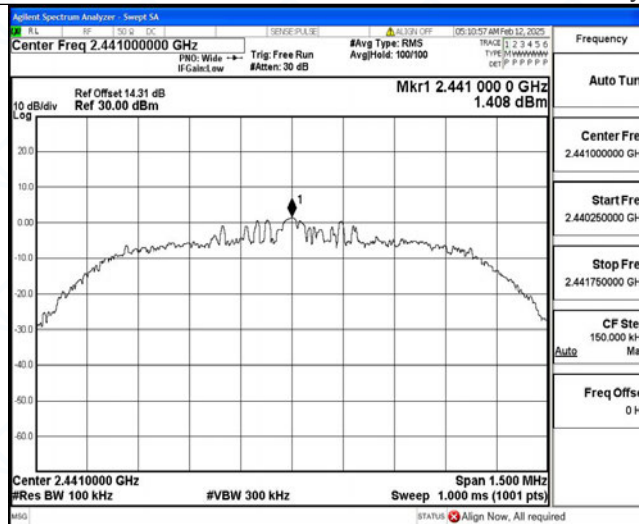


2DH5_Ant1_2441_30~1000

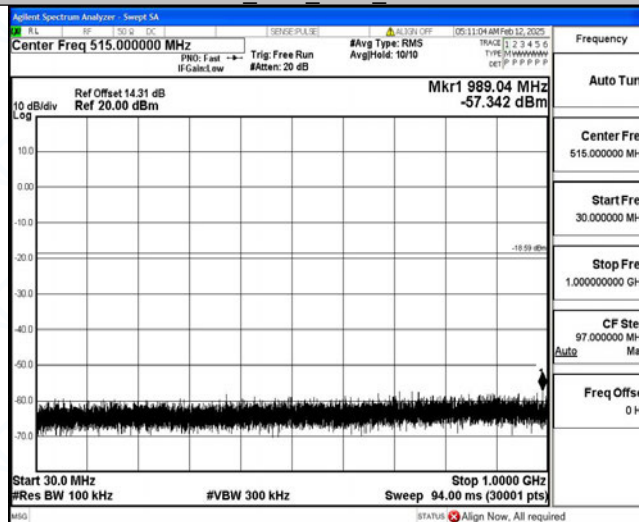


2DH5_Ant1_2441_1000~26500

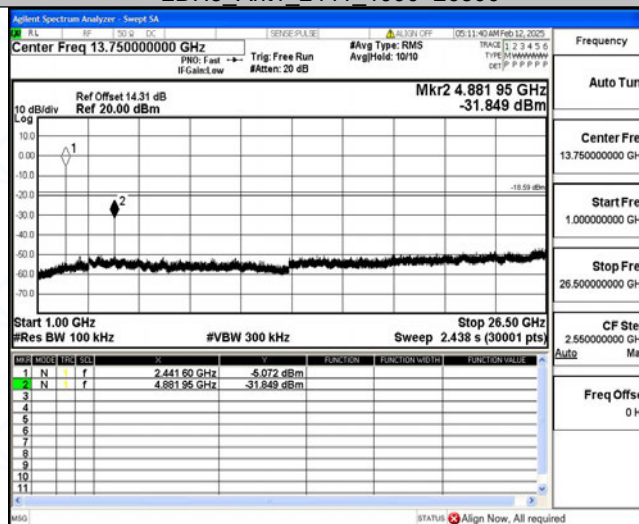


2DH5_Ant1_2480_0~Reference

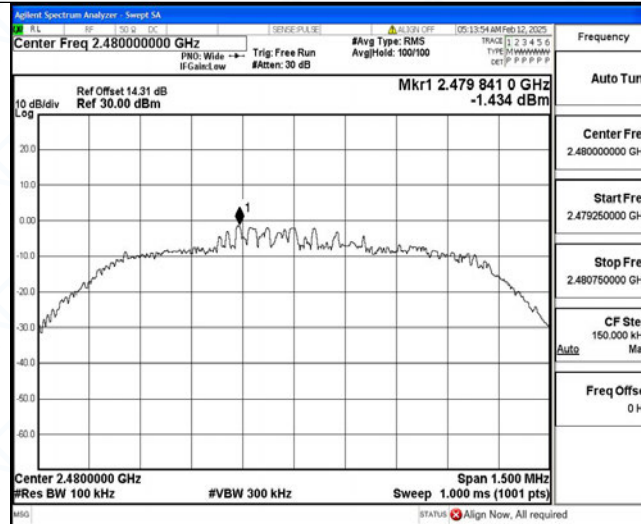


2DH5_Ant1_2480_30~1000

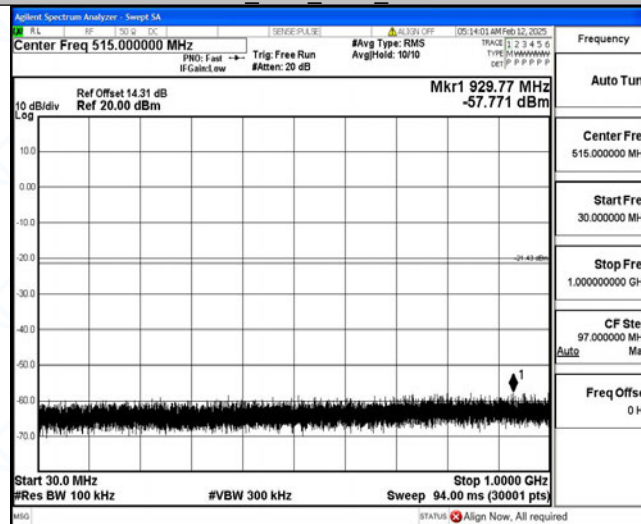


2DH5_Ant1_2480_1000~26500

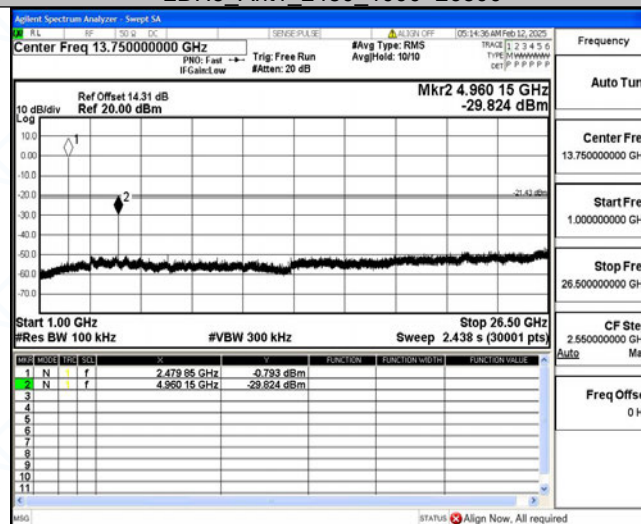


3DH5_Ant1_2402_0~Reference

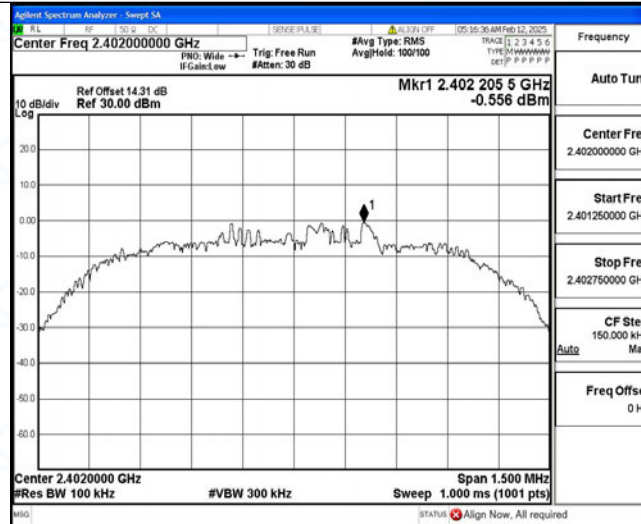


3DH5_Ant1_2402_30~1000

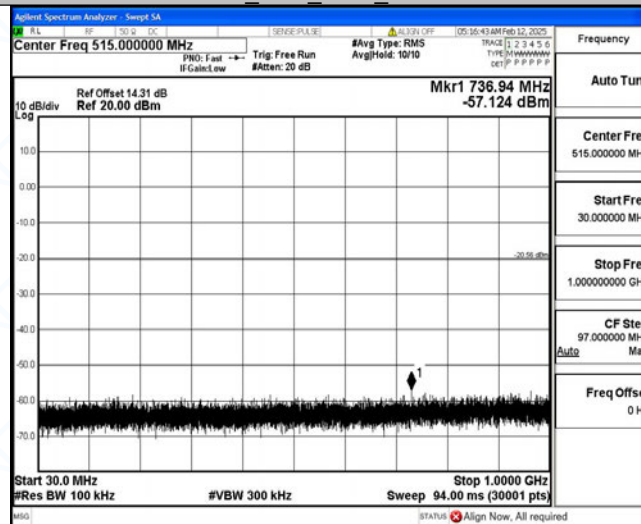


3DH5_Ant1_2402_1000~26500

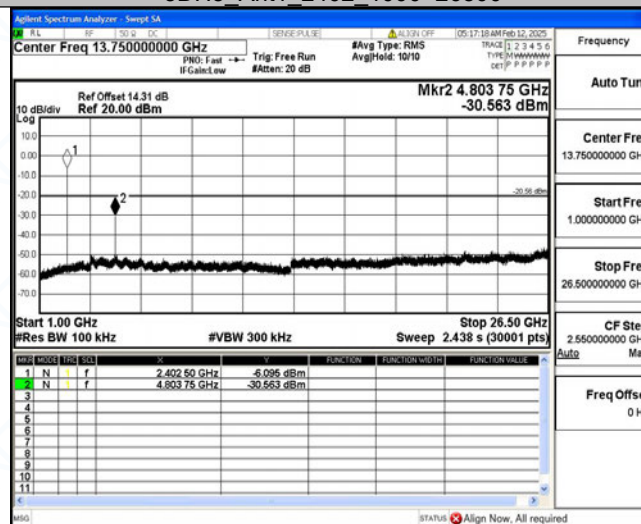


3DH5_Ant1_2441_0~Reference

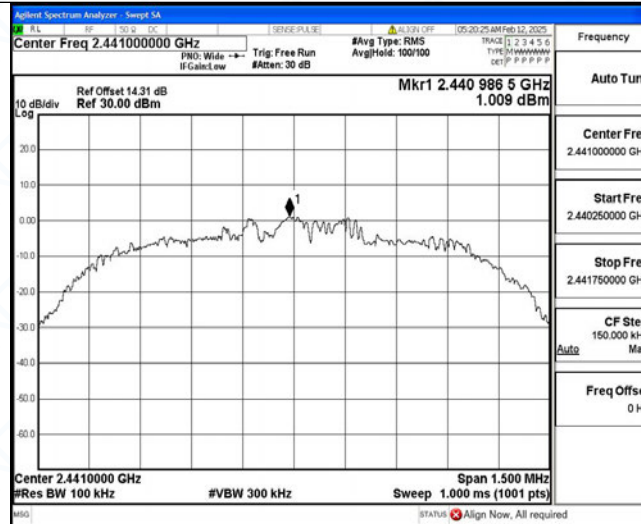


3DH5_Ant1_2441_30~1000

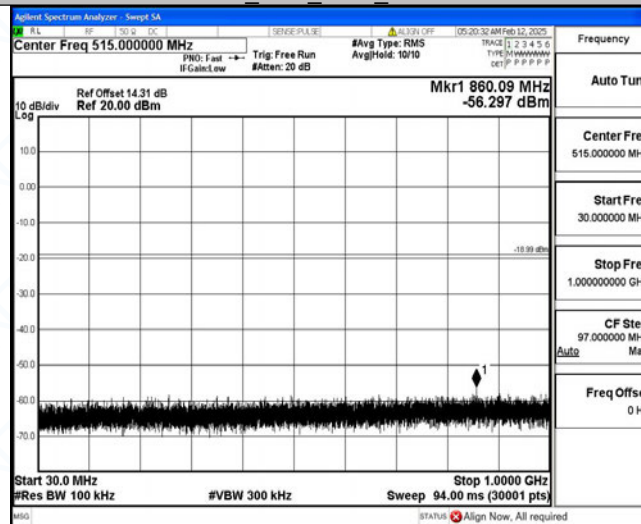


3DH5_Ant1_2441_1000~26500

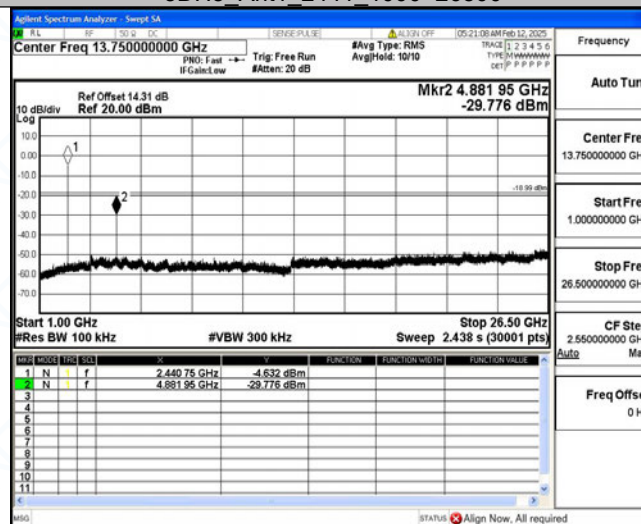


3DH5_Ant1_2480_0~Reference

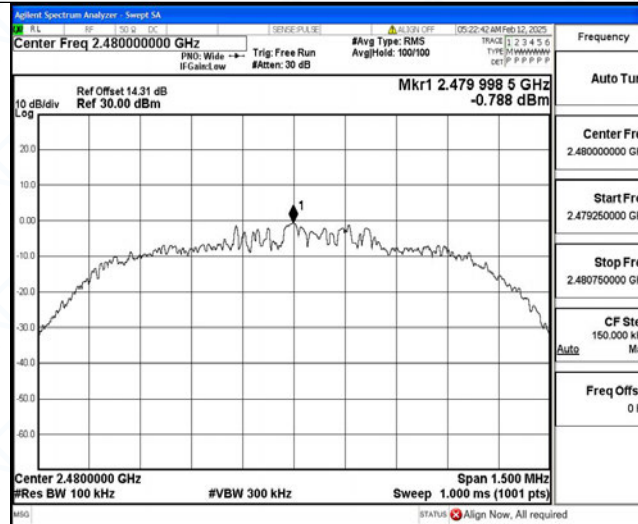

3DH5_Ant1_2480_30~1000

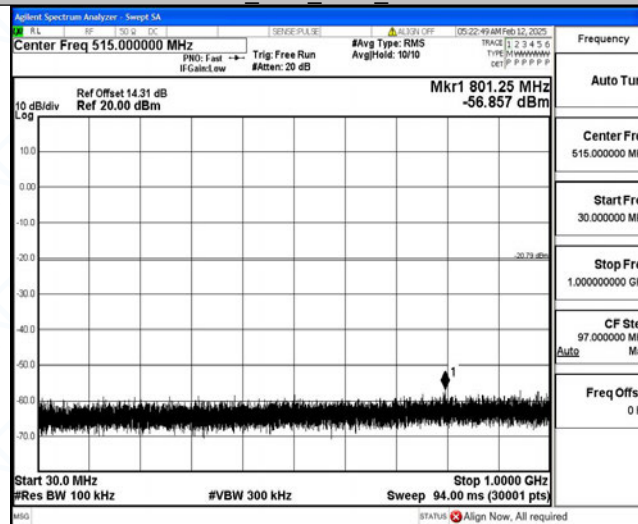

3DH5_Ant1_2480_1000~26500

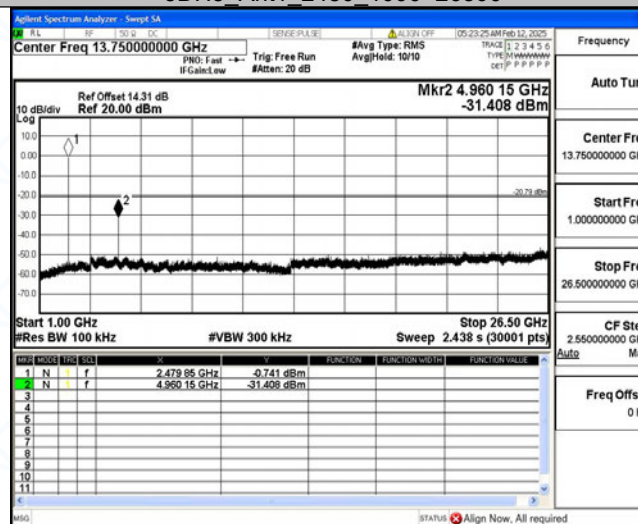

The End Report

Dongguan DN Testing Co., Ltd.

Add: No. 1, West Fourth Street, Xingfa South Road, Wusha Community, Chang 'an Town, Dongguan City, Guangdong P.R.China

Web: www.dn-testing.com

Tel: +86-769-88087383

E-mail: service@dn-testing.com