

849 NW State Road 45 Newberry, FL 32669 USA Phone: 352.472.5500 Fax: 352.472.2030

Email: info@timcoengr.com
Website: www.timcoengr.com

TEST REPORT

FCC PART 15

for

FCC ID: AZ489FT4931

Applicant	MOTOROLA SOLUTIONS, INC.		
Address	8000 WEST SUNRISE BLVD FT. LAUDERDALE FL 33322-9947 USA		
Model Number	CLP1040 w/BT60 Battery		
Product Description	450-470 MHz RADIO		
Date Sample Received	5/10/2016		
Date Tested	5/11/2016		
Tested By	Tim Royer		
Approved By	Cory Leverett		
Test Results	□ FAIL		

Report	Version	Description	Issue Date
Number	Number		
792BUT16TestReport	Rev1	Initial Issue	06/02/2016

THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.

GENERAL REMARKS	
SUMMARY OF TESTING RESULTS	3
GENERAL INFORMATION	4
EUT CABLES USED FOR TESTING	4
TEST INFORMATION	5
RESULTS SUMMARY	5
RADIATED SPURIOUS EMISSIONS	
30–200 MHZ PEAK PLOT	7
200-1000 MHZ PEAK PLOT	8
POWER LINE CONDUCTED INTERFERENCE	9
POWERLINE 1 PEAK PLOT	
POWERLINE 2 PEAK PLOT	
TEST EQUIPMENT LIST	13



GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

The test results only relate to the item tested.

SUMMARY OF TESTING RESULTS

The de	evice under test does:
\boxtimes	Fulfill the general approval requirements as identified in this test report and
	was selected by the customer.
	Not fulfill the general approval requirements as identified in this test report

ATTESTATIONS

This equipment was received without any visible damage and in good working order and has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025: 2005 requirements.

I attest that the necessary measurements were made at:

Timco Engineering Inc. 849 NW State Road 45 Newberry, FL 32669

Tested by:

Name and Title: Tim Royer Project Manager

Date: 5/18/2016

Reviewed and approved by:

Name and Title: Engineering Project Manager

Date: 06/02/2016

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 3 of 13



GENERAL INFORMATION

The test results relate only to the items tested.		
EUT Description	450-470 MHz RADIO	
FCC ID	AZ489FT4931	
Model Number	CLP1040 w/BT60 Battery	
Receiver Range	450-470 MHz	
Lowest Internal Frequency	131kHz	
Highest Tuned Frequency	16.8MHz	
I/O Port Type	Audio phono Jack USB Mini	
	☐ 110-120Vac/50- 60Hz	
EUT Power Source	12.6 VDC Nominal	
	□ Battery Operated Exclusively	
	☐ Prototype	
Test Item	☐ Pre-Production	
Environmental	Temperature: 24-26°C	
Condition in the	Relative humidity: 50-65%	
laboratory	Barometric Pressure: 30.01 in	

EUT CABLES USED FOR TESTING

Description	Type	Connector	Length
Headphone	Unshielded	Phono	1m
Motorola HKKN4027A USB Programming Cable	Shielded	Mini USB-A to Mini USB-B	1m

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 4 of 13



TEST INFORMATION

Regulatory Standard	CFR Title 47 FCC Rule part 15B § 15.109, 15.107
Test Procedures	FCC Part 15.31, 15.33, 15.35 ANSI C63.4 – 2014
Operational Modes	Receive Mode
Setup	The EUT was configured as a computer peripheral through a supplied Motorola P/N: HKKN4027A USB cable, the setup used was a tabletop arrangement for IT equipment as specified in the standard
Modifications required for Testing	None
Deviation from the standard/procedure	No deviation
Host PC Model	Microsoft Surface

RESULTS SUMMARY

Requirement				RESULTS
45 400 B. II. I.	Frequency MHz	Level (dBuV/m)		Pass/Fail
15.109 Radiated	30 – 88	40	0.0	Pass
Emissions	80 – 216	43	3.0	Pass
	216 – 960	46.0		Pass
	Above 960	54.0		Pass
15.107 AC	Frequency MHz	Quasi Peak Limits (dBµV)	Average Limits (dBµV)	
Powerline	0.15 - 0.5	66 – 56	56 – 46 *	Pass
Conducted	0.5 - 5.0	56	46	Pass
	5.0 – 30	60	50	Pass

Decrease with logarithm of frequency

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 5 of 13



RADIATED SPURIOUS EMISSIONS

Rule Part No.: FCC Part 15 Subpart B

Requirements: FCC Part 15.109(a) Radiated Emission Limit

Class B Field Strength Limits @ 3 Meters			
Frequency Level (MHz) (dBuV/m)			
30 – 88	40.0		
80 – 216	43.5		
216 – 960	46.0		
Above 960	54.0		

Procedure: FCC Part 15.33(b)(1) Frequency range of radiated measurements

FCC Part 15.35(a) Measurement detector functions and bandwidths

ANSI C63.4 Methods of Measurement of Radio-Noise Emissions from Low-Voltage Electrical and Electronic Equipment 9 kHz to 40 GHz

§ 11.2 Operating conditions

§ 11.3 Peripherals / Accessories

§ 11.5 Tabletop equipment arrangement § 11.9 Radiated emission measurements

Configuration: The EUT is configured as a computer peripheral through a USB cable

connected to a partially configured host PC. A firmware update to the EUT was used to transfer data between the EUT and the host PC.

TABLE OF CONTENTS

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 6 of 13



RADIATED SPURIOUS EMISSIONS



Ant Polarity: T1 (Green) = Vertical, T2 (Red) = Horizontal

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 7 of 13



RADIATED SPURIOUS EMISSIONS



Ant Polarity: T1 (Green) = Vertical, T2 (Red) = Horizontal

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 8 of 13



POWER LINE CONDUCTED INTERFERENCE

Rules Part No.: FCC Subpart B

Requirements: FCC 15.107 (a) Conducted Limits

Frequency (MHz)	Quasi Peak Limits (dBµV)	Average Limits (dBµV)	
0.15 - 0.5	66 – 56 *	56 – 46 *	
0.5 - 5.0	56	46	
5.0 – 30	60	50	
* Decrease with logarithm of frequency			

Procedure: ANSI C63.4 Methods of Measurement of Radio-Noise Emissions from

Low-Voltage Electrical and Electronic Equipment 9 kHz to 40 GHz

§ 11.2 Operating conditions § 11.3 Peripherals / Accessories

§ 11.5 Tabletop equipment arrangement

§ 11.8 AC power-line conducted emission measurements

Configuration: The EUT is configured as a computer peripheral through a USB cable

connected to a partially configured host PC. A firmware update to the

EUT was used to transfer data between the EUT and the host PC

Setup:

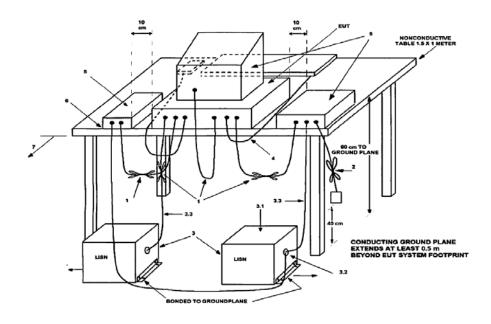


TABLE OF CONTENTS


Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 9 of 13



POWER LINE CONDUCTED INTERFERENCE

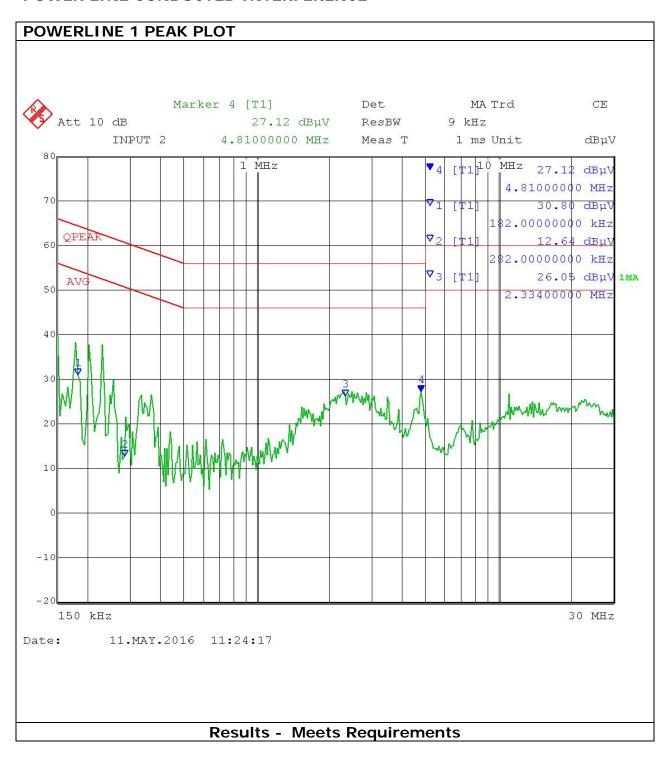


Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 10 of 13



POWER LINE CONDUCTED INTERFERENCE

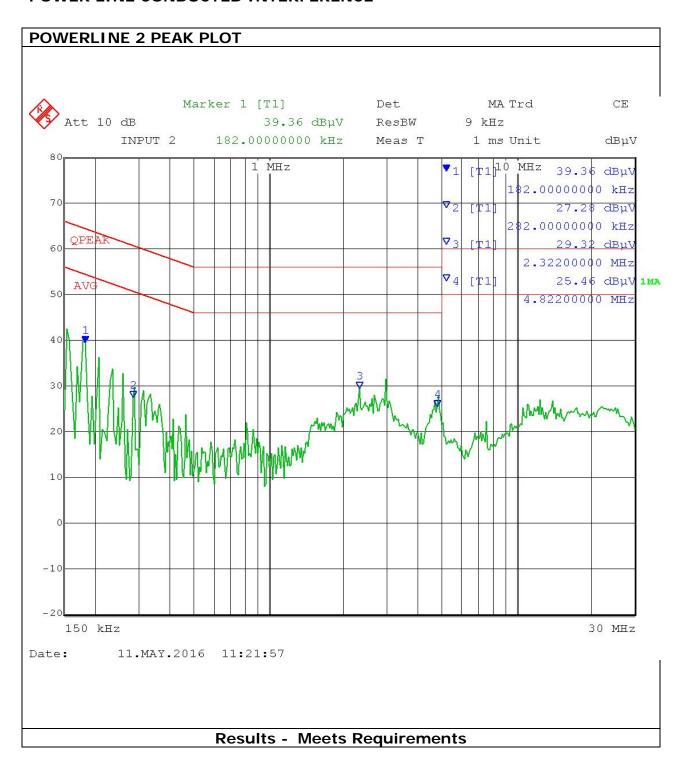

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 11 of 13



UNCERTAINTY TABLE

State of the measurement uncertainty

The data and results referenced in this document are true and accurate. The measurement uncertainty was calculated for all measurements listed in this test report according To CISPR 16 – 4 or ENTR 100-028 Specification for radio disturbance and immunity measuring apparatus and methods – Part 4: "Uncertainty in EMC Measurements" and is documented in the Timco Engineering, Inc. quality system according to DIN EN ISO/IEC 17025. Furthermore, component and process variability of devices similar to that tested may result in additional deviation. The manufacturer has the sole responsibility of continued compliance of the device. Hereafter the best measurement capability for Timco Engineering, Inc. is reported:

Test Items	Measurement Uncertainty	Notes
Radiated Emissions to 6.0GHz	± 4.4dB	(1)
Power line conducted emissions	± 3.9dB	(1)

(1) This uncertainty represents an expanded uncertainty expressed at approximately the 95% confidence level using a coverage factor of k=1.96.

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 12 of 13



TEST EQUIPMENT LIST

Device	Manufacturer	Model	Serial Number	Cal/Char	Due Date
		0.1.155.1		Date	07/11/17
Antenna:	Eaton	94455-1	1096	07/14/15	07/14/17
Biconnical 1096					
Antenna: Log-	Electro-Metrics	LPA-25	1122	07/14/15	07/14/17
Periodic 1122					
LISN (Primary)	Electro-Metrics	EM-7820	2682	05/08/15	05/08/17
CHAMBER	Panashield	3M	N/A	01/05/16	12/31/17
Antenna:	ETS-Lindgren	3117	00041534	02/25/15	02/25/17
Double-Ridged	Chamber				
Horn/ETS Horn					
2					
EMI Test	Rohde &	ESIB 40	100274	08/12/14	08/12/16
Receiver R & S	Schwarz				
ESIB 40 Screen					
Room					
Software: Field	Timco	N/A	Version	N/A	N/A
Strength			4.0		
Program					
EMI Test	Rohde &	ESU 40	100320	04/01/16	04/01/18
Receiver R & S	Schwarz				
ESU 40					
Chamber					
Coaxial Cable	TIMCO LISN	17		01/05/16	01/04/17
for LISN					
Coaxial Cable -	Micro-Coax		Chamber 3	12/05/15	12/05/17
Chamber 3			cable set		
cable set			(Primary).		
(Primary)					

*EMI RECEIVER SOFTWARE VERSION

The receiver firmware used was version 4.43 Service Pack 3

END OF TEST REPORT

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792BUT16TestReport_Rev1 Page 13 of 13