

849 NW State Road 45 Newberry, FL 32669 USA Phone: 352.472.5500

Fax: 352.472.2030

Email: info@timcoengr.com
Website: www.timcoengr.com

TEST REPORT

FCC PART 15

for

FCC ID: AZ489FT4931

| Applicant | MOTOROLA SOLUTIONS, INC. | |
|--|--|--|
| Address | 8000 WEST SUNRISE BLVD FT. LAUDERDALE FL 33322-9947 USA | |
| , and the second | FI. LAUDERDALE FL 33322-9947 USA | |
| Model Number | CLP1040 w/ BT90 | |
| Product Description | 450-470 MHz RADIO | |
| Date Sample Received | 5/10/2016 | |
| Date Tested | 5/11/2016 | |
| Tested By | Tim Royer | |
| Approved By | Cory Leverett | |
| Test Results | □ FAIL | |

| Report | Version | Description | Issue Date |
|--------------------|---------|---------------|------------|
| Number | Number | | |
| 792CUT16TestReport | Rev1 | Initial Issue | 06/02/2016 |

THE ATTACHED REPORT SHALL NOT BE REPRODUCED EXCEPT IN FULL WITHOUT THE WRITTEN APPROVAL OF TIMCO ENGINEERING, INC.

TABLE OF CONTENTS

| GENERAL REMARKS | |
|-----------------------------------|----|
| SUMMARY OF TESTING RESULTS | 3 |
| GENERAL INFORMATION | 4 |
| EUT CABLES USED FOR TESTING | |
| TEST INFORMATION | |
| RESULTS SUMMARY | |
| RADIATED SPURIOUS EMISSIONS | |
| 30–200 MHZ PEAK PLOT | |
| 200-1000 MHZ PEAK PLOT | |
| POWER LINE CONDUCTED INTERFERENCE | |
| POWERLINE 1 PEAK PLOT | |
| POWERLINE 2 PEAK PLOT | |
| TEST EQUIPMENT LIST | 13 |
| | |



GENERAL REMARKS

The attached report shall not be reproduced except in full without the written permission of Timco Engineering Inc.

The test results only relate to the item tested.

SUMMARY OF TESTING RESULTS

The device under test does:

Fulfill the general approval requirements as identified in this test report and was selected by the customer.

Not fulfill the general approval requirements as identified in this test report

ATTESTATIONS

This equipment was received without any visible damage and in good working order and has been tested in accordance with the standards identified in this test report. To the best of my knowledge and belief, these tests were performed using the measurement procedures described in this report.

All instrumentation and accessories used to test products for compliance to the indicated standards are calibrated regularly in accordance with ISO 17025: 2005 requirements.

I attest that the necessary measurements were made at:

Timco Engineering Inc. 849 NW State Road 45 Newberry, FL 32669

Tested by:

Name and Title: Tim Royer Project Manager

Date: 5/18/2016

Reviewed and approved by:

Name and Title: Cory Leverett, Engineering

Date: 6/2/2016

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 3 of 13



GENERAL INFORMATION

| The test results relate only to the items tested. | | |
|---|-----------------------------------|--|
| EUT Description | 450-470 MHz RADIO | |
| FCC ID | AZ489FT4931 | |
| Model Number | CLP1040 | |
| Receiver Range | 450-470 MHz | |
| Lowest Internal Frequency | 131kHz | |
| Highest Tuned Frequency | 16.8MHz | |
| I/O Port Type | Audio phono Jack USB Mini port | |
| Battery | BT90 | |
| | ☐ 110-120Vac/50- 60Hz | |
| EUT Power Source | 12.6 VDC Nominal | |
| | □ Battery Operated Exclusively | |
| | ☐ Prototype | |
| Test Item | ☐ Pre-Production | |
| | | |
| Environmental | Temperature: 24-26°C | |
| Condition in the | Relative humidity: 50-65% | |
| laboratory | Barometric Pressure: 30.01 in | |

EUT CABLES USED FOR TESTING

| Description | Type | Connector | Length |
|--|--------------|-----------------------------|--------|
| Motorola HKKN4027A USB Programming cable | Shielded USB | Mini USB-A to Mini USB-B | 1m |

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 4 of 13



TEST INFORMATION

| Regulatory Standard | CFR Title 47 FCC Rule part 15B § 15.109, 15.107 |
|---------------------------------------|---|
| Test Procedures | FCC Part 15.31, 15.33, 15.35 ANSI C63.4 – 2014 |
| Operational Modes | EUT was placed in a charging cradle and continually communicated with via laptop connection. |
| Setup | The EUT was configured as a computer peripheral through a supplied Motorola P/N: HKKN4027A USB programming cable, the setup used was a tabletop arrangement for IT equipment as specified in the standard |
| Modifications required for Testing | None |
| Deviation from the standard/procedure | No deviation |
| Host PC Model | Microsoft Surface |

RESULTS SUMMARY

| Requirement | | | | RESULTS |
|------------------|------------------|--------------------------------|-----------------------------|-----------|
| 45 400 B. II. I. | Frequency MHz | Level (dBuV/m) | | Pass/Fail |
| 15.109 Radiated | 30 – 88 | 40.0 | | Pass |
| Emissions | 80 – 216 | 43 | 3.0 | Pass |
| | 216 – 960 | 46.0 | | Pass |
| | Above 960 | 54.0 | | Pass |
| 15.107 AC | Frequency MHz | Quasi Peak Limits (dBµV) | Average Limits (dBµV) | |
| Powerline | 0.15 - 0.5 | 66 – 56 | 56 – 46 * | Pass |
| Conducted | 0.5 - 5.0 | 56 | 46 | Pass |
| | 5.0 – 30 | 60 | 50 | Pass |

Decrease with logarithm of frequency

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 5 of 13



RADIATED SPURIOUS EMISSIONS

Rule Part No.: FCC Part 15 Subpart B

Requirements: FCC Part 15.109(a) Radiated Emission Limit

| Class B Field Strength Limits @ 3 Meters | | |
|--|-------------------|--|
| Frequency (MHz) | Level (dBuV/m) | |
| 30 – 88 | 40.0 | |
| 80 – 216 | 43.5 | |
| 216 – 960 | 46.0 | |
| Above 960 | 54.0 | |

Procedure: FCC Part 15.33(b)(1) Frequency range of radiated measurements

FCC Part 15.35(a) Measurement detector functions and bandwidths

ANSI C63.4 Methods of Measurement of Radio-Noise Emissions from Low-Voltage Electrical and Electronic Equipment 9 kHz to 40 GHz

§ 11.2 Operating conditions

§ 11.3 Peripherals / Accessories

§ 11.5 Tabletop equipment arrangement § 11.9 Radiated emission measurements

Configuration: The EUT is configured as a computer peripheral through a USB cable

connected to a partially configured host PC. A firmware update to the EUT was used to transfer data between the EUT and the host PC.

TABLE OF CONTENTS

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 6 of 13



RADIATED SPURIOUS EMISSIONS



Ant Polarity: T1 (Green) = Vertical, T2 (Red) = Horizontal


Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 7 of 13



RADIATED SPURIOUS EMISSIONS

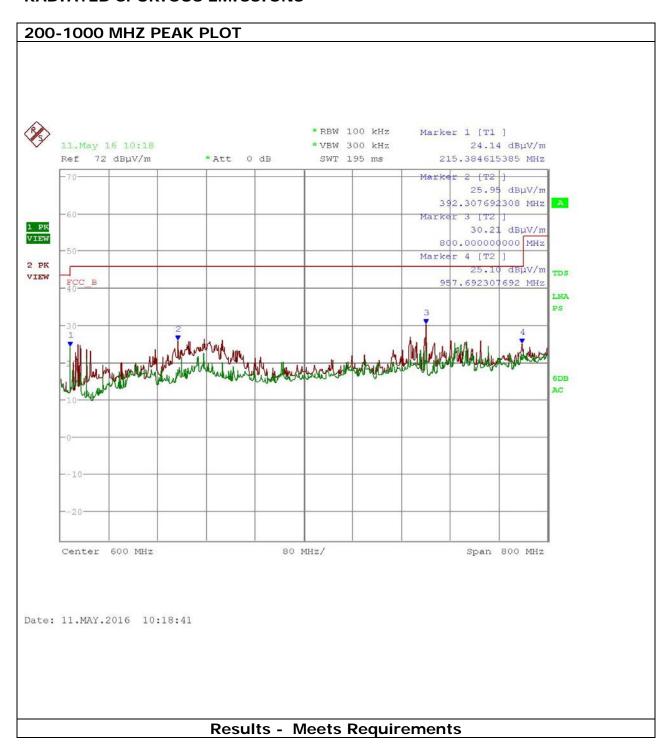

Ant Polarity: T1 (Green) = Vertical, T2 (Red) = Horizontal

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 8 of 13



POWER LINE CONDUCTED INTERFERENCE

Rules Part No.: FCC Subpart B

Requirements: FCC 15.107 (a) Conducted Limits

| Frequency (MHz) | Quasi Peak Limits (dBµV) | Average Limits (dBµV) | |
|--|-----------------------------|--------------------------|--|
| 0.15 - 0.5 | 66 – 56 * | 56 – 46 * | |
| 0.5 - 5.0 | 56 | 46 | |
| 5.0 – 30 | 60 | 50 | |
| * Decrease with logarithm of frequency | | | |

Procedure: ANSI C63.4 Methods of Measurement of Radio-Noise Emissions from

Low-Voltage Electrical and Electronic Equipment 9 kHz to 40 GHz

§ 11.2 Operating conditions § 11.3 Peripherals / Accessories

§ 11.5 Tabletop equipment arrangement

§ 11.8 AC power-line conducted emission measurements

Configuration: The EUT is configured as a computer peripheral through a USB cable

connected to a partially configured host PC. A firmware update to the

EUT was used to transfer data between the EUT and the host PC

Setup:

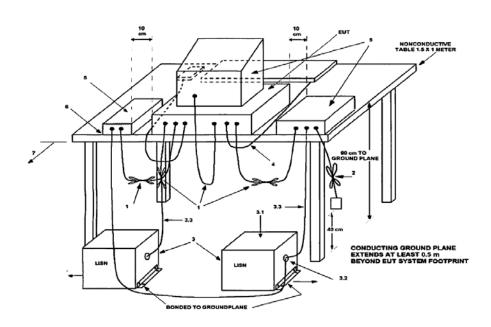


TABLE OF CONTENTS


Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 9 of 13



POWER LINE CONDUCTED INTERFERENCE

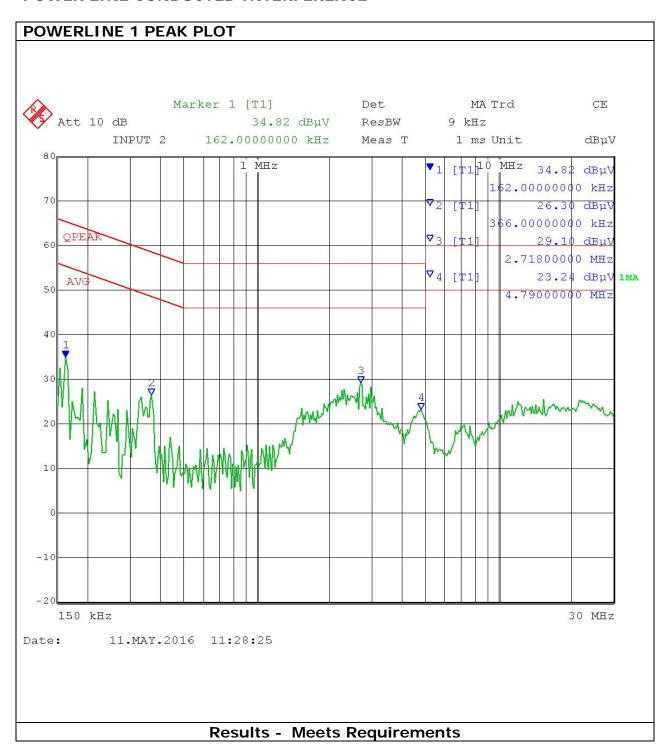

Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 10 of 13



POWER LINE CONDUCTED INTERFERENCE



Applicant: MOTOROLA SOLUTIONS, INC. <u>TABLE OF CONTENTS</u>

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 11 of 13



TABLE OF CONTENTS

UNCERTAINTY TABLE

State of the measurement uncertainty

The data and results referenced in this document are true and accurate. The measurement uncertainty was calculated for all measurements listed in this test report according To CISPR 16 – 4 or ENTR 100-028 Specification for radio disturbance and immunity measuring apparatus and methods – Part 4: "Uncertainty in EMC Measurements" and is documented in the Timco Engineering, Inc. quality system according to DIN EN ISO/IEC 17025. Furthermore, component and process variability of devices similar to that tested may result in additional deviation. The manufacturer has the sole responsibility of continued compliance of the device. Hereafter the best measurement capability for Timco Engineering, Inc. is reported:

| Test Items | Measurement Uncertainty | Notes |
|--------------------------------|-------------------------|-------|
| Radiated Emissions to 6.0GHz | ± 4.4dB | (1) |
| Power line conducted emissions | ± 3.9dB | (1) |
| | | |

(1) This uncertainty represents an expanded uncertainty expressed at approximately the 95% confidence level using a coverage factor of k=1.96.

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 12 of 13



TABLE OF CONTENTS

TEST EQUIPMENT LIST

| Device | Manufacturer | Model | Serial Number | Cal/Char Date | Due Date |
|--|-------------------------|---------|------------------|------------------|----------|
| Antenna: | Eaton | 94455-1 | 1096 | 07/14/15 | 07/14/17 |
| Biconnical 1096 | | | | | |
| Antenna: Log- | Electro-Metrics | LPA-25 | 1122 | 07/14/15 | 07/14/17 |
| Periodic 1122 | | | | | |
| LISN (Primary) | Electro-Metrics | EM-7820 | 2682 | 05/08/15 | 05/08/17 |
| CHAMBER | Panashield | 3M | N/A | 01/05/16 | 12/31/17 |
| Antenna: Double-Ridged Horn/ETS Horn | ETS-Lindgren Chamber | 3117 | 00041534 | 02/25/15 | 02/25/17 |
| 2 | | | | | |
| EMI Test | Rohde & | ESIB 40 | 100274 | 08/12/14 | 08/12/16 |
| Receiver R & S | Schwarz | | | | |
| ESIB 40 Screen Room | | | | | |
| Software: Field Strength | Timco | N/A | Version 4.0 | N/A | N/A |
| Program | | | | | |
| EMI Test | Rohde & | ESU 40 | 100320 | 04/01/16 | 04/01/18 |
| Receiver R & S | Schwarz | | | | |
| ESU 40 | | | | | |
| Chamber | | | | | |
| Coaxial Cable for LISN | TIMCO LISN | 17 | | 01/05/16 | 01/04/17 |
| Coaxial Cable - | Micro-Coax | | Chamber 3 | 12/05/15 | 12/05/17 |
| Chamber 3 | | | cable set | | |
| cable set (Primary) | | | (Primary). | | |

*EMI RECEIVER SOFTWARE VERSION

The receiver firmware used was version 4.43 Service Pack 3

Applicant: MOTOROLA SOLUTIONS, INC.

FCC ID: AZ489FT4931

Report: 792CUT16TestReport_Rev1 Page 13 of 13