

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 1(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Annex A: Probe sensitivity and reference signal measurement plots

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 2(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

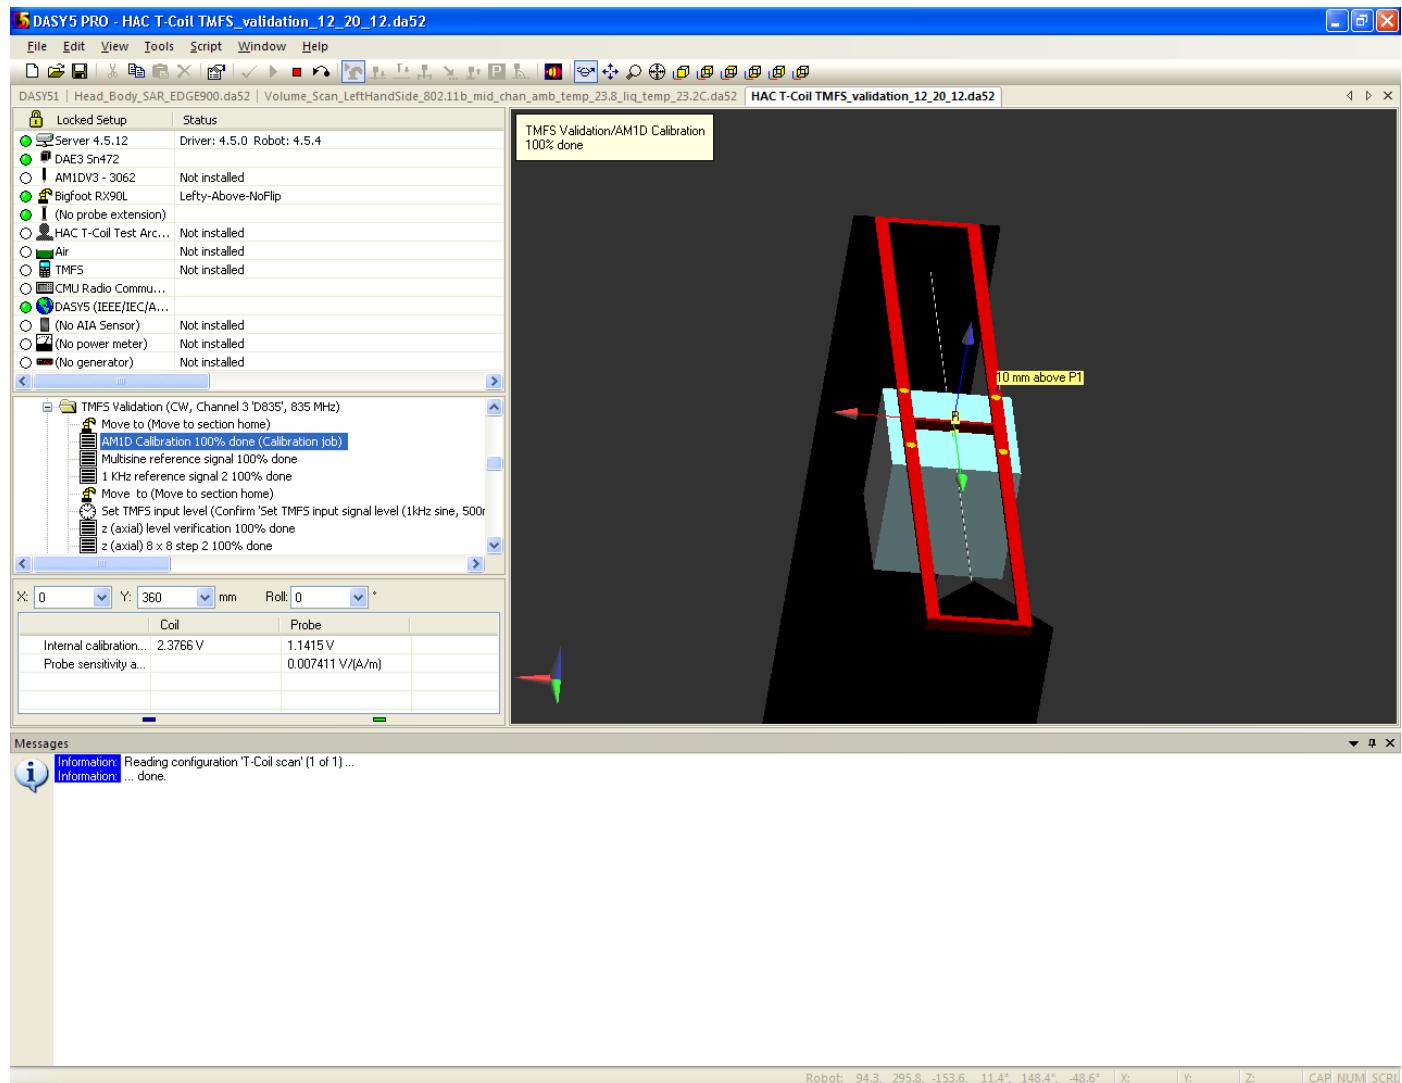


Figure A1: Probe calibration data for coil and probe



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

3(106)

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

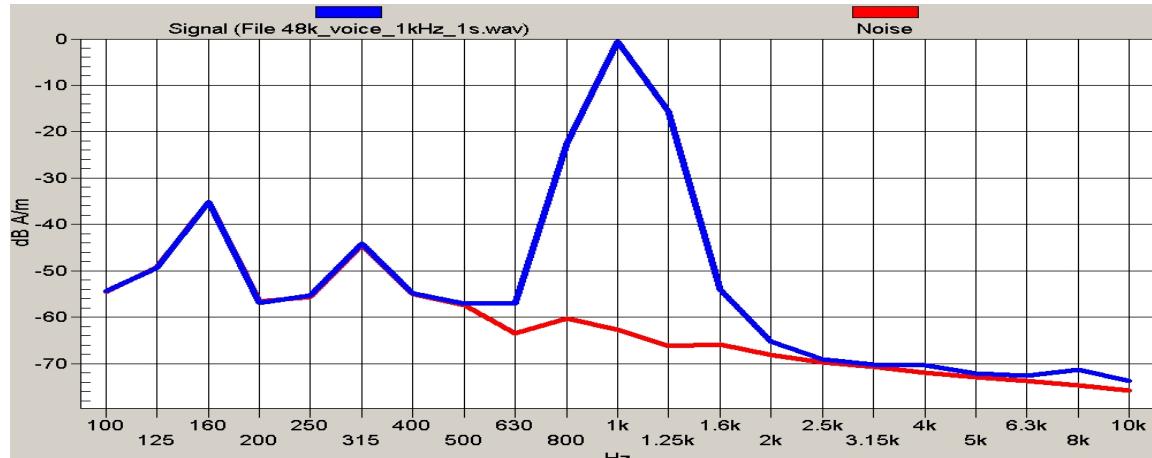
L6ARFL110LW**L6ARFP120LW**

Figure A2: Reference voice 1 kHz signal and noise

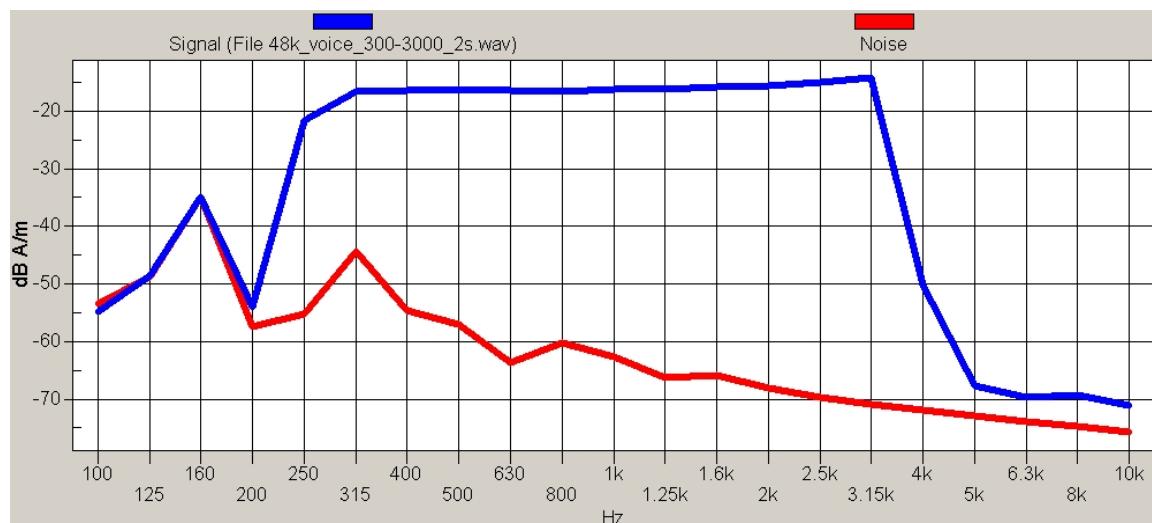


Figure A3: Reference voice simulated signal and noise

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 4(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Annex B: TMFS system validation and ambient data/plots

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 5(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 9:39:24 AM

Test Laboratory: RIM Testing Services

HAC T-Coil TMFS_validation_12_20_12

DUT: TMFS; Type: TMFS-1

Communication System: CW; Frequency: 835 MHz
Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA;
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan/Background Noise/z (axial) noise/ABM Noise Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 6(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

ABM = -56.01 dB A/m

Location: 0, 0, 13 mm

T-Coil scan/Background Noise/x (longitudinal) noise/ABM Noise

Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -56.00 dB A/m

Location: 0, 0, 13 mm

T-Coil scan/Background Noise/y (transversal) noise/ABM Noise

Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -56.05 dB A/m

Location: 0, 0, 13 mm

T-Coil scan/TMFS Validation/z (axial) 8 x 8 step 2/ABM Signal(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.003 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 7(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

ABM1 comp = -20.51 dB A/m

BWC Factor = 0.003 dB

Location: 0, 2, 3.7 mm

T-Coil scan/TMFS Validation/x (longitudinal) 52 x 16 step 4/ABM Signal(x,y,z) (14x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.003 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -25.91 dB A/m

BWC Factor = 0.003 dB

Location: -18, 0, 3.7 mm

T-Coil scan/TMFS Validation/y (transversal) 16 x 52 step 4/ABM Signal(x,y,z) (5x14x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.05

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.003 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -25.96 dB A/m

BWC Factor = 0.003 dB

Location: 0, -18, 3.7 mm

T-Coil scan/TMFS Validation/z (axial) at center 100% gain/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_multisine_50_10k_10s.wav

Output Gain: 87.2

Measure Window Start: 2000ms

Measure Window Length: 5000ms

BWC applied: 13.16 dB

Device Reference Point: 0, 0, -6.3 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

8(106)

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

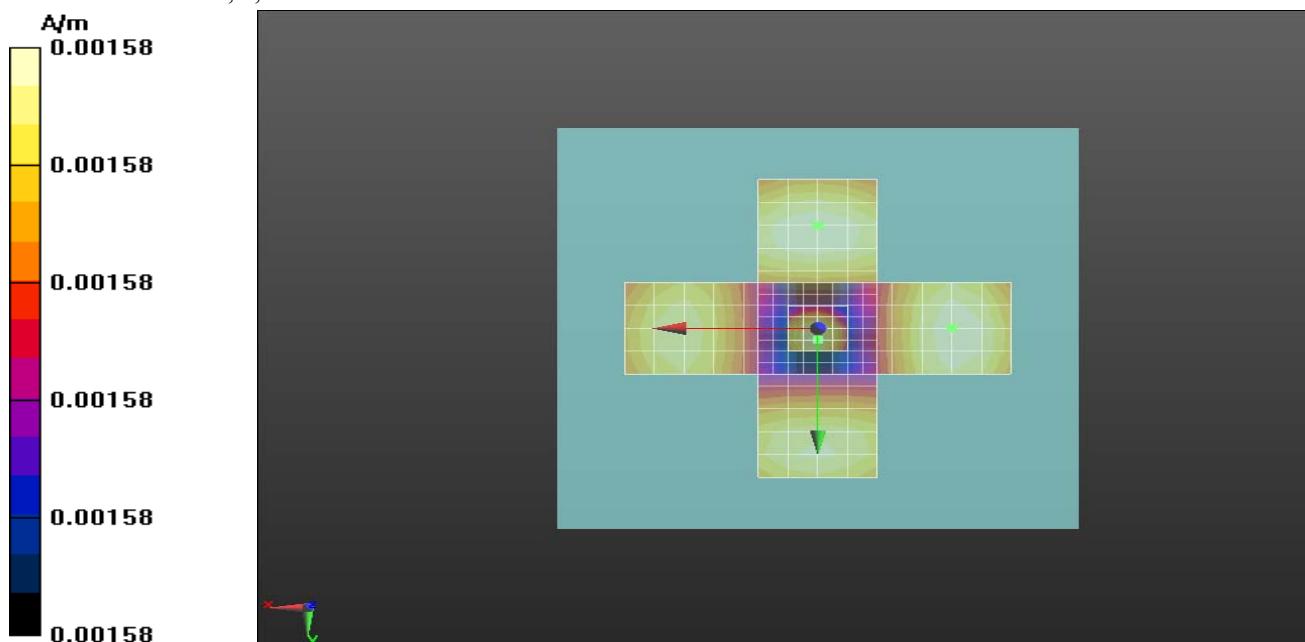
FCC ID

L6ARFL110LW**L6ARFP120LW****Cursor:**

Diff = 1.98 dB

BWC Factor = 13.16 dB

Location: 0, 0, 3.7 mm





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

9(106)

Author Data

Daoud Attayi

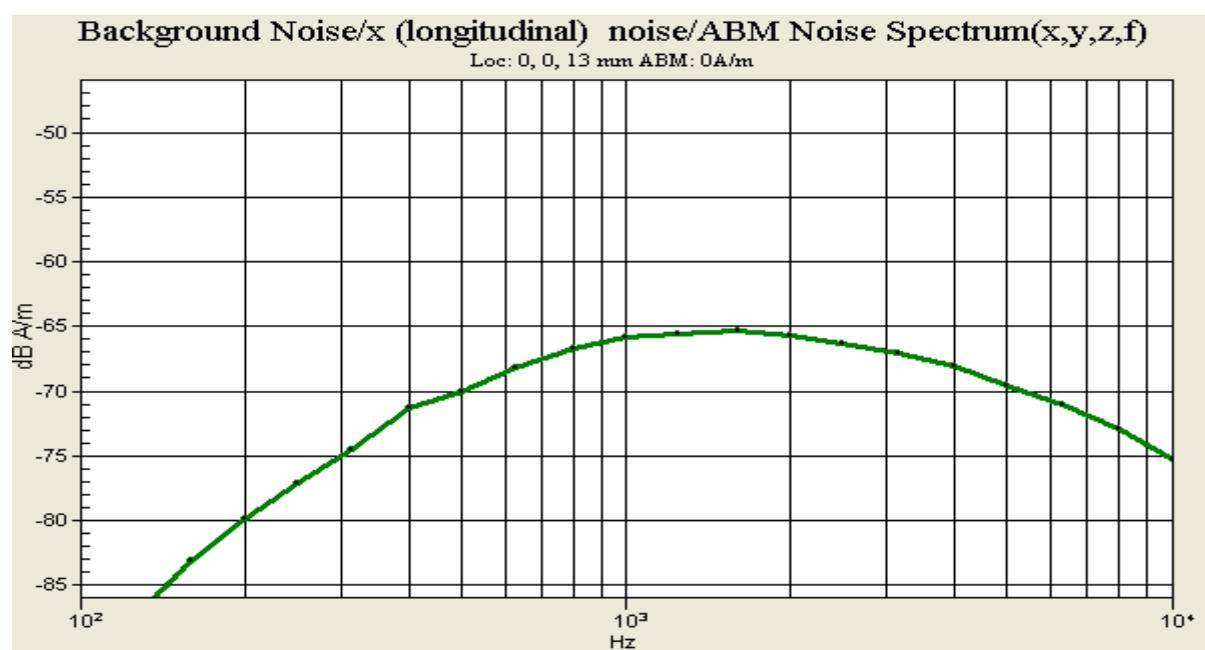
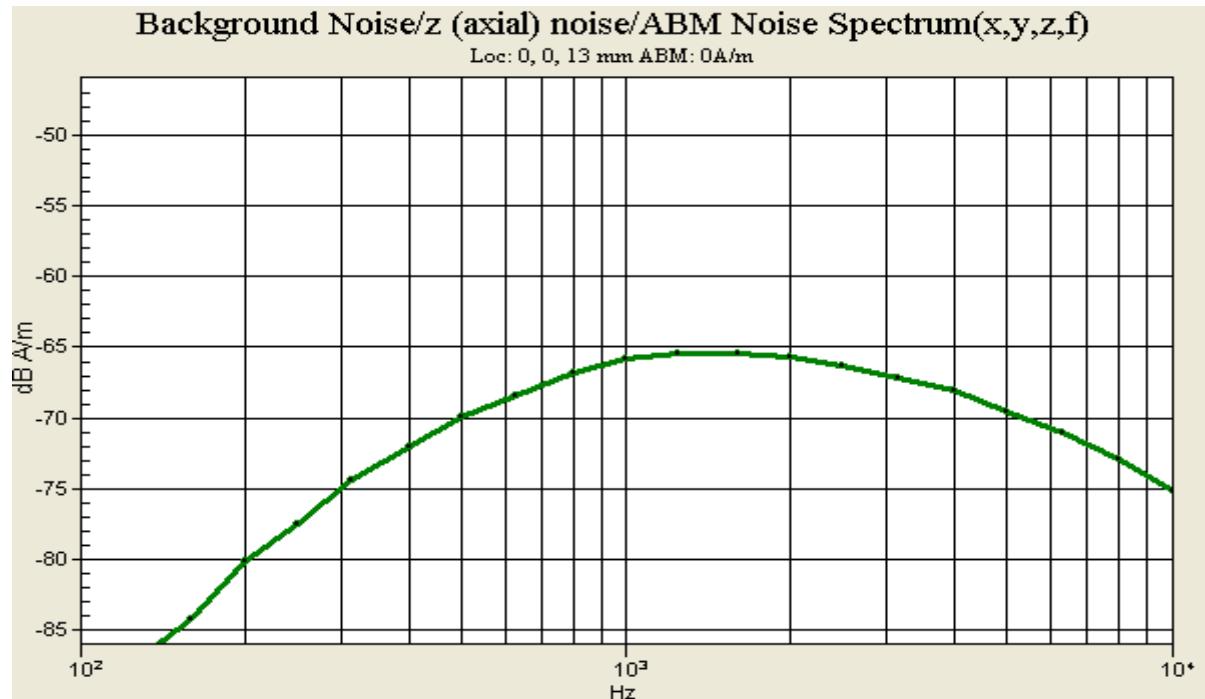
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

10(106)

Author Data

Daoud Attayi

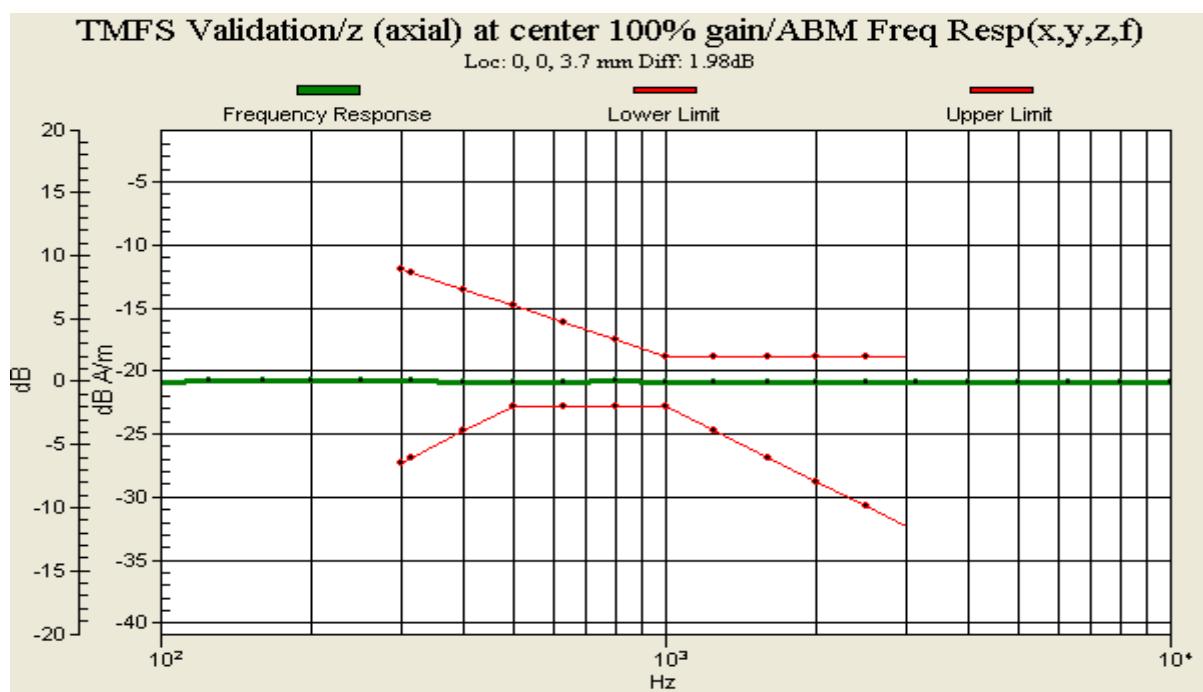
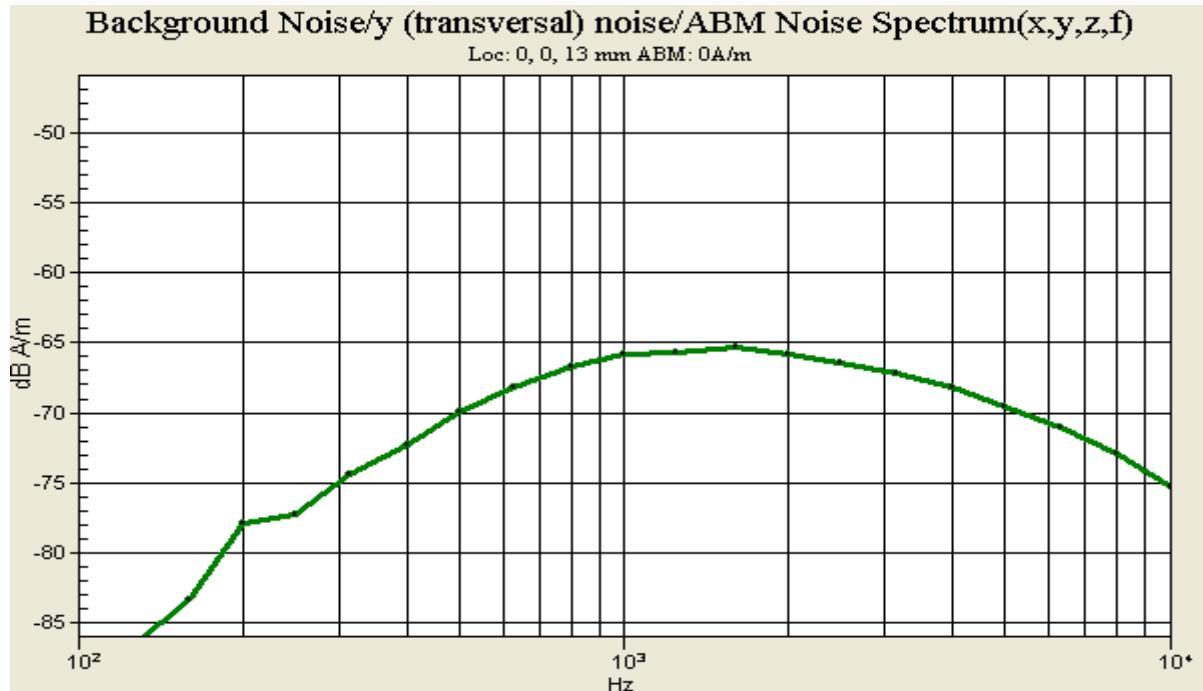
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 11(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 1/25/2013 9:41:30 AM

Test Laboratory: RIM Testing Services

HAC T-Coil TMFS_validation_01_25_13

DUT: TMFS; Type: TMFS-1

Communication System: CW; Communication System Band; Frequency: 835 MHz; Communication System Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/10/2013
 - Modulation Compensation:
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA;
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan/Background Noise/z (axial) noise/ABM Noise Spectrum(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 12(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

ABM = -56.04 dB/m

Location: 0, 0, 13 mm

T-Coil scan/Background Noise/x (longitudinal) noise/ABM Noise

Spectrum(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -56.06 dB/m

Location: 0, 0, 13 mm

T-Coil scan/Background Noise/y (transversal) noise/ABM Noise

Spectrum(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Off

Output Gain: 0

Measure Window Start: 2000ms

Measure Window Length: 5000ms

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM = -56.10 dB/m

Location: 0, 0, 13 mm

T-Coil scan/TMFS Validation/z (axial) 8 x 8 step 2/ABM Signal(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.01

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.0027 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 13(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

ABM1 comp = -20.70 dBA/m

BWC Factor = 0.0027 dB

Location: 0, 2, 3.7 mm

T-Coil scan/TMFS Validation/x (longitudinal) 52 x 16 step 4/ABM

Signal(x,y,z) (14x5x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.01

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.0027 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -26.17 dBA/m

BWC Factor = 0.0027 dB

Location: -22, 0, 3.7 mm

T-Coil scan/TMFS Validation/y (transversal) 16 x 52 step 4/ABM Signal(x,y,z)

(5x14x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: 1 kHz Sine

Output Gain: 35.01

Measure Window Start: 0ms

Measure Window Length: 1000ms

BWC applied: 0.0027 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1 comp = -26.19 dBA/m

BWC Factor = 0.0027 dB

Location: 0, -18, 3.7 mm

T-Coil scan/TMFS Validation/z (axial) at center 100% gain/ABM Freq

Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_multisine_50_10k_10s.wav

Output Gain: 87.2

Measure Window Start: 2000ms

Measure Window Length: 5000ms

BWC applied: 13.16 dB

Device Reference Point: 0, 0, -6.3 mm

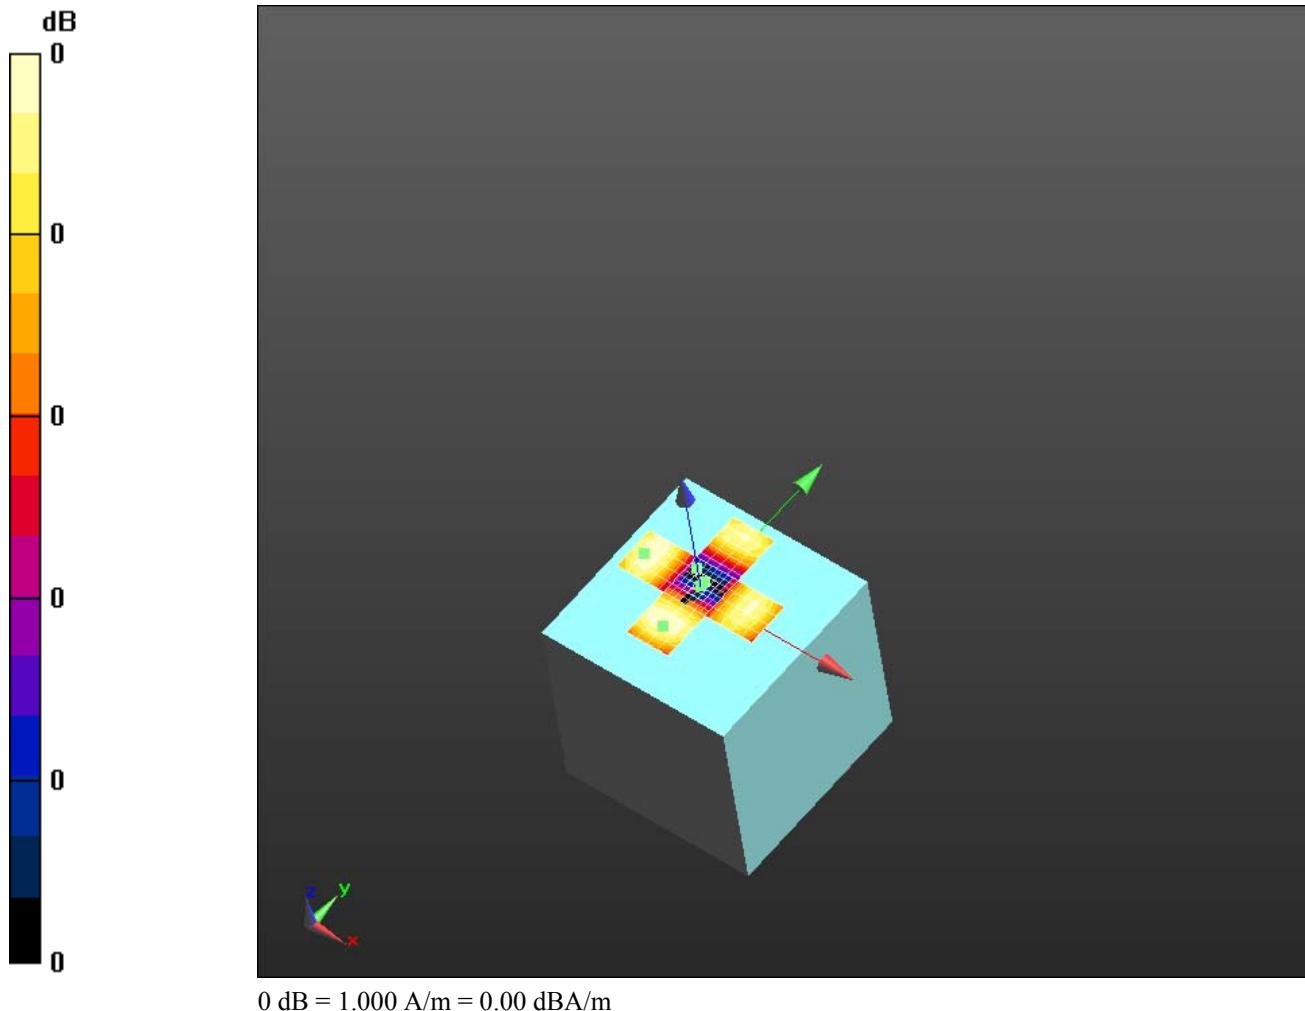
 RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 14(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

Diff = 1.99 dB

BWC Factor = 13.16 dB

Location: 0, 0, 3.7 mm





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

15(106)

Author Data

Daoud Attayi

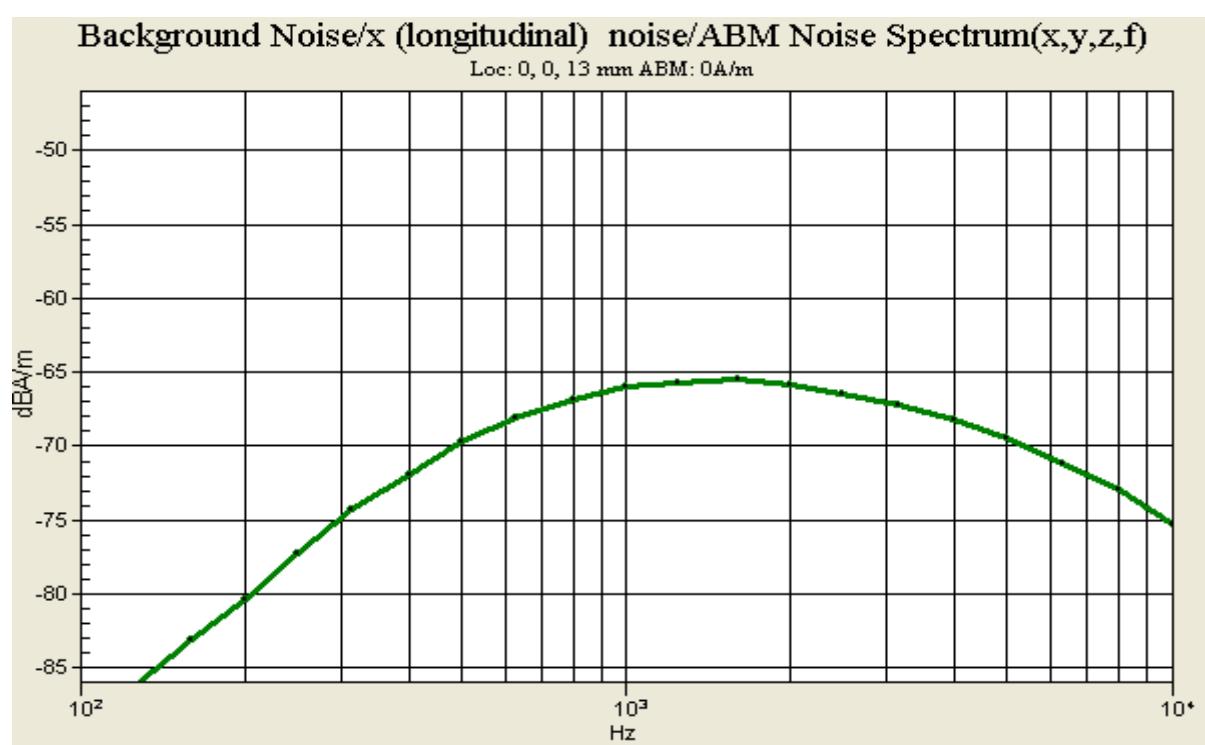
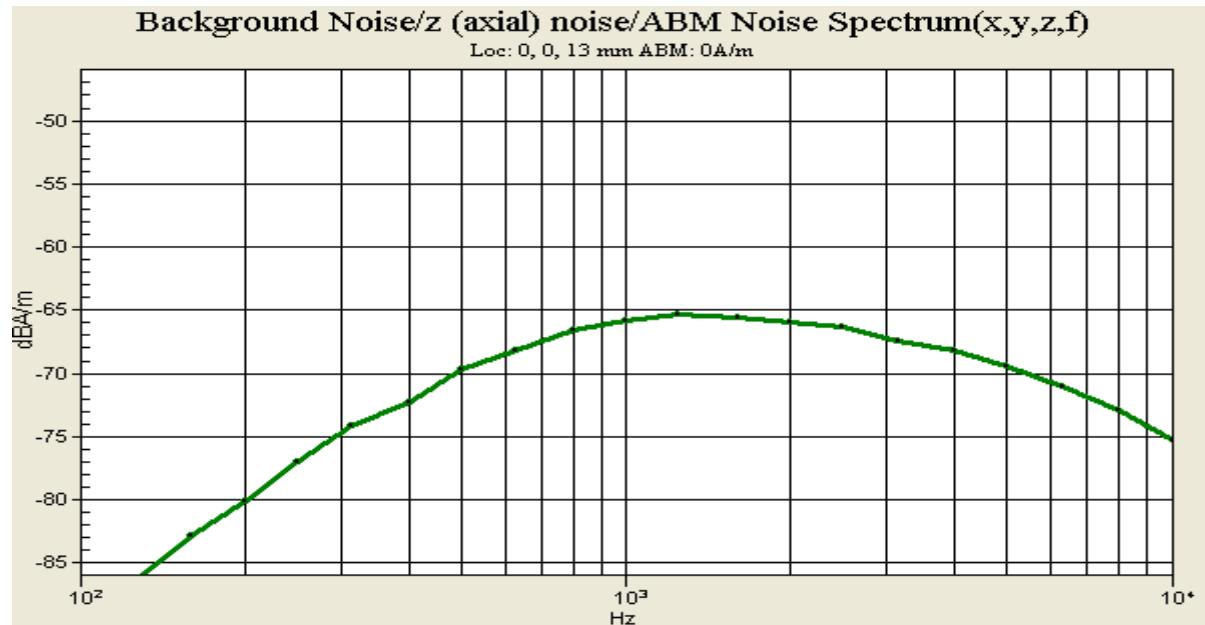
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

16(106)

Author Data

Daoud Attayi

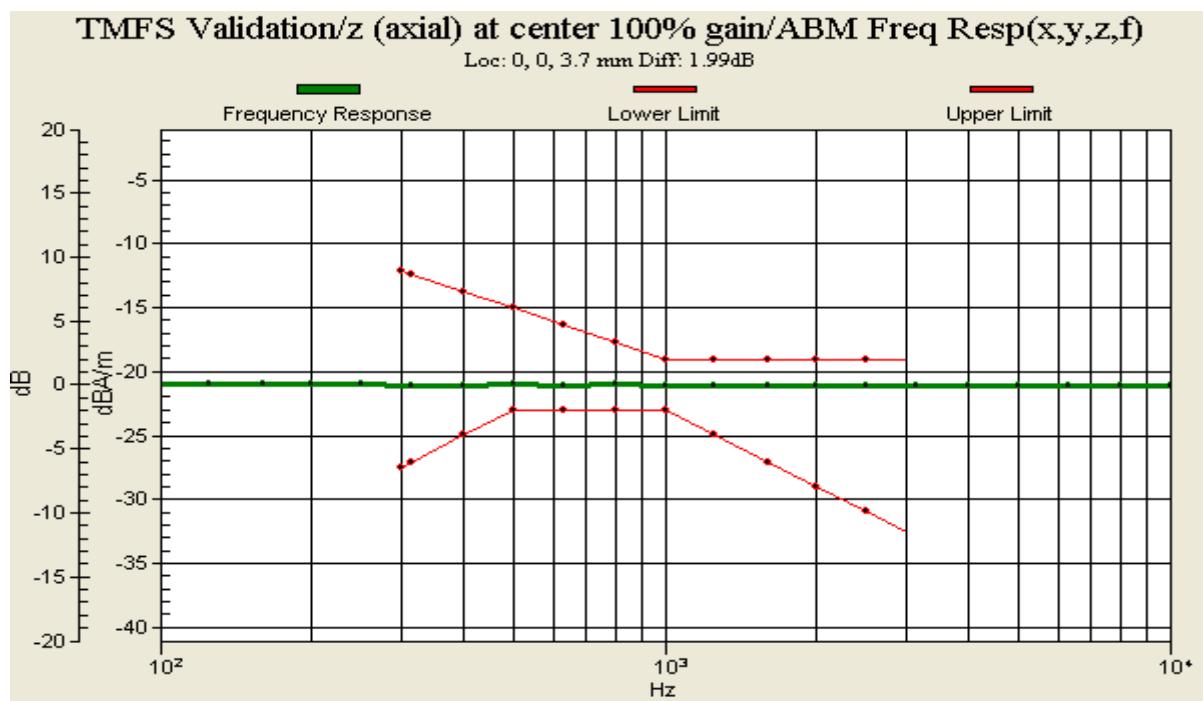
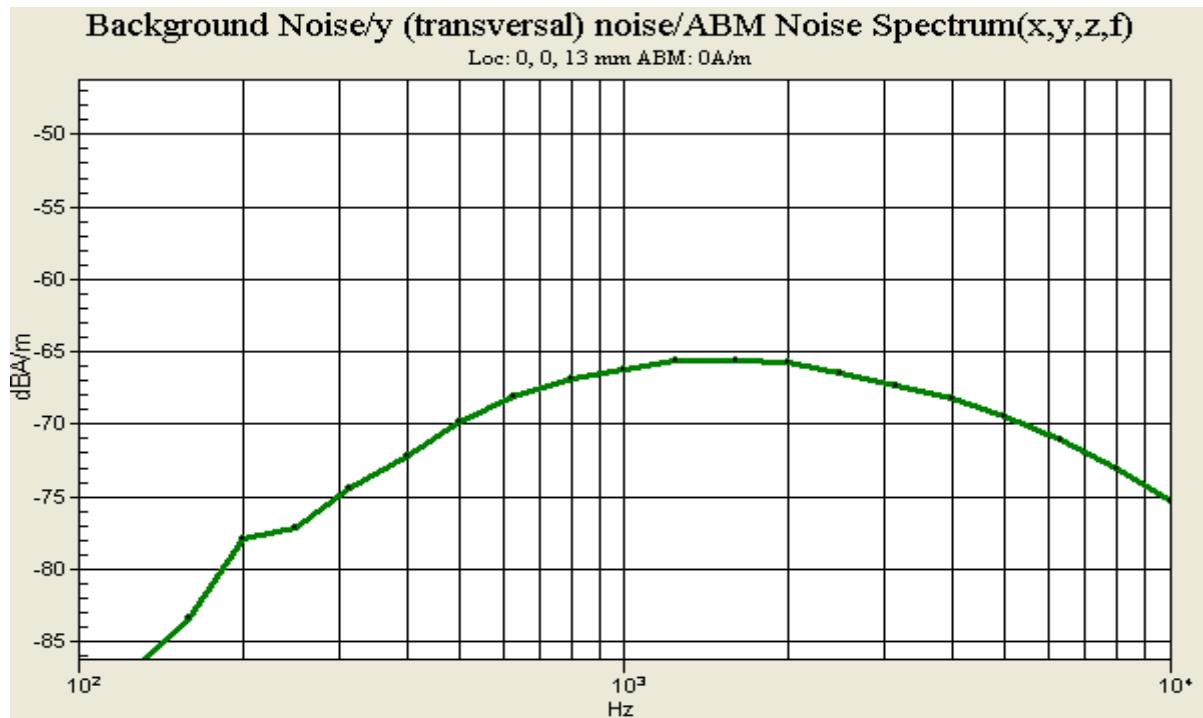
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 17(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Annex C: Audio Band Magnetic measurement data and plots

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 18(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 5:27:28 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM850_Axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz, Frequency: 836.8 MHz, Frequency: 848.8 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_1800mA_Battery/General Scan - Low channel/z (axial) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 19(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_1800mA_Battery/General Scan - Low channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 40.05 dB
 ABM1 comp = 20.58 dB A/m
 BWC Factor = 0.16 dB
 Location: 2, -7, 4.4 mm

T-Coil scan_1800mA_Battery/8x8 Scan - Mid channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 40.44 dB
 ABM1 comp = 20.51 dB A/m
 BWC Factor = 0.16 dB
 Location: 2, -7, 4.4 mm

T-Coil scan_1800mA_Battery/8x8 Scan - High channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

20(106)

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

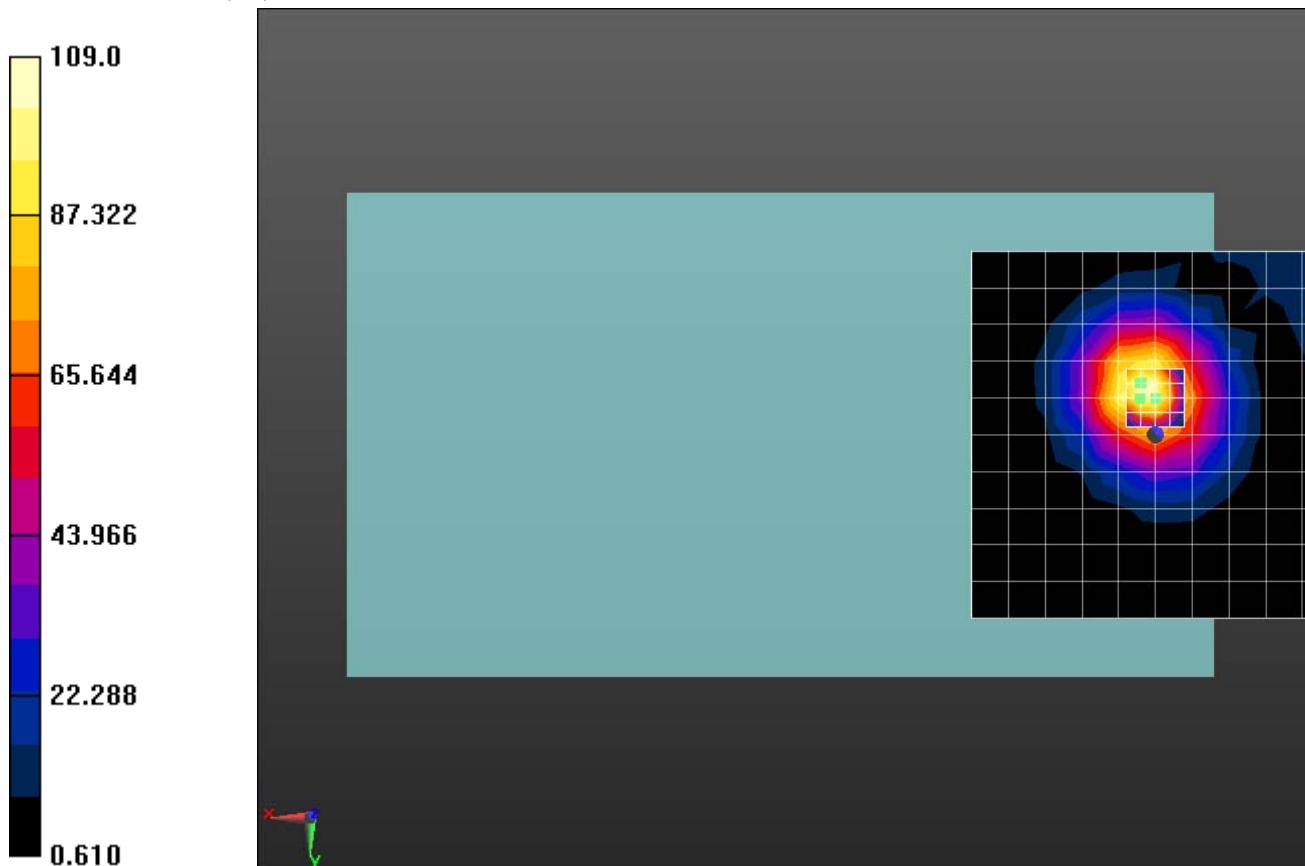
L6ARFL110LW**L6ARFP120LW****Cursor:**

ABM1/ABM2 = 42.85 dB

ABM1 comp = 21.18 dB A/m

BWC Factor = 0.16 dB

Location: 2, -5, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 21(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms

Measure Window Length: 6000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.59 dB

BWC Factor = 10.80 dB

Location: 0, -5, 5.7 mm

T-Coil scan_GSM850_1800mA_Battery/8x8 Scan - Mid channel/z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.53 dB

BWC Factor = 10.80 dB

Location: 0, -5, 5.7 mm

T-Coil scan_GSM850_1800mA_Battery/8x8 Scan - High channel/z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

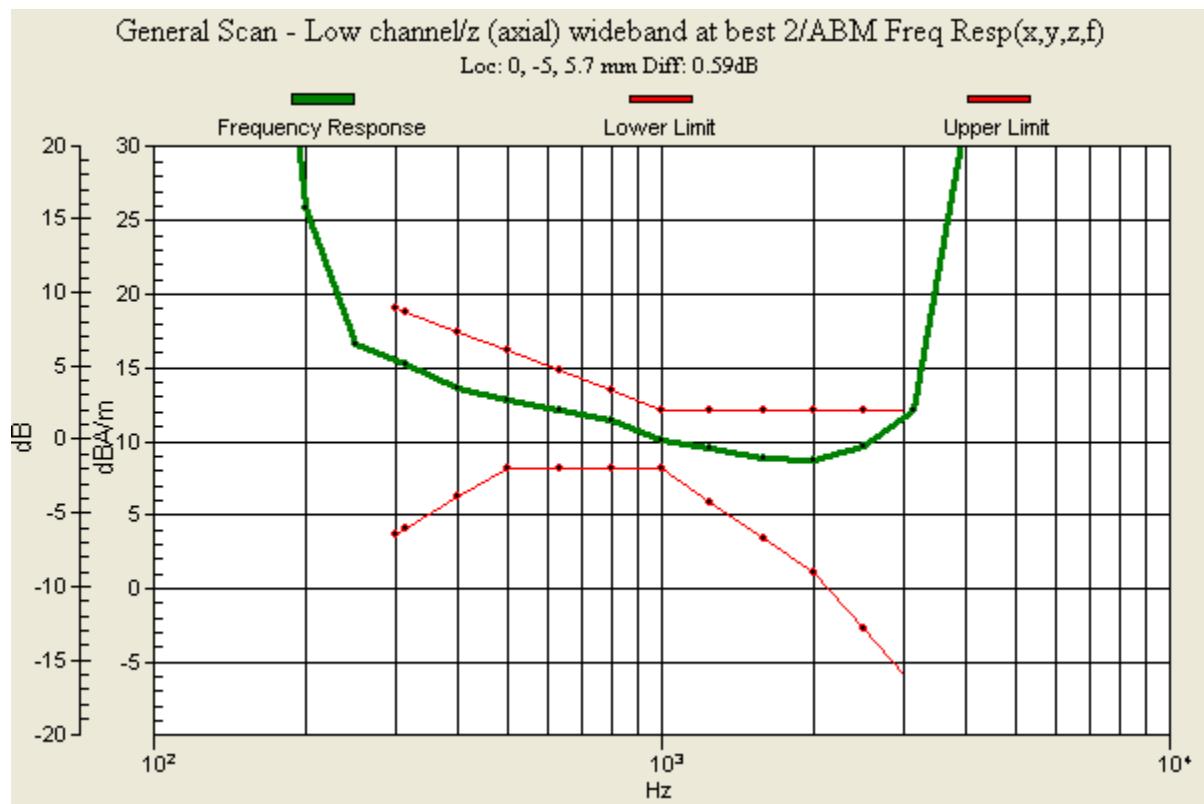
RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 22(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

Diff = 0.51 dB

BWC Factor = 10.80 dB

Location: 0, -5, 5.7 mm





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

23(106)

Author Data

Daoud Attayi

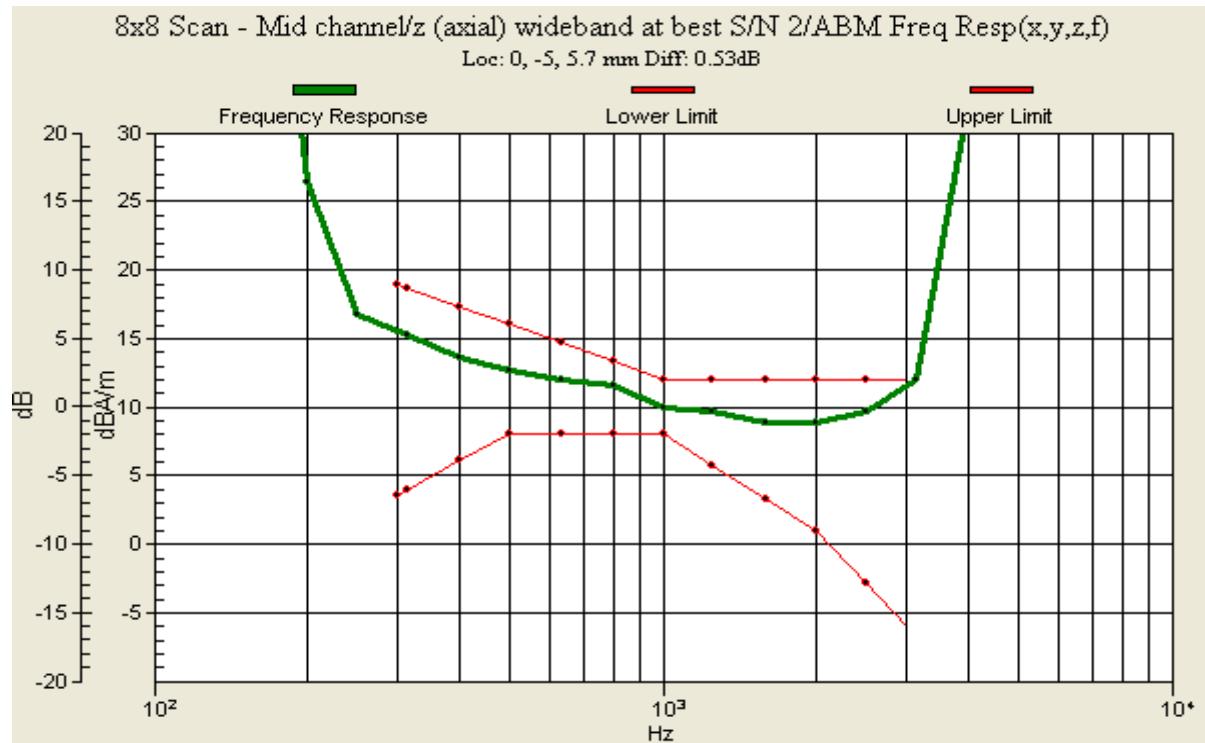
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

24(106)

Author Data

Daoud Attayi

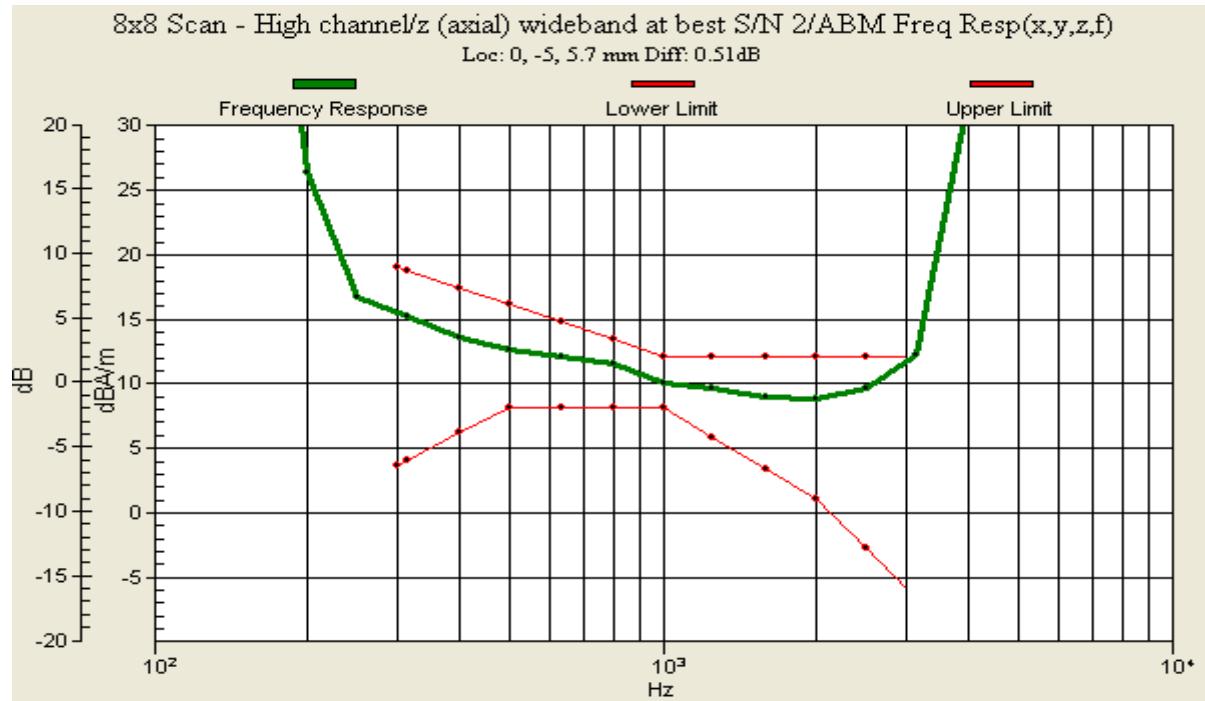
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 25(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 5:40:49 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM850_Radial_L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz, Frequency: 836.8 MHz, Frequency: 848.8 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_1800mA_Battery/General Scan - Low channel/x (longitudinal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 26(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_1800mA_Battery/General Scan - Low channel/x (longitudinal)

2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 45.83 dB

ABM1 comp = 7.67 dB A/m

BWC Factor = 0.16 dB

Location: 15, -10, 4.4 mm

T-Coil scan_1800mA_Battery/8x8 Scan - Mid channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 45.90 dB

ABM1 comp = 7.65 dB A/m

BWC Factor = 0.16 dB

Location: 15, -10, 4.4 mm

T-Coil scan_1800mA_Battery/8x8 Scan - High channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.16 dB

ABM1 comp = 7.66 dB A/m

BWC Factor = 0.16 dB

Location: 15, -10, 4.4 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

27(106)

Author Data

Daoud Attayi

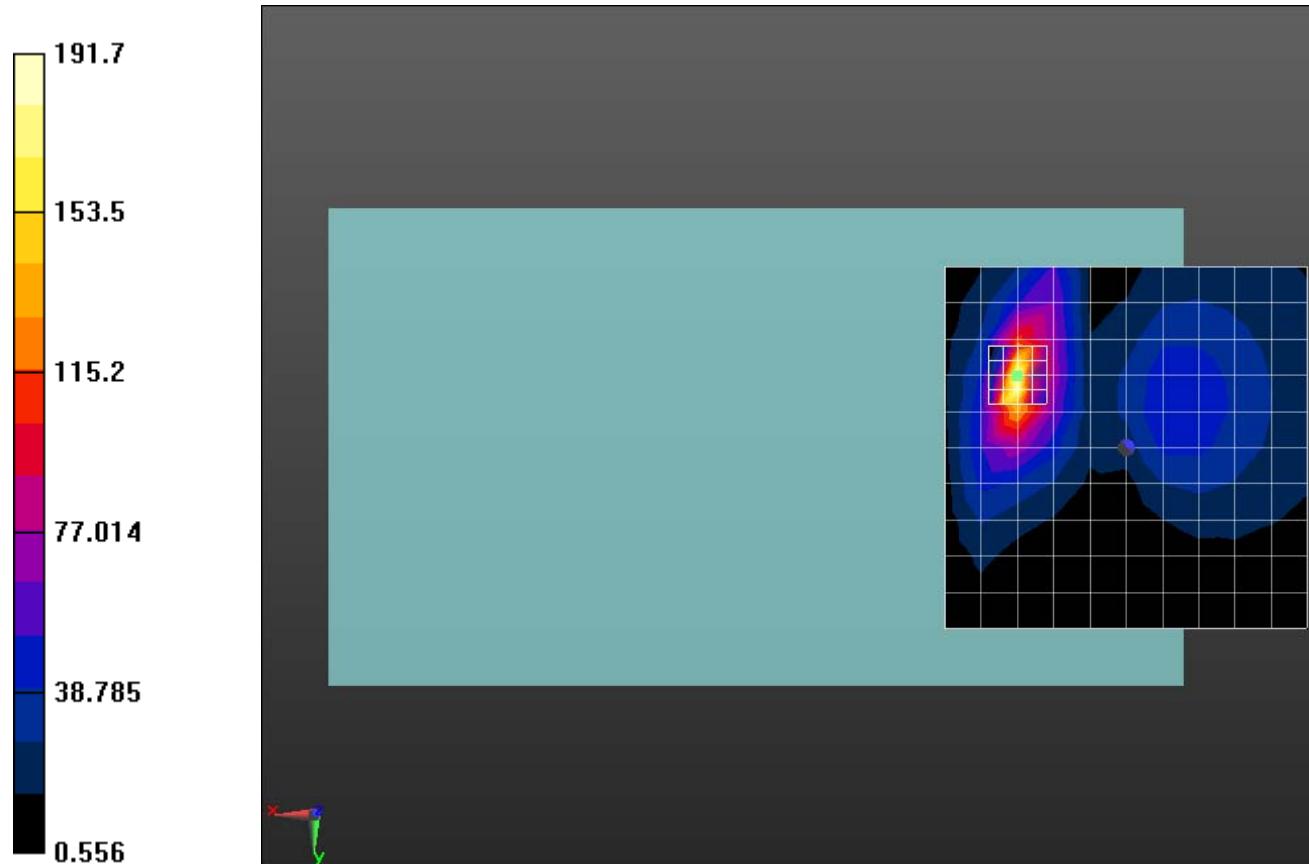
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 28(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 5:54:12 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM850_Radial_T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz, Frequency: 836.8 MHz, Frequency: 848.8 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_1800mA_Battery/General Scan - Low channel/y (transversal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 29(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_1800mA_Battery/General Scan - Low channel/y (transversal)

2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 54.13 dB

ABM1 comp = 4.78 dB A/m

BWC Factor = 0.16 dB

Location: 12, 15, 4.4 mm

T-Coil scan_1800mA_Battery/8x8 Scan - Mid channel/y (transversal) 2mm 8

x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 57.85 dB

ABM1 comp = 5.35 dB A/m

BWC Factor = 0.16 dB

Location: -5, 14, 4.4 mm

T-Coil scan_1800mA_Battery/8x8 Scan - High channel/y (transversal) 2mm 8

x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 59.54 dB

ABM1 comp = 7.65 dB A/m

BWC Factor = 0.16 dB

Location: -1, 14, 4.4 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

30(106)

Author Data

Daoud Attayi

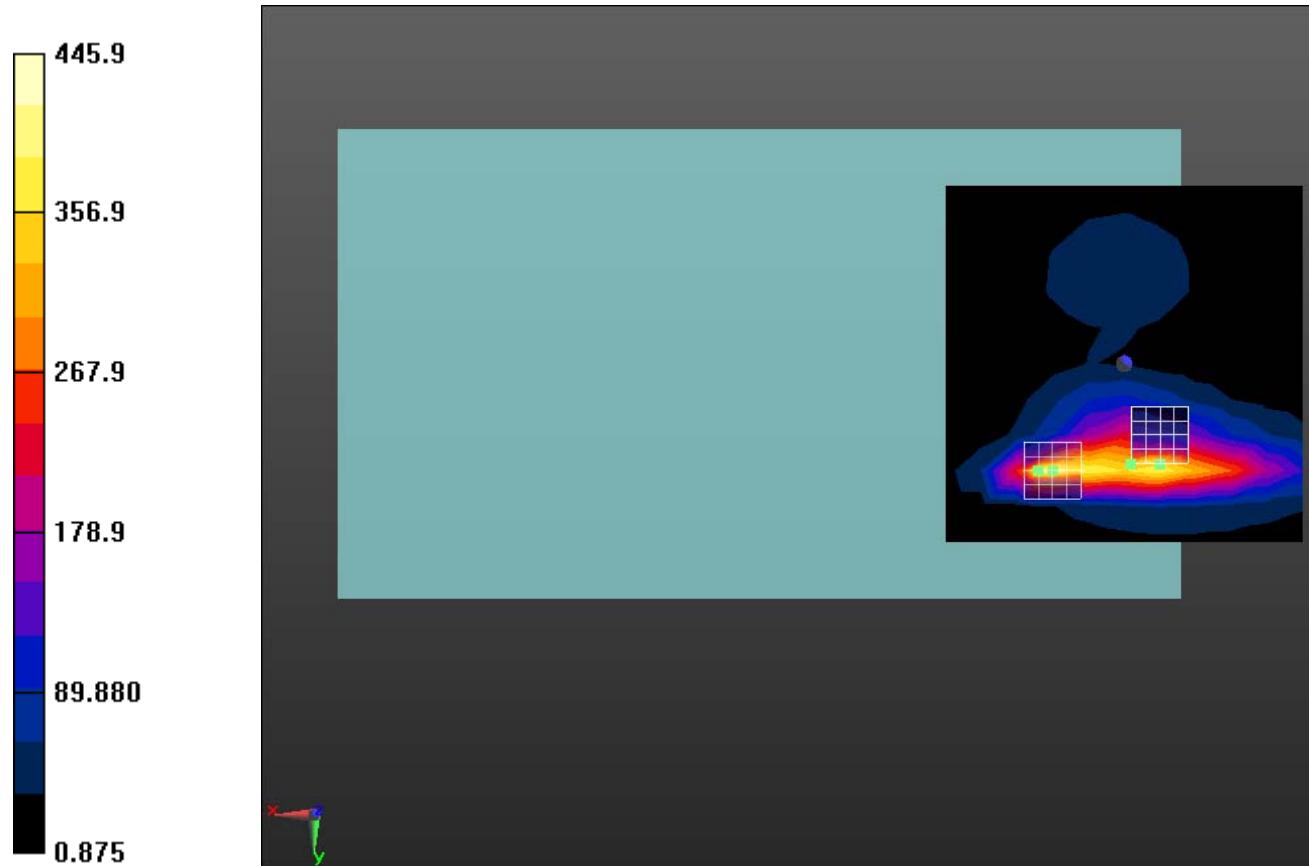
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 31(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 1:49:19 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM850_2100_Battery_Axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/z (axial) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 32(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

**T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/z (axial) 2mm
8 x 8/ABM SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Cursor:

ABM1/ABM2 = 60.01 dB

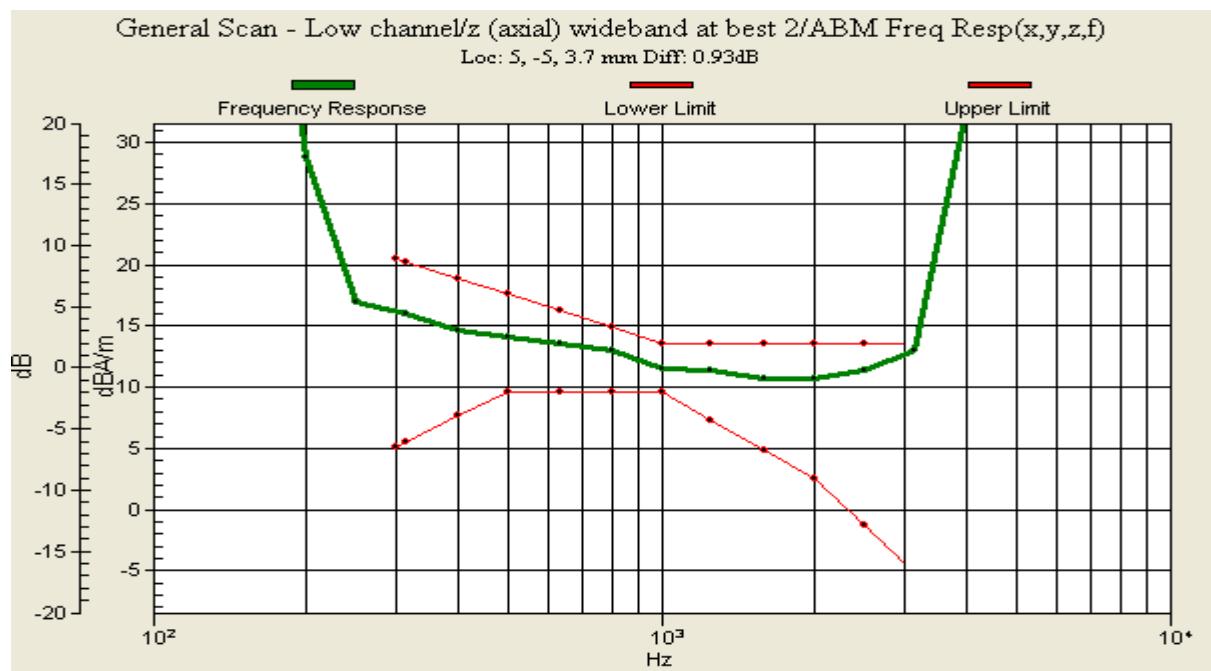
ABM1 comp = 20.90 dB A/m

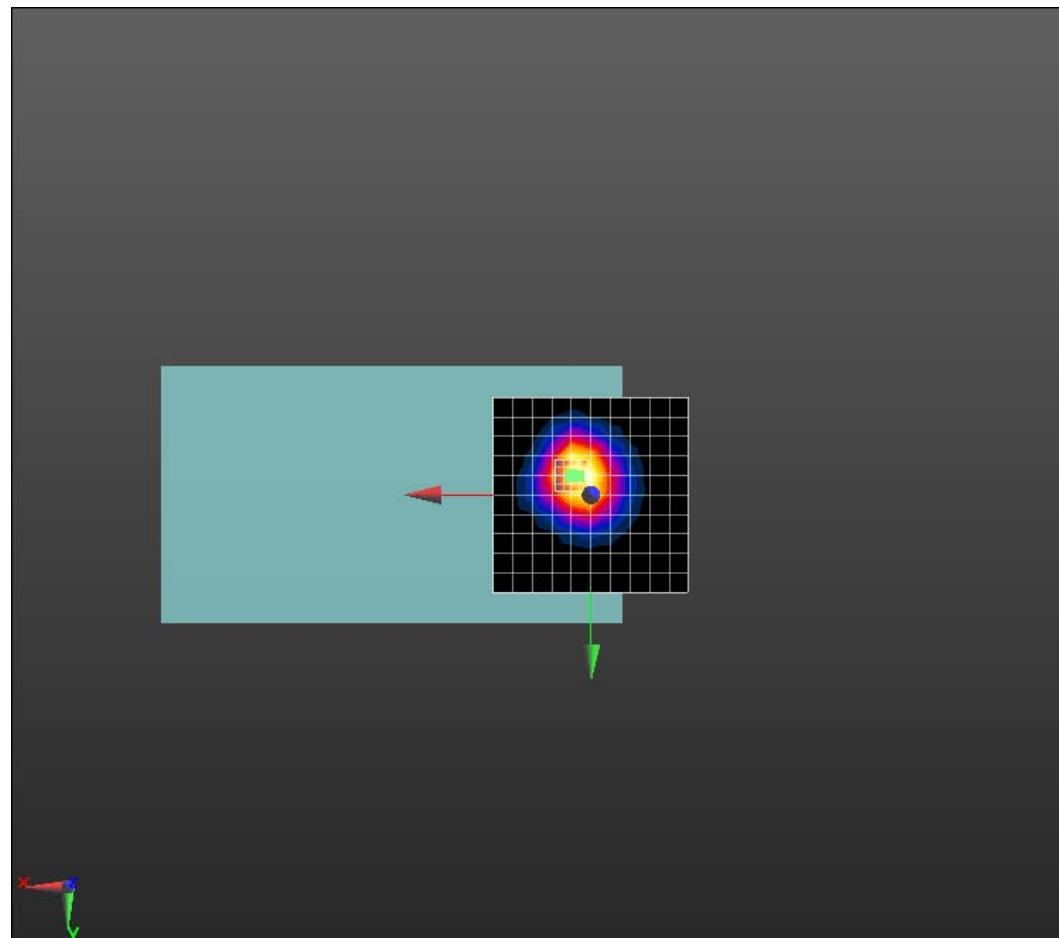
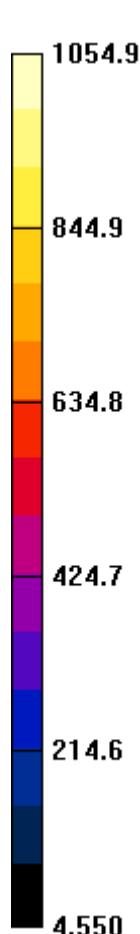
BWC Factor = 0.16 dB

Location: 3, -5, 4.4 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 33(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/z (axial) wideband at best 2/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 300ms
 Measure Window Length: 6000ms
 BWC applied: 10.80 dB



Author Data
Daoud AttayiDates of Test
**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**Report No
RTS-6026-1302-08FCC ID
**L6ARFL110LW
L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 35(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 2:02:37 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM850_2100_Battery_Radial_L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/x (longitudinal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 36(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

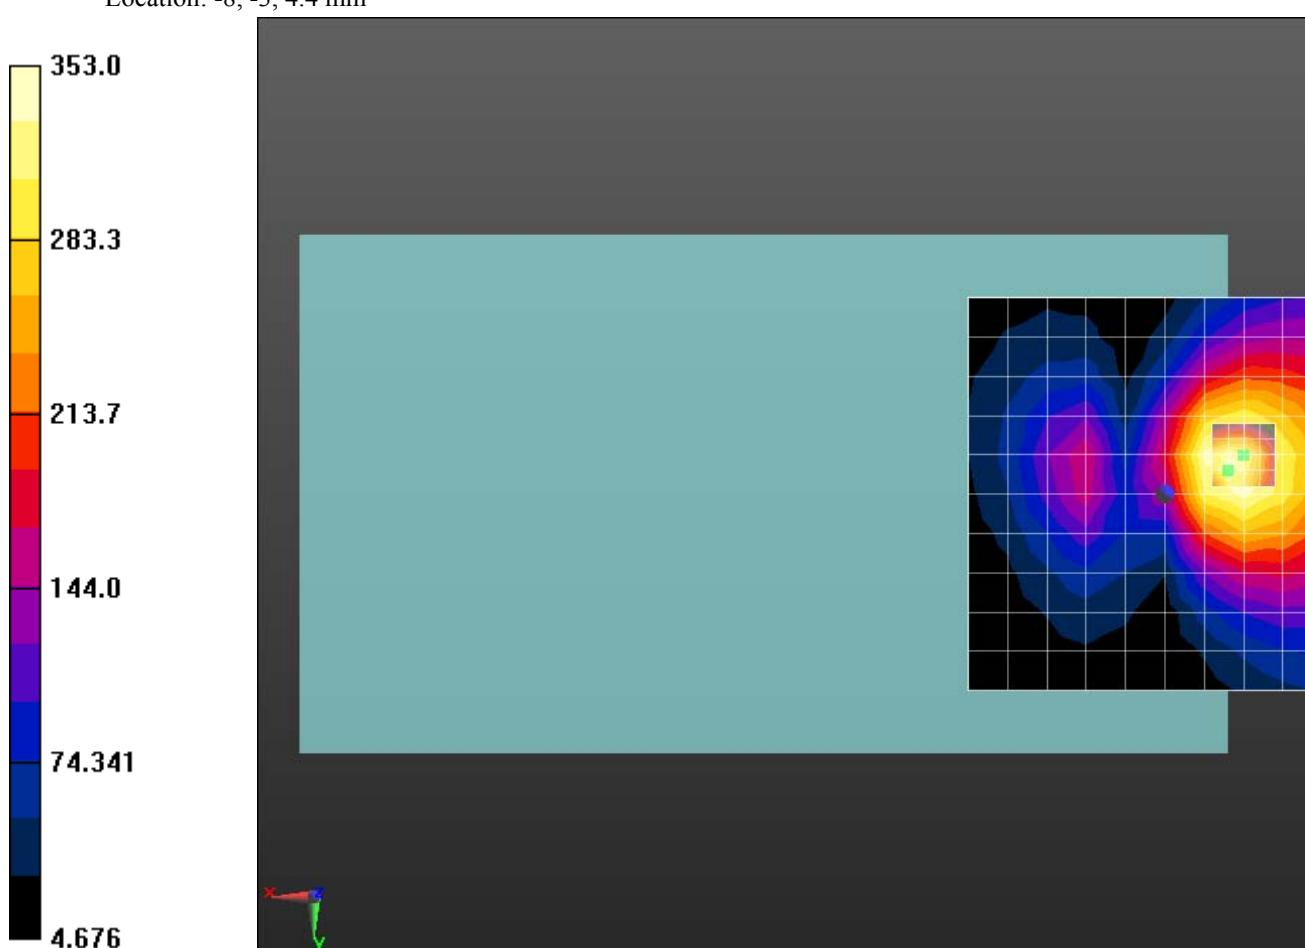
Cursor:

ABM1/ABM2 = 50.35 dB

ABM1 comp = 11.90 dB A/m

BWC Factor = 0.16 dB

Location: -8, -3, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 37(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 38(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 2:15:58 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM850_2100_Battery_Radial_T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/y (transversal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 39(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

T-Coil scan_GSM850_2100mA_Battery/General Scan - Low channel/y (transversal)

2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

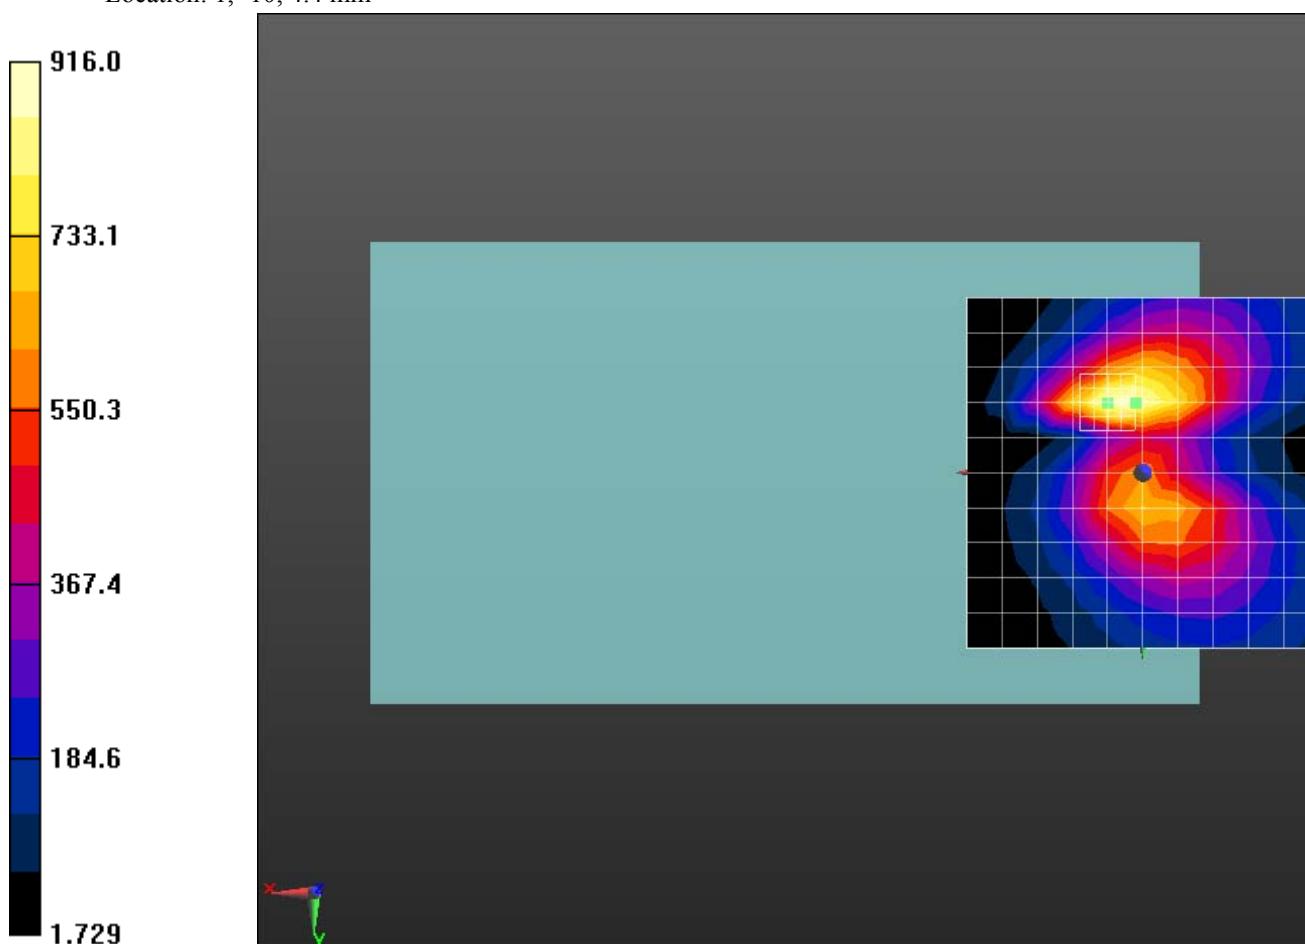
Cursor:

ABM1/ABM2 = 58.55 dB

ABM1 comp = 11.89 dB A/m

BWC Factor = 0.16 dB

Location: 1, -10, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 40(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 9:17:43 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM1900_Axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 1900; Frequency: 1850.2 MHz, Frequency: 1880 MHz, Frequency: 1909.8 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/z (axial) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 41(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 46.62 dB
 ABM1 comp = 20.81 dB A/m
 BWC Factor = 0.16 dB
 Location: 2, -5, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - Mid channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Category	Telephone parameters WD signal quality [(signal+noise)-to-noise ratio in decibels]
Category T1	0 dB to 10 dB
Category T2	10 dB to 20 dB
Category T3	20 dB to 30 dB
Category T4	> 30 dB

Cursor:

ABM1/ABM2 = 45.68 dB
 ABM1 comp = 20.70 dB A/m

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 42(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

BWC Factor = 0.16 dB

Location: 2, -5, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - Mid channel/z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms

Measure Window Length: 2000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Category	Telephone parameters WD signal quality [(signal+noise)-to-noise ratio in decibels]
Category T1	0 dB to 10 dB
Category T2	10 dB to 20 dB
Category T3	20 dB to 30 dB
Category T4	> 30 dB

Cursor:

Diff = -2.01 dB

BWC Factor = 10.80 dB

Location: 0, -5, 3.7 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - Mid channel/z (axial) wideband at best S/N 2/ABM Freq Resp(x,y,z,f) (1x1x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 2000ms

Measure Window Length: 4000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 43(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

Diff = -1.99 dB

BWC Factor = 10.80 dB

Location: 0, -5, 3.7 mm

Cursor:

ABM1/ABM2 = 45.68 dB

ABM1 comp = 20.70 dB A/m

BWC Factor = 0.16 dB

Location: 2, -5, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - High channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

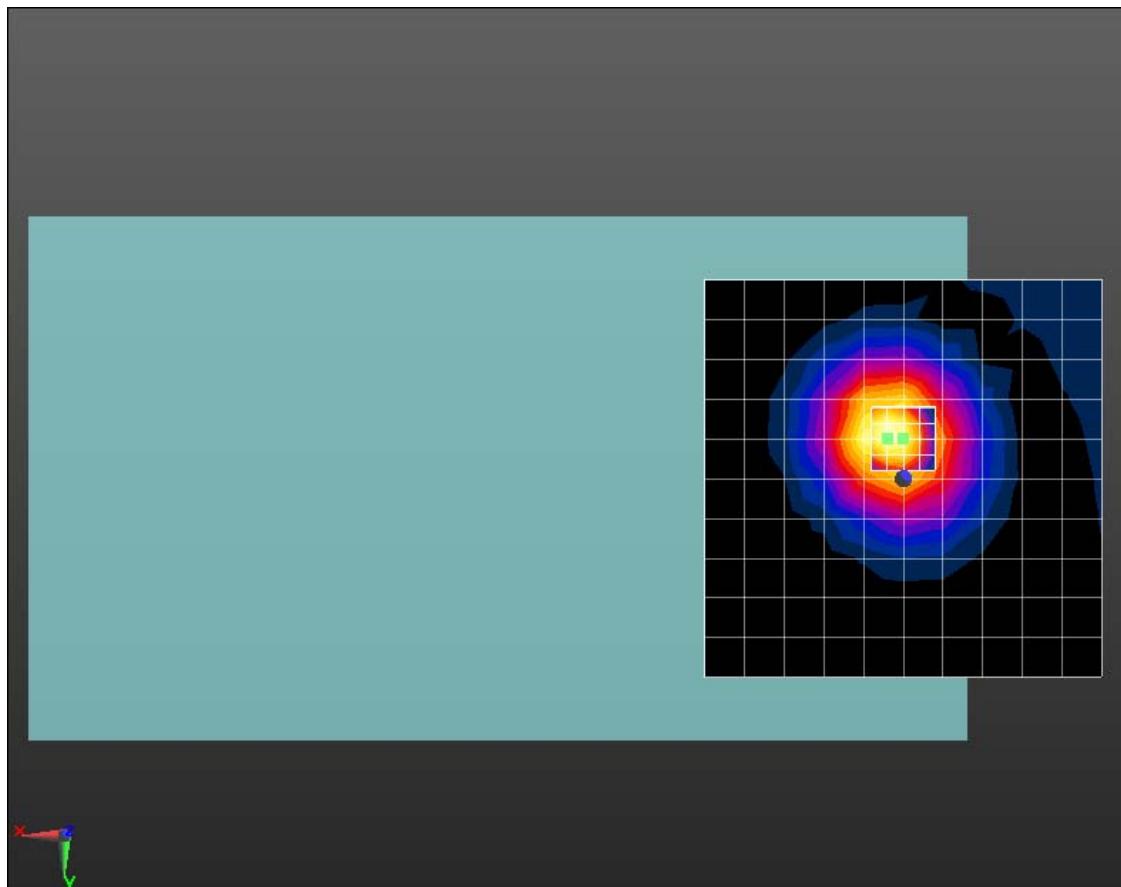
ABM1/ABM2 = 45.12 dB

ABM1 comp = 20.65 dB A/m

BWC Factor = 0.16 dB

Location: 2, -5, 4.4 mm

	<p>Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW</p>	<p>Page 44(106)</p>
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 45(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/z (axial) wideband at best S/N ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 300ms
 Measure Window Length: 6000ms
 BWC applied: 10.80 dB

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - Mid channel/z (axial) wideband at best S/N ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 2000ms
 Measure Window Length: 4000ms
 BWC applied: 10.80 dB

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - High channel/z (axial) wideband at best S/N ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 2000ms
 Measure Window Length: 4000ms
 BWC applied: 10.80 dB



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

46(106)

Author Data

Daoud Attayi

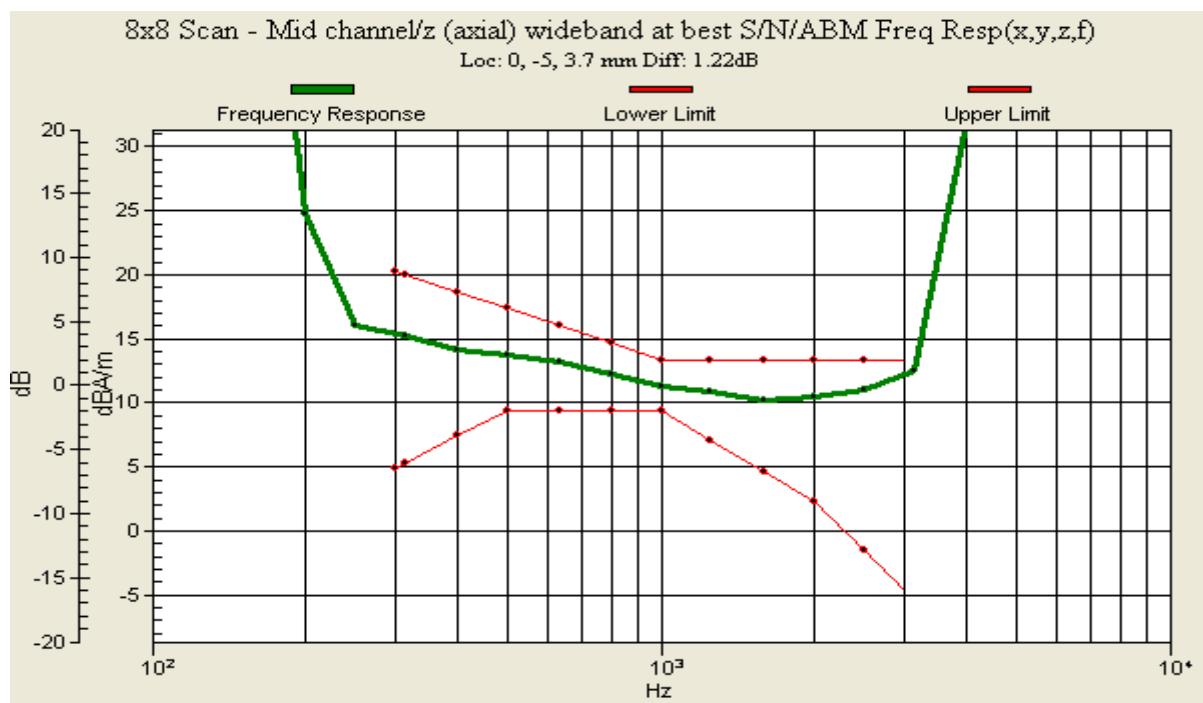
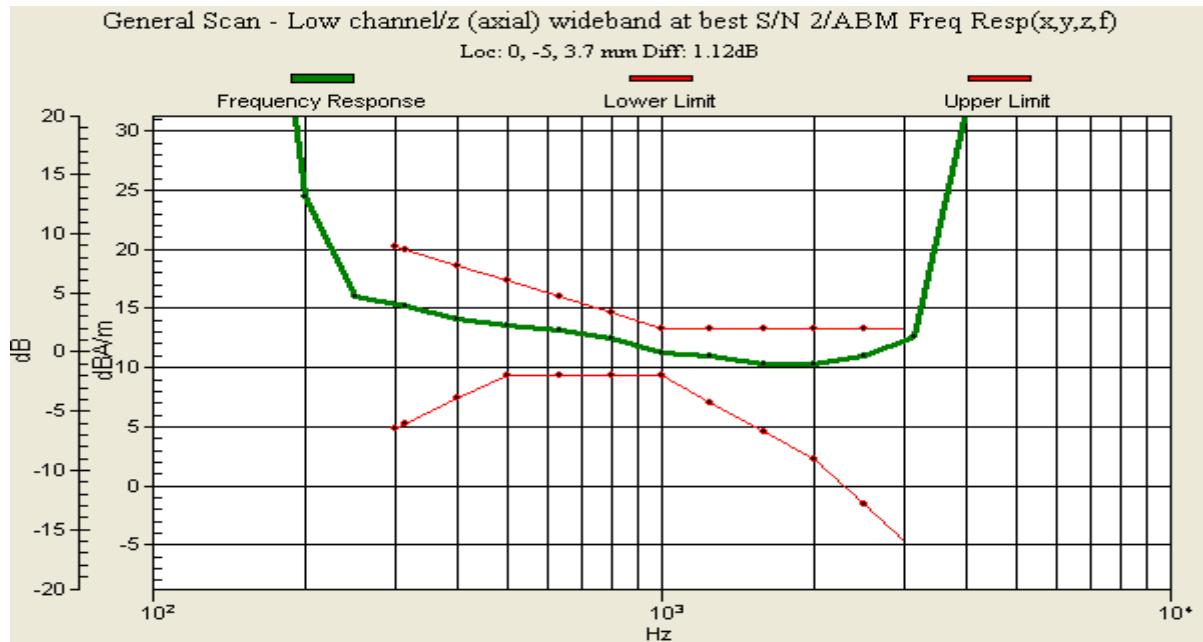
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

47(106)

Author Data

Daoud Attayi

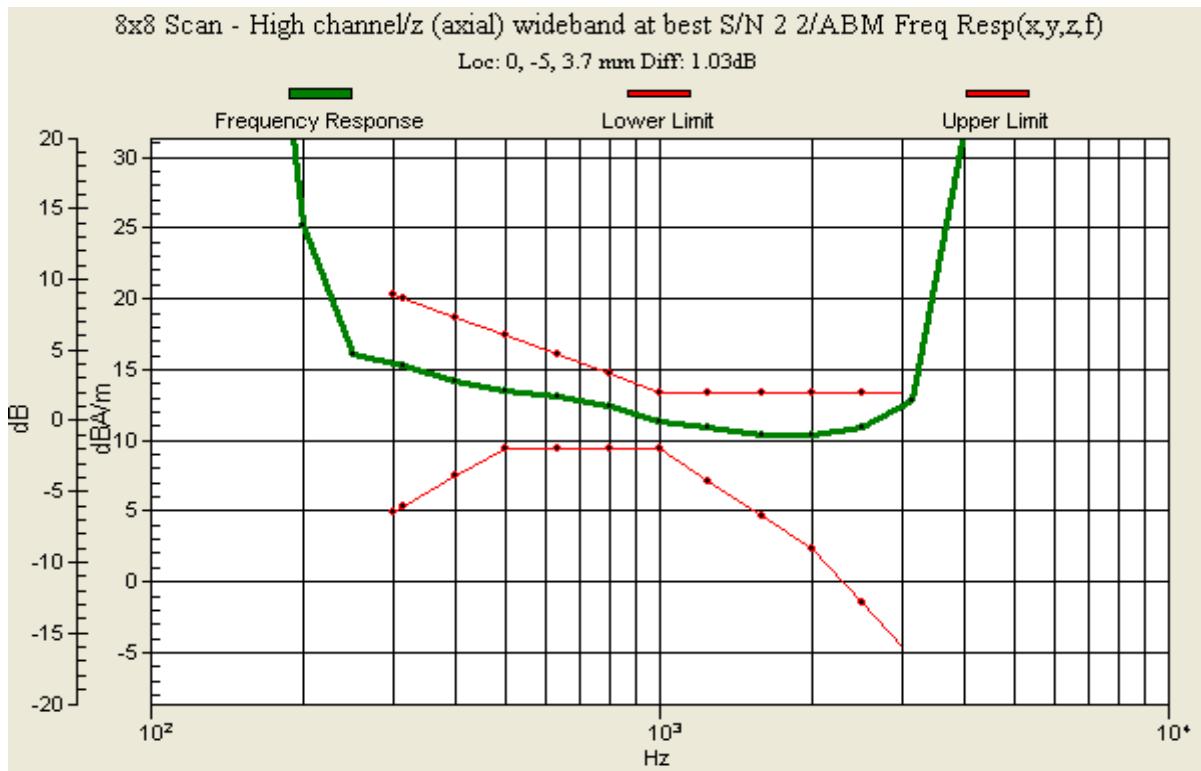
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 48(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 9:31:03 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM1900_Radial_L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 1900; Frequency: 1850.2 MHz, Frequency: 1880 MHz, Frequency: 1909.8 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/x (longitudinal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 49(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 51.82 dB

ABM1 comp = 9.74 dB A/m

BWC Factor = 0.16 dB

Location: 17, -8, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - Mid channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 51.92 dB

ABM1 comp = 9.62 dB A/m

BWC Factor = 0.16 dB

Location: 17, -8, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - High channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 51.59 dB

ABM1 comp = 9.66 dB A/m

BWC Factor = 0.16 dB

Location: 17, -8, 4.4 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

50(106)

Author Data

Daoud Attayi

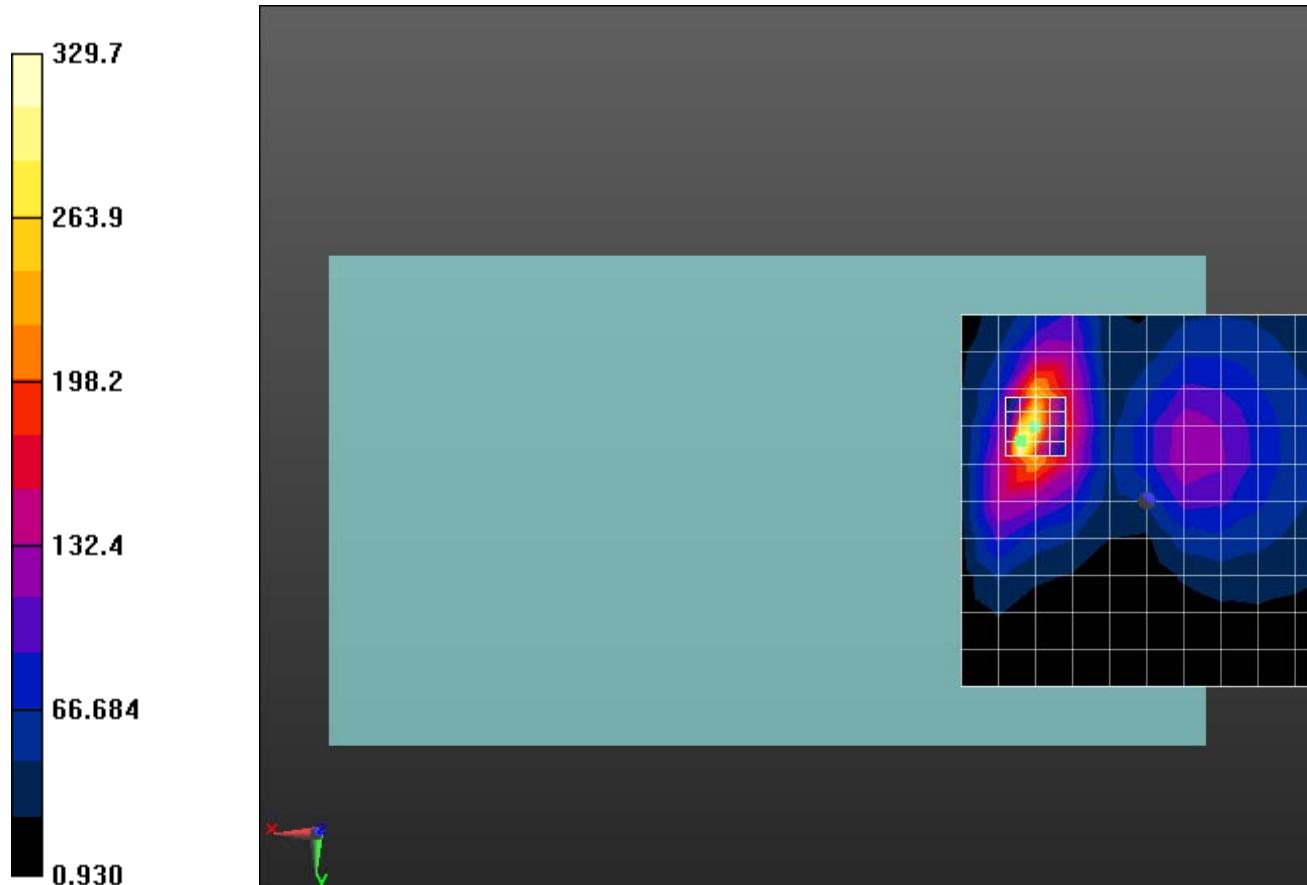
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 51(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 9:44:26 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM1900_Radial_T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 1900; Frequency: 1850.2 MHz, Frequency: 1880 MHz, Frequency: 1909.8 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/y (transversal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 52(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 58.46 dB

ABM1 comp = 9.00 dB A/m

BWC Factor = 0.16 dB

Location: 0, 12, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - Mid channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 57.71 dB

ABM1 comp = 8.96 dB A/m

BWC Factor = 0.16 dB

Location: 0, 12, 4.4 mm

T-Coil scan_GSM1900_1800mA_Battery/8x8 Scan - High channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 57.82 dB

ABM1 comp = 7.30 dB A/m

BWC Factor = 0.16 dB

Location: -4, 12, 4.4 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

53(106)

Author Data

Daoud Attayi

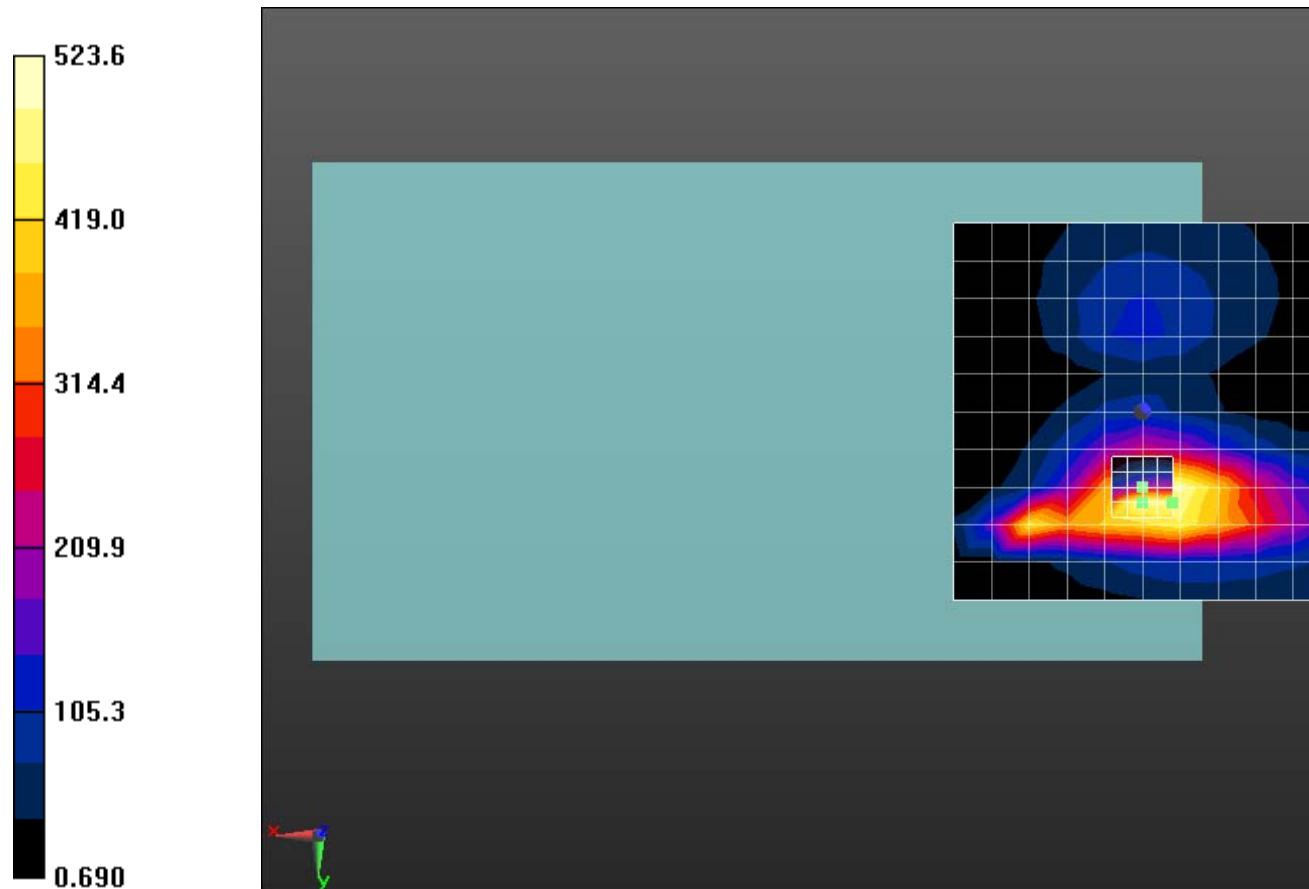
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 54(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 11:07:25 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS_Band_V_Axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD V; Frequency: 826.4 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/z (axial)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 55(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

**T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/z
(axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 35.28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.16 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 60.44 dB
ABM1 comp = 19.79 dB A/m
BWC Factor = 0.16 dB
Location: 3, -1, 4.4 mm

**T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/z
(axial) wideband at best S/N_probe AM1DV2/ABM Freq Resp(x,y,z,f)
(1x1x1):**

Measurement grid: dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
Output Gain: 69.12
Measure Window Start: 300ms
Measure Window Length: 2000ms
BWC applied: 10.80 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = -2.32 dB
BWC Factor = 10.80 dB
Location: 5, -5, 3.7 mm

**T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/z
(axial) wideband at best 2/ABM Freq Resp(x,y,z,f) (1x1x1):** Measurement grid:

dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
Output Gain: 69.12
Measure Window Start: 300ms
Measure Window Length: 6000ms
BWC applied: 10.80 dB
Device Reference Point: 0, 0, -6.3 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

56(106)

Author Data

Daoud Attayi

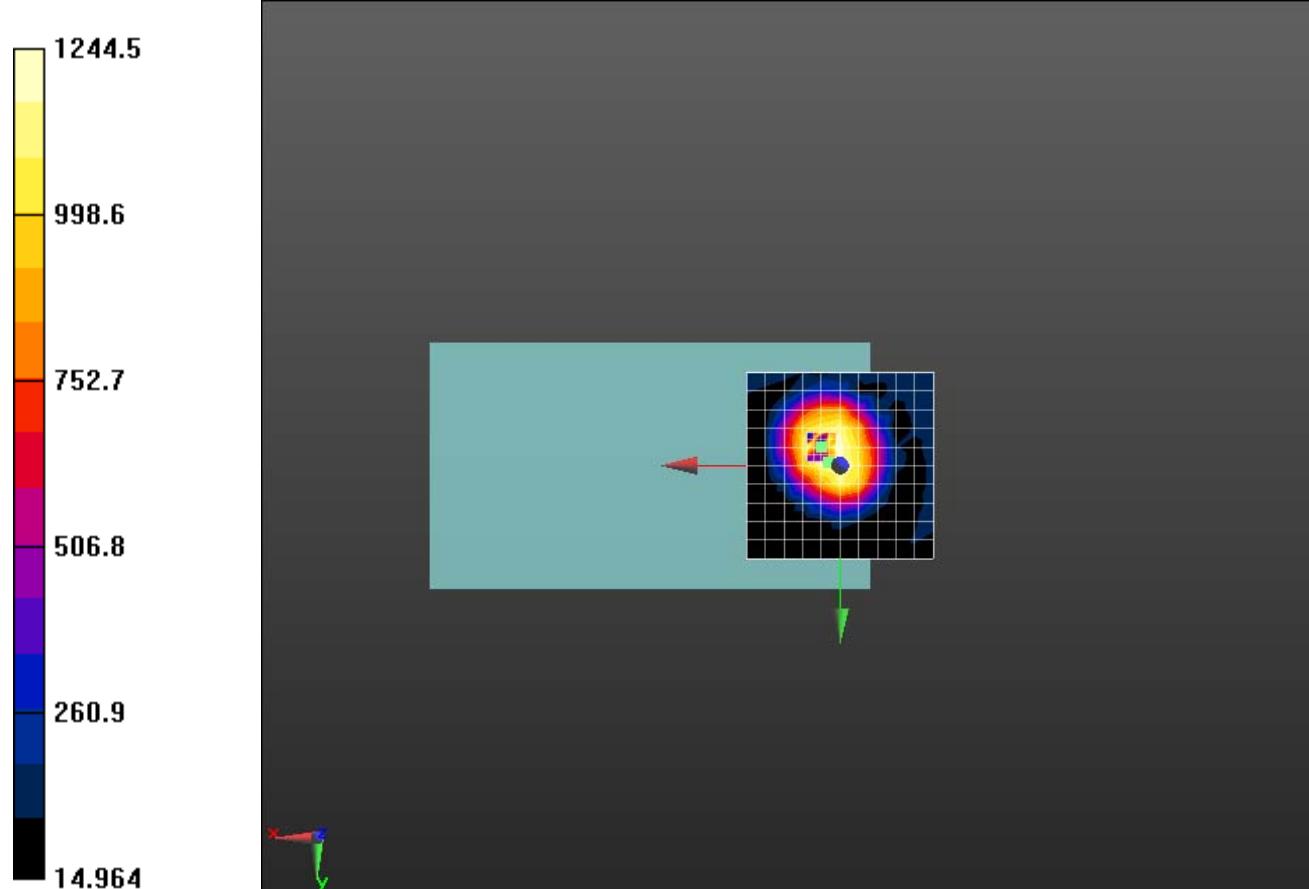
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

57(106)

Author Data

Daoud Attayi

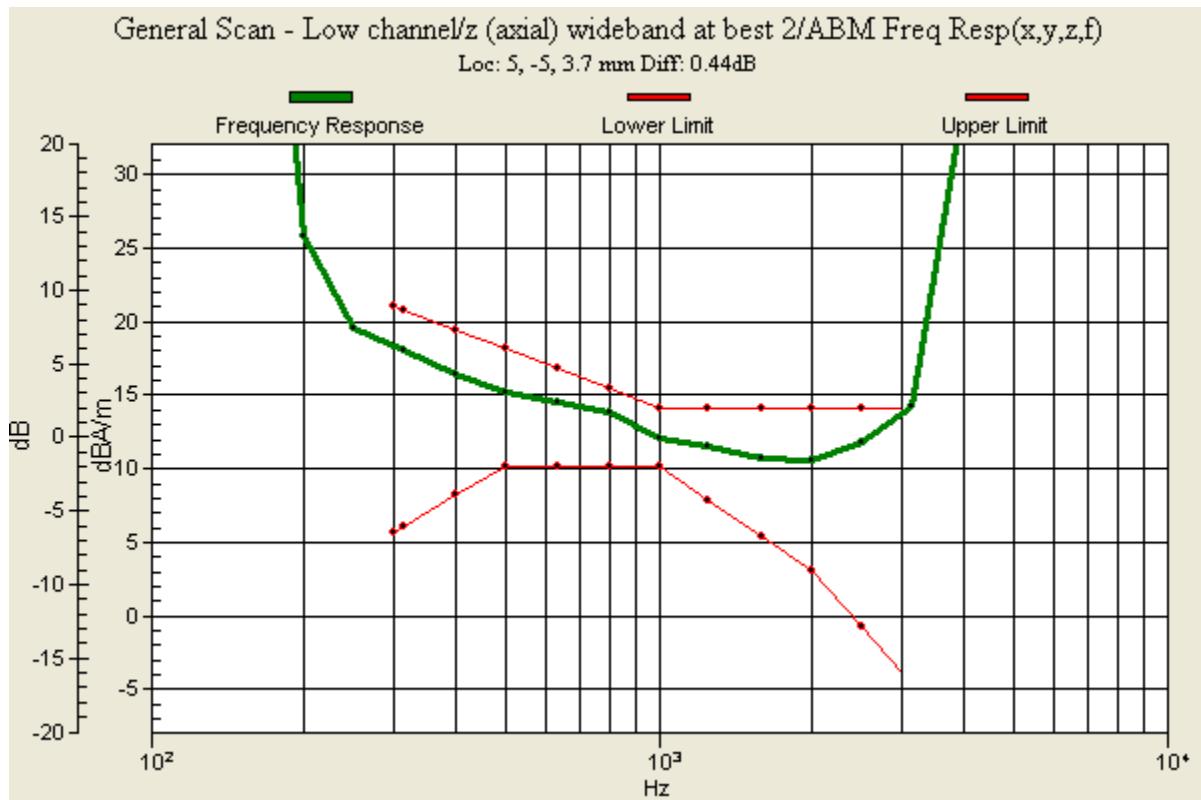
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 58(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 11:20:44 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS_Band_V_Radial_L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD V; Frequency: 826.4 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/x (longitudinal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 59(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

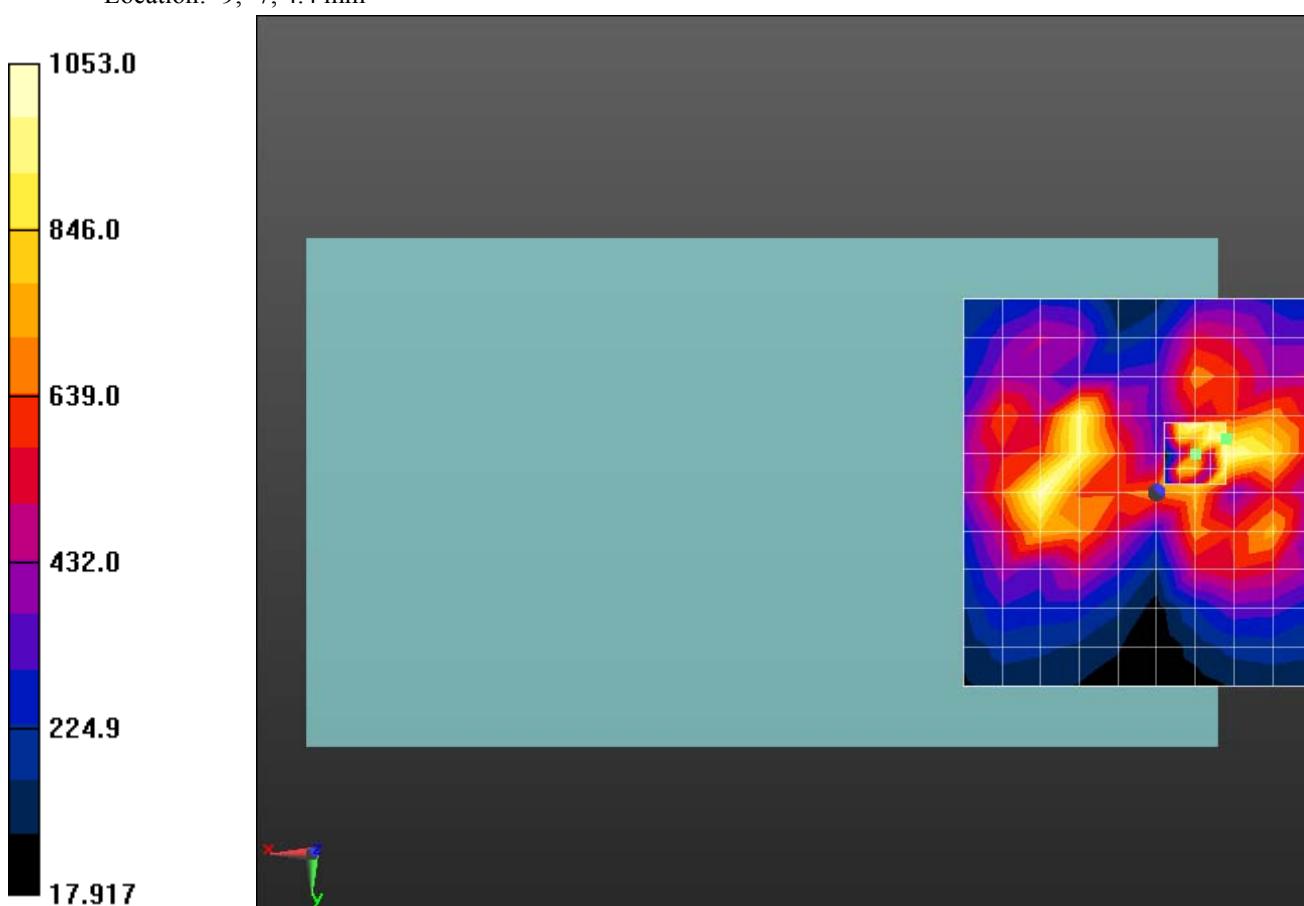
Cursor:

ABM1/ABM2 = 59.78 dB

ABM1 comp = 10.71 dB A/m

BWC Factor = 0.16 dB

Location: -9, -7, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 60(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/19/2012 11:34:07 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS_Band_V_Radial_T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD V; Frequency: 826.4 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/y (transversal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 61(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

**T-Coil scan_UMTS_Band_V_1800mA_Battery/General Scan - Low channel/y
(transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

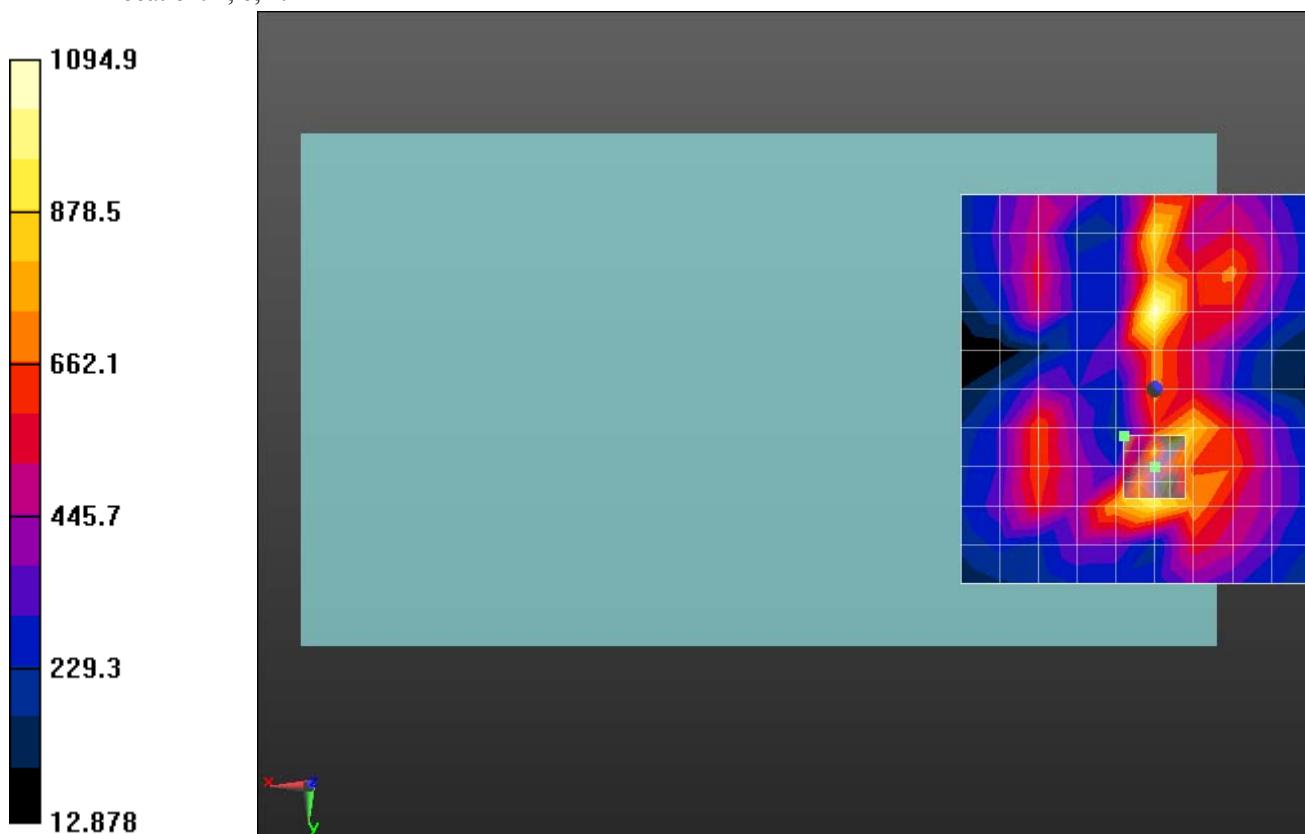
Cursor:

ABM1/ABM2 = 60.78 dB

ABM1 comp = 11.80 dB A/m

BWC Factor = 0.16 dB

Location: 4, 6, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 62(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 12:29:58 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS_Band_II_Axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD II; Frequency: 1852.4 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/z (axial)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 63(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

**T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/z
(axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 60.02 dB

ABM1 comp = 12.34 dB A/m

BWC Factor = 0.16 dB

Location: -5, 0, 4.4 mm

**T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/z
(axial) wideband at best S/N_probe AM1DV2/ABM Freq Resp(x,y,z,f)
(1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms

Measure Window Length: 2000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = -1.28 dB

BWC Factor = 10.80 dB

Location: -5, 0, 3.7 mm

**T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/z
(axial) wideband at best S/N 2 probe AM1DV2/ABM Freq Resp(x,y,z,f)
(1x1x1):**

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms

Measure Window Length: 6000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = -1.21 dB

BWC Factor = 10.80 dB

Location: -5, 0, 3.7 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

64(106)

Author Data

Daoud Attayi

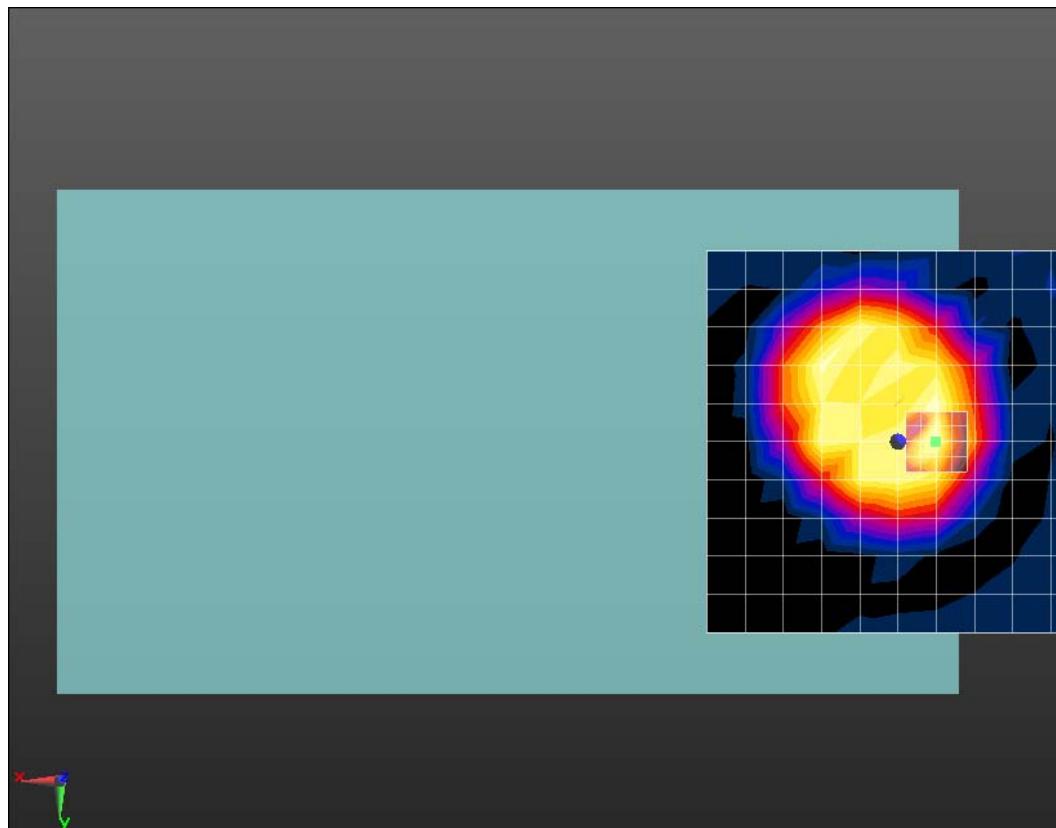
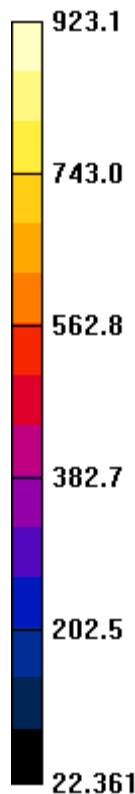
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 65(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 12:43:19 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS_Band_II_Radial_L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD II; Frequency: 1852.4 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/x (longitudinal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 66(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

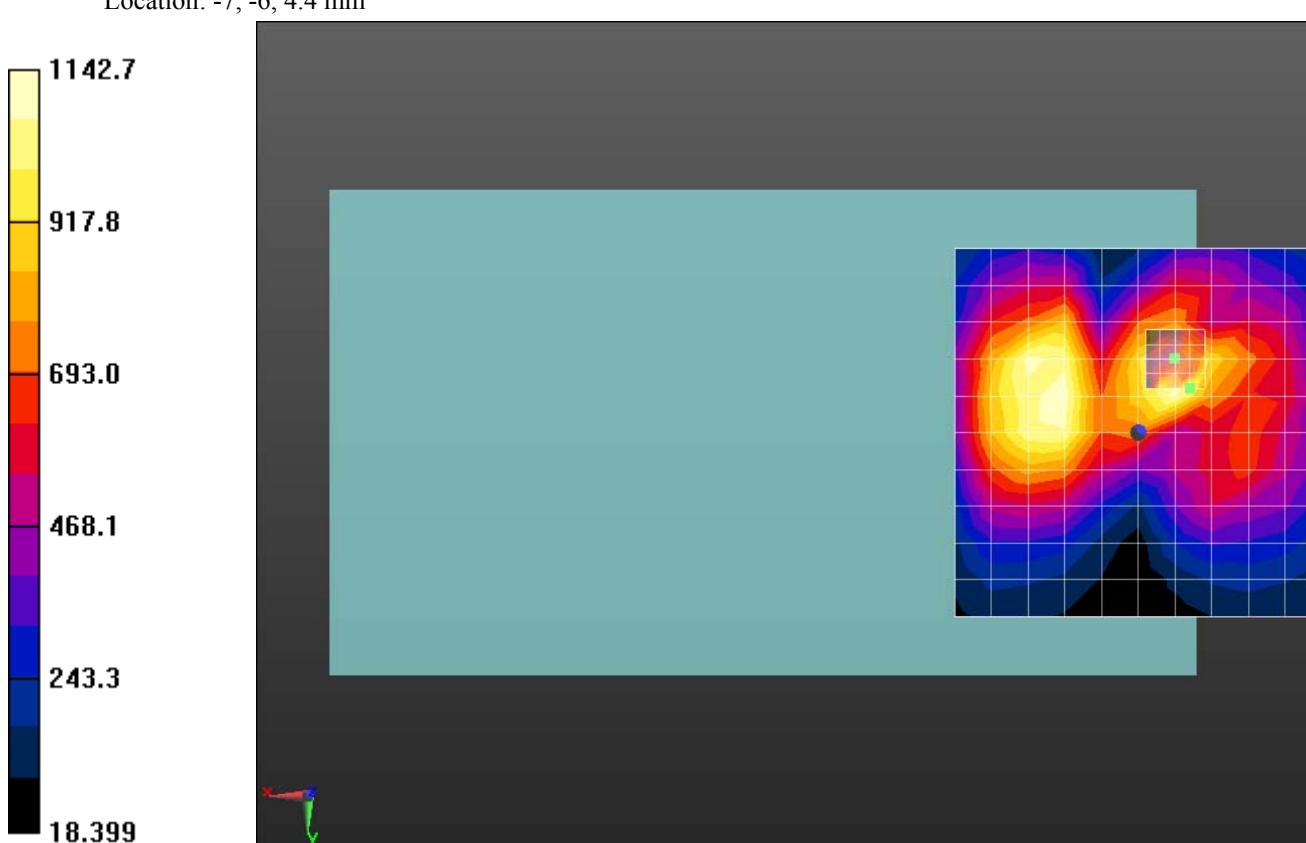
Cursor:

ABM1/ABM2 = 61.39 dB

ABM1 comp = 12.27 dB A/m

BWC Factor = 0.16 dB

Location: -7, -6, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 67(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 12:56:42 AM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS_Band_II_Radial_T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD II; Frequency: 1852.4 MHz

Medium parameters used: $\sigma = 0$ mho/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA
- DASY52 52.8.0(692); SEMCAD X 14.6.4(4989)

T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/y (transversal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 68(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_UMTS_Band_II_1800mA_Battery/General Scan - Low channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):

Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

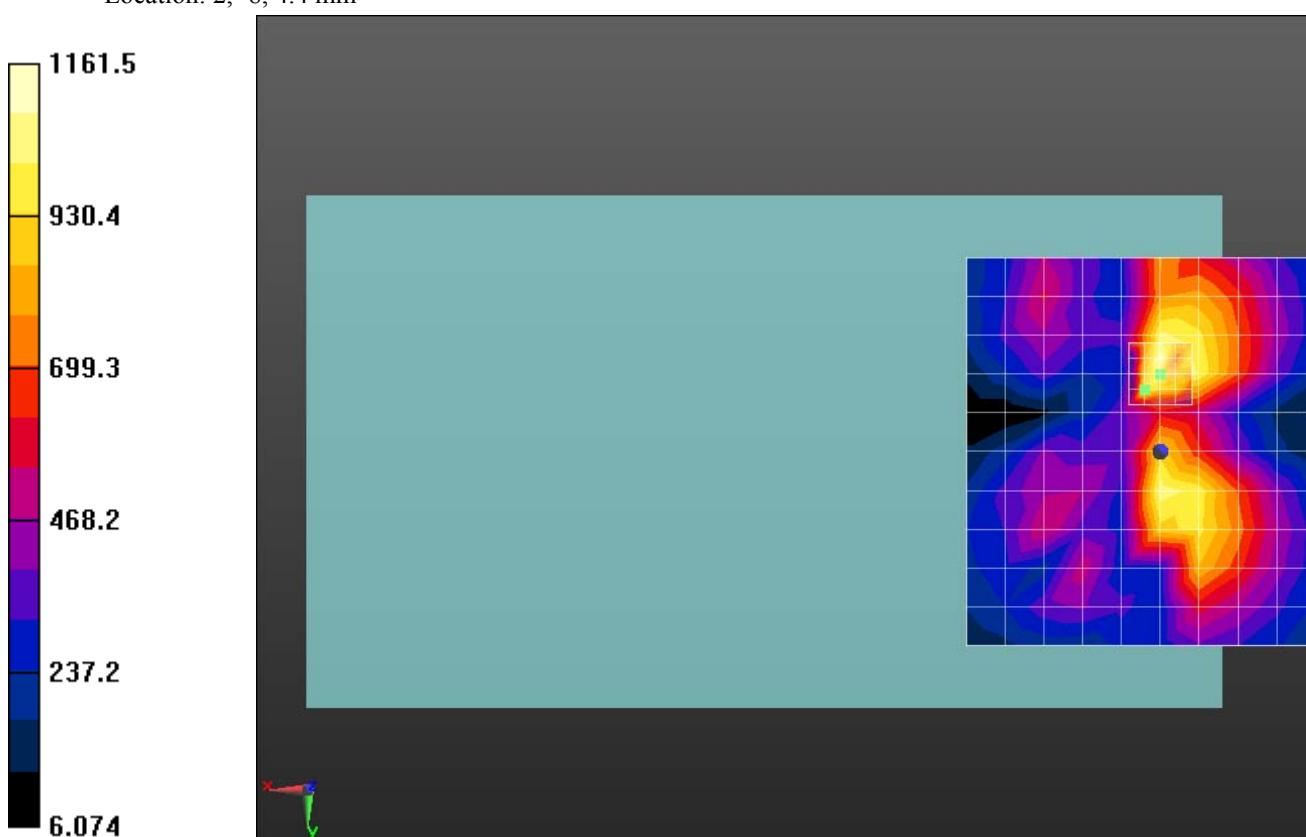
Cursor:

ABM1/ABM2 = 61.02 dB

ABM1 comp = 10.15 dB A/m

BWC Factor = 0.16 dB

Location: 2, -8, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 69(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 7:50:03 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/z (axial) 5.0mm 50 x

50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

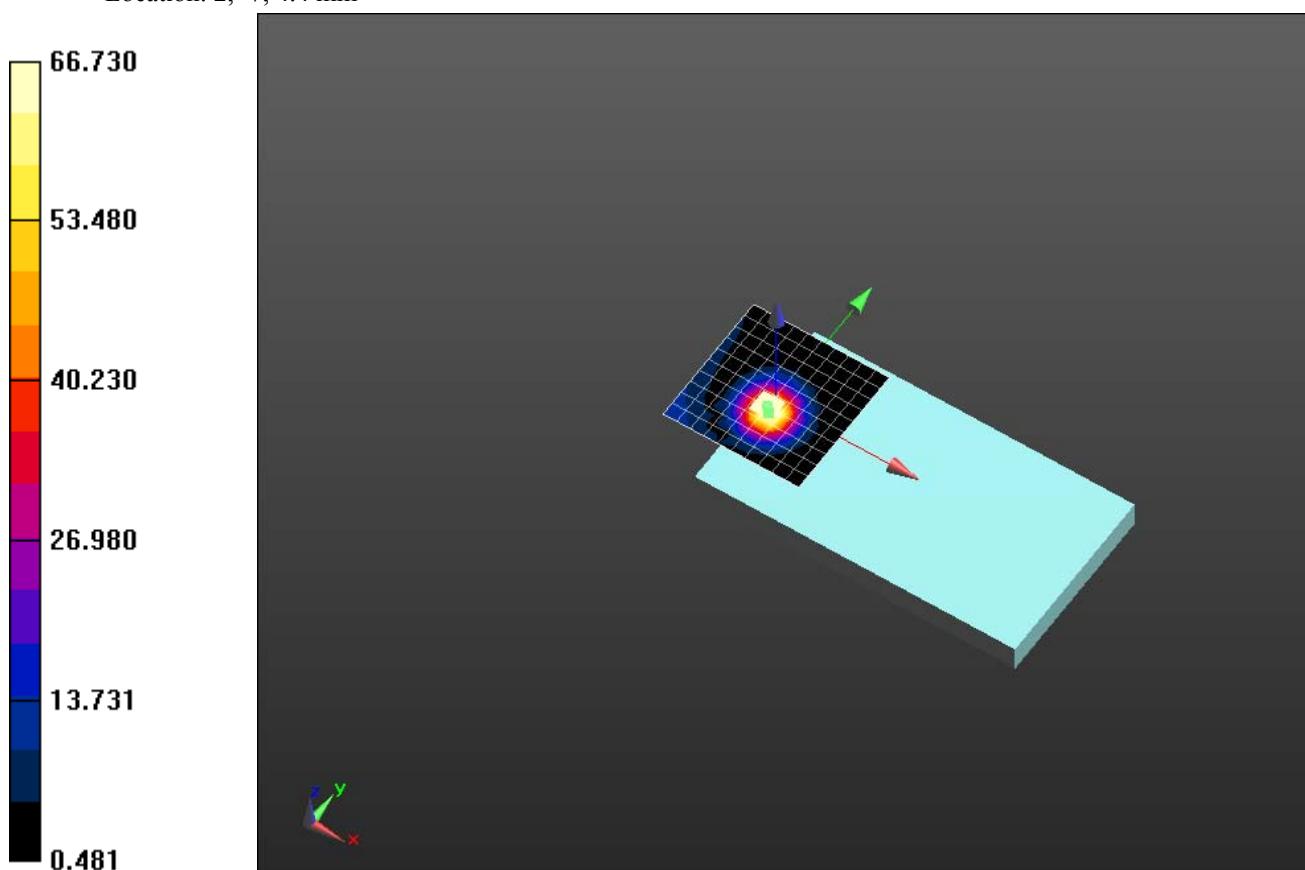
L6ARFL110LW**L6ARFP120LW****Cursor:**

ABM1/ABM2 = 36.20 dB

ABM1 comp = 15.42 dBA/m

BWC Factor = 0.16 dB

Location: 2, -7, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 71(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 8:03:24 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_radial L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/x (longitudinal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm,

dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

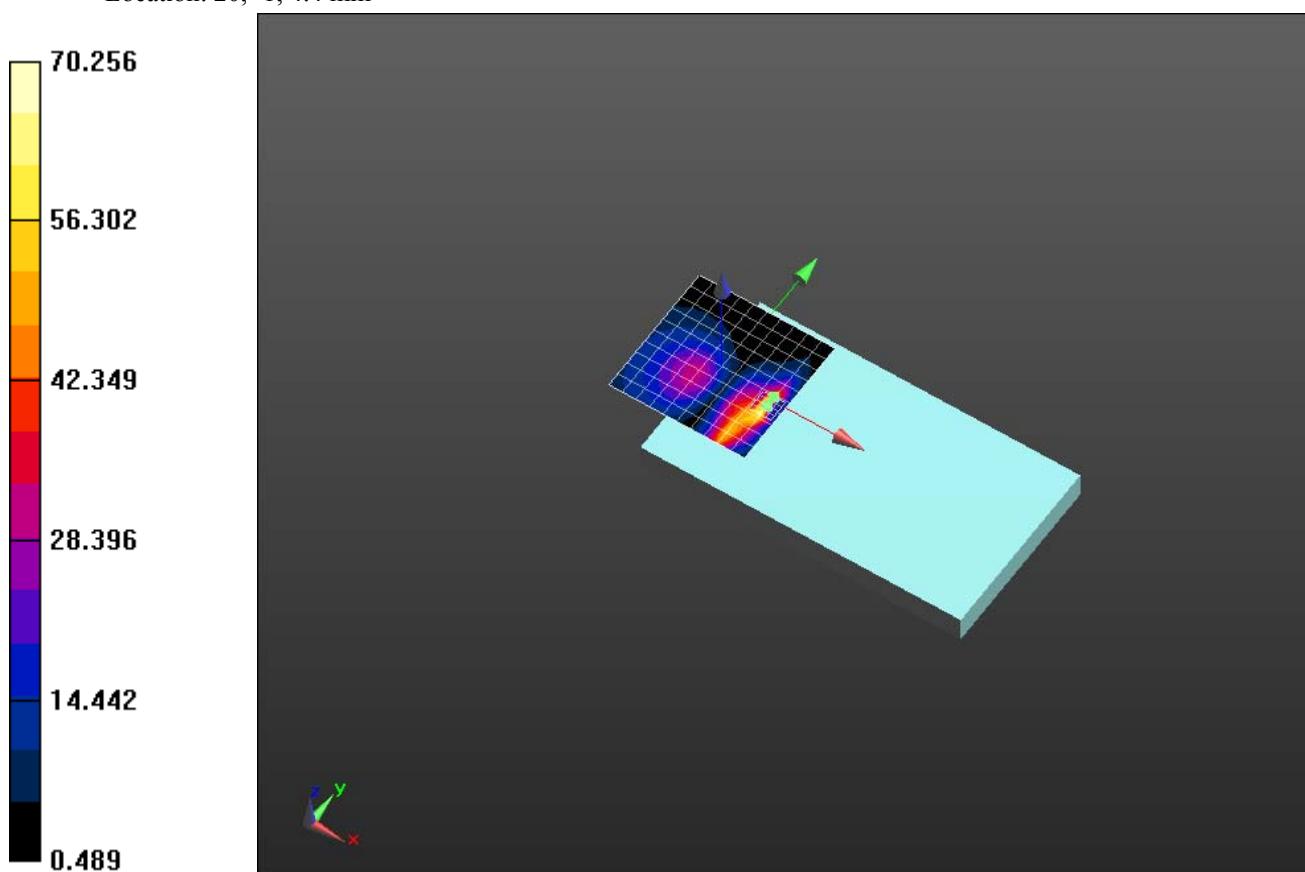
L6ARFL110LW**L6ARFP120LW****Cursor:**

ABM1/ABM2 = 34.82 dB

ABM1 comp = 3.07 dBA/m

BWC Factor = 0.16 dB

Location: 20, -1, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 73(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 8:16:49 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_radial T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850; Frequency: 824.2 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/y (transversal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

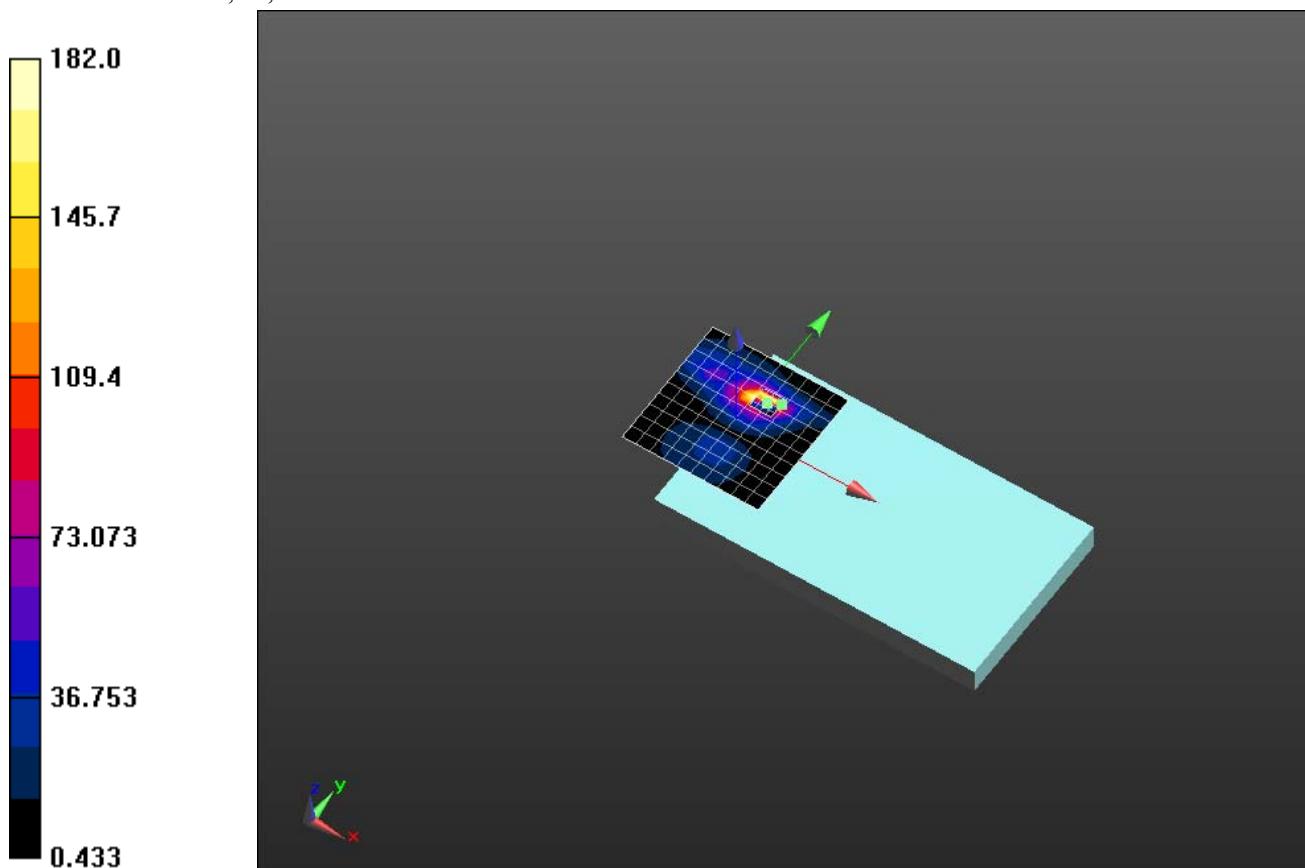
FCC ID

L6ARFL110LW**L6ARFP120LW**

**T-Coil scan_GSM850_1800mA_Battery/General Scan - Low channel/y
(transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1):** Measurement grid: dx=10mm,
dy=10mm
Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
Output Gain: 35.28
Measure Window Start: 300ms
Measure Window Length: 1000ms
BWC applied: 0.16 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 49.47 dB
ABM1 comp = 2.47 dBA/m
BWC Factor = 0.16 dB
Location: 9, 12, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 75(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 8:33:42 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM 1900_axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 1900; Frequency: 1850.2 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/z (axial) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

76(106)

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

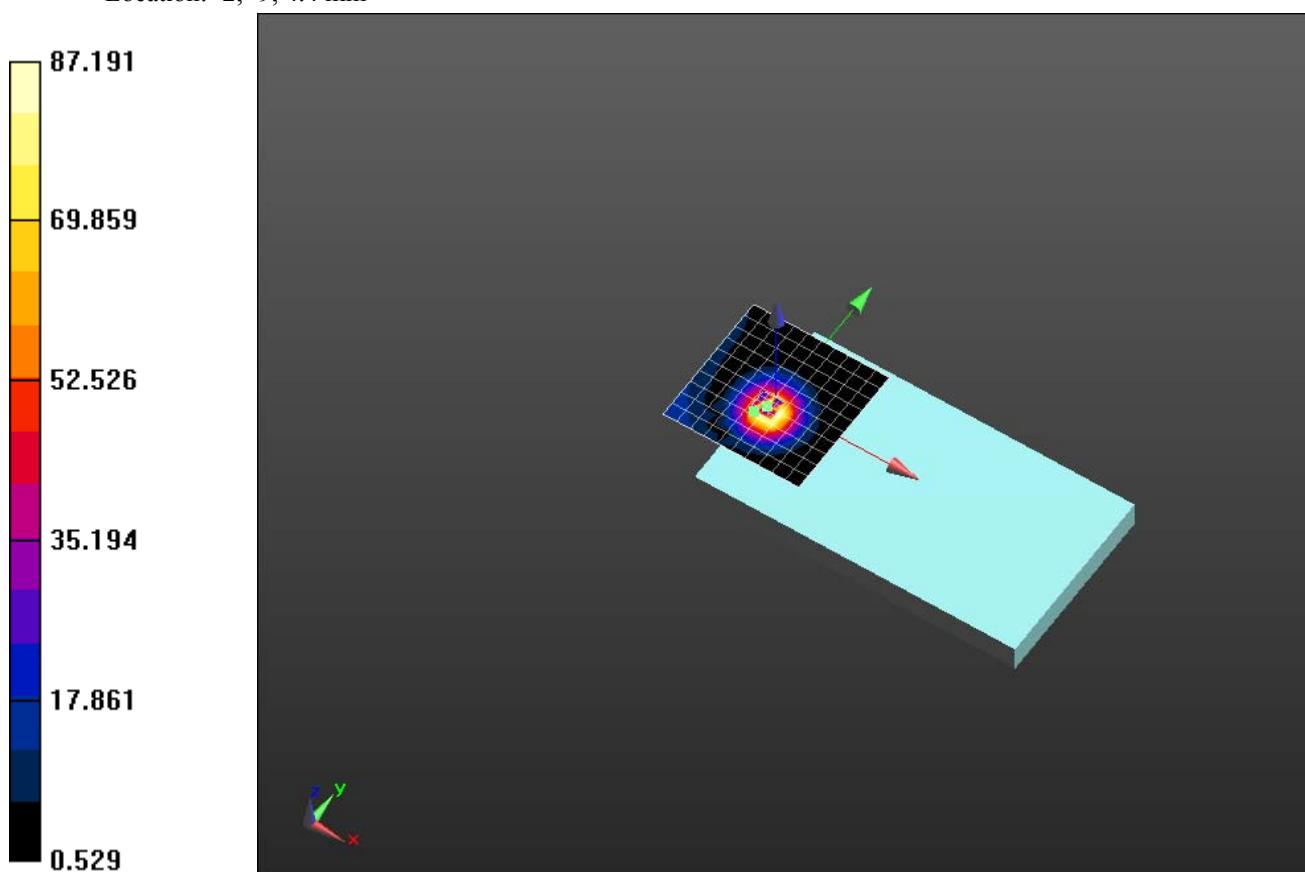
L6ARFL110LW**L6ARFP120LW****Cursor:**

ABM1/ABM2 = 35.10 dB

ABM1 comp = 10.12 dBA/m

BWC Factor = 0.16 dB

Location: -2, -9, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 77(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 8:47:02 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM 1900_radial L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 1900; Frequency: 1850.2 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/x (longitudinal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 78(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

ABM1/ABM2 = 36.40 dB
 ABM1 comp = 3.31 dBA/m
 BWC Factor = 0.16 dB
 Location: 20, -10, 3.7 mm

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 43.17 dB
 ABM1 comp = 1.94 dBA/m
 BWC Factor = 0.16 dB
 Location: 18, -14, 4.4 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

79(106)

Author Data

Daoud Attayi

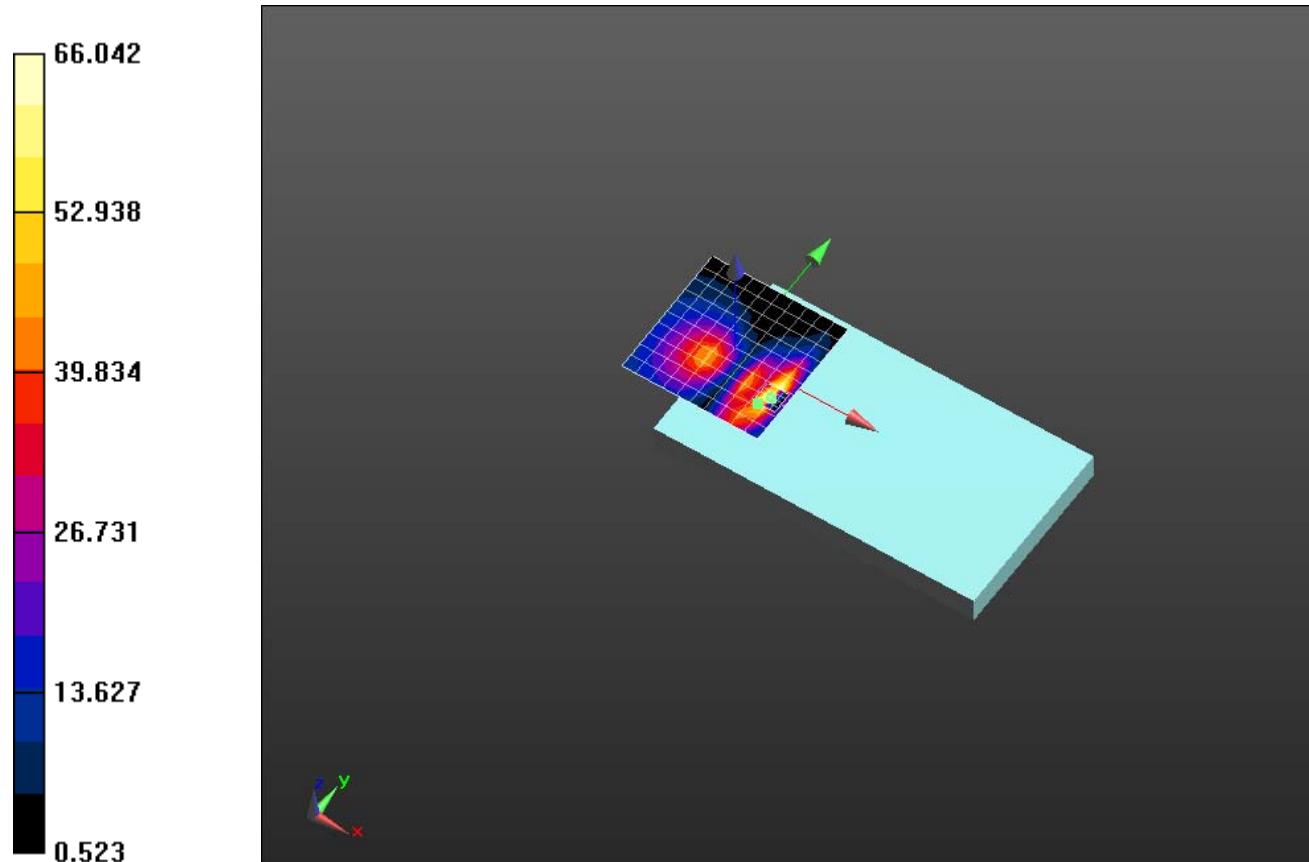
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 80(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 9:00:25 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_GSM 1900_radial T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 1900; Frequency: 1850.2 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/y (transversal)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 81(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

T-Coil scan_GSM1900_1800mA_Battery/General Scan - Low channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

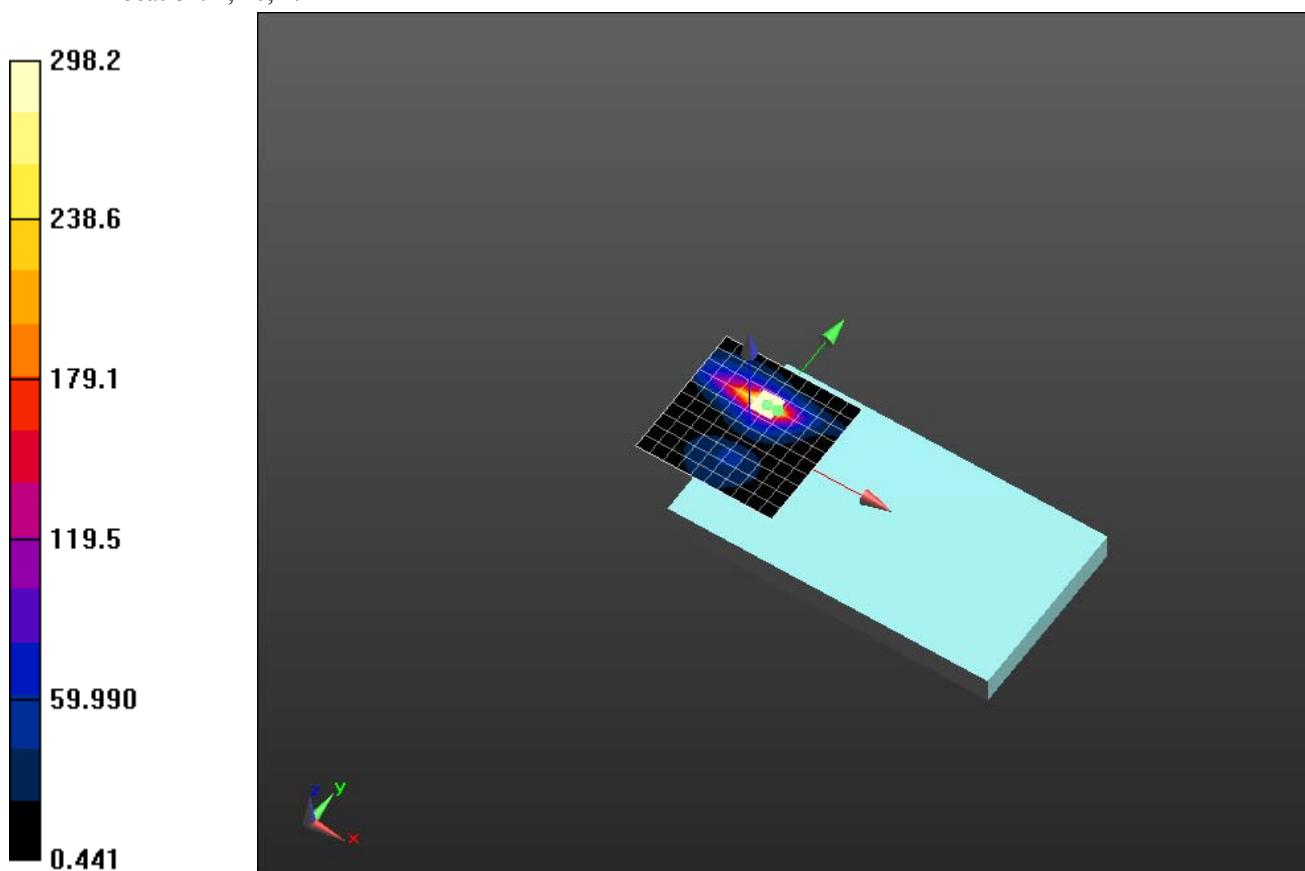
Cursor:

ABM1/ABM2 = 38.38 dB

ABM1 comp = 5.22 dBA/m

BWC Factor = 0.16 dB

Location: 4, 10, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 82(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 83(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 6:24:48 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS band IV_axial

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD IV; Frequency: 1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_UMTS_Band_IV_1800mA_Battery/General Scan - Low channel/z (axial)

5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 84(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_UMTS_Band_IV_1800mA_Battery/General Scan - Low channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 55.49 dB
 ABM1 comp = 16.18 dBA/m
 BWC Factor = 0.16 dB
 Location: 3, -6, 4.4 mm

T-Coil scan_UMTS_Band_IV_1800mA_Battery/8x8 Scan - Mid channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 48.04 dB
 ABM1 comp = 10.58 dBA/m
 BWC Factor = 0.16 dB
 Location: 7, -12, 4.4 mm

T-Coil scan_UMTS_Band_IV_1800mA_Battery/8x8 Scan - High channel/z (axial) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

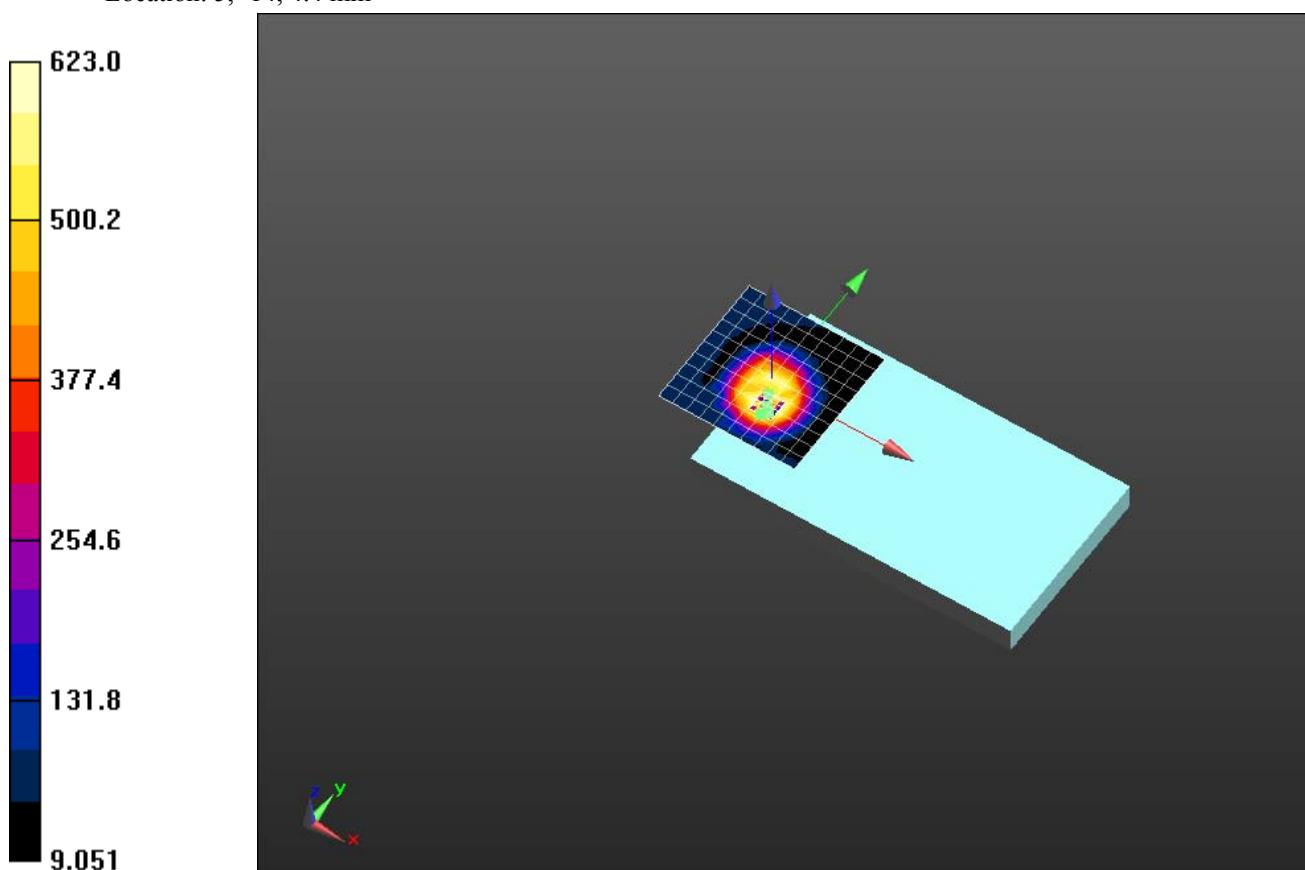
L6ARFL110LW**L6ARFP120LW****Cursor:**

ABM1/ABM2 = 54.91 dB

ABM1 comp = 7.81 dBA/m

BWC Factor = 0.16 dB

Location: 5, -14, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 86(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 6:38:09 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS band IV_radial L

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD IV; Frequency: 1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_UMTS_Band_IV_1800mA_Battery/General Scan - Low channel/x

(longitudinal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 87(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

T-Coil scan_UMTS_Band_IV_1800mA_Battery/General Scan - Low channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 53.82 dB
 ABM1 comp = 4.72 dBA/m
 BWC Factor = 0.16 dB
 Location: -9, -10, 4.4 mm

T-Coil scan_UMTS_Band_IV_1800mA_Battery/8x8 Scan - Mid channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 53.75 dB
 ABM1 comp = 4.65 dBA/m
 BWC Factor = 0.16 dB
 Location: -9, -10, 4.4 mm

T-Coil scan_UMTS_Band_IV_1800mA_Battery/8x8 Scan - High channel/x (longitudinal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Author Data

Daoud Attayi

Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

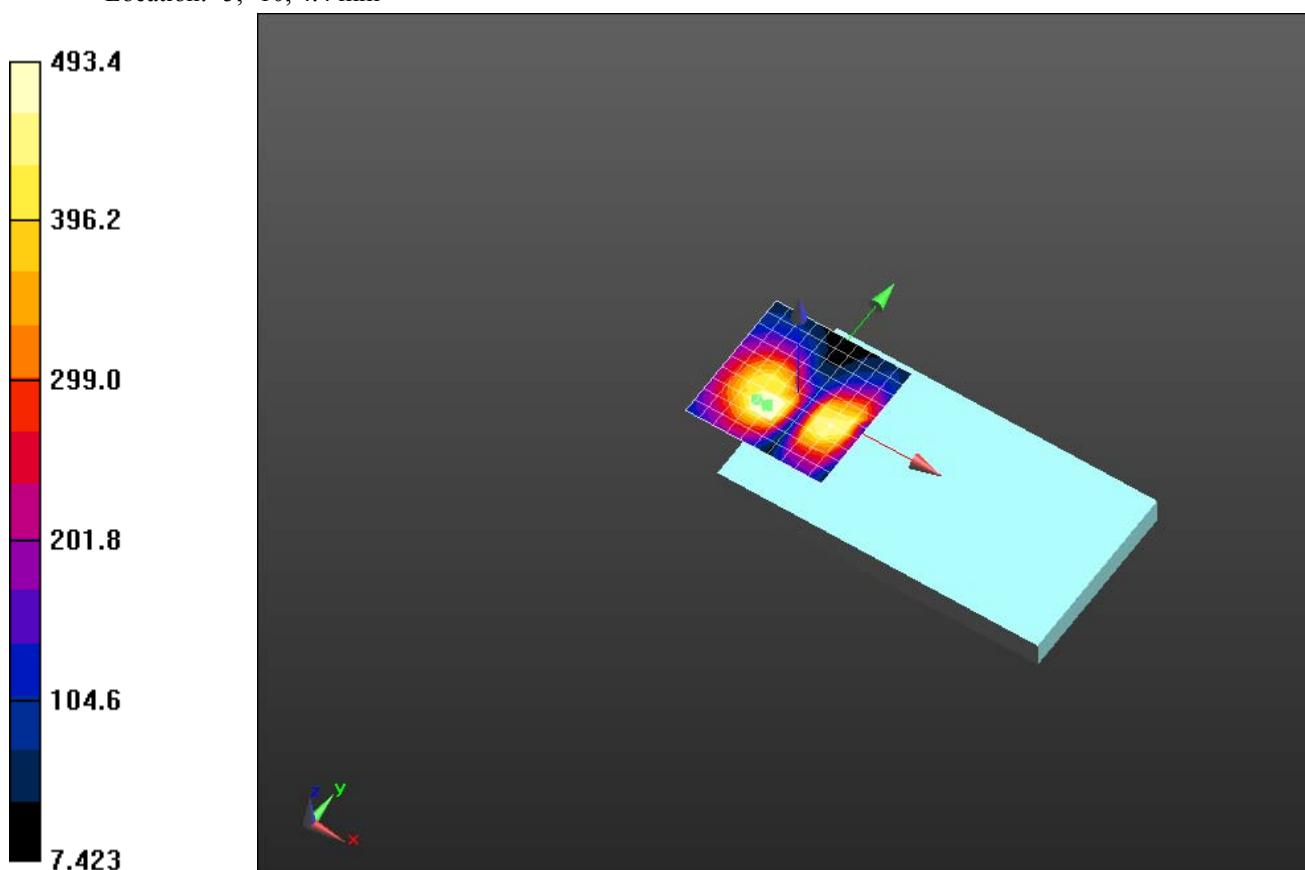
L6ARFL110LW**L6ARFP120LW****Cursor:**

ABM1/ABM2 = 52.72 dB

ABM1 comp = 6.41 dBA/m

BWC Factor = 0.16 dB

Location: -5, -10, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 89(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 12/20/2012 6:51:32 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_UMTS band IV_radial T

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: WCDMA FDD IV; Frequency: 1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz

Medium parameters used: $\sigma = 0$ S/m, $\epsilon_r = 1$; $\rho = 0$ kg/m³

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC T-Coil Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_UMTS_Band_IV_1800mA_Battery/General Scan - Low channel/y (transversal) 5.0mm 50 x 50/ABM SNR(x,y,z) (11x11x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav

Output Gain: 35.28

Measure Window Start: 300ms

Measure Window Length: 1000ms

BWC applied: 0.16 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 90(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

T-Coil scan_UMTS_Band_IV_1800mA_Battery/General Scan - Low channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

ABM1/ABM2 = 54.83 dB
 ABM1 comp = 7.55 dBA/m
 BWC Factor = 0.16 dB
 Location: 5, 5, 4.4 mm

T-Coil scan_UMTS_Band_IV_1800mA_Battery/8x8 Scan - Mid channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

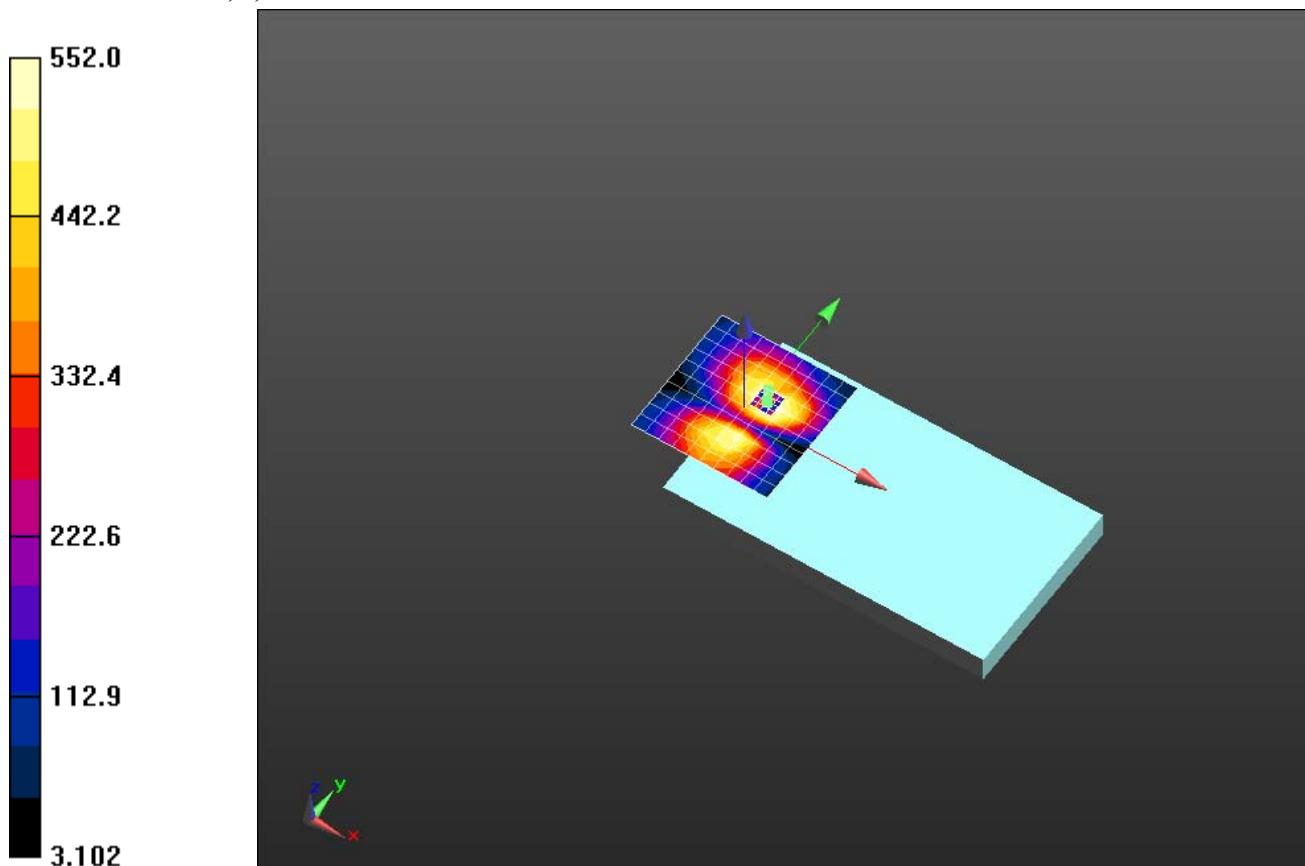
Cursor:

ABM1/ABM2 = 53.69 dB
 ABM1 comp = 5.55 dBA/m
 BWC Factor = 0.16 dB
 Location: 3, 9, 4.4 mm

T-Coil scan_UMTS_Band_IV_1800mA_Battery/8x8 Scan - High channel/y (transversal) 2mm 8 x 8/ABM SNR(x,y,z) (5x5x1): Measurement grid: dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_1kHz_1s.wav
 Output Gain: 35.28
 Measure Window Start: 300ms
 Measure Window Length: 1000ms
 BWC applied: 0.16 dB
 Device Reference Point: 0, 0, -6.3 mm

Author Data
Daoud AttayiDates of Test
**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**Report No
RTS-6026-1302-08FCC ID
**L6ARFL110LW
L6ARFP120LW****Cursor:**

ABM1/ABM2 = 54.59 dB
ABM1 comp = 7.47 dBA/m
BWC Factor = 0.16 dB
Location: 5, 5, 4.4 mm



	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 92(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Date/Time: 2/13/2013 12:53:46 PM

Test Laboratory: RIM Testing Services

HAC T-Coil_ABM_FR

DUT: BlackBerry Smartphone; Type: Sample ; Serial: 25CF0AD8

Communication System: GSM 850, Communication System: GSM 1900, Communication System: WCDMA FDD IV; Frequency: 824.2 MHz, Frequency: 1850.2 MHz, Frequency: 1712.4 MHz, Frequency: 1732.6 MHz, Frequency: 1752.6 MHz

Medium parameters used: $\sigma = 0 \text{ S/m}$, $\epsilon_r = 1$; $\rho = 0 \text{ kg/m}^3$

Phantom section: TCoil Section

Measurement Standard: DASY5 (IEEE/IEC/ANSI C63.19-2007)

DASY Configuration:

- Probe: AM1DV3 - 3062; ; Calibrated: 1/12/2012
- Sensor-Surface: 0mm (Fix Surface), z = 3.0
- Electronics: DAE3 Sn472; Calibrated: 3/7/2012
- Phantom: HAC RF Test Arch with AMCC; Type: SD HAC P01 BA; Serial: **Not Specified**
- DASY52 52.8.4(1052); SEMCAD X 14.6.8(7028)

T-Coil scan_GSM850_1800mA_Battery/FR GSM 850 Low Chan/z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav

Output Gain: 69.12

Measure Window Start: 300ms

Measure Window Length: 2000ms

BWC applied: 10.80 dB

Device Reference Point: 0, 0, -6.3 mm

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 93(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Cursor:

Diff = 0.65 dB
 BWC Factor = 10.80 dB
 Location: 4.8, -4.9, 3 mm

T-Coil scan_GSM850_1800mA_Battery/FR GSM 1900 Low Chan/z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid: dx=10mm, dy=10mm

Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 300ms
 Measure Window Length: 2000ms
 BWC applied: 10.80 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.70 dB
 BWC Factor = 10.80 dB
 Location: 4.8, -4.9, 3 mm

T-Coil scan_GSM850_1800mA_Battery/FR WCDMA Band IV Low Chan 2/z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid:

dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 300ms
 Measure Window Length: 2000ms
 BWC applied: 10.81 dB
 Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.66 dB
 BWC Factor = 10.81 dB
 Location: 4.8, -4.9, 3 mm

T-Coil scan_GSM850_1800mA_Battery/FR WCDMA Band IV Mid Chan/z (axial) wideband at best S/N/ABM Freq Resp(x,y,z,f) (1x1x1): Measurement grid:

dx=10mm, dy=10mm
 Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
 Output Gain: 69.12
 Measure Window Start: 300ms
 Measure Window Length: 2000ms
 BWC applied: 10.80 dB
 Device Reference Point: 0, 0, -6.3 mm



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page
94(106)Author Data
Daoud AttayiDates of Test
**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**Report No
RTS-6026-1302-08FCC ID
**L6ARFL110LW
L6ARFP120LW****Cursor:**

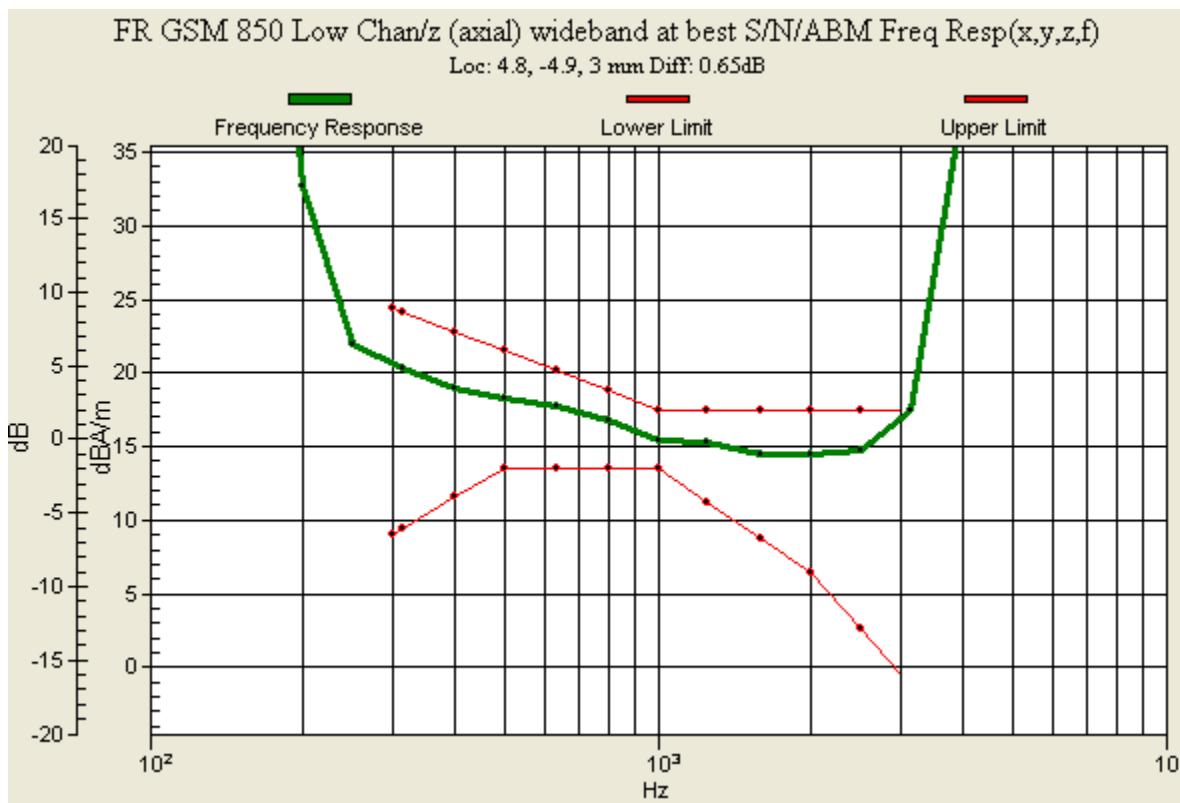
Diff = 0.76 dB
BWC Factor = 10.80 dB
Location: 4.8, -4.9, 3 mm

**T-Coil scan_GSM850_1800mA_Battery/FR WCDMA Band IV High Chan/z
(axial) wideband at best SN/ABM Freq Resp(x,y,z,f) (1x1x1):** Measurement grid:

dx=10mm, dy=10mm
Signal Type: Audio File (.wav) 48k_voice_300-3000_2s.wav
Output Gain: 69.12
Measure Window Start: 300ms
Measure Window Length: 2000ms
BWC applied: 10.80 dB
Device Reference Point: 0, 0, -6.3 mm

Cursor:

Diff = 0.56 dB
BWC Factor = 10.80 dB
Location: 4.8, -4.9, 3 mm





Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

95(106)

Author Data

Daoud Attayi

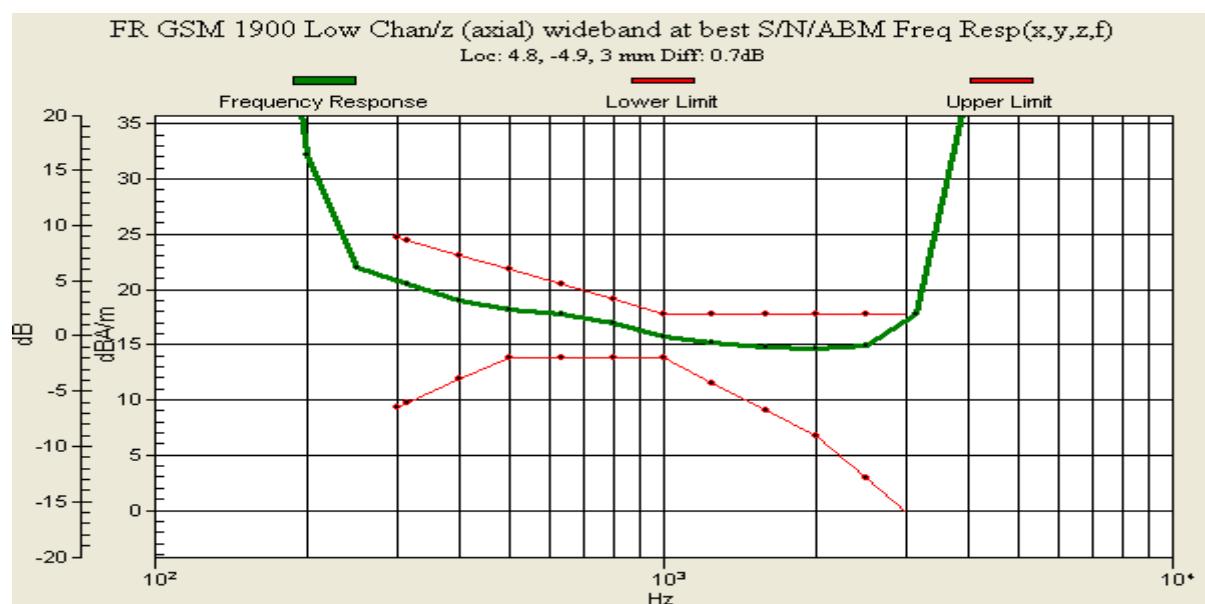
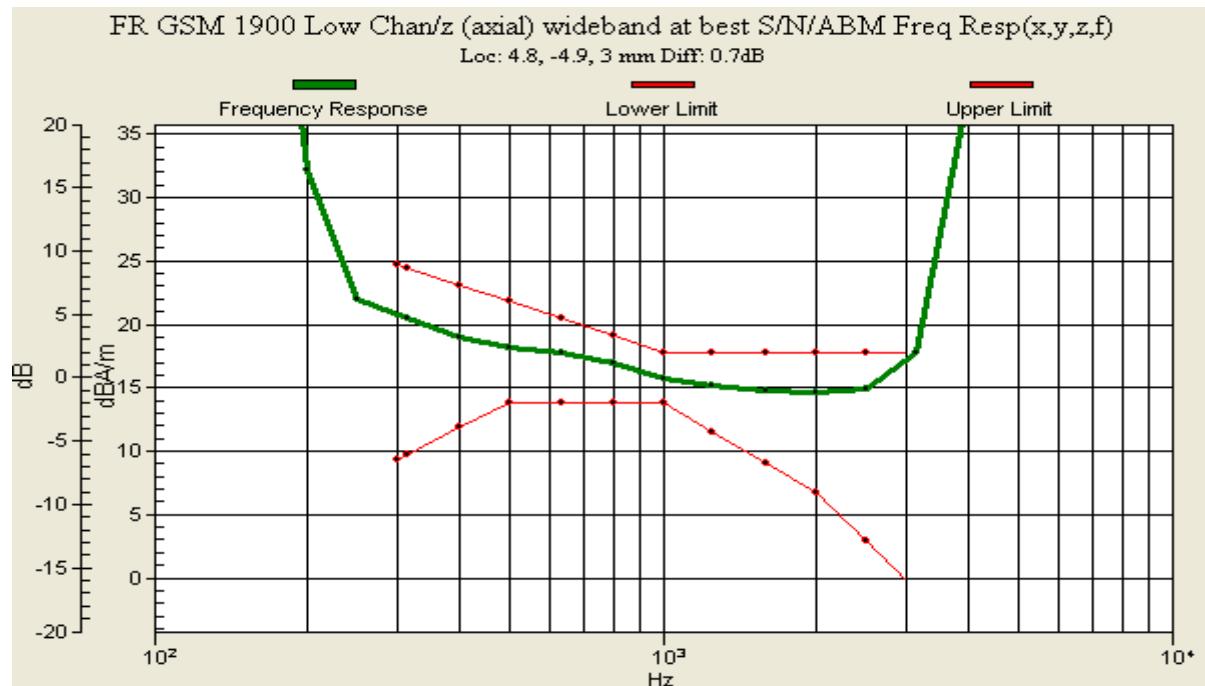
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

96(106)

Author Data

Daoud Attayi

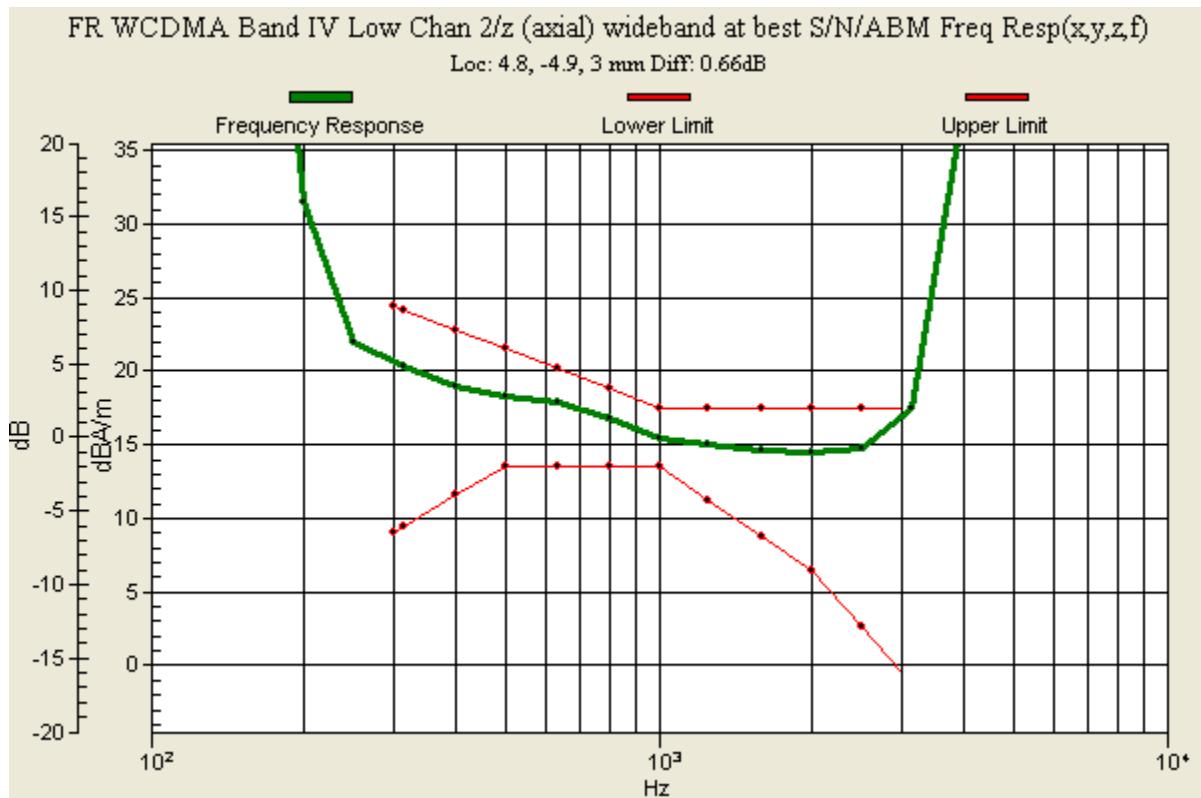
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

**L6ARFL110LW
L6ARFP120LW**



Document

**Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW**

Page

97(106)

Author Data

Daoud Attayi

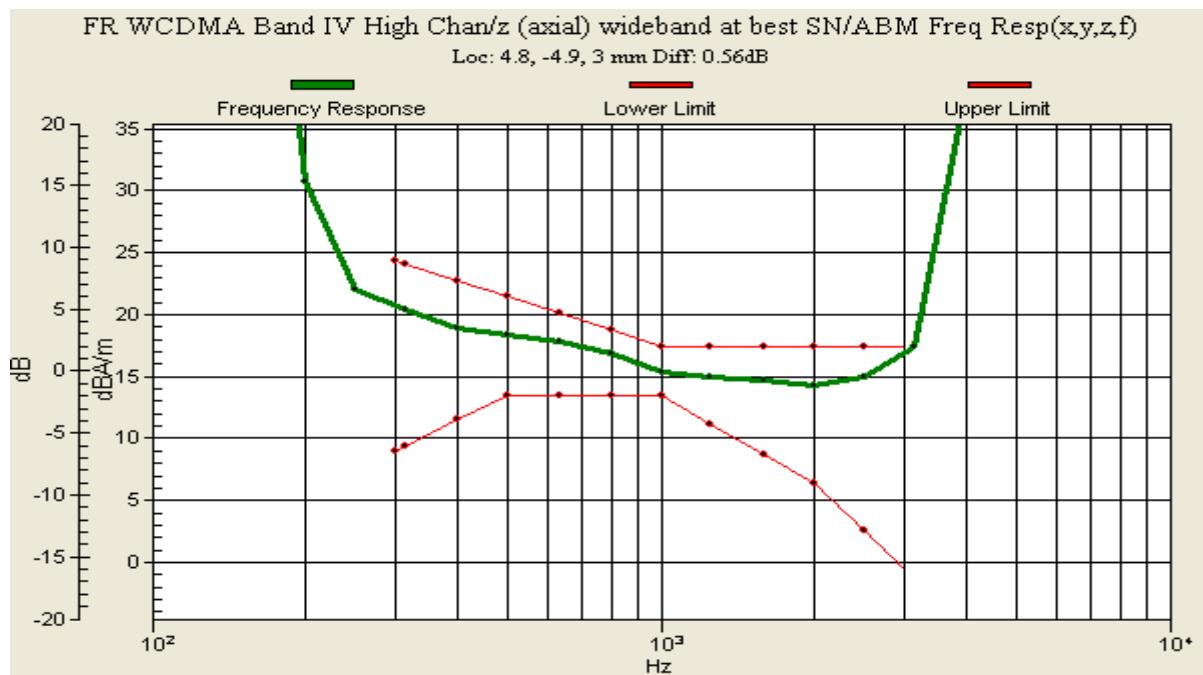
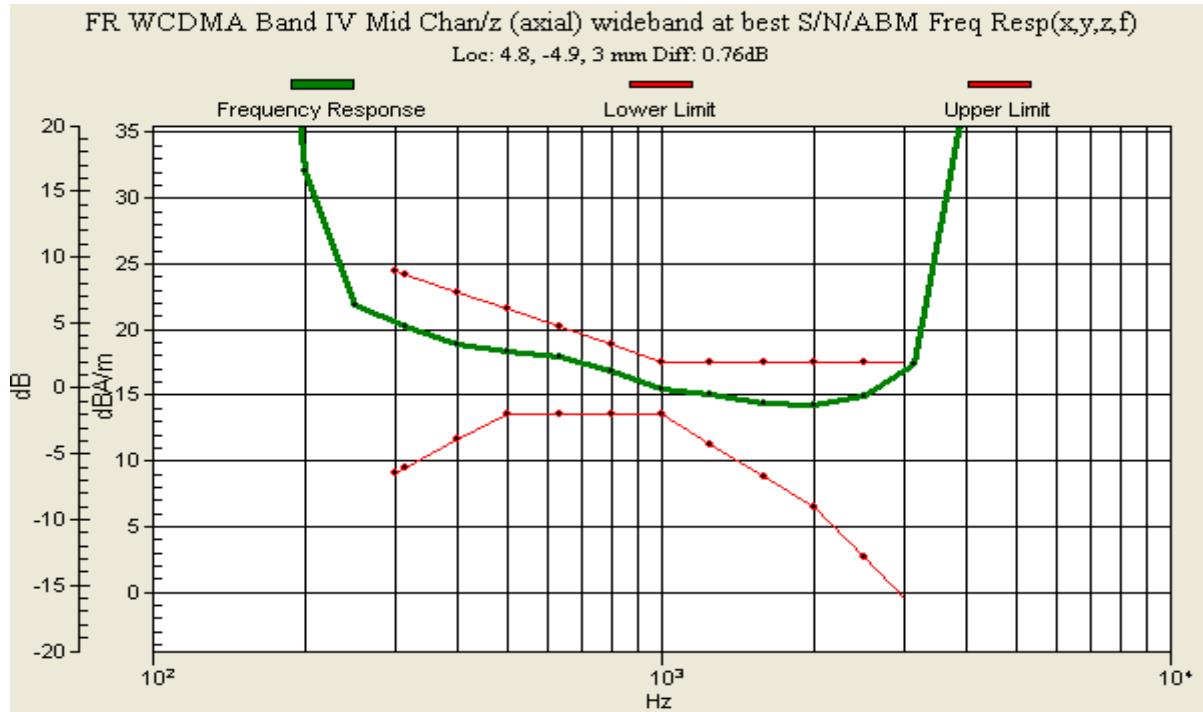
Dates of Test

**Dec. 19, 2012, Jan. 25, Feb.
13, 2013**

Report No

RTS-6026-1302-08

FCC ID

L6ARFL110LW**L6ARFP120LW**

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 98(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08

Annex D: Probe/TMFS calibration certificate

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 99(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

Calibration Laboratory of
Schmid & Partner
Engineering AG
Zeughausstrasse 43, 8004 Zurich, Switzerland



S Schweizerischer Kalibrierdienst
C Service suisse d'étalonnage
S Servizio svizzero di taratura
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)

Accreditation No.: **SCS 108**

The Swiss Accreditation Service is one of the signatories to the EA
Multilateral Agreement for the recognition of calibration certificates

Client **RTS (RIM Testing Services)**

Certificate No: **AM1DV3-3062_Jan13**

CALIBRATION CERTIFICATE

Object **AM1DV3 - SN: 3062**

Calibration procedure(s) **QA CAL-24.v3**
Calibration procedure for AM1D magnetic field probes and TMFS in the audio range

Calibration date: **January 10, 2013**

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI). The measurements and the uncertainties with confidence probability are given on the following pages and are part of the certificate.

All calibrations have been conducted in the closed laboratory facility: environment temperature $(22 \pm 3)^\circ\text{C}$ and humidity $< 70\%$.

Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID #	Cal Date (Certificate No.)	Scheduled Calibration
Keithley Multimeter Type 2001	SN: 0610278	02-Oct-12 (No:12726)	Oct-13
Reference Probe AM1DV2	SN: 1008	10-Jan-13 (No. AM1D-1008_Jan13)	Jan-14
DAE4	SN: 781	29-May-12 (No. DAE4-781_May12)	May-13

Secondary Standards	ID #	Check Date (in house)	Scheduled Check
AMCC	1050	12-Oct-11 (in house check Oct-11)	Oct-13
AMMI Audio Measuring Instrument	1062	26-Sep-12 (in house check Sep-12)	Sep-14

Calibrated by: Name **Dinice Iliev** Function **Laboratory Technician** Signature

Approved by: Name **Fin Bernhoff** Function **Deputy Technical Manager** Signature

Issued: **January 10, 2013**

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 100(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

References

- [1] ANSI C63.19-2007
American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY5 manual, Chapter: Hearing Aid Compatibility (HAC) T-Coil Extension

Description of the AM1D probe

The AM1D Audio Magnetic Field Probe is a fully shielded magnetic field probe for the frequency range from 100 Hz to 20 kHz. The pickup coil is compliant with the dimensional requirements of [1]. The probe includes a symmetric low noise amplifier for the signal available at the shielded 3 pin connector at the side. Power is supplied via the same connector (phantom power supply) and monitored via the LED near the connector. The 7 pin connector at the end of the probe does not carry any signals, but determines the angle of the sensor when mounted on the DAE. The probe supports mechanical detection of the surface.

The single sensor in the probe is arranged in a tilt angle allowing measurement of 3 orthogonal field components when rotating the probe by 120° around its axis. It is aligned with the perpendicular component of the field, if the probe axis is tilted nominally 35.3° above the measurement plane, using the connector rotation and sensor angle stated below.

The probe is fully RF shielded when operated with the matching signal cable (shielded) and allows measurement of audio magnetic fields in the close vicinity of RF emitting wireless devices according to [1] without additional shielding.

Handling of the item

The probe is manufactured from stainless steel. In order to maintain the performance and calibration of the probe, it must not be opened. The probe is designed for operation in air and shall not be exposed to humidity or liquids. For proper operation of the surface detection and emergency stop functions in a DASY system, the probe must be operated with the special probe cup provided (larger diameter).

Methods Applied and Interpretation of Parameters

- *Coordinate System:* The AM1D probe is mounted in the DASY system for operation with a HAC Test Arch phantom with AMCC Helmholtz calibration coil according to [2], with the tip pointing to "southwest" orientation.
- *Functional Test:* The functional test preceding calibration includes test of Noise level
RF immunity (1kHz AM modulated signal). The shield of the probe cable must be well connected. Frequency response verification from 100 Hz to 10 kHz.
- *Connector Rotation:* The connector at the end of the probe does not carry any signals and is used for fixation to the DAE only. The probe is operated in the center of the AMCC Helmholtz coil using a 1 kHz magnetic field signal. Its angle is determined from the two minima at nominally +120° and -120° rotation, so the sensor in the tip of the probe is aligned to the vertical plane in z-direction, corresponding to the field maximum in the AMCC Helmholtz calibration coil.
- *Sensor Angle:* The sensor tilting in the vertical plane from the ideal vertical direction is determined from the two minima at nominally +120° and -120°. DASY system uses this angle to align the sensor for radial measurements to the x and y axis in the horizontal plane.
- *Sensitivity:* With the probe sensor aligned to the z-field in the AMCC, the output of the probe is compared to the magnetic field in the AMCC at 1 kHz. The field in the AMCC Helmholtz coil is given by the geometry and the current through the coil, which is monitored on the precision shunt resistor of the coil.

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 101(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

AM1D probe identification and configuration data

Item	AM1DV3 Audio Magnetic 1D Field Probe
Type No	SP AM1 001 BA
Serial No	3062

Overall length	296 mm
Tip diameter	6.0 mm (at the tip)
Sensor offset	3.0 mm (centre of sensor from tip)
Internal Amplifier	20 dB

Manufacturer / Origin	Schmid & Partner Engineering AG, Zürich, Switzerland
Manufacturing date	October 30, 2008
Last calibration date	January 12, 2012

Calibration data

Connector rotation angle	(in DASY system)	61.0 °	+/- 3.6 ° (k=2)
Sensor angle	(in DASY system)	0.25 °	+/- 0.5 ° (k=2)
Sensitivity at 1 kHz	(in DASY system)	0.00741 V / (A/m)	+/- 2.2 % (k=2)

The reported uncertainty of measurement is stated as the standard uncertainty of measurement multiplied by the coverage factor k=2, which for a normal distribution corresponds to a coverage probability of approximately 95%.



Document

Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil
Test Report for BlackBerry® Smartphone model RFL111LW,
RFP121LW

Page

102(106)

Author Data
Daoud AttayiDates of Test
Dec. 19, 2012, Jan. 25, Feb. 13, 2013Report No
RTS-6026-1302-08FCC ID
L6ARFL110LW
L6ARFP120LW

Calibration Laboratory of
Schmid & Partner
Engineering AG
Zeughausstrasse 43, 8004 Zurich, Switzerland



S Schweizerischer Kalibrierdienst
C Service suisse d'étalonnage
C Servizio svizzero di taratura
S Swiss Calibration Service

Accredited by the Swiss Accreditation Service (SAS)
The Swiss Accreditation Service is one of the signatories to the EA
Multilateral Agreement for the recognition of calibration certificates

Accreditation No.: **SCS 108**Client **RTS (RIM Testing Services)**Certificate No: **TMFS_1003_Nov11**

CALIBRATION CERTIFICATE

Object / Identification **TMFS - SN: 1003**

Calibration procedure(s) **QA CAL-24.v2**
Calibration procedure for AM1D magnetic field probes and TMFS in the
audio range

Calibration date **November 30, 2011**

This calibration certificate documents the traceability to national standards, which realize the physical units of measurements (SI).
The calibrations have been conducted in the R&D laboratory facility: environment temperature $(22 \pm 3)^\circ\text{C}$ and humidity $< 70\%$.

Calibration Equipment used (M&TE critical for calibration)

Primary Standards	ID #	Cal Date (Calibrated by, Certificate No.)	Scheduled Calibration
Keithley Multimeter Type 2001	SN: 0810278	28-Sep-11 (No:11450)	Sep-12
Secondary Standards	ID #	Cal / Check Date	Scheduled Calibration Check
AMCC	1050	12-Oct-11 (in house check Oct-11)	Oct-13
Reference Probe AM1DV2	SN: 1008	18-Jan-11 (No. AM1D-1008_Jan11)	Jan-12
AMMI Audio Measuring Instrument	1062	20-Sep-10 (in house check Sep-10)	Sep-12
Agilent WF Generator 33120A	MY40005266	12-Oct-11 (in house check Oct-11)	Oct-13

Calibrated by:

Name
Claudio LeiblerFunction
Laboratory Technician

Approved by:

Fin Bomholt

R&D Director

Issued: December 5, 2011

This calibration certificate shall not be reproduced except in full without written approval of the laboratory.

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 103(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

References

- [1] ANSI-C63.19-2007 American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids.
- [2] DASY manual, Chapter "Hearing Aid Compatibility (HAC) T-Coil Extension"

Methods Applied and Interpretation of Parameters

- **Coordinate System:** The TMFS is mounted underneath the HAC Test Arch touching equivalently to a wireless device according to [2] 29.2.2.: In "North" orientation, the TMFS signal connector is directed to the north, with x and y axes of TMFS and Test arch coinciding (see fig. 1). The rotational symmetry axis of the TMFS is aligned to the center of the HAC test Arch. For East, South and West configuration, the TMFS has been rotated clockwise in steps of 90°, so the connector looks into the specified direction. The evaluation of the radial direction is referenced to the device orientation (x equivalent to South direction).
- **Measurement Plane:** In coincidence with standard [1], the measurement plane (probe sensor center) is selected to be at a distance of 10 mm above the the surface of the TMFS touching the frame. The 50 x 50 mm scan area is aligned to the center of the unit. The scanning plane is verified to be parallel to the phantom frame before the measurements using the predefined "Geometry and signal check" procedure according to the predefined procedures described in [2].
- **Measurement Conditions:** Calibration of AM1D probe and AMMI are according to [2]. The 1 kHz sine signal for the level measurement is supplied from an external, independent generator via a BNC cable to TMFS IN and monitored at TMFS OUT with an independent RMS voltmeter or Audio Analyzer. The level is set to 0.5 Vrms and monitored during the scans.
- For the *frequency response*, a higher suppression of the background ambient magnetic field over the full frequency range was achieved by placing the TMFS in a magnetically shielded box. The AM1D probe was fixed without robot positioner near the axial maximum for this measurement. The background noise suppression was typ. 30 dB at 100 Hz (minimum) and 42 dB at 1 kHz. The predefined multisine signal (48k_multisine_50-10000_10s.wav) was used and evaluated in the third-octave bands from 100 Hz to 10000 Hz.

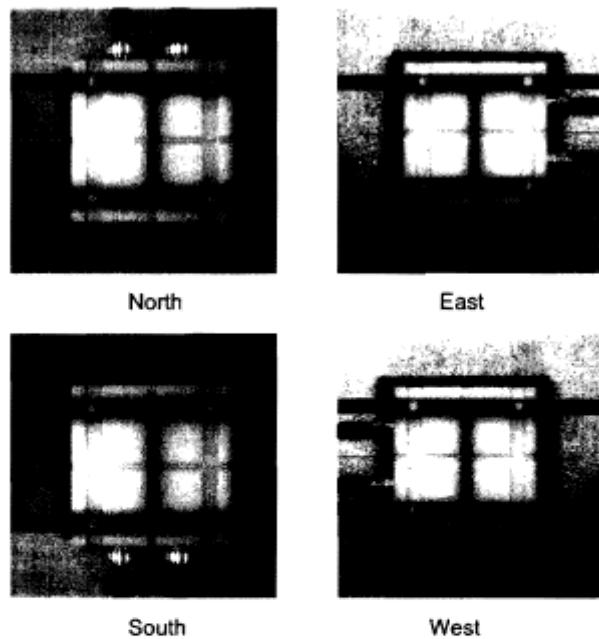


Fig. 1 TMFS scanning measurement configurations

	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 104(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

1 Measurement Conditions

DASY system configuration, as far as not given on page 1.

DASY Version	DASY5	V52.6.2 (482)
DASY PP Version	SEMCAD	V14.4.5 (3634)
Phantom	HAC Test Arch	SD HAC P01 BA, #1002
Distance TMFS Top - Probe Centre	10 mm	
Scan resolution	dx, dy = 5 mm	area = 50 x 50 mm
Frequency	for field scans	1 kHz
Signal level to TMFS	for field scans	500 mV RMS
Signal	for frequency response	multisine signal 50-10000 Hz, each third-octave band

Table 1: System configuration

2 Axial Maximum Field

Configuration	East	South	West	North	Subset Average	Average
Axial Max	-20.36	-20.35	-20.36	-20.35		-20.36
TMFS Y Axis 1st Max	-26.11	-26.06	-26.11	-26.07		
TMFS Y Axis 2nd Max	-26.15	-26.15	-26.29	-26.16		
Longitudinal Max Avg	-26.13	-26.11	-26.20	-26.12		-26.14
TMFS X Axis 1st Max	-25.95	-25.99	-26.02	-25.94		
TMFS X Axis 2nd Max	-25.91	-25.89	-25.95	-25.95		
Transversal Max Avg	-25.93	-25.94	-25.99	-25.95		-25.95
Radial Max			-26.09			-26.04

Table 2: Axial and radial field maxima measured with probe center at 10mm distance in dB A/m

The maximum was calculated as the average from the values measured in the 4 orientations listed in table 2.

Axial Maximum -20.36 dB A/m (+/- 0.33dB, k=2)

3 Radial Maximum Field

In addition, the average from the 16 maxima of the radial field listed in table 2 (measured at 10mm) was calculated:

Radial Maximum -26.04 dB A/m

RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 105(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 FCC ID L6ARFL110LW L6ARFP120LW

4 Appendix

4.1 Frequency response

Max. deviation measured, relative to 1 kHz: min. -0.03, max. 0.01 dB

Frequency [Hz]	Response [dB]
100	0.01
125	0.00
160	-0.03
200	0.00
250	-0.01
315	0.00
400	0.00
500	0.00
630	0.00
800	0.00
1000	0.00
1250	-0.01
1600	-0.01
2000	-0.01
2500	-0.01
3150	-0.01
4000	-0.02
5000	-0.02
6300	-0.03
8000	-0.03
10000	-0.03

Table 3: Frequency response

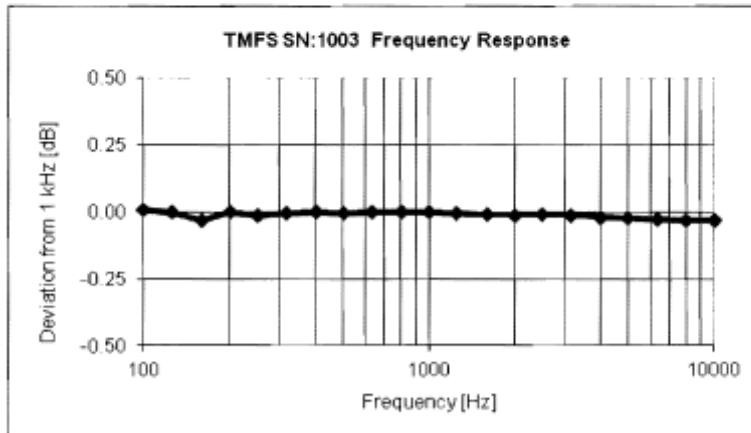


Fig. 2 Frequency response 100 to 10'000 Hz

 RIM Testing Services™	Document Hearing Aid Compatibility Audio Band Magnetic (ABM) T-Coil Test Report for BlackBerry® Smartphone model RFL111LW, RFP121LW	Page 106(106)
Author Data Daoud Attayi	Dates of Test Dec. 19, 2012, Jan. 25, Feb. 13, 2013	Report No RTS-6026-1302-08 L6ARFL110LW L6ARFP120LW

4.2 Field plots

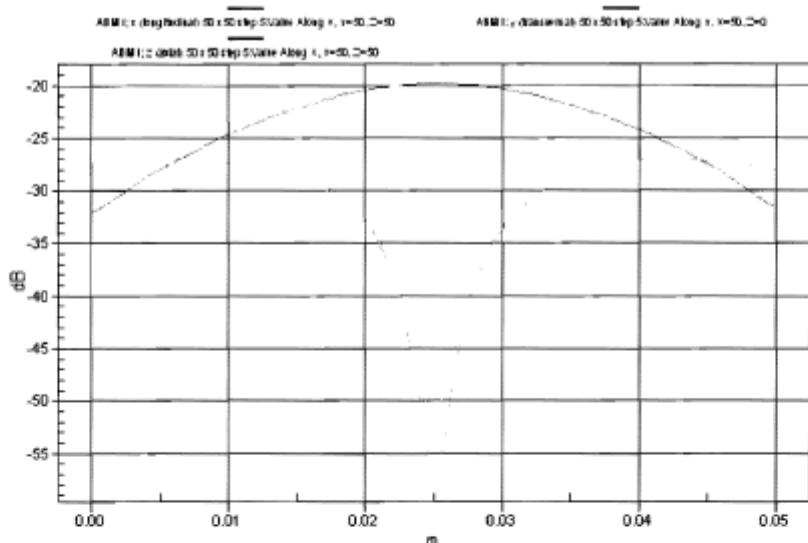


Fig. 3: Typical 2D field plots for x (red), y (green) and z (blue) components

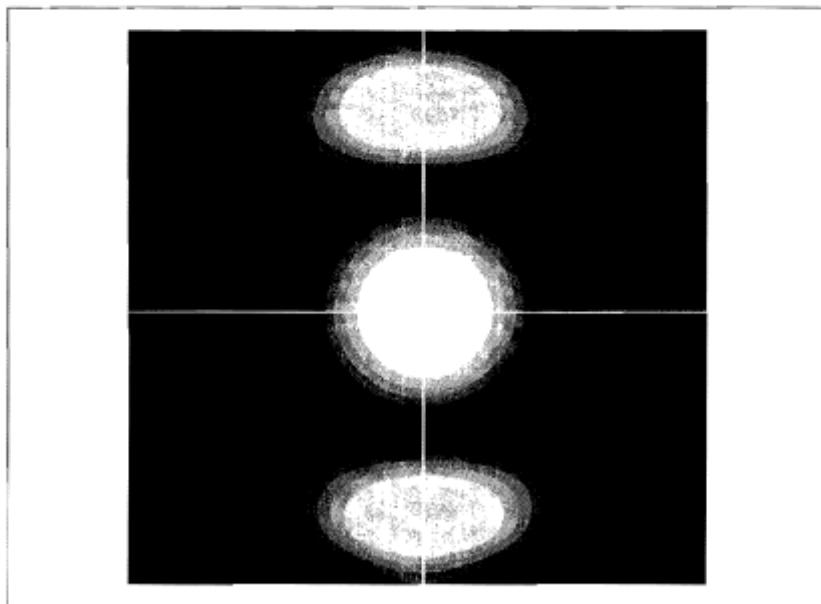


Fig. 4: Superposed field plots of z (axial), x and y radial magnetic field, 50 x 50 mm, individual scaling: white = max. field level, black = -4dB below max. The lines show the position of the 2D field plot of figure 3.