




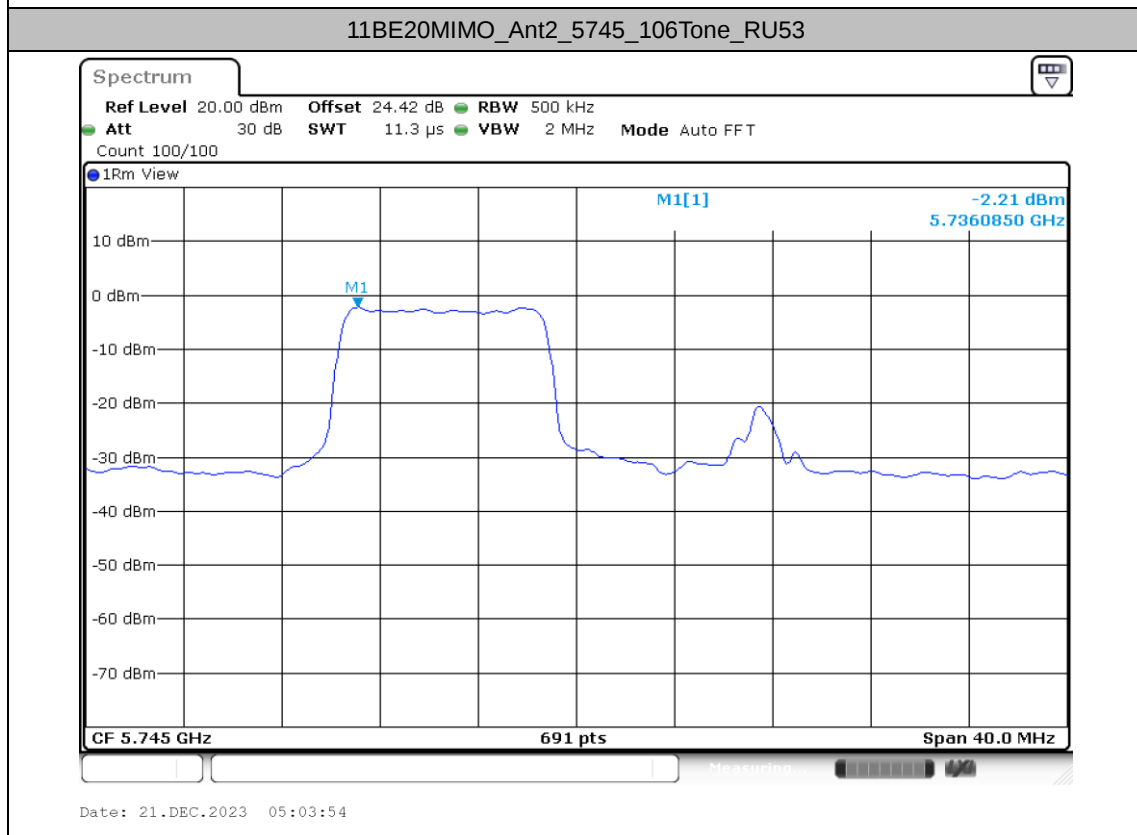
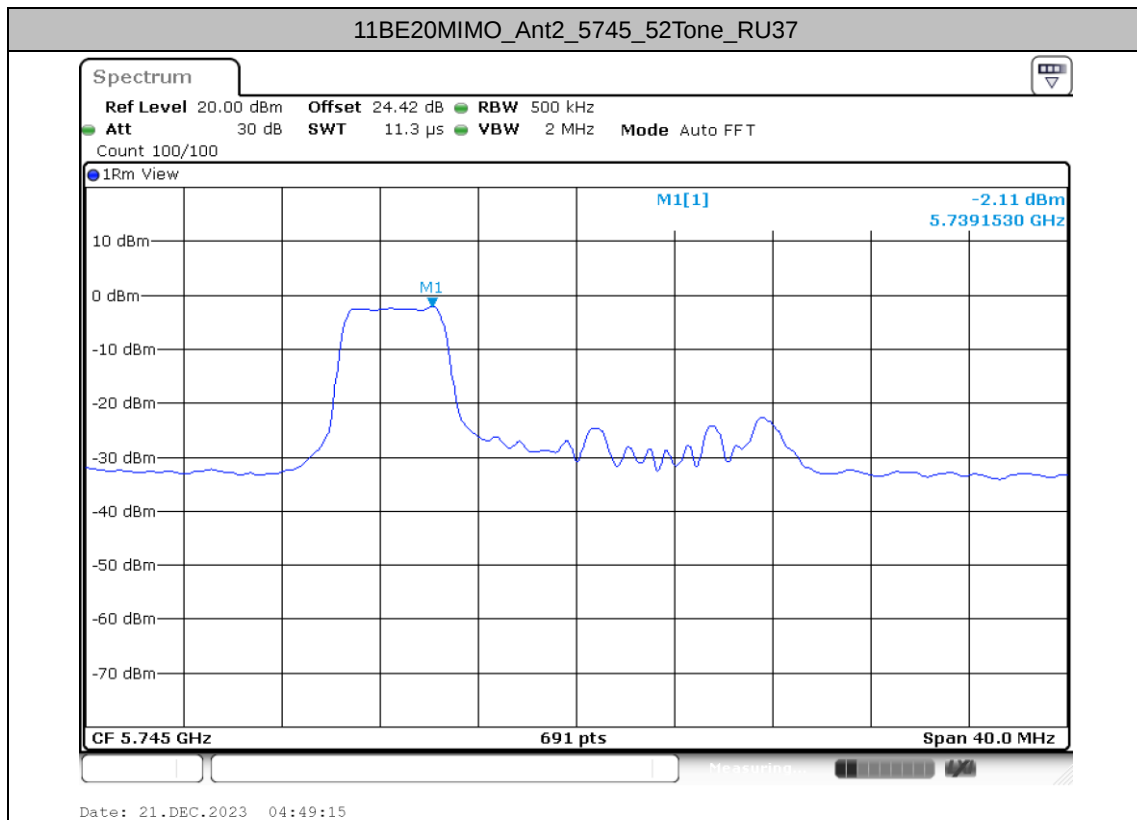


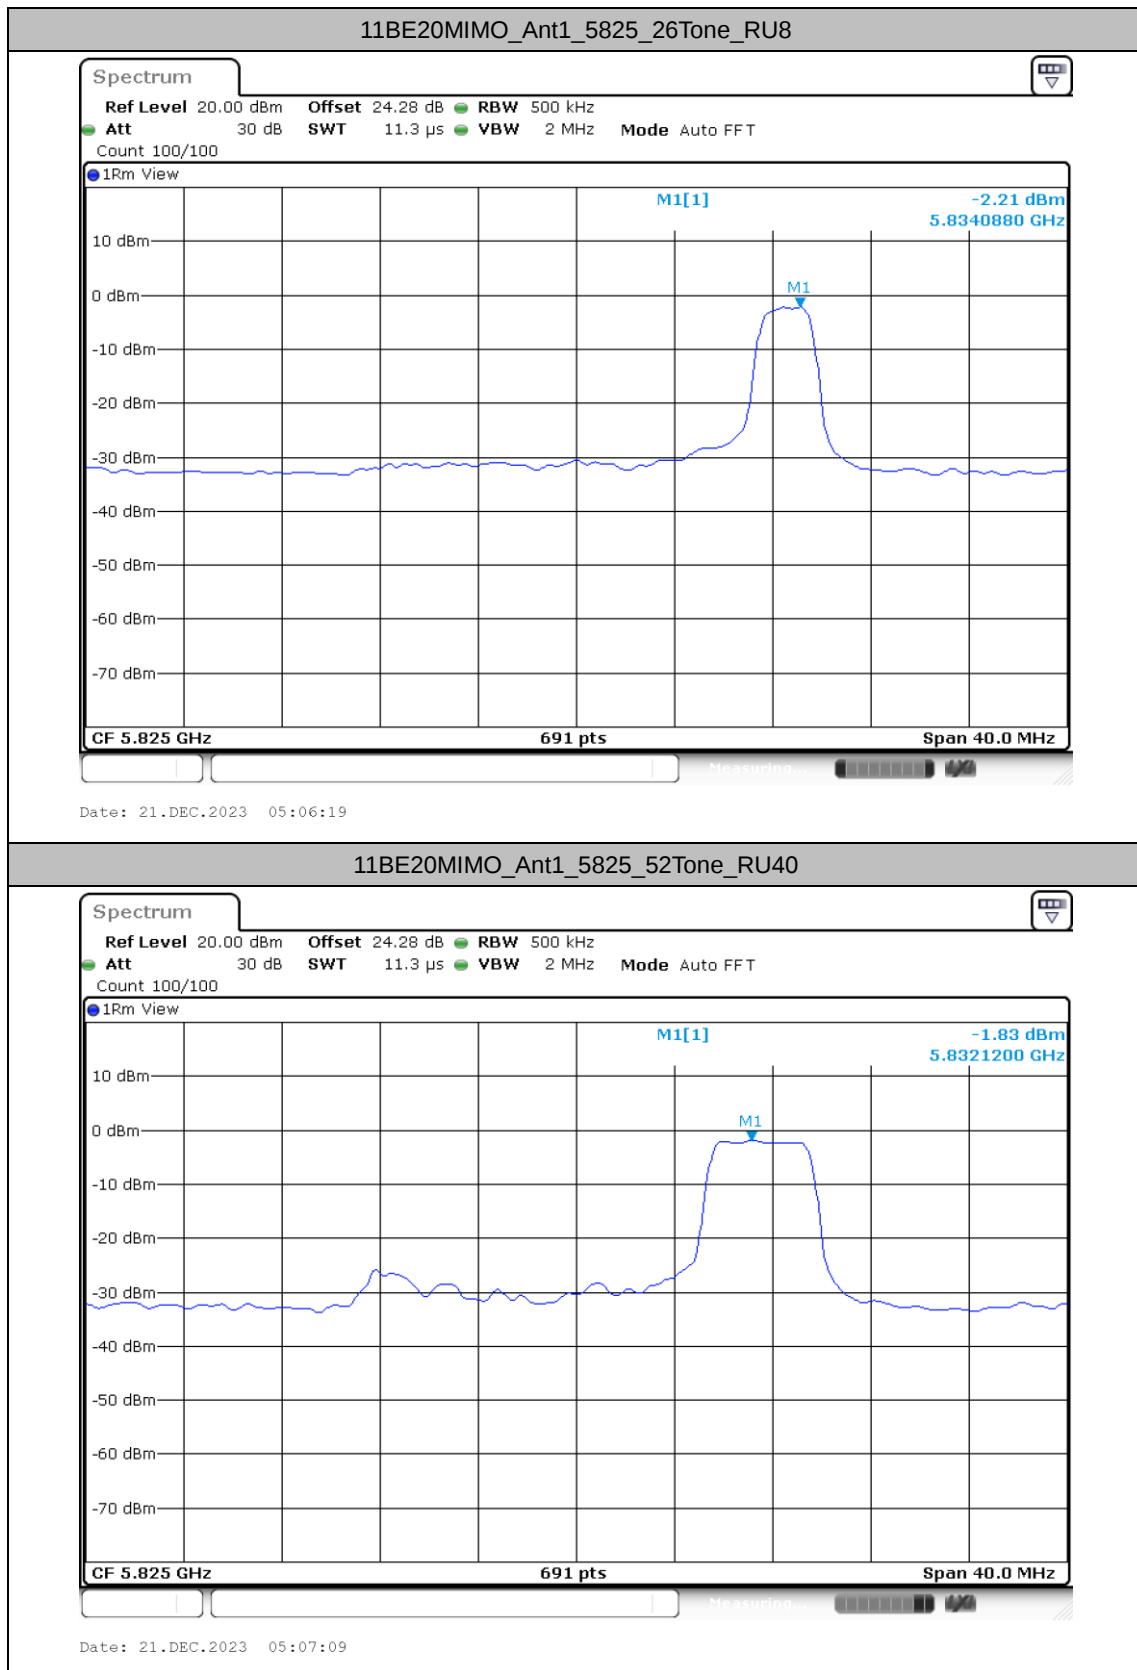

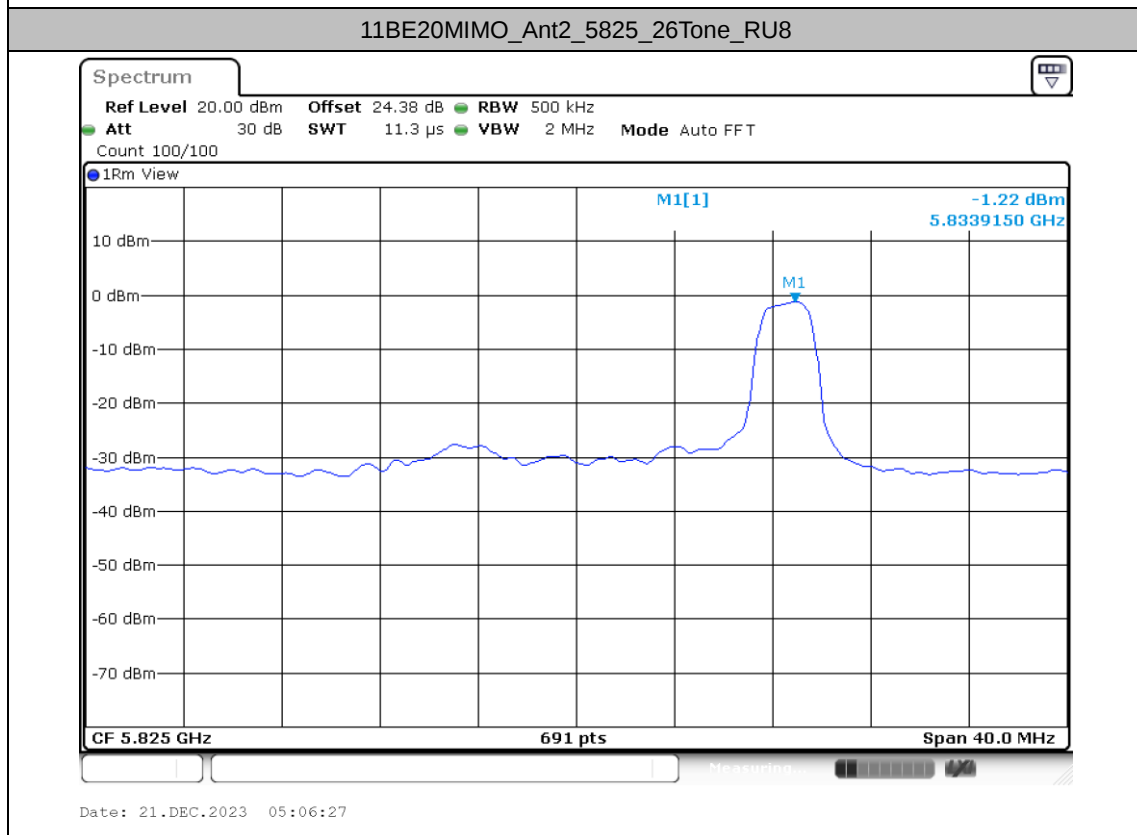

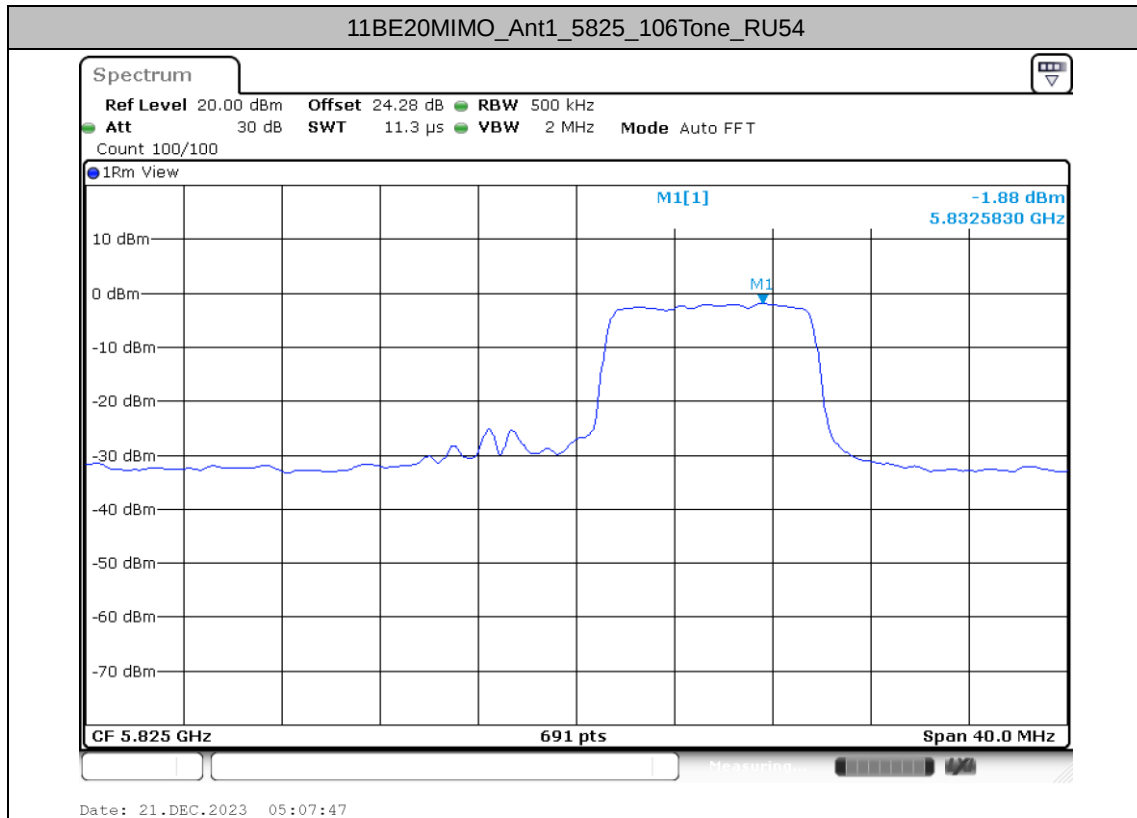

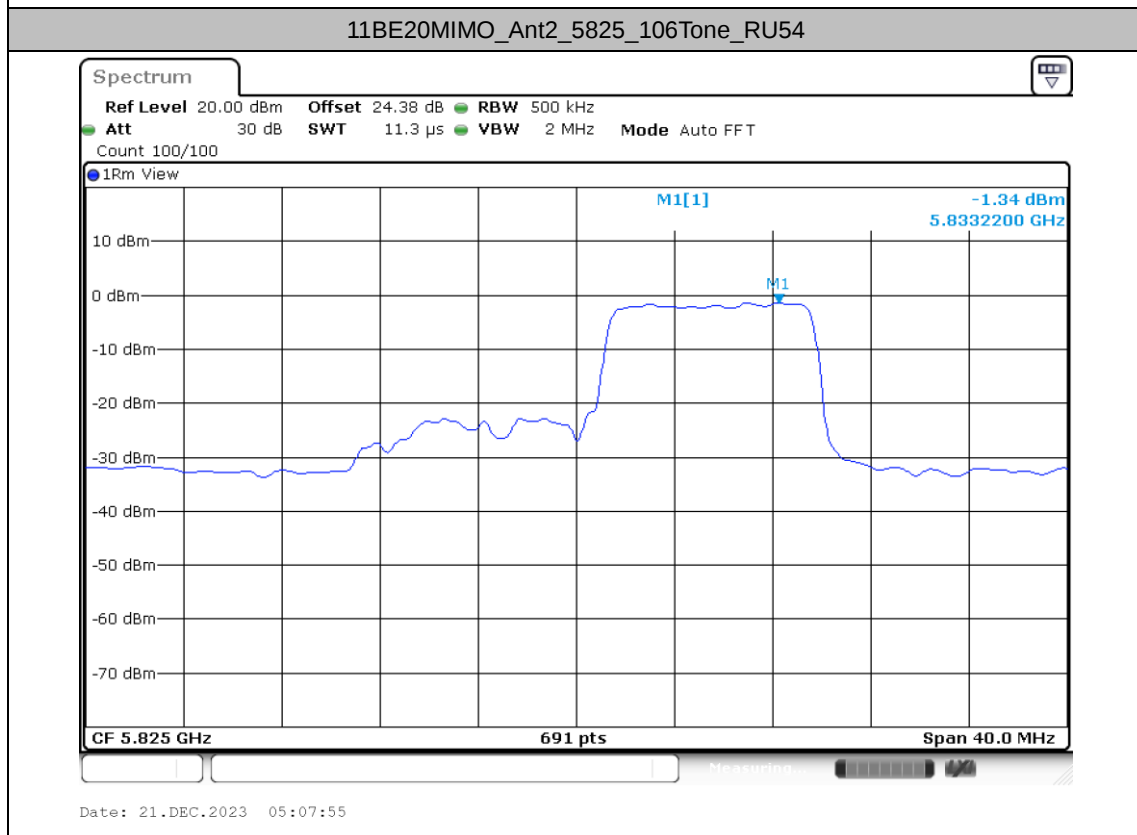

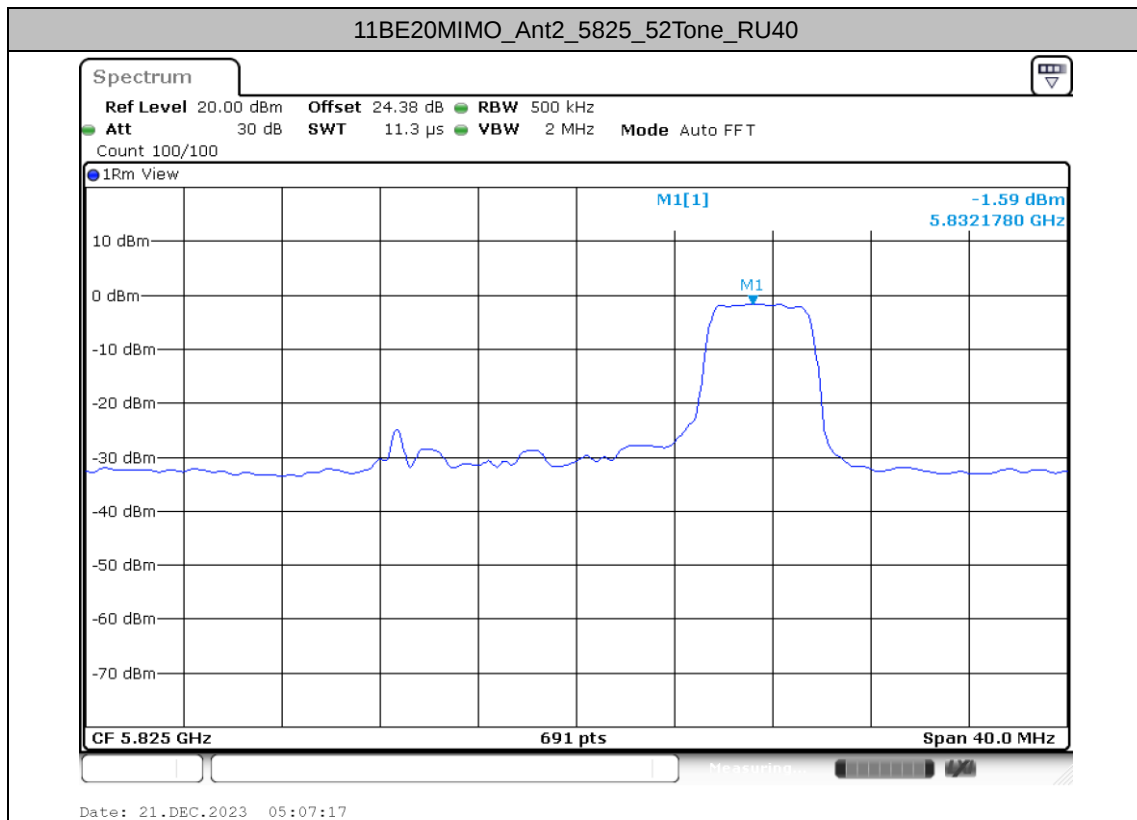

## &lt;MRU&gt;

## Maximum conducted output power

## Test Result

| Test Mode  | Antenna | Freq (MHz) | MRU Type | MRU Index | Set Power | Channel Power [dBm] | Duty Cycle [%] | DC Factor [dBm] | Result [dBm] | Limit [dBm] | Gain [dBi] | EIRP [dBm] | EIRP [dBm] | Verdict |
|------------|---------|------------|----------|-----------|-----------|---------------------|----------------|-----------------|--------------|-------------|------------|------------|------------|---------|
| 11BE20MIMO | Ant1    | 5180       | 52+26    | -         | 9         | 7.88                | 100.00         | 0.00            | 7.88         | ≤30.00      | -0.67      | 7.21       | ---        | PASS    |
|            |         |            | 106+26   | -         | 11        | 9.96                | 99.32          | 0.03            | 9.99         | ≤30.00      | -0.67      | 9.32       | ---        | PASS    |
|            | Ant2    | 5180       | 52+26    | -         | 9         | 8.81                | 99.34          | 0.03            | 8.84         | ≤30.00      | -0.67      | 8.17       | ---        | PASS    |
|            |         |            | 106+26   | -         | 11        | 11.01               | 99.32          | 0.03            | 11.04        | ≤30.00      | -0.67      | 10.37      | ---        | PASS    |
|            | total   | 5180       | 52+26    | -         | ---       | ---                 | ---            | ---             | 11.40        | ≤30.00      | -0.67      | 10.73      | ---        | PASS    |
|            |         |            | 106+26   | -         | ---       | ---                 | ---            | ---             | 13.56        | ≤30.00      | -0.67      | 12.89      | ---        | PASS    |
|            | Ant1    | 5320       | 52+26    | -         | 9         | 9.51                | 99.56          | 0.02            | 9.53         | ≤23.98      | -0.19      | 9.34       | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | 11        | 11.66               | 98.98          | 0.04            | 11.70        | ≤23.98      | -0.19      | 11.51      | ≤30.00     | PASS    |
|            | Ant2    | 5320       | 52+26    | -         | 9         | 9.01                | 99.56          | 0.02            | 9.03         | ≤23.98      | -0.19      | 8.84       | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | 11        | 11.06               | 99.32          | 0.03            | 11.09        | ≤23.98      | -0.19      | 10.90      | ≤30.00     | PASS    |
|            | total   | 5320       | 52+26    | -         | ---       | ---                 | ---            | ---             | 12.30        | ≤23.98      | -0.19      | 12.11      | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | ---       | ---                 | ---            | ---             | 14.42        | ≤23.98      | -0.19      | 14.23      | ≤30.00     | PASS    |
|            | Ant1    | 5500       | 52+26    | -         | 9         | 7.11                | 100.00         | 0.00            | 7.11         | ≤23.98      | 1.28       | 8.39       | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | 11.5      | 9.72                | 99.32          | 0.03            | 9.75         | ≤23.98      | 1.28       | 11.03      | ≤30.00     | PASS    |
|            | Ant2    | 5500       | 52+26    | -         | 9         | 8.26                | 99.34          | 0.03            | 8.29         | ≤23.98      | 1.28       | 9.57       | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | 11.5      | 10.89               | 99.32          | 0.03            | 10.92        | ≤23.98      | 1.28       | 12.20      | ≤30.00     | PASS    |
|            | total   | 5500       | 52+26    | -         | ---       | ---                 | ---            | ---             | 10.75        | ≤23.98      | 1.28       | 12.03      | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | ---       | ---                 | ---            | ---             | 13.38        | ≤23.98      | 1.28       | 14.66      | ≤30.00     | PASS    |
|            | Ant1    | 5700       | 52+26    | -         | 9         | 7.00                | 99.56          | 0.02            | 7.02         | ≤23.98      | 1.28       | 8.30       | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | 11.5      | 9.71                | 98.98          | 0.04            | 9.75         | ≤23.98      | 1.28       | 11.03      | ≤30.00     | PASS    |
|            | Ant2    | 5700       | 52+26    | -         | 9         | 8.22                | 99.56          | 0.02            | 8.24         | ≤23.98      | 1.28       | 9.52       | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | 11.5      | 10.86               | 99.32          | 0.03            | 10.89        | ≤23.98      | 1.28       | 12.17      | ≤30.00     | PASS    |
|            | total   | 5700       | 52+26    | -         | ---       | ---                 | ---            | ---             | 10.68        | ≤23.98      | 1.28       | 11.96      | ≤30.00     | PASS    |
|            |         |            | 106+26   | -         | ---       | ---                 | ---            | ---             | 13.37        | ≤23.98      | 1.28       | 14.65      | ≤30.00     | PASS    |
|            | Ant1    | 5745       | 52+26    | -         | 9         | 6.63                | 100.00         | 0.00            | 6.63         | ≤30.00      | 1.10       | 7.73       | ---        | PASS    |
|            |         |            | 106+26   | -         | 11.5      | 9.45                | 99.32          | 0.03            | 9.48         | ≤30.00      | 1.10       | 10.58      | ---        | PASS    |
|            | Ant2    | 5745       | 52+26    | -         | 9         | 7.90                | 99.34          | 0.03            | 7.93         | ≤30.00      | 1.10       | 9.03       | ---        | PASS    |
|            |         |            | 106+26   | -         | 11.5      | 10.59               | 99.32          | 0.03            | 10.62        | ≤30.00      | 1.10       | 11.72      | ---        | PASS    |
|            | total   | 5745       | 52+26    | -         | ---       | ---                 | ---            | ---             | 10.34        | ≤30.00      | 1.10       | 11.44      | ---        | PASS    |
|            |         |            | 106+26   | -         | ---       | ---                 | ---            | ---             | 13.10        | ≤30.00      | 1.10       | 14.20      | ---        | PASS    |
|            | Ant1    | 5825       | 52+26    | -         | 9         | 7.62                | 99.56          | 0.02            | 7.64         | ≤30.00      | 1.10       | 8.74       | ---        | PASS    |
|            |         |            | 106+26   | -         | 11        | 9.81                | 98.98          | 0.04            | 9.85         | ≤30.00      | 1.10       | 10.95      | ---        | PASS    |
|            | Ant2    | 5825       | 52+26    | -         | 9         | 8.79                | 99.56          | 0.02            | 8.81         | ≤30.00      | 1.10       | 9.91       | ---        | PASS    |
|            |         |            | 106+26   | -         | 11        | 10.86               | 99.32          | 0.03            | 10.89        | ≤30.00      | 1.10       | 11.99      | ---        | PASS    |
|            | total   | 5825       | 52+26    | -         | ---       | ---                 | ---            | ---             | 11.27        | ≤30.00      | 1.10       | 12.37      | ---        | PASS    |
|            |         |            | 106+26   | -         | ---       | ---                 | ---            | ---             | 13.41        | ≤30.00      | 1.10       | 14.51      | ---        | PASS    |
| 11BE80MIMO | Ant1    | 5210       | Large RU | 4         | 12        | 12.44               | 97.59          | 0.11            | 12.55        | ≤30.00      | -0.67      | 11.88      | ---        | PASS    |



|  |       |      |                     |   |      |       |        |      |       |        |       |       |        |      |
|--|-------|------|---------------------|---|------|-------|--------|------|-------|--------|-------|-------|--------|------|
|  |       |      | 484+242             |   |      |       |        |      |       |        |       |       |        |      |
|  |       |      | Puncturing 20M      | 4 | 13   | 12.39 | 100.00 | 0.00 | 12.39 | ≤30.00 | -0.67 | 11.72 | ---    | PASS |
|  | Ant2  | 5210 | Large RU<br>484+242 | 4 | 12   | 13.20 | 97.59  | 0.11 | 13.31 | ≤30.00 | -0.67 | 12.64 | ---    | PASS |
|  |       |      | Puncturing 20M      | 4 | 13   | 13.11 | 99.63  | 0.02 | 13.13 | ≤30.00 | -0.67 | 12.46 | ---    | PASS |
|  | total | 5210 | Large RU<br>484+242 | 4 | ---  | ---   | ---    | ---  | 15.96 | ≤30.00 | -0.67 | 15.29 | ---    | PASS |
|  |       |      | Puncturing 20M      | 4 | ---  | ---   | ---    | ---  | 15.79 | ≤30.00 | -0.67 | 15.12 | ---    | PASS |
|  | Ant1  | 5290 | Large RU<br>484+242 | 1 | 11.5 | 12.78 | 97.59  | 0.11 | 12.89 | ≤23.98 | -0.19 | 12.70 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | 12.5 | 12.91 | 100.00 | 0.00 | 12.91 | ≤23.98 | -0.19 | 12.72 | ≤30.00 | PASS |
|  | Ant2  | 5290 | Large RU<br>484+242 | 1 | 11.5 | 12.54 | 97.59  | 0.11 | 12.65 | ≤23.98 | -0.19 | 12.46 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | 12.5 | 12.39 | 99.45  | 0.02 | 12.41 | ≤23.98 | -0.19 | 12.22 | ≤30.00 | PASS |
|  | total | 5290 | Large RU<br>484+242 | 1 | ---  | ---   | ---    | ---  | 15.78 | ≤23.98 | -0.19 | 15.59 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | ---  | ---   | ---    | ---  | 15.68 | ≤23.98 | -0.19 | 15.49 | ≤30.00 | PASS |
|  | Ant1  | 5530 | Large RU<br>484+242 | 4 | 12   | 12.22 | 97.59  | 0.11 | 12.33 | ≤23.98 | 1.28  | 13.61 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 4 | 13   | 12.15 | 100.00 | 0.00 | 12.15 | ≤23.98 | 1.28  | 13.43 | ≤30.00 | PASS |
|  | Ant2  | 5530 | Large RU<br>484+242 | 4 | 12   | 13.40 | 97.59  | 0.11 | 13.51 | ≤23.98 | 1.28  | 14.79 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 4 | 13   | 13.48 | 99.63  | 0.02 | 13.50 | ≤23.98 | 1.28  | 14.78 | ≤30.00 | PASS |
|  | total | 5530 | Large RU<br>484+242 | 4 | ---  | ---   | ---    | ---  | 15.97 | ≤23.98 | 1.28  | 17.25 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 4 | ---  | ---   | ---    | ---  | 15.89 | ≤23.98 | 1.28  | 17.17 | ≤30.00 | PASS |
|  | Ant1  | 5610 | Large RU<br>484+242 | 1 | 12   | 12.60 | 97.59  | 0.11 | 12.71 | ≤23.98 | 1.28  | 13.99 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | 13   | 12.46 | 100.00 | 0.00 | 12.46 | ≤23.98 | 1.28  | 13.74 | ≤30.00 | PASS |
|  | Ant2  | 5610 | Large RU<br>484+242 | 1 | 12   | 13.38 | 97.59  | 0.11 | 13.49 | ≤23.98 | 1.28  | 14.77 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | 13   | 13.41 | 99.45  | 0.02 | 13.43 | ≤23.98 | 1.28  | 14.71 | ≤30.00 | PASS |
|  | total | 5610 | Large RU<br>484+242 | 1 | ---  | ---   | ---    | ---  | 16.13 | ≤23.98 | 1.28  | 17.41 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | ---  | ---   | ---    | ---  | 15.98 | ≤23.98 | 1.28  | 17.26 | ≤30.00 | PASS |
|  | Ant1  | 5690 | Large RU<br>484+242 | 1 | 12   | 12.18 | 97.59  | 0.11 | 12.29 | ≤23.98 | 1.28  | 13.57 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | 13   | 12.05 | 100.00 | 0.00 | 12.05 | ≤23.98 | 1.28  | 13.33 | ≤30.00 | PASS |
|  | Ant2  | 5690 | Large RU<br>484+242 | 1 | 12   | 13.24 | 97.59  | 0.11 | 13.35 | ≤23.98 | 1.28  | 14.63 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | 13   | 13.25 | 99.45  | 0.02 | 13.27 | ≤23.98 | 1.28  | 14.55 | ≤30.00 | PASS |
|  | total | 5690 | Large RU<br>484+242 | 1 | ---  | ---   | ---    | ---  | 15.86 | ≤23.98 | 1.28  | 17.14 | ≤30.00 | PASS |
|  |       |      | Puncturing 20M      | 1 | ---  | ---   | ---    | ---  | 15.71 | ≤23.98 | 1.28  | 16.99 | ≤30.00 | PASS |
|  | Ant1  | 5775 | Large RU<br>484+242 | 1 | 12   | 12.10 | 97.59  | 0.11 | 12.21 | ≤30.00 | 1.10  | 13.31 | ---    | PASS |
|  |       |      |                     | 4 | 12.5 | 12.45 | 97.59  | 0.11 | 12.56 | ≤30.00 | 1.10  | 13.66 | ---    | PASS |
|  |       |      | Puncturing 20M      | 1 | 13   | 12.08 | 100.00 | 0.00 | 12.08 | ≤30.00 | 1.10  | 13.18 | ---    | PASS |
|  |       |      |                     | 4 | 13.5 | 12.18 | 100.00 | 0.00 | 12.18 | ≤30.00 | 1.10  | 13.28 | ---    | PASS |
|  | Ant2  | 5775 | Large RU            | 1 | 12   | 13.24 | 97.59  | 0.11 | 13.35 | ≤30.00 | 1.10  | 14.45 | ---    | PASS |



|             |       |      |                  |   |      |       |        |      |       |        |       |       |        |      |
|-------------|-------|------|------------------|---|------|-------|--------|------|-------|--------|-------|-------|--------|------|
| 11BE160MIMO |       |      | 484+242          | 4 | 12.5 | 13.60 | 97.59  | 0.11 | 13.71 | ≤30.00 | 1.10  | 14.81 | ---    | PASS |
|             |       |      | Puncturing 20M   | 1 | 13   | 13.16 | 99.45  | 0.02 | 13.18 | ≤30.00 | 1.10  | 14.28 | ---    | PASS |
|             | total | 5775 | Puncturing 20M   | 4 | 13.5 | 13.42 | 99.63  | 0.02 | 13.44 | ≤30.00 | 1.10  | 14.54 | ---    | PASS |
|             |       |      |                  | 1 | ---  | ---   | ---    | ---  | 15.83 | ≤30.00 | 1.10  | 16.93 | ---    | PASS |
|             |       |      | Large RU 484+242 | 4 | ---  | ---   | ---    | ---  | 16.18 | ≤30.00 | 1.10  | 17.28 | ---    | PASS |
|             |       |      |                  | 1 | ---  | ---   | ---    | ---  | 15.68 | ≤30.00 | 1.10  | 16.78 | ---    | PASS |
|             |       |      | Puncturing 20M   | 4 | ---  | ---   | ---    | ---  | 15.87 | ≤30.00 | 1.10  | 16.97 | ---    | PASS |
|             |       |      |                  | 1 | ---  | ---   | ---    | ---  | 15.68 | ≤30.00 | 1.10  | 16.78 | ---    | PASS |
|             | Ant1  | 5250 | Large RU 996+484 | 1 | 10   | 10.65 | 97.50  | 0.11 | 10.76 | ≤30.00 | -0.19 | 10.57 | ---    | PASS |
|             |       |      |                  | 4 | 11   | 11.92 | 97.50  | 0.11 | 12.03 | ≤30.00 | -0.19 | 11.84 | ---    | PASS |
|             |       |      | Puncturing 40M   | 1 | 12.5 | 12.37 | 99.63  | 0.02 | 12.39 | ≤30.00 | -0.19 | 12.20 | ---    | PASS |
|             |       |      |                  | 4 | 12.5 | 12.59 | 99.63  | 0.02 | 12.61 | ≤30.00 | -0.19 | 12.42 | ---    | PASS |
|             |       |      | Puncturing 20M   | 1 | 13   | 12.93 | 100.00 | 0.00 | 12.93 | ≤30.00 | -0.19 | 12.74 | ---    | PASS |
|             |       |      |                  | 8 | 13.5 | 13.43 | 99.63  | 0.02 | 13.45 | ≤30.00 | -0.19 | 13.26 | ---    | PASS |
|             |       | 5250 | Large RU 996+484 | 1 | 10   | 11.02 | 97.50  | 0.11 | 11.13 | ≤30.00 | -0.19 | 10.94 | ---    | PASS |
|             |       |      |                  | 4 | 11   | 12.23 | 100.00 | 0.00 | 12.23 | ≤30.00 | -0.19 | 12.04 | ---    | PASS |
|             |       |      | Puncturing 40M   | 1 | 12.5 | 12.58 | 100.00 | 0.00 | 12.58 | ≤30.00 | -0.19 | 12.39 | ---    | PASS |
|             |       |      |                  | 4 | 12.5 | 12.67 | 100.00 | 0.00 | 12.67 | ≤30.00 | -0.19 | 12.48 | ---    | PASS |
|             |       |      | Puncturing 20M   | 1 | 13   | 13.02 | 100.00 | 0.00 | 13.02 | ≤30.00 | -0.19 | 12.83 | ---    | PASS |
|             |       |      |                  | 8 | 13.5 | 13.62 | 100.00 | 0.00 | 13.62 | ≤30.00 | -0.19 | 13.43 | ---    | PASS |
|             | total | 5250 | Large RU 996+484 | 1 | ---  | ---   | ---    | ---  | 13.96 | ≤30.00 | -0.19 | 13.77 | ---    | PASS |
|             |       |      |                  | 4 | ---  | ---   | ---    | ---  | 15.14 | ≤30.00 | -0.19 | 14.95 | ---    | PASS |
|             |       |      | Puncturing 40M   | 1 | ---  | ---   | ---    | ---  | 15.50 | ≤30.00 | -0.19 | 15.31 | ---    | PASS |
|             |       |      |                  | 4 | ---  | ---   | ---    | ---  | 15.65 | ≤30.00 | -0.19 | 15.46 | ---    | PASS |
|             |       |      | Puncturing 20M   | 1 | ---  | ---   | ---    | ---  | 15.99 | ≤30.00 | -0.19 | 15.80 | ---    | PASS |
|             |       |      |                  | 8 | ---  | ---   | ---    | ---  | 16.55 | ≤30.00 | -0.19 | 16.36 | ---    | PASS |
|             | Ant2  | 5570 | Large RU 996+484 | 1 | 11.5 | 12.06 | 97.50  | 0.11 | 12.17 | ≤23.98 | 1.28  | 13.45 | ≤30.00 | PASS |
|             |       |      |                  | 4 | 11   | 11.85 | 97.50  | 0.11 | 11.96 | ≤23.98 | 1.28  | 13.24 | ≤30.00 | PASS |
|             |       |      | Puncturing 40M   | 1 | 12.5 | 12.06 | 99.63  | 0.02 | 12.08 | ≤23.98 | 1.28  | 13.36 | ≤30.00 | PASS |
|             |       |      |                  | 4 | 12   | 12.01 | 99.63  | 0.02 | 12.03 | ≤23.98 | 1.28  | 13.31 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | 13   | 12.92 | 100.00 | 0.00 | 12.92 | ≤23.98 | 1.28  | 14.20 | ≤30.00 | PASS |
|             |       |      |                  | 8 | 13   | 13.02 | 99.63  | 0.02 | 13.04 | ≤23.98 | 1.28  | 14.32 | ≤30.00 | PASS |
|             |       | 5570 | Large RU 996+484 | 1 | 11.5 | 12.73 | 97.50  | 0.11 | 12.84 | ≤23.98 | 1.28  | 14.12 | ≤30.00 | PASS |
|             |       |      |                  | 4 | 11   | 12.41 | 100.00 | 0.00 | 12.41 | ≤23.98 | 1.28  | 13.69 | ≤30.00 | PASS |
|             |       |      | Puncturing 40M   | 1 | 12.5 | 12.74 | 100.00 | 0.00 | 12.74 | ≤23.98 | 1.28  | 14.02 | ≤30.00 | PASS |
|             |       |      |                  | 4 | 12   | 12.42 | 100.00 | 0.00 | 12.42 | ≤23.98 | 1.28  | 13.70 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | 13   | 13.33 | 100.00 | 0.00 | 13.33 | ≤23.98 | 1.28  | 14.61 | ≤30.00 | PASS |
|             |       |      |                  | 8 | 13   | 13.42 | 100.00 | 0.00 | 13.42 | ≤23.98 | 1.28  | 14.70 | ≤30.00 | PASS |
|             | total | 5570 | Large RU 996+484 | 1 | ---  | ---   | ---    | ---  | 15.53 | ≤23.98 | 1.28  | 16.81 | ≤30.00 | PASS |
|             |       |      |                  | 4 | ---  | ---   | ---    | ---  | 15.20 | ≤23.98 | 1.28  | 16.48 | ≤30.00 | PASS |
|             |       |      | Puncturing 40M   | 1 | ---  | ---   | ---    | ---  | 15.43 | ≤23.98 | 1.28  | 16.71 | ≤30.00 | PASS |
|             |       |      |                  | 4 | ---  | ---   | ---    | ---  | 15.24 | ≤23.98 | 1.28  | 16.52 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | ---  | ---   | ---    | ---  | 16.14 | ≤23.98 | 1.28  | 17.42 | ≤30.00 | PASS |
|             |       |      |                  | 8 | ---  | ---   | ---    | ---  | 16.24 | ≤23.98 | 1.28  | 17.52 | ≤30.00 | PASS |

Note: The Duty Cycle Factor is compensated in the graph.



## Maximum power spectral density

## Test Result

| Test Mode  | Antenna | Freq (MHz) | MRU Type         | MRU Index | Result [dBm/MHz] | Limit [dBm/MHz] | Verdict |
|------------|---------|------------|------------------|-----------|------------------|-----------------|---------|
| 11BE20MIMO | Ant1    | 5180       | 52+26            | -         | 1.23             | ≤17.00          | PASS    |
|            |         |            | 106+26           | -         | 1.12             | ≤17.00          | PASS    |
|            | Ant2    | 5180       | 52+26            | -         | 1.67             | ≤17.00          | PASS    |
|            |         |            | 106+26           | -         | 1.46             | ≤17.00          | PASS    |
|            | total   | 5180       | 52+26            | -         | 4.31             | ≤17.00          | PASS    |
|            |         |            | 106+26           | -         | 4.12             | ≤17.00          | PASS    |
|            | Ant1    | 5320       | 52+26            | -         | 2.50             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 2.72             | ≤11.00          | PASS    |
|            | Ant2    | 5320       | 52+26            | -         | 2.04             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 1.72             | ≤11.00          | PASS    |
|            | total   | 5320       | 52+26            | -         | 5.26             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 5.18             | ≤11.00          | PASS    |
|            | Ant1    | 5500       | 52+26            | -         | 0.82             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 0.89             | ≤11.00          | PASS    |
|            | Ant2    | 5500       | 52+26            | -         | 0.94             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 1.05             | ≤11.00          | PASS    |
|            | total   | 5500       | 52+26            | -         | 3.82             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 3.71             | ≤11.00          | PASS    |
|            | Ant1    | 5700       | 52+26            | -         | 0.32             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 0.28             | ≤11.00          | PASS    |
|            | Ant2    | 5700       | 52+26            | -         | 0.58             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 0.60             | ≤11.00          | PASS    |
|            | total   | 5700       | 52+26            | -         | 3.41             | ≤11.00          | PASS    |
|            |         |            | 106+26           | -         | 3.36             | ≤11.00          | PASS    |
|            | Ant1    | 5745       | 52+26            | -         | -2.70            | ≤30.00          | PASS    |
|            |         |            | 106+26           | -         | -2.32            | ≤30.00          | PASS    |
|            | Ant2    | 5745       | 52+26            | -         | -2.45            | ≤30.00          | PASS    |
|            |         |            | 106+26           | -         | -2.20            | ≤30.00          | PASS    |
|            | total   | 5745       | 52+26            | -         | 0.44             | ≤30.00          | PASS    |
|            |         |            | 106+26           | -         | 0.75             | ≤30.00          | PASS    |
|            | Ant1    | 5825       | 52+26            | -         | -1.75            | ≤30.00          | PASS    |
|            |         |            | 106+26           | -         | -2.37            | ≤30.00          | PASS    |
|            | Ant2    | 5825       | 52+26            | -         | -1.44            | ≤30.00          | PASS    |
|            |         |            | 106+26           | -         | -1.72            | ≤30.00          | PASS    |
|            | total   | 5825       | 52+26            | -         | 1.42             | ≤30.00          | PASS    |
|            |         |            | 106+26           | -         | 0.98             | ≤30.00          | PASS    |
| 11BE80MIMO | Ant1    | 5210       | Large RU 484+242 | 4         | -3.80            | ≤17.00          | PASS    |
|            |         |            | Puncturing 20M   | 4         | -4.05            | ≤17.00          | PASS    |
|            | Ant2    | 5210       | Large RU 484+242 | 4         | -3.45            | ≤17.00          | PASS    |
|            |         |            | Puncturing 20M   | 4         | -4.00            | ≤17.00          | PASS    |
|            | total   | 5210       | Large RU 484+242 | 4         | -0.83            | ≤17.00          | PASS    |



|             |       |      |                  |   |       |        |      |
|-------------|-------|------|------------------|---|-------|--------|------|
| 11BE160MIMO | Ant1  | 5290 | Puncturing 20M   | 4 | -1.09 | ≤17.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -2.99 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -3.25 | ≤11.00 | PASS |
|             |       | 5290 | Large RU 484+242 | 1 | -3.74 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -4.09 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -0.62 | ≤11.00 | PASS |
|             | total | 5290 | Puncturing 20M   | 1 | -0.84 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 4 | -4.32 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 4 | -4.34 | ≤11.00 | PASS |
|             | Ant2  | 5530 | Large RU 484+242 | 4 | -3.65 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 4 | -3.78 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 4 | -1.18 | ≤11.00 | PASS |
|             | total | 5530 | Puncturing 20M   | 4 | -1.06 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -4.18 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -4.33 | ≤11.00 | PASS |
|             | Ant2  | 5610 | Large RU 484+242 | 1 | -4.10 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -4.37 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -1.19 | ≤11.00 | PASS |
|             | total | 5610 | Puncturing 20M   | 1 | -1.34 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -4.18 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -4.66 | ≤11.00 | PASS |
|             | Ant2  | 5690 | Large RU 484+242 | 1 | -4.01 | ≤11.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -3.70 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -1.21 | ≤11.00 | PASS |
|             | total | 5690 | Puncturing 20M   | 1 | -1.21 | ≤11.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -7.17 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 4 | -7.03 | ≤30.00 | PASS |
|             | Ant1  | 5775 | Puncturing 20M   | 1 | -7.27 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 4 | -7.20 | ≤30.00 | PASS |
|             |       |      | Large RU 484+242 | 1 | -6.54 | ≤30.00 | PASS |
|             |       |      | Large RU 484+242 | 4 | -6.57 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -6.87 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 4 | -6.33 | ≤30.00 | PASS |
|             | Ant2  | 5775 | Large RU 484+242 | 1 | -3.83 | ≤30.00 | PASS |
|             |       |      | Large RU 484+242 | 4 | -3.78 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -4.06 | ≤30.00 | PASS |
|             |       |      | Puncturing 20M   | 4 | -3.73 | ≤30.00 | PASS |
|             |       |      | Large RU 996+484 | 1 | -6.48 | ≤17.00 | PASS |
|             |       |      | Large RU 996+484 | 4 | -5.97 | ≤17.00 | PASS |
|             | Ant1  | 5250 | Puncturing 40M   | 1 | -6.58 | ≤17.00 | PASS |
|             |       |      | Puncturing 40M   | 4 | -6.23 | ≤17.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -6.11 | ≤17.00 | PASS |
|             |       |      | Puncturing 20M   | 8 | -6.07 | ≤17.00 | PASS |
|             |       |      | Large RU 996+484 | 1 | -6.07 | ≤17.00 | PASS |
|             |       |      | Large RU 996+484 | 4 | -6.78 | ≤17.00 | PASS |
|             |       |      | Puncturing 40M   | 1 | -6.49 | ≤17.00 | PASS |
|             |       |      | Puncturing 40M   | 4 | -6.75 | ≤17.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -6.12 | ≤17.00 | PASS |
|             |       |      | Puncturing 20M   | 1 | -6.12 | ≤17.00 | PASS |




|  |       |      |                  |   |       |        |      |
|--|-------|------|------------------|---|-------|--------|------|
|  | total | 5250 | Large RU 996+484 | 8 | -6.23 | ≤17.00 | PASS |
|  |       |      |                  | 1 | -3.49 | ≤17.00 | PASS |
|  |       |      |                  | 4 | -3.45 | ≤17.00 | PASS |
|  |       |      | Puncturing 40M   | 1 | -3.67 | ≤17.00 | PASS |
|  |       |      |                  | 4 | -3.73 | ≤17.00 | PASS |
|  |       |      | Puncturing 20M   | 1 | -3.39 | ≤17.00 | PASS |
|  |       |      |                  | 8 | -3.45 | ≤17.00 | PASS |
|  | Ant1  | 5570 | Large RU 996+484 | 1 | -6.46 | ≤11.00 | PASS |
|  |       |      |                  | 4 | -6.45 | ≤11.00 | PASS |
|  |       |      | Puncturing 40M   | 1 | -6.67 | ≤11.00 | PASS |
|  |       |      |                  | 4 | -6.43 | ≤11.00 | PASS |
|  |       |      | Puncturing 20M   | 1 | -5.95 | ≤11.00 | PASS |
|  |       |      |                  | 8 | -5.93 | ≤11.00 | PASS |
|  | Ant2  | 5570 | Large RU 996+484 | 1 | -6.52 | ≤11.00 | PASS |
|  |       |      |                  | 4 | -6.91 | ≤11.00 | PASS |
|  |       |      | Puncturing 40M   | 1 | -6.73 | ≤11.00 | PASS |
|  |       |      |                  | 4 | -6.70 | ≤11.00 | PASS |
|  |       |      | Puncturing 20M   | 1 | -6.15 | ≤11.00 | PASS |
|  |       |      |                  | 8 | -6.20 | ≤11.00 | PASS |
|  | total | 5570 | Large RU 996+484 | 1 | -3.80 | ≤11.00 | PASS |
|  |       |      |                  | 4 | -3.81 | ≤11.00 | PASS |
|  |       |      | Puncturing 40M   | 1 | -3.93 | ≤11.00 | PASS |
|  |       |      |                  | 4 | -3.96 | ≤11.00 | PASS |
|  |       |      | Puncturing 20M   | 1 | -3.26 | ≤11.00 | PASS |
|  |       |      |                  | 8 | -3.39 | ≤11.00 | PASS |



Note: 1.The Result and Limit Unit is dBm/500 kHz in the band 5.725–5.85 GHz.

2.The Duty Cycle Factor and RBW Factor is compensated in the graph.




## Test Graphs

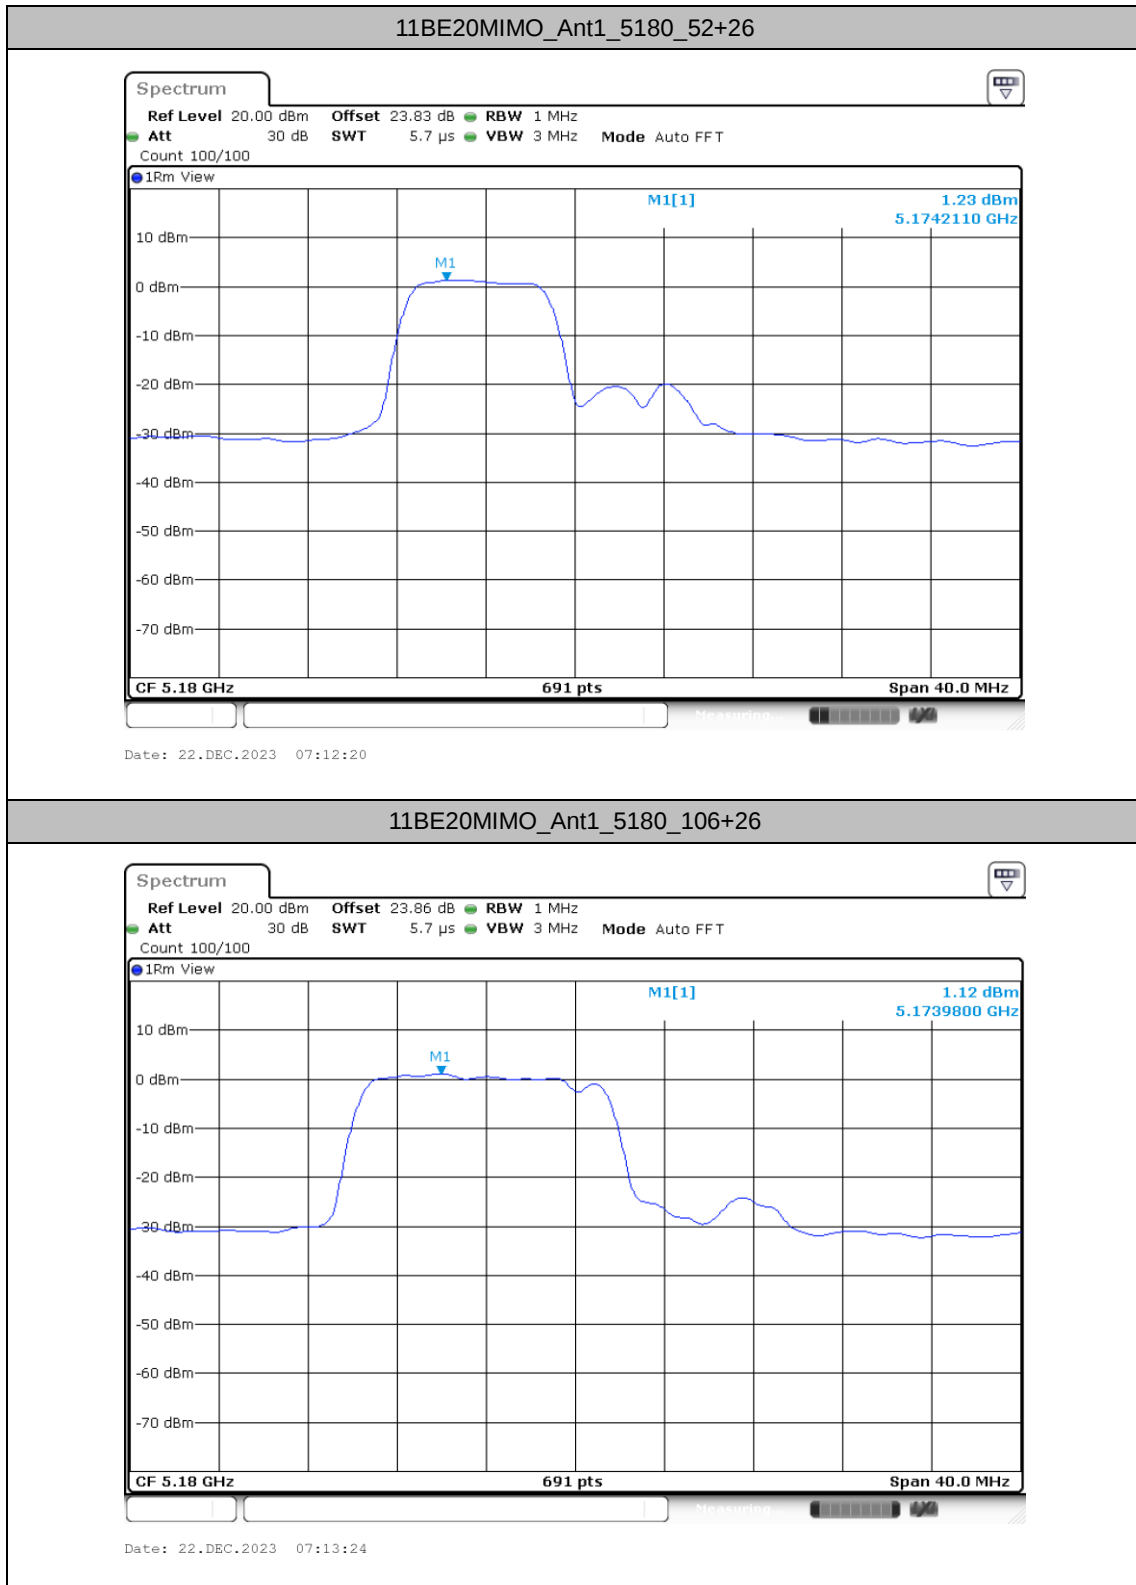

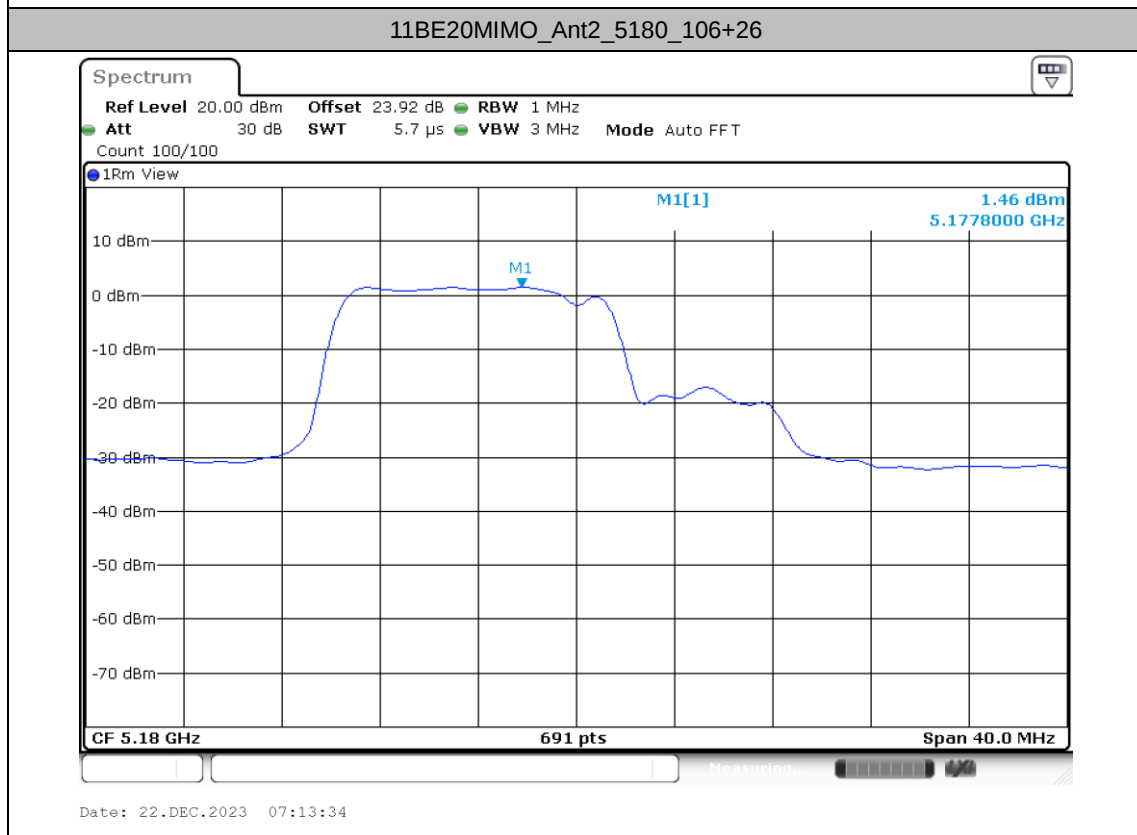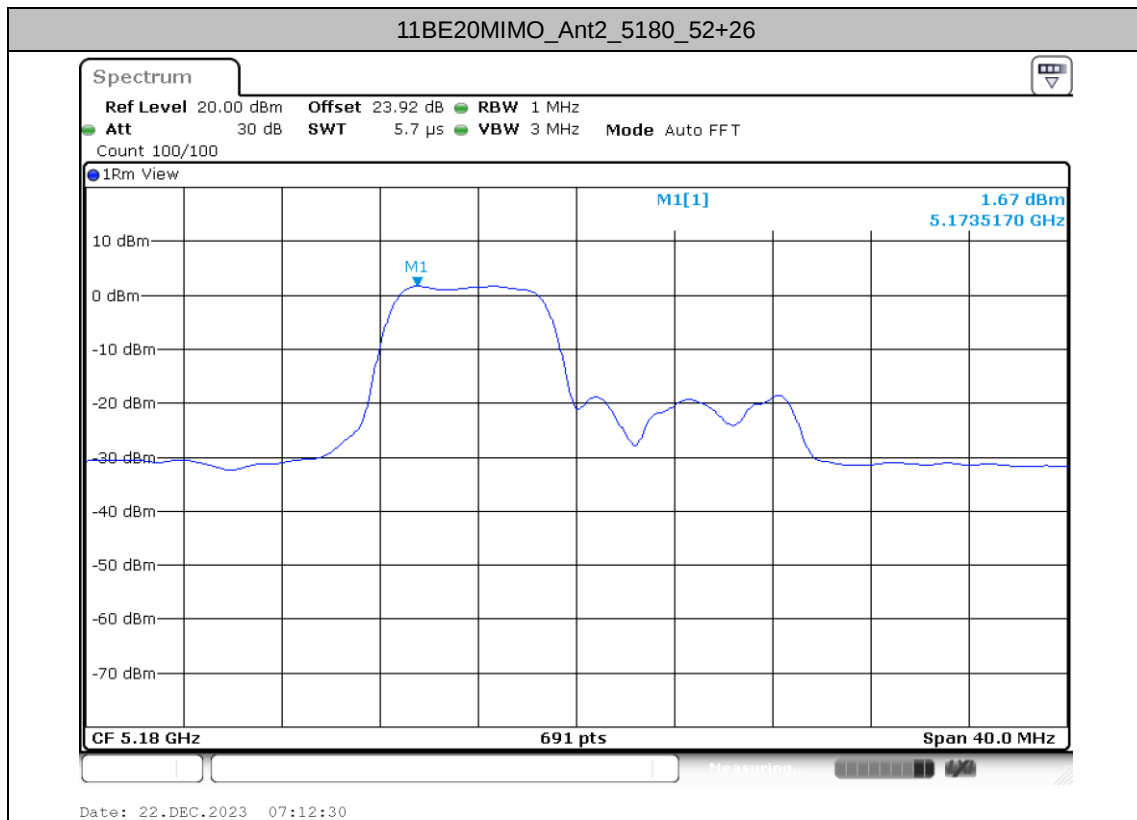








11BE20MIMO\_total\_5180\_52+26

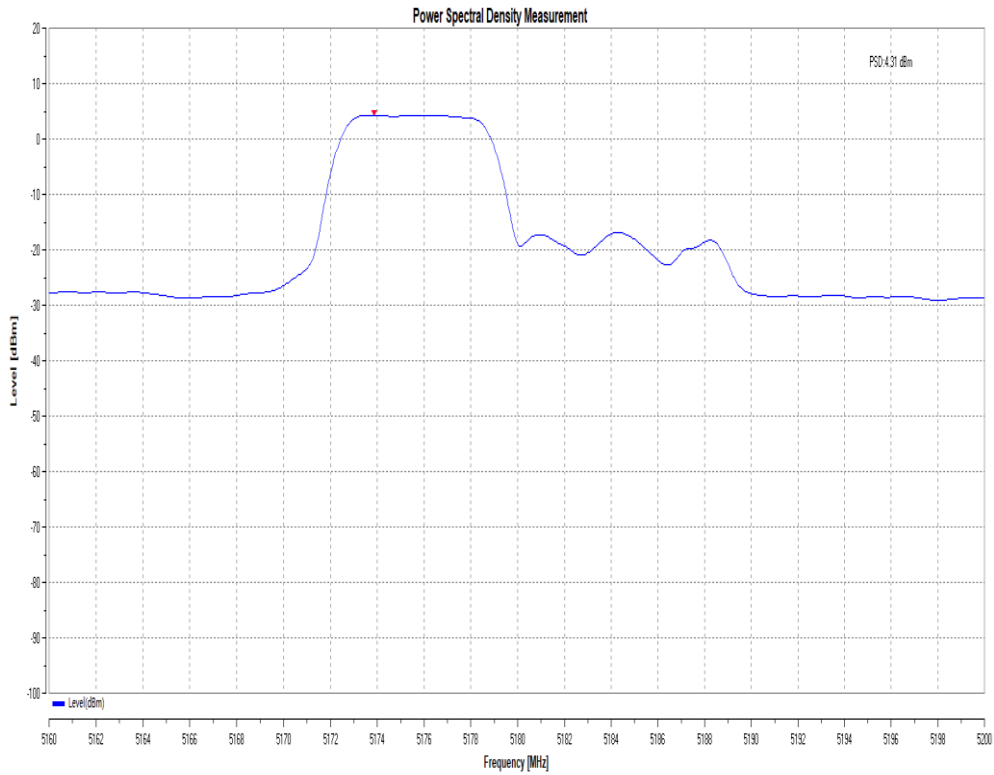

11BE20MIMO\_total\_5180\_106+26

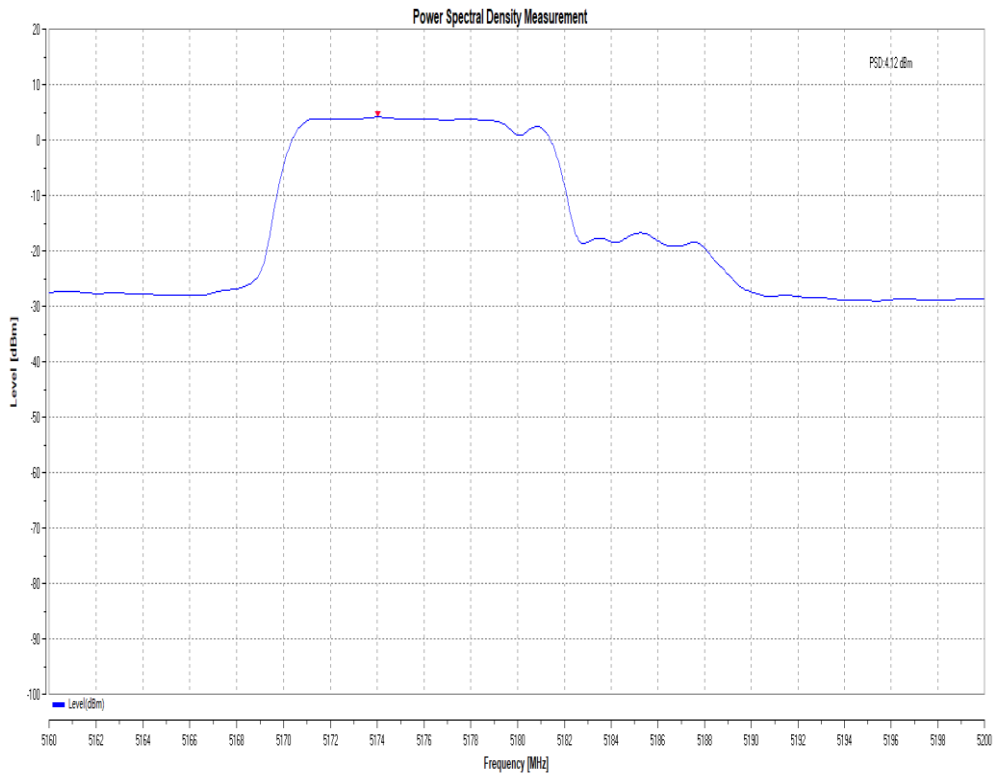


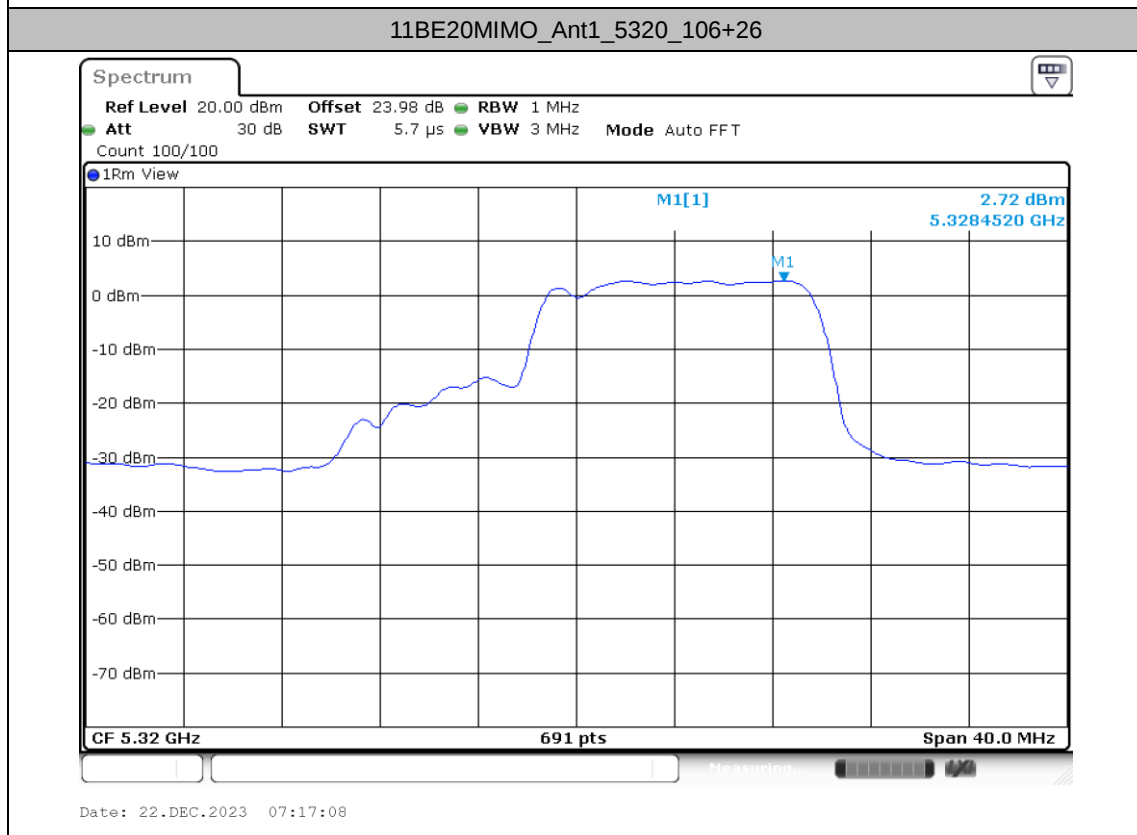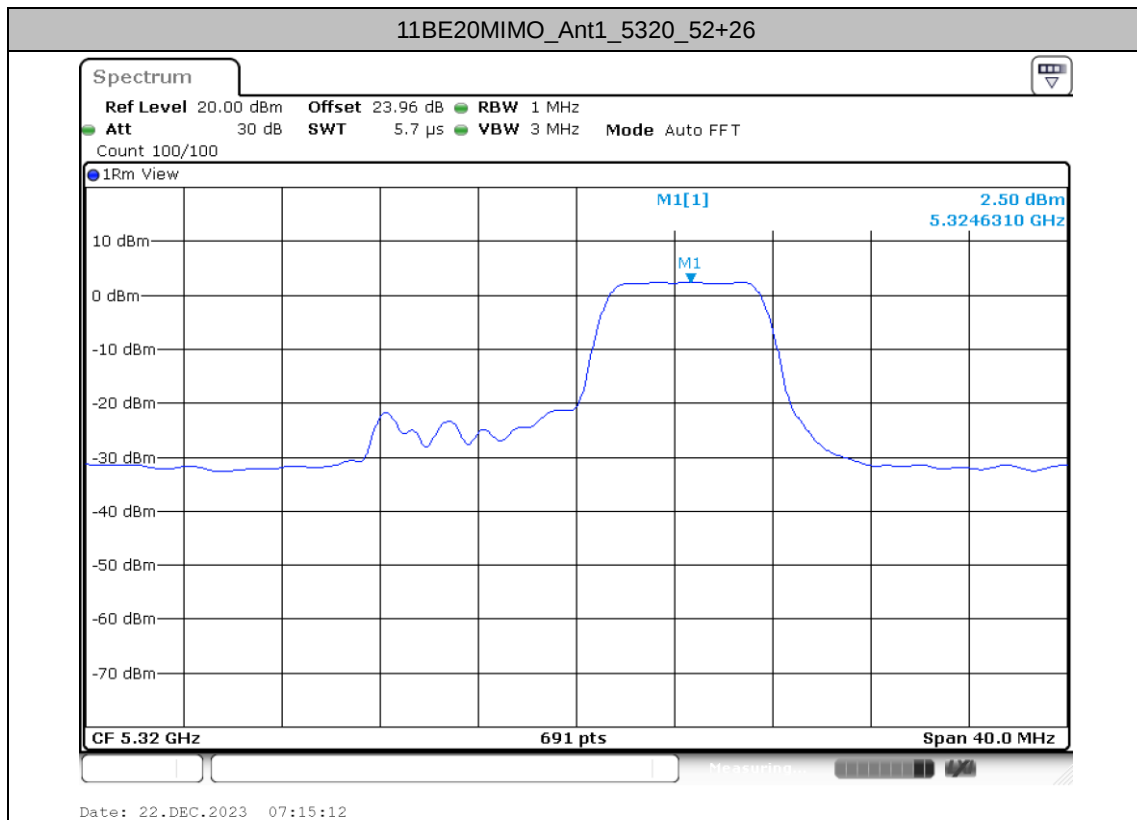

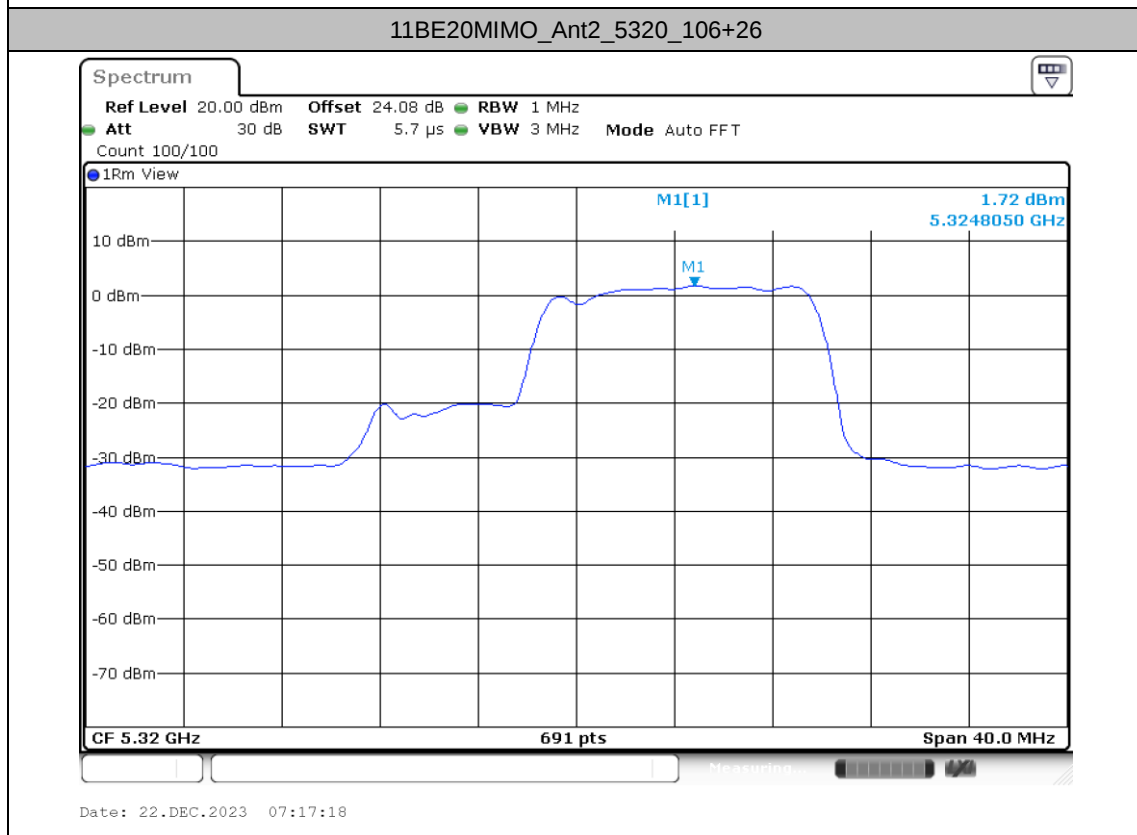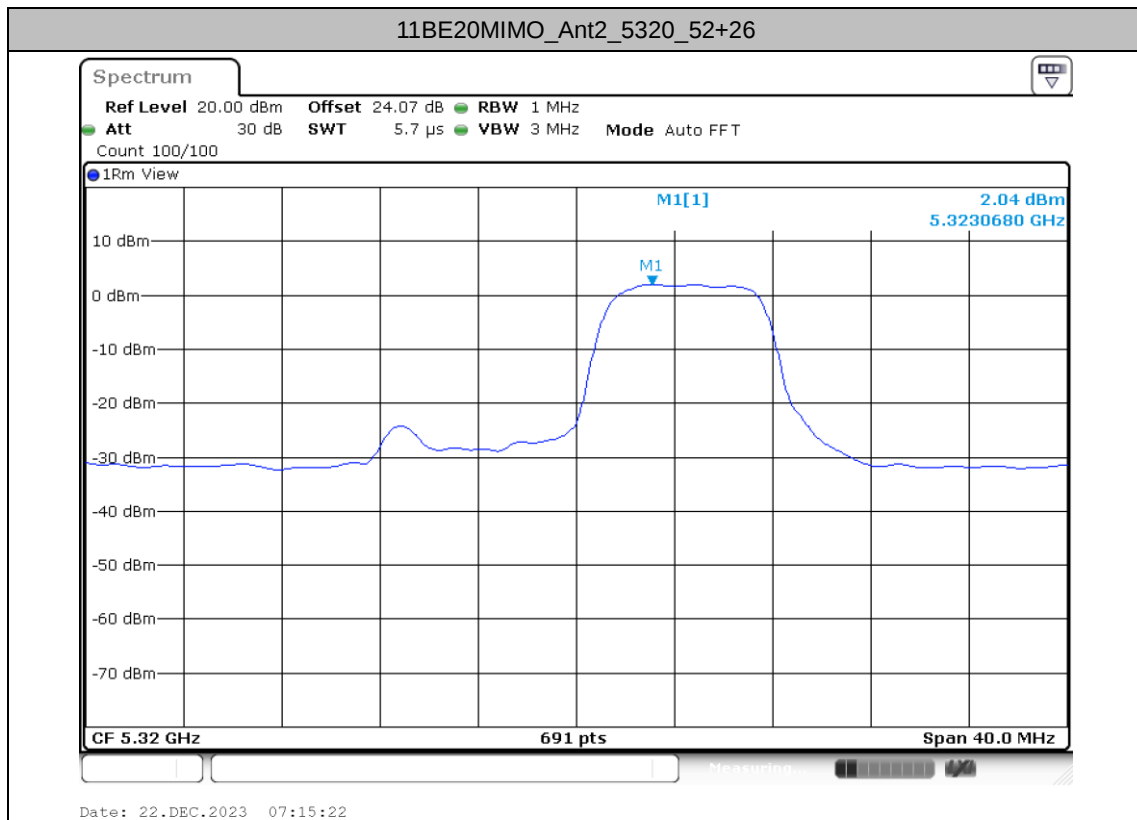







11BE20MIMO\_total\_5320\_52+26

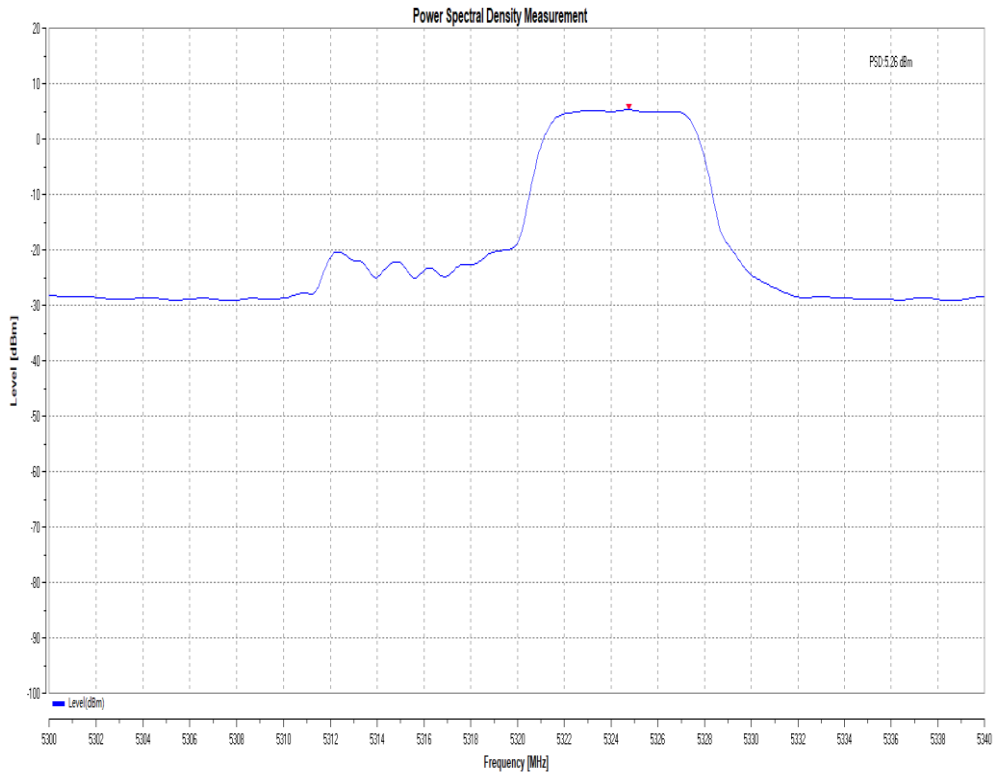

11BE20MIMO\_total\_5320\_106+26

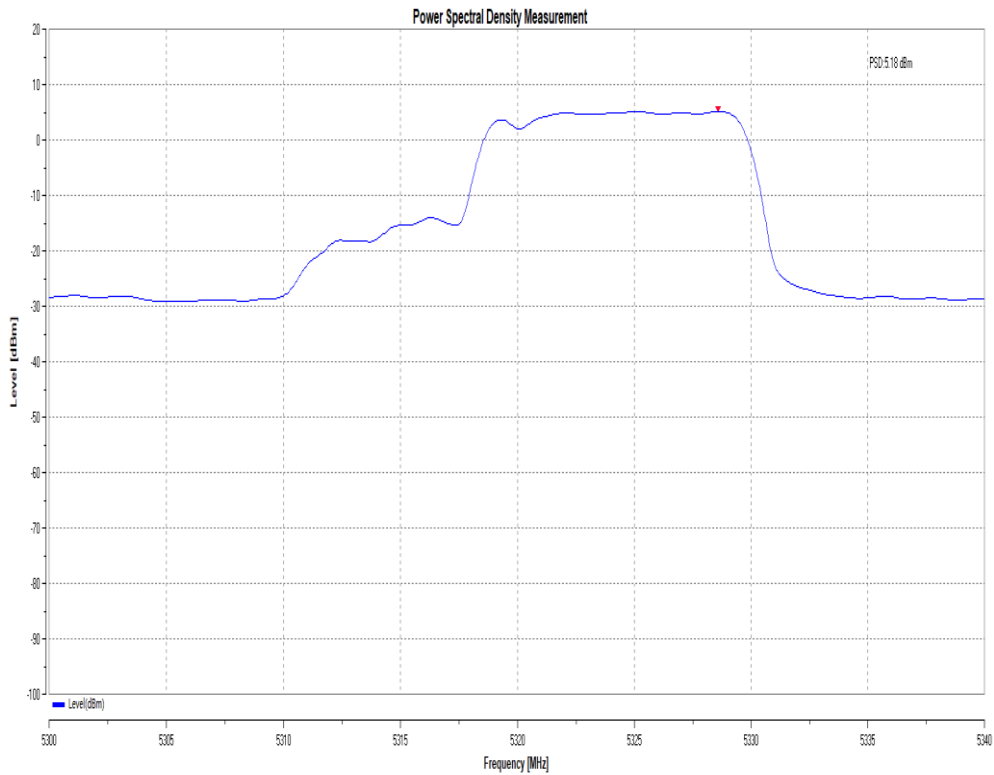


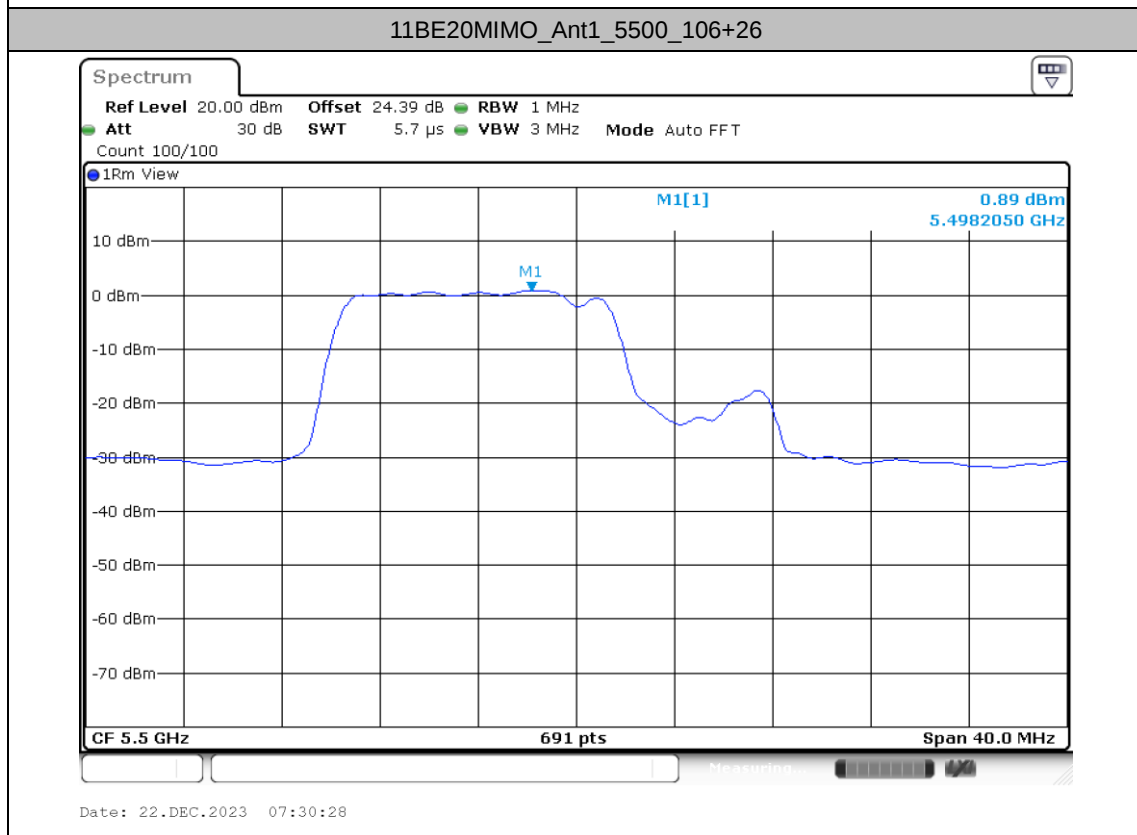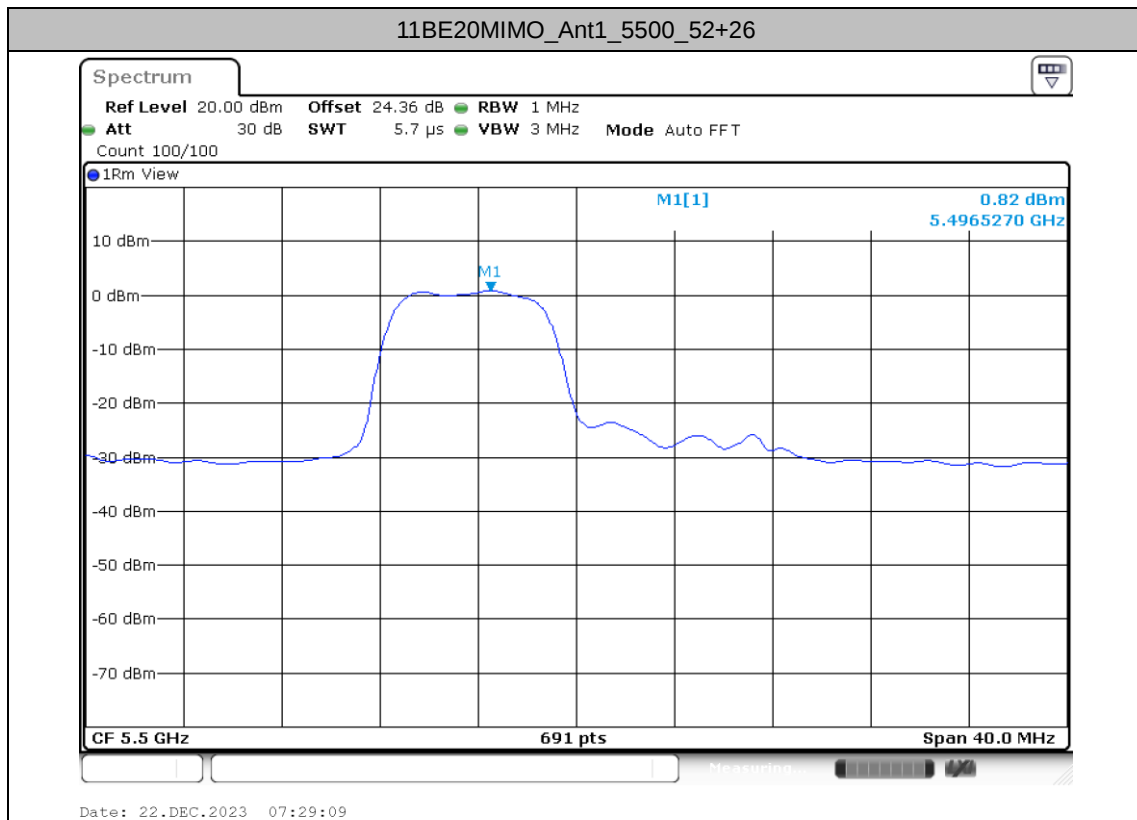

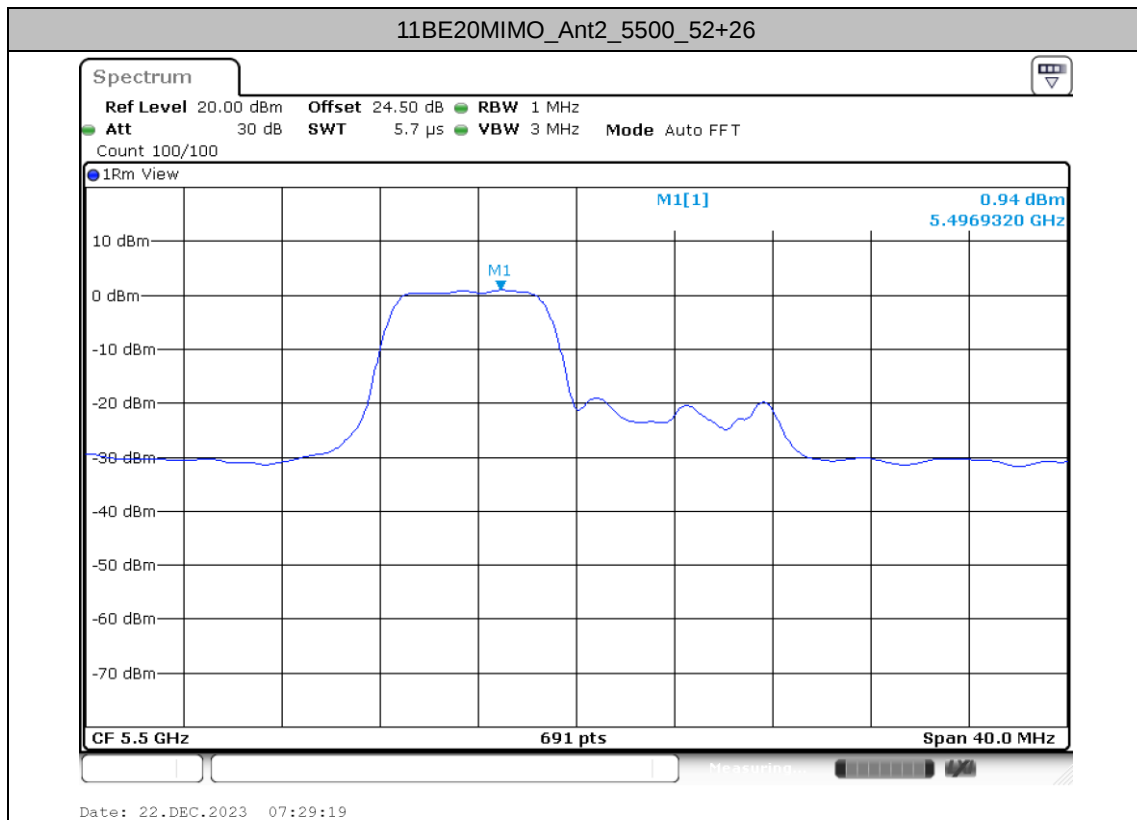







11BE20MIMO\_total\_5500\_52+26

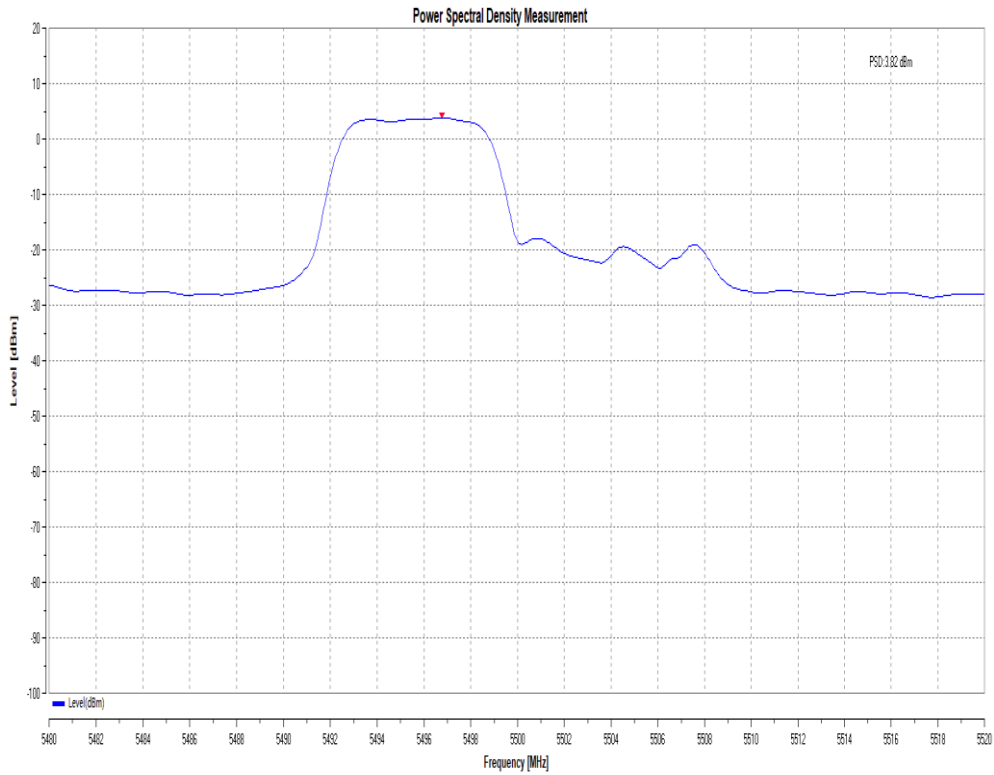




11BE20MIMO\_total\_5500\_106+26


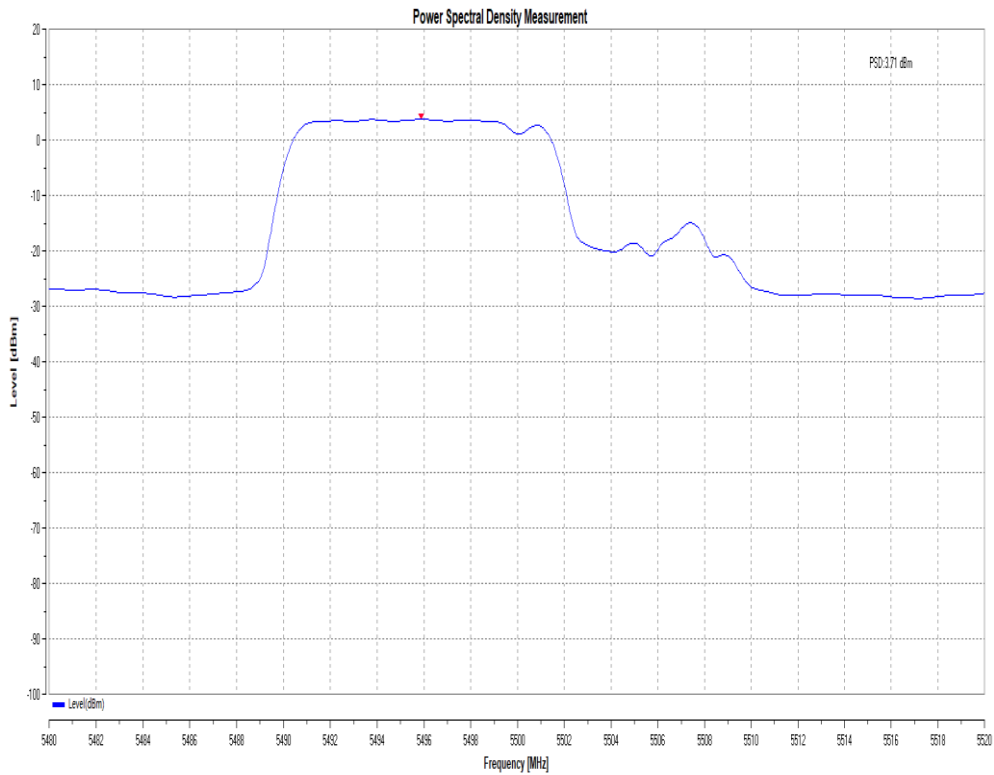



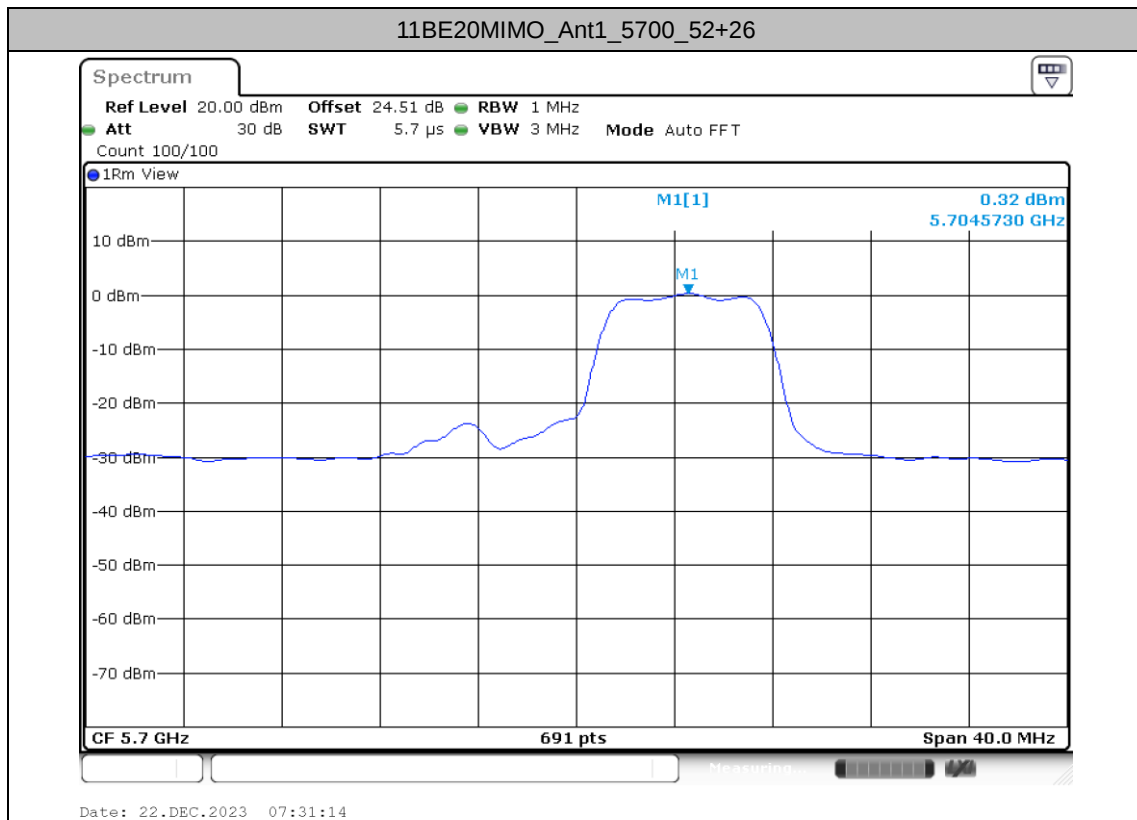


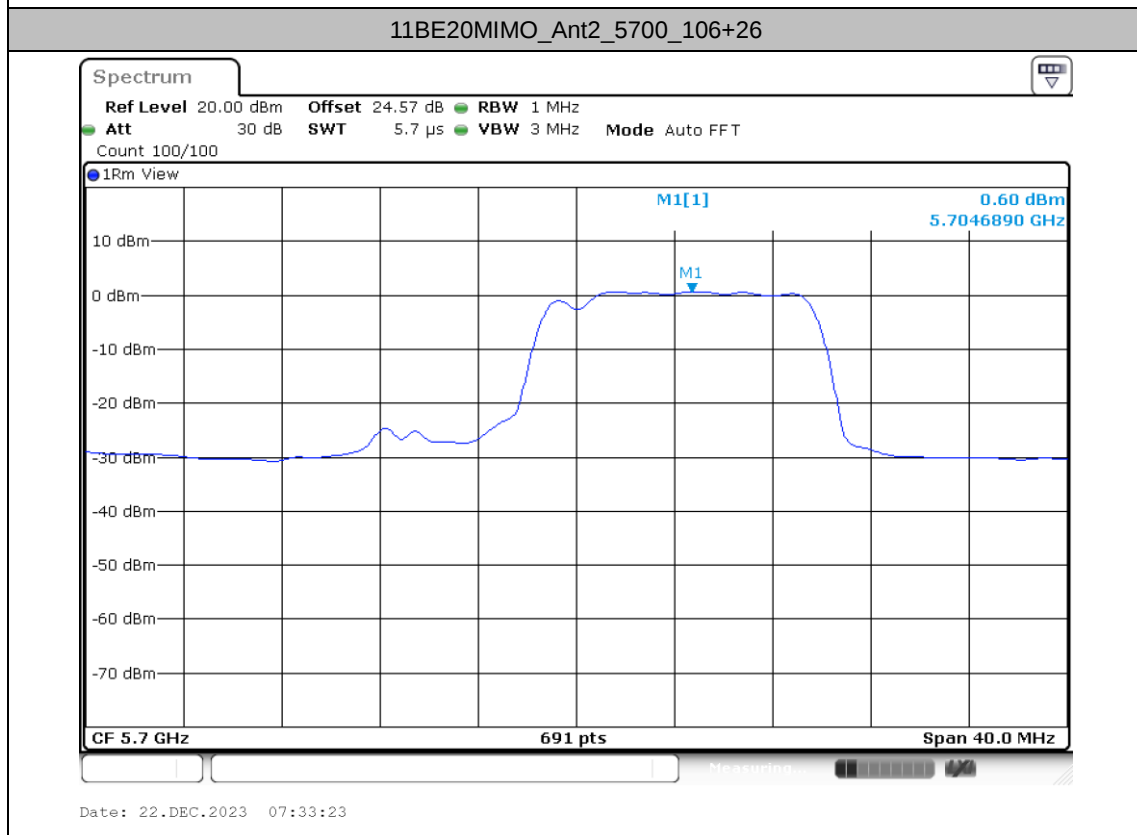
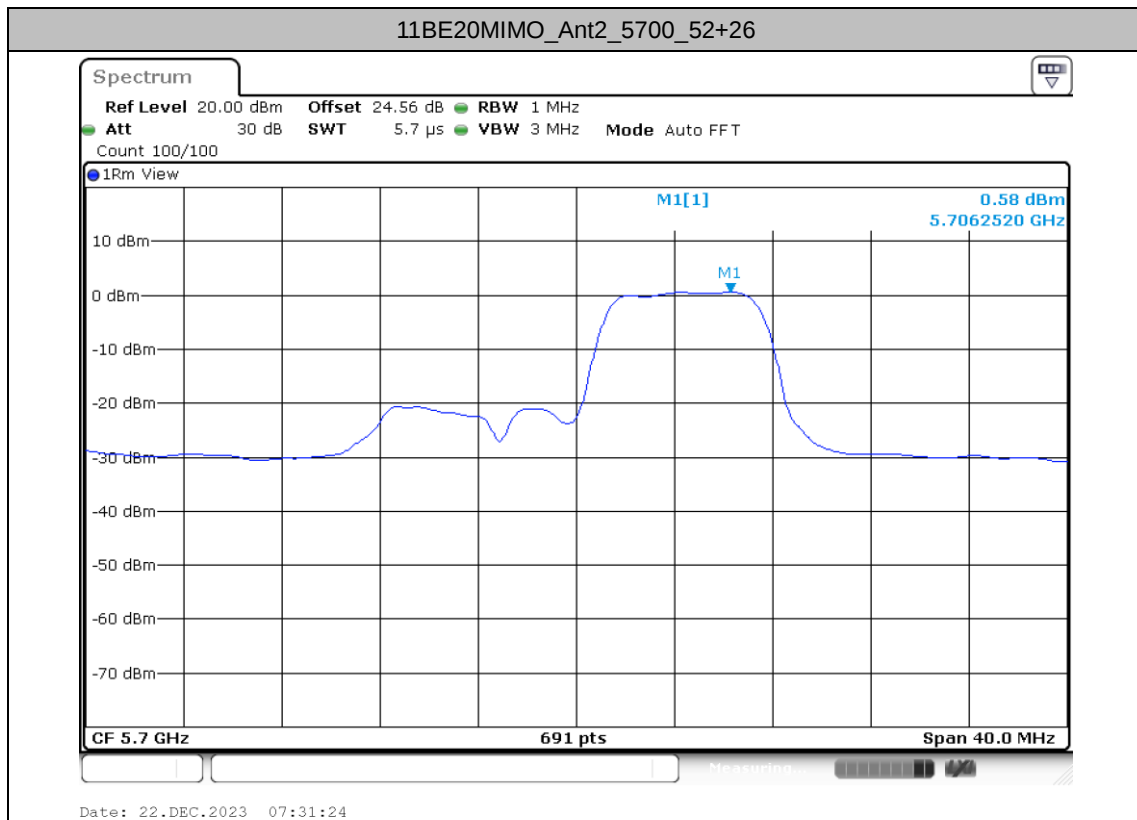



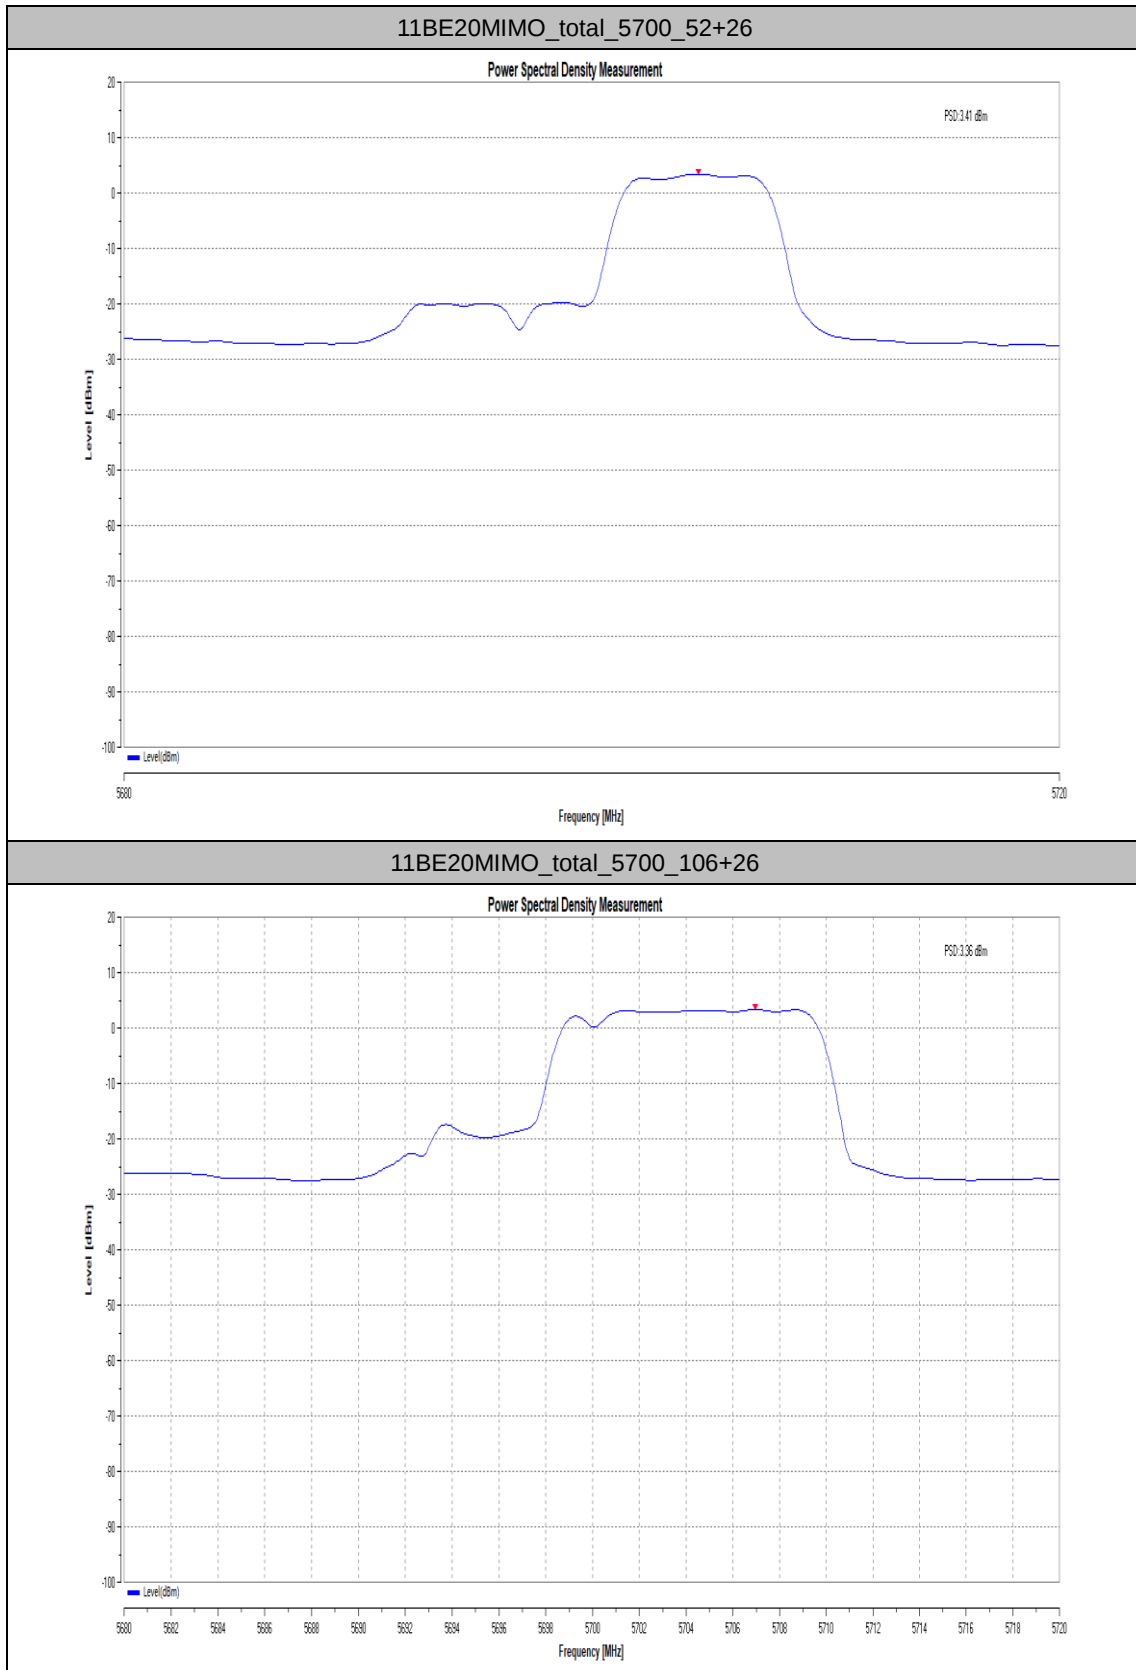


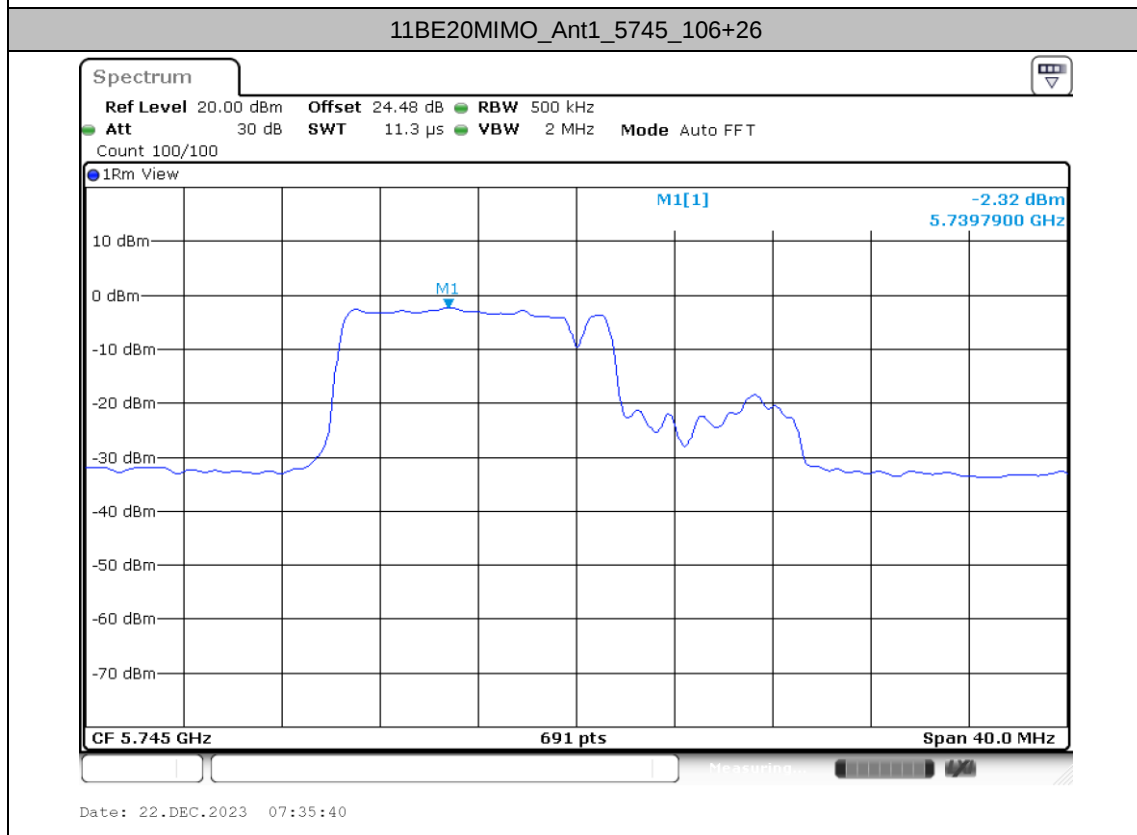
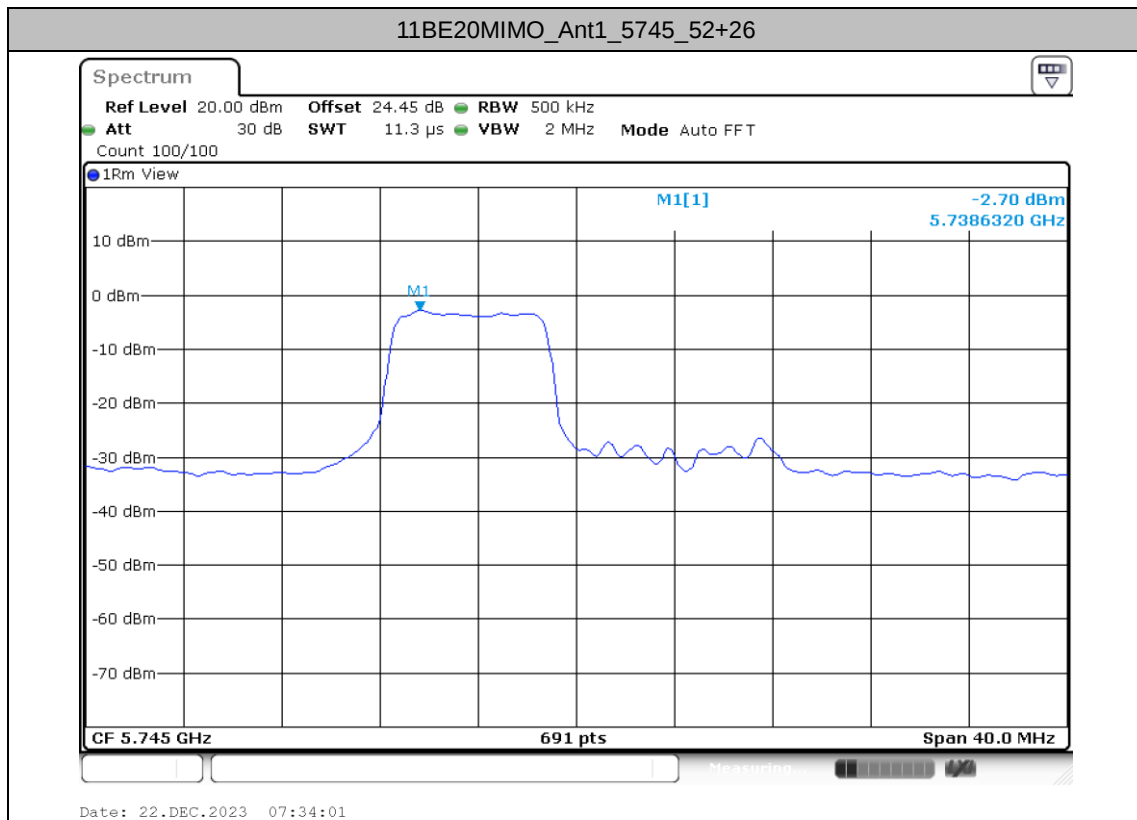


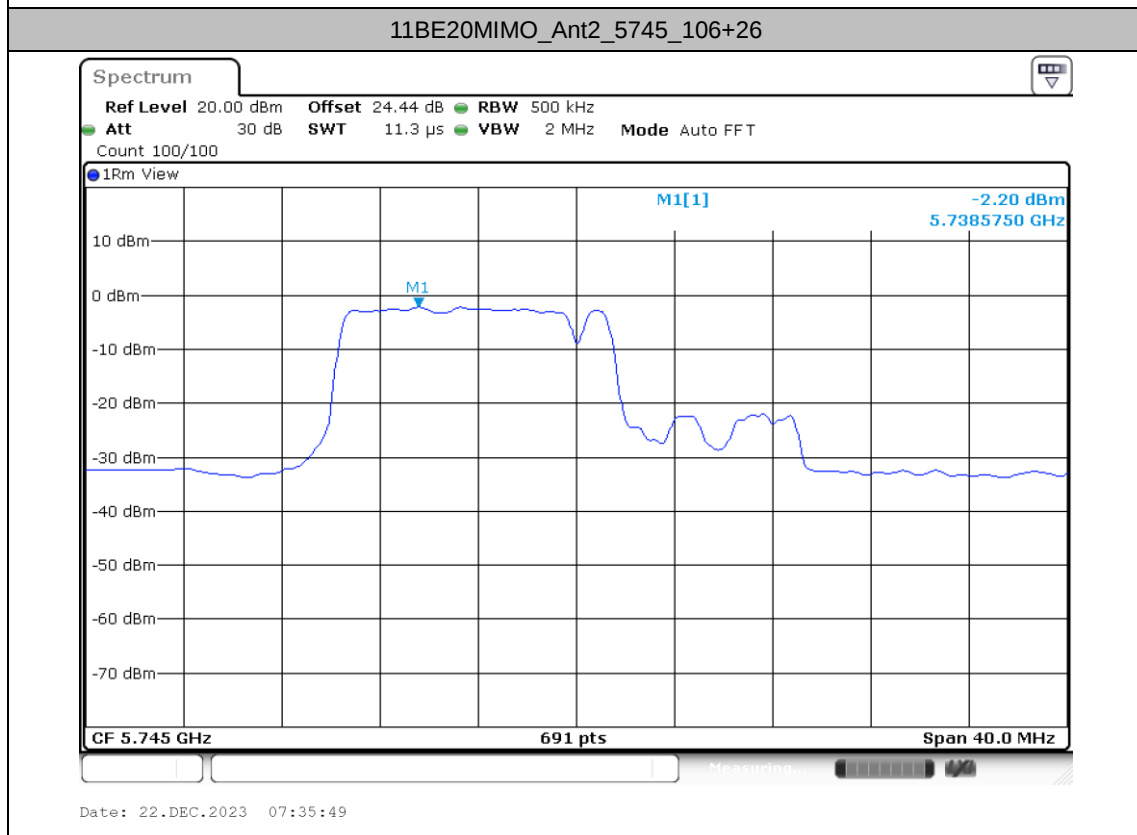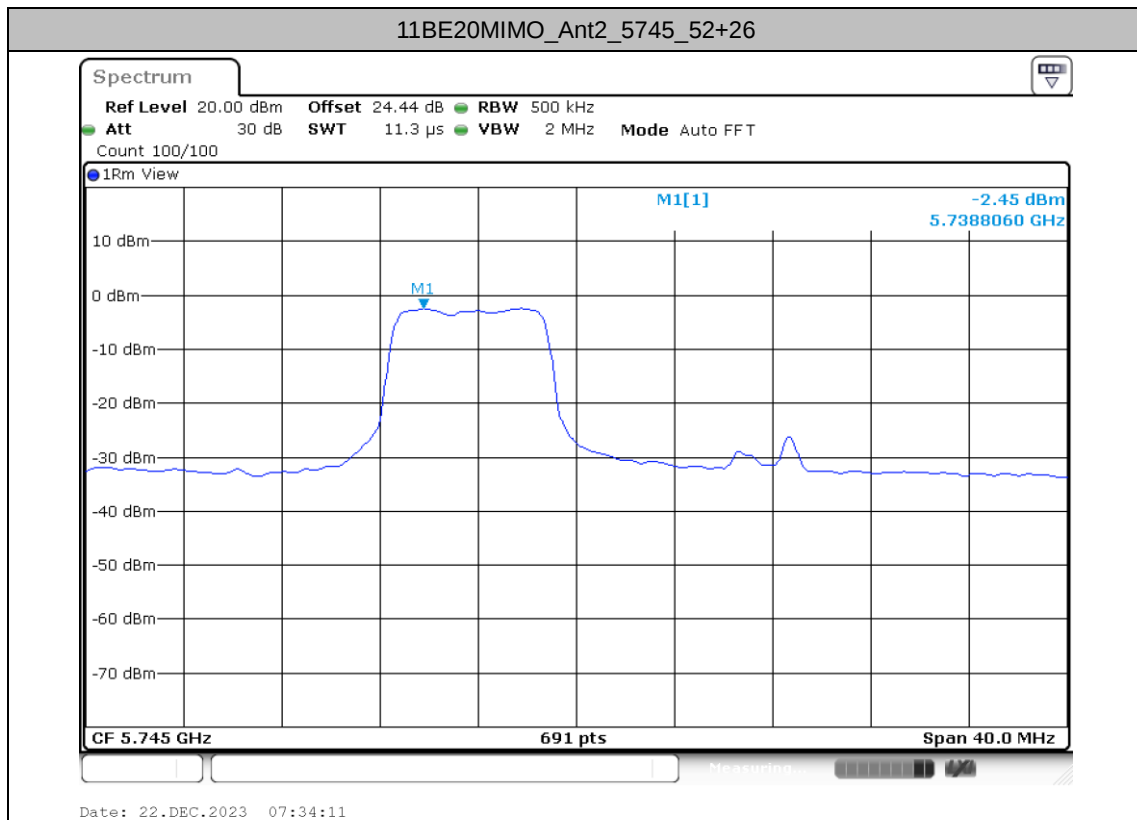

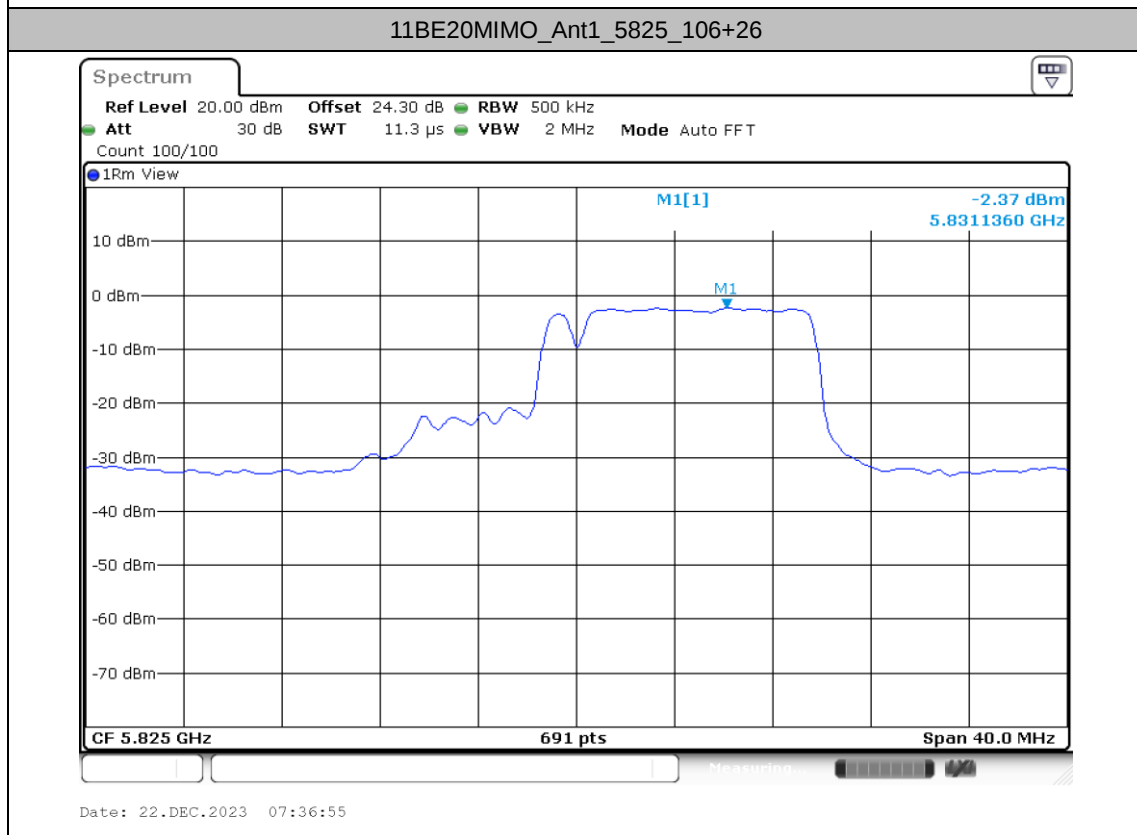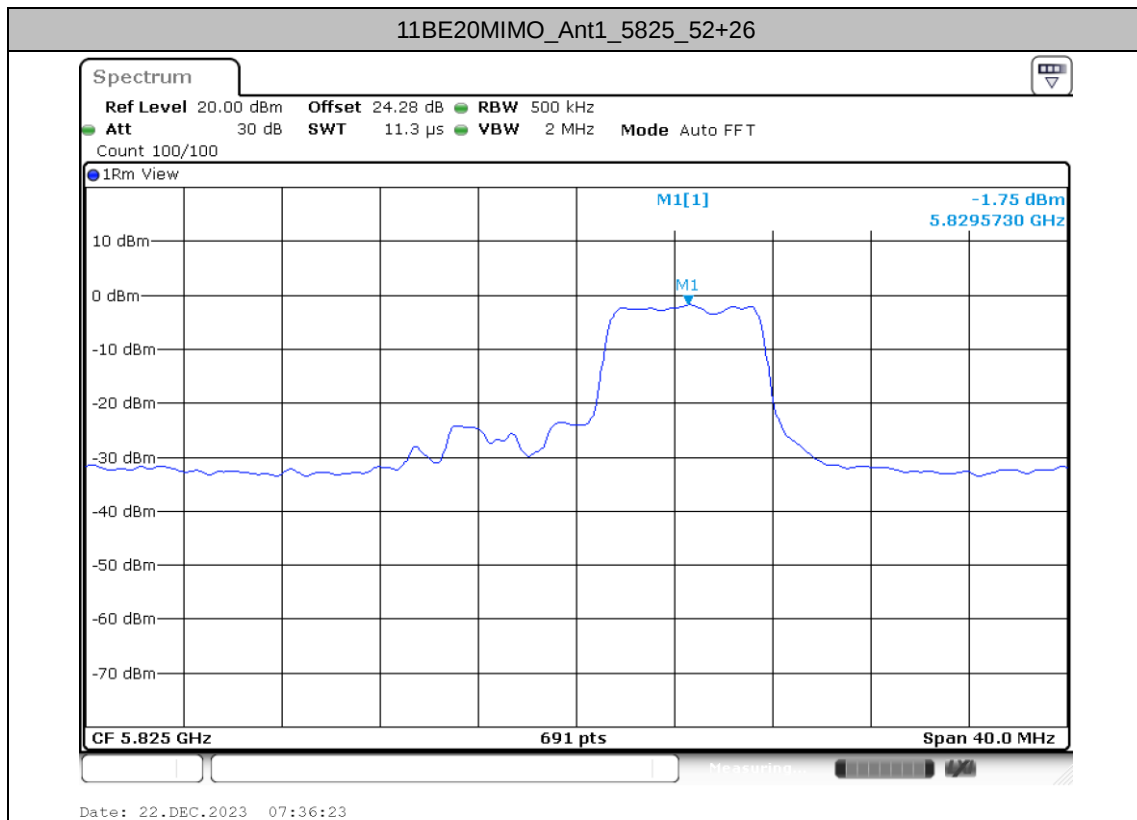

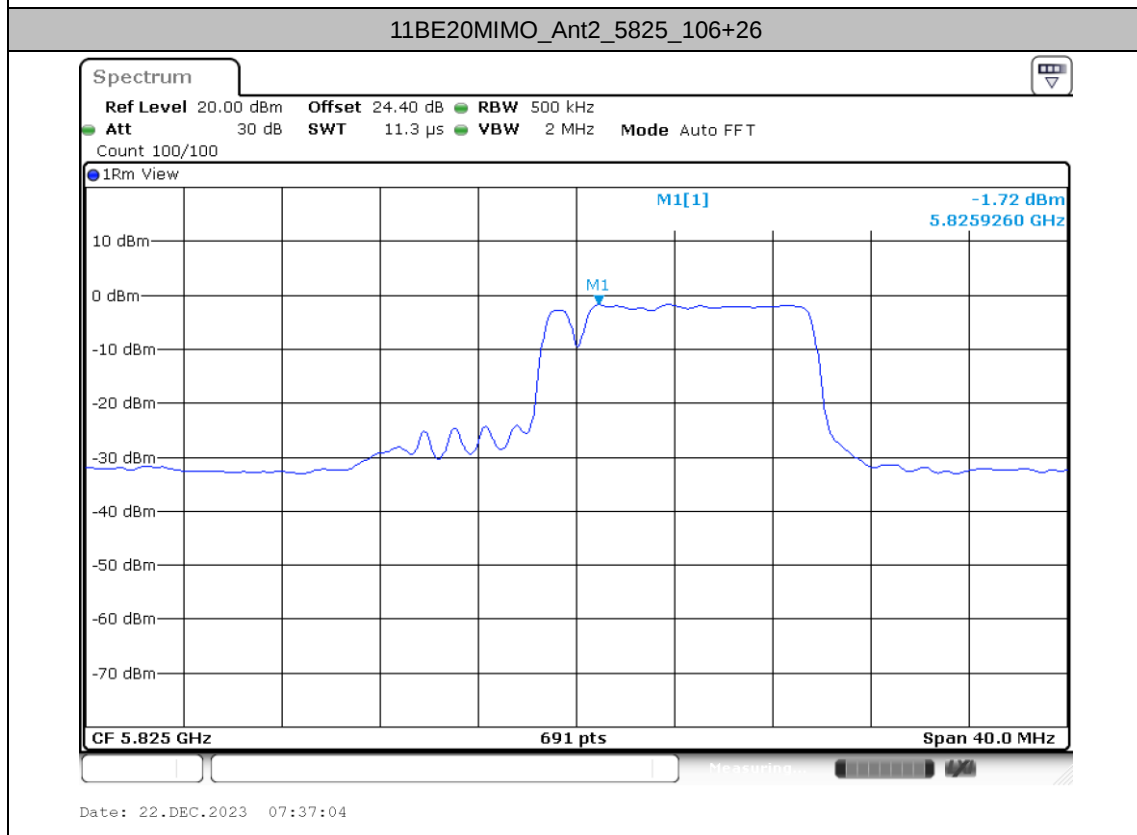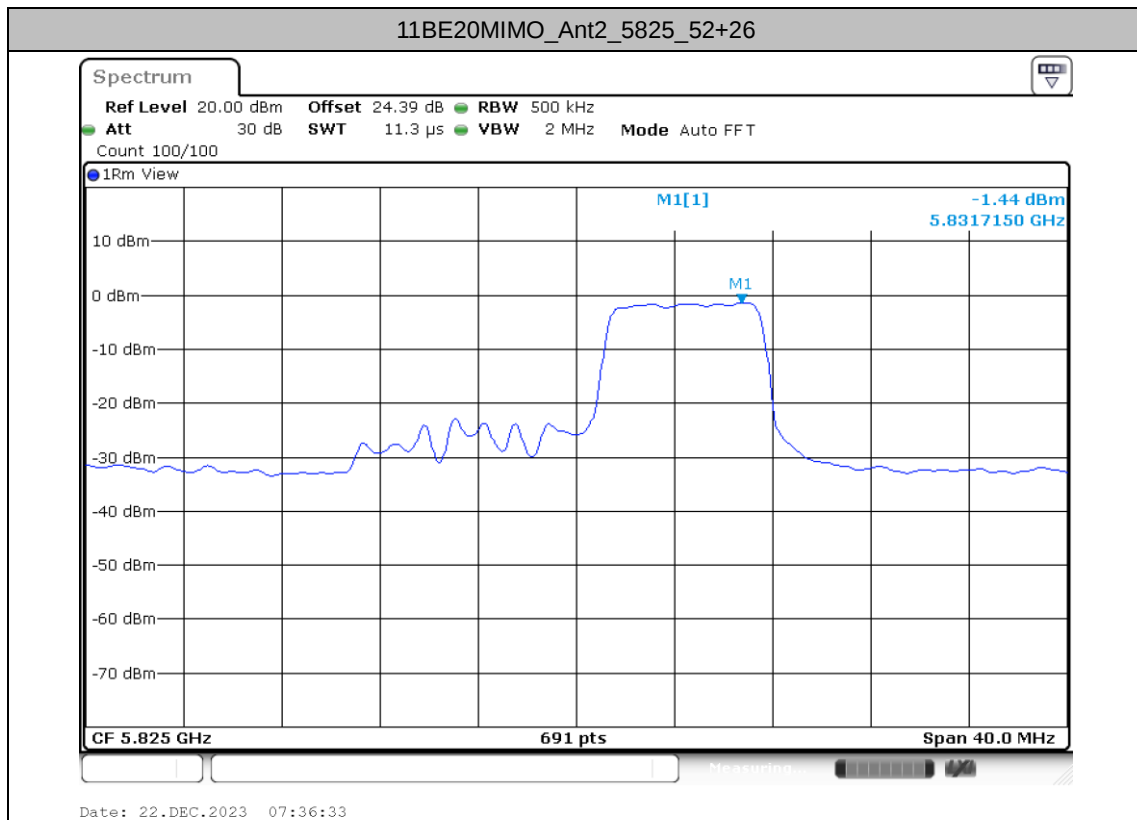


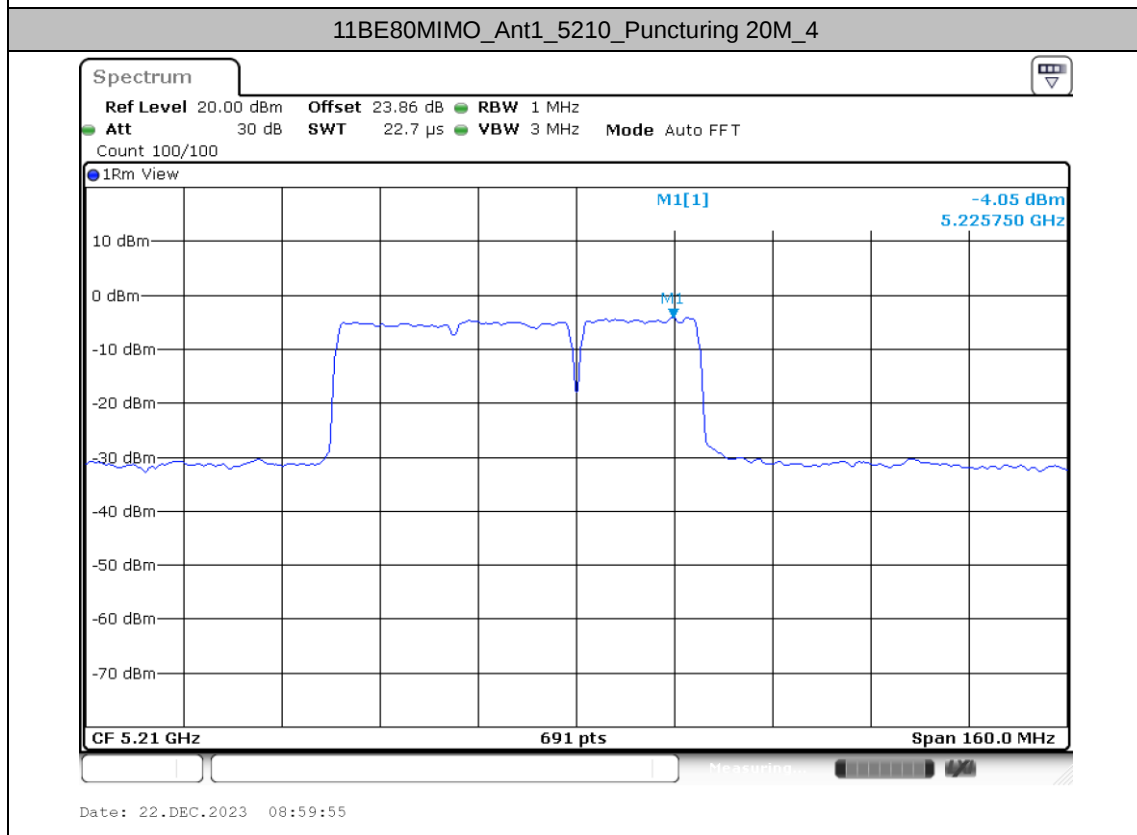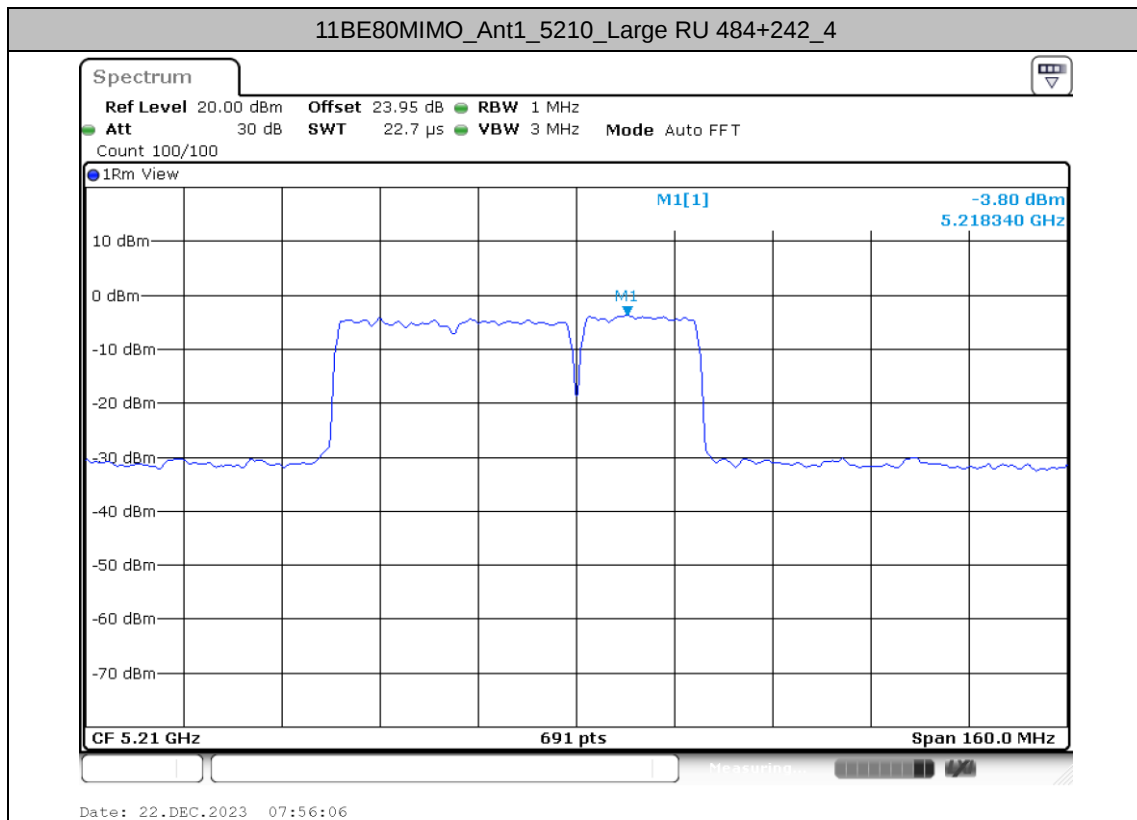

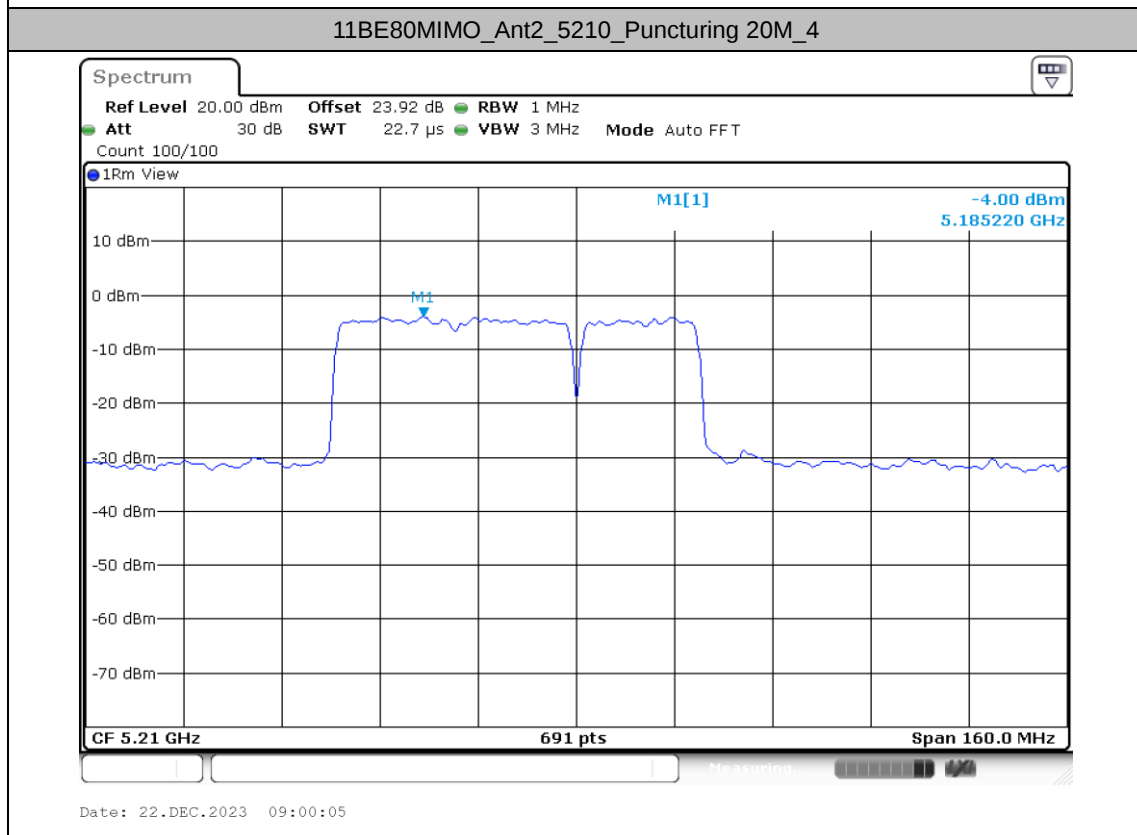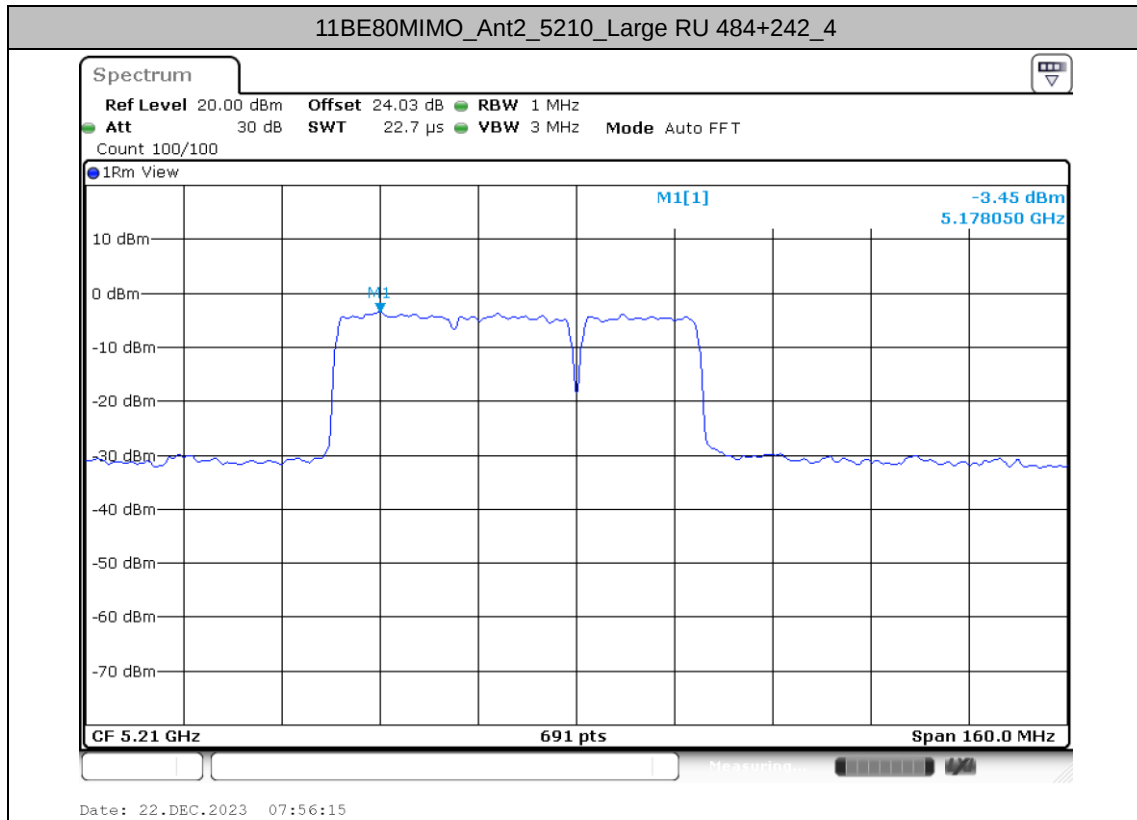








11BE80MIMO\_total\_5210\_Large RU 484+242\_4

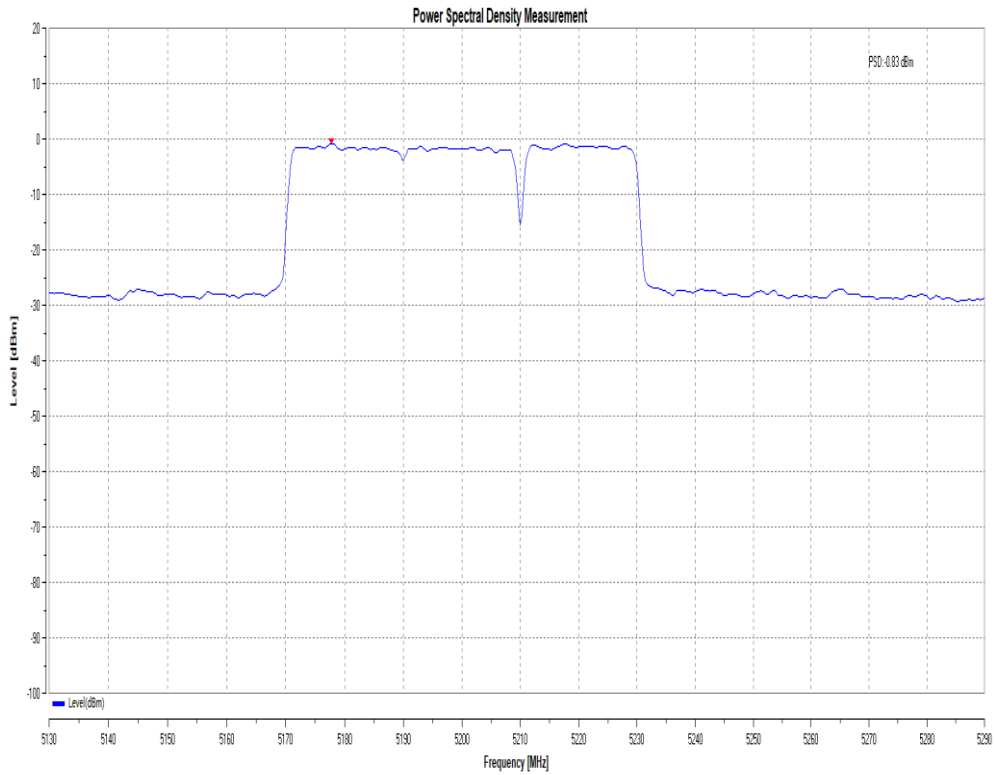

11BE80MIMO\_total\_5210\_Puncturing 20M\_4

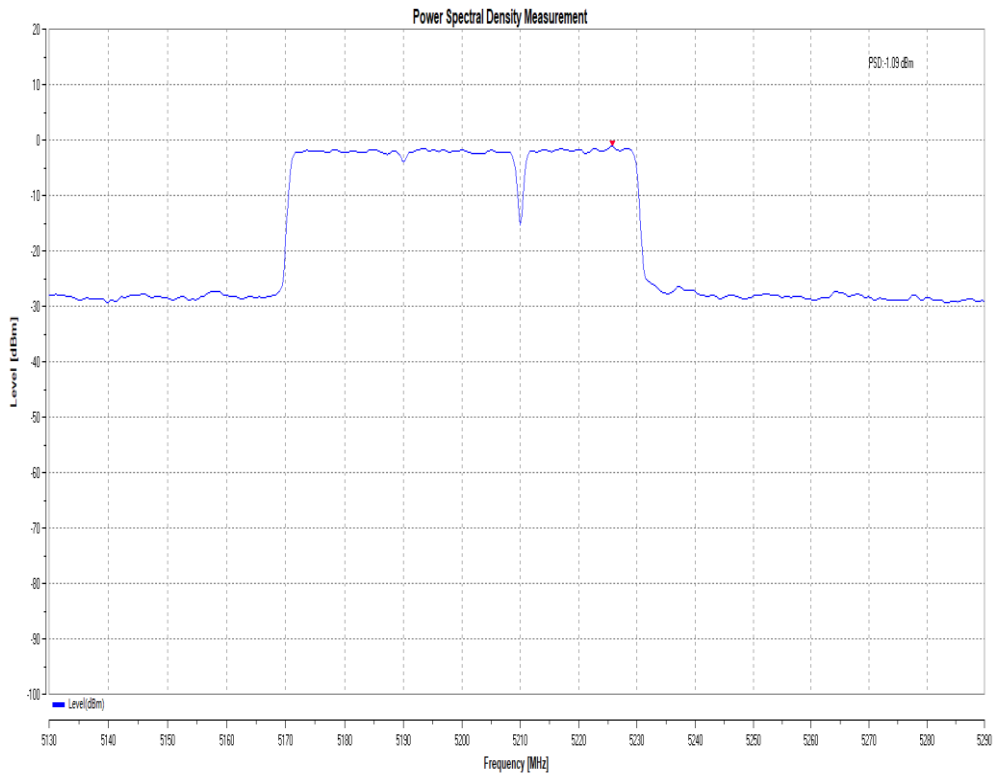


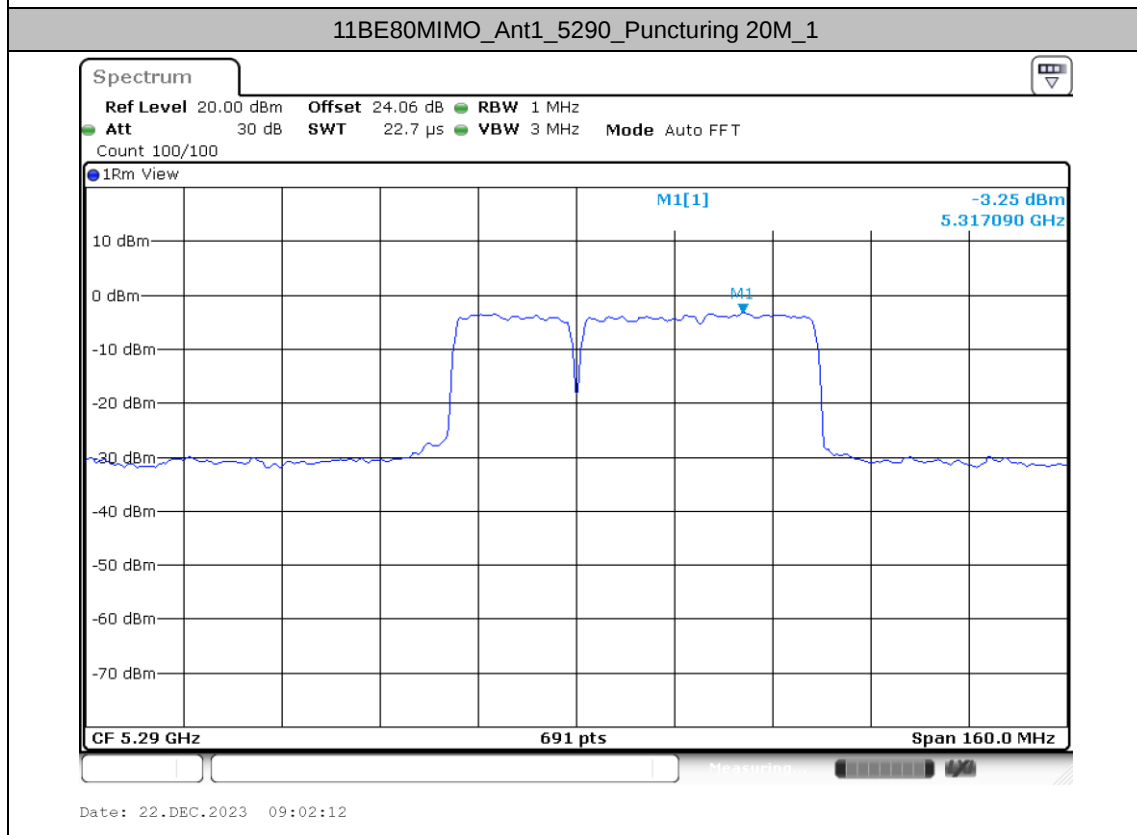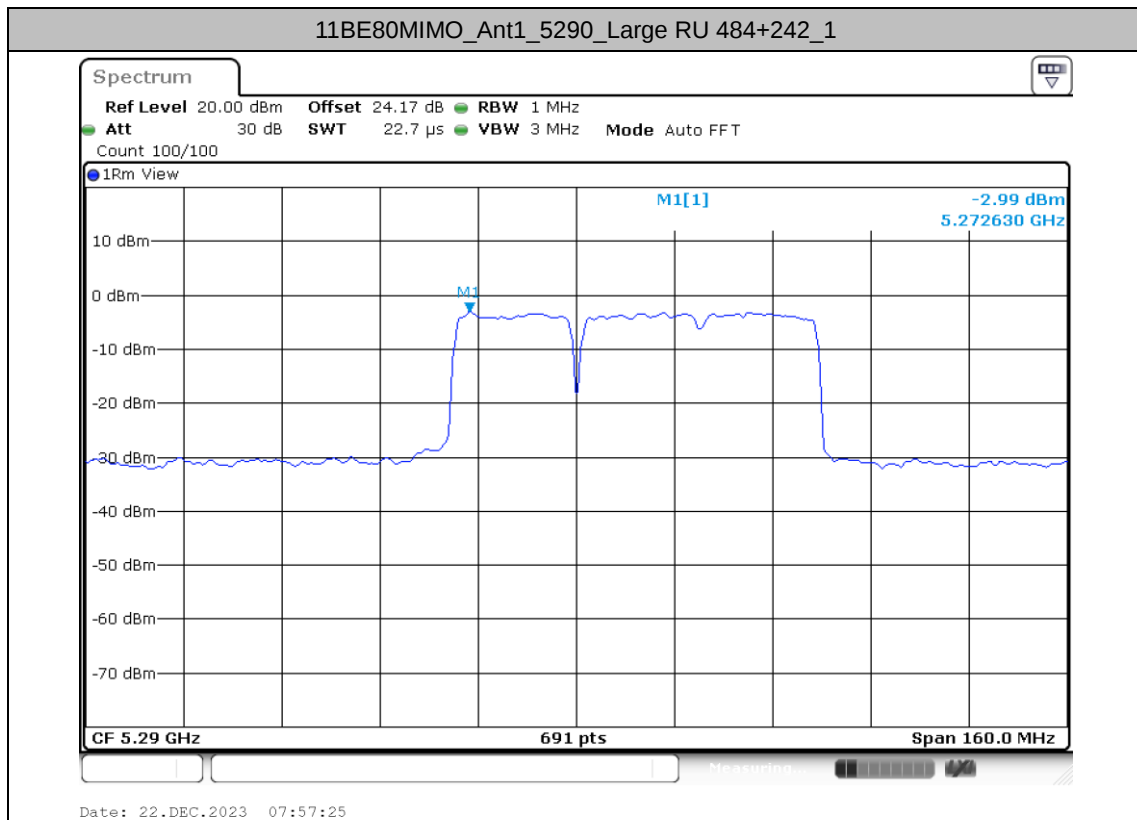

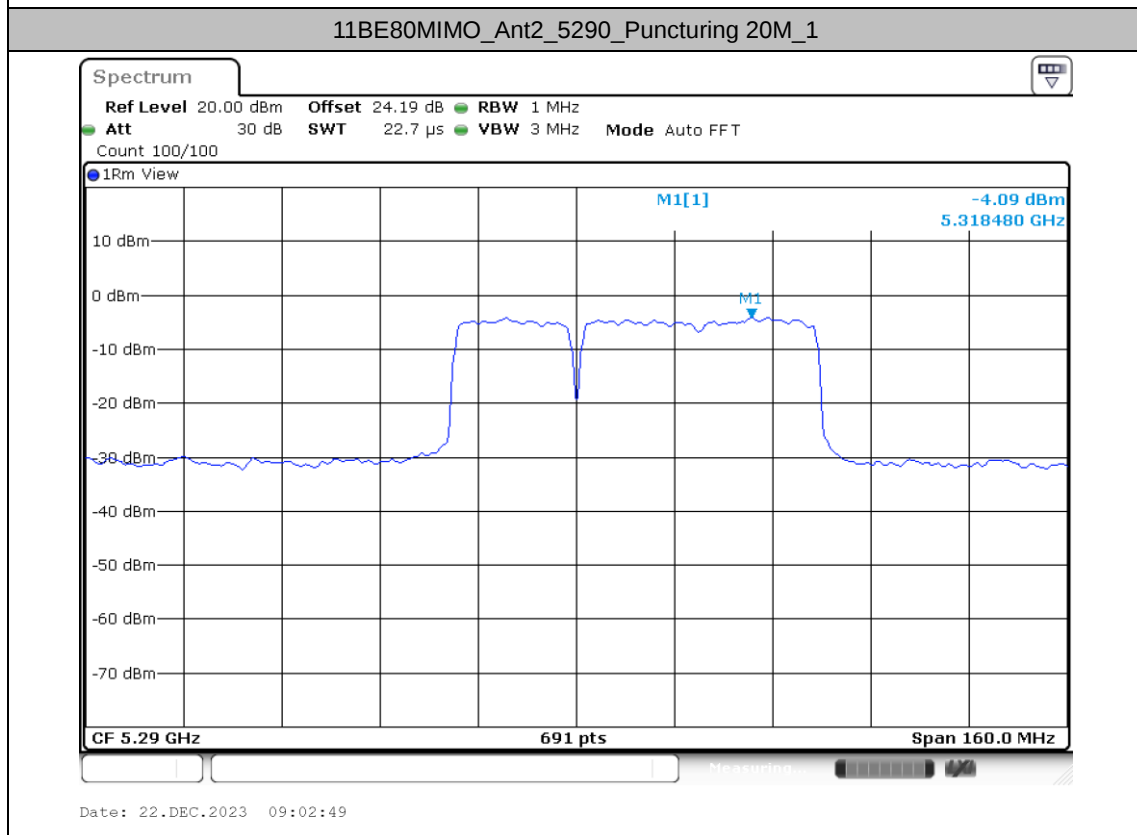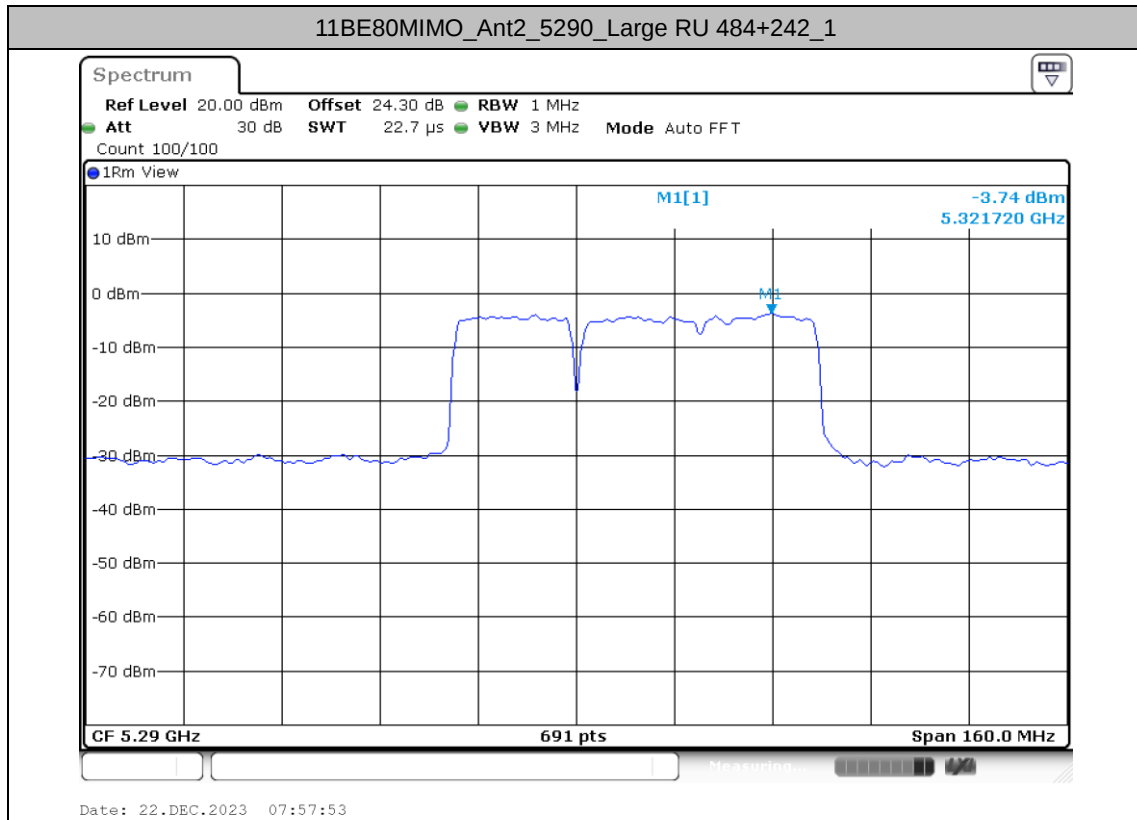








11BE80MIMO\_total\_5290\_Large RU 484+242\_1

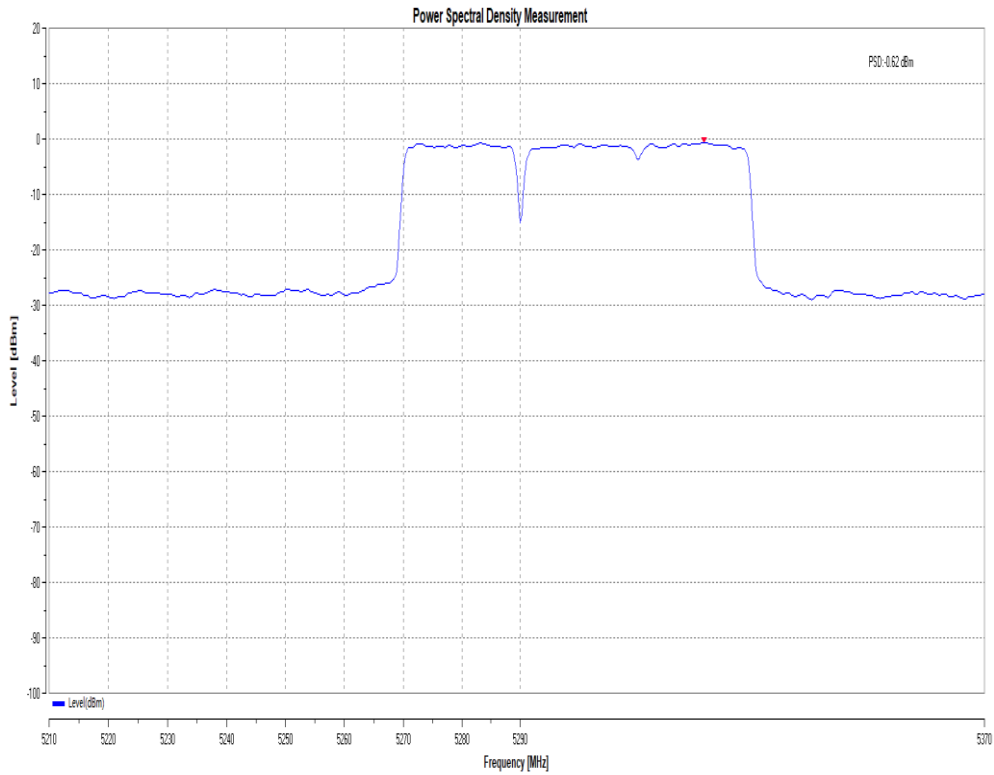

11BE80MIMO\_total\_5290\_Puncturing 20M\_1

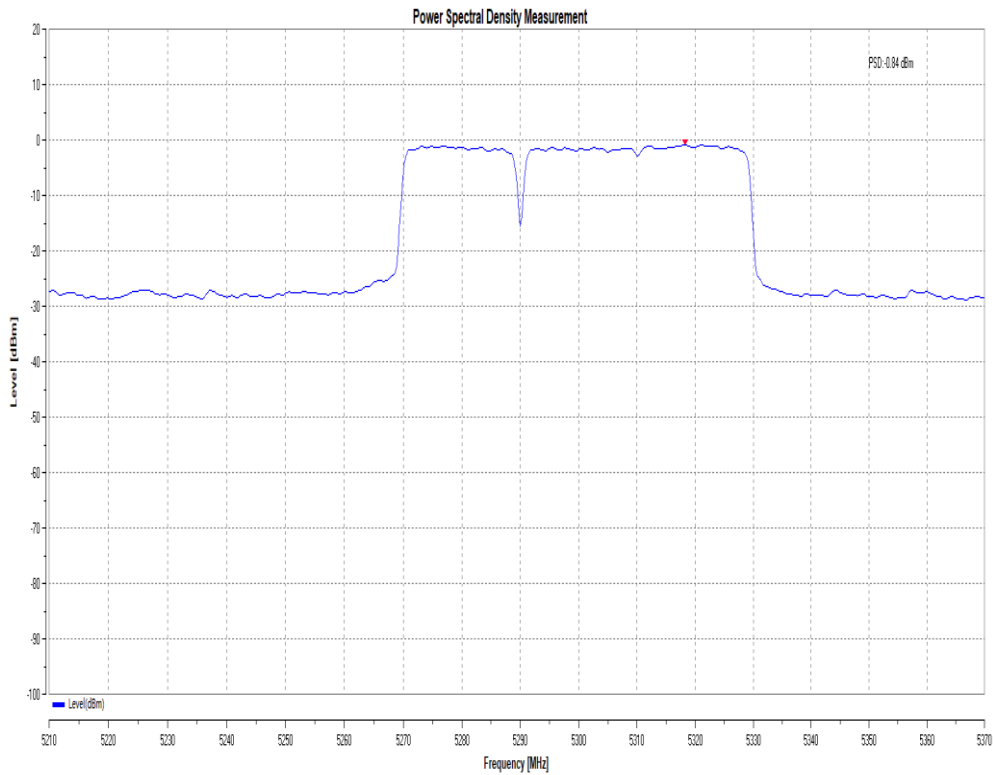


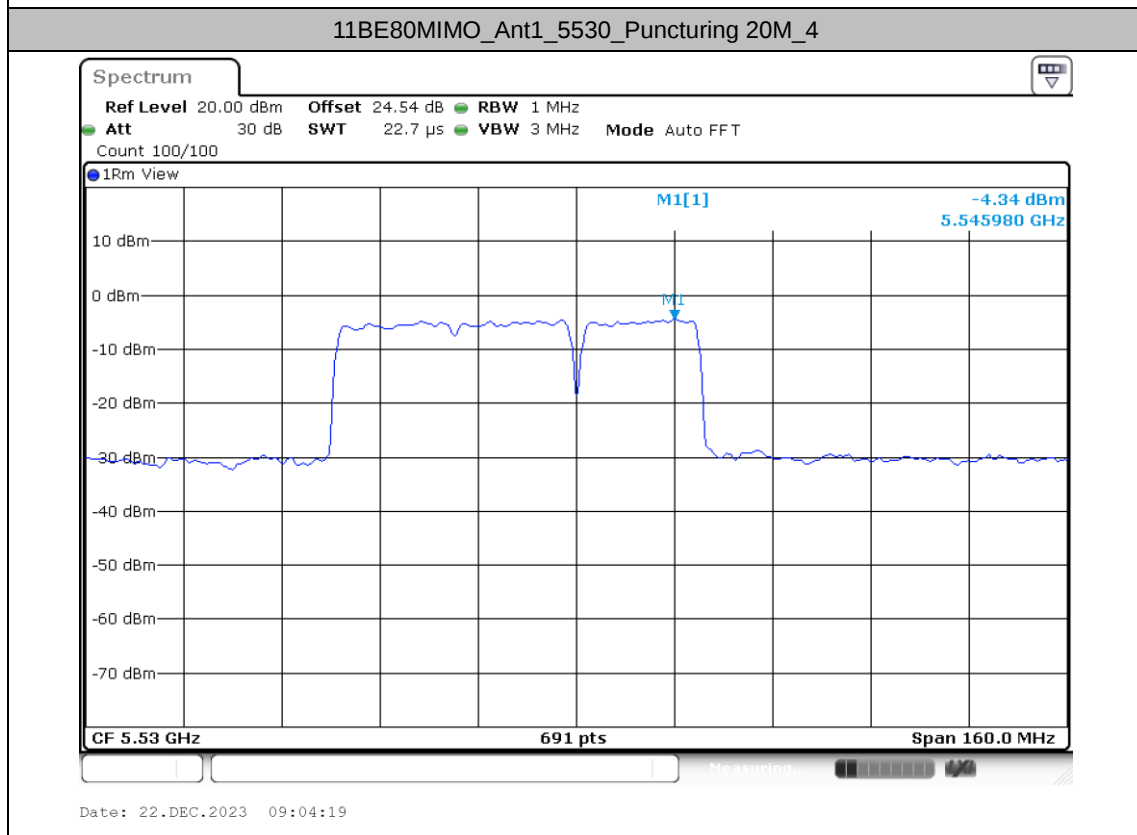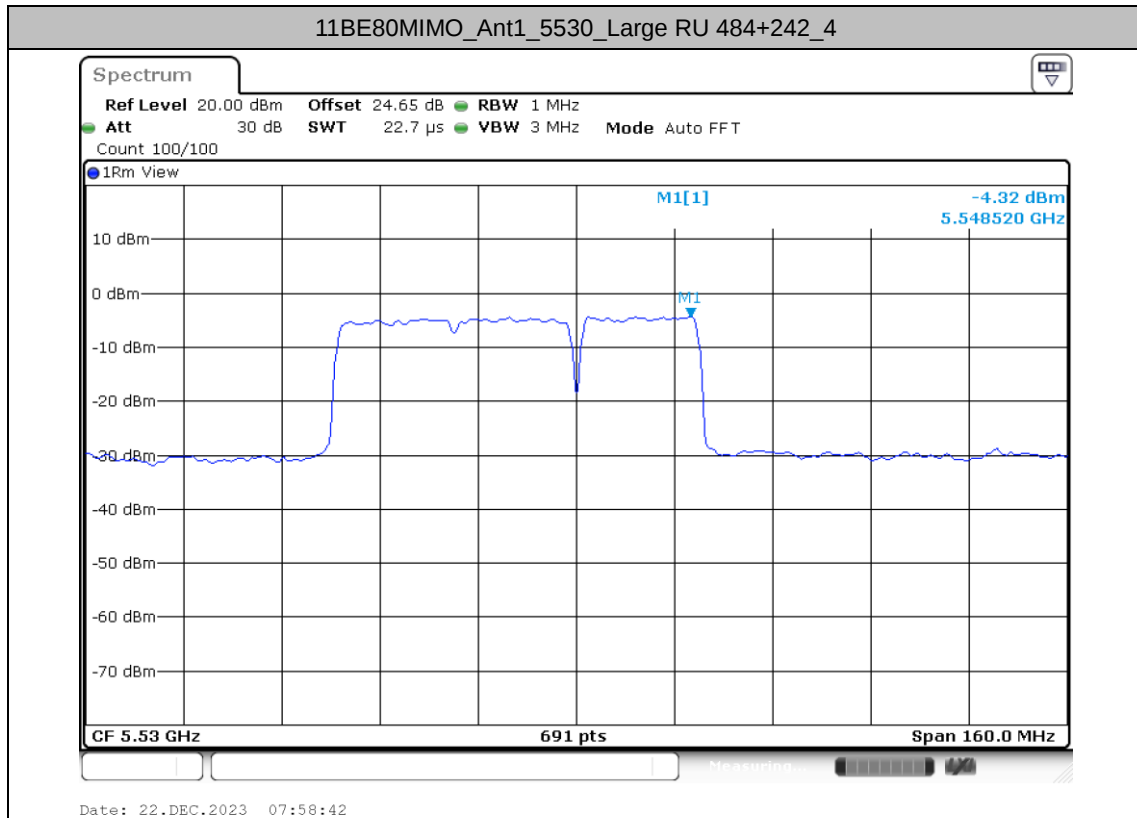

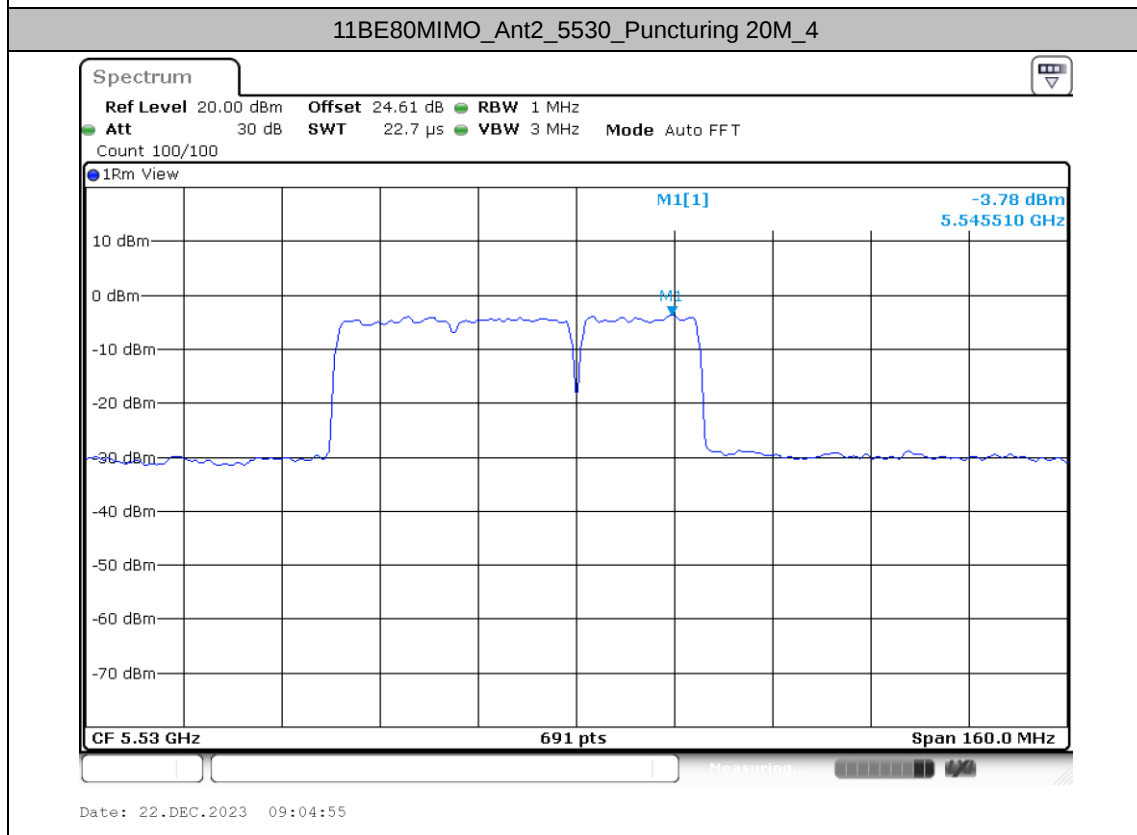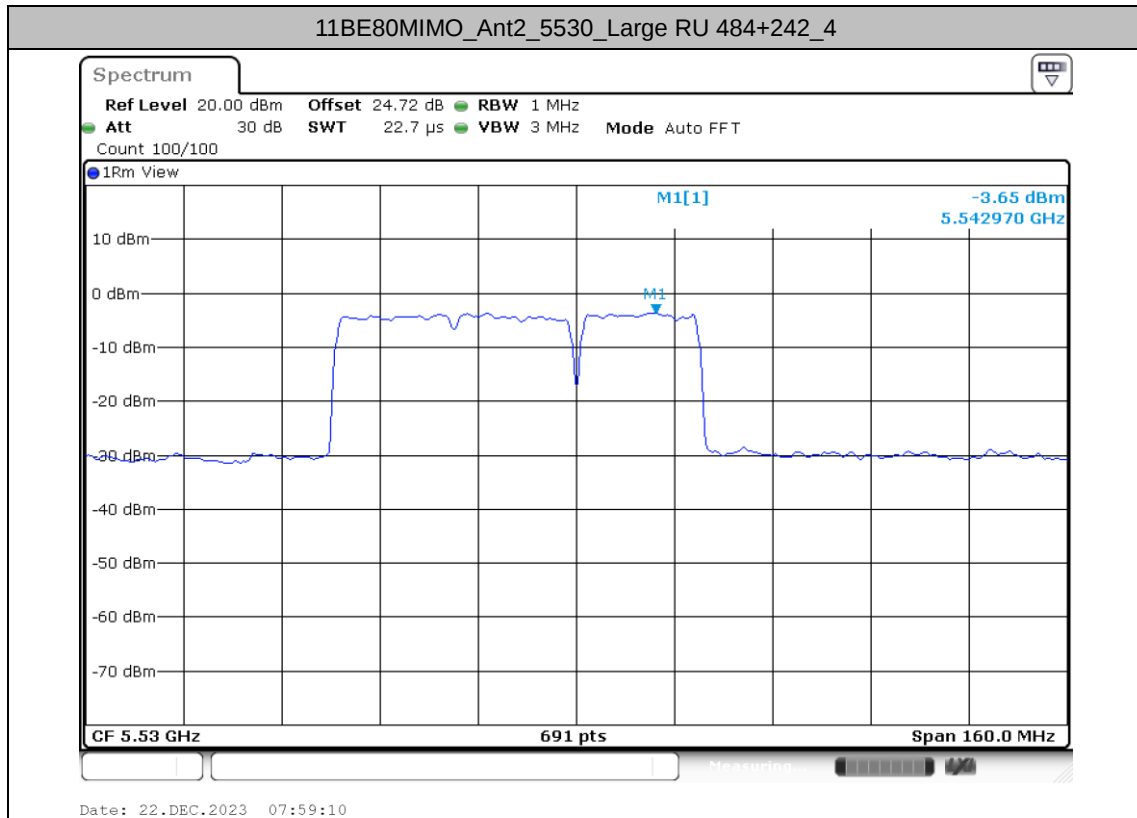






11BE80MIMO\_total\_5530\_Large RU 484+242\_4

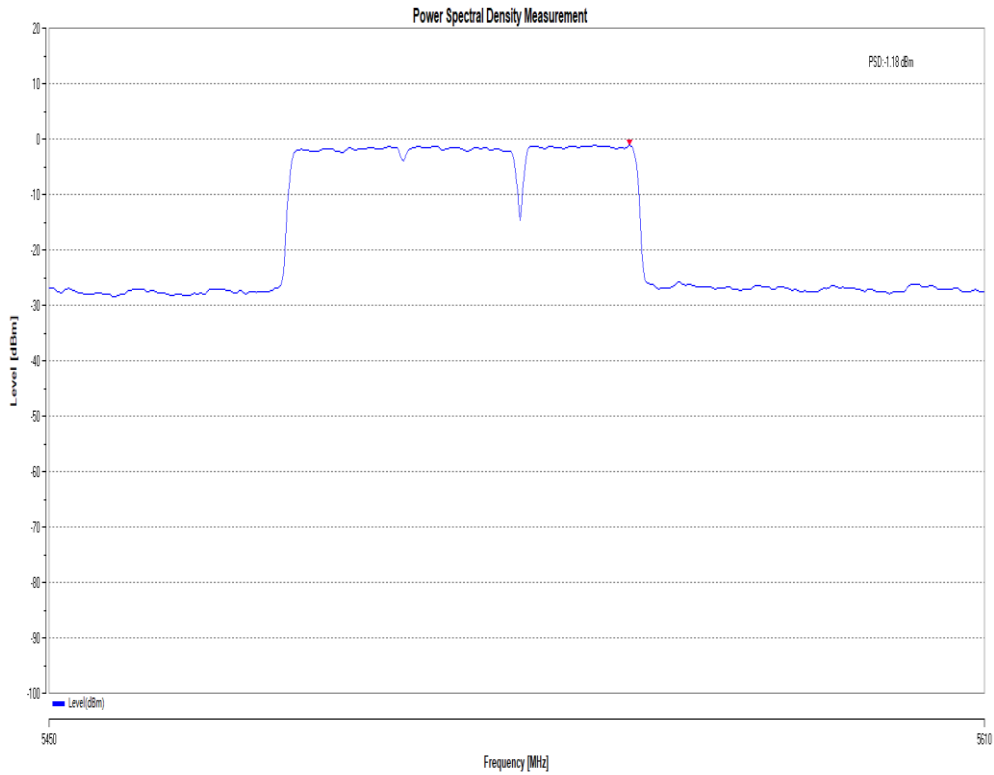

11BE80MIMO\_total\_5530\_Puncturing 20M\_4

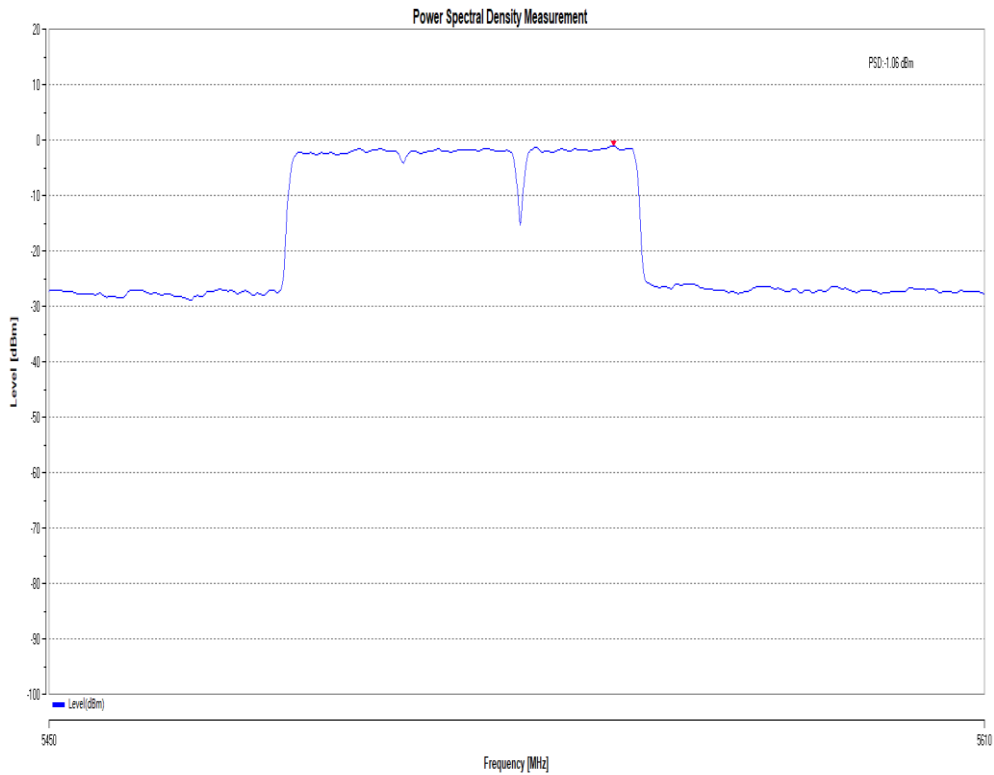


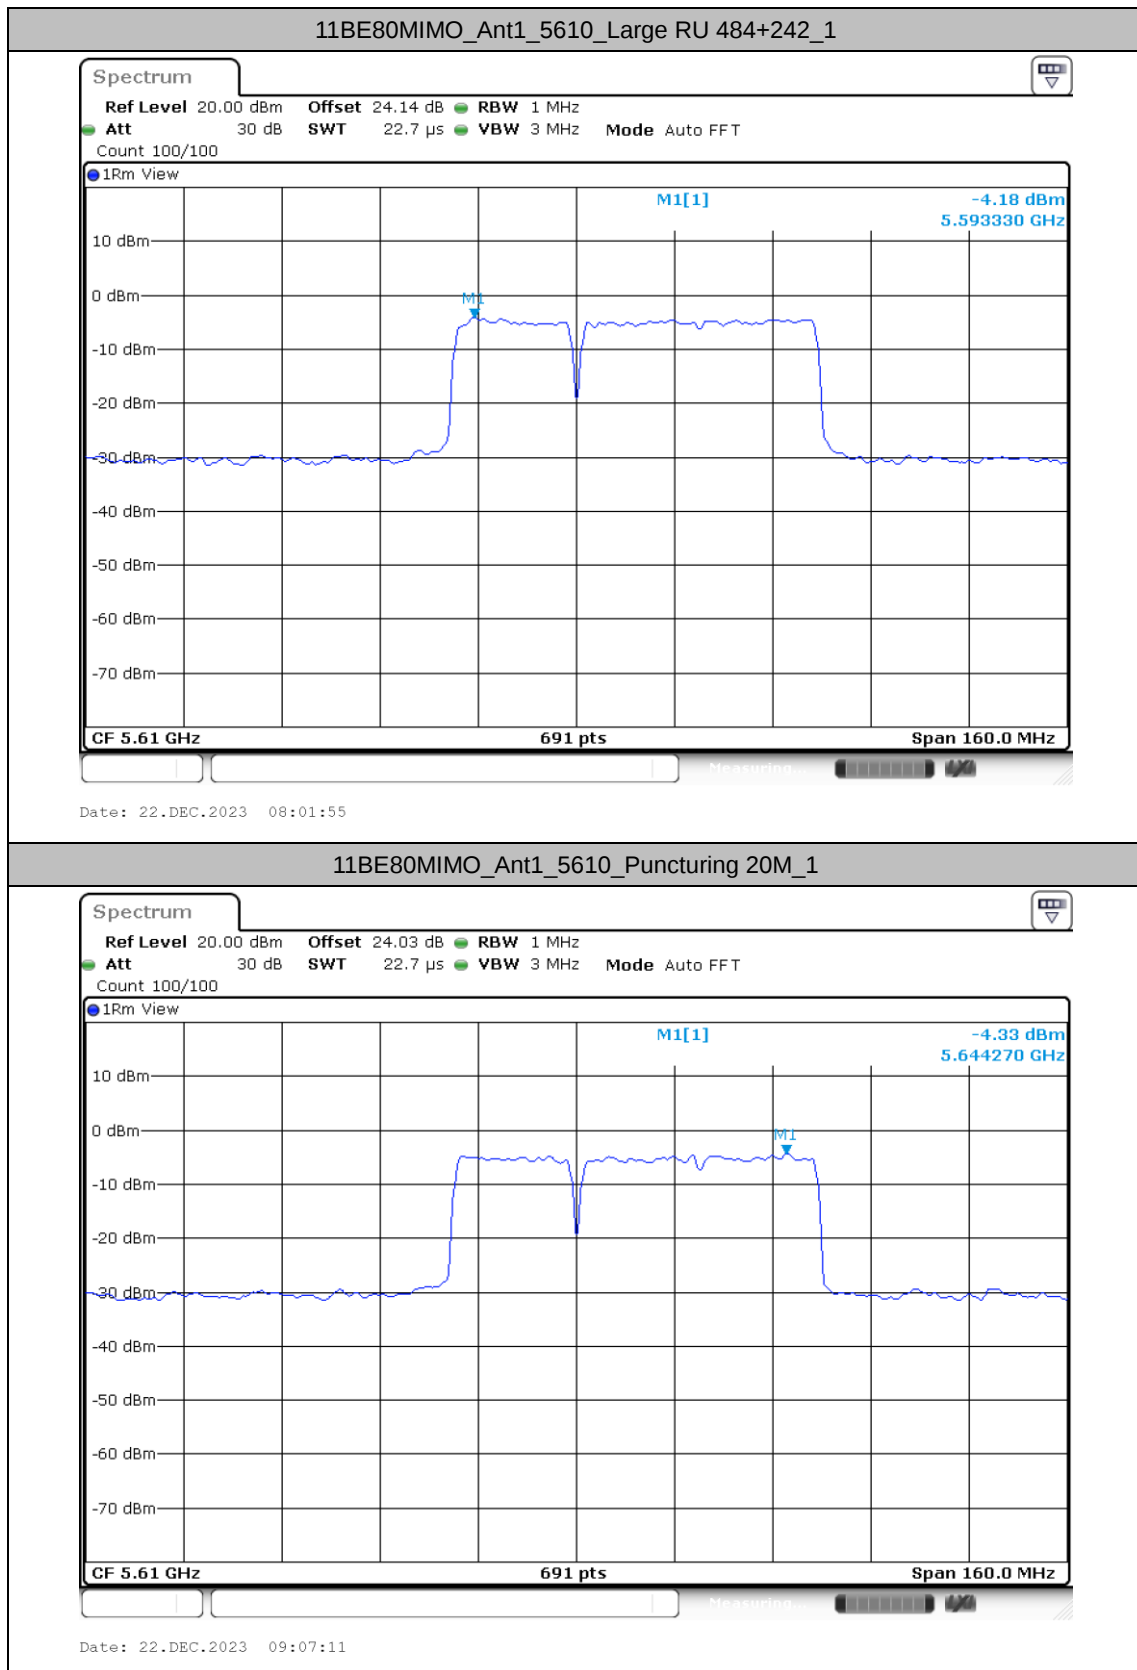

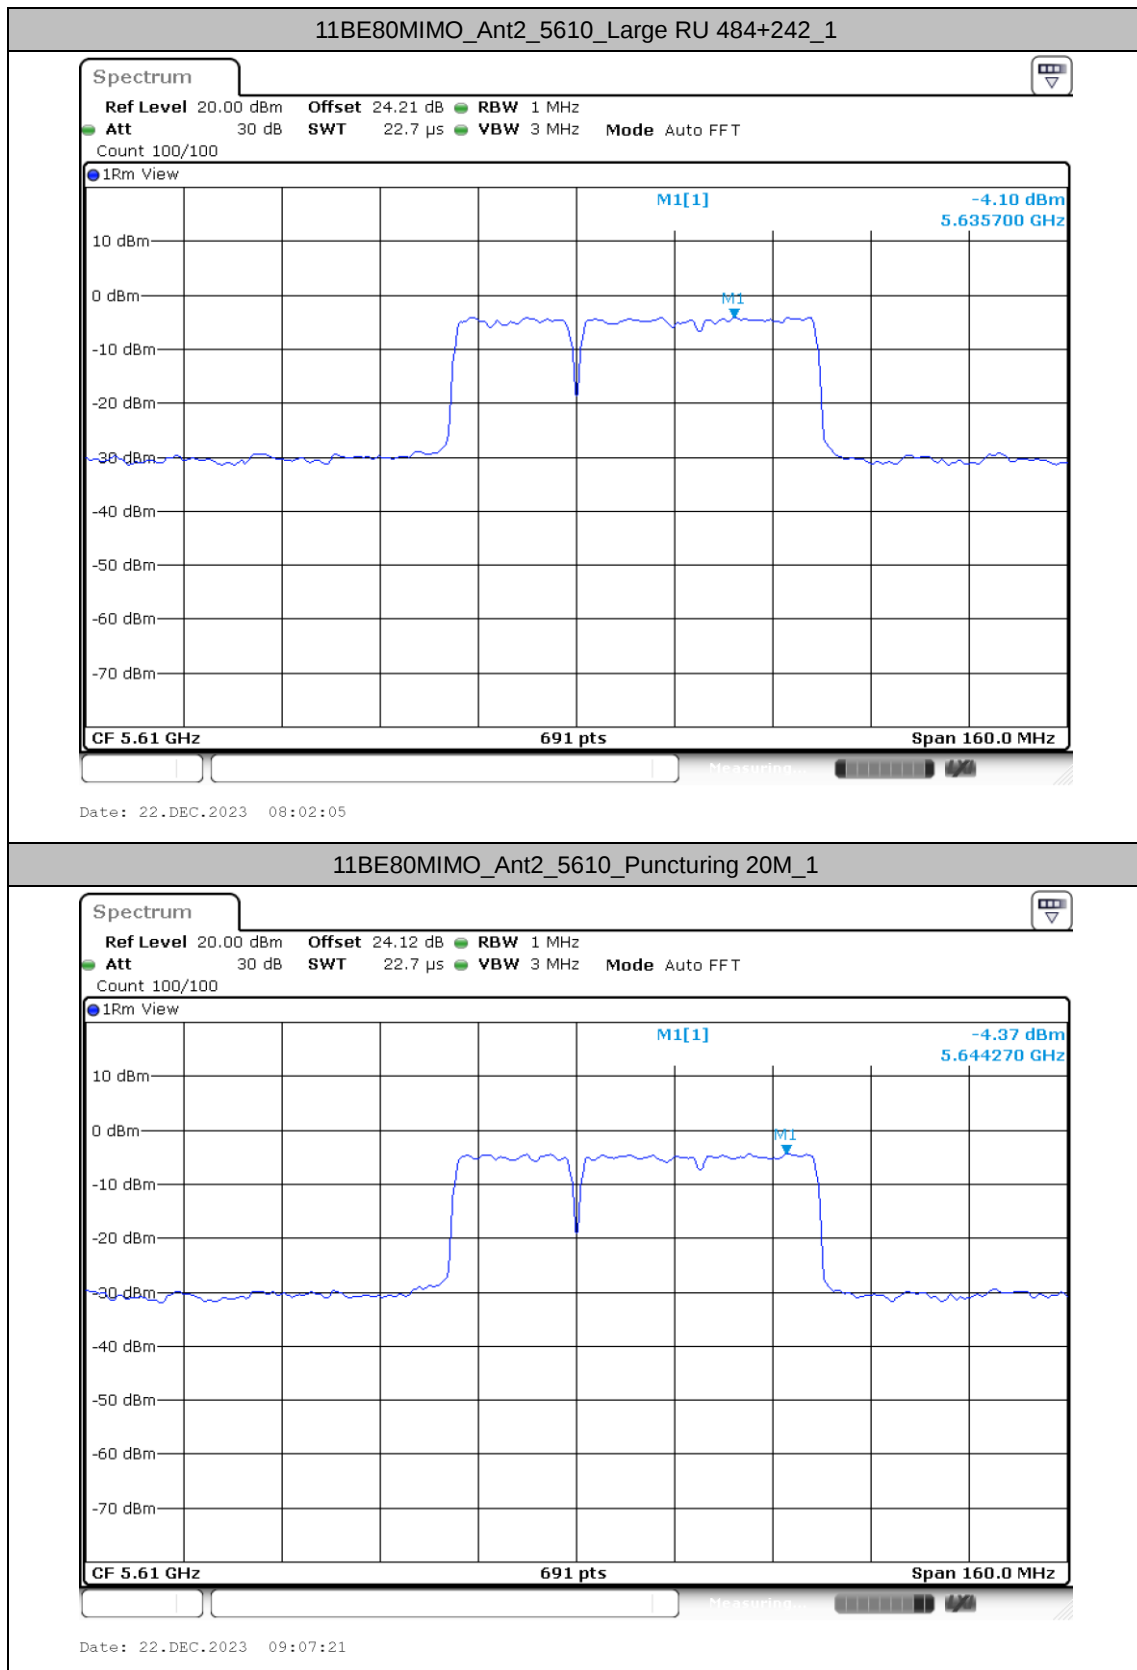







11BE80MIMO\_total\_5610\_Large RU 484+242\_1

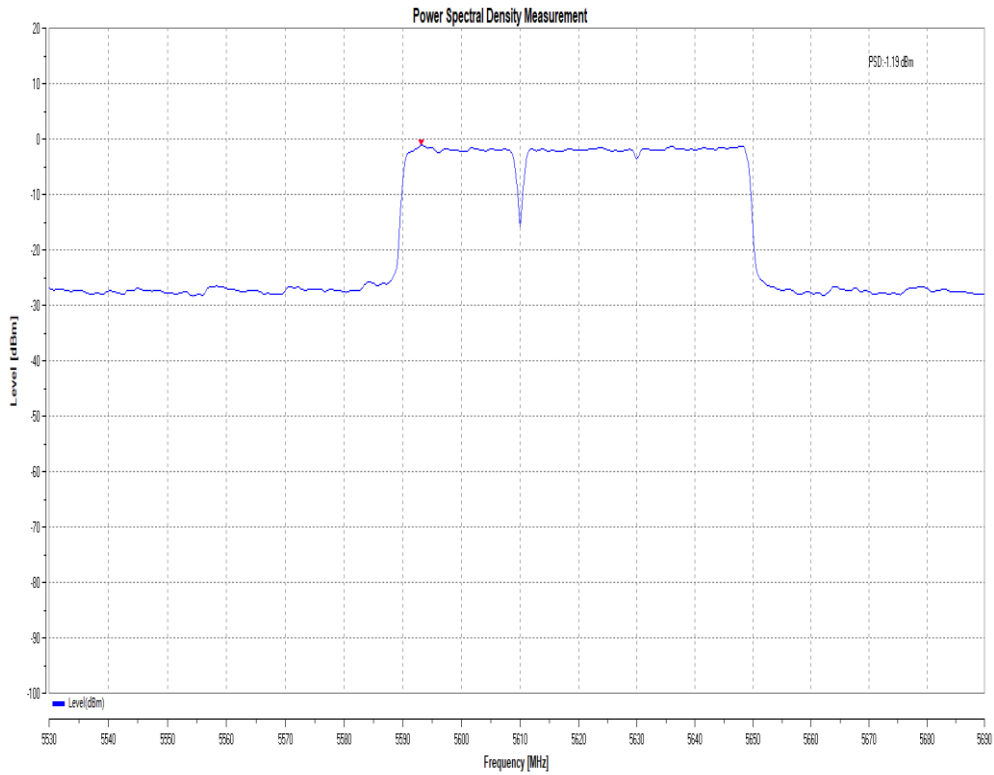

11BE80MIMO\_total\_5610\_Puncturing 20M\_1

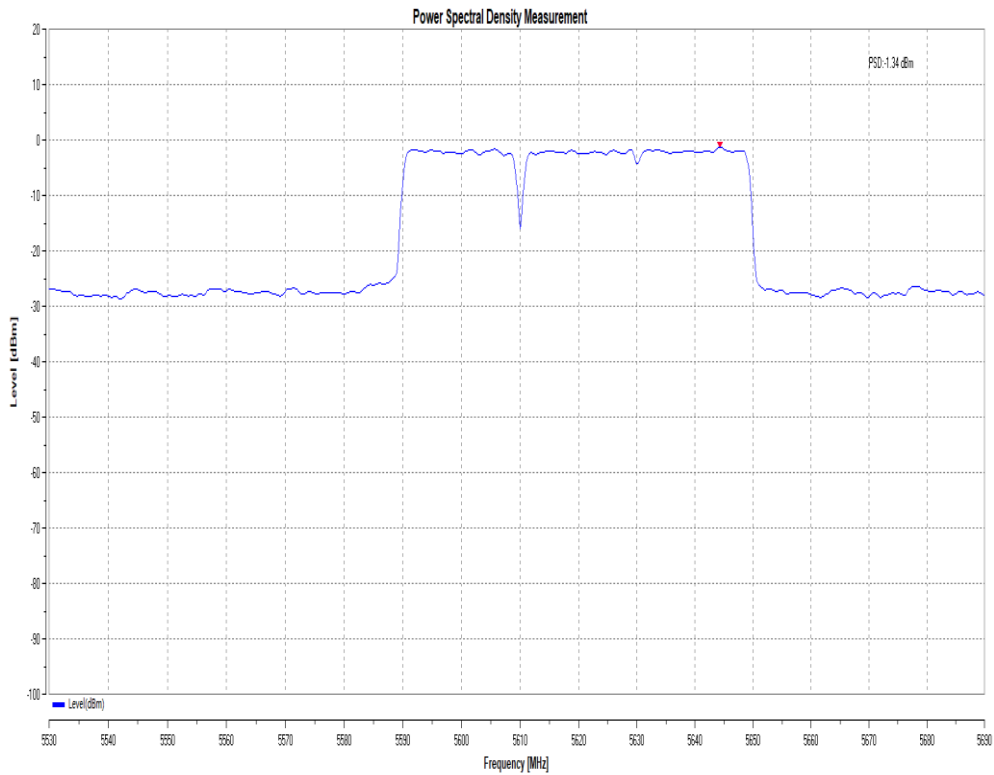


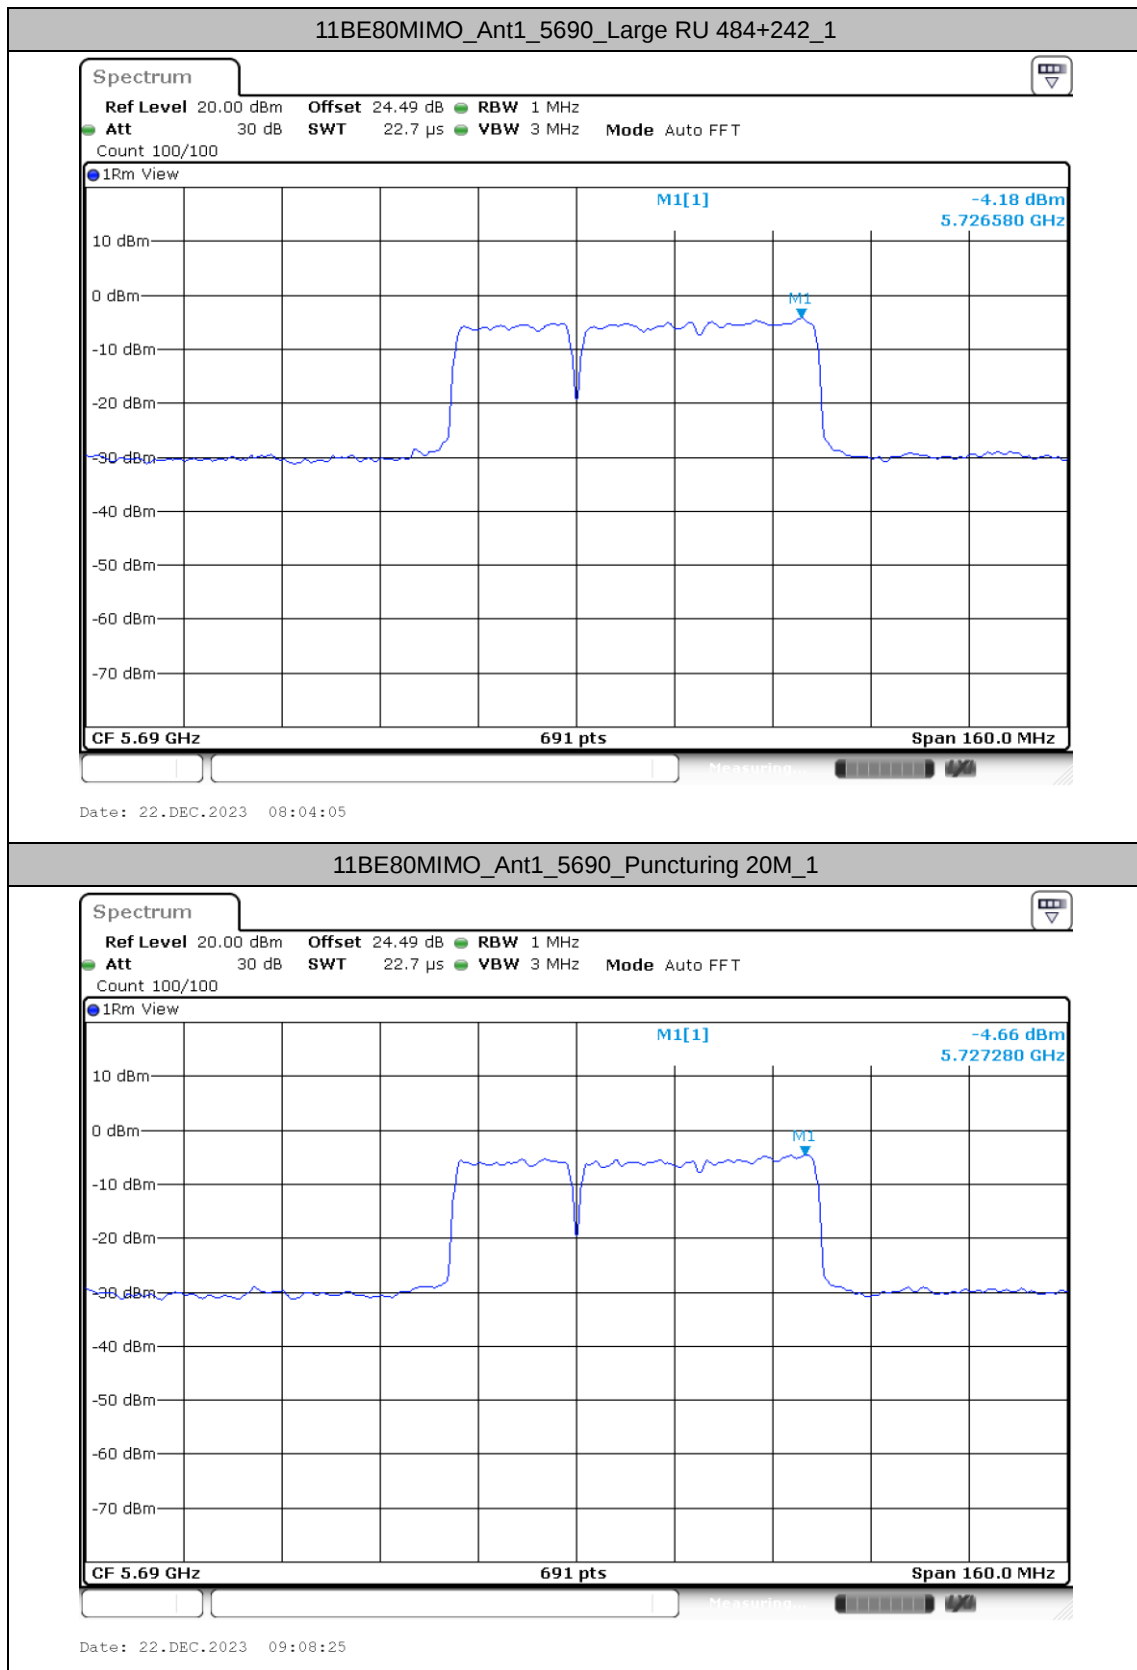

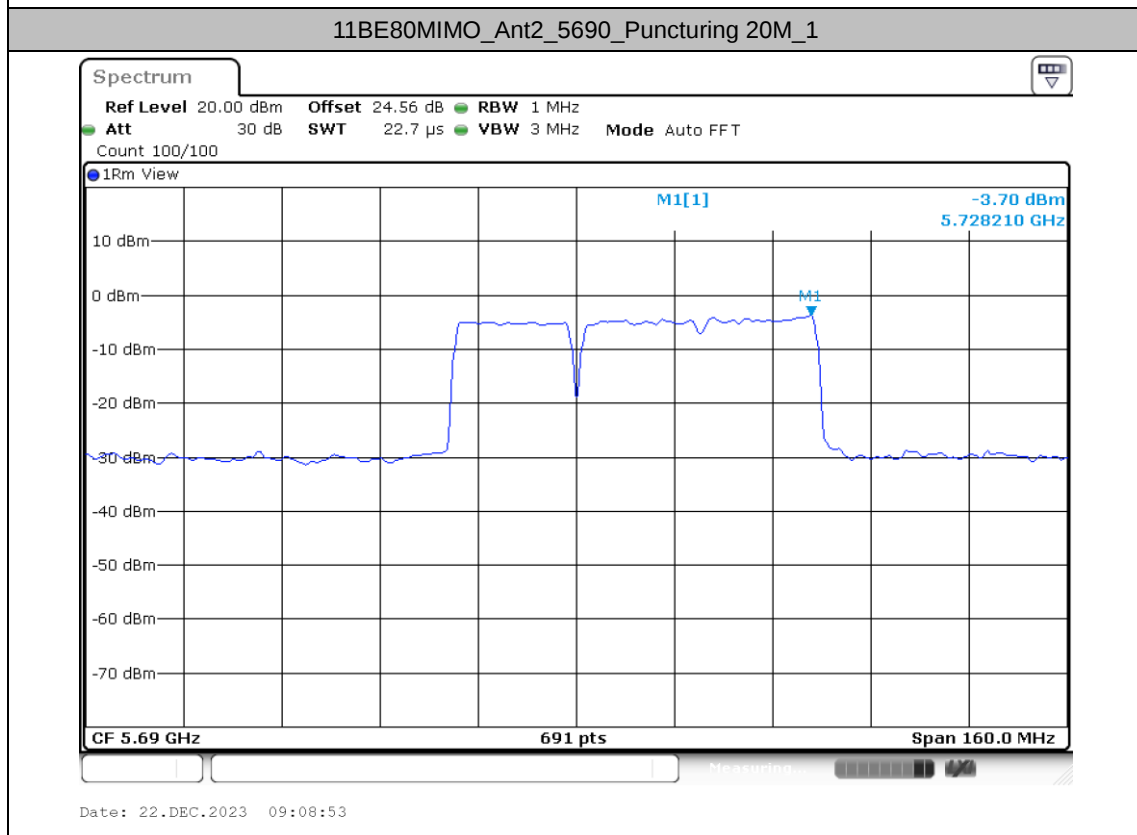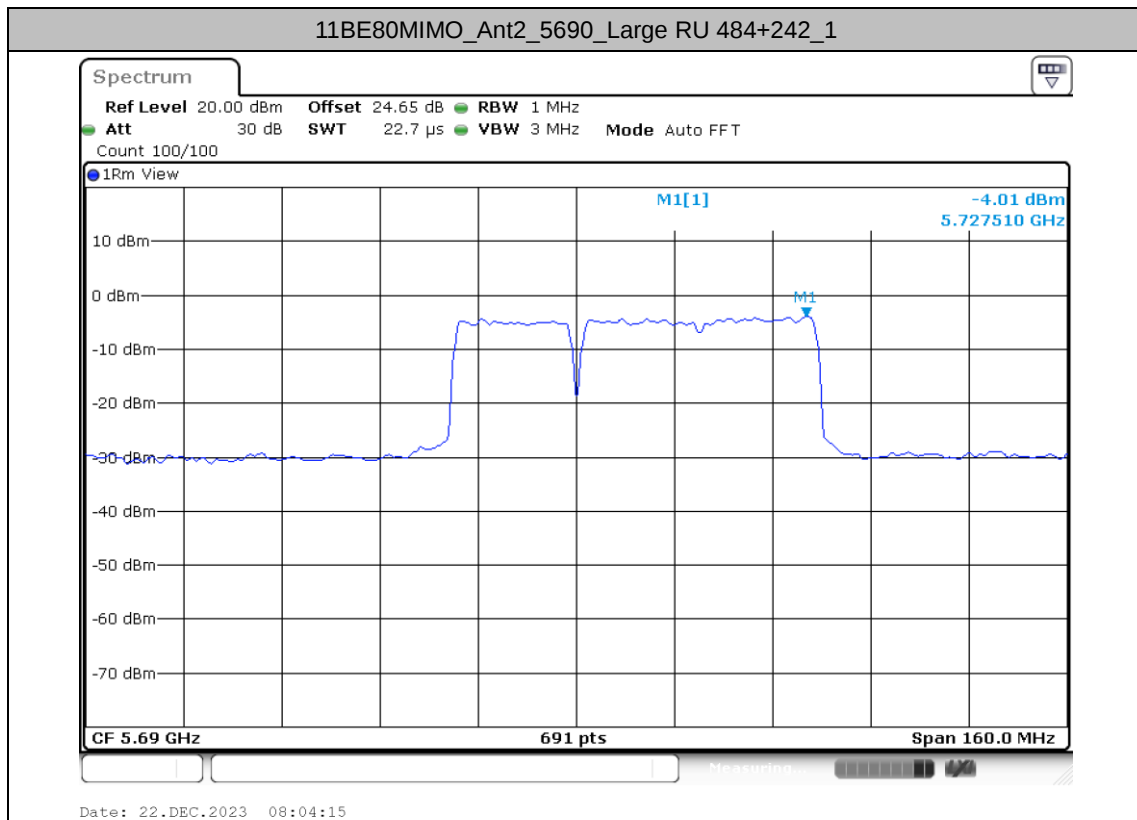








11BE80MIMO\_total\_5690\_Large RU 484+242\_1

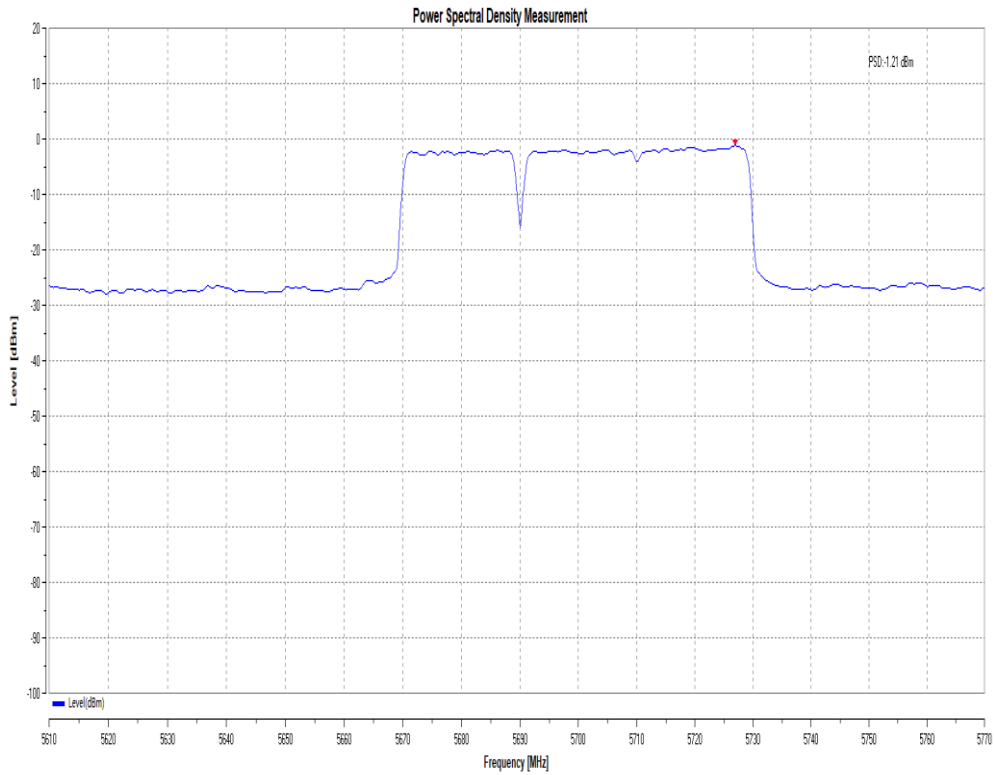




11BE80MIMO\_total\_5690\_Puncturing 20M\_1

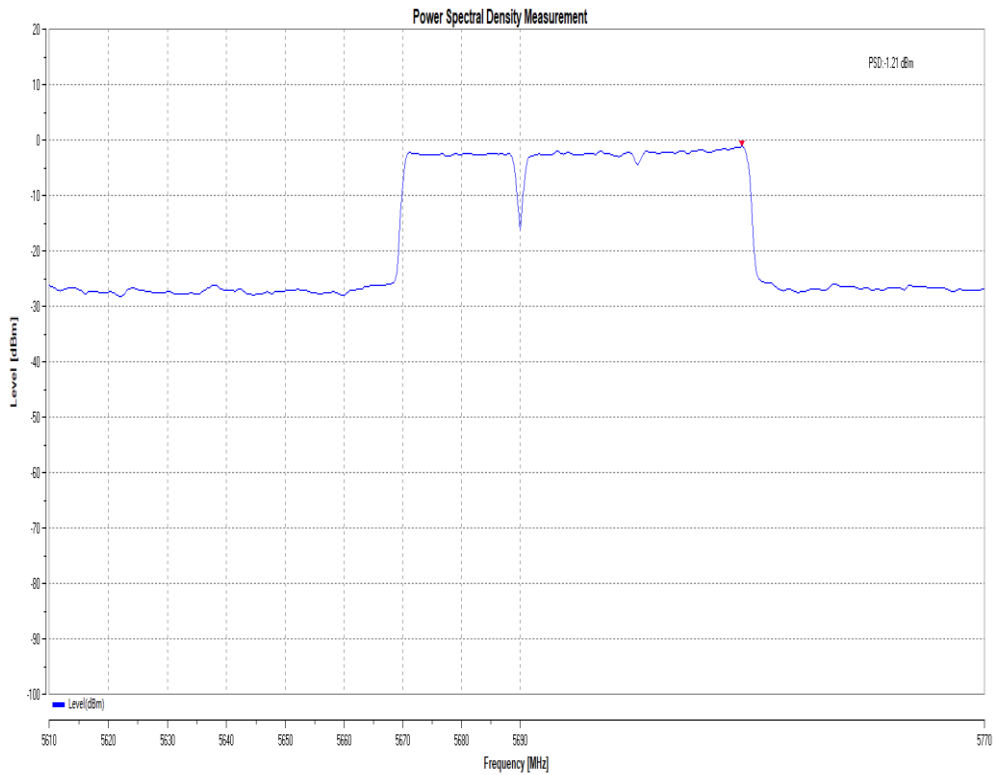


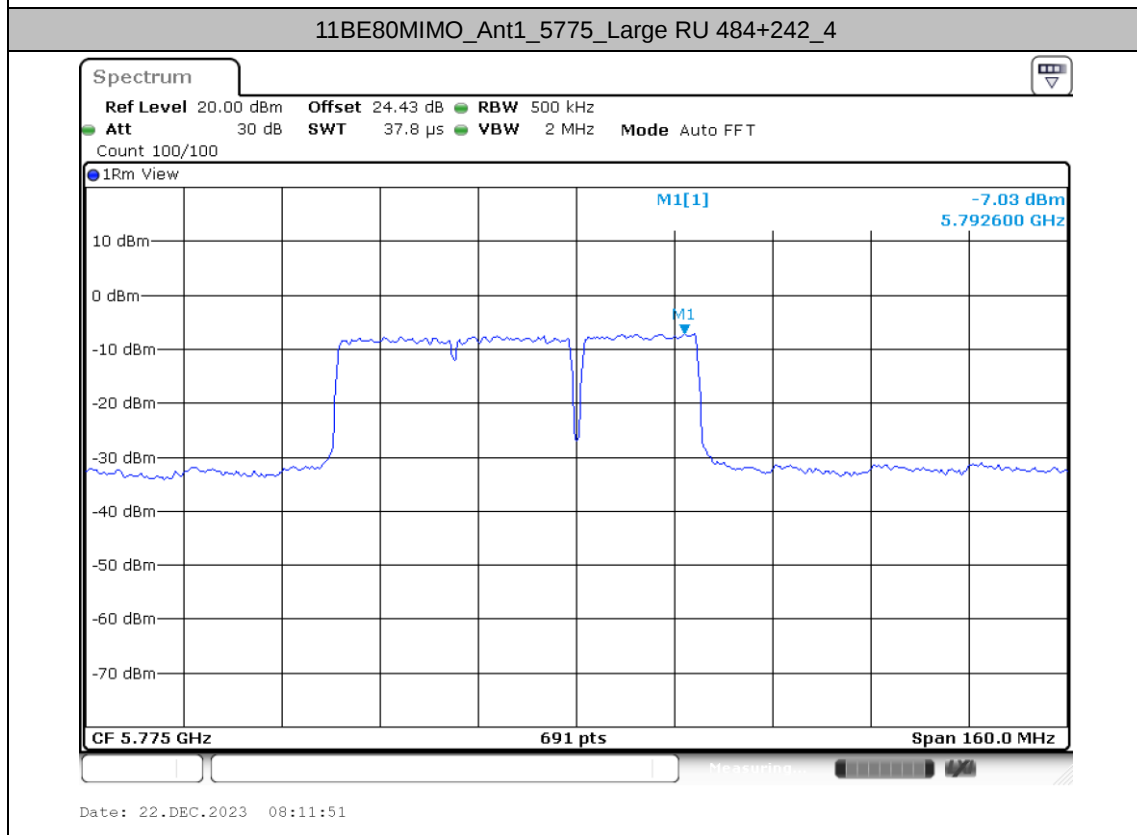
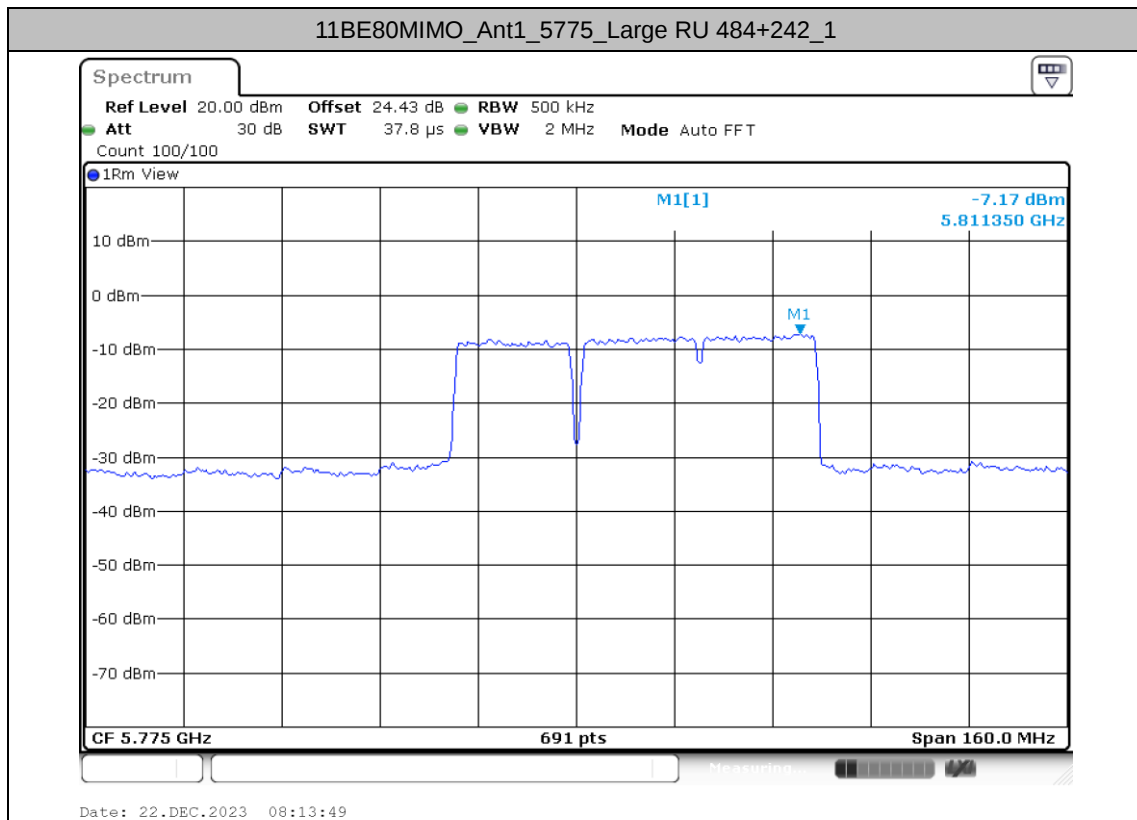


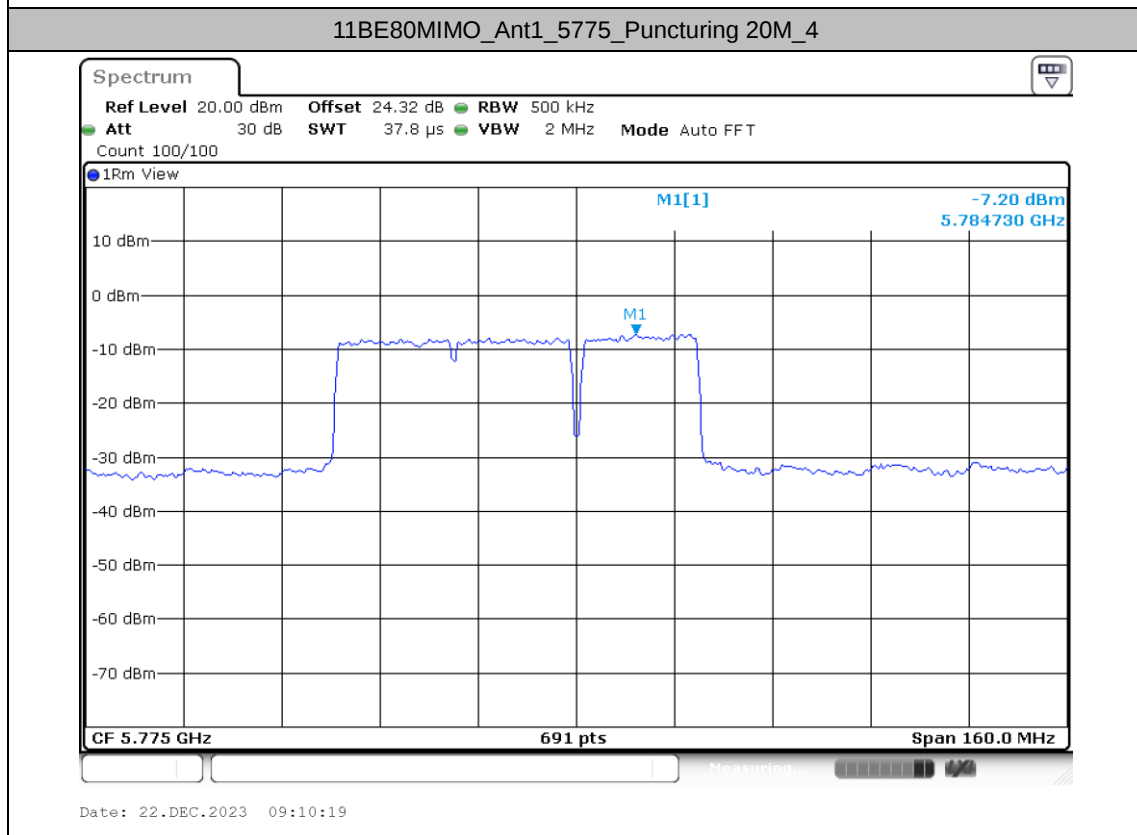
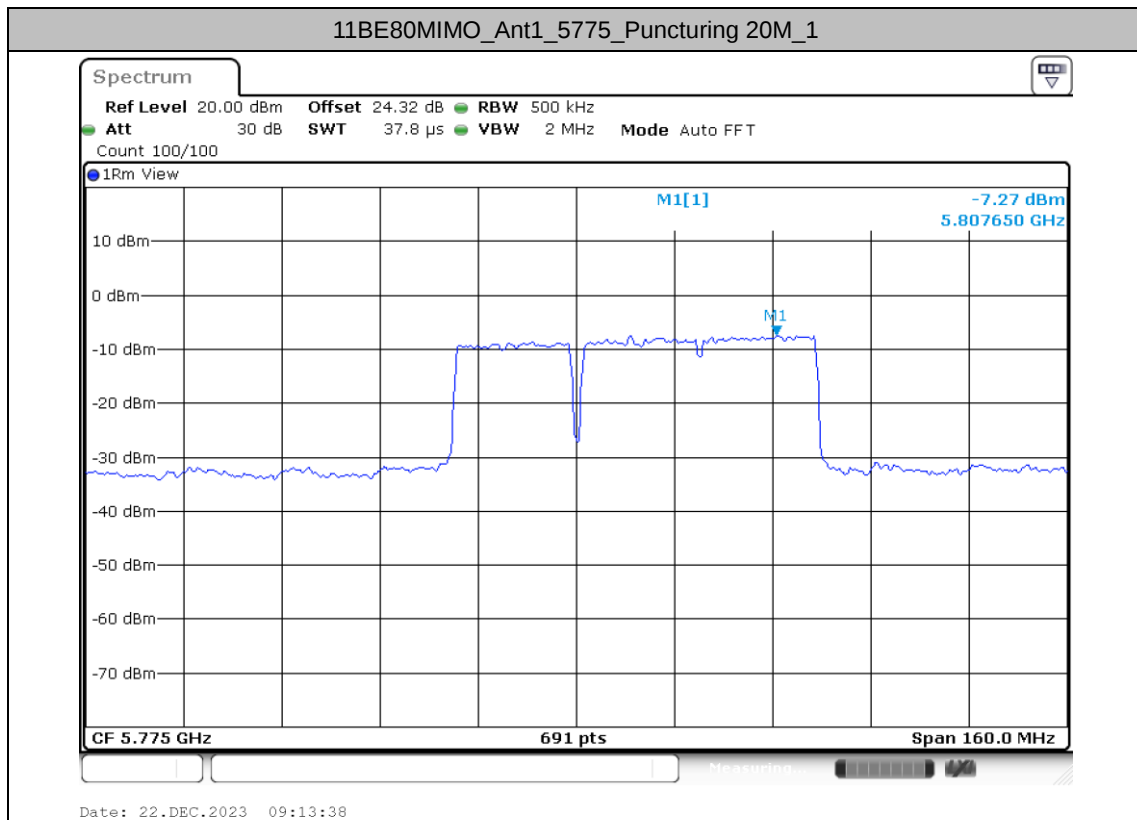


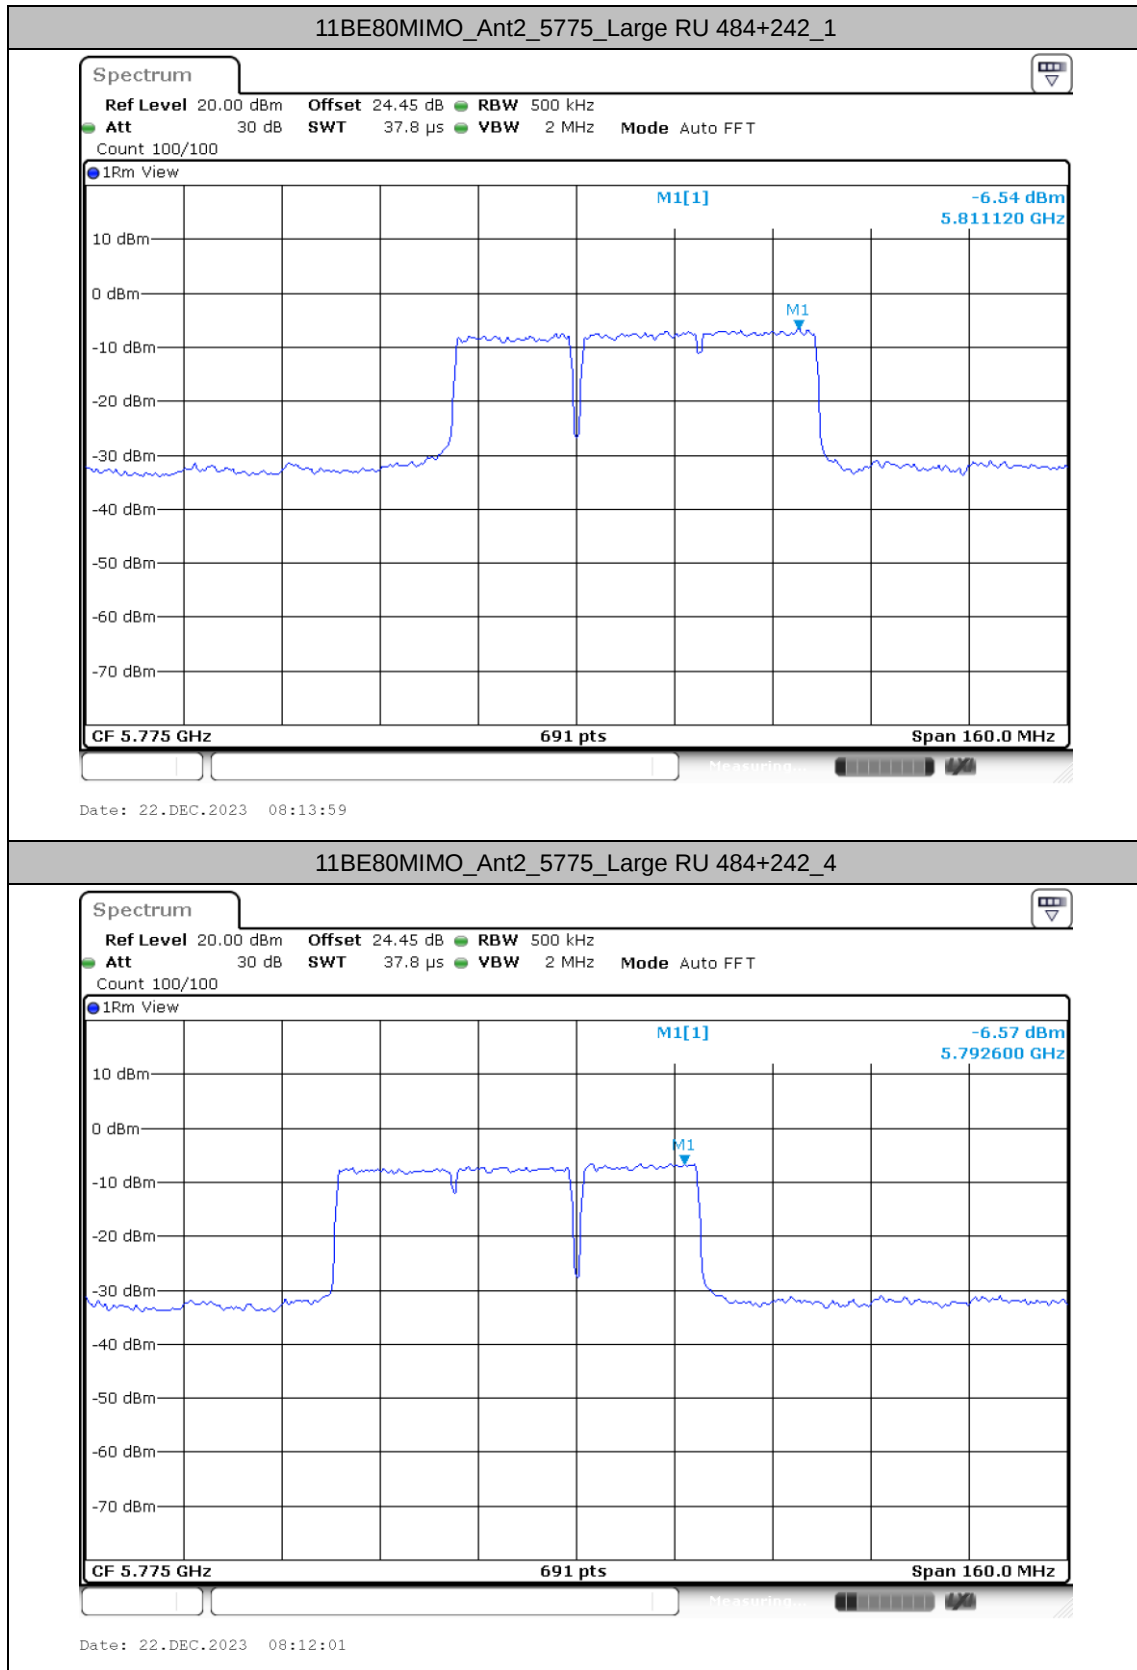


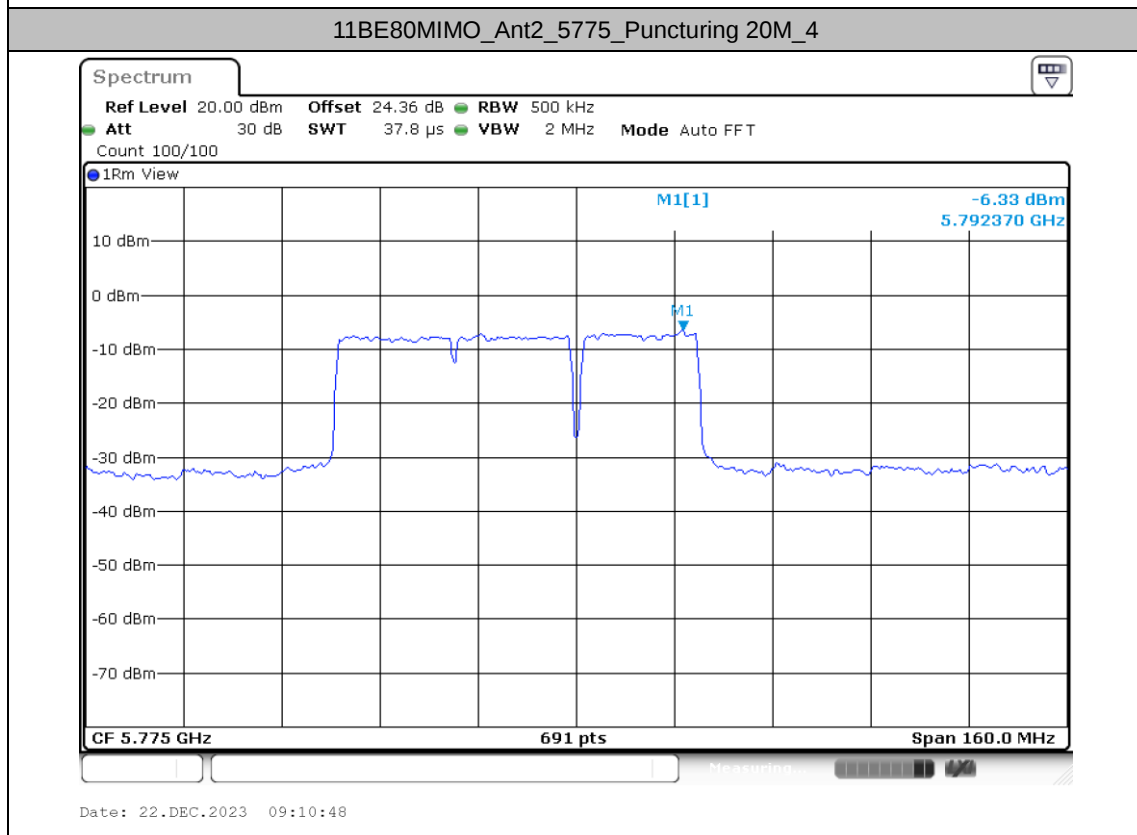
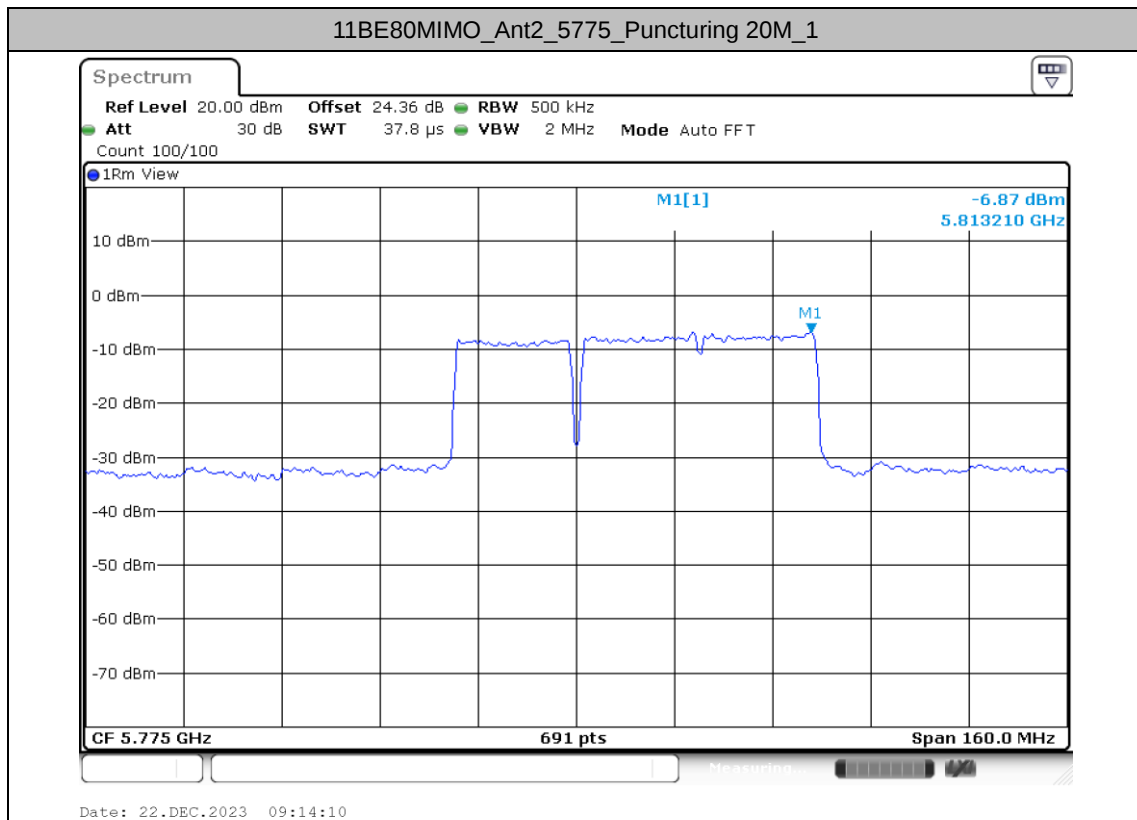



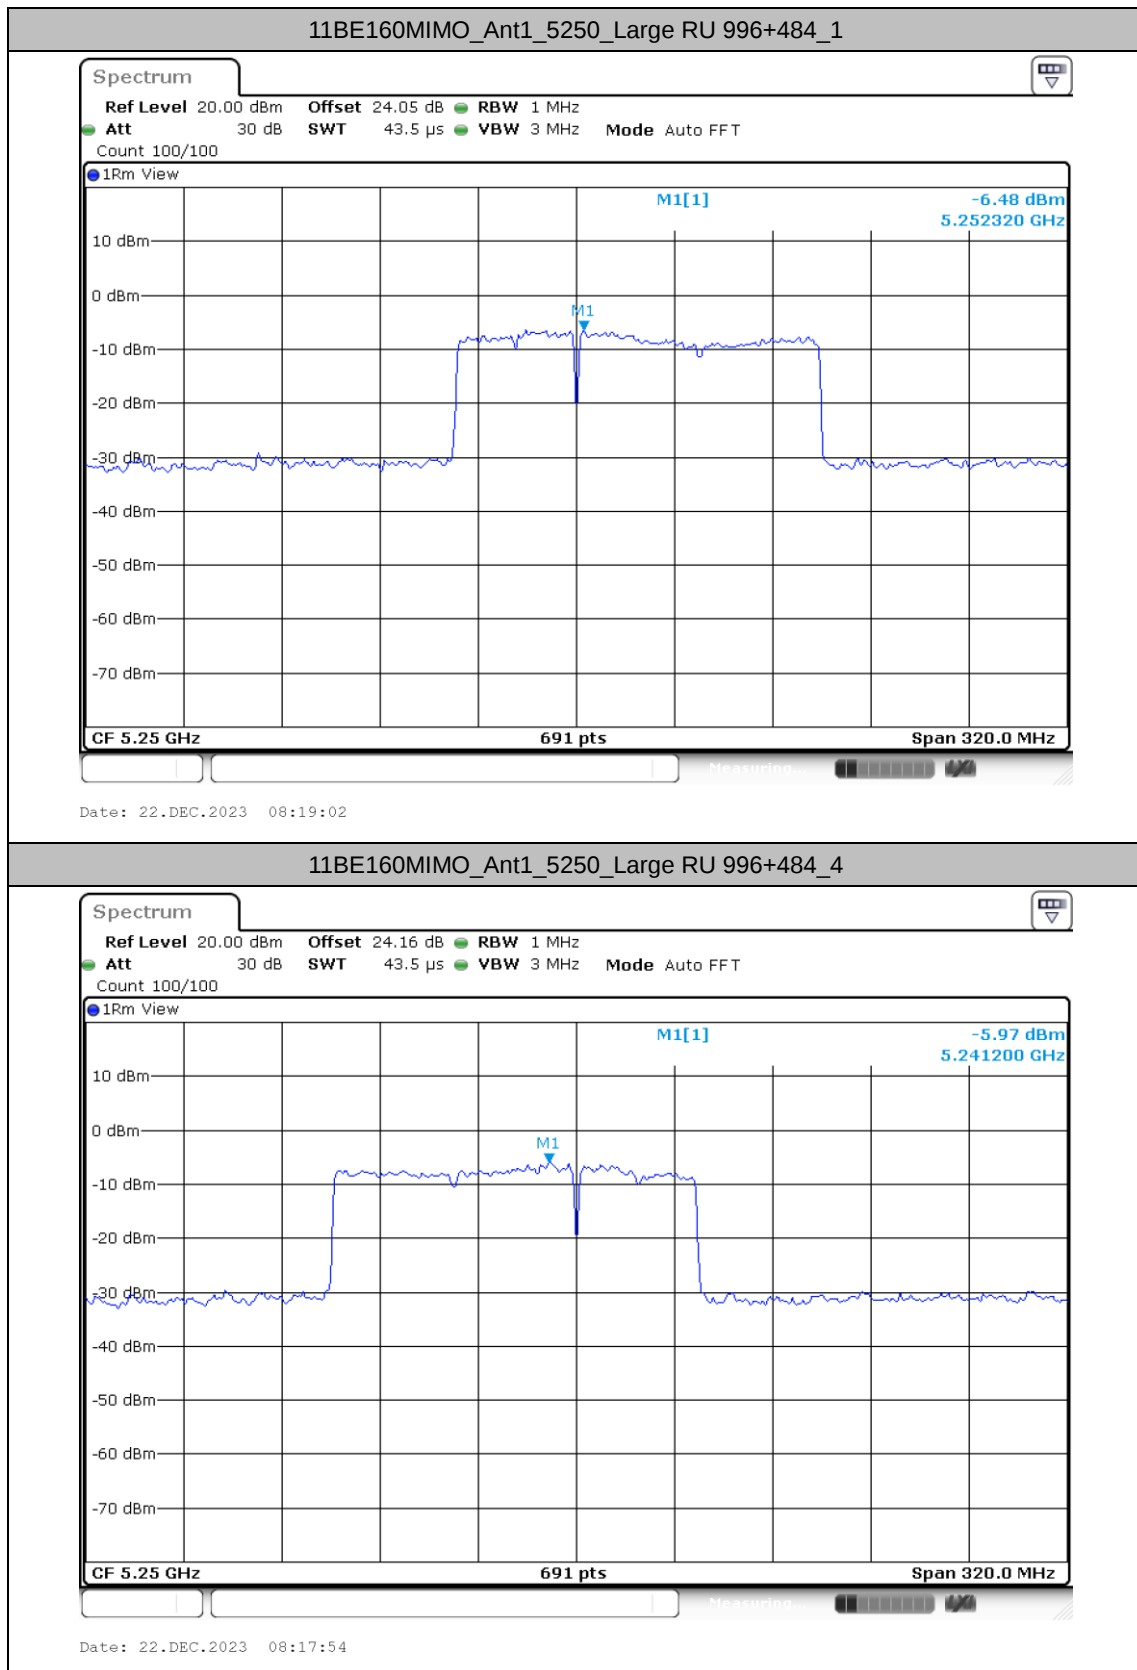


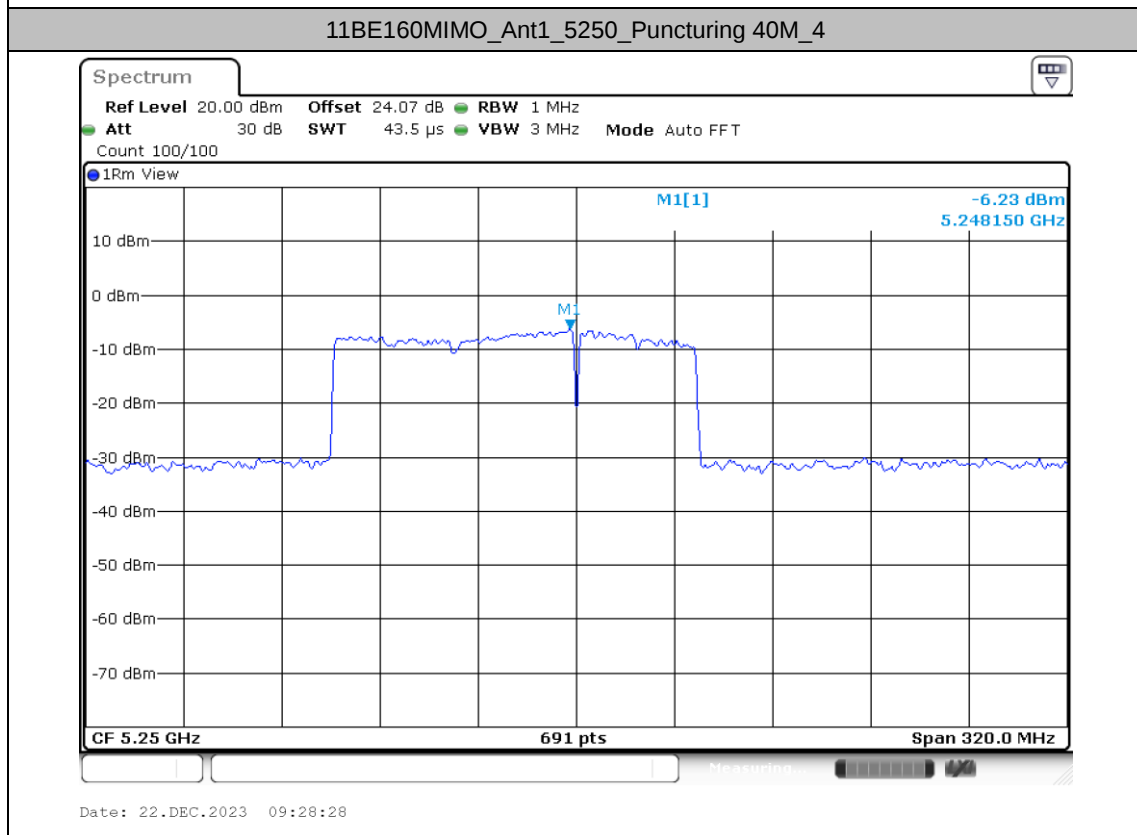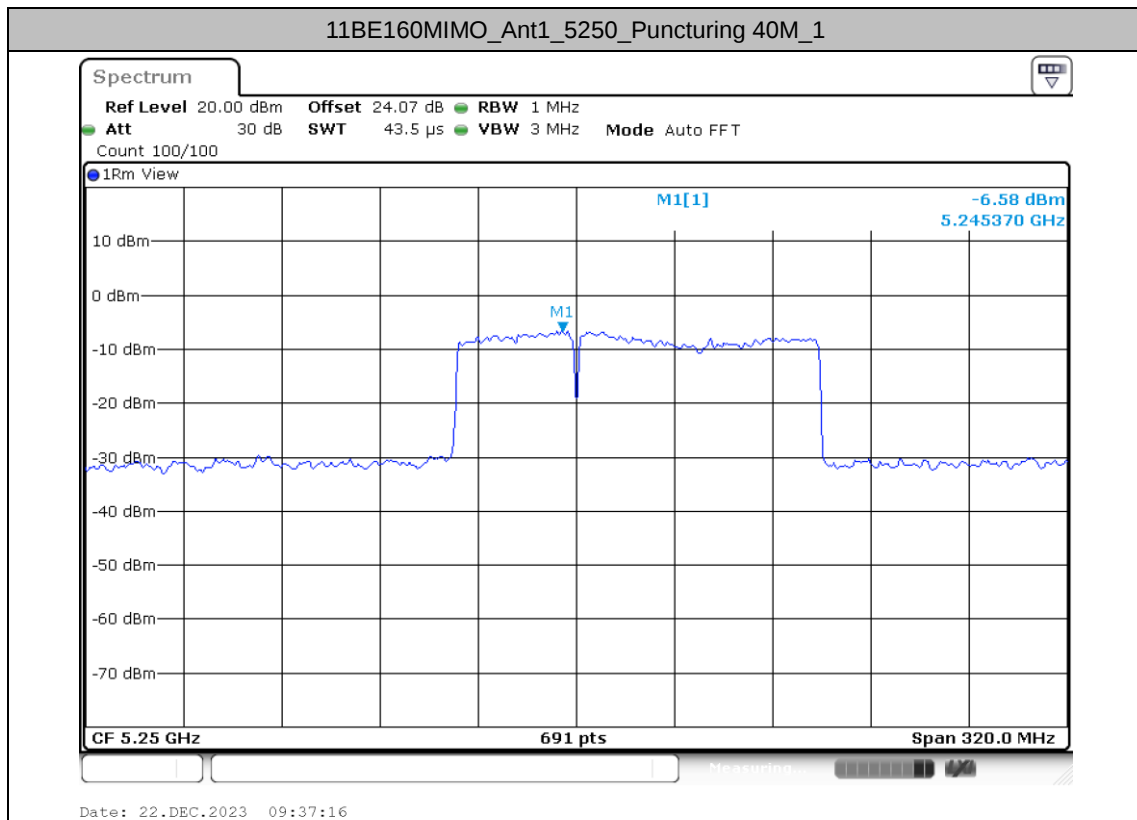

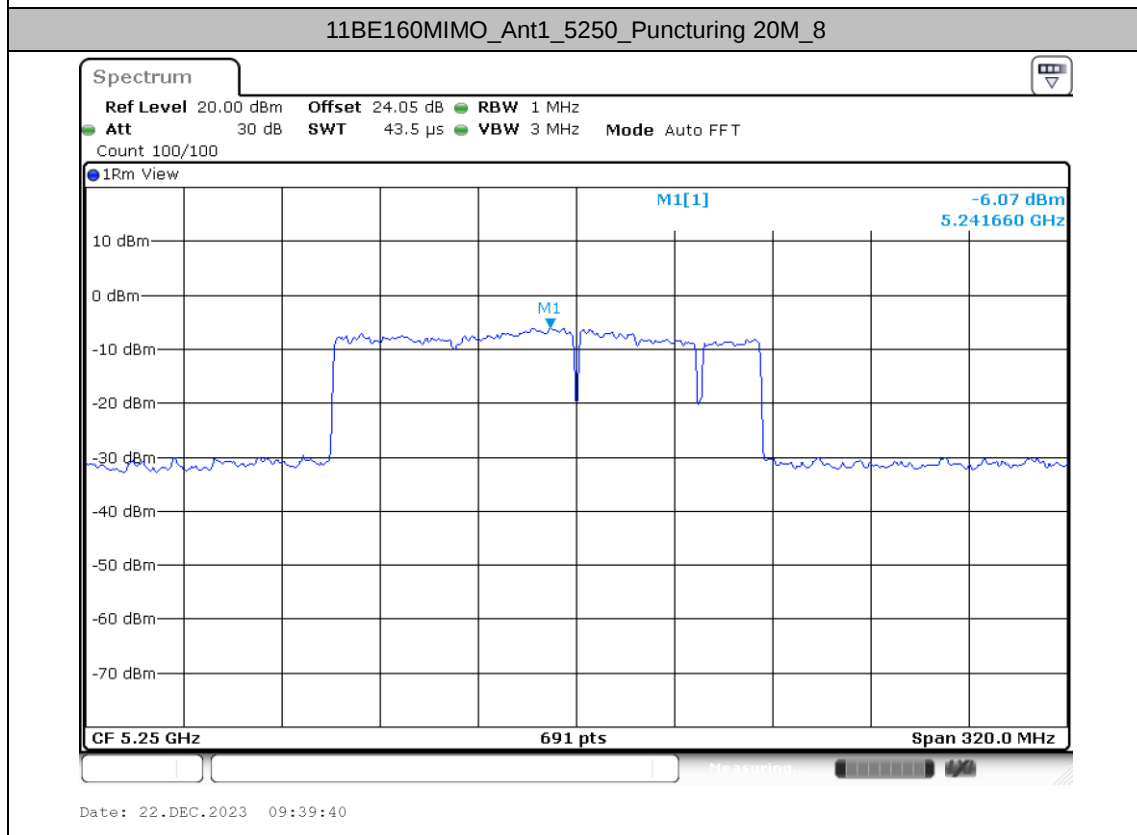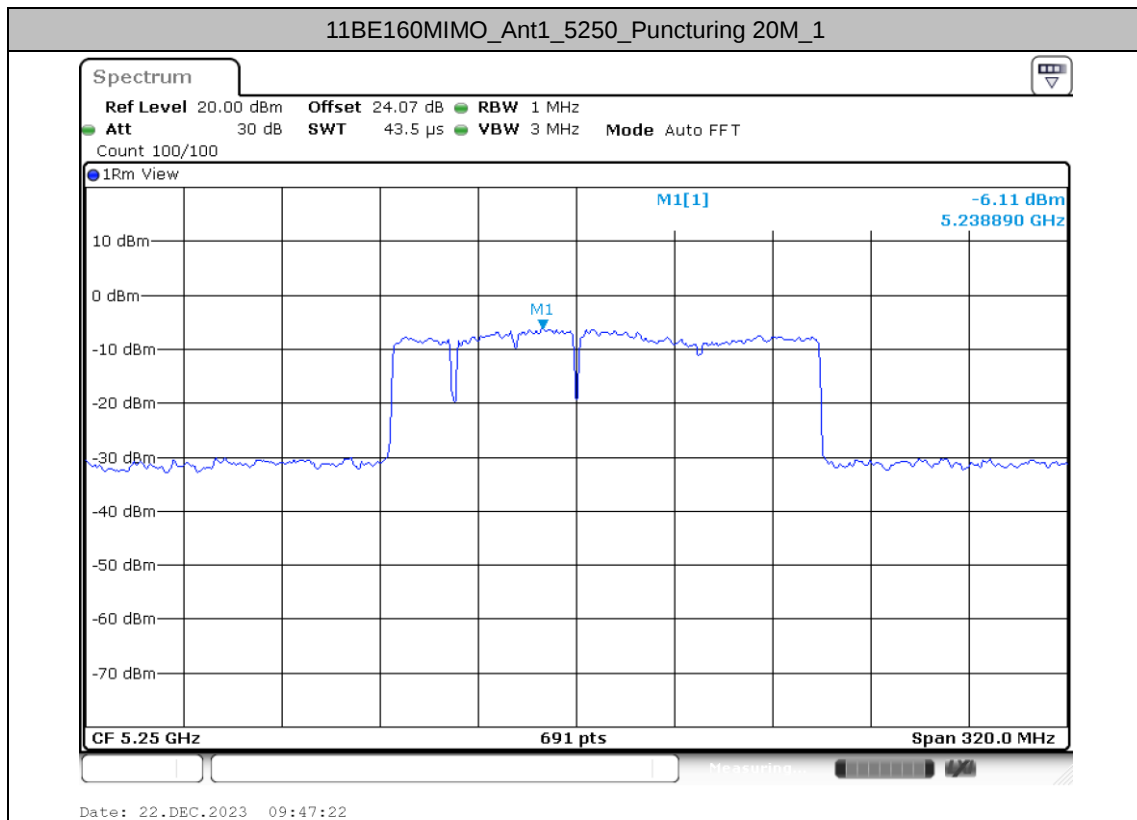

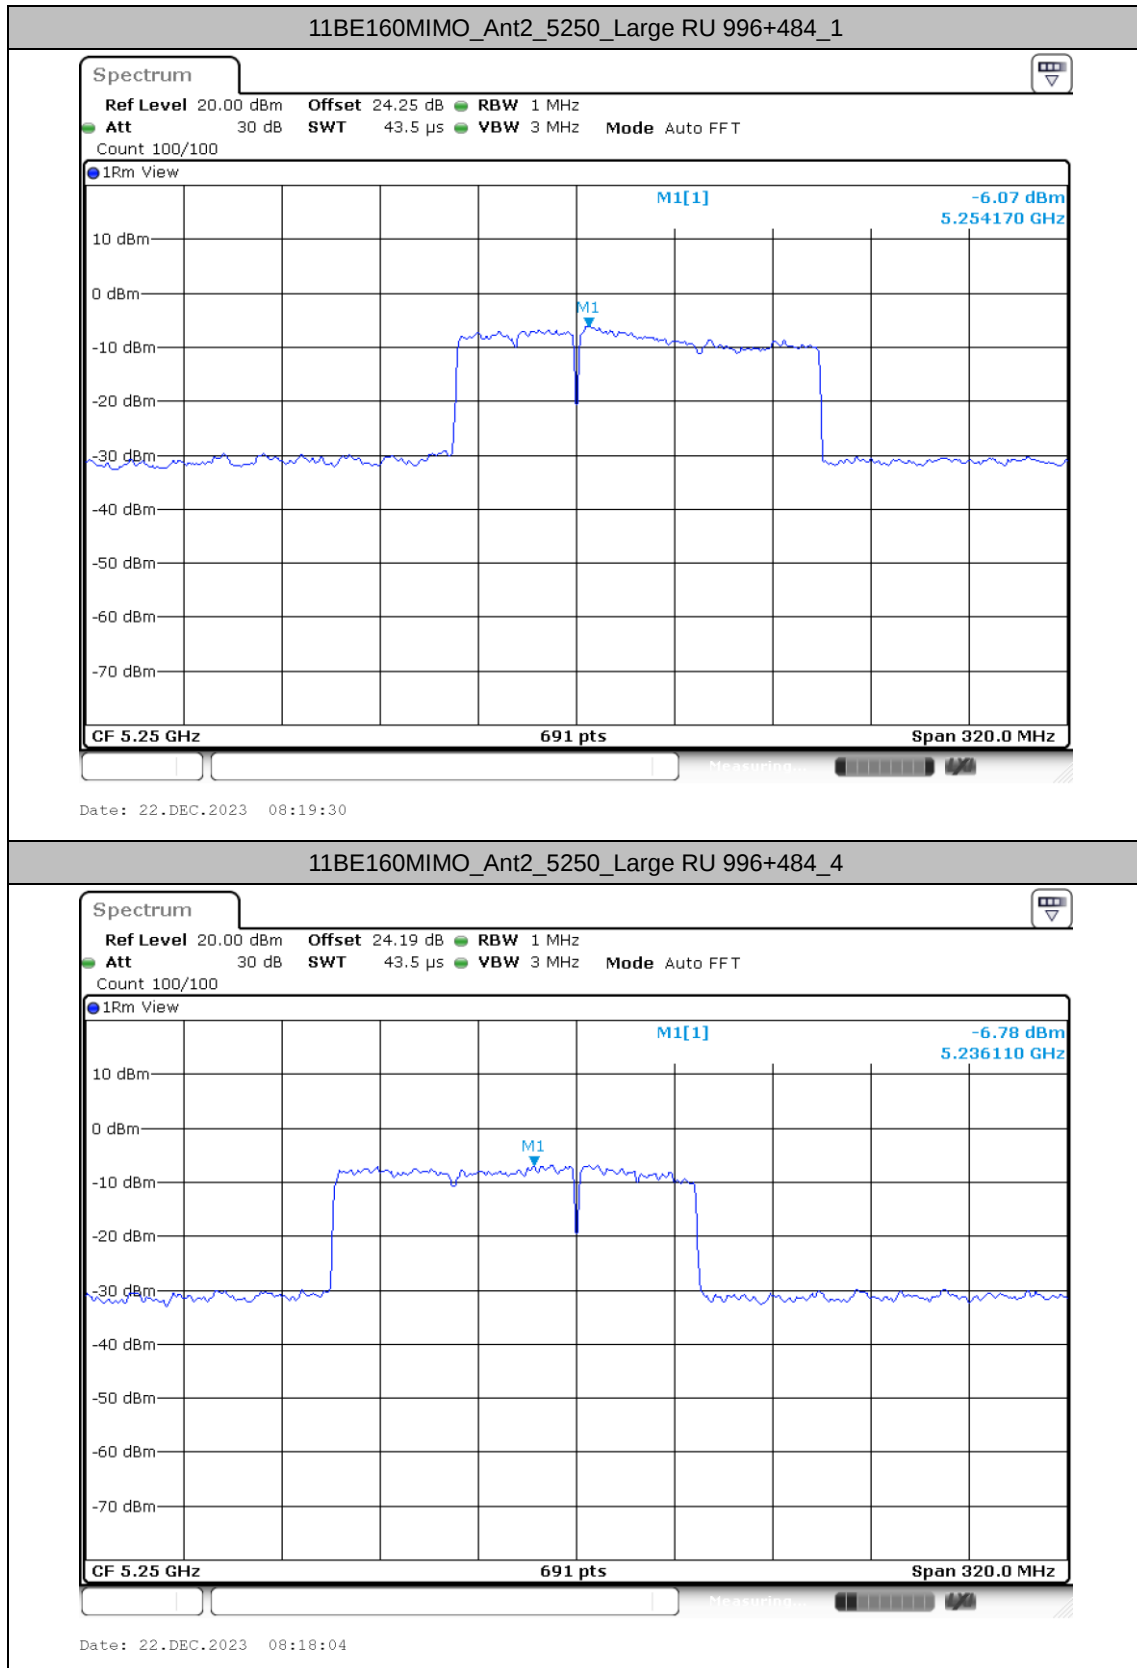


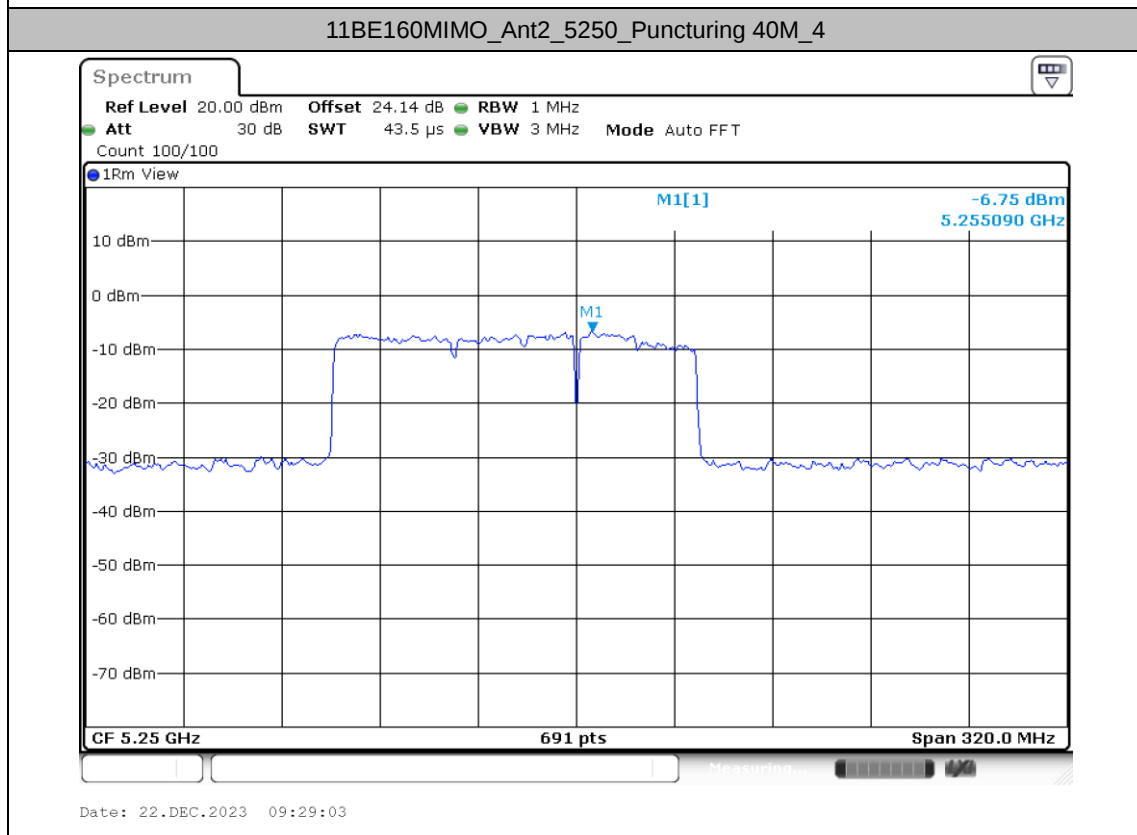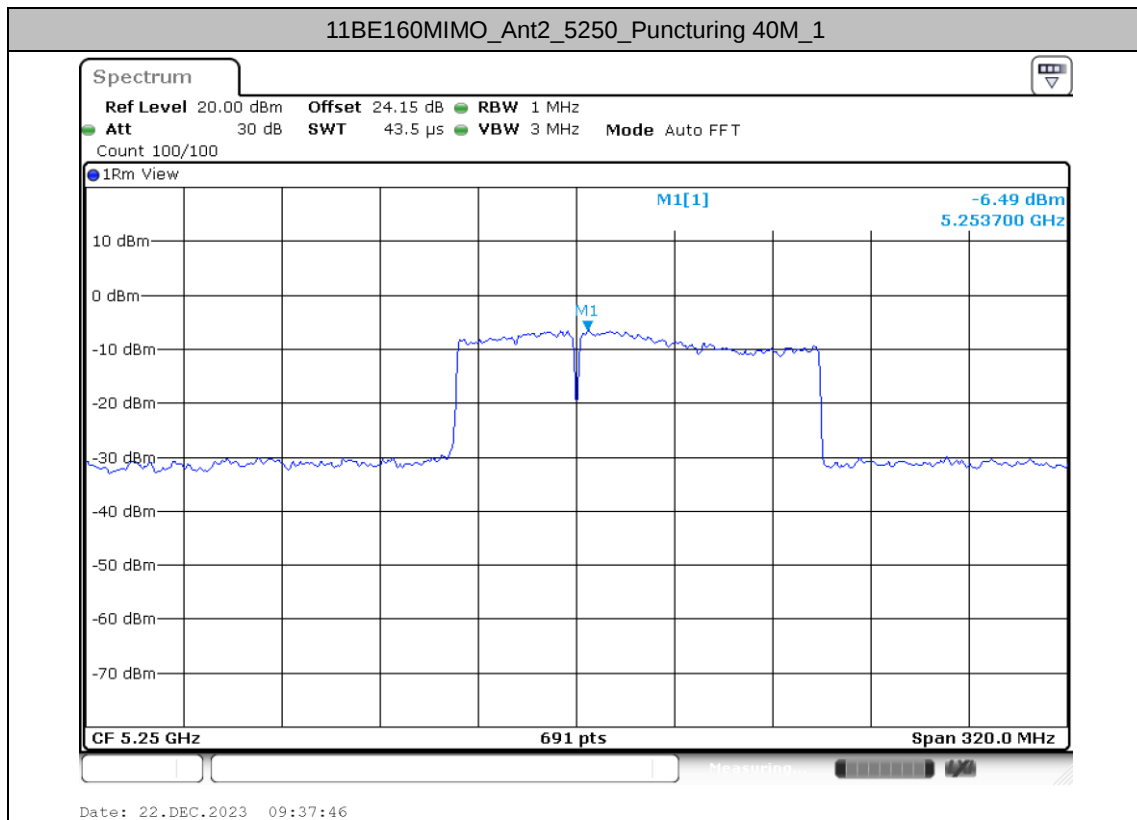

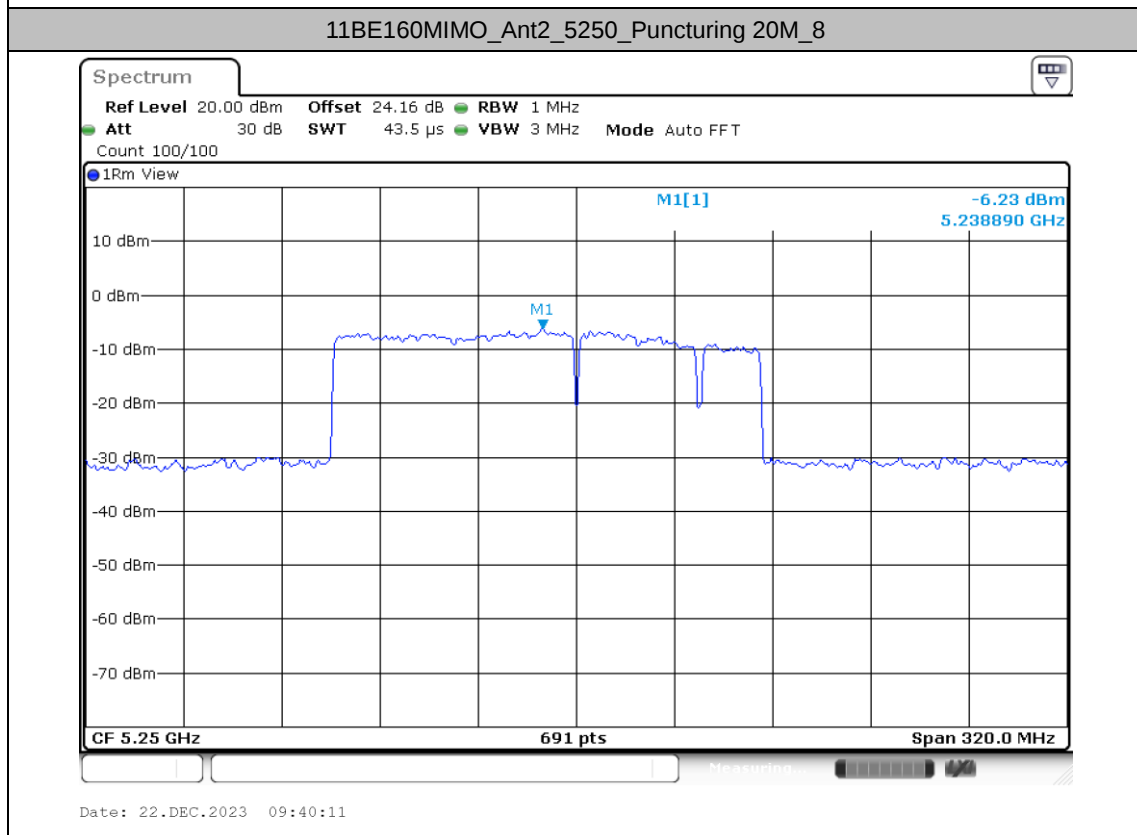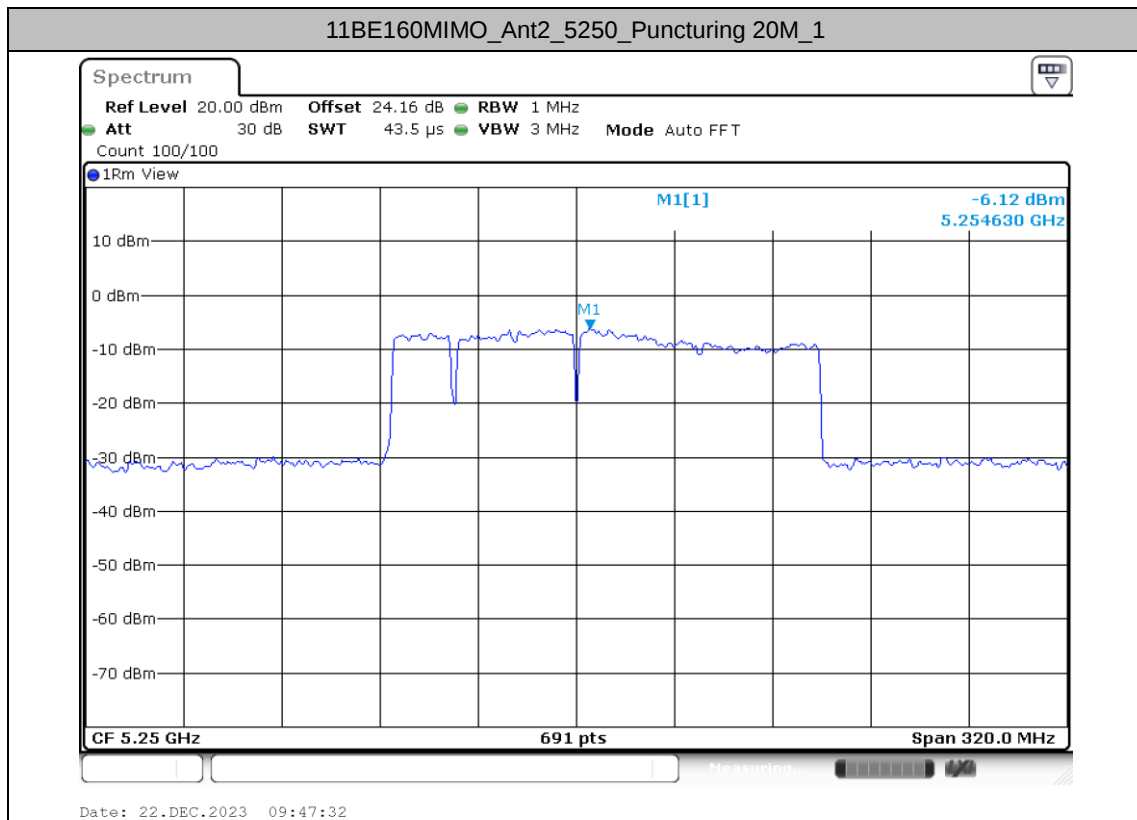




11BE160MIMO\_total\_5250\_Large RU 996+484\_1

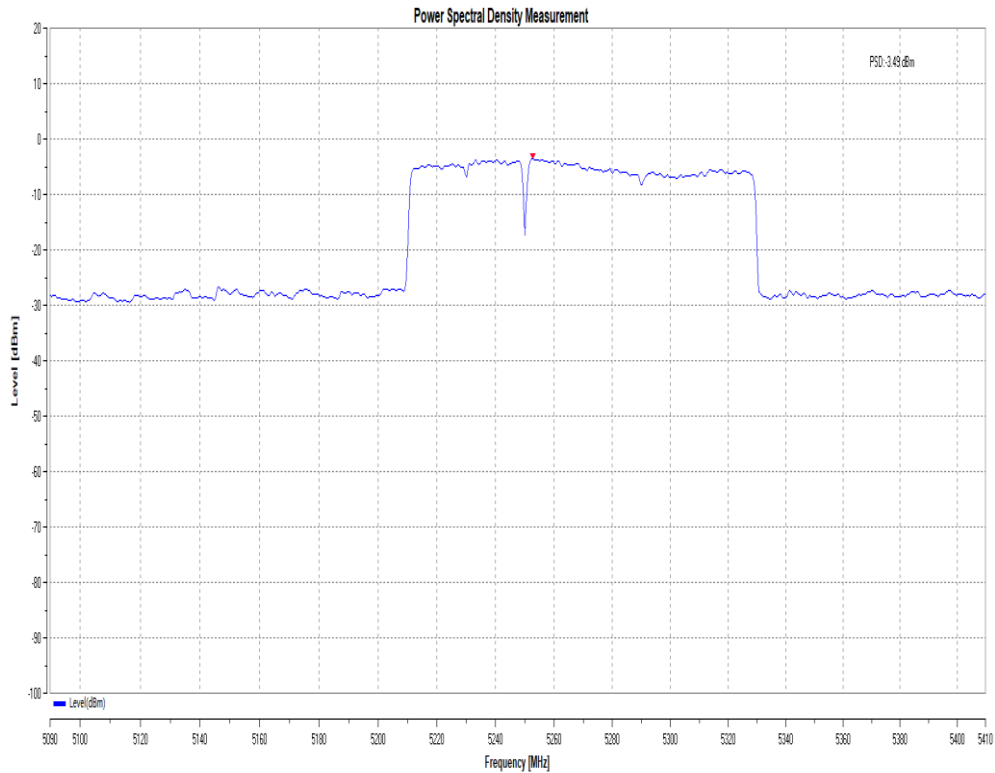


11BE160MIMO\_total\_5250\_Large RU 996+484\_4

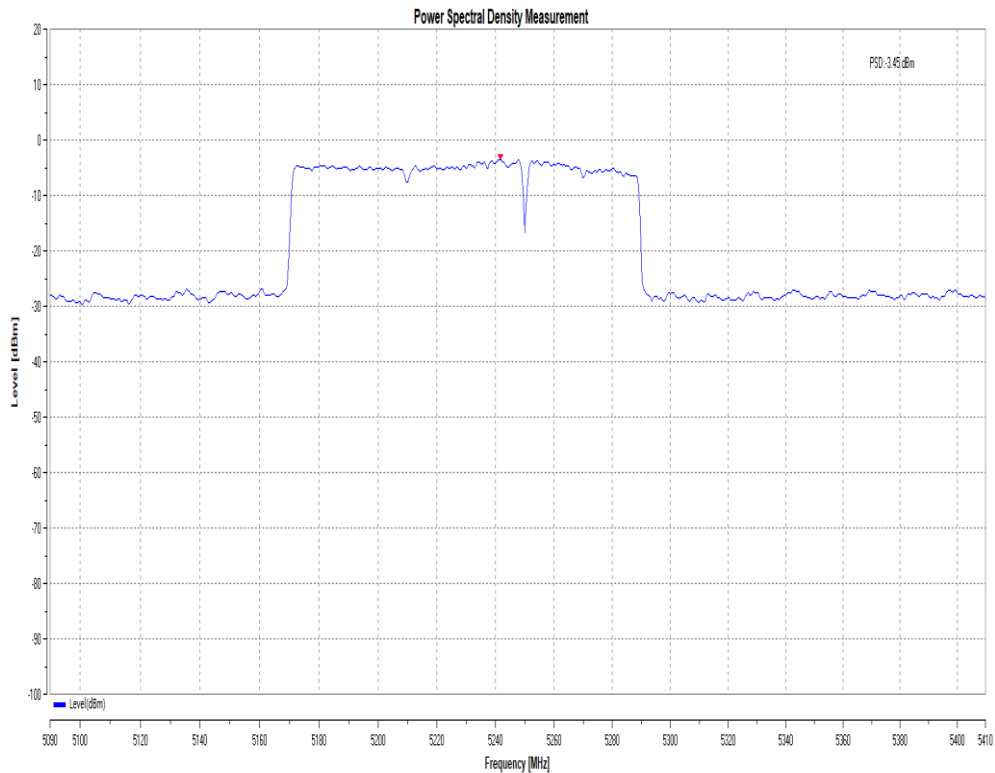




11BE160MIMO\_total\_5250\_Puncturing 40M\_1

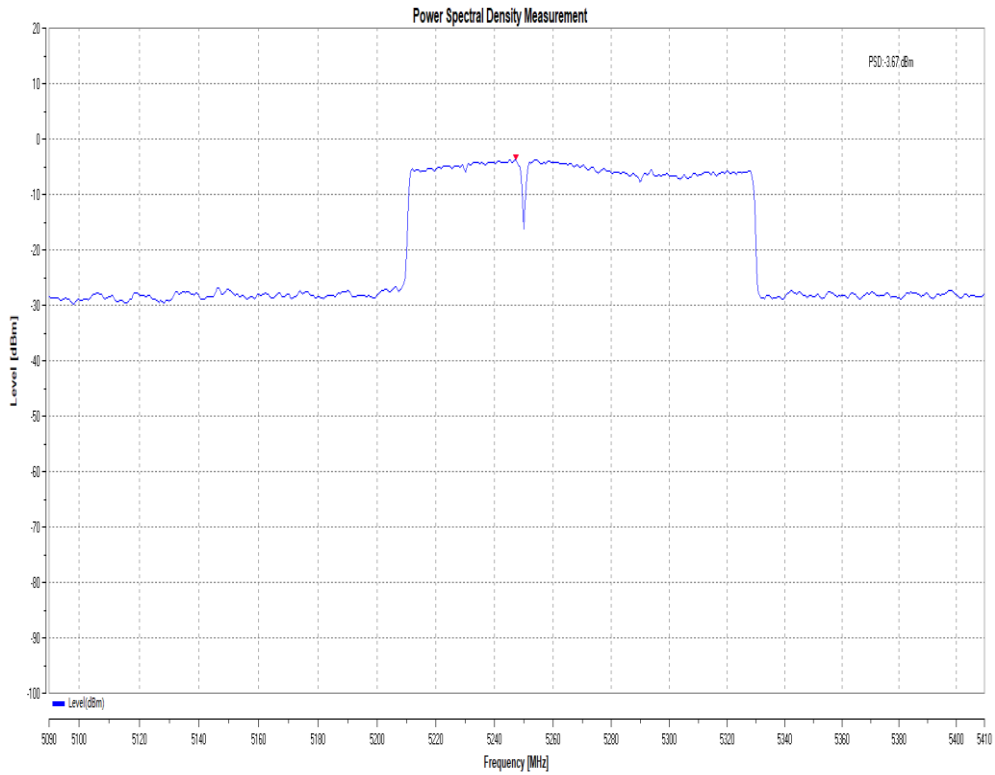


11BE160MIMO\_total\_5250\_Puncturing 40M\_4

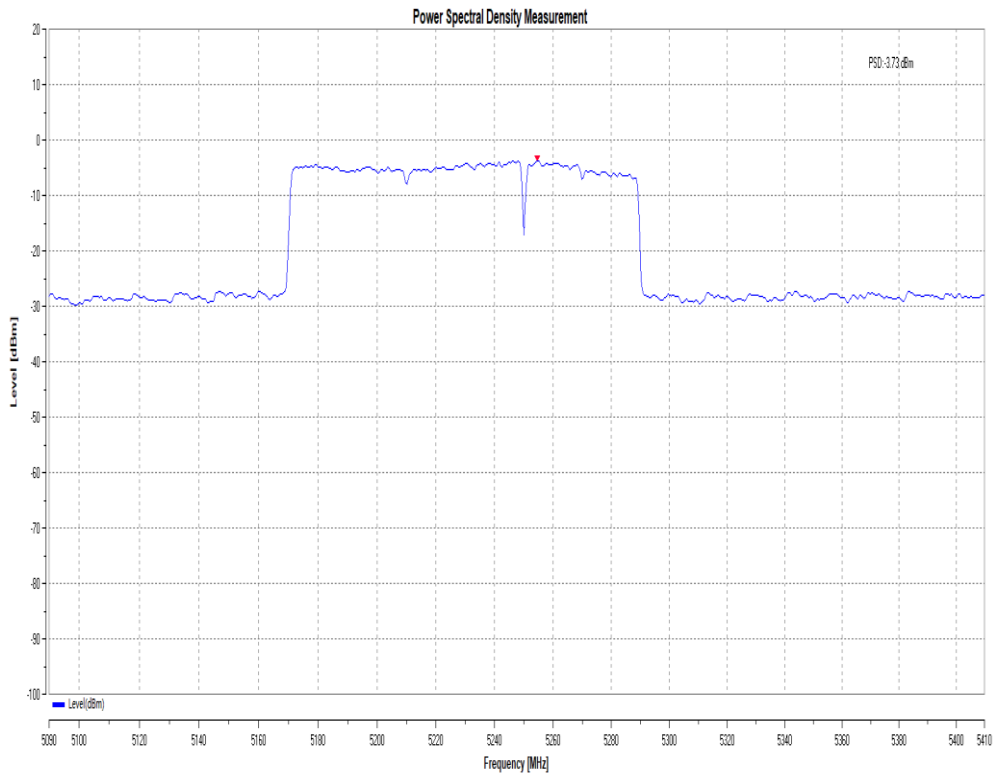



11BE160MIMO\_total\_5250\_Puncturing 20M\_1

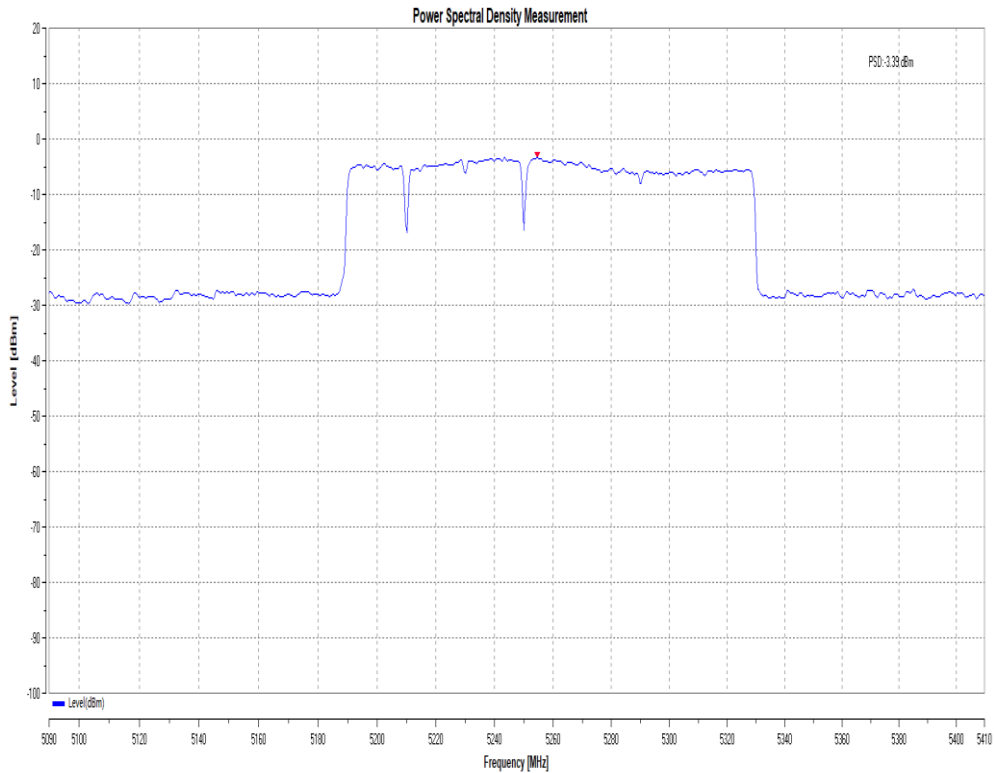

11BE160MIMO\_total\_5250\_Puncturing 20M\_8

